

**Phase One Environmental Site Assessment:
Proposed Development Hamilton Avenue,
Spencer Avenue, Parkdale Avenue, Armstrong Street,
Ottawa, Ontario**

Final Report

February 7, 2025

Prepared for:
Taggart Realty Management/ 1000147699 Ontario Inc.

Prepared by:
Stantec Consulting Ltd.

Project/File:
122170424.600



Limitations and Sign-off

The conclusions in the Report titled Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario are Stantec's professional opinion, as of the time of the Report, and concerning the scope described in the Report. The opinions in the document are based on conditions and information existing at the time the scope of work was conducted and do not take into account any subsequent changes. The Report relates solely to the specific project for which Stantec was retained and the stated purpose for which the Report was prepared. The Report is not to be used or relied on for any variation or extension of the project, or for any other project or purpose, and any unauthorized use or reliance is at the recipient's own risk.

Stantec has assumed all information received from Taggart Realty Management/ 1000147699 Ontario Inc. (the "Client") and third parties in the preparation of the Report to be correct. While Stantec has exercised a customary level of judgment or due diligence in the use of such information, Stantec assumes no responsibility for the consequences of any error or omission contained therein.

This Report is intended solely for use by the Client in accordance with Stantec's contract with the Client. While the Report may be provided to applicable authorities having jurisdiction and others for whom the Client is responsible, Stantec does not warrant the services to any third party. The report may not be relied upon by any other party without the express written consent of Stantec, which may be withheld at Stantec's discretion.

Gonsalves,
Romeet
Digitally signed
by Gonsalves,
Romeet
Date: 2025.02.07
14:38:19 -07'00'

Prepared by:

Signature

Romeet Gonsalves, B.Sc., G.I.T.
Environmental Scientist

Printed Name and Title


Digitally signed
by Peters-
Dechman, Jill
Date: 2025.02.07
17:14:33 -05'00'

Reviewed by:

Signature

Jill Peters-Dechman, P.Eng., QP_{ESA}
Principal, Environmental Services

Printed Name and Title



Executive Summary

Stantec Consulting Ltd. (Stantec) was retained by Taggart Reality Management/1000147699 Ontario Inc. (Taggart) to conduct a Phase One Environmental Site Assessment (ESA) of the properties bounded by Spencer Street, Hamilton Avenue North, Parkdale Avenue, and Armstrong Street (the Phase One Property) in Ottawa, Ontario. These properties are broadly referred to as the “Block”. The municipal addresses for the properties within the Block are 3 Hamilton Avenue North (which includes units 5, 7A, 7B, and 340 Parkdale Avenue); and 223, 229, and 233 Armstrong Street.

The Phase One ESA was completed to determine if Areas of Potential Environmental Concern (APECs) exist at the Phase One Property, which may be present as a result of current and/or past potentially contaminating activities (PCAs) on the Phase One Property or nearby properties within 250 m of the perimeter of the Phase One Property (Phase One Study Area). Stantec understands that the Phase One ESA is required to support the re-development of the Phase One Property from its current commercial land use to a mixed commercial and residential land use. Due to the proposed change of land use, Taggart is required to file a Record of Site Condition (RSC) under Ontario Regulation 153/04 (O.Reg.153/04).

A site survey is provided in **Appendix A**, while site plans showing the Phase One Study Area and Phase One Property are included in **Appendix B**.

Site Description and Current Operations

Based on the historical information gathered during the Phase One ESA, the Phase One Property and surrounding Study Area were generally vacant/undeveloped or of residential property use prior to 1920. From 1920 until present day, the Phase One Property and surrounding Study Area has been developed for mixed residential/commercial/light industrial uses. Based on aerial photography, the Phase One Property underwent its first major development sometime between 1928 and 1958, and the buildings appears to be of similar configuration as present day.

At the time of the site visit, the Site consisted of multiple multi-tenant buildings, a paved parking area, and an inaccessible grassy/treed courtyard area. Current operations included a pet salon, a home hardware storage space (hardwood and tile storage), a storage service, several small coffee shops, and upholsterer, a bicycle shop, a tattoo parlor, a workout space, and a pub.

Previous Investigations

A number of previous environmental and geotechnical reports were provided to Stantec for review including a Phase I ESA, a Phase II ESA, geotechnical investigations, and Remedial Action Plans (RAPs) completed by a number of consultants between 2005 to 2021.



The most recent Phase I ESA completed by Paterson Group Inc. (Paterson) in October 2011 identified six PCAs contributing to two on-site APECs and 13 PCAs located at 11 off-site properties within the 250 m of the Block that were not determined to result in APECs.

Paterson completed a Phase II ESA simultaneously with the Phase I ESA. The Phase II ESA completed by Paterson identified chlorinated solvent impacts in the groundwater at the Block ranging from marginal exceedances to concentrations approximately 700 times the applicable standard. The chlorinated solvents and other observed impacts included: tetrachloroethylene (PCE), trichloroethylene (TCE), vinyl chloride, benzene, 1,2-dichloroethane, and 1,1-dichloroethylene (DCE). Paterson also developed a RAP in conjunction with the Phase I and Phase II ESAs to be implemented prior to the re-development of any portion of an Area of Environmental Concern (AEC). The RAP recommended a full-depth remediation approach, including pumping and treatment of impacted groundwater to be undertaken concurrently with site redevelopment.

Conclusions and Recommendations

The Phase One ESA has revealed 17 APECs at the Site.

APEC	Location of APEC on Phase One Property	PCA	Location of PCA (on-site or off-site)	Contaminants of Potential Concern ¹	Media Potentially Impacted (Ground water, soil and/or sediment)
1a	Southern portion of Phase One Property	<i>PCA No. 6</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg. 153/04 PCA 28) and a fuel related spill	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
1b	Southwest portion of Phase One Property	<i>PCA No. 8</i> Commercial Autobody Shop (O.Reg. 153/04 PCA 10) and waste generation of various types including fuel related waste	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
1c	Southeast portion of Phase One Property	<i>PCA No. 11</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg. 153/04 PCA 28)	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater



**Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue,
Parkdale Avenue, Armstrong Street, Ottawa, Ontario**
Executive Summary
February 7, 2025

APEC	Location of APEC on Phase One Property	PCA	Location of PCA (on-site or off-site)	Contaminants of Potential Concern¹	Media Potentially Impacted (Ground water, soil and/or sediment)
1d	South portion of Phase One Property	<i>PCA No. 12</i> Mill, lumber yard, and dry kiln (O.Reg. 153/04 PCA Undefined)	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
1e	Southeast portion of Phase One Property	<i>PCA No. 13</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg.153/04 PCA 28) Fuel related spill	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
2	Northern portion of Phase One Property	<i>PCA No. 9</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg. 153/04 PCA 28) and a fuel related spill	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
3a	Southwestern portion of Phase One Property	<i>PCA No. 1</i> Potential PCE use during leather preparation for shoe fabrication (O.Reg.153/04 PCA Undefined)	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
3b	West portion of Phase One Property	<i>PCA No. 14</i> Metal Fabrication (O.Reg 153/04 PCA 34)	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
3c	West portion of Phase One Property	<i>PCA No. 15</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg. 153/04 PCA 28)	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater



**Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue,
Parkdale Avenue, Armstrong Street, Ottawa, Ontario**

Executive Summary

February 7, 2025

APEC	Location of APEC on Phase One Property	PCA	Location of PCA (on-site or off-site)	Contaminants of Potential Concern¹	Media Potentially Impacted (Ground water, soil and/or sediment)
4a	Northwest portion of Phase One Property	<i>PCA No. 3</i> Vehicles and Associated Parts Manufacturing (O.Reg. 153/04 PCA 57) and waste generation of various types including fuel related waste and chlorinated solvents	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil Ground water
4b	Northwest portion of Phase One Property	<i>PCA No. 7</i> Metal Fabrication (O.Reg. 153/04 PCA 34)	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil Ground water
5a	Southeastern portion of Phase One Property	<i>PCA No. 10</i> Fuel related spill	Off-Site	• BTEX • PHCs • Metals • PAHs • VOCs	Soil Ground water
5b	Southeastern portion of One Property	<i>PCA No. 16</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg. 153/04 PCA 28)	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil Ground water
6a	Entire Phase One Property	<i>PCA No. 2</i> 2: Confirmed PCE, TCE, DCE, vinyl chloride and hydrocarbon impacts	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil Ground water



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
Executive Summary
February 7, 2025

APEC	Location of APEC on Phase One Property	PCA	Location of PCA (on-site or off-site)	Contaminants of Potential Concern ¹	Media Potentially Impacted (Ground water, soil and/or sediment)
6b	Entire Phase One Property	<i>PCA No. 4</i> 4: Importation of Fill Material of Unknown Quality (O.Reg. 153/04 PCA 30)	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil
7	Northeast portion of the Site	<i>PCA No. 5</i> Poorly managed waste in basement directly overlying eroded building foundation (O.Reg.153/04 PCA Undefined)	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil Ground water
8	Central and south-central (exterior) portions of Phase One Property. Off-site sidewalks and roadways	<i>PCA No. 17</i> Historical application of de-icing compounds (O.Reg.153/04 PCA Undefined)	On-Site Off-Site	• EC, SAR • Sodium, chloride	Soil Ground water

¹ Contaminants include petroleum hydrocarbons (PHCs), volatile organic compounds (VOCs), benzene, toluene, ethylbenzene, and xylenes (BTEX), polycyclic aromatic hydrocarbons (PAHs), electrical conductivity (EC), Sodium Adsorption Ratio (SAR), metals.

The table below briefly summarizes the APECs and associated PCAs at the Site. Based on the findings of the Phase One ESA, it is our opinion that there are areas of potential environmental concern with respect to soil and groundwater quality. A Phase Two ESA would be required to assess those issues before a Record of Site Condition could be submitted for the Phase One ESA Property.

The statements made in this Executive Summary are subject to the same limitations included in the Closure (**Section 7.4**) and are to be read in conjunction with the remainder of this report



Table of Contents

1	Introduction	1
1.1	Phase One Property Information	1
1.2	Contact Information.....	2
2	Scope of Investigation.....	3
2.1	Phase One ESA Scope of Work	3
2.2	Regulatory Framework.....	4
3	Records Review	5
3.1	General.....	5
3.1.1	Phase One Study Area Determination	5
3.1.2	First Developed Use Determination.....	5
3.1.3	Fire Insurance Plans	6
3.1.4	Chain of Title	7
3.1.5	Environmental Reports	8
3.2	Environmental source information	14
3.2.1	City Directories.....	14
3.2.2	Property Underwriters' Reports and Plans	14
3.2.3	National Pollutant Release Inventory (NPRI).....	14
3.2.4	PCB Storage Sites and Inventory Databases.....	14
3.2.5	Certificate of Approval / Environmental Compliance Approval	14
3.2.6	MECP Freedom of Information Requests.....	15
3.2.7	Coal Gasification Plant Waste Sites	15
3.2.8	Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars	16
3.2.9	Hazardous Waste Generators and Receivers	16
3.2.10	Technical Standards and Safety Authority (TSSA)	17
3.2.11	Environmental Registry.....	17
3.2.12	Records of Site Condition (RSC).....	17
3.2.13	Areas of Natural Significance (ANSI).....	18
3.2.14	Waste Disposal Sites	18
3.2.15	ERIS Report.....	19
3.2.16	Other information sources.....	22
3.3	Physical Setting Sources	22
3.3.1	Aerial Photographs	22
3.3.2	Topography, Hydrology and Geology.....	24
3.3.3	Fill Materials.....	26
3.3.4	Water Bodies and Areas of Natural Significance	26
3.3.5	Well Records.....	26
3.4	Site Operating Records.....	26
4	Interviews.....	28
5	Site Reconnaissance	29
5.1	General Requirements	29
5.2	Specific Observations at Phase One Property	29
5.2.1	Property Buildings and Structures	29



5.2.2	Aboveground and Underground Storage Tanks	30
5.2.3	Underground Utilities and Services	30
5.2.4	Site Building Features	30
5.2.5	Wells	31
5.2.6	Sewage Works	31
5.2.7	Surface Features	31
5.2.8	Current or Former Railway Lines or Spurs	31
5.2.9	Surface Staining and Stressed Vegetation	31
5.2.10	Imported Fill and Debris	32
5.2.11	Enhanced Investigation Property	32
5.3	Phase One Study Area	32
5.4	Written Description of Investigation	37
6	Review and Evaluation of Information	39
6.1	Current and Past Uses of The Phase One Property	39
6.2	Potentially Contaminating Activities (PCA)	45
6.3	Areas of Potential Environmental Concern (APEC)	47
6.4	Phase One Conceptual Site Model	51
7	Conclusions	53
7.1	Whether Phase Two Environmental Site Assessment required before Record of Site Condition submitted	53
7.2	Record of Site Condition based on Phase One Environmental Site Assessment alone	53
7.3	Signatures	53
7.4	Closure	53
8	References	55

List of Tables

Table 1	Legal Descriptions of the Phase One Property	1
Table 2	Contact Information	2
Table 3	Summary of Title Search Results	5
Table 4	Reviewed Environmental and Geotechnical Reports and Company Records	8
Table 5	ERIS Report	19
Table 6	Aerial Imagery Summary	22
Table 7	Phase One Study Area Information	33
Table 8	Table of Current and Past Uses of the Phase One Property	39
Table 9	Potentially Contaminating Activities	46
Table 10	Areas of Potential Environmental Concern	48
Table 11	Conceptual Site Model	51
Table 12	References	55



List of Appendices

- Appendix A Site Survey**
- Appendix B Site Plans**
- Appendix C Site Reconnaissance Photographs**
- Appendix D Project Team Members**
- Appendix E Supporting Documentation**



1 Introduction

1.1 Phase One Property Information

Stantec Consulting Ltd. (Stantec) was retained by Taggart Reality Management/1000147699 Ontario Inc. (Taggart) to conduct a Phase One Environmental Site Assessment (ESA) of the properties bounded by Spencer Street, Hamilton Avenue North, Parkdale Avenue, and Armstrong Street (the Phase One Property) in Ottawa, Ontario. These properties are broadly referred to as the “Block”. The municipal addresses for the properties within the Block are 3 Hamilton Avenue North (which includes units 5, 7A, 7B, and 340 Parkdale Avenue); and 223, 229, and 233 Armstrong Street.

The property identification number (PIN), owner, and legal description for each parcel comprising of the Phase One Property are provided in **Table 1**.

Table 1 Legal Descriptions of the Phase One Property

Location ID	Property Address(es)	PIN and Owner	Legal Description
Northern portion of the Block	3 Hamilton Avenue North	PIN 04035-0144 1000147699 Ontario Inc.	LT 1156, PL 157; LTS 1158 & 1159, PL 157; LT 1161, PL 157; OTTAWA
Southwest portion of the Block	233 Armstrong Street, 7 Hamilton Avenue North	PIN 04035-0145 1000147699 Ontario Inc.	LT 1163, PL 157; LT 1165, PL 157; OTTAWA
Southeast portion of the Block	229 Armstrong Street	PIN 04035-0146 Linda Saikaley	PT LT 1160, PL 157; PT LT 1162, PL 157, PART 2 & 3, 4R1186; S/T CR664868; OTTAWA
Southeast portion of the Block	223 Armstrong Street	PIN 04035-0147 Carleton Tavern (Ottawa) Limited	PT LT 1160, PL 157; PT LT 1162, PL 15 ; PT 1, 4R1186; AS IN NS89155 EXCEPT CR664868, T/W CR664868; OTTAWA

The Phase One ESA was completed to determine if Areas of Potential Environmental Concern (APECs) exist at the Phase One Property, which may be present as a result of current and/or past potentially contaminating activities (PCAs) on the Phase One Property or nearby properties within 250 m of the perimeter of the Phase One Property (Phase One Study Area). Stantec understands that the Phase One ESA is required to support the re-development the Phase One Property from its current commercial land use to a mixed commercial and residential land use. Due to the proposed change of land use, Taggart is required to file a Record of Site Condition (RSC) under Ontario Regulation 153/04 (O.Reg.153/04).

A site survey is provided in **Appendix A**, while site plans showing the Phase One Study Area and Phase One Property are included in **Appendix B**.



1 Introduction

February 7, 2025

1.2 Contact Information

The Phase One Property is owned by Taggart. Stantec understands that Taggart recently purchased all properties on the Block, and that the titles provided for review do not necessarily reflect the updated ownership, particularly PINs 04035-0146, and 04035-0147.

Access to the Phase One Property was arranged by Viktoriya Neadow, Assistant Property Manager at Taggart, and Mikala DeMarchi, Junior Property Manager at Taggart. Access to individual properties at the Block was granted by tenants on site at the time of the site visit on March 17, 2023. Contact details for Viktoriya Neadow and Mikala DeMarchi are provided in **Table 2** below.

Table 2 Contact Information

Name	Position	Company	Telephone	Address
Viktoriya Neadow	Assistant Property Manager	Taggart	613-234-7000 ext. 585	225 Metcalfe Street, Suite 708, Ottawa, Ontario, K2P 1P9
Mikala DeMarchi	Junior Property Manager	Taggart	613-234-7000 ext. 584	225 Metcalfe Street, Suite 708, Ottawa, Ontario, K2P 1P9



2 Scope of Investigation

2.1 Phase One ESA Scope of Work

The Phase One ESA was completed to determine if APECs exist at the Phase One Property, which may be present as a result of current and/or past PCAs on the Phase One Property or nearby properties within 250 m of the perimeter of the Phase One Property (Phase One Study Area). Stantec understands the filing of an RSC by Taggart is required under O.Reg.153/04. The objectives of the Phase One ESA included the following:

- To develop a preliminary determination of the likelihood that one or more contaminants have affected any land or water on, in or under the Phase One Property.
- To assess the need for a Phase Two ESA.
- To provide a basis for carrying out a Phase Two ESA, if necessary.
- To provide adequate preliminary information about the environmental condition of in the land or water on, in or under the Phase One Property to conduct a risk assessment following completion of a Phase Two ESA, if necessary.

The Phase One ESA is intended to reduce, but not necessarily eliminate, uncertainty regarding the potential for contamination at a property. The Phase One ESA carried out by Stantec on this property generally satisfied the requirements of O.Reg.153/04, and consisted of the following:

- Records review including, but not limited to, publicly available aerial photographs, city directories, environmental databases, landfill inventory, geological and topographic maps
- Purchase of a database report from Environmental Risk Information Services (ERIS) that consisted of a search of available databases within a 250 m radius of the perimeter of the Site
- Request for fire insurance plans (FIPs) and/or property underwriters' reports/plans associated with the Site from Opta Information Intelligence (Opta)
- A request submitted to the Ministry of Environment, Conservation, and Parks (MECP) Freedom of Information and Protection of Privacy Office included a search for occurrence reports and general information from the District Office, investigation documents from the Investigations and Enforcement Branch, and orders from the Sector Compliance Branch pertaining to the municipal addresses of the Site and current/former tenants and owners of the Site.
- Review of available environmental databases and records
- Review of previous environmental reports and existing title searches, if made available
- Interviews with persons having specific knowledge of the Phase One Property, if available



- A site reconnaissance to identify PCAs associated with:
 - Current on-site operations
 - Waste generation
 - Fuel, chemical and waste storage
 - Exterior conditions including surface features, fill material and wells
 - Potential off-site activities and operations in the Phase One Study Area
- Evaluation of information from records reviewed, interviews and site reconnaissance
- Preparation of the Phase One ESA report.

A Phase One ESA does not include sampling or testing of air, soil, ground water, surface water or building materials. This assessment did not include a review or audit of compliance with any environmental legislation applicable to the Phase One Property, or of any environmental management systems which may exist for the Phase One Property.

A site reconnaissance was conducted at the Phase One Property by Romeet Gonsalves, B.Sc., G.I.T., of Stantec, on March 17, 2023. The Phase One Property and readily visible and publicly accessible portions of nearby properties within the Phase One Study Area were observed for PCAs. Stantec was unaccompanied during the site visit but was provided access to the units within the Block by individual tenants of each unit. No interviews were conducted with persons associated with the Site during the Phase One ESA; however, brief description of daily operations were provided by some tenants on site. Relevant details from these discussions are included in the appropriate sections of this report.

2.2 Regulatory Framework

In Ontario, the roles and powers of the MECP when dealing with contaminated sites are outlined primarily in the *Environmental Protection Act* (R.S.O. 1990). The MECP has a mandate to address conditions where there is an adverse effect, or the likelihood of an adverse effect, associated with the presence or discharge of a contaminant. O.Reg.153/04 provides roles and responsibilities for property owners and consultants to use when assessing the environmental condition of a property when determining whether or not restoration is required and in determining the kind of restoration needed to allow continued use or reuse of a property. The regulation includes generic numerical standards for soil and ground water quality for specific land and ground water uses. A Phase One ESA is an initial step in the site assessment process, which may lead to the requirement for restoration work if areas of potential environmental contamination are identified. During a Phase One ESA, samples are not collected; however, if there are previous soil or ground water sample results available, the results are compared to applicable O.Reg.153/04 site condition standards.



3 Records Review

3.1 General

3.1.1 Phase One Study Area Determination

The Phase One Study Area included the Phase One Property, properties immediately adjoining the Phase One Property, and neighbouring properties located wholly or partially within 250 m from the boundary of the Phase One Property. The presence or absence of landfills and/or coal gasification plants within approximately 1 km of the Phase One Property was also evaluated.

3.1.2 First Developed Use Determination

Aerial photographs from 1928 to 2021, information obtained during the site reconnaissance, information from the ERIS report and selected city directories published from 1920 to 2021 were considered to determine the first developed use of the Site. Based on this information review, 3 Hamilton Avenue North (the northern half of the Phase One Property) was first developed in the early 1940s for industrial use which converted to various commercial uses in 2000. 233 Armstrong Street (the southwest portion of the Phase One Property) was first developed for residential use between 1928 and 1932 and was converted to various commercial uses in the early 1940s. 229 and 223 Armstrong Street (the southeast portion of the Phase One Property) were first developed for residential use prior to 1932 and were converted to commercial uses in the 1940s and 1930s, respectively.

The title search documentation provided by Taggart for PINs 04035-0144, 04035-0145, 04035-0146, and 04035-0147 is summarized in **Table 3** below and is provided in **Appendix E**.

Table 3 Summary of Title Search Results

Portion of the Phase One Property	PIN	Patent	Granted to	Historical Ownership
Northern portion of the Block (3 Hamilton Ave. N.)	040345-0144	1987	Honeywell Limited	After the initial grant holder, this parcel was under residential use until 1940 when manufacturing of scientific instruments began as Ontario Hughes Owen Co. then continued as Sperry Gyroscope Co. in 1951, as Sperry Rand Canada in 1970 and as Honeywell Limited in 1987 until 2000. The parcel ownership then changed to Spencedale Properties Limited in 2000, Joanne Edwards in 2006, 2018297 Ontario Inc./Nello Inc./ Marcel Delattre/Joelle Delattre in 2011, several parties in 2016, Taggart Land Holdings (Group 1) Ltd. in 2021 and 1000147699 Ontario Inc. in 2022. In 2023 the property owner is listed as 1000147699 Ontario Inc.



Portion of the Phase One Property	PIN	Patent	Granted to	Historical Ownership
Southwest portion of the Block (233 Armstrong Street)	040345-0145	1956	Ottawa Shoe Manufacturing Company Limited	After the initial grant holder, this parcel changed ownership to Robert Brown in 1938 and based on available city directories, various commercial and light industrial tenants occupied this parcel between 1945 and the present, including the Ottawa Shoe Manufacturing Company Limited in 1958. The parcel ownership changed from Robert Brown to June Davidson Lacharity in 1962, Earl Gary Lacharity in 1996, Strongton Holdings Limited in March 2006, Markton Properties Limited in May 2006, 2018297 Ontario Inc./Nello Inc./ Marcel Delattre/Joelle Delattre in 2011, Tega Homes (Attika) Inc. in 2015, several parties in 2016, Taggart Land Holdings (Group 1) Ltd., in 2021, and 1000147699 Ontario Inc. in 2022. In 2023 the property owner is listed as 1000147699 Ontario Inc.
Southeast portion of the Block (229 Armstrong Street)	040345-0146	1974	Touffic and Linda Saikaley	After the initial grant holder, this parcel changed ownership from the City of Ottawa to Touffic and Linda Saikaley in 1975 and then the Carleton Tavern (Ottawa) Limited in 1980.
Southeast portion of the Block (223 Armstrong Street)	040345-0147	1980	Carleton Tavern (Ottawa) Limited	After the initial grant holder, this parcel changed ownership from the City of Ottawa to Carleton Tavern (Ottawa) Limited in 1930. Since 1980, the property has not changed ownership.

3.1.3 Fire Insurance Plans

A request was submitted to Opta Information Intelligence (Opta) for Fire Insurance Plans and Site Inspection Plans associated with the addresses at and adjacent to the Site. A response from Opta indicated that several records were available for review; however, Stantec opted to not purchase these records as copies were available in-house and digitally online.

1902 (revised 1912):

- The Phase One Property is mostly undeveloped with some structures occupying the northeast quadrant of the Block and some structures along the eastern boundary of the Block.
- The surrounding Phase One Study Area is less developed compared to present day. The properties directly north of the Phase One Property were undeveloped. The areas to the east and the south appear to be developed with single unit residential properties and light industrial and light commercial properties. Directly south of the Phase One Property are several light industrial properties including a planning mill, a barrel and pail distributor and a lumber yard including the



storage of lumber and a dry kiln where a steam boiler was indicated as being present.

(APEC 1d)

- The remaining surrounding area appears to be generally occupied by residential properties aside from a commercial property (grain and feed elevator) which can be observed approximately 200 m southeast from the Phase One Property.
- Several larger structures including St. Georges Home (church) and Capital Wire & Clothing Manufacturing Co. were noted as being under construction in 1902 fire insurance plan, indicating that development was ongoing in the Phase One Study Area.

Fire Insurance Plan 1956

- The Phase One Property and surrounding Study Area appear to have undergone significant development since the 1902 fire insurance plans, and as observed in the 1928, 1932, and 1945 aerial imagery described in **section 4.3.1**, below.
- The Phase One Property is almost completely occupied with industrial, commercial and retail structures including but not limited to Sperry Gyroscope Ottawa Ltd, including machine shop and instrument manufacturing (PCA 3, APEC 4a), the Carleton Hotel, and the Ottawa Shoe Manufacturing Co. Ltd (PCA 1, APEC 3a).
- The surrounding Phase One Study Area has also undergone significant development. East of the Phase One Property continues to be occupied by single unit residential properties; however, significant industrial, commercial, and retail properties have been developed to the north, south, and west of the Site.
- Notable industrial properties include several foundries on the property directly northwest of the Phase One Property where two associated boilers can be observed (**APEC 4b**)
- Two retail fuel stations can be observed south of the Phase One Property located at 390 Parkdale Avenue where three underground storage tanks (USTs) can be observed (**APEC 1e**) and 1186 Wellington Street West where two USTs can be observed (**APEC 1a**).
- The planning mill, lumber yard, and dry kiln directly south of the Phase One Property appear to no longer be present, as the 1956 fire insurance plans indicate the entire property is now vacant (with exception of a small structure in the southeast corner of the property).

3.1.4 Chain of Title

Chain of title searches for the Phase One Property were provided by Taggart. Relevant information from the chains of title were used to determine the first developed uses at the Phase One Property and is discussed in more detail in **Section 4.1.2**.

A complete list of the owners' names and dates of ownership is provided in the various chain of title documentation provided in **Section 7.1, Table 8 – Current and Past Land Uses**, and in **Appendix E**.



3.1.5 Environmental Reports

Stantec was provided with 32 environmental and geotechnical reports or letters from work completed at the Phase One Property from 2007 to 2022. The following eight recent environmental and geotechnical reports described in **Table 4**, were determined to contain relevant information related to this Phase One Environmental Site Assessment.

Table 4 Reviewed Environmental and Geotechnical Reports and Company Records

Title	Date	Client	Author
Analysis of Sources of Chlorinated Solvents at 223 Armstrong Street, 233 Armstrong Street and 3 Hamilton Avenue North, Ottawa, Ontario	August 2005	Honeywell International Inc. (Honeywell)	Golder Associates Ltd (Golder).
Findings:	The purpose of this report was to assess and describe the sources of chlorinated solvents resulting in groundwater impacts identified at the Site (APEC 6a) through a review of geology, hydrogeology, and contaminant distribution at 223 Armstrong Street, 233 Armstrong Street, 3 Hamilton Avenue North, and surrounding properties. - A review of historical documents indicated the presence of floor drains at 233 Armstrong Street drained wastes from motor and parts degreasing into the subsurface. - A review of historical documents indicated that Ottawa Shoe Manufacturing company at 233 Armstrong Street may have used PCE for leather preparation during shoe manufacturing. - A review of historical documents indicated historical storage of liquid hazardous materials including various chlorinated solvent degreasers, in the courtyard area of 3 Hamilton Avenue North. - A review of historical documents indicated the historical operation of a structure resembling a dry well, and the historical operation of a degreasing dip tank under a "lean-to" structure located in the courtyard of 3 Hamilton Avenue North. - A review of historical reports documented a number of other off-site uses of chlorinated solvents including a foundry, printing facilities, a retail fuel outlet, and a former dry cleaner within the Study Area; however, it was noted that based on the distribution of impacts observed at the Site, that these off-site potential sources were unlikely to be the sources of chlorinated solvent impacts identified at the Site. - Two distinct areas of Dense Non Aqueous Phase Liquid (DNAPL) chlorinated solvents in soils in unsaturated zones were identified: 1) 3 Hamilton Avenue North, and 2) 233 Armstrong Street - The areas of chlorinated solvents had distinct chemical signatures. - The main contaminants of concerns consisted of PCE, trichloroethylene (TCE), cis-1,2 dichloroethylene (DCE), and vinyl chloride. Additionally, some localized hydrocarbon impacts were identified. - Higher concentrations of chlorinated solvents in groundwater were observed at 233 Armstrong Street than at 3 Hamilton Avenue North. - Based on the different chemical signatures, it appeared that the chlorinated solvents from 233 Armstrong Street had migrated towards 3 Hamilton Avenue North and beyond; however, the chlorinated solvents from 3 Hamilton Avenue North did not appear to have migrated towards 233 Armstrong Street.		



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
3 Records Review
February 7, 2025

Title	Date	Client	Author
	As the purpose of the report was to identify the sources of the confirmed chlorinated solvent impacts, no further recommendations were made at the time of report issuance; however, Golder did provide a Remedial Action Plan (RAP) under separate cover, summarized below. Based on the review of this report, Stantec has identified PCAs contributing to APECs were identified at 223 Armstrong Street (APECs 3a, 3b, 3c) and 3 Hamilton Avenue North (APEC 4a and 4b).		
Remedial Action Plan, Migration Control – For Perimeter Shallow Groundwater Control System, 3 Hamilton Avenue North, Ottawa, Ontario	August 2005	Honeywell International Inc.	Golder Associates Ltd.
Findings:	The purpose of this report was to provide description of the technical justification for a perimeter groundwater control system to be installed around 3 Hamilton Avenue North, 223 Armstrong Street, and 233 Armstrong Street. The purpose of the perimeter groundwater control system was to prevent contaminants originating from the aforementioned properties from migrating to the municipal rights-of-way and other downgradient and surrounding properties. - Sources of chlorinated solvents were identified at 3 Hamilton Avenue North and 233 Armstrong Street. 3 Hamilton Avenue North is downgradient of 233 Armstrong Avenue Street (implying a north/northwesterly local groundwater flow direction). The chlorinated solvents from 233 Armstrong Street were migrating towards 3 Hamilton Street and beyond. - Without prevention of further migration of the chlorinated solvents, shallow groundwater impacts may pose an unacceptable risk to indoor air at properties downgradient of the Site. - A network of eductors in extraction wells was proposed based on cost effectiveness, ease of upgrading additional recovery wells if needed, the ability to maintain a negative vacuum on the well head to effectively recover groundwater and vapour, and the ability to maintain low water levels in the wells to induce a reasonable radius of influence in the groundwater. - The proposed system would consist of 24 recovery wells installed to a depth of 7 metres below ground surface (m bgs) and designed for continual operation. Based on pilot testing, each eductor would have a radius of influence of up to 4 metres and would recover up to 1.0L/minute. - The proposed treatment system would have two waste streams (an air stream and a water stream), running through granular activated carbon fiber filters, and the expected groundwater extraction rate would be less than 50,000 litres per day.		
Ministry of Environment (MOE) (now MECP) correspondence with Golder Associates Ltd. in response to the Analysis of Sources of Chlorinated Solvents and the Remedial Action Plan for 223 Armstrong Street, 233 Armstrong Street and 3 Hamilton Avenue North, Ottawa, Ontario	October 13, 2005	Golder Associates Ltd.	Ministry of Environmental (Ontario)
Findings:	A letter was provided to comment on the findings and recommendations of the Analysis of Sources of Chlorinated Solvents and the Remedial Action Plan for 223 Armstrong Street, 233 Armstrong Street and 3 Hamilton Avenue North, as well as to provide further recommendations and requirements, as applicable. - The Ministry was in agreement with the conclusions and proposed RAP provided by Golder as outlined in the two summarized reports above. - The Ministry was concerned that the success of the perimeter pump and treatment system may depend on how closely the system simulates the Sites hydrogeological conditions; therefore, the Ministry recommended that Golder conduct quarterly sampling of 12 monitoring wells for at least two years after initiating the treatment system.		



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
3 Records Review
February 7, 2025

Title	Date	Client	Author
The treatment system was required to be operational for as long as the identified DNAPL source zones existed, which “may be an exceedingly long time as no accurate estimation of contaminant source mass was determined at the Site.”			
Phase I – Environmental Site Assessment, Proposed Multi-Storey Building, 233 Armstrong Street, and 3 Hamilton Avenue North, Ottawa, Ontario	October 21, 2011	Tega Developments (Tega)	Paterson Group Inc. (Paterson)
Findings:	The purpose of this report was to conduct a Phase I ESA to research the past and current land uses of the Site and surrounding Study Area and to identify any environmental concerns with the potential to have impacts on the Site. - The Phase I ESA documented six former industrial sites within 200 m of the Site that had been reported as having been redeveloped by present day. - No significant environmental concerns were identified during the site visit with exception of suspected asbestos containing material. No off-site concerns were identified. - The report indicated there were six unique PCAs at two properties (233 Armstrong Street [APECs 3a, 3b, 3c] and 3 Hamilton Avenue North [APECs 4a and 4b]), with three PCAs at each property. Paterson recommended a Phase II ESA to assess on-site groundwater impacts that had been previously documented, as well as a remedial program for the property prior to redevelopment.		
Phase II – Environmental Site Assessment, Proposed Multi-Storey Building, 233 Armstrong Street, and 3 Hamilton Avenue North, Ottawa, Ontario	December 1, 2011	Tega Developments	Paterson Group Inc.
Findings:	The purpose of this report was to conduct a Phase II ESA along with a geotechnical study and remedial action plan (RAP) to support the proposed redevelopment of the site as residential condominiums. - The Phase II ESA consisted of three boreholes advanced to a maximum depth of 18 m bgs and completed with monitoring wells. Groundwater samples were collected and submitted for the analysis of VOCs. - BH1 was drilled near the centre of the Site; BH2 was drilled at the southwestern corner of the Site; and BH3 was drilled near the northwestern corner of the Site. - Concentrations of DCE and chloroform exceeded MECP Table 7 standards at all three monitoring wells. - Concentrations of PCE exceeded MECP Table 7 standards at BH1 and BH2. - Concentrations of TCE and VC exceeded MECP Table 7 standards at BH1 and BH3 - Concentrations of benzene, 1,2-dichloroethane, and 1,1-DCE exceeded MECP Table 7 standards at BH1. - Exceedances varied from marginal to significant with the largest exceedance being PCE observed at a concentration to be 700 times the applicable standard at BH1 (APECs 3a, 3b, 3c, APECs 4a and 4b, APEC 6a). Paterson recommended that a full-depth remediation approach including pumping and treatment of impacted groundwater be conducted concurrently with site redevelopment.		
Report review, 3 Hamilton Avenue North and 233 Armstrong Street, Ottawa, Ontario	September 12, 2011	Business Development Bank of Canada	Pinchin Environmental



Title	Date	Client	Author
Findings:	The purpose of this report was to review five environmental reports previously completed for the Site from 2005 to 2011. Key points of each report are summarized below: “Remedial Action Plan, Migration Control - For Perimeter Shallow Groundwater Control System, 3 Hamilton Avenue North, Ottawa, Ontario”, prepared by Golder Associates., for Honeywell International Inc., dated August 2005. - Summarized in Section 4.1.5, above. “August 2010 Quarterly and Annual Off-Site Groundwater at 3 Hamilton Avenue North, Ottawa, Ontario”, prepared by Golder for Honeywell, dated February 2011. 71 monitoring well samples were assessed for VOCs and PHCs from quarterly and annual groundwater monitoring and sampling events since 2005. - Golder concluded that groundwater impacts within the shallow and deep bedrock remained present both on- and off-Site but that impacts in close proximity to the Site were not increasing (APECs 3a, 3b, 3c and APECs 4a and 4b, APEC 6a). “Soil Vapour Sampling and Screening Level Risk Assessment, 3 Hamilton Avenue North, Ottawa, Ontario”, prepared by Golder Associates for Honeywell International Inc., dated March 2011. - Eight vapour sample probes were installed at the Site and select off-Site locations to collect samples to determine ambient vapour conditions. - Potential risks were calculated based on hazard quotients and incremental lifetime cancer risks, and human receptors were identified as being residential tenants (both children and adults). - Previous risk assessment investigations completed at the Site and surrounding properties concluded that chloroform concentrations did not originate from the on-Site impacts and were likely generated from an off-Site chlorinated source leak such as drinking water or sanitary sewer. The RA concluded that chloroform did not present unacceptable risk. - Additional risk was evaluated for construction workers with limited time in a hypothetical on-Site trench (human receptor) and it was determined that no significant risk could be identified; however, it was recommended that these human receptors take precaution in the form of respirators, long sleeve shirts, pants, gloves, and boots to minimize exposure and contact with the impacts. - Golder recommended vapour sampling be continued to ensure long-term risks from inhalation remain acceptable. “Phase I-II Environmental Site Assessment, Proposed Multi-Storey Building, 233 Armstrong Street and 3 Hamilton Avenue North, Ottawa, Ontario”, prepared by Paterson Group Inc. for Tega Developments, dated August 12, 2011. - Summarized in Section 4.1.5, above. “Environmental Remedial Action Plan and Associated Quantities, Proposed Residential Building, 233 Armstrong Street and 3 Hamilton Avenue North, Ottawa, Ontario”, prepared by Paterson for Tega Developments, dated August 15, 2011. - The RAP consisted of a memorandum discussing Site development including excavating on-Site soil and bedrock to an approximate depth of 21 m bgs. - Paterson proposed that all groundwater accumulated in the excavation be pumped, treated on site via air stripping or granular activated carbon and then discharged to the City sanitary sewer system. - The remedial option would be required to meet MECP requirements to complete a Record of Site Conditions as a land use change was being proposed. - The excavation was estimated to be open for 6 to 8 months and drawdown created by the excavation was estimated to be approximately 85 to 170 metres.		



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
3 Records Review
February 7, 2025

Title	Date	Client	Author
It was surmised that any remaining impacts would biodegrade through natural attenuation.			
Memorandum - Environmental Remedial Action Plan, Proposed Residential Building, 233 Armstrong Street and 3 Hamilton Avenue - Ottawa	December 20, 2012	Tega Developments	Paterson Group Inc.
Findings:	The purpose of the 2012 memorandum was to revise the RAP from 2011 based on new information. A summary of key points in the RAP are below: - Paterson recommended that two additional deep monitoring wells be drilled to confirm groundwater contamination was not present below the proposed foundation depth of 21 metres. - A remediation program using a full depth generic approach be used, including source removal by excavating all VOC impacted soil, bedrock, and groundwater from within the boundaries of the Site. - Overburden soils, where present would be stripped and segregated for off-Site disposal. Soil would be stockpiled in 20 to 40 m³ piles and screened and tested for VOC impacts. - Bedrock would be removed by line drilling and blasting, and line drilled holes along the site perimeter would be immediately grouted to eliminate potential vertical migration of VOCs. - Following excavation, bedrock face would be sprayed with 50 mm layer of shotcrete to seal the bedrock surface and minimize vertical migration of off-Site impacted groundwater. - Groundwater and surface water infiltrating the excavation would be directed towards a lower area of the excavation and water would be pumped through a treatment system prior to being disposed. - A VOC resistant waterproof membrane would be installed between two layers of concrete along the concrete floor slab and follow up testing and corrections would be made, if necessary, to ensure the functionality of the membrane. - A confirmatory sampling program would be carried out following the implementation of the RAP program.		
2018-2019 Soil Vapour Sampling and Risk Assessment, 3 Hamilton Avenue North, Ottawa, Ontario	March 2020	Honeywell International	Golder Associates Ltd.
Findings:	The purpose of this report was to document the soil vapour sampling and a Screening Level Risk Assessment (SLRA) update for the annual soil vapour sampling program at 3 Hamilton Avenue North (formerly a manufacturing facility). - Previous investigations included the analysis of VOCs, benzene, toluene, ethylbenzene, and xylene (BTEX), and PHCs. PHC and BTEX concentrations were above target levels in indoor air samples in 2014; however, the concentrations were determined to be unrelated to the subsurface conditions at the Site as PHC and BTEX in subslab vapour did not exceed screening levels. Elevated concentrations in the air were likely due to chemical use at JD Upholstery located at 340 Parkdale Avenue. - Golder focused solely on VOCs in 2016 for the purposes of the SLRA. - Golder provided recommendations for three scenarios: 1) Residential, 2) Commercial, Slab-On-Grade, or 3) Trench Worker For scenarios 1 and 2, the recommendations were continued monitoring of soil vapours and that current risk for the Site and surrounding areas be re-evaluated based on 2019 and 2020 soil vapour and sub-slab results. For scenario 2, it was noted that in November 2018, TCE and PCE were at their highest measured concentrations in indoor air since 2014 when indoor air monitoring was last conducted. Additional sampling was planned for the winter of 2019-2020. Golder recommended that limited indoor air sampling be conducted for commercial tenants on the Site, including the CrossFit		



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
3 Records Review
February 7, 2025

Title	Date	Client	Author
Hintonburg tenant space at 3 Hamilton Avenue North as the space was vacant and not assessed during the previous events. For scenario 3, Golder concluded that there were potential risks for construction workers involved with excavation activities at the Site as TCE concentrations were above soil vapour screening levels in 2017, and both TCE and PCE concentrations were above soil vapour screening levels in 2018. It was recommended that a health and safety plan outlining personal protective equipment to minimize risk from these vapours be created.			
2022 Soil Vapour Sampling and Risk Assessment, 3 Hamilton Avenue North, Ottawa, Ontario	February 2023	Honeywell International	WSP Canada Inc. (WSP)
Findings:	The purpose of this report was to conduct a soil vapour sampling and risk assessment (SLRA) update based on the results of the soil vapour sampling program between 2021 and 2022 at 3 Hamilton Avenue North. - The assessment provided an update of the soil vapour levels at the Site by comparing recent soil vapour results to historical levels through annual sampling conducted since 2003. - Assessments were made considering the implications of the results on potential human health risks at the Site and the surrounding area. - The SLRA considered three scenarios (1) residential receptors in the site's surrounding area, (2) commercial workers on the site's properties, (3a) construction worker in a hypothetical open trench at the site's surrounding properties, and (3b) construction workers in a hypothetical open trench on the site. - The assessment identified contaminants of concern (COCs) by comparing maximum concentrations of a parameter to the soil vapour screening level that was calculated using industrial health-based indoor air criteria and MECP guidance. - The assessment found that for scenario (1) no COCs were identified and potential risks were considered acceptable. For scenario (2) COCs included PCE and TCE, that had been historically noted to exceed criteria at the site; however, it appeared that PCE and TCE elevations were not observed year-round and therefore potential risks were considered acceptable. For scenario (3a) no COCs were identified, and potential risks were considered acceptable; however, it was noted that for scenario (3b) PCE and TCE were found to be elevated in several soil vapour probes in the courtyard area near the centre of the site. No construction work was planned for the specific area; therefore, no further evaluation was made. It was recommended that continued monitoring of soil vapour concentrations be carried out for scenarios (1) and (2). For scenario (3b), it was recommended that a health and safety plan be developed should construction work be considered for the site and that PPE should be used to block both direct contact and inhalation with COCs in groundwater and soil vapour in a trench. Continued monitoring of soil vapour was also recommended for scenarios (3a) and (3b).		

The PCAs and APECs identified in the previous investigations has been incorporated into the findings of the current Phase One ESA. A compilation of groundwater and soil vapour data was also provided to Stantec on June 11, 2021 and over 6500 hardcopy pages of information were purchased through the Freedom of Information required. Generally, the results were consistent with information that was previously provided to Taggart.



3.2 Environmental source information

Available environmental databases and records were searched to determine if the Phase One Property and nearby lands within the Phase One Study Area were listed. The databases and search results are presented in the following subsections.

3.2.1 City Directories

City directories were purchased from ERIS for the Site and properties within the Phase One Study Area (see **Appendix E**). 3 Hamilton Avenue North (the Site) was listed as Sperry Gyroscope Ottawa Ltd from 1955 to 1984, Honeywell Sperry Aerospace from 1988 to 1994, and Honeywell Ltd. in 2000. 340 Parkdale Avenue (the Site) was also listed as Sperry Gyroscope Ottawa Ltd. from 1966 to 1984 and Honeywell in 1988 and 1989. The operations at these addresses are considered to be a PCA that may contribute to an APEC at the Site (**APEC 4a**).

The remaining listings in the city directories included residential properties, office spaces and commercial/retail properties including but not limited to restaurants and bars, a radio store, sporting goods stores, a tattoo parlour, sewing shops, advertising agencies, personal storage spaces, health clubs, etc. Due to the nature of operations of these properties, these properties are not considered to be PCAs that may contribute to an APEC to the Phase One Property.

3.2.2 Property Underwriters' Reports and Plans

No property underwriter reports or plans for the Phase One Property were provided by Opta.

3.2.3 National Pollutant Release Inventory (NPRI)

Included in the ERIS report was a search of the National Pollutant Release Inventory database for properties within the Phase One Study Area. No properties within the Phase One Study Area were listed in the NPRI database.

3.2.4 PCB Storage Sites and Inventory Databases

Included in the ERIS report was a search of the National PCB Inventory and the Ontario Inventory of PCB Storage Sites databases for properties within the Phase One Study Area. No properties within the Phase One Study Area were listed in these databases.

3.2.5 Certificate of Approval / Environmental Compliance Approval

Included in the ERIS report was a search of the Certificates of Approval (CofA) and Environmental Compliance Approval (ECA) databases for properties within the Phase One Study Area. One record was found for the Phase One Property, three records were found along the rights of way bounding the Block,



and 16 were found in the remaining Phase One Study Area. An additional 40 unplottable records were also found.

The record found for the Site was an Environmental Compliance Approval registered to Honeywell Limited and dated October 2007, was for emissions to air for the perimeter treatment system of chlorinated solvent and hydrocarbon impacted soil vapour and groundwater at the Phase One Property. This ECA is not in and of itself considered to be a PCA which may contribute to an APEC at the Phase One Property; however, it does highlight the ongoing environmental remediation work being completed at the Site. The three records found at the rights of way along the perimeter of the Block were related to municipal and/or private water or sewage works.

Of the 16 records found for the Study Area, two records were related to air emissions and 14 records were related to municipal and/or private water or sewage works. The 40 unplottable records were either similar in nature or could not be confidently attributed to the Site or Study Area.

A review of the records did not identify activities that could pose a significant environmental concern to the Site.

3.2.6 MECP Freedom of Information Requests

A request submitted to the MECP's Freedom of Information and Protection of Privacy Office included a search for occurrence reports and general information from the District Office, investigation documents from the Investigations and Enforcement Branch, waste generator information from the Environmental Monitoring and Reporting Branch, Certificates of Approval from the Environmental Assessment and Approvals Branch, and orders from the Sector Compliance Branch pertaining to the municipal address of the Site and current/former tenants and owners of the Site.

The response received from the MECP indicated that approximately 6,500 hardcopy pages had been located and are available for purchase. Stantec has purchased the information and it was received from the MECP on February 13, 2024. A total of 20,403 pages of records were provided and reviewed. Generally, the results were consistent with information that was previously provided to Taggart. Further, considering the historical data there was no new information presented that would warrant additional environmental assessment or change the recommendation for a Phase Two ESA.

3.2.7 Coal Gasification Plant Waste Sites

Stantec reviewed the report titled *Inventory of Coal Gasification Plant Waste Sites in Ontario, (Volumes I and II)*, dated April 1987, prepared by Intera Technologies Ltd. for the Ontario Ministry of the Environment (now MECP). The documents include an inventory of known coal gasification plants historically operating in Ontario. No properties within 1 km of the Phase One Property were listed as former coal gasification plants.



3.2.8 Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars

Stantec reviewed the report titled Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario, (Volumes I and II), dated November 1988, prepared by Intera Technologies Ltd. for the MECP. The documents identify industrial sites that produced and/or continue to produce or use coal tar and other related tars. No properties within 1 km of the Site were listed as industrial sites producing or using coal tar.

3.2.9 Hazardous Waste Generators and Receivers

Included in the ERIS report was a search of the Ontario Regulation 347 Waste Generators and the Ontario Regulation 347 Waste Receivers databases for properties within the Phase One Study Area.

17 hazardous waste listings are associated with 3 Hamilton Avenue North (the Site); one for Honeywell Aerospace and/or Sperry Aerospace for the generation of aliphatic solvents, halogenated solvents, inorganic laboratory chemicals, petroleum distillates, oil skimmings and sludges, light fuels, and inert organic wastes between 1988 to 2021. Based on the nature of operations and types of wastes generated, these operations are expected to be a PCA that has contributed to an APEC at the Site (**APEC 4a**).

CAA North & East Ontario located at 16 Hamilton Avenue North, approximately 90 m south of the Phase One Property, is listed once for the generation of waste oils and lubricants from 1999 to 2001. Based on the proximity of this operation to the Site, this operation is expected to be a PCA that may contribute to an APEC at the Site (**APEC 1b**).

Ontario Petroleum Pump located at 1 Hamilton Avenue North, approximately 140 m north of the Phase One Property was listed for the generation of light fuels in 2005. Based on the distance between this address and the Site, this operation is not expected to be a PCA that may contribute to an APEC at the Site.

M.O.M Printing and Scintrex Trace Corp. located at 300 Parkdale, approximately 130 m north of the Phase One Property are listed 15 times for the generation of various wastes including but not limited to acid wastes, aliphatic solvents, petroleum distillates, acid waste and alkaline wastes, waste oils and lubricants, photoprocessing waste, paint/pigment/coating residues, etc., between 1992 to 2022. Based on the distance between this address and the Site, these operations are not expected to be PCAs that may contribute to an APEC at the Site.

Rosemount Family Health Organization and GEM Health Care Services Inc. located at 383 Parkdale, approximately 80 m southeast of the Phase One Property, are listed ten times for the generation of pathological wastes from 2015 to 2021. Based on the nature of operations and types of wastes generated, these operations are not expected to be a PCA that has contributed to an APEC at the Site.



62 more waste generators were registered within the Phase One Study Area. Based on separation distances from the Phase One Property, the inferred and observed ground water flow directions, and the nature of the operations at these properties, these waste generators are not expected to be PCAs contributing to an APEC at the Site.

Graphic Display Canada located at 45 Spencer Street, adjacent to the north of the Phase One Property, is listed three times for the generation of photoprocessing wastes from 1986 to 2001. Based on the nature of the operations at this address, this property is not expected to be a PCA that has contributed to an APEC at the Site.

Metcalfe Realty Company Limited located at 7 Hinton Avenue, adjacent to the west of the Phase One Property, is listed four times for the generation of waste oils and lubricants, organic laboratory chemicals, and oil skimmings and sludges in 2006, 2009, 2012. Given that the quantities of waste were likely limited due to the nature of the operations at this address, this property is not expected to be a PCA that has contributed to an APEC at the Site.

3.2.10 Technical Standards and Safety Authority (TSSA)

A request was made to the TSSA for a search of their files regarding tank installations, fueling facilities, outstanding instructions, incident reports, fuel oil spills and/or contamination records for the Phase One Property. An individual request was made for each address: 223 Armstrong Street, 229 Armstrong Street, 233 Armstrong Street, and 3 Hamilton Avenue North, Ottawa, Ontario.

A reply dated March 31, 2023, was received from the TSSA for each aforementioned addresses indicating they had no records in their database of any fuel storage tanks at the Phase One Property. The TSSA responses are provided in **Appendix E**.

3.2.11 Environmental Registry

Included in the ERIS report was a search of the Environmental Registry database for properties within the Phase One Study Area. Honeywell Limited located at 3 Hamilton Avenue (the Phase One Property) was approved for the discharge of emissions to air in 2007. Based on the receiving medium, this environmental registry is not expected to contribute to an APEC to the Site. Windmill Development Group located at 1233 Wellington Street West approximately 250 m southwest of the Phase One Property was approved for the discharge of emissions to air in 2007. Based on the receiving medium and the distance from the Phase One Property, this environmental registry is not expected to contribute to an APEC to the Site.

3.2.12 Records of Site Condition (RSC)

Included in the ERIS report was a search of the Record of Site Condition (RSC) database for properties within the Phase One Study Area. No records were for the Phase One Property while two records were found for the Study Area whose relevant details are summarized below:



- Hamilton Avenue Holdings Inc. at 20 Hamilton Avenue North, approximately 90 m south and upgradient of the Site was listed in 2022.
- Numbered company 1592541 Ontario Inc., at 1233 Wellington Street West, approximately 250 m southwest and upgradient of the Site, was listed in 2005.

A search of the online MECP Brownfields Environmental Site Registry was completed for the abovementioned properties. This registry is the native data source for the *Record of Site Condition* database.

For 20 Hamilton Avenue North, the Record of Site Condition indicated that 1,702 cubic metres (m³) of soil was removed from the property, including soils within 3 m of the property boundary for the purpose of remediation. Final soil and groundwater conditions met applicable provincial regulatory standards. No other remedial, risk management, or maintenance was required. The COCs were PAHs, metals including mercury and hydride-forming metals, PHCs, BTEX, hexavalent chromium, electric conductivity, sodium absorption ratio, and VOCs in soil and groundwater. Given the final soil and groundwater conditions met the applicable provincial regulatory standards, the property at 20 Hamilton Avenue North is not considered to represent a potential environmental concern for the Site.

For 1233 Wellington Street West, the Record of Site Condition indicated that 4,400 cubic metres (m³) of soil was removed from the property, including soils within 3 m of the property boundary for the purpose of remediation. Final soil and groundwater conditions met applicable provincial regulatory standards. No other remedial, risk management, or maintenance was required. The COCs were PHCs and VOCs in the soil and groundwater. Given the final soil and groundwater conditions met the applicable provincial regulatory standards, the property at 1233 Wellington Street West is not considered to represent a potential environmental concern for the Site.

3.2.13 Areas of Natural Significance (ANSI)

Stantec searched the Ontario Ministry of Natural Resources and Forestry's (MNRF's) Natural Heritage online database. No areas of natural or scientific interest (ANSIs) or natural heritage areas were identified within 1 km of the Phase One Property.

3.2.14 Waste Disposal Sites

Stantec reviewed the information contained in the MOE document titled Waste Disposal Site Inventory, dated June 1991 and the Golder Associates document titled Old Landfill Management Strategy (OLMS), Phase 1, Identification of Sites dated 2004. The reports include lists of known active and closed waste disposal sites in Ontario, as of October 31, 1990. Based on the coordinates provided in the inventory, four former waste disposal sites were identified within 1 km of the Phase One Property ranging from 540 m to 850 m from the Site. The details of the four waste disposal sites are summarized below:



- The dump at the corner of Yonge Street and Fairmont Avenue located approximately 830 m southeast of the Phase One Property operated between 1928 to 1932. No methane was detected during monitoring conducted in 1988. Based on the distance of this former landfill to the Phase One Property it is not expected to contribute to an APEC to the Site.
- The dump at Bayswater Avenue and Wellington Street West located approximately 850 m east of the Phase One Property is noted as having been in operation prior to 1928 and used for the disposal of glass, crushed stone, brick fragments, and other construction rubble. Based on the distance of this former landfill to the Phase One Property it is not expected to contribute to an APEC to the Site.
- The dump at Laroche Park, east of Stonehurst Avenue, located approximately 540 m northeast of the Phase One Property is noted as having been in operation between 1928 and 1932. Based on the distance of this former landfill to the Phase One Property it is not expected to contribute to an APEC to the Site.
- The Bayview Dump located approximately 815 m northeast of the Phase One Property is noted as having been in operation between 1933 and 1946 presumably for domestic waste and light industrial solid waste. Previous environmental investigations have observed PAH and metal impacts at the former dump and the area has been used as a snow dump area. Based on the distance of this former landfill to the Phase One Property it is not expected to contribute to an APEC to the Site.

In addition, included in the ERIS report was a search of the Waste Disposal Sites and Anderson's Waste Disposal Sites databases for the Site and properties within a 250 m radius of the perimeter of the Site. No listings for waste disposal sites were found in the ERIS report.

3.2.15 ERIS Report

An ERIS report was obtained as part of the Phase One ESA. The report consisted of a search of available databases (including unplotable records) within a 250 m radius of the perimeter of the Phase One Property. Records of environmental significance within the Phase One Study Area, which are not discussed elsewhere in this report, are summarized in **Table 5** below.

Table 5 ERIS Report

Location	Summary
228 Armstrong Street (adjacent to south of the Phase One Property)	• A natural gas leak was noted in June 2018 due to a pipeline strike. Based on nature of the leak and the receiving medium (atmosphere), this incident is not considered to be a PCA that has contributed to an APEC at the Site.
4 Hamilton Avenue North (adjacent to the west of the Phase One Property)	• A 1 L spill of hydraulic oil to ground was listed in June 1993. Based on the age and volume of the spill, this incident is not considered to be a PCA that has contributed to an APEC at the Site.



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario

3 Records Review

February 7, 2025

Location	Summary
320 Parkdale Avenue (adjacent to the north of the Phase One Property)	A fuel oil leak of unknown quantity was reported in October 2016 at the apartment building. Although the volume was not disclosed in the ERIS report, it is possible that it was a significant quantity as the source of the leak was piping from a multi-unit residential building's storage tank. As a result, and due to the proximity of the property to the Phase One Property, this incident is considered a PCA that has contributed to an APEC at the Site (APEC 2).
300 Parkdale Avenue (approximately 130 m north of the Phase One Property)	- A 40 L spill of hydraulic oil to asphalt was listed in April 2020 and was noted to have been cleaned at the time of the incident. - M.O.M. printing was listed in the Scott's Manufacturing Directory twice in 1963 for commercial printing, lithography, digital printing, and quick printing. - Scintrex Trace Corp. was listed in the Scott's Manufacturing Directory Based on distance of the spill and the cleanup response, this spill is not considered to be a PCA that has contributed to an APEC at the Site.
20 Pinehurst Avenue (approximately 110 m northeast of the Phase One Property)	A furnace oil leak of unknown quantity was reported at a private residence in November 1991. It was noted that the leak occurred in the basement and was directed to a drain. Based on distance of the spill and the receiving medium (a drain), this incident is not considered to be a PCA that has contributed to an APEC at the Site.
84 Hinton Avenue North (approximately 120 m southwest of the Phase One Property)	A natural gas leak was noted in December 2021 due to a pipeline strike. Based on nature of the leak and the receiving medium (atmosphere), this incident is not considered to be a PCA that has contributed to an APEC at the Site.
22 Hamilton Avenue North (approximately 120 m southwest of the Phase One Property)	A natural gas leak was noted in June 2021 due to a pipeline strike. Based on nature of the leak and the receiving medium (atmosphere), this incident is not considered to be a PCA that has contributed to an APEC at the Site.
383 Parkdale Avenue (approximately 80 m southeast of the Phase One Property)	- A gasoline spill of unknown quantity was recorded in 1988 due to a gasoline odour report from the sump pump located in the parking garage of the building at the property. - GEM Software Scheduling and Myropen Publishing were listed in the Scott's Manufacturing Directory. No information was provided for the GEM Software Scheduling, and Myropen Publishing was listed in 1932 as a Periodical Publisher. Based on the nature of the manufacturing at these properties, these operations are not considered to be a PCA to has contributed to an APEC at the Site; however, due to the proximity of the property, the gasoline spill is considered to be a PCA that has contributed to an APEC at the Site (APEC 5a).
1175 Wellington Street West (approximately 100 m south of the Phase One Property)	One 5,000 L fuel tank (delisted in 2012) was registered to 785730 Ontario Inc. in 1990. Based on the proximity of the fuel tank to the Site, the presence of the former fuel tank is considered to be a PCA that has contributed to an APEC at the Site (APEC 1c).



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
3 Records Review
February 7, 2025

Location	Summary
390 Parkdale Avenue (approximately 110 m south of the Phase One Property)	6205429 Canada Inc., Suncor Energy Products, 1496030, and Parkdale Sunoco were noted in several fuel storage related databases for the gasoline service station located at the property from 1996 to 2020. Tanks listed included two 25,000 L liquid fuel USTs, one 50,000 L fuel UST, and one 65,000 L fuel UST. - A gasoline spill of unknown quantity was reported at the Sunoco Gas Station in 2005. Based on the proximity of these operations to the Phase One Property as well as a gasoline spill, this property is considered to be a PCA that has contributed to an APEC at the Site (APEC 1e).
1186 Wellington Street West (approximately 160 m south of the Phase One Property)	- Esso Petroleum Canada/Parkdale Esso Ron Aspek & Son Ltd. were noted in several fuel storage related databases for several USTs installed in 1979 and delisted in 2013. The fuel tanks included at least one 22,700 L liquid fuel tank, and one 13,600 L liquid fuel tank. - A 3000 L furnace oil leak from an underground tank was noted in March 1992 with confirmed impacts to soil and groundwater. - A gasoline spill of unknown quantity from an underground tank to soil was noted in 1993. Based on the proximity of this operation to the Phase One Property, the nature of a gas station operation, and the volume of the spills, this property is considered to be a PCA that has contributed to an APEC at the Site (APEC 1a).
Unplottable records	- Several ECAs and Environmental Registry listings were associated with Quantum Remediation Inc., located at 15 Fitzgerald Road (<12 km from the Phase One Property). - Several waste generators of varying waste streams were associated with buildings at the Tunney's Pasture campus north of Holland Avenue and <300 m from the Phase One Property. - Several fuel and coolant spills of small >15 L quantities were noted along Wellington Street West but were not able to be confidently attributed to addresses within the Phase One Study Area. - A 156 L diesel spill associated with an Esso fuel station was reported in 1998. Although no evidence was provided to indicate where the Esso was located, it is possible the spill was associated with the Esso fuel station located at 1186 Wellington Street West (APEC 1a). Of the remaining unplottable records which could confidently be attributed to addresses within the Phase One Study Area, it did not appear that records were associated with PCAs which may contribute to APECs to the Phase One Property. The remaining unplottable records could not be confidently attributed to addresses within the Phase One Property.

The remaining listings in the ERIS report are not expected to contribute to an APEC at the Site based on the nature of their operations, inferred ground water flow direction and/or the separation distances.



3.2.16 Other information sources

The report titled *Mapping and Assessment of Former Industrial Sites* produced by Intera Technologies Limited in 1988 was also reviewed. The report indicated that the 1922 City of Ottawa fire insurance plans referenced a UST located at the block of properties directly west of the Phase One Property (**APEC 3c**)

3.3 Physical Setting Sources

3.3.1 Aerial Photographs

Satellite images taken in 1932, 1946, 1981, and 2021 were purchased and reviewed from ERIS. Aerial photographs from the GeoOttawa mapping website were reviewed for 1928, 1958, 1965, 1976, 1991, 1999, 2002, 2005, 2007, 2008, 2011, 2014, 2015, 2017, 2019, and 2021. The aerial imagery was utilized to determine the historical activities at the Site and nearby lands. A general summary of significant features shown in each aerial image of the Site and surrounding area is provided in **Table 6** below:

Table 6 Aerial Imagery Summary

Year	Summary
1928	- The Phase One Property appears to be mostly undeveloped with the exception of a structure visible in the southeastern corner of the property. - The surrounding Study Area is a mix of undeveloped and residential properties. Some larger buildings including a foundry can be observed directly northwest of the Phase One Property (APEC 4b). The road network appears to be configured generally the same as the present day road network; however, Hamilton Avenue North appears to only be constructed from Armstrong Street to Tyndall Street.
1932	- The Phase One Property appears to have some further development of small structures; however, they remain restricted to the southeastern corner of the property. - Some construction can be observed on previously undeveloped land within the Study Area, particularly on the block adjacent to west of the Phase One Property where Capital Wire and Cloth (a brass foundry) was constructed and operated from the 1930s to the 1950s (APEC 3b). The construction of Hamilton Avenue North appears to have been completed to the north of Armstrong Street to Bullman Street.
1946	- More of the present-day buildings on the Phase One Property appear to have been constructed and development has extended beyond the southeastern corner of the block. - Continued development of commercial/light industrial buildings can be observed in the surrounding Study Area, particularly at the two blocks to the west of the Phase One Property, and the block adjacent to the north of the Phase One Property.
1958	- No significant changes can be observed at the Phase One Property in the 1958 aerial imagery. - The development of some small buildings can be observed on the block to adjacent to the south of the Phase One Property, primarily along the border of the block.
1965	- No significant changes can be observed at the Phase One Property in the 1965 aerial imagery. - Some minor re-development including building reconfigurations can be seen in the surrounding Study Area, notably in the blocks adjacent to the north and the south of the Phase One Property.



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
3 Records Review
February 7, 2025

Year	Summary
1976	- No significant changes can be observed at the Phase One Property in the 1976 aerial imagery. - Some minor re-development including building reconfigurations can be seen in the surrounding Study Area, notably in the block adjacent to the south of the Phase One Property can be observed to have several structures constructed including the Parkdale Park pool and the Parkdale Market (temporary tarp and fencing structures for local farmer markets)
1981	- The building at 233 Armstrong appears to have been extended to the east on the Phase One Property. - Some minor development can be observed at the block adjacent to the south of the Phase One Property; no significant changes can be observed in the surrounding Study Area.
1991	- No significant changes can be seen at the Phase One Property in the 1991 aerial imagery. - Significant development can be seen directly northwest of the Phase One Property at The Holland Square office park including two low-rise buildings and two-levels of office space occupying the remainder of the block. Some buildings that were previously present within the southern portion of the Holland Square office park have been removed or re-developed and some open courtyard space has been developed in its place. Further, a gas station can be observed approximately 110 m south of the Phase One Property at 390 Parkdale Avenue (APEC 1e), and another gas station can be observed approximately 160 m south of the Phase One Property at 1186 Wellington Street West (APEC 1a)
1999	- No significant changes can be seen at the Phase One Property in the 1999 imagery. - Some residential construction can be observed beginning to take place northwest of the Phase One Property, while the rest of the surrounding Study Area continues to remain consistent with 1991 imagery. - The gas station at 1186 Wellington Street West no longer appears to be present.
2002	- No significant changes can be seen at the Phase One Property in the 2002 imagery. - No significant changes can be seen in the surrounding Study Area with exception of some buildings being re-constructed approximately 200 m southeast of the Phase One Property.
2005	- No significant changes can be seen at the Phase One Property in the 2005 aerial imagery. - No significant changes can be seen in the surrounding Study Area with exception of a building being constructed in a former parking lot area directly north of the Phase One Property.
2007	- No significant changes can be seen at the Phase One Property in the 2007 aerial imagery; however, it is noted that the courtyard area near the centre of the Site can be observed to be filled with domestic waste. - No significant changes can be seen in the surrounding Study Area with exception of a building being constructed in a former parking lot area approximately 190 m southwest of the Phase One Property.
2011	No significant changes can be seen at the Phase One Property or Study Area in the 2011 aerial imagery with exception of a shipping container placed along the northern boundary of the Block. It is noted that the courtyard at the centre of the Site appears to still be poorly maintained and domestic waste can be observed.



Year	Summary
2014	- No significant changes can be seen at the Phase One Property in the 2014 aerial imagery. The previously observed domestic waste in the courtyard near the centre of the Site appears to be removed and the courtyard appears in good condition. - No significant changes can be seen in the surrounding Study Area with exception of a building being constructed in a former parking lot area approximately 240 m southwest of the Phase One Property.
2015, 2017, 2019, 2021	No significant changes can be seen at the Phase One Property or Study Area in the 2015, 2017, 2019, and 2021 aerial imagery.

The property uses identified in the aerial photographs are not expected to contribute to an APEC at the Site based on the nature of their operations and/or the separation distances.

No additional aerial imagery was obtained as the time period between photos was deemed adequate and shows the first development of the Site.

3.3.2 Topography, Hydrology and Geology

3.3.2.1 Topography and Regional Drainage

Based on available topographic maps, the regional surface drainage (inferred regional ground water flow direction) appears to be north toward the Ottawa River approximately 1 km from the Phase One Property.

According to the Phase II ESA completed by Paterson in 2011, groundwater in the lower bedrock unit was determined to be flowing towards the northeast. In both the semi-annual groundwater monitoring reports by Golder in April 2018 and September 2018, it was determined that the groundwater flow direction in the shallow bedrock was variable (towards the west, north, and east), likely due to the heavy influence by underground utility trenches.

While the groundwater flow direction in the deep bedrock was noted being east and northeast towards a geological fault, it was concluded that the CoCs at the Phase One Property appeared to be migrating in a southerly direction due to the influence of the southerly dipping bedrock, with a slightly easterly migration component due to the geological fault.

It should be noted the elevation of the local ground water table can generally mimic the local topography and may not reflect the regional trend in drainage. The local shallow ground water flow pattern can also be influenced by nearby subsurface structures, such as building foundations, weeping tiles and utility trenches. Previously determined groundwater flow directions may not be reflective of current groundwater flow directions due to varying conditions during previous site investigations or current site investigations including on-going construction, remedial efforts at the Phase One Property, changes to underground utilities, and the influence of temporary construction or permanent dewatering at properties within the Study Area.



3.3.2.2 Hydrology and Surface Water Drainage

Where buildings are not present, the surfaces of the Phase One Property consist of paved parking areas, concrete sidewalks, asphalt rights-of-way, and a grassy courtyard area. It is expected that surface water infiltrates to the subsurface through the grassy courtyard area or runs off towards the storm drains around the perimeter of the Phase One Property. During the site visit on March 17, 2023, there was significant pooling of rainwater in open potholes and other small localized depressions including areas where monitoring wells had been installed.

3.3.2.3 Surficial Geology

Based on information obtained from Ontario Geological Survey Map titled Surficial Geology of Southern Ontario, native surficial soils near the Site reportedly consist of stone-poor, sandy silt to silty sand-textured till on Paleozoic terrain. It should be noted that the map indicates the surficial geology immediately east of the Phase One Property is Paleozoic bedrock at surface, indicating that surficial geology is likely shallow and minimal in the Phase One Study Area.

According to the Phase II ESA completed by Paterson in 2011, two of the three boreholes advanced at the Phase One Property consisted of fill from 0.08 to 1.75 m bgs overlying bedrock. One of the three boreholes indicated there being a thin 60 cm layer of glacial till between fill and bedrock at approximately 1.17 to 1.75 m bgs. Stratigraphic logs for boreholes advanced at the Phase One Property by Golder between 2008 and 2012 were also provided to Stantec for review, indicating fill consisting of silt, sand, gravel, boulders, and cobbles was observed underlying concrete and/or asphalt to depths of approximately 0.10 to 0.20 m bgs.

3.3.2.4 Bedrock Geology

Based on information obtained from MNR Ontario Geological Survey Map 2544, titled Bedrock Geology of Ontario, Southern Sheet, bedrock in the vicinity of the Site is reported to consist of limestone, dolostone, shale, arkose, and sandstone of the Ottawa Group and Simcoe Group, Shadow Lake Formation. The depth to bedrock was not indicated on the map.

According to the Phase II ESA completed by Paterson in 2011, grey limestone bedrock was encountered at the Phase One Property at depths ranging from 0.81 to 4.19 m bgs. The borehole logs by Golder from 2008 to 2014 indicated limestone bedrock was encountered at depths between 0.84 to 2.44 m bgs. The borehole logs provided by Golder indicated that there were 6 distinct bedrock units identified as G2 through G9. Unit G6 was characterized as a siliceous dolostone with grey shaly bedding partings; unit G8 was characterized as a siltstone and fine grained sandstone with interbeds of limestone and dolomitic limestone; unit G9 was characterized as siliceous sandstone interbedded with calcareous siltstone and shale; and the remaining bedrock units were characterized as geologically differing limestones. Golder completed boreholes between 2008 to 2016 to depths ranging from 7.20 to 22.15 m bgs



3.3.3 Fill Materials

It is possible fill material has been brought to the Site to support the construction activities observed, and likely subgrade fill material is present under the entire roadway on and adjacent to the Site. As this fill is of an unknown quality it is considered to be a PCA contributing to an APEC at the Phase One Property (APEC 6b).

3.3.4 Water Bodies and Areas of Natural Significance

No water bodies are present at the Phase One Property. The Ottawa River is located approximately 1 km north of the Phase One Property. Based on a review of selected aerial photographs and topographic maps, no other bodies of water or areas of natural significance were identified on or in the immediate vicinity of the Phase One Property.

According to the MECP Source Water Information Atlas interactive map, well-head protection areas are not present at the Phase One Property or within the Phase One Study Area. The Site is serviced by the municipal drinking water system based on the presence of water lines observed during the site reconnaissance and presented on GeoOttawa.

3.3.5 Well Records

Included in the ERIS report was a search of the Water Well Information System database for properties within the Phase One Study Area. Approximately 41 well records, the majority for monitoring wells, were listed in the ERIS report for the Phase One Property. Another 62 well records were identified within the remainder of the Study Area for domestic, industrial water supply, municipal water supply, commercial water supply and monitoring purposes.

Some records indicated wells had been abandoned. According to these well records, soil in the vicinity of the Site is primarily comprised of silt, sand, gravel or imported fill from surface to an approximate maximum depth of 4.5 m, although most well records indicate the surficial soil horizons are thin and are underlain by shallow (1 – 2 m bgs) bedrock as described in **Section 4.3.2**, above.

3.4 Site Operating Records

The Phase One Property is deemed an Enhanced Investigation Property, as defined in O.Reg.153/04. No operating records were provided to Stantec for review; however, an ECA registered to Honeywell Limited at 3 Hamilton Avenue North was noted in the historical report review and in the ERIS report.



Honeywell Limited located at 3 Hamilton Avenue North was registered and approved for air emissions in 2017 for emissions of air to the atmosphere related to the on-site vapour treatment process. The emissions were required to be exhausted into the atmosphere at a maximum volumetric flow rate of 0.0072 cubic metres per second through a stack with an exit diameter of 0.076 metres and extending 8.23 m above grade. Based on the height of the stack, and the emissions directly to the atmosphere, this on-Site treatment process is not considered to be a PCA contributing to an APEC at the Phase One Property.



4 Interviews

February 7, 2025

4 Interviews

Stantec was unaccompanied during the site visit on March 17, 2023. No Taggart Reality Management/1000147699 Ontario Inc. personnel were available on-Site for interviews during the site visit. Stantec briefly discussed site operations with individual tenants when given the opportunity. The details of these discussions have been included in **Table 7** below, as applicable.

No other individuals at or associated with the current and/or former operations at the Phase One Property were available for an interview. Information gathered from individual tenants and received during the reporting process has been included in the applicable sections throughout this report.



5 Site Reconnaissance

5.1 General Requirements

The site visit was conducted by Romeet Gonsalves, B.Sc., G.I.T., of Stantec, on March 17, 2023. The field work was conducted between 8:30AM and 1:00PM. The weather was cloudy and rainy, and the temperature was approximately 2°C. Portions of the ground surface including the sidewalks were partly covered in snow during the site visit. Other localized depressions were filled with rainwater and snowmelt, where some monitoring wells were suspected to be present. At the time of the site visit, the Site was occupied by several commercial businesses ranging from self-storage, coffee shops, a bar, a fitness centre, a comic book shop, an interior design firm, a pet salon, and a bicycle store. The courtyard near the centre of the Phase One Property was locked and not accessible during the site visit. Select photographs from the site visit conducted on March 17, 2023 are included in **Appendix C**.

The Site and readily visible and publicly accessible portions of adjoining and neighbouring properties were observed for the presence of potential sources of environmental contamination. Some snow and rainwater remained on the ground at and around the Site, minimally obstructing the view during the site visit. Stantec was unaccompanied during the site visit; however, Stantec briefly discussed site operations with the owners and managers of the stores within the units on the Phase One Property, when possible.

5.2 Specific Observations at Phase One Property

5.2.1 Property Buildings and Structures

Several multi-tenant buildings were present on the Phase One Property as well as a seacan along the northern boundary of the property owned by Golder, likely related to remediation activities at the Site. The Phase One Property included a paved parking lot area near the centre of the Site, and a grassy/treed courtyard also near the centre of the Site. The courtyard area was not accessible during the site visit. The buildings on the Phase One Property ranged from one storey to four storeys including three above-grade levels and one basement level. At the time of the site visit, all accessible units were occupied with exception of the Sphere Café located at 7 Hamilton Avenue unit 7A; however, the area was being used as a storage space of overstocked hardwood and tile owned by an adjoining tenant, Inner Design.

Salt was historically used for de-icing purposes on the courtyard area of the Phase One Property and on the adjacent off-site sidewalks and roadways (APEC 8).



5.2.2 Aboveground and Underground Storage Tanks

No USTs were observed on the Phase One Property at the time of the site visit; however, it was noted that a fill and vent port was observed at the apartment building directly north of the Phase One Property, located 320 Parkdale Avenue, which indicated at least one UST in the Study Area (**APEC 2**). One PVC drum was observed along the northern boundary of the Phase One Property in front of 340 Parkdale Avenue adjacent to the Golder shipping container. The drum was not accessible, and its contents were not confirmed during the site visit.

There was no evidence of any spill surrounding the drum; therefore, this drum is not expected to contribute to an APEC to the Site.

Based on email correspondence with Paul Hurst of WSP on April 22, 2024, two aboveground storage tanks (ASTs) were previously located on the east-central portion of the Phase One Property in the northeast corner of the basement of the Carleton Tavern at 223 Armstrong Street. The ASTs were located on a concrete floor and were removed in 2019 when the sub-slab depressurization system was installed. The presence of fuel storage ASTs on the east-central portion of the Phase One Property is considered a PCA (PCA 28 – Gasoline and Associated Products Storage in Fixed Tanks) that contributes to an APEC on the southeast portion of the Phase One Property (**APEC 5b**).

No ASTs, generators, or other chemical or fuel storage tanks were observed at the Phase One Property at the time of the site reconnaissance.

5.2.3 Underground Utilities and Services

As confirmed by multiple tenants of various units on the Phase One Property and GeoOttawa, the buildings on site are provided underground utilities and services including sanitary, storm, hydro, and natural gas.

One pole-mounted transformer was located along the southern boundary of the Phase One Property. One pole-mounted transformer was also located east and west of the Phase One Property, immediately across the adjacent rights-of-way. No apparent leakage or staining were present at the transformers. Overhead hydro lines were also present along the boundaries of the Phase One Property.

5.2.4 Site Building Features

At least four buildings, comprising several units and a variety of tenants, were observed at the Phase One Property during the site reconnaissance. The building at the southwest corner of the Block included the civic addresses 7 Hamilton Avenue North and 233 Armstrong Street (including 233A, 223B, and 223C) and was only one floor, with access to a small basement level in 233A Armstrong Street only. The building along the centre of the southern boundary of the Block was identified by the civic address 229 Armstrong Street and was two above grade storeys with a small basement space; during the site reconnaissance, access was provided to the basement area, but not the second storey. The building located at the southeastern corner of the Block was identified by the civic address 223 Armstrong Street



and appeared to include two storeys and a basement. The property at 223 Armstrong Street was not accessed at the time of the site reconnaissance. The building along the entirety of the northern boundary of the Block included civic addresses 340 Parkdale Avenue, 340B Parkdale Avenue, 3 Hamilton Avenue North, and 5 Hamilton Avenue North. This building had three storeys and a basement level; however, all three storey and the basement section were only accessible through Parkdale Mini Storage located at 340 Parkdale Avenue at the northeast corner of the Block. The remaining tenants at the other units in this building were not aware of basement space below their units, nor did they have access to the second or third storeys. These buildings, the tenants, and their specific operations are discussed further in **Table 7**, below.

5.2.5 Wells

Numerous monitoring wells were observed on the Phase One Property or the properties within the Phase One Study Area at the time of the Site reconnaissance. At least 26 monitoring wells were observed; however, it should be noted that portions of the Phase One Property and the Study Area were partly covered by snow and rainwater puddles. It should also be noted that at least 10 monitoring wells and one observation well were observed in the paved parking area near the centre of the Phase One Property where numerous cars were parked, and that observation of additional wells may have been obstructed by parked cars.

5.2.6 Sewage Works

Storm and sanitary sewer manholes, and storm drains were observed on Hamilton Avenue North, Spencer Street, Parkdale Avenue, and Armstrong Avenue around the Phase One Property block. As noted on GeoOttawa, sanitary and storm sewers are located along Spencer Street, Parkdale Avenue, and Armstrong Avenue; and a combined sanitary/storm sewer is located along Hamilton Avenue North. Public water mains are also located along Hamilton Avenue North, Parkdale Avenue, and Armstrong Avenue. Wastewater was observed to be generated by all observed units at the Phase One Property.

5.2.7 Surface Features

Where buildings were not present, the surfaces of the Phase One Property consisted of and paved parking areas, access routes, and a landscaped courtyard. The Phase One Property is at grade with the surrounding Study Area and dips very gently north towards the Ottawa River.

5.2.8 Current or Former Railway Lines or Spurs

No current or former railway lines were identified on the Phase One Property or surrounding Study Area.

5.2.9 Surface Staining and Stressed Vegetation

No stained surficial materials or stressed vegetation was observed during the March 17, 2023 site visit; however, it should be noted that no access was provided to the courtyard near the centre of the Phase One Property and surfaces were generally wet due to rain and snowmelt.



5.2.10 Imported Fill and Debris

It is possible fill material has been brought to the Site to support the construction of the buildings on the Phase One Property. As many units on the Phase One Property did not have any basement area, it is possible that subgrade fill material is present on portions of the Phase One Property and under the roadways adjacent to the Phase One Property. As this fill is of an unknown quality is considered to be a PCA contributing to an APEC at the Phase One Property (**APEC 6b**).

Domestic and restaurant garbage was observed along the sidewalks outside of the units. The garbage appeared to be well-maintained and organized and no evidence of a PCA resulting from the present debris could be observed.

5.2.11 Enhanced Investigation Property

Due to current and historical industrial operations at the Phase One Property, the Phase One Property is considered an Enhanced Investigation Property, as defined in O.Reg.153/04.

Minor generation of solid and/or liquid waste would be expected from ongoing commercial activities at the Phase One Property.

None of the following were observed at the Site:

- Stained surficial materials or stressed vegetation
- Watercourses, pits, or lagoons
- Air emissions or strong, pungent, or unusual odours

However, the following were observed:

- Drains, sumps, and septic systems
- Standing water

Standing water was observed due to ongoing rain and recent snowmelt in localized depressions, potholes and other cracks in the concrete and asphalt surroundings. Drains, sumps, and septic systems were observed to be associated with the buildings on the property and storm and sanitary manholes as well as storm catch basins were observed along the rights-of-way surrounding the Block. As these drains, sumps, and septic systems were observed to be in good maintenance, these are not considered to be PCAs contributing to APECs to the Phase One Property.

5.3 Phase One Study Area

The Phase One Property is located within a commercial land use area and is bounded by Spencer Street to the north, Parkdale Avenue to the east, Armstrong Road to the south, and Hamilton Avenue North to the west. The surrounding Phase One Study Area is comprised of mixed residential and commercial land use properties.



A summary of relevant property use information in the Phase One Study Area is provided below in **Table 7** below.

Table 7 One Study Area Information

Address	Occupant/Unit	Summary
340 Parkdale Avenue (the Site)	Parkdale Drip House Unit 340B	During the site visit, this part of the Site appeared to be in good maintenance and operated as a coffee shop. Some kitchen oils were observed in small quantities and the employees on site were not aware of recent spills. The coffee house included one floor of space with a kitchen and a storage room used by employees to cook and prepare food, and to store breads, pastries, coffee and other coffee shop style foods. The current site operations are not expected to contribute to an APEC to the Phase One Property.
340 Parkdale Avenue (the Site)	CrossFit Hintonburg	Minimal access was provided to the crossfit gym space; however, the entire space appeared to be visible from the entrance. The space included one large exercise area stocked with weights, ropes and other similar exercise equipment. Staff on site indicated not being aware of any known spills or environmental occurrences at the property. The current site operations are not expected to contribute to an APEC to the Phase One Property.
340 Parkdale Avenue (the Site)	Jack's Upholstery and Re-Finishing	Minimal access was provided to this store. During the site visit, this property appeared to be disorganized; however, the store area was small and no notable observations were made. Some small paint cans and household cleaning products were noted to be present but no evidence of staining or spilling could be observed. The current site operations are not expected to contribute to an APEC to the Phase One Property.
340 Parkdale Avenue (the Site)	Parkdale Mini Storage	During the site visit, this property appeared to be in good maintenance with exception of the basement area. Staff on site accompanied Stantec through the unit. Access was provided to the second and third floor hallways, where storage units were noted, but none were entered. Near the main entrance, an elevator was identified, and according to the staff on site was reported to be original to the building but had been out of service for several years. A mechanical room was observed on the second floor with a variety of equipment present. Service tags on the equipment indicated the equipment was last inspected in March 2023. Staff on site did not know how the equipment operated; however, no staining was observed and no floor drains were noted in the vicinity. The basement of the unit was observed to be in poor maintenance, with a room occupied by various wastes including old plumbing, and fluorescent light bulbs. As the basement room appeared to be built directly on top of the underlying bedrock at the property (no floor or impermeable membrane), the poor maintenance of the storage area and potentially contaminating materials laid directly on top of the subsurface may be a PCA contributing to an APEC at the Phase One Property (APEC 7). Access was also briefly provided to the roof of the unit; however, Stantec only observed the roof from the door. The roof was covered in snow and no environmental concerns were noted at the time.



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario

5 Site Reconnaissance

February 7, 2025

Address	Occupant/Unit	Summary
223 Armstrong Street (the Site)	The Carleton Tavern	Minimal access as provided to this property as there were not sufficient staff on site to escort Stantec to the basement area or the kitchen area. During the site visit, the main restaurant and bar portion were observed and appeared to be in good maintenance. Based on the observations made at the time of the site visit, the current site operations are not expected to contribute to an APEC to the Phase One Property; however, the historical presence of ASTs in the basement (which were removed in 2019) is considered to be a PCA and contributes to an APEC (APEC5b).
229 Armstrong Street (the Site)	Morning Owl Coffee	During the site visit, this property appeared to be in good maintenance. This property is a coffee shop. Several small (<1 gallon) bottles of cooking oils and cleaning products were observed at the site, and staff were unaware of any spills. The store had access to a basement used to extra storage space. No visible tanks, sumps, floor drains or other notable observations were made in the basement area. The current site operations are not expected to contribute to an APEC to the Phase One Property.
233 Armstrong Street (the Site)	Nostalgia Collectibles Unit 233C	During the site visit, this property appeared to be in good maintenance. This property was a comic book store with other similar cartoon memorabilia. Access was limited as the space was generally small and the store was densely packed with books; however, no notable observations were made. The current site operations are not expected to contribute to an APEC to the Phase One Property.
233 Armstrong Street (the Site)	The Barking Barber Unit 233B	During the site visit, this property appeared to be in good maintenance. This property is a pet groomer for small animals, namely dogs. No floor drains were observed at the site; however, one sump was noted near the centre of the store. The store manager on site was unsure if the sump was for sanitary or storm services; however, based on visual inspection it appeared to have been for combined storm/sanitary sewage. Two hot water tanks were observed, both appeared to be in good maintenance. Several 1 gallon bottles of shampoos (for dogs) were observed around the store, in good maintenance with no visible spills or staining. The current site operations are not expected to contribute to an APEC to the Phase One Property.
233 Armstrong Street (the Site)	Inner Designs	During the site visit, this property appeared to be in good maintenance. This property is an interior design showroom and storage site. Floor drains were noted in the small basement space below the shop; however, only a hot water tank was observed in the basement area and the staff on site were unaware of any spills at the site. The site served as a showroom and storage space for some hardwood, tile, and ceramic materials for residential properties. The current site operations are not expected to contribute to an APEC to the Phase One Property.



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
5 Site Reconnaissance
February 7, 2025

Address	Occupant/Unit	Summary
7 Hamilton Avenue North (the Site)	Full Cycles	During the site visit, this property appeared to be in good maintenance. This property is a bicycle sale, repair, and maintenance shop. Small volumes of household cleaning products were observed and small volumes of suspension fluids were noted as being used during bicycle repair and maintenance. The staff on site indicated that suspension fluid is jarred and disposed off-site, and no spills were known to have recently occurred on the site. Bike frames, tires, and other parts are disposed of on the corner of the sidewalk for pick up by the City of Ottawa. The current site operations are not expected to contribute to an APEC to the Phase One Property.
5 Hamilton Avenue North (the Site)	Mino'Weesini	During the site visit, this part of the site appeared to be in good maintenance and operated as a food bank. Some small volumes of cooking oils, paints, and household cleaning products were observed to be stored for usage at the property. The employees indicated that oils are not used at the property, instead they are collected, stored and donated. The employees were not aware of any oil or paint spills. The property included one floor of space. Two floor drains were observed at the property, and one monitoring well was observed. The current site operations are not expected to contribute to an APEC to the Phase One Property.
3 Hamilton Avenue North (the Site)	Railbender Tattoo Shades & Art Gallery	During the site visit, this part of the Site appeared to be in good maintenance and operated as a tattoo parlour. Small volumes of household cleaning products used during tattooing were observed and employees indicated that cleaning supplies were disposed of down the drain or disposed of at nearby pharmacies along with needles and other tattooing supplies rather than being disposed of in the garbage on site. One soil vapour probe was observed under a table but was not accessed. The employees indicated the port was typically accessed once or twice a year. The property included one floor of space. The current site operations are not expected to contribute to an APEC to the Phase One Property.



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
5 Site Reconnaissance
February 7, 2025

Address	Occupant/Unit	Summary
	The remainder of the Phase One Property	The remainder of the Phase One Property that was not occupied by buildings was noted as being a paved area with parked vehicles, and a courtyard area. During the site visit, at least 26 monitoring wells were observed on the Phase One Property, and several more in the rights of way surrounding the Block. Ten monitoring wells and one observation well were noted in the paved parking lot area near the centre of the Property; however, it should be noted that observation of additional wells or vapour probes may have been obstructed by vehicles, rainwater and snowmelt was puddled into localized depressions, and snow was still present on the Site. No access was provided to the courtyard area and the view of this area was generally obstructed by parked cars in front of the fence leading to the courtyard area. The Phase One Study Area was generally observed during the site reconnaissance. The surrounding Study Area was comprised mostly of residential homes (single unit and multi-level apartments), parking lots, rights of way, a community park, and small businesses/local retailers; however, some notable observations include: A fill and vent pipe was observed at the southern entrance to the apartment building at 320 Parkdale Avenue, adjacent to the north of the Phase One Property. A fuel oil leak of unknown quantity was listed in the ERIS report in 2016 at this property. This spill and the presence of at least one UST near the Site is considered to be a PCA contributing to an APEC at the Phase One Property (APEC 2). A Petro-Canada gas station was observed at 390 Parkdale Avenue approximately 110 m from the Site. As noted in Table 5, above several USTs were listed at the gas station. Based on the proximity to the Site, this property is considered to be a PCA contributing to an APEC at the Phase One Property (APEC 1e). Grant's Street Garage located at 1 Grant Street approximately 180 m east of the Site, and Bourk's Car Care located at 24 Hamilton Avenue North, approximately 120 m south of the Site were observed during the site reconnaissance. Both automobile garages appeared to be in good maintenance and no significant environmental concerns were observed. Although these two properties are PCAs, due to the distance to the Site, it is not expected that the volumes of fuel normally observed at local garages would be of environmental impact to the Site. Therefore, this PCA is not considered to contribute to an APEC to the Phase One Property.



5.4 Written Description of Investigation

The site reconnaissance was conducted on March 17, 2023, between 8:30AM and 1:00PM. The Site and readily visible with exception of some partly snow and rain covered portions, and publicly accessible portions of adjoining and neighbouring properties were observed for the presence of potential sources of environmental contamination. Numerous monitoring wells and at least one observation well, and one soil-vapour port were observed on the Phase One Property or the properties within the Phase One Study Area at the time of the Site reconnaissance. Based on the proximity to the Site and the inferred groundwater flow direction to the Site, the following PCAs were identified as contributing to an APEC to the Site:

- A historical mill, lumber yard, and dry kiln located at several properties at the block directly south of the Phase One Property;
- A historical foundry and several other metal fabrication-related workshops located at the block of properties directly northwest of the Phase One Property;
- A historical foundry located at the block directly west of the Phase One Property;
- The former manufacturing and maintenance of aviation, aerospace, defense, and other electronic equipment at 3 Hamilton Avenue North and 340 Parkdale Avenue (the Site);
- Former shoe manufacturing at 3 Hamilton Avenue North (the Site);
- A gas station with at least three USTs operating at 390 Parkdale Avenue as well as a gasoline spill of unknown quantity in 2005 (approximately 110 m south of the Phase One Property).
- A former gas station with at least two USTs previously operating at 1186 Wellington Street West as well as a 3000 L furnace oil spill in 1992, and another gasoline spill to soil of unknown quantity in 1993 (approximately 160 m south of the Phase One Property);
- A commercial autobody shop registered for the fuel and oil related waste generation at 16 Hamilton Avenue (approximately 90 m south of the Phase One Property);
- A UST and associated fuel leak of unknown quantity in 2016 at the apartment building directly north of the Phase One Property located at 320 Parkdale Avenue;
- A gasoline spill of unknown quantity in 1988 located at 383 Parkdale Avenue (approximately 80 m southeast of the Phase One Property);
- A 5,000 L fuel tank formerly located at 1175 Wellington Street West (approximately 100 m south of the Phase One Property);
- The importation of fill material of unknown quality at the Site and surrounding rights-of-way
- Exposed subsurface in the basement of 340 Parkdale Avenue (the Site) where potentially contaminating wastes have been stockpiled with no impermeable floor between the building and the underlying subsurface (APEC 7).
- Historical use of salt for de-icing purposes on the courtyard areas of the Phase One Property and on off-Site sidewalks and roadways (APEC 8).



No other PCAs contributing to an APEC were identified on the Site or within the Phase One Study Area. Findings of the site reconnaissance of the Phase One Property and the Phase One Study Area are presented in **Section 6.0**.

Section 4.0 presents the findings of the records review for the Phase One Property and **Section 5.0** presents the findings of the interviews with the site contacts, where applicable. No additional investigations were undertaken during the Phase One ESA to assess potential environmental concerns noted or identified during the site reconnaissance or records review. A summary of the relevant findings to the existence of APECs at the Phase One Property is provided below in **Section 7.0**.



6 Review and Evaluation of Information

6.1 Current and Past Uses of The Phase One Property

Based on the scope of the Phase One ESA, formal land registry searches were not completed to identify historical ownership information for the Phase One Property. Current and past uses have been identified through other sources as described below.

Based on information collected during the Phase One ESA, 3 Hamilton Avenue North (the northern half of the Phase One Property) was first developed in the early 1940s for industrial use which converted to commercial uses in 2000; 233 Armstrong Street (the southwest portion of the Phase One Property) was first developed for residential use between 1928 and 1932 and was converted to various commercial uses in the early 1940s; 229 and 223 Armstrong Street (the southeast portion of the Phase One Property) were first developed for residential use prior to 1932 and were converted to commercial uses in the 1940s and 1930s, respectively, as noted in **Table 8** below. Current land use is commercial/residential.

Table 8 One Study Area Information

Year	Name of Owner	Description of Property Use(s)	Property Use(s) (per regulatory types)	Other Observations from Aerial Photographs, Fire Insurance Plans, etc.
3 Hamilton North (PIN 04035 – 0144)				
Historical Property Use				
1895 - 1938	Ottawa Land Association	Undeveloped	Agricultural or other use	Based on a review of the 1932 aerial photo, the northern 3 Hamilton Ave. N. parcel of the Site appears undeveloped.
1938 – 1940	Shirley Woods, Duncan MacTavish, Frederick Runge, Robert Brown	Undeveloped	Agricultural or other use	
1940 - 1951	Ontario Hughes Owens Company Ltd.	Manufacturing	Industrial	3 Hamilton Ave. N. was first listed in Ottawa city directories as 'Ontario Hughes Owen Co.' (manufacturer of scientific instruments) from 1945 to 1950 and as 'Sperry Gyroscope' from 1955 to 1984. Based on a review of the 1946 aerial photo, the Site appears developed in a similar configuration to the present.
1951 - 1970	Sperry Gyroscope Co. of Canada Ltd.	Manufacturing	Industrial	
1970 - 1987	Sperry Rand Canada Limited	Manufacturing	Industrial	



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
6 Review and Evaluation of Information
February 7, 2025

Year	Name of Owner	Description of Property Use(s)	Property Use(s) (per regulatory types)	Other Observations from Aerial Photographs, Fire Insurance Plans, etc.
1987 - 2000	Honeywell Limited	Manufacturing	Industrial	3 Hamilton Ave. N. was listed in Ottawa city directories as 'Honeywell Ltd.' from 1988 to 2000.
2000 – 2006	Spencedale Properties Limited and Markton Properties Limited	Various commercial tenants	Commercial	N/A
2006 - 2011	Joanne Edwards	Various commercial tenants	Commercial	N/A
2011 - 2016	2018298 Ontario Inc., Nellco Inc., Marcel Delattre, Joelle Delattre	Various commercial tenants	Commercial	3 Hamilton Ave. N. was listed in the Ottawa city directories as 'JD Upholstery' from 2012 to 2017.
2016 - 2022	B&M Handelman Investments Ltd., 5K Investments Inc., Diane Grafstein, Ronald Pollock, Judy Pollock, Marvin Teperman, Bamburgh Holdings Ltd., Celmar Investments Corp., Yerusha Investments Inc., C.S. Eisenstat Associates Inc, National Tire Sales and Service (2011) Ltd., 4055845 Canada Inc., Beverly Gordon, Southern Atlantic Service (Ontario) Ltd., 1886404 Ontario Inc., Amanda Salem, 673830 Ontario Limited, The Bank of Nova Scotia Trust Company, 593651 Ontario Ltd., 2227046 Ontario Limited	Various commercial tenants	Commercial	3 Hamilton Ave. N. was listed in the Ottawa city directories as 'Railbender Tattoo Studio' in 2021.



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
6 Review and Evaluation of Information
February 7, 2025

Year	Name of Owner	Description of Property Use(s)	Property Use(s) (per regulatory types)	Other Observations from Aerial Photographs, Fire Insurance Plans, etc.
Current Property Use				
2022- Present	100147699 Ontario Inc.	Various commercial tenants	Commercial	3 Hamilton Ave. is currently occupied by commercial tenants including 'Parkdale Mini Storage', 'Jack's Upholstery', 'Crossfit Hintonburg' and 'DripHouse Café'
233 Armstrong Street (PIN 04035 – 0145)				
Historical Property Use				
1895 - 1938	Ottawa Land Association	Undeveloped	Agricultural or other use	233 Armstrong Street appears to be undeveloped on the 1928 aerial photo. 233 Armstrong St. was first listed in the Ottawa city directories as 'vacant' in 1934 and as 'single tenant residential' in 1940.
1938 - 1961	Robert Brown	Various commercial tenants	Commercial	A residential home is visible on the east boundary of the 233 Armstrong St. parcel on the 1932 aerial photo. 233 Armstrong St. was listed in Ottawa city directories as 'Stubby Beverages' from 1945 to 1950, as 'Ottawa Shoe Co. Ltd.' in 1955 and as 'Henderson Furniture Repair' in 1960. Based on a review of the 1946 aerial photo, the Site appears developed in a similar configuration to the present.
1961 - 1996	June Davidson Lacharity	Various commercial tenants	Commercial	233 Armstrong St. was listed in Ottawa city directories as various commercial tenants between 1966 and 1994 including 'Beautician's Supply', 'Renold Canada', 'Presently Engineering Products', 'Billy's Appliance Sales & Service', 'Add Electronics'
1996 - 2006	Earl Gary Lacharity	Various commercial tenants	Commercial	233 Armstrong St. was listed in Ottawa city directories as 'Add



**Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue,
Parkdale Avenue, Armstrong Street, Ottawa, Ontario**

6 Review and Evaluation of Information

February 7, 2025

Year	Name of Owner	Description of Property Use(s)	Property Use(s) (per regulatory types)	Other Observations from Aerial Photographs, Fire Insurance Plans, etc.
2006 - 2006	Strongton Holdings Limited	Various commercial tenants	Commercial	Electronics Inc.' from 2000 to 2012.
2006 - 2008	Markton Properties Limited	Various commercial tenants	Commercial	
2008 - 2011	C.A Bancorp G.P. Inc., and C.A.B. Realty Finance L.P.	Various commercial tenants	Commercial	
2011 - 2011	2018298 Ontario Inc. Nellco Inc., Marcel Delattre, and Joelle Delattre	Various commercial tenants	Commercial	
2011 - 2014	Spencedale Properties Limited and Markton Properties Limited	Various commercial tenants	Commercial	



**Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue,
Parkdale Avenue, Armstrong Street, Ottawa, Ontario**

6 Review and Evaluation of Information

February 7, 2025

Year	Name of Owner	Description of Property Use(s)	Property Use(s) (per regulatory types)	Other Observations from Aerial Photographs, Fire Insurance Plans, etc.
2014 - 2021	B&M Handelman Investments Ltd., 5K Investments Inc., Diane Grafstein, Ronald Pollock, Judy Pollock, Marvin Teperman, Bamburgh Holdings Ltd., Celmar Investments Corp., Yerusha Investments Inc., C.S. Eisenstat Associates Inc, National Tire Sales and Service (2011) Ltd., 4055845 Canada Inc., Beverly Gordon, Southern Atlantic Service (Ontario) Ltd., 1886404 Ontario Inc., Amanda Salem, 673830 Ontario Limited, The Bank of Nova Scotia Trust Company, 593651 Ontario Ltd., 2227046 Ontario Limited	Various commercial tenants	Commercial	233 Armstrong St. was listed in Ottawa city directories as 'Fore Sports Plus' from 2017 to 2021.
Current Property Use				
2021 – Present	1000147699 Ontario Inc.	Commercial	Commercial	233 Armstrong St. was listed in Ottawa city directories as 'Fore Sports Plus' from 2017 to 2021.



**Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue,
Parkdale Avenue, Armstrong Street, Ottawa, Ontario**
6 Review and Evaluation of Information
February 7, 2025

Year	Name of Owner	Description of Property Use(s)	Property Use(s) (per regulatory types)	Other Observations from Aerial Photographs, Fire Insurance Plans, etc.
229 Armstrong Street (PIN 04035 – 0146)				
Historical Property Use				
Patent – 1940s	Unknown	Residential	Residential	229 Armstrong St. was first listed in Ottawa city directories as 'single tenant residential' in 1929 until 1945. Based on a review of the 1932 aerial photo, the southeast 229 Armstrong St. parcel appears developed with a small building attached to the tavern building at 223 Armstrong St. Based on a review of the 1946 aerial photo, the Site appears developed in a similar configuration to the present.
1940s - 1975	Unknown	Restaurant	Commercial	229 Armstrong St. was listed in Ottawa city directories as 'Carleton Sweets' in 1950 and as 'Carleton Steak House' from 1955 to 2012.
1975 - 1980	Touffic Saikaley and Linda Saikaley	Commercial	Commercial	N/A
1980 – 2022	Carleton Tavern (Ottawa) Limited	Tavern, Art gallery	Commercial	229 Armstrong St. was listed in Ottawa city directories as 'Parkdale Gallery' in 2021.
Current Property Use				
2022-Present	100165951 Ontario Inc.	Commercial	Commercial	229 Armstrong Street is currently occupied by the Morning Owl Café.



Year	Name of Owner	Description of Property Use(s)	Property Use(s) (per regulatory types)	Other Observations from Aerial Photographs, Fire Insurance Plans, etc.
223 Armstrong Street (PIN 04035 – 0147)				
Historical Property Use				
Patent – 1930	Unknown	Residential	Residential	223 Armstrong St. was first listed in Ottawa city directories as 'vacant' in 1920 and as 'single tenant residential' from 1924 to 1934. Based on a review of the 1928 aerial photo, the Carleton Tavern building is visible at 223 Armstrong St. in a similar configuration to the present.
1930 - 1974	Carleton Tavern	Restaurant	Commercial	223 Armstrong St. was listed in Ottawa city directories as 'Carleton Hotel/House/Tavern' from 1940 to 2021. Based on a review of the 1946 aerial photo, the Site appears developed in a similar configuration to the present.
Current Property Use				
1974 – Present	Carleton Tavern (Ottawa) Limited	Commercial	Commercial	223 Armstrong St. was listed in Ottawa city directories as 'Carleton Tavern' in 2021.

6.2 Potentially Contaminating Activities (PCA)

The following PCAs, as defined in O.Reg.153/04, were identified to have been present currently or historically on the Phase One Property or within the Phase One Study Area and were considered to be environmentally relevant to the Phase One Property. The PCA numbering, where applicable, is consistent with the Table 2, Schedule D. in O.Reg.153/04.

As discussed in previous sections of this report, Stantec has identified 13 groupings of PCAs that have contributed to APECs at the Site. For the purpose of this investigation, the PCAs have been grouped by the property on which they are located, **Table 9** summarizes these PCAs.



Table 9 Potentially Contaminating Activities

#	O.Reg 153/04 PCA number	Location	Description
1	No PCA number; however, it is the opinion of the QP _{ESA} that this is a PCA, and confirmed impacts have been previously observed	On-site	The review of previous reports indicated that PCE may have been used by the Ottawa Shoe Manufacturing Company at 233 Armstrong Avenue during leather preparation as part of shoe fabrication.
2	No PCA number; however, it is the opinion of the QP _{ESA} that this is a PCA, and confirmed impacts have been previously observed	On-site	A review of previous reports indicated various impacts of PCE, TCE, DCE, vinyl chloride and petroleum hydrocarbon impacts in soil and groundwater around the Site.
3	Waste generation of various types including fuel related waste and chlorinated solvents Vehicles and Associated Parts Manufacturing (PCA 57)	On-site	Honeywell Aerospace, Sperry Gyroscope and/or Sperry Aerospace were noted as having operated at 3 Hamilton Avenue North between 1955 to 2021. During this time wastes related to fuel and chlorinated solvents were registered as they related to operations or aerospace and aviation equipment.
4	Importation of Fill Material of Unknown Quality (PCA 30)	On-site	It is likely that fill material has been imported to site for the construction of the buildings on the Property and the rights of ways along the perimeter of the Site. Fill has been noted in previously drilled boreholes on the Property and in the Phase One Study Area.
5	No PCA number; however, it is the opinion of the QP _{ESA} that this is a PCA	On-site	Property maintenance debris (discarded PVC pipe, fluorescent bulbs) and domestic waste were observed in a pile in the basement of the property at 340 Parkdale Avenue (Photo 006). Waste materials further within the pile could not be safely characterized. The poor housekeeping in this area suggests a potential for adverse impacts to the Site.
6	Gasoline and Associated Products Storage in Fixed Tanks (PCA 28) Fuel related spill	Off-site	A former gas station with at least two USTs was present at 1186 Wellington Street West (160 m south of the Site) since at least 1956 as noted in the fire insurance plans, until the early 2000s. Furthermore, a 3000 L furnace oil spill was noted in 1992 with confirmed impacts to the soil and groundwater in the area, as well as a gasoline spill of unknown quantity in 1993
7	Metal Fabrication (PCA 34)	Off-site	Several metal-work operations including Beach Foundry Ltd. were located at the block of properties adjacent to the northwest of the Phase One Property, observed in the 1956 fire insurance plans.
8	Waste generation of various types including fuel related waste Commercial Autobody Shop (PCA 10)	Off-site	CAA North and East Ontario located 16 Hamilton Avenue North (90 m south of the Site) were registered for the generation of oil and fuel related wastes between 1999 to 2001.



#	O.Reg 153/04 PCA number	Location	Description
9	Gasoline and Associated Products Storage in Fixed Tanks (PCA 28) Fuel related spill	Off-site	A multi-unit apartment building located at 320 Parkdale Avenue (adjacent to the north of the Site) was noted as having a fuel leak of unknown quantity in 2016 during the filling of an underground storage tank. The fill and vent pipes were also observed during the site visit, confirming the presence of a tank.
10	Fuel related spill	Off-site	A gasoline spill of unknown quantity was recorded in 1988 at 383 Parkdale Avenue (approximately 80 m southeast of the Site).
11	Gasoline and Associated Products Storage in Fixed Tanks (PCA 28)	Off-site	A 5,000 L fuel tank which was delisted in 2012 was registered to 785730 Ontario Inc. in 1990 at 1175 Wellington Street West (100 m south of the Site).
12	No PCA number; however, it is the opinion of the QP _{ESA} that this is a PCA	Off-site	Several properties on the block adjacent to the south of the Phase One Property were associated with milling, the storage of lumber, and a dry kiln were observed in the 1902 fire insurance plans.
13	Gasoline and Associated Products Storage in Fixed Tanks (PCA 28) Fuel related spill	Off-site	A gas station with at least three USTs present at 390 Parkdale Avenue (110 m south of the Site) since at least 1956 as noted in the fire insurance plans. Furthermore, a spill of unknown quantity was noted in 2005 near the operating gas station.
14	Metal Fabrication (PCA 34)	Off-site	A brass foundry, Capital Wire and Cloth (previously Capital Wire and Clothing Manufacturing Co.) was observed at the block directly west of the Phase One Property in the 1932 aerial imagery.
15	Gasoline and Associated Products Storage in Fixed Tanks (PCA 28)	Off-site	A UST was noted in the 1922 fire insurance plans at the block of properties west of the Phase One Property.
16	Gasoline and Associated Products Storage in Fixed Tanks (PCA 28)	On-site	Two 500 L fuel oil ASTs were reported to be previously located in the northeast corner of the Carleton Tavern basement. The ASTs were removed from the Site in 2019.
17	No PCA number; however, it is the opinion of the QP _{ESA} that this is a PCA	On-Site	Central and south-central portions of the Site (outside the building footprints), as well as off-Site sidewalks and roadways, have been used in part for paved parking and pathway areas which may have been impacted by historical application of de-icing compounds for winter safety.

6.3 Areas of Potential Environmental Concern (APEC)

APECs identified on the Phase One Property based on the presence of PCAs (see **Table 9**) are summarized in **Table 10**. PCAs were considered likely to contribute to APECs based on distance from and/or direction in relation to the Phase One Property. **Table 9** also presents the contaminants of potential concern (COPCs) associated with the PCAs, the media of concern, and a brief description of each of the APECs.



The Phase One ESA research has identified 17 APECs at the Site.

Table 10 briefly summarizes the APECs and associated PCAs at the Site.

Table 10 Areas of Potential Environmental Concern

APEC	Location of APEC on Phase One Property	PCA	Location of PCA (on-site or off-site)	Contaminants of Potential Concern¹	Media Potentially Impacted (Ground water, soil and/or sediment)
1a	Southern portion of Phase One Property	<i>PCA No. 6</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg. 153/04 PCA 28) and a fuel related spills	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
1b	Southwest portion of Phase One Property	<i>PCA No. 8</i> Commercial Autobody Shop (O.Reg. 153/04 PCA 10) and waste generation of various types including fuel related waste	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
1c	Southeast portion of Phase One Property	<i>PCA No. 11</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg. 153/04 PCA 28)	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
1d	South portion of Phase One Property	<i>PCA No. 12</i> Mill, lumber yard, and dry kiln (O.Reg. 153/04 PCA Undefined)	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
1e	Southeast portion of Phase One Property	<i>PCA No. 13</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg.153/04 PCA 28) Fuel related spill	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario
6 Review and Evaluation of Information
February 7, 2025

APEC	Location of APEC on Phase One Property	PCA	Location of PCA (on-site or off-site)	Contaminants of Potential Concern¹	Media Potentially Impacted (Ground water, soil and/or sediment)
2	Northern portion of Phase One Property	<i>PCA No. 9</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg. 153/04 PCA 28) and a fuel related spill	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
3a	Southwestern portion of Phase One Property	<i>PCA No. 1</i> 1: Potential PCE usage during leather preparation (O.Reg.153/04 PCA Undefined)	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
3b	West portion of Phase One Property	<i>PCA No. 14</i> Metal Fabrication (O.Reg 153/04 PCA 34)	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
3c	West portion of Phase One Property	<i>PCA No. 15</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg. 153/04 PCA 28)	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil and groundwater
4a	North portion of Phase One Property	<i>PCA No. 3</i> Vehicles and Associated Parts Manufacturing (O.Reg. 153/04 PCA 57) and waste generation of various types including fuel related waste and chlorinated solvents	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil Ground water
4b	Northwest portion of Phase One Property	<i>PCA No. 7</i> Metal Fabrication (O.Reg. 153/04 PCA 34)	Off-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil Ground water



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario

6 Review and Evaluation of Information

February 7, 2025

APEC	Location of APEC on Phase One Property	PCA	Location of PCA (on-site or off-site)	Contaminants of Potential Concern¹	Media Potentially Impacted (Ground water, soil and/or sediment)
5a	Southeastern portion of Phase One Property	<i>PCA No. 10</i> Fuel related spill	Off-Site	• BTEX • PHCs • Metals • PAHs • VOCs	Soil Ground water
5b	Southeastern portion of One Property	<i>PCA No. 16</i> Gasoline and Associated Products Storage in Fixed Tanks (O.Reg. 153/04 PCA 28)	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil Ground water
6a	Entire Phase One Property	<i>PCA No. 2</i> 2: Confirmed PCE, TCE, DCE, vinyl chloride and hydrocarbon impacts	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil Ground water
6b	Entire Phase One Property	<i>PCA No. 4</i> 4: Importation of Fill Material of Unknown Quality (O.Reg. 153/04 PCA 30)	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil
7	Northeast portion of the Site	<i>PCA No. 5</i> Poorly managed waste in basement directly overlying eroded building foundation (O.Reg.153/04 PCA Undefined)	On-Site	• PAHs • VOCs • BTEX • PHCs • Metals	Soil Ground water
8	Central and south-central (exterior) portions of Phase One Property. Off-site sidewalks and roadways	<i>PCA No. 17</i> Historical application of de-icing compounds (O.Reg.153/04 PCA Undefined)	On-Site Off-Site	• EC, SAR • Sodium, chloride	Soil Ground water

¹ Contaminants include petroleum hydrocarbons (PHCs), volatile organic compounds (VOCs), benzene, toluene, ethylbenzene, and xylenes (BTEX), polycyclic aromatic hydrocarbons (PAHs), electrical conductivity (EC), Sodium Adsorption Ratio (SAR), metals (includes 19 metals parameters including hydride-forming metals, but does not include Chromium VI as no evidence of leather tanning in historical records).



6.4 Phase One Conceptual Site Model

In developing the Conceptual Site Model for the Phase One Property and Phase One Study Area, the following physical characteristics/pathways described in **Table 11** were evaluated to assess whether PCAs have contributed to an APEC at the Phase One Property:

Table 11 Conceptual Site Model

Physical Characteristics/ Pathways	Description
Subsurface Soils	Based on information obtained from the Ontario Geological Survey Map titled Surficial Geology of Southern Ontario, the surficial geology in the vicinity of the Phase One Property generally consists of stone-poor, sandy silt to silty sand-textured till on Paleozoic terrain. According to previous assessments of the Site, surficial soils are only present to approximately 1.75 m bgs, overlying a shallow bedrock in the area.
Bedrock	Based on information obtained from MNR Ontario Geological Survey Map 2544, titled Bedrock Geology of Ontario, Southern Sheet, bedrock in the vicinity of the Site is reported to consisted of limestone, dolostone, shale, arkose, and sandstone of the Ottawa Group and Simcoe Group, Shadow Lake Formation. The depth to bedrock was not indicated on the map; however, according to previous assessments of the Site and the Phase One Study Area, bedrock was encountered at depths as shallow as 0.81 m bgs.
Inferred Ground Water Flow Direction	Based on information accessed from the MNR online mapping, regional surface drainage (and anticipated shallow ground water flow direction) is expected to flow to the north toward the Ottawa River approximately 1 km from the Phase One Property. It should be noted the elevation of the local ground water table can generally mimic the local topography and may not reflect the regional trend in drainage. The local shallow ground water flow pattern can also be influenced by nearby subsurface structures, such as building foundations, weeping tiles and utility trenches. According to the Phase II ESA completed by Paterson in 2011, groundwater in the lower bedrock unit was determined to be flowing to the northeast; however, according two semi-annual groundwater monitoring events by Golder in 2018 (April and September 2018), groundwater flow was variable towards the west, north, and east. Groundwater flow in the deep bedrock was also noted as being towards the south due to the southerly dipping bedrock. Stormwater collected on the Site is anticipated to drain by infiltration or overland flow to nearby catch basins or roadways.
Underground Utilities	Given the current operations on the Site and surrounding Study Area and evidence provided by GeoOttawa, the Phase One Property is serviced and underground utility can be observed surrounding the Phase One Property and likely under the Property. Sanitary and storm manholes, catch basins, and fire hydrants were observed along the streets bounding the Block.



The following items were deemed to be not present at the Phase One Property:

1. water bodies located in whole or in part on the Phase One Study Area;
2. ANSIs located in whole or part on the Phase One Study Area and;
3. drinking water wells.

Discussion of Uncertainty or Absence of Information

As indicated in Section 5.0, no representatives knowledgeable of the Site were provided to Stantec for an interview.

However, the past use of the Phase One Property is well understood based on historical information sources obtained and reviewed during the Phase One ESA.

The physical characteristics of the land area comprising the Site are inferred from the available historical information sources referenced herein. The presence of any associated subsurface structures and/or utilities, as well as the geological faults identified in the Semi-Annual Groundwater Monitoring reports prepare by Golder in 2018 may influence contaminant migration pathways within the Phase One Property.

As indicated in Section 4.2.6., a response from the MECP has been received indicating that approximately 6,500 hardcopy pages had been located and were available for purchase. Stantec has purchased the information and it was received from the MECP on February 13, 2024. A total of 20,403 pages of records were provided and reviewed. Generally, the results were consistent with information that was previously provided to Taggart. Further, considering the historical data there was no new information presented that would warrant additional environmental assessment or change the recommendation for a Phase Two ESA.

As indicated in Section 6.1, some areas of the Phase One Property and the surrounding Study Area were partially covered by snow and/or rainwater and may have obstructed the view of some surface features.

No other potential uncertainties or missing information were encountered during completion of the Phase One ESA.

The figures include features and details in relation to the Phase One Study Area and the Phase One Property. In general, the figures illustrate the following where applicable: road names and existing buildings and structures, water bodies, location of areas of natural significance (if present), presence of drinking water wells at the Phase One Property (if present), property usage types on adjoining properties, APECs, locations and types of known tanks (if present), general inferred direction of ground water flow in the vicinity of the Phase One Property, and the approximate locations of underground utilities or structures, if known.



7 Conclusions

7.1 Whether Phase Two Environmental Site Assessment required before Record of Site Condition submitted

As APECs were identified associated with the Phase One Property based on review of the city directories, aerial photographs, chains of title, other historical records and observations made during the site reconnaissance, a Phase Two ESA is required before an RSC can be submitted.

Prior to filing an RSC, the maximum soil and ground water concentrations of contaminants of concern must either meet the applicable MECP generic standards, or alternatively, property specific standards generated specifically for the Phase One Property.

7.2 Record of Site Condition based on Phase One Environmental Site Assessment alone

An RSC cannot be filed based solely on the findings of this Phase One ESA.

7.3 Signatures

The site reconnaissance and the preparation of this report was completed by Romeet Gonsalves, B.Sc., G.I.T. Quality review was completed by Jill Peters-Dechman, P.Eng., QP_{ESA}. The tasks completed for the Phase One ESA were also overseen by Jill Peters-Dechman. Credentials of the project team members are provided in **Appendix D**.

The objectives and requirements set out in O.Reg.153/04 for a Phase One Environmental Site Assessment were applied in carrying out the environmental site assessment and preparing this report.

7.4 Closure

This report documents work that was performed in accordance with generally accepted professional standards at the time and location in which the services were provided. No other representations, warranties or guarantees are made concerning the accuracy or completeness of the data or conclusions contained within this report, including no assurance that this work has uncovered all potential liabilities associated with the identified property.

This report provides an evaluation of selected environmental conditions associated with the identified portion of the property that was assessed at the time the work was conducted and is based on information obtained by and/or provided to Stantec at that time. There are no assurances regarding the accuracy and completeness of this information. All information received from the client or third parties in



7 Conclusions

February 7, 2025

the preparation of this report has been assumed by Stantec to be correct. Stantec assumes no responsibility for any deficiency or inaccuracy in information received from others.

The opinions in this report can only be relied upon as they relate to the condition of the portion of the identified property that was assessed at the time the work was conducted. Activities at the property subsequent to Stantec's assessment may have significantly altered the property's condition. Stantec cannot comment on other areas of the property that were not assessed.

Conclusions made within this report consist of Stantec's professional opinion as of the time of the writing of this report and are based solely on the scope of work described in the report, the limited data available and the results of the work. They are not a certification of the property's environmental condition. This report should not be construed as legal advice.

This report has been prepared for the exclusive use of the client identified herein and any use by any third party is prohibited. Stantec assumes no responsibility for losses, damages, liabilities or claims, howsoever arising, from third party use of this report.

The locations of any utilities, buildings and structures, and property boundaries illustrated in or described within this report, if any, including pole lines, conduits, water mains, sewers and other surface or sub-surface utilities and structures are not guaranteed. If future work is planned, the exact location of all such utilities and structures should be confirmed and Stantec assumes no liability for damage to them.

The conclusions are based on the site conditions encountered by Stantec at the time the work was performed at the specific testing and/or sampling locations, and conditions may vary among sampling locations. Factors such as areas of potential concern identified in previous studies, site conditions (e.g., utilities) and cost may have constrained the sampling locations used in this assessment.

In addition, analysis has been carried out for only a limited number of chemical parameters, and it should not be inferred that other chemical species are not present. Due to the nature of the investigation and the limited data available, Stantec does not warrant against undiscovered environmental liabilities nor that the sampling results are indicative of the condition of the entire site.

As the purpose of this report is to identify site conditions which may pose an environmental risk, the identification of non-environmental risks to structures or people on the site is beyond the scope of this assessment.

Should additional information become available which differs significantly from our understanding of conditions presented in this report, Stantec specifically disclaims any responsibility to update the conclusions in this report.

The site reconnaissance and the preparation of this report was completed by Romeet Gonsalves, B.Sc., G.I.T., and the senior technical review was conducted by Jill Peters-Dechman, P.Eng., QP_{ESA}. Credentials of the project team members are provided in **Appendix D**.



8 References

Information sources obtained and reviewed as part of the records review are listed in **Table 12** below.

Table 12 **References**

Reference Type/Source	Information/Documents Obtained
Aerial Photographs	- ERIS: 1932, 1946, 1981, and 2021 - GeoOttawa (online): 1928, 1958, 1965, 1976, 1991, 1999, 2002, 2005, 2007, 2008, 2011, 2014, 2015, 2017, 2019, and 2021
Fire Insurance Plans	- Ottawa Fire Insurance Plans, Carleton University e-Library, (1902 revised 1912), https://library.carleton.ca/find/gis/geospatial-data/georeferenced-ottawa-fire-insurance-plans. Accessed: March 13, 2023 - Stantec In-house Fire Insurance Plans: 1956: Ottawa Volume 2, Sheet 311-1, 311-2, 313-1, 314, 313-2
Environmental Reports	"Analysis of Sources of Chlorinated Solvents at 223 Armstrong Street, 233 Armstrong Street and 3 Hamilton Avenue North, Ottawa, Ontario", dated August 2005, prepared for Honeywell, by Golder. "Remedial Action Plan, Migration Control – For Perimeter Shallow Groundwater Control System, 3 Hamilton Avenue North, Ottawa, Ontario", dated August 2005, prepared for Honeywell, by Golder. "MECP correspondence with Golder in response to the Analysis of Sources of Chlorinated Solvents and the Remedial Action Plan for 223 Armstrong Street, 233 Armstrong Street and 3 Hamilton Avenue North, Ottawa, Ontario", dated October 13, 2005, prepared for Golder, by MECP. "Phase I – Environmental Site Assessment, Proposed Multi-Storey Building, 233 Armstrong Street, and 3 Hamilton Avenue North, Ottawa, Ontario", dated October 21, 2011, prepared for Tega Developments, by Paterson. "Phase II – Environmental Site Assessment, Proposed Multi-Storey Building, 233 Armstrong Street, and 3 Hamilton Avenue North, Ottawa, Ontario", dated December 1, 2011, prepared for Tega Developments, by Paterson. "Report review, 3 Hamilton Avenue North and 233 Armstrong Street, Ottawa, Ontario", dated September 12, 2011, prepared for Business Development Bank of Canada, by Pinchin. "Memorandum - Environmental Remedial Action Plan, Proposed Residential Building, 233 Armstrong Street and 3 Hamilton Avenue – Ottawa", dated December 20, 2012, prepared for Tega Developments, by Paterson. "2018-2019 Soil Vapour Sampling and Risk Assessment, 3 Hamilton Avenue North, Ottawa, Ontario", dated March 2020, prepared for Honeywell, by Golder. "2022 Soil Vapour Sampling and Risk Assessment, 3 Hamilton Avenue North, Ottawa, Ontario", dated February 2023, prepared for Honeywell, by WSP.
Geotechnical Reports	None reviewed



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario

8 References

February 7, 2025

Reference Type/Source	Information/Documents Obtained
Company Records	No company records were provided to Stantec for review.
Reportable Spill Occurrences	ERIS – Ontario Spills
Contaminated Sites	"Inventory of Coal Gasification Plant Waste Sites in Ontario - Volume I and II" dated April 1987, prepared for the Ontario Ministry of the Environment. by Intera Technologies Ltd. "Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario" dated November 1988, prepared for the Ontario Ministry of the Environment by Intera Technologies Ltd. - ERIS – MECP Brownfields Environmental Site Registry
Hazardous Waste Generators	ERIS – Ontario Regulation 347 Waste Generators Summary
PCB Storage Sites	ERIS – National and Ontario PCB Inventories
Waste Disposal Sites	"Waste Disposal Site Inventory" dated June 1991, Ontario Ministry of the Environment Waste Management Branch - ERIS – Waste Disposal Sites - ERIS – Anderson's Waste Disposal Sites
Underground & Aboveground Storage Tanks	ERIS – Technical Standards and Safety Authority (TSSA) Fuel Storage Tank Databases
Water Well Records	ERIS – Water Well Information System
EcoLog ERIS	ERIS Report (250 m radius from Site), full database list at erisinfo.com
Topographic Maps	- Ontario Ministry of Natural Resources and Forestry (MNR) Make a Topographic Map online mapping tool, http://www.gisapplication.lrc.gov.on.ca/matm/Index.html?site=Make_A_Topographic_Map&viewer=MATM&locale=en-US. Accessed March 17, 2023. - Ontario Base Mapping (OBM) Data provided by EcoLog ERIS
Geologic Maps	- Quaternary Geology of Ontario, Southern Sheet; Ontario Geological Survey, Map 2556, 1991 - Ontario Geological Survey 1991. Bedrock Geology of Ontario, southern sheet; Ontario Geological Survey, Map 2544, Scale 1:1,000,000 - Holden, K.M., Thomas, J. and Karrow, P.F. 1992. Bedrock topography of the Markham area, southern Ontario; Ontario Geological Survey, Open File Map 196, scale 1:50 000.



Phase One Environmental Site Assessment: Proposed Development Hamilton Avenue, Spencer Avenue, Parkdale Avenue, Armstrong Street, Ottawa, Ontario

8 References

February 7, 2025

Reference Type/Source	Information/Documents Obtained
Areas of Natural Significance	• Ontario Ministry of Natural Resources and Forestry's (MNRF's) Natural Heritage online database accessed May 17, 2023 • Area of Natural & Scientific Interest (ANSI) provided by EcoLog ERIS • MECP Source Protection Information Atlas, https://www.lioapplications.lrc.gov.on.ca/SourceWaterProtection/index.html?viewer=SourceWaterProtection.SWPViewer&locale=en-CA. Accessed April 12, 2023.
Other Reports	• "Mapping and Assessment of Former Industrial Sites, City of Ottawa" dated 1988, prepared by Interra Technologies Limited.



Appendices



Appendix A Site Survey



TOPOGRAPHICAL PLAN OF

LOTS 1156, 1158, 1159, 1160, 1161,
1163 AND 1165
REGISTERED PLAN 157
CITY OF OTTAWA

Prepared by Annis, O'Sullivan, Vollebakk Ltd.

Scale 1:200

0 2.0 4.0 6.0 8.0 Metres

Metric

DISTANCES SHOWN ON THIS PLAN ARE IN METRES AND
CAN BE CONVERTED TO FEET BY DIVIDING BY 0.3048

Date 2/2/2011

Notes & Legend

Denotes	
—○—	Survey Monument Planted
—■—	Survey Monument Found
SIB	Standard Iron Bar
SSIB	Short Standard Iron Bar
IB	Iron Bar
IB*	Round Iron Bar
SSIB*	Short Standard Iron Bar
IB*	Iron Bar
(WIT)	Witness
(AOG)	Annis, O'Sullivan, Vollebakk Ltd.
—FH—	Fire Hydrant
—MH—	Maintenance Hole (Storm Sewer)
—MH—S	Maintenance Hole (Sanitary)
—MH—G	Maintenance Hole (Gas)
—MT—	Metal Lid
—VC—	Valve Chamber (Watermain)
—WV—	Water Valve
—ST—	Underground Storm Sewer
—S—	Underground Sanitary Sewer
—W—	Underground Water
—G—	Underground Gas
—OHW—	Overhead Wires
—B—	Telephone - Bell
—P—	Underground Hydro
—CB—	Catch Basin
—M—W	Monitoring Well
—GM—	Gas Meter
—B—	Bollard
—S—	Sign
—TEL—	Telephone Booth (Bell)
—CLF—	Chain Link Fence
—MF—	Metal Fence
—TL—	Traffic Light
—UP—	Utility Pole
—AN—	Anchor
—LS—	Light Standard
—Elev.	Location of Elevations
T/G	Top of Grate
C/L	Centreline
Inv.	Invert
	Property Line

Topographic data was collected under Winter Conditions.
Snow cover and ice preclude determining location and
elevation of some topographical data that is otherwise visible.

Convergence of 0°30'40" has been applied to bearing from a Plan by
(AOG) November 3, 2000 to account for different reference meridians.
Bearings shown hereon are grid bearings and are derived from
the westerly limit of Hamilton Avenue North shown to be
N23°34'30"E on a Plan by (B57) dated August 31, 1983 and are
referred to the Central Meridian of Zone 9 of the Ontario
Coordinate System, Longitude 76°30' West (MTM NAD-83).

BOUNDARY INFORMATION SHOWN HEREON HAS
BEEN COMPILED FROM FIELD SURVEY AND EXISTING
SURVEY RECORD.

SITE AREA = 2654 m²


ELEVATION NOTES

- Elevations shown are referred to geodetic datum.
- It is the responsibility of the user of this information to verify that the job benchmark
has not been altered or disturbed and that its relative elevation and description
agrees with the information shown on this drawing.

UTILITY NOTES



- This drawing cannot be accepted as acknowledging all of the utilities and it will
be the responsibility of the user to contact the respective utility authorities for
confirmation.
- Only visible surface utilities were located.
- A field location of underground plant by the pertinent utility authority is
mandatory before any work involving breaking ground, probing, excavating etc.
- Underground utility services and inverts are taken from City of Ottawa Engineering
Drawings E-07-14, E-07-10, 2333 sheet 5 of 6, 3094 sheet 4 of 7 and 2292 sheet
5 of 6.

ANNIS, O'SULLIVAN, VOLLEBEKK LTD.
14 Concourse Gate, Suite 500
Nepean, Ont. K2E 7S6
Phone: (613) 727-0850 / Fax: (613) 727-1079
Email: Annis@annissolvol.com
Job No. 11362-10 Top Developments Lot 1156-1165 M57 F1 A.M.

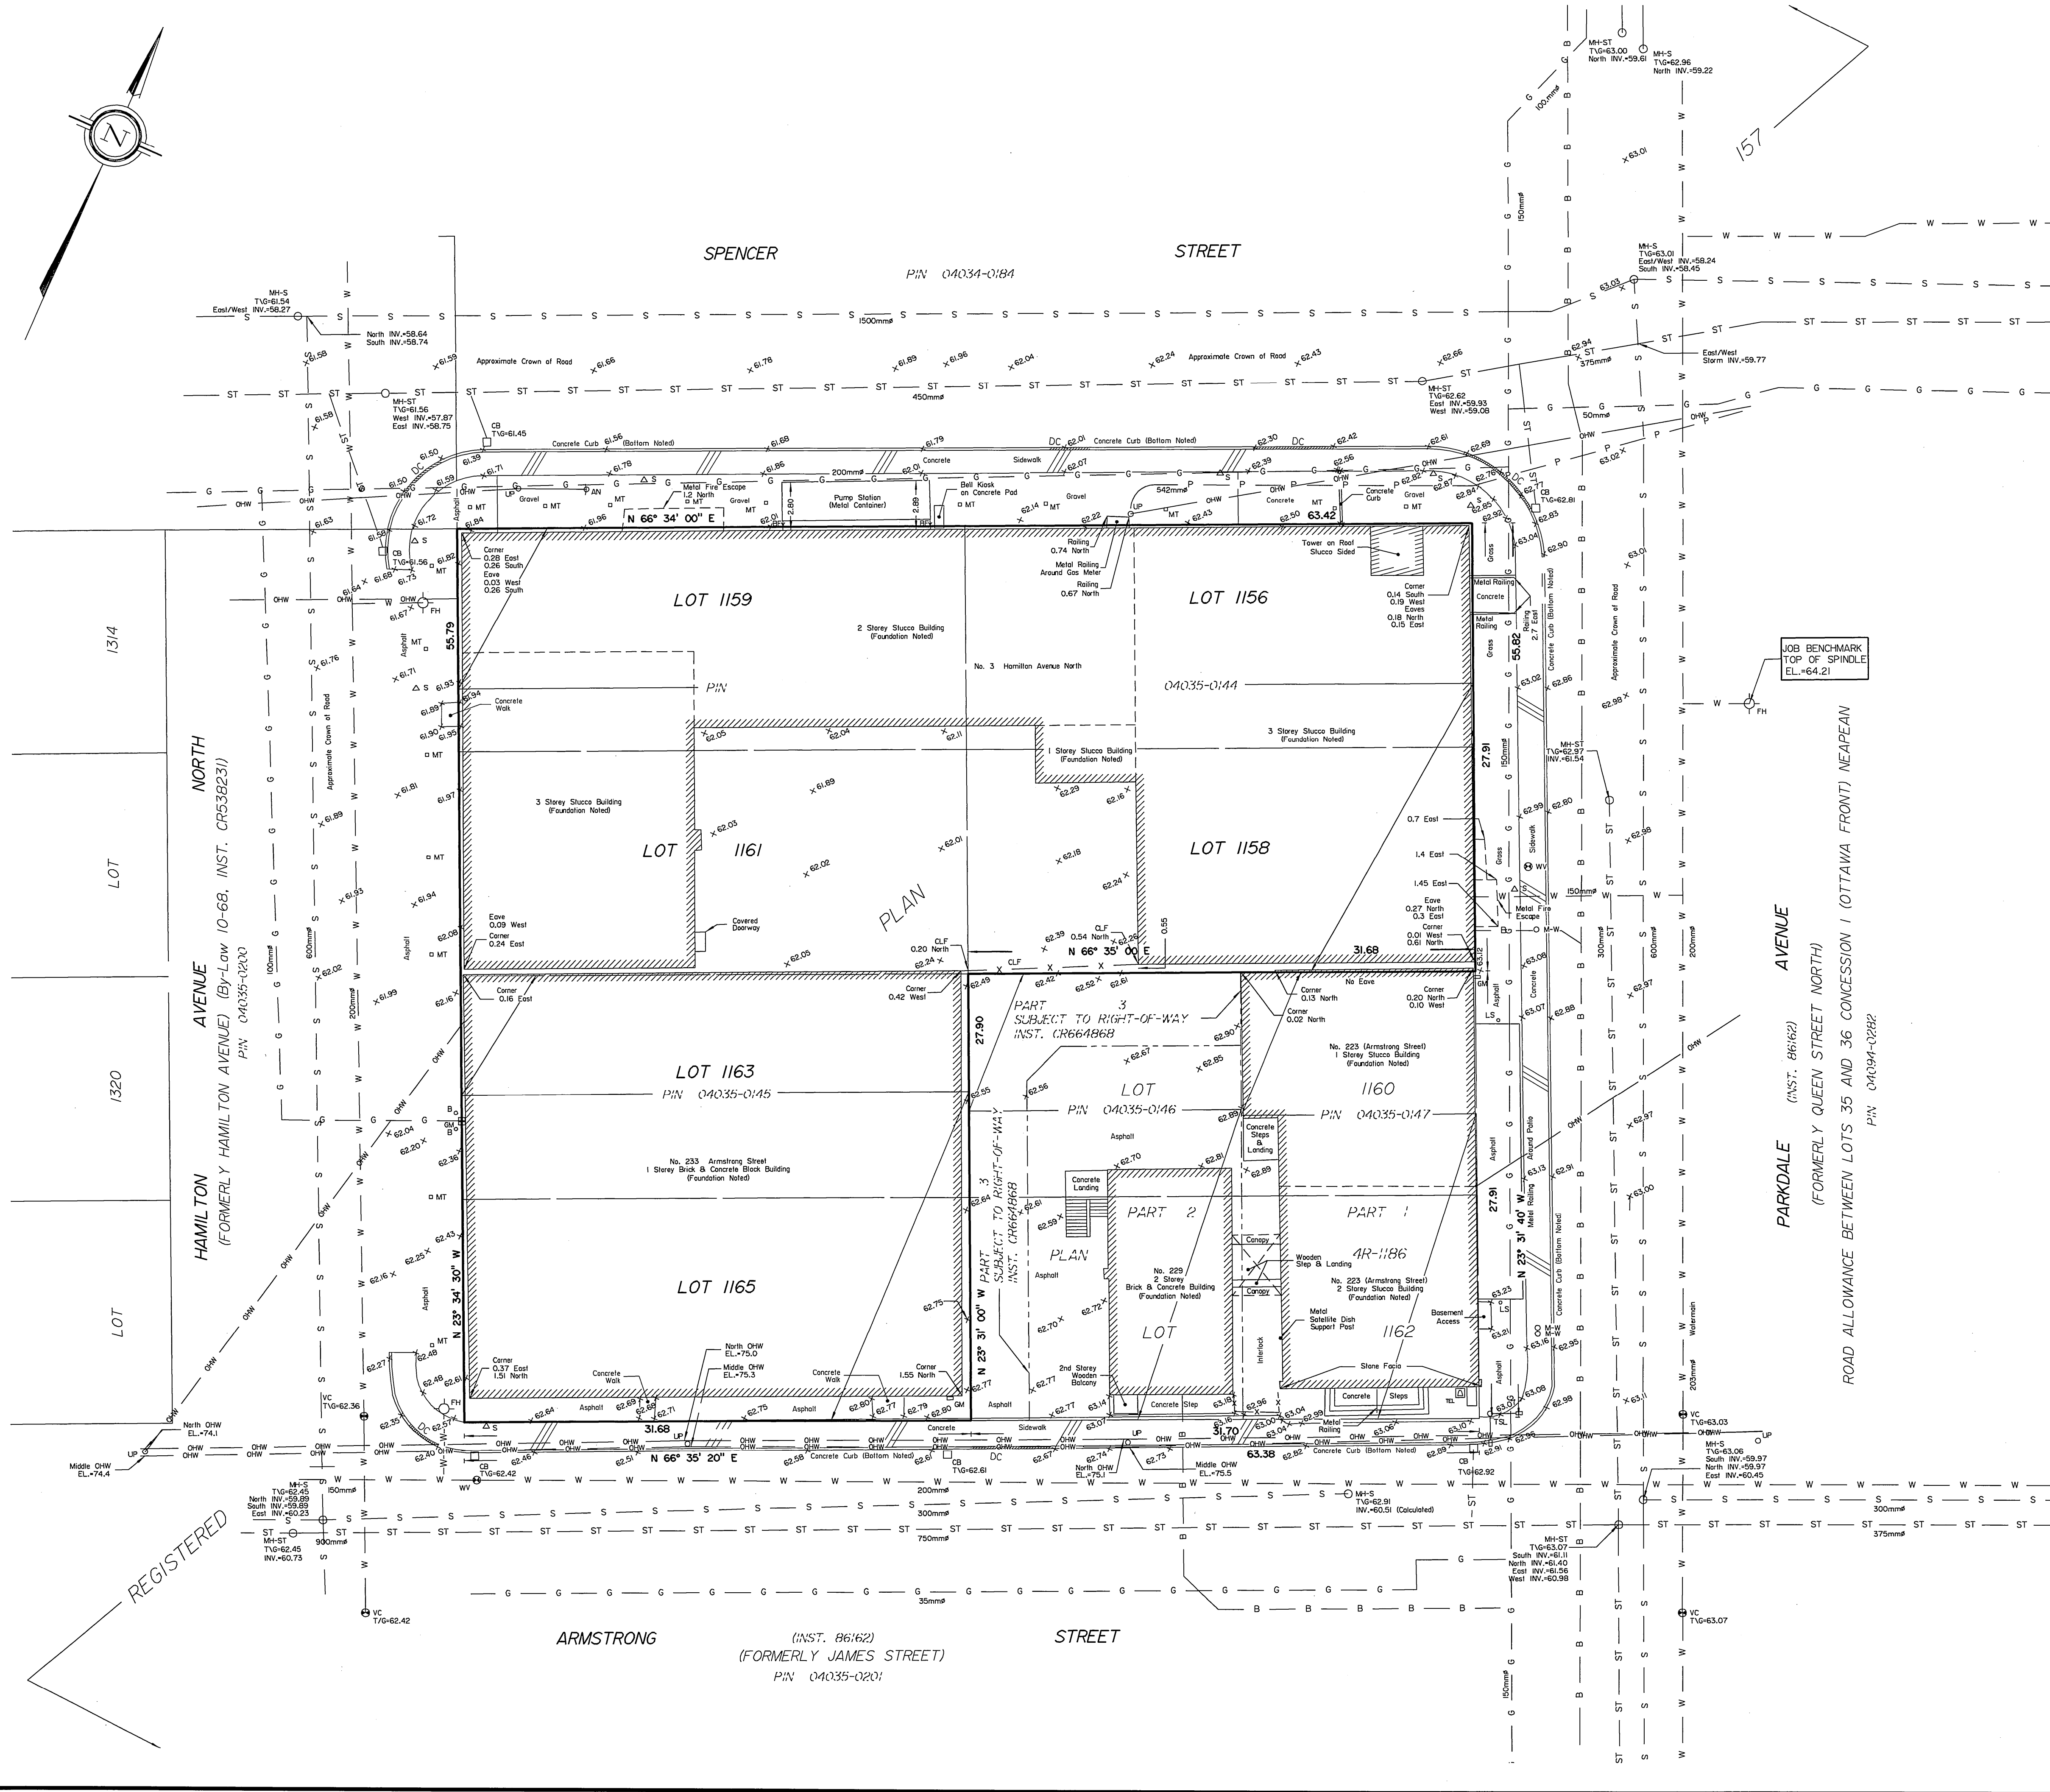

Appendix B Site Plans



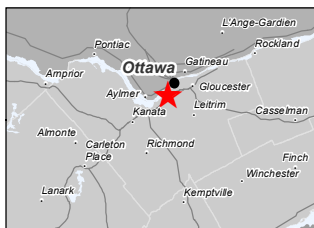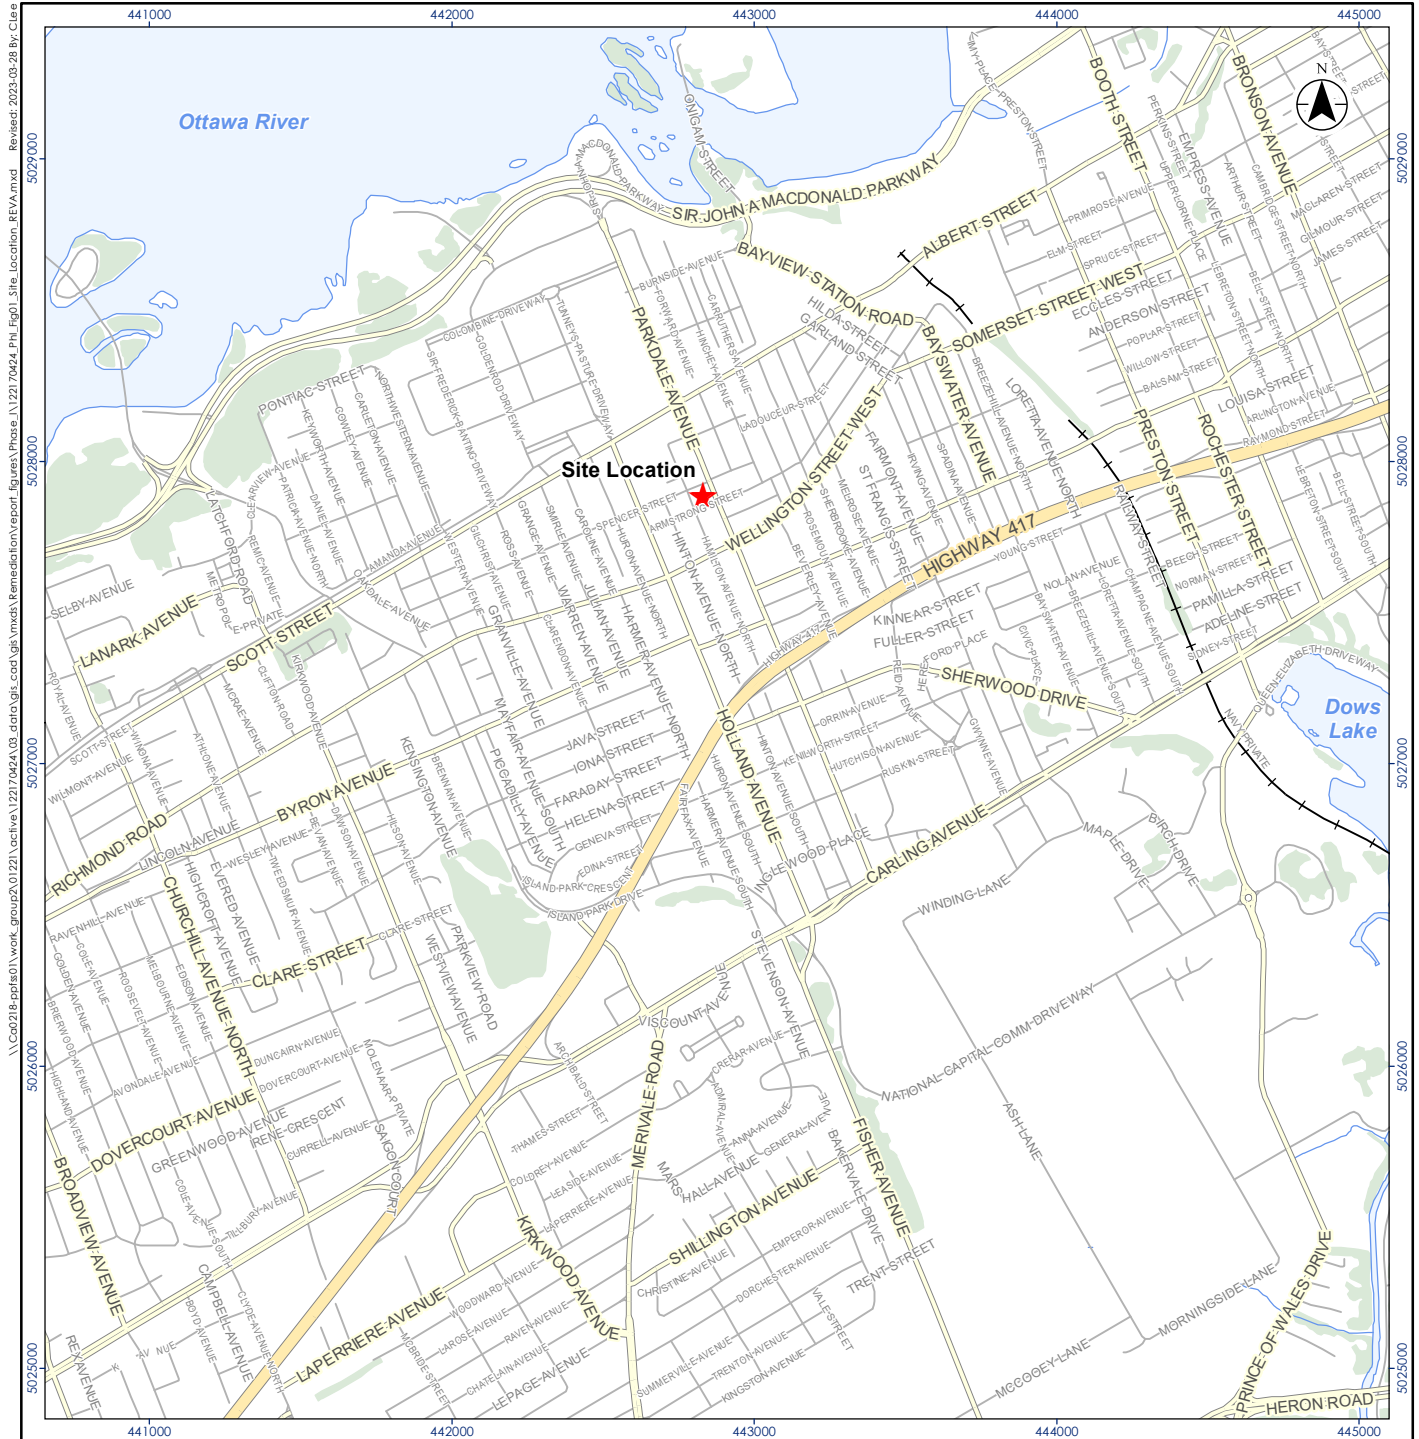

Notes
 1. Coordinate System: NAD 1983 UTM Zone 18N
 2. Base features produced under license with the Ontario Ministry of Natural Resources and Forestry © Queen's Printer for Ontario, 2023.

Legend

- ★ Site Location
- Highway
- Major Road
- Minor Road
- + Railway
- Watercourse
- Waterbody
- Wooded Area

0 250 500
metres
 1:25,000 (at original document size of 8.5x11)



Project Location
 Ottawa, ON


122170424 REVA
 Prepared by CL on 2023-03-28

Client/Project
 To ggart Reality Management/1000147699 Ontario Inc.
 Phase One ESA - Proposed Development Hamilton
 Avenue, Spencer Street, Parkdale Avenue and
 Armstrong Street, Ottawa, ON

Figure No.
 1


Site Location

Disclaimer: Stantec assumes no responsibility for data supplied in electronic format. The recipient accepts full responsibility for verifying the accuracy and completeness of the data. The recipient releases Stantec, its officers, employees, consultants and agents, from any and all claims arising in any way from the content or provision of the data.

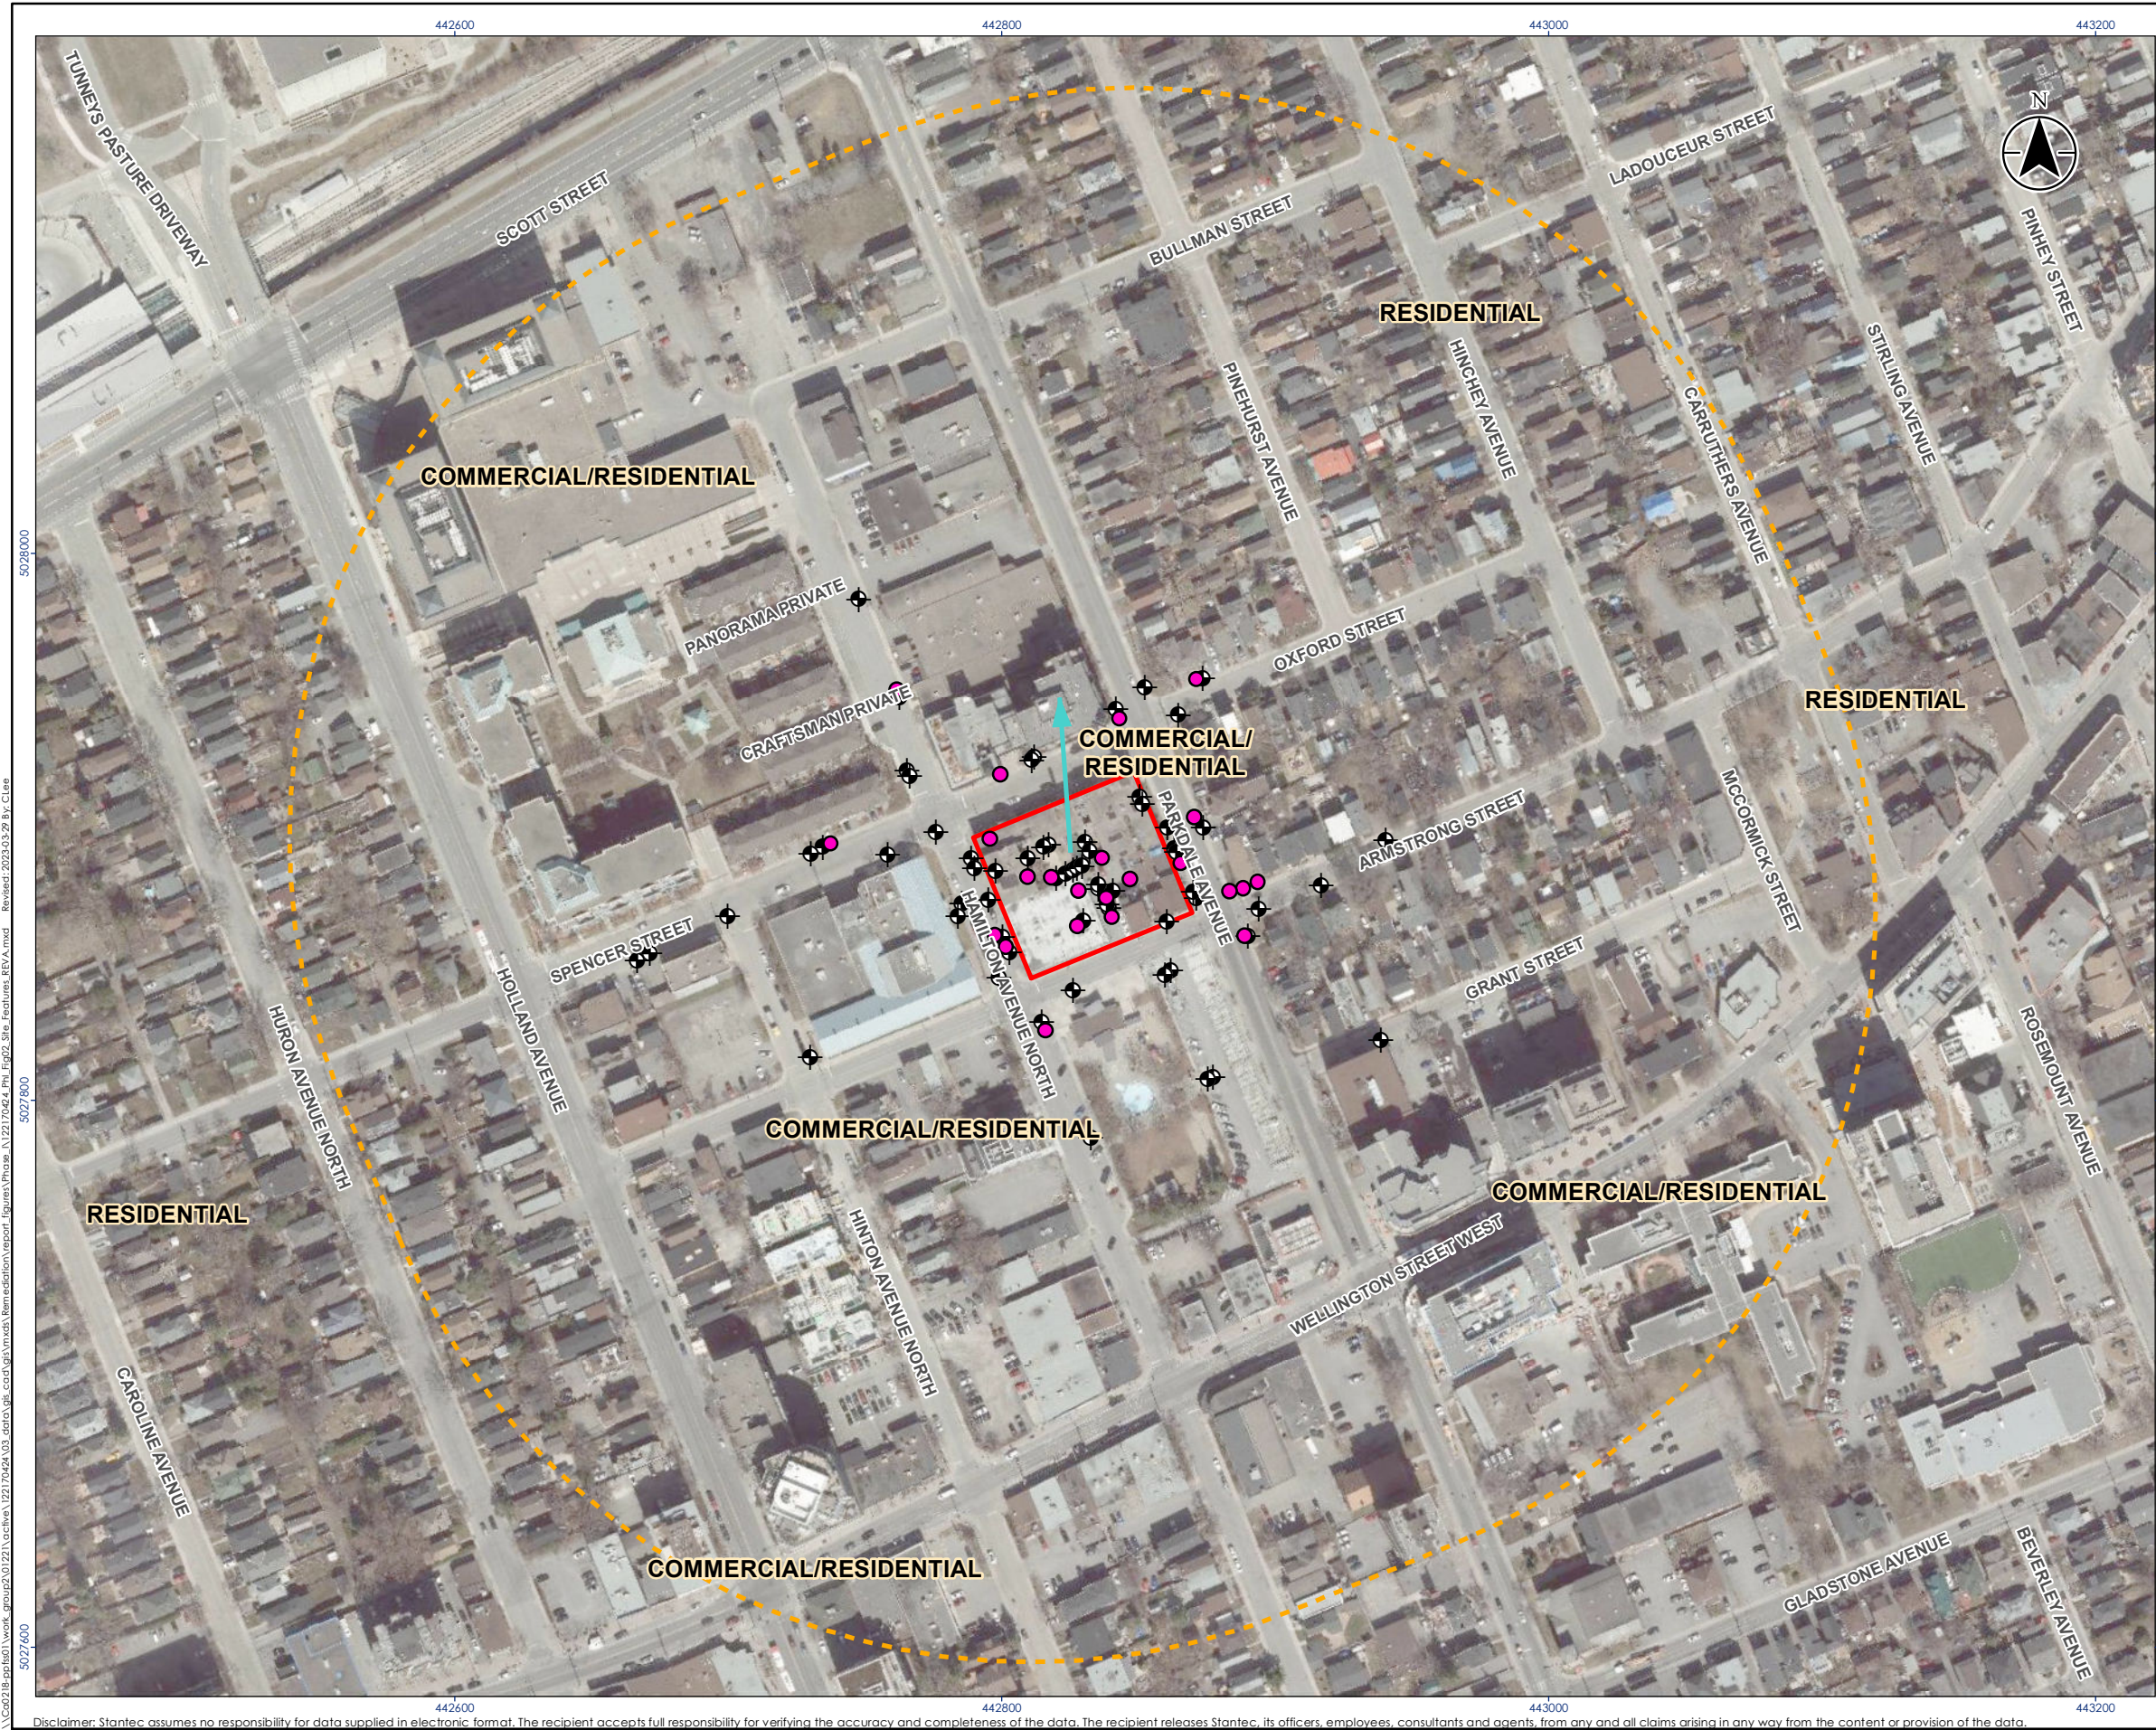

Legend

- Approximate Monitoring Well Location
- Approximate Vapour Probe Location
- Inferred Shallow Groundwater Flow Direction
- Approximate Site Boundary
- Phase One Study Area (250 m)



Notes

- Coordinate System: NAD 1983 UTM Zone 18N
- Base features produced under license with the Ontario Ministry of Natural Resources and Forestry © Queen's Printer for Ontario, 2023.
- Orthimagery © City of Ottawa, 2023. Imagery Date, 2021.



Project Location
Ottawa, ON

122170424 REVA
Prepared by CL on 2023-03-29

Client/Project
Taggart Realty Management/1000147699 Ontario Inc.
Phase One ESA – Proposed Development Hamilton Avenue, Spencer Street, Parkdale Avenue and Armstrong Street, Ottawa, ON

Figure No.

2

Title

Site Plan

Appendix C Site Reconnaissance Photographs



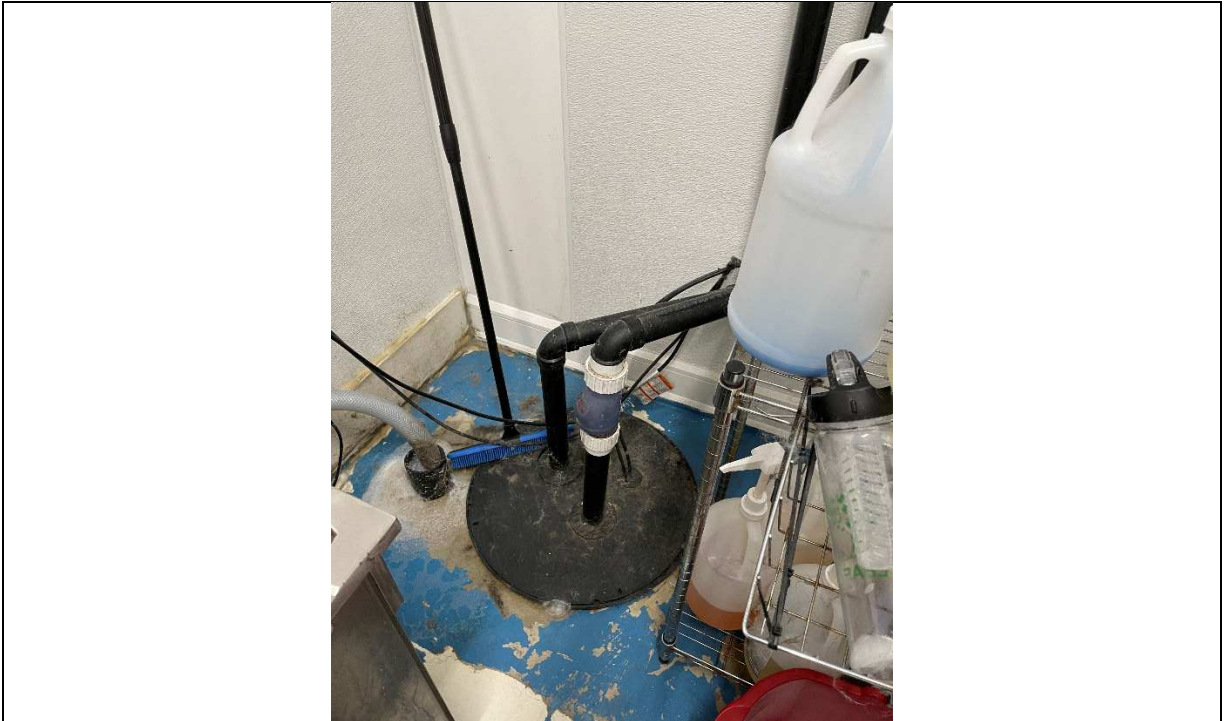


Photo 001 View of sump in The Barking Barber located at 233B Armstrong Street (the Phase One Property) (facing west).



Photo 002 View of pet shampoos in The Barking Barber located at 233B Armstrong Street (the Phase One Property) (facing west).



Photo 003 View of tile and hardwood samples in Inner Designs located at 233 Armstrong Street (the Phase One Property) (facing northeast).

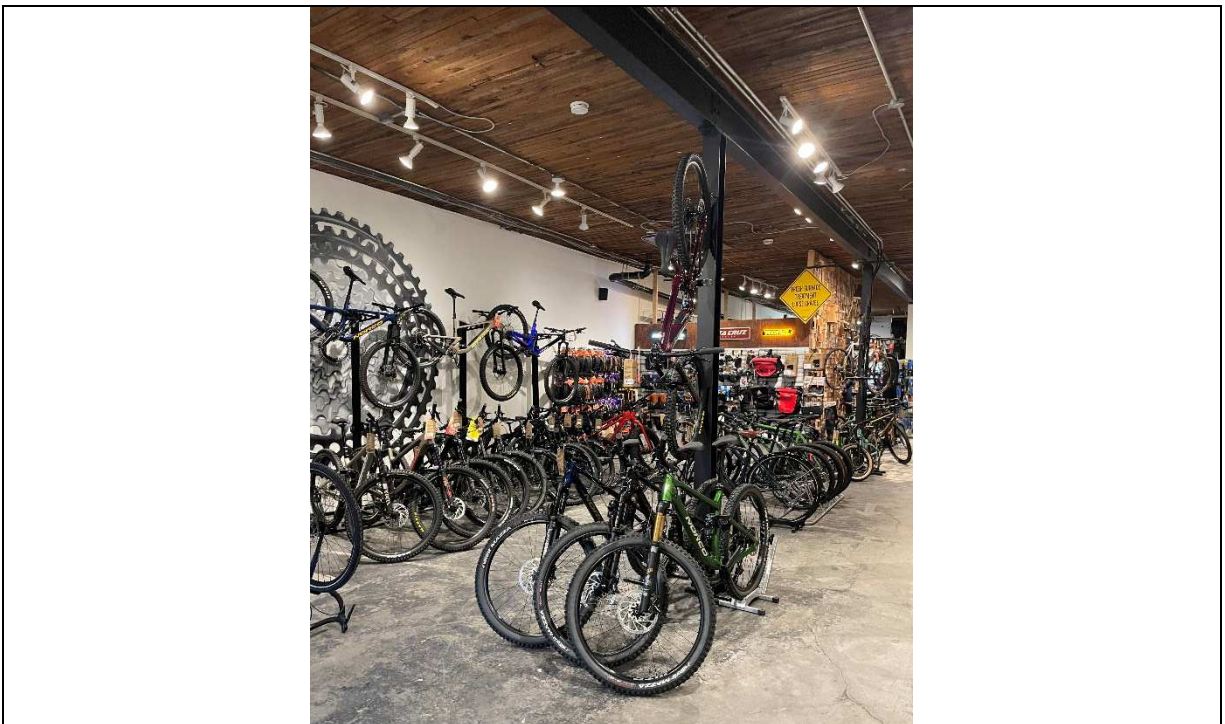


Photo 004 View of bicycle inventory in Full Cycles located at 7 Hamilton Avenue North (the Phase One Property) (facing east).



Photo 005 View of suspected soil vapour probe under tattooing table in Railbender Tattoo and Shades & Art Gallery located at 3 Hamilton Avenue North (the Phase One Property) (facing down).

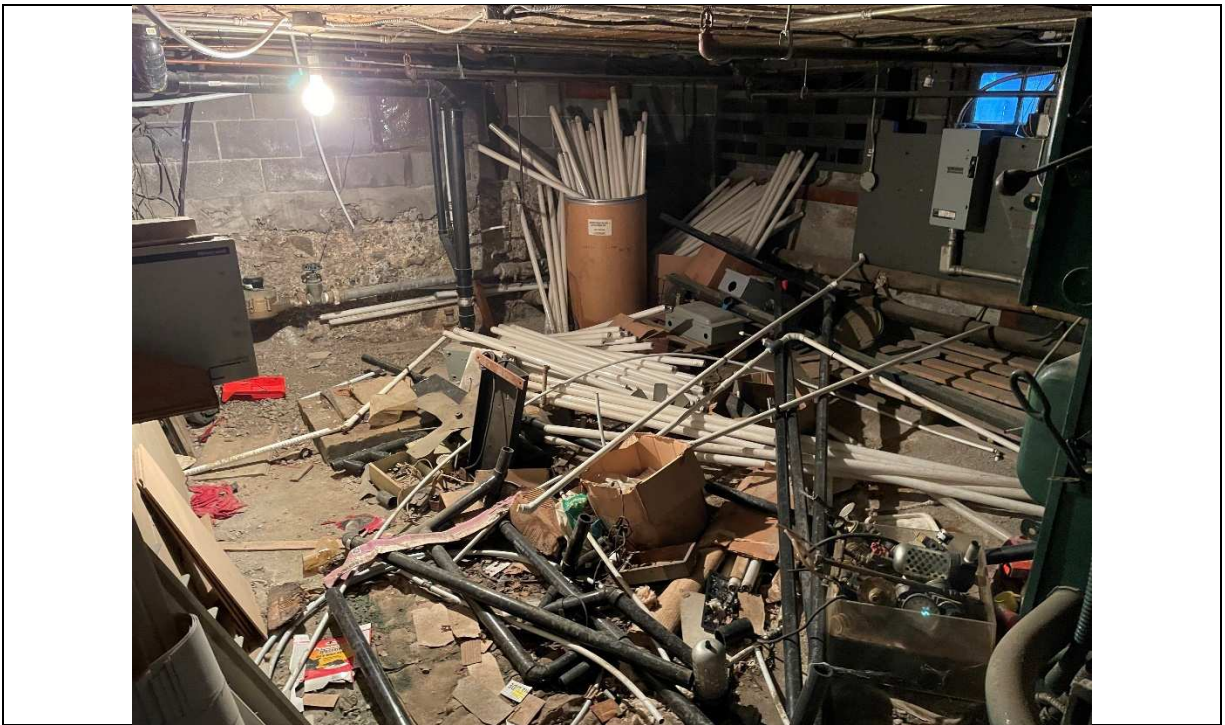


Photo 006 View of poorly managed waste overlying building foundation/subsurface in northeast corner of basement of Parkdale Mini Storage located at 340 Parkdale Avenue (the Phase One Property) (facing northeast).



\\ca0218-
ppfs01\work_group2\01221\active\122170424
\05_report_deliv\draft_doc\phase_one_esa\ap
p c - site recon
photographs\appc_photolog_20230501.docx

PREPARED FOR:
Taggart Realty Management/ 1000147699
Ontario Inc.
SITE:
Phase One Environmental Site Assessment –
Proposed Development Hamilton Avenue,
Spencer Avenue, Parkdale Avenue, Armstrong
Street, Ottawa, Ontario

PROJECT #
122170424
TITLE
Site Photographs
PAGE
3 of 11



Photo 007 View of heating unit on the second floor of Parkdale Mini Storage located at 340 Parkdale Avenue (the Phase One Property) (facing north).



Photo 008 View of PVC drum along the northern boundary of the Phase One Property, adjacent to the west of Golder Associates container (facing west).

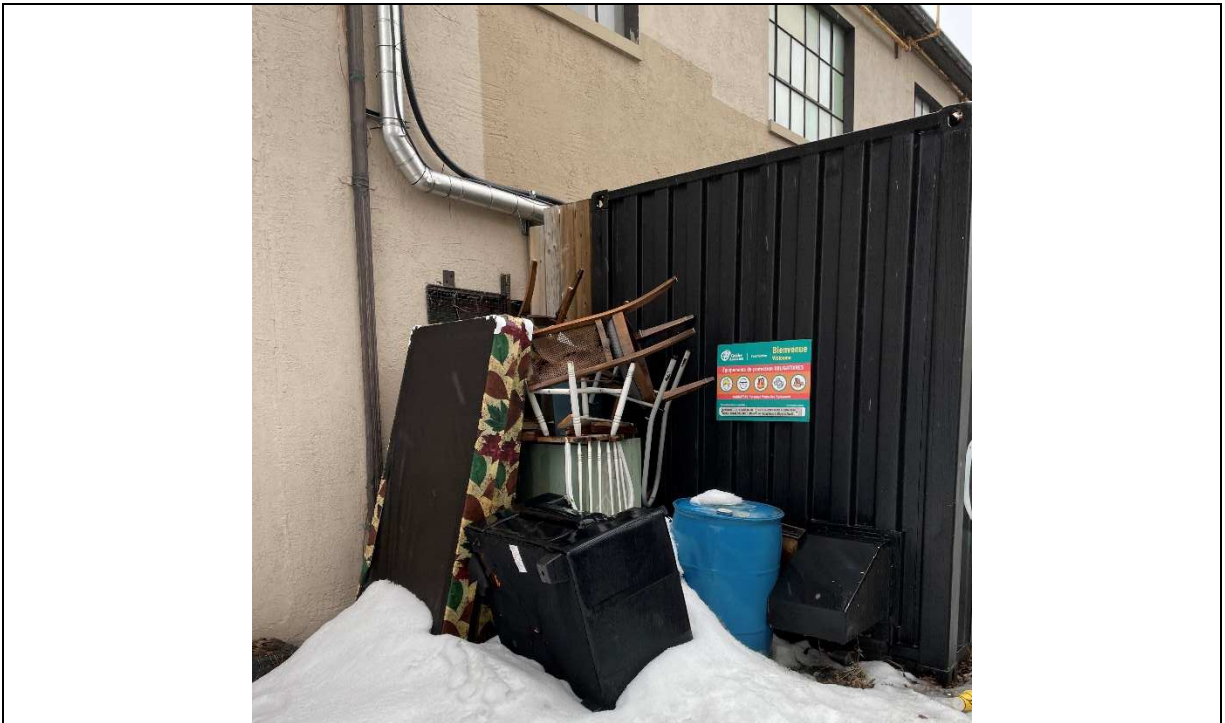


Photo 009 View of PVC drum and disposed furniture propped against Golder Associates container, likely from Jack's Upholstery and Re-finishing located along the northern boundary of the Phase One Property (340 Parkdale Avenue) (facing southwest).



Photo 010 View of furniture inside Jack's Upholstery and Re-finishing located at 340 Parkdale Avenue (the Phase One Property) (facing northeast).



Photo 011 View of stored household supplies inside Mino'Weesini located at 5 Hamilton Avenue North (the Phase One Property) (facing east).



Photo 012 View of paint stored inside Mino'Weesini located at 5 Hamilton Avenue North (the Phase One Property) (facing east).

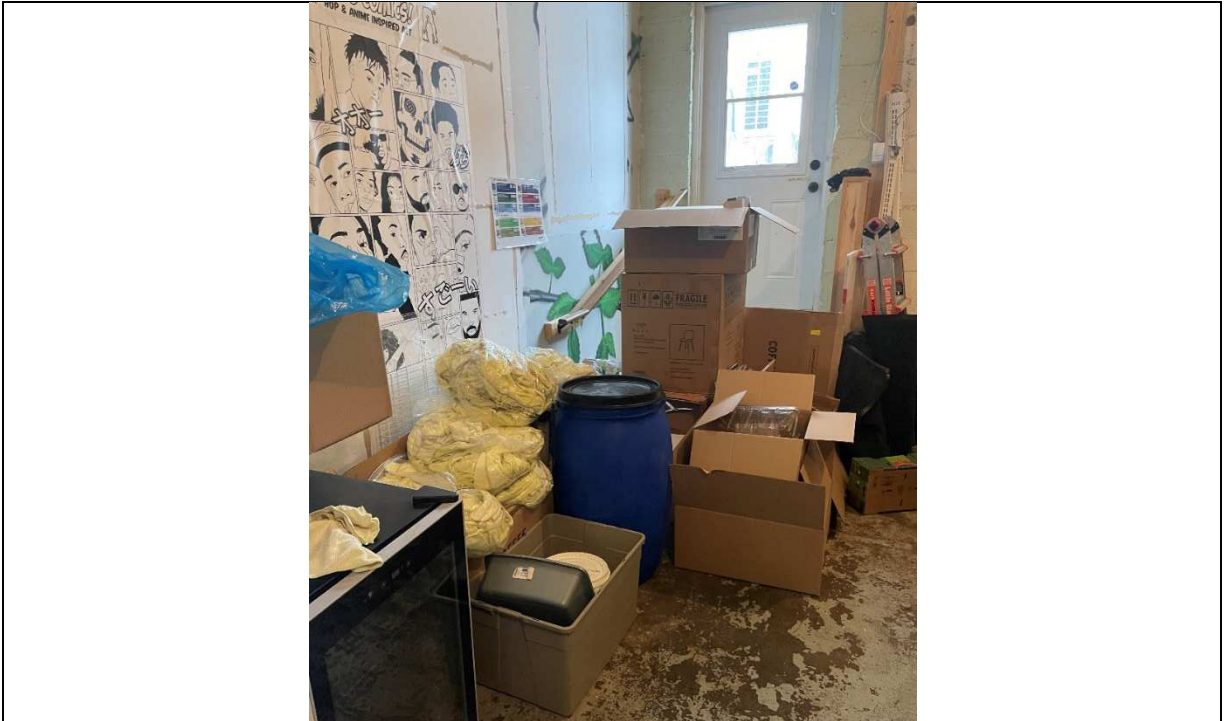


Photo 013 View of stored food and containers at Parkdale Drip House located at 340B Parkdale Avenue (the Phase One Property) (facing east).



Photo 014 View of numerous groundwater monitoring wells in the parking area near the centre of the Phase One Property (facing north).



Photo 015 View of domestic waste at the northwest corner of the Phase One Property (facing southeast).



Photo 016 View of multiple groundwater monitoring wells along the eastern sidewalk of the Phase One Property (along Parkdale Avenue) (facing south).



Photo 017 View of the northeast corner and northern portion of the Phase One Property (facing southwest).



Photo 018 View of the Carleton Tavern and the Morning Owl (the Phase One Property) (facing north).



Photo 019 View of townhouses and an apartment building directly northwest of the Phase One Property (northwest).



Photo 020 View of Parkdale Market/Parkdale Park directly south of the Phase One Property (facing southeast).

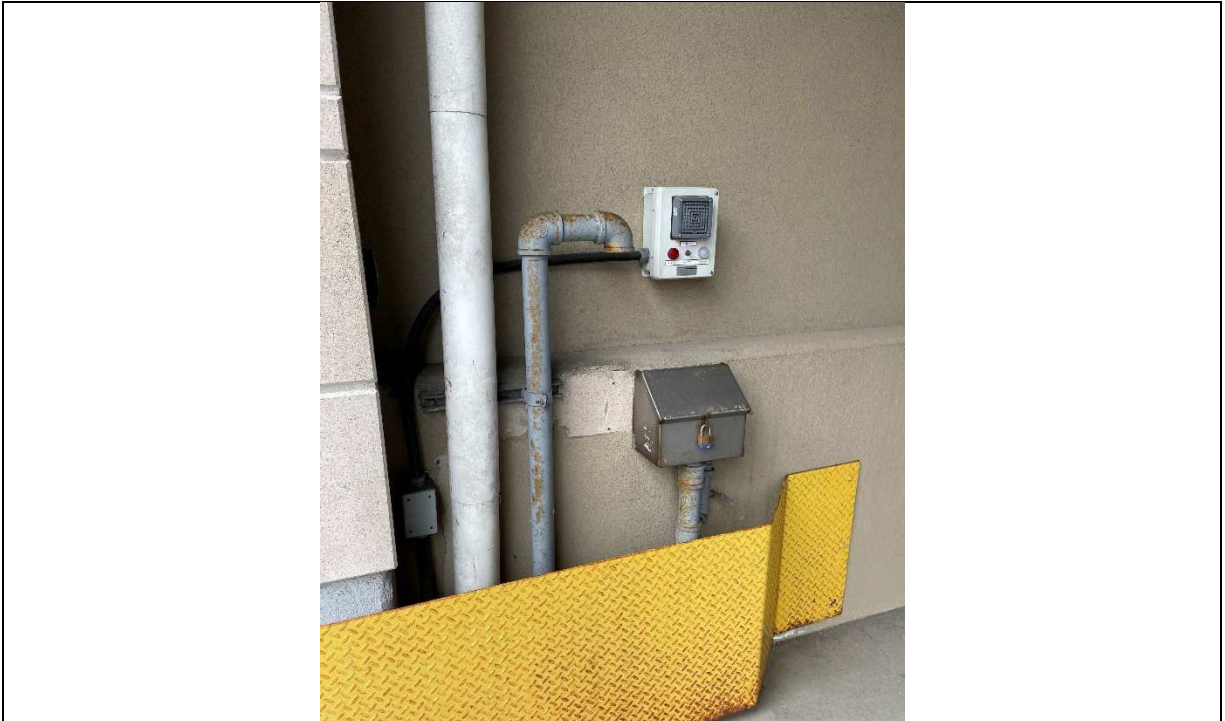


Photo 021 View of fill and vent pipes at the apartment building directly north of the Phase One Property located at 320 Parkdale Avenue (facing northwest).

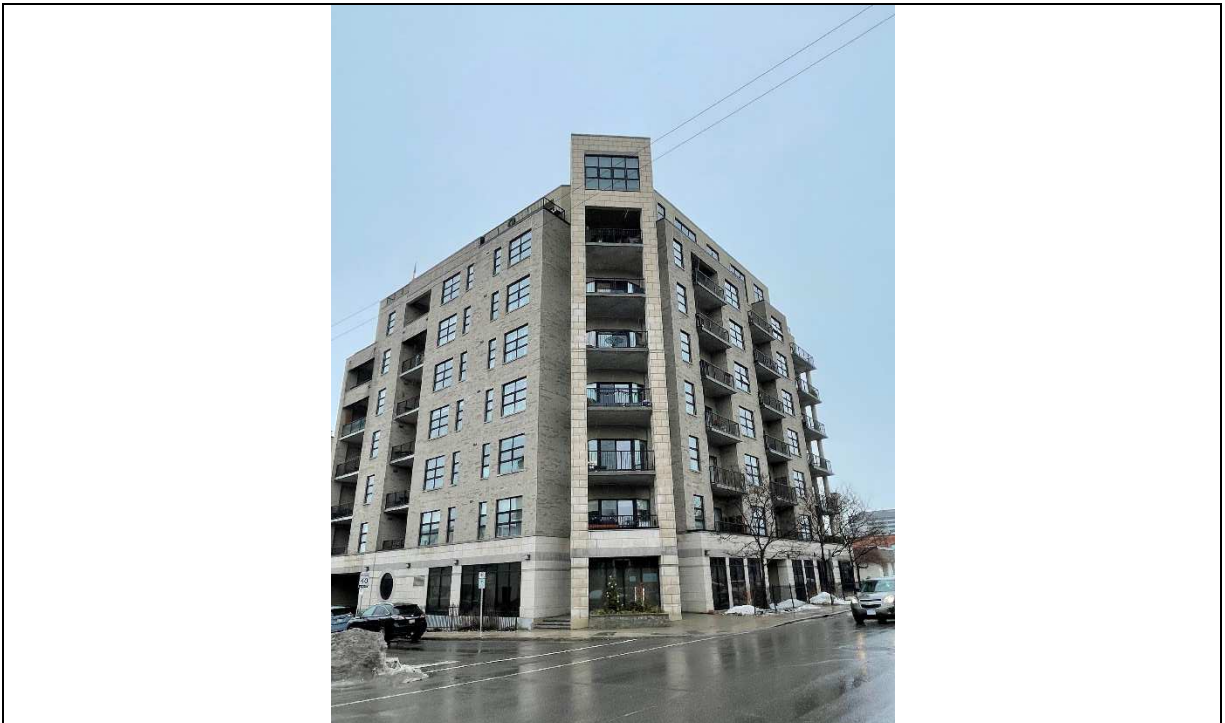


Photo 022 View of apartment building directly north of the Phase One Property located at 320 Parkdale Avenue (facing northwest).

Appendix D Project Team Members



Principal, Business Centre Practice Leader, Environmental Engineer

24 years of experience · Ottawa, Ontario

Jill Peters Dechman is a Principal and Business Centre Practice Leader for the Environmental Services group in Ontario. She has more than 20 years' experience in environmental consulting, specifically with respect to Environmental Site Assessment (ESA) programs at contaminated sites. Ms. Peters Dechman is a licensed professional engineer in Ontario and is a Qualified Person under Ontario Regulation 153/04 of the Environmental Protection Act. She also is a licensed professional engineer in Manitoba. Ms. Peters Dechman is responsible for health and safety, technical quality, and innovation within the Environmental Services group in Ontario. She provides senior support and technical review for Phase I, Phase II, Phase III ESAs and remediation programs at contaminated sites. She has completed environmental site assessments and remediation action plans dealing with a variety of contaminants (fuels, solvents, and emerging contaminants) at sites for federal, municipal, and private proponents. Ms. Peters Dechman has provided consulting services as an environmental engineer on multiple municipal infrastructure-related projects for road, bridge, and utility projects. Ms. Peters Dechman has experience in the development and preparation of tender specifications to support remediation projects at a variety of properties.

EDUCATION

B.Eng. Environmental, Carleton University, Ottawa, Ontario, Canada, 2000

Groundwater Pollution & Hydrology, Princeton Groundwater Inc., Orlando, Florida, USA, 2008

Remediation Course, Princeton Groundwater Inc., Miami, Florida, 2012

CERTIFICATIONS & TRAINING

Certificate of Achievement, POST 2023 LEVEL 1 - BBS - Orientation and Test, Ottawa, Ontario, Canada, 2023

REGISTRATIONS

Professional Engineer, Engineers Geoscientists Manitoba

Professional Engineer, Professional Engineers Ontario

PROJECT EXPERIENCE

ENVIRONMENTAL SITE ASSESSMENTS PHASE I, II, III

Cove Island Light Station, Environmental Program | PSPC | Cove Island, Ontario, Canada | 2020-2021 | Senior Quality Reviewer

Provided senior quality review for the preparation of a remedial options evaluation and liability estimate for the 13.2 hectare DFO light station and related facilities situated on the northern portion of the island in Fathom Five National Marine Park. Intent of the program was to provide viable remediation / risk management options for the Site and to present a preferred option and associated liability estimates.

Tunney's Pasture, Phase One ESA | PSPC | Ottawa, Ontario, Canada | 2019-2020 | Project Manager

Phase One ESA completed to assess the 49-hectare land parcel occupied by the federal government office building complex. The assessment included 21 buildings and two former building lots. Project was completed to support the PWGSC Tunney's Pasture Master Plan and potential divestment of the Site. The Phase One ESA was tailored to guide further assessment work to reduce environmental liabilities prior to divestment.

530 Tremblay Road Redevelopment | PSPC | Ottawa, Ontario, Canada | 2018-2020 | Project Manager, Senior Quality Reviewer

Provided project management and senior quality review for the Phase I ESA and subsequent Phase II ESA of a former MTO equipment and repair centre prior to possible property divestment. Areas of potential environmental concern were identified in the Phase I ESA and were further assessed in the Phase II ESA. Included the preparation of recommendations for further assessment, delineation, and remediation of the soil and groundwater impacts identified. Subsequent work stage included the preparation of cost estimates for remediation prior to redevelopment.

Debris, Waste & Rubble Pile at Joyceville Institution, Potable Water Well Survey and Data Gap Analysis, and Detailed Work Plan | | PSPC | Kingston, Ontario, Canada | 2018-2021 | Senior Quality Reviewer

Provided senior quality review for the completion of the potable water well survey, data gap analysis, and development of the detailed workplan for further assessment activities to address the identified data gaps. Intent of the work plan was to prepare a program to inform and support subsequent remediation/risk management program to achieve site closure. Subsequent work stages included soil and debris sampling, installation and sampling of groundwater monitoring wells in support of a screening level risk assessment.

Phase I ESA, Sorting Facility | Canada Post | Kingston, Ontario, Canada | 2015 | Project Manager

Managed the Phase I ESA of a mail sorting facility in downtown Kingston. The assessment was completed for due diligence purposes prior to potential divestment of the property.

Phase I ESA, Three First Nations Sites | AANDC | Manitoba, Canada | 2016 | Senior Quality Reviewer

Senior quality reviewer of Phase I ESAs of three First Nations sites in Manitoba. The sites included former gasoline retail outlets and waste disposal sites within the First Nation's communities. Recommendations included the completion of Phase II ESAs to assess potential soil and groundwater concerns.

Phase I and II ESA, Boteler Street | City of Ottawa | Ottawa, Ontario, Canada | 2015 | Project Manager

Managed the completion of both Phase I and II ESAs of a vacant property in downtown Ottawa, to support the divestment and redevelopment of the property. The assessments were completed in accordance with the requirements of Ontario Regulation 153/04. Additional components of the project included remedial excavation of mercury impacts, management of soil transfer activities, asbestos sampling and removal.

Phase II ESA, Former Fire Fighting Training Area #2 | DCC/DND | CFB Shilo, Manitoba, Canada | 2017-2018 | Senior Technical Reviewer

Provided senior technical review and support for the Phase II ESA to assess possible soil and groundwater impacts by PFAS at the site.

Phase I & II ESA, Conroy Road | City of Ottawa | Ottawa, Ontario, Canada | 2016-2017 | Project Manager

Managed the Phase I and II ESA of a vacant parcel of land in rural Ottawa, ON. The assessments were completed for due diligence purposes prior to potential divestment of the property. The Phase I ESA was completed in accordance with O.Reg. 153/04. The Phase II ESA was recommended to address potential environmental concerns associated with the presence of fill material and debris at the former driving range facility.

Phase I and II ESA, 1599 Carling Avenue | Suncor | Ottawa, Ontario, Canada | 2010-2019 | Senior Quality Reviewer

Provided senior quality review for the environmental site assessments required to support the filing of a Record of Site Condition under O.Reg. 153/04. Project work included the completion of a Phase I ESA and Phase II ESA in accordance with O.Reg. 153/04, as well as the completion of a remedial excavation at the site. Environmental site assessment work completed to support the completion of a human health and ecological risk assessment for proposed future re-development of the property.

Phase I & II ESA, 25 Khymer Court | City of Ottawa | Ottawa, Ontario, Canada | 2016-2017 | Project Manager

Managed the Phase I and II ESA of a vacant parcel of land in rural Ottawa, ON. The assessments were completed for due diligence purposes prior to potential divestment of the property. The Phase I ESA was completed in accordance with O.Reg. 153/04. The Phase II ESA was recommended to address potential environmental concerns associated with an off-site salvage yard/auto wrecker.

Phase I & II ESA | Via Rail Canada | Smiths Falls to Brockville, Ontario, Canada

Managed the completion of both Phase I and II ESAs of the rail alignment between Smiths Falls and Brockville, ON, in support of potential acquisition of the property. The completion of the assessments were time sensitive to meet the requirements of the transaction.

Canadian Food Inspection Agency, Phase I ESA | PSPC | Ottawa, Ontario, Canada | 2021 | Senior Quality Reviewer

Phase I ESA completed to assess the 820-hectare land parcel occupied by agricultural land, wooded areas, offices, storage buildings and laboratory facility for a total of 24 buildings. Reporting included recommendations for further assessment of identified APECs.

Residential Drinking Water Sampling | DCC/DND | 22 Wing North Bay, North Bay, Ontario, Canada | 2017-2018 | Senior Technical Reviewer

Contaminated Sites Specialist and Quality Reviewer for water supply survey and PFAS testing program of 30 privately- owned water supply wells upgradient and downgradient of former firefighter training locations at the North Bay airport.

Shirley's Bay Campus and Connaught Range and Primary Training Centre, Phase I ESA | DCC/DND | Ottawa, Ontario, Canada | 2018-2019 | Senior Technical Advisor, Quality Review

Provided senior technical support and quality review for the Phase I ESA in support of the development of a major infrastructure project at the Site and potential land transfer activities. Historical report review in conjunction with standard Phase I ESA practices were employed to identify and prioritize areas of potential environmental concern for further assessment.

Knapp Point Minor Shore Light, Remedial Confirmation Soil Assessment and Site Closure Report | PSPC | Wolfe Island, Ontario, Canada | 2018-2019 | Senior Quality Review

Provided senior quality review for the site closure reporting which included the completion of a remedial confirmation sampling program to document that remediation/risk management objectives had been achieved at the Site. Report provided documentation of the completion of the FCSAP 10-Step process.

London International Airport, Golfland Area, Phase I and II ESA | Transport Canada | London, Ontario, Canada | 2018-2019 | Project Manager, Senior Quality Reviewer

Provided project management and senior quality review for the Phase I ESA and subsequent Phase II ESA of property adjacent to the LIA for due diligence purposes. Areas of potential environmental concern were identified in the Phase I ESA and were further assessed in the Phase II ESA. Scoring according to the NCSCS was completed. Included the preparation of recommendations for further assessment, delineation, and remediation of the soil and groundwater impacts identified.

PSPC/NRCan, 555 Booth Street Remediation | Ottawa, Ontario, Canada | 2016-2018 | Senior Environmental Engineer

Senior Environmental Engineer for the preparation and review of design documents for the remediation of metals and PAH impacted soils surrounding the site building. Responsible for the review of existing documentation including: Environmental Site Investigations, Environmental Assessments, and Geotechnical Investigations. Responsible for the preparation of 75%, 99%, and tender-ready drawings, specifications, and cost estimates and submission to PSPC for review and approval. Project included provision of client support during the tendering process and third-party oversight of contractor during remediation phase.

Canada Centre for Inland Waters, Phase II ESA | PSPC | Burlington, Ontario, Canada | 2018-2019 | Quality Reviewer

Provided independent quality review of the Phase II ESA of the land-based portions of the facility positioned on an infilled area separating the Hamilton Harbour from Lake Ontario. The Phase II ESA assessed seven areas of potential environmental concern through installation of boreholes and monitoring wells. Scoring according to the NCSCS was completed. Included the preparation of recommendations for further assessment of AECs.

Lyal Island Light Station, Detailed Work Plan, Liability Reporting and Supplemental Site Investigation | PSPC | Lyal Island, Ontario, Canada | 2018-2021 | Senior Quality Reviewer

Provided senior quality review for the completion of a data gap analysis, sampling program, and development of the detailed workplan for the unmanned DFO light station on the western side of Bruce Peninsula. Subsequent work stage included the completion of a supplemental site investigation to close data gaps identified through historical documentation review. Intent of the program was to conduct a Site Specific Risk Assessment for the Site.

Parliamentary Precinct Block 2 Redevelopment, Phase II ESA | PSPC | Ottawa, Ontario, Canada | 2018-2019 | Senior Technical Advisor, Quality Review

Provided senior technical support and quality review for the Phase II ESA of the Site which included 11 buildings slated for a redevelopment including possible demolition, infill development, and redevelopment. The Phase II ESA assessed areas of potential environmental concern identified through a review of historical documentation. Installation of a network of groundwater monitoring wells allowed for the collection of soil and groundwater samples to better delineate known areas of impact. Scoring according to the NCSCS was completed. Project included the preparation of recommendations for further assessment, delineation, and remediation of the soil and groundwater impacts identified.

DCC/DND, Detailed Testing Program, Building 16, 22 Wing, CFB North Bay | North Bay, Ontario, Canada | 2016 | Senior Technical Review

Provided senior technical review and support for the detailed testing program to characterize and better delineate soil and groundwater impacted by PFAS at the site. Estimated volumes of impacted soil and groundwater were provided along with recommendations for further assessment. NCSCS scoring completed for the Site.

NRC National Fire Laboratory | Mississippi Mills, Ontario, Canada | 2012-2019 | Senior Technical Reviewer

Provided senior technical review and support for a multi-disciplinary PFAS investigation program that has included: on-site groundwater, soil, surface water, and sediment sampling, off-site residential drinking water sampling, targeted soil removal, ecological assessment programs, and air deposition studies at the NRC's NFL property. The NFL facility has historically been used to conduct a wide-range of full-scale scenarios to test fire detection, fire suppression, smoke movement, and smoke movement management and to test the performance of building materials and systems.

Abandoned Grenade Range, Phase I ESA, CFB Shiloh | DCC/DND | Shilo, Manitoba, Canada | 2015 | Senior Quality Reviewer

Senior quality reviewer for the Phase I ESA of an abandoned grenade range at CFB Shiloh, Manitoba. Assessment included the review of historical information including interviews with retired personnel. Provided remedial options analysis and recommendations for on-going site management.

Phase I & II ESA | PSPC | 100 Sparks Street / 30 Metcalf Street, Ottawa, Ontario, Canada | 2019-2020 | Senior Environmental Engineer

Provided senior technical review and support for the Phase I ESA of two downtown office buildings. Subsequent work included completing a combined Phase II ESA and Geotechnical Investigation at each of the two buildings and completing a Soil and Groundwater Management Plan to support future development at the site.

Proposed CSC National Training Academy | PSPC | Kingston, Ontario, Canada | 2020-2021 | Senior Environmental Engineer

Provided senior technical review and support for the Phase II ESA of the 12.5 hectare land parcel within the Collins Bay Institution grounds. The Phase II ESA was completed in support of the site selection process and assessed areas of potential environmental concern identified through a previously completed data gap analysis. Soil and groundwater sampling to characterize the environmental quality of the Site was completed in coordination with a geotechnical investigation and archaeological investigation. Data collected was used to develop a conceptual site model and prepare recommendations based on the Site findings.

Former Sir John Carling Building | PSPC | Ottawa, Ontario, Canada | 2016-2021 | Senior Quality Reviewer

Provided senior quality review for the Phase II ESA, subsequent Phase III ESA of the former government office building demolished by controlled implosion. Provided support to the project team on environmental aspects of the assessment and provided recommendations for further assessment, delineation, and remediation of the soil and groundwater impacts identified. Additional work stages were undertaken to inform further demolition plans and specifications required to support site redevelopment.

Peer Review and Remedial Options Cost Estimating | Resolute Forestry Products | Iroquois Falls, Ontario, Canada | 2015 | Senior Environmental Engineer

Environmental engineer and project manager for the peer review of Phase I and Phase II ESA reports completed by others on behalf of Resolute for the mill site. Opinion of cost for remedial options prepared based on delineation work completed and findings of preliminary gap analysis.

Environmental Site Assessments | Suncor | Various Sites, Eastern Ontario, Canada | 2010-present | Project Manager/Senior Environmental Engineer

Project Manager and Senior Environmental Engineer for multiple property environmental site assessments for the purposes of: 1) investigation of contaminant impacts, 2) baseline evaluation in context of property acquisition and/or divestment, and 3) support for on-going operation of the property. Projects have been undertaken throughout Ontario in a variety of geological and hydrogeological environments. Projects have included conventional remedial excavations, removal of underground storage tank systems, in-situ chemical oxidation, and passive (e.g., MNA) and active (e.g., pump and treat) groundwater remediation. Responsibilities have included: preparation of scope of work, development and management of budgets and schedules, integration of project team and contractors, completing assessments, managing acquired data, preparation and senior review of report quality, mitigation of project risks, attendance of client and third party meetings.

Critical Peer Review, FFTA & HazMat Compounds Site | PSPC | 8 Wing CFB Trenton, Trenton, Ontario, Canada | 2021-2023 | Senior Quality Reviewer

Provided senior technical support for the peer review of historical reports completed by others regarding PFAS and the remediation of perfluoroalkyl substances (PFAS) impacted media at the Site. Historical documentation included a remedial options evaluation, indicative liability estimate, and annual monitoring and inspection plan. Peer review identified key issues regarding site characterization and management goals.

Pelee Island Non-Directional Beacon Site | PSPC | Pelee Island, Ontario, Canada | 2021 | Senior Quality Reviewer

Provided senior quality review for the preparation of a sampling and analysis plan and remedial action plan for the Nav Canada NAVAID site at Pelee Island Municipal Airport. The purpose of the program was to outline the sampling requirements to close identified data gaps and to outline the approach to the biopile remediation of hydrocarbon impacts at the Site.

Davieaux Island Light Station, Environmental Program | PSPC | Davieaux Island, Ontario, Canada | 2020-2021 | Senior Quality Reviewer

Provided senior quality review for the environmental site assessment program for the 50 hectare island site in Lake Superior that is occupied by a DFO light station and related facilities. Scope of the program included historical review and data gap analysis, with subsequent environmental work program to address the data gaps in support of future remediation and risk management of the Site. Recommendations for the Site, a Site Worker Health and Safety Plan and liability estimates were prepared.

3 CDSB Edmonton, FFTA, Phase III ESA | DCC/DND | Edmonton, Alberta, Canada | 2015-2016 | Project Manager

Managed the completion of the Phase III ESA which included the delineation and preliminary human health risk assessment of co-impacted soil and groundwater at the fire fighter training area. Contaminants of concern included both petroleum hydrocarbons and PFAS. Estimated volumes of impacted soil and groundwater and provided remedial options analysis and recommendations for on-going site management.

Reclassification of 7 DFO Small Craft Harbour Sites, Central and Arctic Region | DFO | Various Sites, Ontario, Manitoba, and Saskatchewan, Canada | 2014-2015 | Project Manager

Managed the reclassification of seven small craft harbor sites located in Ontario, Manitoba, and Saskatchewan. Sites had a variety of background environmental site assessment work completed and detailed reviews were required to prepare the reclassifications employing the current Aquatic Sites Classification System for each Site.

Fuel Oil Spills | Various Sites, Eastern Ontario, Canada | 2010-present | Senior Quality Reviewer

Provided senior technical review of several fuel oil spill assessments completed on behalf of a variety of insurance providers at sites throughout Ontario. Remediation of these residential fuel oil spills is driven by the TSSA or the MECP. Preliminary work includes Phase II ESA to determine the extent of the spill. Subsequent work has included conventional excavation followed by in-situ chemical oxidation and groundwater monitoring.

Defoliant Impact Assessment | DND | CFB Gagetown, New Brunswick, Canada | 2005-2006 | Environmental Engineer

Reviewed historical records and prepared field sampling program for collection of subsurface and surface soil, water, sediment, and vegetation samples for analysis of a variety of defoliants. Field observations and analytical results were extremely sensitive and confidential; media training was required prior to project commencement. Roles: historical research, field activities, report writing.

Phase I & II ESA - National Printing Bureau | PSPC | Gatineau, Quebec, Canada | 2019-2021 | Senior Environmental Engineer

Provided senior technical review and support for the Phase I & II ESAs completed to support future construction and/or redevelopment of the Site. Phase I ESA included recommendations for further assessment of identified APECs. Phase II ESA included the collection and analysis of soil and groundwater samples to assess the identified APECs. Scoring according to the NCSCS was completed. Soil and groundwater management plans were developed along with a roadmap to guide environmental components of possible redevelopment activities.

Hawkins Island | PSPC | Lake Superior, Ontario, Canada | 2022-2024 | Senior Environmental Engineer

Provided senior technical review and support for the environmental site assessment work and remediation planning at the site occupied by a minor shore light where near surface soils are impacted by metals, included elemental mercury.

Supplemental Phase II ESA, Former Fire Fighting Training Area #1 | DCC/DND | Shilo, Manitoba, Canada | 2017-2018 | Senior Technical Reviewer

Provided senior technical review and support for the supplemental Phase II ESA to better delineate soil and groundwater impacted by perfluoroalkyl substances (PFAS) at the site.

Phase II ESAs, Buildings 87, 88, and 129 | DCC/DND | CFB Winnipeg, Manitoba, Canada | 2017 | Senior Technical Reviewer

Provided senior technical review and support for the Phase II ESA of three sites at CFB Winnipeg to assess potential soil and groundwater impacts associated with the use of fire fighting foams containing PFAS. Recommendations for additional assessment and delineation provided. NCSCS scoring provided.

Phase II ESAs, Foam Sites #1 and #2, 15 Wing | DCC/DND | CFB Moose Jaw, Saskatchewan, Canada | 2017-2018 | Senior Technical Reviewer

Provided senior technical review and support for the Phase II ESA of two sites at CFB Moose Jaw to assess potential soil and groundwater impacts associated with the use of fire fighting foams containing PFAS. Recommendations for additional assessment and delineation provided. NCSCS scoring provided.

Nottawasaga Island | PSPC | Lake Huron, Ontario, Canada | 2023-2024 | Senior Environmental Engineer

Provided senior technical review and support for the environmental site assessment work and remediation planning at the site occupied by a minor shore light where near surface soils are impacted by metals.

REMEDIATION

Kinonjeoshtegon - Former Hydro Diesel Site | Indigenous Services Canada | Hodgson, Manitoba, Canada | 2021-2024 | Senior Environmental Engineer

Senior Environmental Engineer for the supplemental site assessment activities and remedial program undertaken in support of the construction of a water treatment facility within the First Nation. Petroleum hydrocarbon impacted soil and groundwater were assessed and removed from the Site during construction. Long-term monitoring program initiated following remedial excavation.

In-Situ Bioremediation Program - Former landfill site | PSPC | Ottawa, Ontario, Canada | 2018-2023 | Senior Environmental Engineer

Senior Environmental Engineer supporting the multi-year bioremediation of a chlorinated volatile organic compound groundwater plume. Initial program consisted of the injection of molasses substrate solution to enhance reductive dechlorination of VOCs in the groundwater. Performance monitoring completed following each injection event

State Island Coast Guard Site | PSPC | Ontario, Canada | 2020-2022 | Senior Environmental Engineer

Senior Environmental Engineer responsible for the remedial components of the program to remove impacted soil from three individual contaminated areas that comprise the Coast Guard Site. Draft specifications were prepared for remediation of the Site through soil washing and through excavation and sorting. Provided senior technical review of the NMS specifications to facilitate the remediation planning and required pilot program for the work program at this remote Site.

Booth Street Complex Remediation Project | NRCan | Ottawa, Ontario, Canada | 2009-2010 | Environmental Engineer

Environmental engineer during contracting and remediation stages of Phase 1 of the remediation project. Senior technical review of environmental component of NMS specifications for Phase III of the remediation project. Duties included consultant coordination, reporting to federal management team, client meetings, ESA review and approval for NRCan.

Former Bulk Plant Soil Remediation, CFB Uplands | DND | Ottawa, Ontario, Canada | 2004-2007 | Environmental Engineer

Environmental engineer for Phase 2 of former bulk plant soil remediation. Project included the review of existing environmental site assessment reports and the Phase 1 remediation report. Engineering design included the remedial excavation and the construction/operation of the soil treatment cell for jet-fuel impacted soils. The construction stage of the project included monitoring construction, operation, and decommissioning of soil treatment cell that successfully achieved site closure on schedule. Deliverables included: contract drawings and specifications, site monitoring, coordination with client and contractors, and reporting. A thorough knowledge of municipal, provincial, and federal environment related legislation was required to address intersecting needs of federal (DND, NRC, PWGSC, Environment Canada), provincial (MOE), and municipal (City of Ottawa) stakeholders.

Diesel Spill Remediation, Former Lumber Mill | Tembec Inc. | Braeside, Ontario, Canada | 2001-2004 | Environmental Engineer

Completed Phase II ESA following identification of a fuel release along the Ottawa River. Prepared and submitted remedial action plan, permitting for soil and surface water remediation, undertook clean-up activities with a remediation contractor and completed annual groundwater monitoring and reporting.

WASTEWATER

Annual Wastewater Monitoring - Multiple DND Sites within NCA | PSPC/DND | Ottawa, Ontario, Canada | 2016-Present | Senior Technical Reviewer

Stantec completed annual sampling of sanitary and storm sewers at multiple DND sites within the National Capital Area. The sampling programs were completed to identify concentrations at each facility at the point of compliance prior to discharge to the municipal sewer system. Responsible providing senior support to the programs and technical review of report deliverables.

Hydrotest Water Sampling Program - Reinforcement Project | Enbridge | Ottawa, Ontario, Canada | 2015 | Senior Technical Reviewer

Provided senior technical review of hydrotest water sampling program; including collection of surface water samples prior to and following discharge of hydrotest water. Analytical results were compared to Ontario Provincial Water Quality Objectives (PWQO).

Sewer Effluent Compliance Monitoring | Algonquin College | Ottawa, Ontario, Canada | 2010-2021 | Senior Technical Reviewer

Provided senior technical review for monthly sewer effluent sampling program in accordance with sewer use agreement with the City of Ottawa.

POTABLE WATER

Annual Potable Water Quality Assessment - SPIB Facilities | PSPC | Ottawa, Ontario, Canada | 2016-2024 | Senior Technical Reviewer

Stantec provides annual potable water quality assessment, data interpretation and reporting for multiple Science and Parliamentary Infrastructure Branch facilities in Ottawa. The intent of the sampling program is to assess the quality of water at selected fixtures in accordance with federal and provincial guidelines and standards. Provided senior support and technical review of report deliverables for the annual potable water sampling programs.

2020 Potable Water Audit Program - Four Health Canada Facilities | PSPC/Health Canada | Ottawa, Ontario, Canada | 2019-2020 | Senior Technical Reviewer

Stantec undertook potable water audits at four Health Canada facilities to assess areas for improvement of the distribution of potable water within the identified buildings. The audit included a site visit, interviews, and review of water demand within the buildings, review of fixture availability and layout, and review of recent potable water quality data to develop recommendations for improved water quality. Provided senior support and technical review of report deliverables for the audit.

Residential Drinking Water Sampling | DCC/DND | North Bay, Ontario, Canada | 2017-2018 | Senior Technical Reviewer

Contaminated Sites Specialist and Quality Reviewer for water supply survey and PFAS testing program of 30 privately- owned water supply wells upgradient and downgradient of former firefighter training locations at the North Bay airport.

Annual Potable Water Quality Assessment - Multiple Sites within NCA | PSPC/DND | Ontario, Canada | 2016-2024 | Senior Technical Reviewer

Stantec provides annual potable water quality assessment, data interpretation and reporting for multiple DND facilities in Ottawa. The intent of the sampling program is to assess the quality of water at selected fixtures in accordance with federal and provincial guidelines and standards. Provided senior support and technical review of report deliverables for the annual potable water sampling programs.

GAS & LIQUID PIPELINES

Emergency Suspect Soil Response | Enbridge Gas Distribution | Various Sites, Eastern Ontario, Canada | 2015-2019 | Senior Technical Reviewer

Provided senior technical review of proposals, work programs following emergency response to calls regarding suspected contaminated soil at various Enbridge Gas Distributions site across Eastern Ontario. Subsequent work included senior technical review and support during assessment of site conditions, collection of soil and/or groundwater samples for laboratory analyses of contaminants of concern, summary reporting and recommendations for proper safety protocols and soil management options.

Proposals and Work Programs | TransCanada PipeLines Ltd. | Various Sites, Ontario, Canada | 2016-2019 | Senior Technical Reviewer

Provided senior technical review of proposals and work programs to facilitate the application for Permits to Take Water in support of the launcher/receiver program at sites across Ontario. Subsequent work included senior technical review and support during assessment of site conditions, collection of soil and/or groundwater samples for laboratory analyses of contaminants of concern, summary reporting and recommendations for proper safety protocols and soil management options.

Maintenance Investigation Site | Trans-Northern Pipelines Inc. | Near Belleville, Ontario, Canada | 2020 | Independent Technical Review

Provided independent review of work programs and deliverables to support the assessment of soil and groundwater quality at Maintenance Investigation Site as part of the 2020 Legacy Contaminated Sites Assessment Program.

Integrity Maintenance Investigation Site | Trans-Northern Pipelines Inc. | Near Bowmanville, Ontario, Canada | 2020-2021 | Independent Technical Review

Provided independent review of work programs and deliverables to support the assessment and delineation of soil and groundwater quality impacts at an Integrity Maintenance Investigation Site.

CIVIL & MUNICIPAL INFRASTRUCTURE

Orleans Watermain East Link | City of Ottawa | Ottawa, Ontario | 2013 | Environmental Engineer

Senior Environmental Engineer for the Phase I/II Environmental Site Assessment. Assignment consisted of the assessment of existing environmental conditions along the project alignment. Issues of potential environmental concern included several locations where historical and/or current activities on neighbouring sites may have adversely impacted the quality of soil and/or groundwater within the project alignment. Supplemental assessment of soil, fill, and groundwater quality within the right-of-way was completed to support materials management during the Construction Stage. Materials management support provided during Construction Stage.

Rideau River Pedestrian Crossing | City of Ottawa | Ottawa, Ontario | 2013 | Environmental Engineer

Senior Environmental Engineer for the Phase I Environmental Site Assessment. Assignment consisted of the assessment of existing environmental conditions within the project area. The project area was assessed for issues of potential environmental concern where historical and/or current activities on neighbouring sites may have adversely impacted the quality of soil and/or groundwater.

Glebe Avenue Integrated Road Renewal | City of Ottawa | Ottawa, Ontario, Canada | 2022-2024 | Senior Environmental Engineer

Glebe Avenue Integrated Road Renewal | City of Ottawa | Ottawa, Ontario, Canada | 2022 - 2023 | Senior Environmental Engineer Senior Environmental Engineer and Qualified Person for the excess soil planning in accordance with Ontario Regulation 406/19. Assessment of Past Uses, Sampling and Analysis Plan, and Soil Characterization Reports prepared to support the management of excess soils anticipated to be generated during the construction phase of the integrated road renewal program.

Greenbank Road Realignment & Southwest Transitway Extension | City of Ottawa | Ottawa, Ontario, Canada | 2021-2024 | Senior Environmental Engineer

Senior Environmental Engineer and Qualified Person for the excess soil planning in accordance with Ontario Regulation 406/19. Assessment of Past Uses, Sampling and Analysis Plan, and Preliminary Soil Characterization Reports prepared to support the management of excess soils anticipated to be generated during the construction phases.

Laurier Avenue West Bike Lane Redevelopment | City of Ottawa | Ottawa, Ontario, Canada | 2022-2023 | Senior Environmental Engineer

Senior Environmental Engineer and Qualified Person for the excess soil planning in accordance with Ontario Regulation 406/19. Assessment of Past Uses, Sampling and Analysis Plan, and Soil Characterization Reports prepared to support the management of excess soils anticipated to be generated during the construction phase.

Montreal Station Bus Loop | City of Ottawa | Ottawa, Ontario, Canada | 2022-2023 | Senior Environmental Engineer

Senior Environmental Engineer and Qualified Person for the excess soil planning in accordance with Ontario Regulation 406/19. Assessment of Past Uses, Sampling and Analysis Plan, and Soil Characterization Reports prepared to support the management of excess soils anticipated to be generated during the construction phase.

Integrated Road, Sewer and Watermain for Canterbury, Arch, Plesser | City of Ottawa | Ottawa, Ontario | 2020-2024 | Environmental Engineer

Senior Environmental Engineer for the Phase I Environmental Site Assessment (ESA) and Limited Phase II ESA. Assignment consisted of the assessment of existing environmental conditions within the project area and identification of areas potential environmental concern including a former fuel spill, former gasoline retail outlet, and fill quality concerns. Assessment of soil and groundwater quality within the project area was completed in conjunction with geotechnical and hydrogeological investigations to support materials management during construction.

Combined Sewer Storage Tunnel | City of Ottawa | City of Ottawa, Ottawa, Ontario, Canada | 2015-2020 | Environmental Engineer

Environmental Site Assessment Team Lead for the design and construction phases of the project. Design assignment consisted of the assessment of existing environmental conditions along the project alignment. Issues of potential environmental concern included several locations where historical and/or current activities on neighbouring sites may have adversely impacted the quality of soil and/or groundwater within the project alignment. Assessment of soil, fill, and groundwater quality within the right-of-way was completed to support materials management and the development of environmental components of the construction drawings and specifications. Construction phase responsibilities include presentations at public consultation meetings, client support for stakeholder questions, additional baseline assessments to support stakeholder requirements, and review of contractor submissions based on the requirements of the construction drawings and specifications.

Imperial Avenue, Renfrew Avenue, Lakeview Terrace Reconstruction | City of Ottawa | Ottawa, Ontario | Environmental Engineer

Provided senior technical review and support for the two Phase I ESAs and two Phase II ESAs completed for the project. Included recommendations relating to management and disposal of contaminated soil for the project.

Lynda Lane Urbanization | City of Ottawa | Ottawa, Ontario | 2015 | Environmental Engineer

Senior Environmental Engineer for the Phase I Environmental Site Assessment. Assignment consisted of the assessment of existing environmental conditions within the project area. The project area was assessed for issues of potential environmental concern where historical and/or current activities on neighbouring sites may have adversely impacted the quality of soil and/or groundwater.

Crystal Beach Area, Infrastructure Renewal and Roadway Reconstruction | City of Ottawa | Ottawa, Ontario | 2015 | Environmental Engineer

Senior Environmental Engineer for the Phase I Environmental Site Assessment. Assignment consisted of the assessment of existing environmental conditions within the project area. The project area was assessed for issues of potential environmental concern where historical and/or current activities on neighbouring sites may have adversely impacted the quality of soil and/or groundwater.

Glen Cairn Stormwater Management Pond and Storm Pumping Station | City of Ottawa | Ottawa, Ontario | 2013 | Environmental Engineer

Senior Environmental Engineer for the Phase I/II Environmental Site Assessment. Assignment consisted of the assessment of existing environmental conditions in the proposed work area. Assessed potential environmental concerns associated with historical and/or current activities that may have adversely impacted the quality of soil and/or groundwater within the project area.

Chapel Hill Park & Ride Environmental Assessment | City of Ottawa | Ottawa, Ontario | 2015 | Environmental Engineer

Senior Environmental Engineer for the Phase I Environmental Site Assessment. Assignment consisted of the assessment of existing environmental conditions within the project area. The project area was assessed for issues of potential environmental concern where historical and/or current activities on neighbouring sites may have adversely impacted the quality of soil and/or groundwater.

Street Improvement: Albert and Slater | City of Ottawa | Ottawa, Ontario | 2019 | Environmental Engineer

Senior Environmental Engineer for the Modified Phase I Environmental Site Assessment (ESA) and Limited Phase II ESA. Assignment consisted of the assessment of existing environmental conditions within the project area and identification of 47 areas potential environmental concern associated with the historical uses of the project area. Assessment of soil and groundwater quality within the project area was completed in conjunction with geotechnical and hydrogeological investigations to develop recommendations for materials management.

Mooney's Bay Sanitary Sewer Collector Replacement Program | City of Ottawa | Ottawa, Ontario | 2019 | Environmental Engineer

Senior Environmental Engineer for the Phase I Environmental Site Assessment (ESA) and Limited Phase II ESA. Assignment consisted of the assessment of existing environmental conditions within the project area and identification of areas potential environmental concern including rail lines and associated historical infrastructure, fill quality concerns, former petroleum products storage, and a closed waste disposal site. Assessment of soil and groundwater quality within the project area was completed in conjunction with geotechnical and hydrogeological investigations to support materials management.

SPECIFICATIONS WRITING

Cabot Head Light Station Abatement and Remediation, Cabot Head Light Station | PSPC | Ontario, Canada | 2018-2019 | Senior Environmental Engineer

Senior Environmental Engineer responsible for the remediation components of the program to remove impacted soil from the area surrounding the light station. Work program was to be designed to be carried out in conjunction with interior and exterior lead-based paint abatement on select structures at the Light Station. Provided senior technical review of environmental component of NMS specifications to facilitate the aggressive project schedule for the work program.

Bullmoose Area Mine Sites, Updated Remedial Action Plan and Class B Cost Estimate, Mine Remediation and Rehabilitation | PSPC | 0 km west of Tumbler Ridge, British Columbia, Canada | 2014-2015 | Senior Environmental Engineer

Senior Environmental Engineer responsible for the review of 75% and 99% NMS specifications for the remediation and rehabilitation of seven abandoned mine sites in the area of the former Bullmoose mine site.

Kenaston/Scurfield Property Remediation | Client Confidential | Winnipeg, Manitoba, Canada | 2017 | Senior Environmental Engineer

Senior Environmental Engineer for the preparation and review of design documents for the remediation of metals and PAH impacted soils surrounding the site building. Responsible for the review of existing documentation including: Environmental Site Investigations, Environmental Assessments, and Geotechnical Investigations. Responsible for the preparation of 75%, 99%, and tender-ready drawings, specifications, and cost estimates.

Finance and Finance Annex Building Demolition | BGIS | Ottawa, Ontario, Canada | 2021-2022 | Senior Environmental Engineer

The objective of this project was to provide environmental and engineering support for the demolition of the Finance and Finance Annex buildings. The scope of environmental services included the collection soil and groundwater data from the site, a pre-construction survey of site conditions, development of a soil and groundwater management plan, development of the project specific specifications, provision of support for the tendering and demolition phases of the project, and review of contractor submittals. In addition, contractor oversight including oversight of soil and groundwater management and imported and excess soil sampling was completed. The collected soil and groundwater data were compared to the applicable provincial and federal criteria, including the excess soil regulation (O.Reg. 406/19). Groundwater data was also compared to municipal sewer use criteria. Specifications were prepared using the National Master Specifications (NMS), including project specific customization to align with the requirements of O.Reg. 406/19.

Building Demolition and Remediation, CFB Rockcliffe | DCC | Ottawa, Ontario, Canada | 2011 | Project Manager, Senior Environmental Engineer

Project Manager and Senior environmental engineer responsible for the preparation of NMS specifications for the abatement of hazardous materials and demolition of a former elementary school building, and for three remedial excavations nearby. Duties included client meetings, background documentation review, team coordination, and preparation of specifications.

Cliff Street Central Heating and Cooling Plant, Underground Storage Tank Removal | PSPC | Ottawa, Ontario, Canada | 2016 | Senior Environmental Engineer

Senior Environmental Engineer responsible for the environmental components of the program to remove two 30,000 L concrete underground bunker "C" storage tanks from their location adjacent to the Site building. Provided senior technical review of environmental component of NMS specifications for the excavation project. The UST removal program was supplemented by a Phase III ESA to further assess residual soil impacts associated with the USTs. Project work was completed in support of on-going renovation and redevelopment of the Site.

7 Clarence Street | NCC | Ottawa, Ontario, Canada | 2016 | Senior Environmental Engineer

Senior Environmental Engineer for the preparation and review of design documents for the remediation of metals and PAH impacted soils surrounding the site building. Responsible for the review of existing documentation including: Environmental Site Investigations, Environmental Assessments, and Geotechnical Investigations. Responsible for the preparation of 75%, 99%, and tender-ready drawings, specifications, and cost estimates.

Davieaux Island Light Station | PSPC | Davieaux Island, Ontario, Canada | 2024 | Senior Quality Reviewer

Senior Environmental Engineer responsible for the specifications developed for the site works to support the exterior lead-based paint abatement and structural repairs of select structures at the Light Station. Provided senior technical review of environmental component of NMS specifications.

PUBLICATIONS & WHITEPAPERS

Presentation. Federal Contaminated Sites Workshop.
Successful Application of On-Site Ex-Situ
Bioremediation, Canadian Forces Support Unit
(CFSU) Uplands Tank Farm, Ottawa, Ontario,
RPIC/PWGSC, Ottawa, ON. *Peters Dechman, Jill, P.
Maheux, D. Drost, and A. Silverstein, 2006.*

Environmental Scientist

7 years of experience · Calgary, Alberta

Romeet is a geoscientist-in-training and has project management and technical field experience in completing Environmental Site Assessments (Phases I, II, III). Romeet focuses on site safety and client communication to propel projects to successful execution and completion. Romeet works primarily within the Environmental Services group but also spends time supporting the Water Resources group with hydrogeological investigations.

Project coordination and implementation of field operations including safety compliance, supervision of jobsite personnel and contractors, soil management, and environmental sampling. Romeet is experienced in site project management, environmental and hydrogeological field work, and technical report writing.

Prior to consulting, Romeet worked in the energy sector providing technical geological and geophysical support for oil and gas exploration and production in the Western Canadian Sedimentary Basin and offshore Gulf of Mexico.

EDUCATION

B.Sc. (Hons), Geology with a minor in Geophysics,
University of Calgary, Calgary, Alberta, 2017

CERTIFICATIONS & TRAINING

POST 2022 LEVEL 2 BBS - Orientation and Test,
Ottawa, Ontario, 2022

Enbridge, 2022 Contractor Environment Orientation,
Ottawa, Ontario, 2022

Enbridge, 2022 General Safety Orientation, Ottawa,
Ontario, 2022

REGISTRATIONS

Geologist-In-Training #244785 , Association of
Professional Engineers and Geoscientists of Alberta

Geoscientist-In-Training #11104, Professional
Geoscientists Ontario, 2021 to Present

MEMBERSHIPS

Member, Canadian Society of Petroleum Geologists

PROJECT EXPERIENCE

ENVIRONMENTAL SITE ASSESSMENTS

Canadian Forces Base, Trenton | Various including
DCC, DND, PSPC | Quinte West, Ontario, Canada |
Project Manager, Field Technician and Environmental
Scientist (Report Author)

Phase II ESA and remedial program support as
project manager, field technician, and report author
for various projects across several locations at CFB
Trenton including the Aerospace Telecommunications
and Engineering Support Squadron (ATESS),
Firefighting Training Area (FFTA), Cadet Camp, and
Hangars 5 and 6. Field support including soil,
groundwater, and surface water sampling for various
contaminants of concern including PHCs, PAHs,
VOCs, PFAS. Subsequent reporting writing for annual
field programs.

NRC Effluent Sampling | National Research Council
Canada | 2020-Present | Project Manager, Field
Technician and Reporting

Conducted waste water sampling at NRC campuses
(Sussex Drive, Montreal North, Montreal South), as
well as project management and annual reporting.

1601 The Queensway | Crombie REIT | Project
Manager

Oversaw project management and assisted senior
project manager is multi-faceted real estate re-
development of former Sobey's building. Multiple
scopes of works including environmental, indoor
environment (DSS), hydrogeology, and geotechnical.
Provided client communication between multiple
Stantec BCs, tracked several unique budget and
tasks, and ensured field work and reporting efforts
were efficiently conducted between all BCs on the
client Site.

Excess Soil Projects for the City of Ottawa | City of Ottawa | Ottawa, Ontario, Canada | Site Assessor, Report Author

Conducted numerous Phase I Environmental Site Assessments and Assessments of Past Uses at City of Ottawa owned sites across the city to support excess soil projects related to infrastructure renewal and property development/re-development.

Subsequently acted as a field technician during the drilling and collection of soil and groundwater on sites, and as the report author to produce Sampling Analysis Plans and Soil Characteristic Reports. Projects include the Glebe Avenue Road Renewal; Canterbury, Arch & Plesser Road, Sanitary, and Watermain Project; Montreal Road Bus Loop Construction; Ottawa South and Carlington Heights Pump Station Upgrades.

Shadow Ridge Production Wells | City of Ottawa | Ottawa, Ontario, Canada | Site Inspector

Provide on-site support to contractors (drillers, hydrogeology, geophysics) during the construction and installation of two production water wells. Tasks included general oversight of the project, maintaining health and safety requirements, and communicating with nearby residents regarding ongoing project progress.

Road Renewal at Yonge Street, Newmarket, ON (Excess Soil) | Municipality of Newmarket | Newmarket, Ontario, Canada | Environmental Scientist (Report Author)

Conducted an Assessment of Past Uses and provided assistance in developing the Sampling Analysis Plan and Soil Characterization Report.

Phase I ESA at L'Esplanade Laurier and the Jackson Building | PSPC Canada | Ottawa, Ontario, Canada | Site Assessor and Report Author

Conducted a Phase I ESA at two PSPC-owned sites in preparation of re-development of the properties. Conducted the Phase I Site Reconnaissance at the 11-storey Jackson Building and 23-storey (two tower) L'Esplanade Laurier Building. Subsequently authored the Phase I ESA report for both Sites.

NRC National Fire Laboratory On-site and Residential Sampling | National Research Council Canada | Kanata, Ontario | Field Technician

Sampled groundwater wells and residential water wells and taps for PFAS, while following specific PFAS-sampling standard operating procedures.

Slate Island Remediation | PSPC | Environmental Scientist

Prepared the Plans and Specifications package for a soil remediation program at Slate Island.

Greely Phase I and Phase II ESA | Justice Construction Limited. | Greely, Ontario | Field Technician and Report Author

Conducted the Phase I and Phase II ESA including overseeing of drilling and monitoring well installation, soil sampling, and groundwater sampling. Completed the final report for the Phase I and Phase II ESA.

Phase I ESA at 187 Boteler Drive | Ministry of Foreign Affairs of the State of Qatar | Ottawa, Ontario, Canada | Site Assessor and Report Author

Conducted a Phase I Site Visit including reconnaissance of previously installed monitoring wells at the client Site as well as subsequent authoring of the Phase I ESA.

PSPC 2019-2020 Annual Potable Water Quality Assessment | Public Services and Procurement Canada | Ottawa, Ontario | Report Author and Field Technician

Conducted field work including accounting fixtures, flushing fixtures, and collecting potable water samples across various DND sites. Assisted project managers in coordination of field work including scheduling and planning of site work and, preparing site specific field forms and writing proposals. Report writing for individual sites upon completion of field programs.

Phase II Environmental Site Assessment 355 Riverside Drive | Public Services and Procurement Canada | Field Technician

Helped plan and coordinate a three week field program, and conducted field work including well reconnaissance and groundwater monitoring and sampling.

Phase I Environmental Site Assessment 720 Riverside Drive | Public Services and Procurement Canada | Report Author

Conducted a Phase One ESA including site visit and report writing.

Phase III Environmental Site Assessment Sir Charles Tupper Building | Public Services and Procurement Canada | Field Technician

Supervised drilling program while collecting environmental soil samples.

Phase II and III Environmental Site Assessment Gloucester Landfill | Public Works and Government Services Canada | Field Technician

Oversaw injection of remediation material at contaminated site, and subsequent drilling of new monitoring wells.

Arnprior Data Gap Analysis and Work Plan | Public Works and Government Services Canada

Well reconnaissance and site investigation at former RCAF training center site.

DND Well Reconnaissance and Decommissioning | 2020-Present | Field Technician

Well reconnaissance at various DND sites across the Ottawa area for potential sampling events or decommissioning.

Canada Post Annual Groundwater Monitoring | Canada Post | Ottawa, Ontario | 2019-2020 | Field Technician

Maintenance/repair, development and groundwater sampling of 21 monitoring wells on a Canada Post vehicle fleet site. Conducting groundwater sampling.

Phase II ESA Albany Drive | Public Services and Procurement Canada | Ottawa, Ontario | Report Author

Completed a Phase II ESA report for a drilling and well monitoring program for the City of Ottawa.

Phase I ESA Telus Telecommunication Tower | Telus Communications | Ottawa, Ontario | 2019 | Site Assessor, Report Author

Successful proposal, assessment and final report for Phase I ESA for a Telecommunications Tower.

Phase II ESA Telus Telecommunication Tower | Telus | Ottawa, Ontario | Field Technician

Oversaw and coordinated drilling of three monitoring well, followed by soil and groundwater sampling of the three wells.

Carlton Place semi-annual groundwater monitoring | AVIVA | Ottawa, Ontario | Field Technician

Groundwater sampling for several flushmount wells, and two potable wells.

Suncor Carling In-Situ Remediation | Suncor | Ottawa, Ontario | Field Technician

Oversaw drilling and in-situ remediation of 32 injections points over multiple weeks.

Pendleton Phase II ESA | EDF Renewables Development Inc. | Curran, Ontario | Field Technician

Dug four test pits, oversaw drilling of two monitoring wells, and sampled five monitoring wells.

Phase I ESA Brandt Developments | Brandt Developments | Carp, Ontario | Field Assessor, Report Author

Completed a Phase I ESA site visit and assessment as well as reporting for the Nortrax heavy equipment facility.

Phase I ESA Tesla | Tesla Motors Inc. | Several sites in southern Ontario | Site Assessor, Report Author

Completed the Phase I ESA for a suite of proposed Tesla supercharger stations along southern Ontario as well as completed reporting for the sites.

Casselman Annual Groundwater Monitoring | Village of Casselman | Casselman, Ontario | Field Technician

Conducted monitoring and sampling for 19 wells in the Village of Casselman.

Casselman Village Landfill Monitoring | Village of Casselman | Casselman, Ontario | Field Technician

Collected surface water and groundwater samples from across the Casselman landfill.

Castlefrank Well Decommissioning | Kanata, Ontario

Oversaw the decommissioning of nine wells.

Suncor Phase II ESA Groundwater Monitoring | Suncor | Ottawa, Ontario

Conducted the monitoring and sampling of 29 wells post-remediation as well as supporting the report writing for the project.

Enbridge Gas Distribution Soil Monitoring | Enbridge Gas Distribution | Ottawa, Ontario

Ongoing support at various location across Ottawa for soil and vapour monitoring on as as-needed basis.

Campeau Drive Drilling | Kanata, Ontario | Field Technician

Oversaw and supported drilling of three monitoring wells.

OHS Emergency Spills | NavCanada | Ottawa, Ontario | Emergency Responder (phone)

Oversee the emergency response line for the NavCanada spill response phone.

Monthly and Quarterly Effluent Sampling | Stante | Ottawa, Ontario | Field Technician

Collect effluent samples (sewer, sanitary) for multiple projects and clients on a monthly or quarterly basis.

Water Well Testing | NavCanada | Ottawa, Ontario | Field Technician

Collected water samples from inlet and outlet valves on either end of heat exchangers and completed reporting for the project.

HYDROGEOLOGY

TransCanada Energy PTTW/EASR applications | TransCanada Energy | Report Author

Provided assistance in the preparing PTTW and EASR applications in support of pipeline modifications being made to TC infrastructure in northern Ontario.

Greenbank Road Realignment | City of Ottawa | Field Technician and Report Author

Deployed and collected level loggers at twelve monitoring well locations and conducted slug tests at each location to support a realignment project at Greenbank Road. Performed K-test analysis of the data and subsequent reporting.

Various support roles | Environmental Scientist

Provided support to various hydrogeological assessments for projects all around Ontario (mostly the Ottawa and GTA regions) by correcting level logger data, creating hydrographs, and k-test analysis. Provided additional support through the preparation of EASR and PTTW reports.

Shadow Ridge Production Wells | City of Ottawa

Site supervision during the drilling of two municipal production wells being drilled to augment the Shadow Ridge Well System to supply over 2,000 local residents for the proposed community developments in Greely, Ontario. Conducted on-site interviews with local residents to plan and coordinate pumping tests using the domestic, installed level loggers, and prepared the EASR application for the pumping tests.

335 River Road | PSPC | Field Technician

In addition to environmental site assessment including groundwater monitoring and sampling, conducted k-testing at several well locations for hydrogeological assessment.

POTABLE WATER AND LEGIONELLA SAMPLING

SPIB (formerly PPB) Annual Drinking Water Quality Assessment | PSPC | Ottawa, ON, Canada | 2020-present | Project Manager and Field Technician

Project management and coordination for the annual and bi-monthly sampling and drinking water quality assessment of 40 buildings located in the Science and Parliamentary Infrastructure Branch for the Canadian Federal Government located in downtown Ottawa, Ontario. Also provides technical assistance to field technicians executing field program and proposal writing for upcoming drinking water quality assessment bids. Previous role of field technician also included executing field program and reporting writing.

PSPC Potable Water and Flushing Program | Public Services and Procurement Canada | 2019-Present | Project Manager and Field Technician

Conducted field work including accounting fixtures, flushing fixtures, and collecting potable water samples across various federally-owned or leased sites in Ottawa. Assisted project managers in coordination of field work including scheduling and planning of site work and, preparing site specific field forms and writing proposals. Report writing upon completion of field programs. Project management of various potable water programs includes providing services for urgent sampling requests, providing notifications for potable water exceedances, efficient budget tracking, and continuous client communication to ensure successful project execution and completion.

EMPLOYMENT HISTORY

TC Energy (Formerly TransCanada Pipelines Ltd.)

SCADA Technician (Contract)

2017 - 2017 · 1 year

Point-to-point verification of several key North American pipelines and implementation of CygNet and OASyS SCADA systems.

Blaze Energy Ltd.

Geologist-In-Training

2016 - 2017 · 1 year

Characterization of shale gas plays in the Deep

Basin, Alberta, and the Western Canadian Sedimentary Basin. Development of the company's first horizontal production plan.

Suncor Energy Ltd.

Geology Intern

2015 - 2015 · 1 year

Large-scale exploration of US Gulf of Mexico deep-water assets.

Blaze Energy Ltd.

Geology Intern.

2015 - 2015 · 1 year

Characterization of shale-gas plays in the Deep Basin.

Appendix E Supporting Documentation





DATABASE REPORT

Project Property: *Hamilton Avenue, Spencer Avenue,
Parkdale Avenue and Armstrong Street
Block
Hamilton Avenue, Spencer Avenue,
Parkdale Avenue and Armstrong Street
Block
Ottawa ON K1Y 1B4*

Project No: *122170424.600*

Report Type: *Standard Report*

Order No: *23030600564*

Requested by: *Stantec Consulting Ltd.*

Date Completed: *March 9, 2023*

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	6
Executive Summary: Site Report Summary - Surrounding Properties.....	7
Executive Summary: Summary By Data Source.....	37
Map.....	74
Aerial.....	75
Topographic Map.....	76
Detail Report.....	77
Unplottable Summary.....	498
Unplottable Report.....	503
Appendix: Database Descriptions.....	538
Definitions.....	547

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: *Hamilton Avenue, Spencer Avenue, Parkdale Avenue and Armstrong Street Block
Hamilton Avenue, Spencer Avenue, Parkdale Avenue and Armstrong Street Block
Ottawa ON K1Y 1B4*

Project No: *122170424.600*

Coordinates:

Latitude: *45.4021131*
Longitude: *-75.7305209*
UTM Northing: *5,027,881.18*
UTM Easting: *442,827.95*
UTM Zone: *18T*

Elevation: *206 FT
62.88 M*

Order Information:

Order No: *23030600564*
Date Requested: *March 6, 2023*
Requested by: *Stantec Consulting Ltd.*
Report Type: *Standard Report*

Historical/Products:

Aerial Photographs *Aerials - National Collection*
City Directory Search *CD - Subject Site plus 10 Adjacent Properties*
ERIS Xplorer [*ERIS Xplorer*](#)
Insurance Products *Fire Insurance Maps/Inspection Reports/Site Plans*

Executive Summary: Report Summary

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Within 0.25 km</i>	<i>Total</i>
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	0	0
CA	Certificates of Approval	Y	0	14	14
CDRY	Dry Cleaning Facilities	Y	0	0	0
CFOT	Commercial Fuel Oil Tanks	Y	0	0	0
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	15	15
EASR	Environmental Activity and Sector Registry	Y	0	3	3
EBR	Environmental Registry	Y	0	2	2
ECA	Environmental Compliance Approval	Y	0	6	6
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	0	55	55
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	0	0
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	11	11
FSTH	Fuel Storage Tank - Historic	Y	0	1	1
GEN	Ontario Regulation 347 Waste Generators Summary	Y	0	113	113
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	1	1
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Within 0.25 km</i>	<i>Total</i>
INC	Fuel Oil Spills and Leaks	Y	0	1	1
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory	Y	0	0	0
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	1	1
PINC	Pipeline Incidents	Y	0	5	5
PRT	Private and Retail Fuel Storage Tanks	Y	0	5	5
PTTW	Permit to Take Water	Y	0	1	1
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	2	2
RST	Retail Fuel Storage Tanks	Y	0	3	3
SCT	Scott's Manufacturing Directory	Y	0	19	19
SPL	Ontario Spills	Y	0	21	21
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	0	103	103
		Total:	0	382	382

Executive Summary: Site Report Summary - Project Property

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number

No records found in the selected databases for the project property.

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
1	WWIS		233 ARMSTRONG Ottawa ON Well ID: 7220783	WNW/3.5	0.00	77
2	WWIS		3 Hamilton Ave Ottawa ON Well ID: 7343185	ESE/5.2	0.00	80
3	WWIS		229 Armstrong St Ottawa ON Well ID: 7343178	E/6.2	0.00	83
4	WWIS		340 PARKDALE AVE Ottawa ON Well ID: 7342140	N/7.9	0.00	87
5	WWIS		Ottawa ON Well ID: 7343187	ESE/9.6	0.00	91
6	WWIS		366 ARMSTRONG ST Ottawa ON Well ID: 7276808	E/11.4	0.00	95
6	WWIS		2323 RIVERSIDE RD Ottawa ON Well ID: 7275422	E/11.4	0.00	98
7	WWIS		Parkdale + Hamilton St. Ottawa ON Well ID: 7343184	ESE/11.8	0.00	101
8	WWIS		340 PARKDALE AVE Ottawa ON Well ID: 7342139	NE/12.4	0.00	105
9	WWIS		2323 RIVERSIDE DR Ottawa ON Well ID: 7275421	ENE/13.5	0.00	109
10	SCT	ADD ELECTRONICS INC.	233 Armstrong St Ottawa ON K1Y 2W5	SSW/13.7	0.00	112
11	GEN	HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION P.O. BOX 3160, STATION "C" 3 HAMILTON AV OTTAWA ON K1Y 4J4	NNW/14.5	0.00	113

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>11</u>	GEN	HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>113</u>
<u>11</u>	GEN	HONEYWELL LIMITED 35-071	SPERRY AEROSPACE DIVISION P.O. BOX 3160,STATION "C" 3 HAMILTON AV OTTAWA ON K1Y 4J4	NNW/14.5	0.00	<u>114</u>
<u>11</u>	GEN	SPERRY INC	AEROSPACE & MARINE GROUP 3 HAMILTON AVE. N., P.O. BOX 390 OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>114</u>
<u>11</u>	GEN	SPERRY SEE&USE ON0144004	AEROSPACE & MARINE GROUP 3 HAMILTON AVE. N., P.O. BOX 390 OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>115</u>
<u>11</u>	GEN	SPERRY SEE&USE ON0144004 35-071	AEROSPACE & MARINE GROUP 3 HAMILTON AVE. N., P.O. BOX 390 OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>115</u>
<u>11</u>	GEN	SPERRY (SEE&USE ON0144004)	AEROSPACE & MARINE GROUP 3 HAMILTON AVENUE NORTH OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>116</u>
<u>11</u>	EBR	Honeywell Limited	Adjacent to 3 Hamilton Avenue, Ottawa, Ontario CITY OF OTTAWA ON	NNW/14.5	0.00	<u>116</u>
<u>11</u>	PTTW	Honeywell Limited	3 Hamilton Ave, 223 & 233 Armstrong Street CITY OF OTTAWA ON	NNW/14.5	0.00	<u>116</u>
<u>11</u>	GEN	HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>117</u>
<u>11</u>	GEN	HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>117</u>
<u>11</u>	GEN	HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 4J4	NNW/14.5	0.00	<u>118</u>
<u>11</u>	ECA	Honeywell Limited	3 Hamilton Ave 223 & 233 Armstrong Street Ottawa ON M2H 3N7	NNW/14.5	0.00	<u>118</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>11</u>	GEN	HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>119</u>
<u>11</u>	GEN	HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>119</u>
<u>11</u>	GEN	HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>120</u>
<u>11</u>	GEN	HONEYWELL LIMITED Aerospace Electronic Systems	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>120</u>
<u>11</u>	GEN	HONEYWELL LIMITED Aerospace Electronic Systems	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>121</u>
<u>11</u>	GEN	HONEYWELL LIMITED Aerospace Electronic Systems	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>121</u>
<u>11</u>	GEN	HONEYWELL LIMITED Aerospace Electronic Systems	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW/14.5	0.00	<u>122</u>
<u>12</u>	EASR	HONEYWELL LIMITED/HONEYWELL LIMITEE	229 Armstrong ST Ottawa ON K1Y 2W5	ESE/17.1	0.00	<u>123</u>
<u>13</u>	WWIS		229 Armstrong St Ottawa ON Well ID: 7343177	SE/18.2	0.00	<u>123</u>
<u>14</u>	WWIS		Ottawa ON Well ID: 7343186	ESE/18.5	0.00	<u>126</u>
<u>15</u>	WWIS		3 Hamilton Ave Ottawa ON Well ID: 7343183	SE/23.0	0.00	<u>130</u>
<u>16</u>	ECA	Anco Homes Ltd.	ON K0A 3K0	SE/26.7	0.00	<u>134</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>17</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041973	N/28.8	0.00	<u>134</u>
<u>18</u>	WWIS		Armstrong St. Ottawa ON Well ID: 7343191	ESE/30.8	0.00	<u>137</u>
<u>19</u>	WWIS		223 Armstrong St Ottawa ON Well ID: 7343181	ESE/31.0	0.00	<u>142</u>
<u>20</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041962	W/33.0	0.31	<u>145</u>
<u>21</u>	WWIS		3 HAMILTON AVE. NORTH ON Well ID: 7107670	E/33.1	0.00	<u>148</u>
<u>22</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7042084	ENE/33.1	0.00	<u>151</u>
<u>23</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041961	WSW/33.7	1.00	<u>153</u>
<u>24</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041974	N/33.9	0.00	<u>156</u>
<u>25</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041963	W/33.9	0.31	<u>159</u>
<u>26</u>	WWIS		Armstrong St Ottawa ON Well ID: 7343200	SSE/34.2	0.00	<u>161</u>
<u>27</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041980	NE/34.3	0.00	<u>165</u>
<u>28</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041981	E/36.0	0.00	<u>168</u>
<u>29</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041964	W/37.6	0.31	<u>170</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>30</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041960	SW/38.3	1.00	<u>173</u>
<u>31</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041976	W/38.7	0.31	<u>176</u>
<u>32</u>	WWIS		Parkdale Ave Ottawa ON Well ID: 7343166	E/39.3	0.00	<u>178</u>
<u>33</u>	WWIS		ON Well ID: 7386176	ESE/39.6	0.00	<u>182</u>
<u>34</u>	WWIS		Parkdale Ottawa ON Well ID: 7343163	ENE/40.8	0.00	<u>183</u>
<u>35</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041969	WNW/41.6	0.00	<u>187</u>
<u>36</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041965	WNW/41.7	0.31	<u>189</u>
<u>37</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041970	NW/42.3	0.00	<u>192</u>
<u>38</u>	WWIS		parkdale Ave Ottawa ON Well ID: 7343164	ENE/43.8	0.00	<u>194</u>
<u>39</u>	WWIS		366 Parkdale Ave Ottawa ON Well ID: 7343169	ESE/44.2	0.00	<u>198</u>
<u>40</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041968	WNW/44.5	0.00	<u>202</u>
<u>41</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041966	WNW/44.8	0.00	<u>205</u>
<u>42</u>	WWIS		PARKDALE AVE Ottawa ON Well ID: 7343193	ESE/44.8	0.00	<u>207</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
43	WWIS		231 ARMSTRONG Ottawa ON Well ID: 7276809	E/45.0	0.00	211
44	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041971	NW/45.3	0.00	215
45	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041967	WNW/45.8	0.00	217
46	WWIS		ON Well ID: 7200459	S/46.6	0.31	220
47	WWIS		PARKDALE AVE Ottawa ON Well ID: 7343192	E/46.8	0.00	221
48	WWIS		Parkdale Ottawa ON Well ID: 7343162	ESE/47.0	0.00	225
49	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041978	NE/47.3	0.00	229
50	SPL	Enbridge Gas Distribution Inc.	infront of 228 Armstrong St Ottawa ON	ESE/47.5	0.00	231
50	PINC	PIPELINE HIT 1.25"	228 ARMSTRONG ST.,OTTAWA,ON,K1Y 4T1,CA ON	ESE/47.5	0.00	232
51	WWIS		Parkdale Ave Ottawa ON Well ID: 7343165	E/47.9	0.00	232
52	WWIS		ON Well ID: 7385911	ESE/48.7	0.00	237
53	WWIS		Parkdale Ave Ottawa ON Well ID: 7343190	ENE/48.8	0.00	238
54	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041972	NW/49.2	0.00	242

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>55</u>	WWIS		PARKDALE Ave Ottawa ON Well ID: 7343198	SSE/50.3	0.00	<u>245</u>
<u>56</u>	WWIS		PARKDALE Ave Ottawa ON Well ID: 7343196	SE/51.2	0.00	<u>248</u>
<u>57</u>	WWIS		Parkdale Ave Ottawa ON Well ID: 7343189	E/51.3	0.00	<u>252</u>
<u>58</u>	WWIS		Parkdale Ottawa ON Well ID: 7343180	ESE/51.8	0.00	<u>257</u>
<u>58</u>	WWIS		ON Well ID: 7385914	ESE/51.8	0.00	<u>261</u>
<u>59</u>	WWIS		PARKDALE Ottawa ON Well ID: 7343194	SE/53.4	0.00	<u>262</u>
<u>60</u>	WWIS		Parkdale Ottawa ON Well ID: 7343179	ESE/54.2	0.00	<u>266</u>
<u>61</u>	CA	OTTAWA CITY	PARKDALE AVE/ARMSTRONG ST. OTTAWA CITY ON	E/54.2	0.00	<u>270</u>
<u>61</u>	CA	R.M. OF OTTAWA-CARLETON	PARKDALE AVE/ARMSTRONG ST. OTTAWA CITY ON	E/54.2	0.00	<u>270</u>
<u>62</u>	WWIS		ON Well ID: 7385912	ESE/55.8	0.00	<u>270</u>
<u>63</u>	SCT	Canadian Criminal Justice Assn	320 Parkdale Ave Suite 101 Ottawa ON K1Y 4X9	NNW/56.4	0.00	<u>271</u>
<u>63</u>	SPL		320 Parkdale Ave Ottawa ON	NNW/56.4	0.00	<u>271</u>
<u>63</u>	INC		320 PARKDALE AVE, OTTAWA ON	NNW/56.4	0.00	<u>272</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>64</u>	WWIS		PARKDALE Ave Ottawa ON Well ID: 7343195	SE/56.4	0.00	<u>272</u>
<u>65</u>	WWIS		7 HINTON AVE Ottawa ON Well ID: 7166778	WSW/56.8	1.00	<u>276</u>
<u>66</u>	WWIS		7 HINTON AVE Ottawa ON Well ID: 7166779	W/57.5	1.00	<u>280</u>
<u>67</u>	WWIS		366 Parkdale Ave Ottawa ON Well ID: 7343170	ESE/57.6	0.00	<u>283</u>
<u>68</u>	CA	R.M. OF OTTAWA-CARLETON	HAMILTON ST./SPENCER ST. OTTAWA ON	WNW/57.7	0.00	<u>287</u>
<u>69</u>	SPL	OTTAWA HYDRO	4 HAMILTON ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	W/57.9	1.00	<u>287</u>
<u>70</u>	WWIS		ON Well ID: 7385913	ESE/58.7	0.00	<u>288</u>
<u>71</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041979	ENE/59.3	0.00	<u>289</u>
<u>72</u>	WWIS		PARKDALE Ave Ottawa ON Well ID: 7343197	ESE/61.7	0.00	<u>291</u>
<u>73</u>	WWIS		ON Well ID: 7385910	ESE/61.9	0.00	<u>295</u>
<u>74</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041975	NNE/61.9	0.00	<u>296</u>
<u>75</u>	WWIS		Parkdale Ave Ottawa ON Well ID: 7343188	E/64.4	0.00	<u>299</u>
<u>76</u>	SCT	Artech Studios	6 Hamilton Ave N Suite 250 Ottawa ON K1Y 4R1	WSW/64.6	1.00	<u>303</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>77</u>	WWIS		PARKDALE Ave Ottawa ON Well ID: 7343199	SE/65.8	0.15	<u>304</u>
<u>78</u>	EHS		341 Parkdale Avenue Ottawa ON K1Y 2W3	ENE/66.2	0.00	<u>307</u>
<u>78</u>	EHS		341 Parkdale Avenue Ottawa ON K1Y 2W3	ENE/66.2	0.00	<u>308</u>
<u>78</u>	EHS		341 Parkdale Avenue Ottawa ON K1Y 2W3	ENE/66.2	0.00	<u>308</u>
<u>79</u>	SCT	GRAPHIC DISPLAY CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	NW/66.3	0.00	<u>308</u>
<u>79</u>	SCT	FUJI GRAPHIC SYSTEMS CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	NW/66.3	0.00	<u>308</u>
<u>79</u>	SCT	THE ENVELOPE HOUSE	45 SPENCER ST OTTAWA ON K1Y 2P5	NW/66.3	0.00	<u>309</u>
<u>79</u>	SCT	GRAPHIC DISPLAY CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	NW/66.3	0.00	<u>309</u>
<u>79</u>	SCT	Graphic Display Canada - A St-Joseph Corporation Company	45 Spencer St Ottawa ON K1Y 2P5	NW/66.3	0.00	<u>309</u>
<u>79</u>	GEN	GRAPHIC DISPLAY CANADA	DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	NW/66.3	0.00	<u>309</u>
<u>79</u>	GEN	GRAPHIC DISPLAY CANADA 18-125	DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	NW/66.3	0.00	<u>310</u>
<u>79</u>	GEN	GRAPHIC DISPLAY CANADA	M.O.M. PRINTING LIMITED, A DIVISION OF 45 SPENCER STREET OTTAWA ON K1Y 2P5	NW/66.3	0.00	<u>310</u>
<u>80</u>	WWIS		Parkdale Ave Ottawa ON Well ID: 7343182	ESE/70.8	0.00	<u>311</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>81</u>	WWIS		366 Parkdale Ave Ottawa ON Well ID: 7343168	SE/70.9	0.00	<u>314</u>
<u>82</u>	WWIS		7 HINTON AVE OTTAWA ON Well ID: 7192836	WSW/75.6	1.00	<u>318</u>
<u>83</u>	WWIS		Parkdale Ave Ottawa ON Well ID: 7343172	ESE/77.5	0.00	<u>322</u>
<u>84</u>	WWIS		ON Well ID: 7385915	SE/80.8	0.00	<u>327</u>
<u>85</u>	WWIS		7 HINTON AVE. Ottawa ON Well ID: 7119461	W/82.1	1.00	<u>328</u>
<u>86</u>	WWIS		ON Well ID: 7383510	NW/83.0	0.00	<u>336</u>
<u>87</u>	WWIS		Parkdale Ave Ottawa ON Well ID: 7343171	ESE/84.5	0.00	<u>337</u>
<u>88</u>	WWIS		Parkdale Ave Ottawa ON Well ID: 7343167	SE/84.7	0.00	<u>342</u>
<u>89</u>	EHS		323 Parkdall Ave Ottawa ON	NNE/86.7	0.00	<u>346</u>
<u>90</u>	EHS		260 Armstrong Street Ottawa ON K1Y 2W6	SW/87.6	1.00	<u>346</u>
<u>90</u>	EHS		260 Armstrong Street Ottawa ON K1Y 2W6	SW/87.6	1.00	<u>346</u>
<u>91</u>	WWIS		3 HAMILTON AVE NORTH ON Well ID: 7041977	NE/88.2	-1.00	<u>346</u>
<u>92</u>	WWIS		ON Well ID: 7203872	SE/90.3	0.00	<u>349</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>93</u>	EHS		262 Armstrong Street Ottawa ON K1Y 2W6	SW/95.5	1.00	<u>350</u>
<u>93</u>	EHS		262 Armstrong Street Ottawa ON K1Y 2W6	SW/95.5	1.00	<u>350</u>
<u>93</u>	EHS		262 Armstrong Street Ottawa ON K1Y 2W6	SW/95.5	1.00	<u>350</u>
<u>94</u>	EHS		12 Hamilton Ave N Ottawa ON	SSW/98.2	1.00	<u>350</u>
<u>95</u>	WWIS		ON Well ID: 7389506	NW/100.9	0.00	<u>351</u>
<u>96</u>	EHS		312 Parkdale Avenue Ottawa ON K1Y 4X9	NNW/110.1	0.00	<u>351</u>
<u>97</u>	EHS		7 Hinton Ave N Ottawa ON K1Y4P1	WSW/112.0	1.00	<u>352</u>
<u>98</u>	SCT	VOGUE BRASSIERE INC.	7 HINTON AVE N OTTAWA ON K1Y 4P1	WSW/112.1	1.00	<u>352</u>
<u>98</u>	SCT	CANADIAN ARCTIC RESOURCES COMM	7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	WSW/112.1	1.00	<u>352</u>
<u>98</u>	SCT	Canadian Arctic Resources Committee Inc.	7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	WSW/112.1	1.00	<u>353</u>
<u>98</u>	GEN	Metcalf Realty Company Limited	7 Hinton Avenue Ottawa ON	WSW/112.1	1.00	<u>353</u>
<u>98</u>	EHS		7 Hinton Ave N. Ottawa ON K1Y 4P1	WSW/112.1	1.00	<u>353</u>
<u>98</u>	GEN	METCALFE REALTY LIMITED	7 HINTIN AVE., NORTH OTTAWA ON	WSW/112.1	1.00	<u>353</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>98</u>	GEN	Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	WSW/112.1	1.00	<u>354</u>
<u>98</u>	GEN	Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	WSW/112.1	1.00	<u>354</u>
<u>99</u>	EHS		312 Parkdale Avenue Ottawa ON K1Y 4X9	N/112.9	0.00	<u>354</u>
<u>99</u>	EHS		312 Parkdale Avenue Ottawa ON K1Y 4X9	N/112.9	0.00	<u>355</u>
<u>99</u>	EHS		312 Parkdale Avenue Ottawa ON K1Y 4X9	N/112.9	0.00	<u>355</u>
<u>100</u>	GEN	CAA NORTH & EAST ONTARIO	16 HAMILTON AVENUE OTTAWA ON	SSW/115.6	1.00	<u>355</u>
<u>100</u>	EHS		16 Hamilton Avenue North Ottawa ON K1Y 1B6	SSW/115.6	1.00	<u>355</u>
<u>101</u>	EHS		211 Armstrong Street Ottawa ON K1Y 2W4	E/121.8	0.00	<u>356</u>
<u>101</u>	EHS		211 Armstrong Street Ottawa ON K1Y 2W4	E/121.8	0.00	<u>356</u>
<u>101</u>	EHS		211 Armstrong Street Ottawa ON K1Y 2W4	E/121.8	0.00	<u>356</u>
<u>102</u>	EHS		79 Hinton Avenue North Ottawa ON K1Y 0Z7	SW/124.8	1.00	<u>356</u>
<u>103</u>	WWIS		366 PARKDALE AVE. Ottawa ON Well ID: 7133809	SE/125.9	1.00	<u>356</u>
<u>104</u>	WWIS		366 PARKDALE AVE. Ottawa ON Well ID: 7133808	SSE/126.4	1.00	<u>360</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>105</u>	CA	OTTAWA CITY - PHINEY ST. /HOLLAND AVE.	ARMSTRONG ST./HINTON AVE. N OTTAWA CITY ON	WSW/126.6	1.00	<u>363</u>
<u>106</u>	SPL	UNKNOWN	OFFICE BLDG AT 383 PARKDALE AVE IN THE SUMP PUMP HOLES IN PARKING GARAGE OTTAWA CITY ON K1Y 4R4	ESE/127.8	0.00	<u>363</u>
<u>106</u>	SCT	Myropen Publications Ltd.	383 Parkdale Ave Suite 402 Ottawa ON K1Y 4R4	ESE/127.8	0.00	<u>364</u>
<u>106</u>	SCT	GEM Software Scheduling	383 Parkdale Av Suite 304 Ottawa ON K1Y 4R4	ESE/127.8	0.00	<u>364</u>
<u>106</u>	GEN	Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE/127.8	0.00	<u>364</u>
<u>106</u>	GEN	Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE/127.8	0.00	<u>365</u>
<u>106</u>	GEN	Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE/127.8	0.00	<u>365</u>
<u>106</u>	GEN	GEM Health Care Services (2011) Inc.	383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	ESE/127.8	0.00	<u>365</u>
<u>106</u>	GEN	GEM Health Care Services (2011) Inc.	383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	ESE/127.8	0.00	<u>366</u>
<u>106</u>	GEN	Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE/127.8	0.00	<u>366</u>
<u>106</u>	GEN	Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE/127.8	0.00	<u>366</u>
<u>106</u>	GEN	GEM Health Care Services (2011) Inc.	383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	ESE/127.8	0.00	<u>367</u>
<u>107</u>	CA	R.M. OF OTTAWA-CARLETON	PINEHURST AVE./OXFORD ST. OTTAWA ON	NE/128.8	-1.00	<u>367</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>108</u>	WWIS		ON Well ID: 7122598	NW/129.1	0.00	<u>367</u>
<u>109</u>	WWIS		6 HINTON AVE. Ottawa ON Well ID: 7126433	WSW/130.2	1.00	<u>368</u>
<u>110</u>	EASR	2145675 ONTARIO INC.	20 Hamilton AV N_FR Ottawa ON K1Y 1B6	S/133.5	1.00	<u>371</u>
<u>110</u>	RSC	HAMILTON AVENUE HOLDINGS INC.	20 HAMILTON AVENUE NORTH, OTTAWA, ON K1Y 1B6 Ottawa ON	S/133.5	1.00	<u>371</u>
<u>111</u>	WWIS		22 HAMILTON AVE Ottawa ON Well ID: 7180987	S/135.2	1.00	<u>372</u>
<u>112</u>	GEN	Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE/135.7	0.00	<u>376</u>
<u>112</u>	GEN	GEM Health Care Services (2011) Inc.	383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	ESE/135.7	0.00	<u>377</u>
<u>113</u>	GEN	CYBERMEDIX HEALTH (OUT OF BUSINESS)	44 HINTON AVE OTTAWA ON K1Y 1B3	WSW/137.3	1.00	<u>377</u>
<u>114</u>	EHS		22 Hamilton Ave N Ottawa ON K1Y 1B6	S/137.7	1.00	<u>377</u>
<u>115</u>	PINC	ENBRIDGE GAS INC	22 HAMILTON AVE N,,OTTAWA,ON,K1Y 1B6,CA ON	S/143.5	1.00	<u>377</u>
<u>116</u>	WWIS		ON Well ID: 7389946	S/144.2	1.00	<u>378</u>
<u>117</u>	PRT	785730 ONTARIO INC	1175 WELLINGTON ST OTTAWA ON K1Y 2Y9	SE/150.7	0.00	<u>379</u>
<u>117</u>	PRT	785730 ONTARIO INC	1175 WELLINGTON ST OTTAWA ON K1Y2Y9	SE/150.7	0.00	<u>379</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>117</u>	DTNK	785730 ONTARIO INC	1175 WELLINGTON ST OTTAWA ON	SE/150.7	0.00	<u>379</u>
<u>117</u>	DTNK	785730 ONTARIO INC	1175 WELLINGTON ST OTTAWA ON K1Y 2Y9	SE/150.7	0.00	<u>380</u>
<u>118</u>	PINC	ENBRIDGE GAS INC	84 HINTON AVE N,,OTTAWA,ON,K1Y 0Z8,CA ON	SW/151.5	1.31	<u>380</u>
<u>119</u>	EHS		300 Parkdale Avenue Ottawa ON K1Y 1B4	NNW/153.7	0.00	<u>381</u>
<u>120</u>	PRT	PARKDALE SUNOCO	390 PARKDALE AV OTTAWA ON K1Y1G6	SE/155.9	1.00	<u>381</u>
<u>120</u>	CA	SUNOCO INC.	390 PARKDALE AVENUE (SWM) OTTAWA CITY ON K1Y 1G6	SE/155.9	1.00	<u>381</u>
<u>120</u>	RST	PARKDALE SUNOCO FUNFOOD	390 PARKDALE AVE OTTAWA ON K1Y 1G6	SE/155.9	1.00	<u>381</u>
<u>120</u>	SPL	Suncor service station<UNOFFICIAL>	390 Parkdale Ave Ottawa ON	SE/155.9	1.00	<u>382</u>
<u>120</u>	FSTH	1496030 ONTARIO INC	390 PARKDALE AV OTTAWA ON K1Y 1G6	SE/155.9	1.00	<u>382</u>
<u>120</u>	FST	SUNCOR ENERGY PRODUCTS PARTNERSHIP	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE/155.9	1.00	<u>383</u>
<u>120</u>	FST	SUNCOR ENERGY PRODUCTS PARTNERSHIP	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE/155.9	1.00	<u>383</u>
<u>120</u>	RST	PARKDALE SUNOCO FUNFOOD	390 PARKDALE AVE OTTAWA ON K1Y1G6	SE/155.9	1.00	<u>384</u>
<u>120</u>	DTNK	6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE/155.9	1.00	<u>384</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>120</u>	DTNK	6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE/155.9	1.00	<u>384</u>
<u>120</u>	DTNK	6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE/155.9	1.00	<u>385</u>
<u>120</u>	RST	PARKDALE SUNOCO FUNFOOD	390 PARKDALE AVE OTTAWA ON K1Y1G6	SE/155.9	1.00	<u>386</u>
<u>120</u>	FST	6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE/155.9	1.00	<u>386</u>
<u>120</u>	FST	SUNCOR ENERGY PRODUCTS PARTNERSHIP	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE/155.9	1.00	<u>386</u>
<u>120</u>	DTNK		390 PARKDALE AVE OTTAWA ON K1Y 1G6	SE/155.9	1.00	<u>387</u>
<u>120</u>	FST	6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE/155.9	1.00	<u>387</u>
<u>120</u>	FST	6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE/155.9	1.00	<u>388</u>
<u>120</u>	FST	SUNCOR ENERGY PRODUCTS PARTNERSHIP	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE/155.9	1.00	<u>388</u>
<u>121</u>	WWIS		6 HINTON AVE. Ottawa ON Well ID: 7126434	WSW/156.2	1.00	<u>389</u>
<u>122</u>	WWIS		1195 WELLINGTON ST W Ottawa ON Well ID: 7232122	SSE/156.7	1.00	<u>392</u>
<u>123</u>	SCT	M O M PRINTING	300 PARKDALE AVE OTTAWA ON K1Y 1G2	NNW/157.0	0.00	<u>395</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>123</u>	SCT	ST-JOSEPH M.O.M. PRINTING	300 Parkdale Ave Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>395</u>
<u>123</u>	GEN	M.O.M. PRINTING	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	NNW/157.0	0.00	<u>395</u>
<u>123</u>	GEN	M.O.M. PRINTING	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	NNW/157.0	0.00	<u>396</u>
<u>123</u>	GEN	M.O.M. PRINTING 25-205	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	NNW/157.0	0.00	<u>396</u>
<u>123</u>	GEN	M.O.M. PRINTING	300 Parkdale Ave Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>397</u>
<u>123</u>	GEN	Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>397</u>
<u>123</u>	SCT	Scintrex Trace Corp.	300 Parkdale Ave Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>398</u>
<u>123</u>	EHS		300 Parkdale Avenue Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>398</u>
<u>123</u>	GEN	Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>398</u>
<u>123</u>	GEN	Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>399</u>
<u>123</u>	GEN	Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>399</u>
<u>123</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>400</u>
<u>123</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>400</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>123</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>401</u>
<u>123</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>402</u>
<u>123</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>402</u>
<u>123</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>403</u>
<u>123</u>	SPL	Waste Connections of Canada Inc. as general partner for and on behalf of Ridge	(Chatham) Holdings L.P. 300 Parkdale Ave Ottawa ON	NNW/157.0	0.00	<u>404</u>
<u>123</u>	GEN	Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>404</u>
<u>123</u>	EHS		300 Parkdale Avenue Ottawa ON K1Y 1G2	NNW/157.0	0.00	<u>405</u>
<u>124</u>	WWIS		6 HINTON AVE. Ottawa ON Well ID: 7126432	WSW/157.1	1.00	<u>405</u>
<u>125</u>	WWIS		1195 WELLINGTON ST W Ottawa ON Well ID: 7232120	SSE/162.7	1.00	<u>408</u>
<u>126</u>	EHS		25 Grant Street Ottawa ON K1Y 2W8	E/164.2	0.00	<u>411</u>
<u>126</u>	EHS		25 Grant Street Ottawa ON K1Y 2W8	E/164.2	0.00	<u>411</u>
<u>126</u>	EHS		25 Grant Street Ottawa ON K1Y 2W8	E/164.2	0.00	<u>411</u>
<u>127</u>	SPL	PRIVATE RESIDENCE	20 PINEHURST AVE. FURNACE OIL TANK OTTAWA CITY ON K1Y 1K3	NNE/165.7	-1.00	<u>412</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
128	WWIS		7 MINTON AVE OTTAWA ON Well ID: 7192835	WSW/166.0	1.00	412
129	SPL	PRIVATE OWNER	395 PARKDALE TRANSPORT TRUCK (CARGO) OTTAWA ON K1Y 4V4	SE/167.3	1.00	415
129	GEN	Ottawa Community Housing Corp.	395 Parkdale Ave. Ottawa ON K1Y 4V4	SE/167.3	1.00	416
130	WWIS		1195 WELLINGTON ST W Ottawa ON Well ID: 7232121	SSE/168.4	1.00	416
131	EHS		84 Hinton Ave N Ottawa ON K1Y0Z8	SW/172.8	2.00	420
132	EHS		1195 Wellington Street West Ottawa Ontario Ottawa ON K1Y 2Z6	SSE/173.5	1.00	420
132	EHS		1195 Wellington Street West Ottawa Ontario Ottawa ON K1Y 2Z6	SSE/173.5	1.00	420
132	EHS		1195 Wellington Street West Ottawa Ontario Ottawa ON K1Y 2Z6	SSE/173.5	1.00	420
133	GEN	VIC'S HARDROCK CYCLE	1203 WELLINGTON STREET OTTAWA ON K1Y 2Z8	S/175.0	1.00	420
134	GEN	MARQUARDT PRINTING	1195 WELLINGTON STREET OTTAWA ON K1Y 2Z6	SSE/175.3	1.00	421
134	EHS		1195 Wellington St W Ottawa ON K1Y2Z6	SSE/175.3	1.00	421
135	SCT	Merge Business Solutions	1165 Wellington St W Ottawa ON K1Y 2Y9	ESE/176.8	0.00	421
136	WWIS		7 HINTON AVE OTTAWA ON	WSW/179.0	1.00	422

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7192834			
137	EHS		71 Holland Ottawa ON	WSW/180.2	1.00	425
138	EHS		1 Hamilton Avenue North ottawa ON K1Y 1B5	NW/182.3	0.00	425
138	GEN	ONTARIO PETROLEUM PUMP	1 HAMILTON AVE N OTTAWA ON K1Y 1B5	NW/182.3	0.00	425
139	SPL		Parkdale Ave. & Wellington St. Ottawa ON	SE/183.9	1.00	426
140	GEN	Rexall Pharmacy Group Ltd.	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE/185.8	1.00	426
141	EHS		77 Holland Ave Ottawa ON K1Y 0Y1	WSW/186.8	1.00	427
142	GEN	Welldale Limited Partnership	1186-1194 Wellington Street West Ottawa ON K1Y 2Z1	SSE/187.4	1.00	427
143	SPL	PRIVATE RESIDENCE	79 HOLLAND AVENUE FURNACE OIL TANK OTTAWA CITY ON K1Y 0Y1	WSW/188.5	2.00	427
144	GEN	CCC476	45 Holland Ave. Ottawa ON K1Y 4S3	W/188.7	1.00	428
145	SPL	Tomlinson Environmental Services Ltd	83 Holland Ave Ottawa ON	WSW/189.1	2.00	428
146	WWIS		1161 WELLINGTON ST OTTAWA ON Well ID: 7044709	E/190.5	0.00	429
147	GEN	OLIVER, MANGIONE, MCCALLA & ASSOC.	LTD. 154 COLONNADE RD. SOUTH NEPEAN ON K2E 7J5	ENE/191.2	-1.00	432
147	GEN	OLIVER, MANGIONE, MCCALLA AND	ASSOCIATES LIMITED 154 COLONNADE ROAD SOUTH NEPEAN ON K2E 7J5	ENE/191.2	-1.00	432

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
147	GEN	OLIVER, MANGIONE, MCCALLA & ASSOC.29-465	LTD. 154 COLONNADE RD. SOUTH NEPEAN ON K2E 7J5	ENE/191.2	-1.00	432
147	GEN	OLIVER, MANGIONE, MCCALLA AND	154 COLONNADE ROAD SOUTH NEPEAN ON K2E 7J5	ENE/191.2	-1.00	433
147	EHS		154 Colonnade Rd S Nepean ON K1Y 2R7	ENE/191.2	-1.00	433
147	EHS		154 Colonnade Rd S Nepean ON K1Y 2R7	ENE/191.2	-1.00	433
147	EHS		154 Colonnade Rd S Nepean ON K1Y 2R7	ENE/191.2	-1.00	434
148	HINC		85 HOLLAND AVENUE OTTAWA ON K1Y 0Y1	SW/191.4	1.85	434
149	EHS		1560 Scott Street Ottawa ON K1Y	WNW/193.7	0.00	434
150	EHS		1161-1171 Wellington Ave Ottawa ON	ESE/198.4	1.00	434
150	EHS		1161 Wellington St W Ottawa ON K1Y2Z1	ESE/198.4	1.00	435
150	SPL		1161 Wellington St. W Ottawa ON	ESE/198.4	1.00	435
151	CA	City of Ottawa	Hamilton Avenue and Bullman Street Ottawa ON	NW/202.4	0.00	435
151	ECA	City of Ottawa	Hamilton Avenue and Bullman Street Ottawa ON K2G 6J8	NW/202.4	0.00	436
152	EHS		1188 Wellington St. W Ottawa ON K1Y 2Z5	SSE/204.9	1.00	436

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
152	EHS		1188 Wellington St. W Ottawa ON K1Y 2Z5	SSE/204.9	1.00	436
152	EHS		1188 Wellington St. W Ottawa ON K1Y 2Z5	SSE/204.9	1.00	436
153	EHS		91 & 83 Holland Avenue Ottawa ON	SW/209.3	2.00	436
153	EHS		91 & 83 Holland Avenue Ottawa ON	SW/209.3	2.00	437
154	CA	OTTAWA CITY - PARKDALE AVE./SPENCER ST.	OXFORD ST./HINCHEY ST. OTTAWA CITY ON	ENE/209.5	-1.00	437
155	WWIS		1156 WELLINGTON STREET WEST Ottawa ON <i>Well ID: 7203873</i>	SE/211.3	1.00	437
155	GEN	Doran Contractors Limited	1166 Wellington Stree West Ottawa ON K1V 8Y3	SE/211.3	1.00	441
155	WWIS		1166 WELLINGTON ST Ottawa ON <i>Well ID: 7315271</i>	SE/211.3	1.00	441
155	SPL		1166 Wellington Street W Ottawa ON	SE/211.3	1.00	444
156	SPL		1190 Wellington Street Ottawa ON	SSE/211.8	1.00	444
156	GEN	Rexall Pharmacy Group Ltd.	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE/211.8	1.00	445
156	GEN	Pharma Plus Drugmarts Ltd	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE/211.8	1.00	445
156	GEN	Pharma Plus Drugmarts Ltd	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE/211.8	1.00	445

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
156	GEN	Rexall Pharmacy Group Ltd.	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE/211.8	1.00	446
156	GEN	Rexall Pharmacy Group Ltd.	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE/211.8	1.00	446
156	GEN	Rexall Pharmacy Group Ltd.	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE/211.8	1.00	447
157	SPL	ESSO PETROLEUM CANADA	ESSO STATION AT 1186 WELLINGTON AT PARKDALE SERVICE STATION OTTAWA CITY ON K1Y 2Z5	SE/212.9	1.00	447
157	SPL	IMPERIAL OIL	IMPERIAL OIL GAS STATION 1186 WELLINGTON AT PARKDALE ESSO SERVICE STATION OTTAWA CITY ON K1Y 2Z5	SE/212.9	1.00	448
157	PRT	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON K1Y2Z5	SE/212.9	1.00	448
157	PRT		1186 WELLINGTON ST. OTTAWA ON	SE/212.9	1.00	448
157	DTNK	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON K1Y 2Z5	SE/212.9	1.00	448
157	DTNK	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON	SE/212.9	1.00	449
157	DTNK	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON	SE/212.9	1.00	450
157	DTNK	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON	SE/212.9	1.00	450
157	DTNK	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON	SE/212.9	1.00	451

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>157</u>	DTNK	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA ON	SE/212.9	1.00	<u>451</u>
<u>157</u>	DTNK	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA ON	SE/212.9	1.00	<u>452</u>
<u>157</u>	DTNK	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA ON	SE/212.9	1.00	<u>453</u>
<u>157</u>	DTNK	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA ON	SE/212.9	1.00	<u>453</u>
<u>157</u>	FST	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	SE/212.9	1.00	<u>454</u>
<u>157</u>	FST	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	SE/212.9	1.00	<u>454</u>
<u>157</u>	FST	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	SE/212.9	1.00	<u>455</u>
<u>157</u>	FST	PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	SE/212.9	1.00	<u>455</u>
<u>158</u>	GEN	CARVERS DRUG-STORE (1971) LIMITED	1200-B WELLINGTON STREET OTTAWA ON K1Y 2Z7	S/213.3	1.31	<u>456</u>
<u>158</u>	GEN	PHARMA PLUS DRUGMARTS LTD.	1200B WELLINGTON STREET OTTAWA ON K1Y 2Z7	S/213.3	1.31	<u>456</u>
<u>158</u>	SCT	Emerald Bakery	1200D Wellington St W Ottawa ON K1Y 2Z7	S/213.3	1.31	<u>457</u>
<u>159</u>	EHS		1194 Wellington St W Ottawa ON Ottawa ON K1Y 2Z5	SSE/213.8	1.00	<u>457</u>
<u>160</u>	PES	HOLISTECH PEST CONTROL INC.	5 GRANT ST.; APT. #2 OTTAWA ON K1Y 2W8	E/214.3	0.00	<u>457</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
161	GEN	Colonnade Development Inc.	1600 Scott St Ottawa ON	NW/216.5	0.00	458
162	GEN	PHARMA PLUS DRUGS LTD	1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	NW/220.4	0.00	458
162	GEN	PHARMA PLUS DRUGS LTD. 31-660	1620 SCOTT STREET, UNIT 29, OTTAWA C/O 5935 AIRPORT ROAD STE. 500 MISSISSAUGA ON K1Y 4S7	NW/220.4	0.00	458
162	GEN	PHARMA PLUS DRUGS LTD.	1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	NW/220.4	0.00	459
162	GEN	PHARMA PLUS DRUGS LTD.	1620 SCOTT STREET, UNIT 29 OTTAWA ON K1Y 4S7	NW/220.4	0.00	459
162	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW/220.4	0.00	459
162	GEN	Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW/220.4	0.00	460
162	GEN	Pharma Plus Drugmarts Ltd	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW/220.4	0.00	460
162	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW/220.4	0.00	461
162	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW/220.4	0.00	461
162	GEN	Pharma Plus Drugmarts Ltd	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW/220.4	0.00	461
162	GEN	Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW/220.4	0.00	462
162	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW/220.4	0.00	462

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>162</u>	GEN	Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW/220.4	0.00	<u>462</u>
<u>162</u>	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW/220.4	0.00	<u>463</u>
<u>162</u>	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW/220.4	0.00	<u>463</u>
<u>162</u>	GEN	Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW/220.4	0.00	<u>464</u>
<u>162</u>	GEN	Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW/220.4	0.00	<u>464</u>
<u>162</u>	GEN	Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW/220.4	0.00	<u>464</u>
<u>163</u>	CA	JASAAB HOLDINGS LIMITED	1217 WELLINGTON ST. OTTAWA CITY ON	SSW/220.9	2.00	<u>465</u>
<u>164</u>	EHS		1156 Wellington Street Ottawa ON	ESE/222.8	1.00	<u>465</u>
<u>165</u>	GEN	OTTAWA UPHOLSTERY	1 MCCORMICK STREET OTTAWA ON K1Y 1M4	E/227.5	0.00	<u>465</u>
<u>165</u>	GEN	OTTAWA UPHOLSTERY INC	1 MCCORMICK STREET OTTAWA ON K1Y 1M4	E/227.5	0.00	<u>466</u>
<u>166</u>	EASR	DORAN CONTRACTORS LIMITED	ON K1Y 1E4	SE/228.7	1.00	<u>466</u>
<u>167</u>	SPL	City of Ottawa	329 Hinchey St Ottawa ON	ENE/228.7	-1.00	<u>466</u>
<u>168</u>	PINC	PIPELINE HIT - 1/2"	72 HOLLAND AVE.,,OTTAWA,ON,K1Y 0X6,CA ON	WSW/228.8	1.00	<u>467</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>168</u>	SPL	Enbridge Gas Distribution Inc.	72 Holland Ave Ottawa ON	WSW/228.8	1.00	<u>467</u>
<u>169</u>	GEN	Wellington Medical Clinic	1221 Wellington Street West Ottawa ON	SSW/229.0	2.00	<u>468</u>
<u>169</u>	GEN	Wellington Medical Clinic	1221 Wellington Street West Ottawa ON K1Y 2Z9	SSW/229.0	2.00	<u>468</u>
<u>169</u>	GEN	Wellington Medical Clinic	1221 Wellington Street West Ottawa ON K1Y 2Z9	SSW/229.0	2.00	<u>468</u>
<u>169</u>	GEN	Wellington Medical Clinic	1221 Wellington Street West Ottawa ON K1Y 2Z9	SSW/229.0	2.00	<u>469</u>
<u>169</u>	GEN	Wellington Medical Clinic	1221 Wellington Street West Ottawa ON K1Y 2Z9	SSW/229.0	2.00	<u>469</u>
<u>169</u>	GEN	Wellington Medical Clinic	1221 Wellington Street West Ottawa ON K1Y 2Z9	SSW/229.0	2.00	<u>470</u>
<u>170</u>	EHS		424 Parkdale Avenue Ottawa ON K1Y 1H1	SE/230.6	1.00	<u>470</u>
<u>171</u>	CA	OTTAWA CITY - PARKDALE AVENUE	BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	N/231.1	-1.00	<u>470</u>
<u>171</u>	CA	OTTAWA CITY - HINCHEY STREET	BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	N/231.1	-1.00	<u>470</u>
<u>172</u>	GEN	ARISTOTEC GENERATOR SERVICES INC	13A BULLMAN ST. OTTAWA ON K1Y 2S2	NW/231.5	-1.00	<u>471</u>
<u>172</u>	GEN	ARISTOTEC (OUT OF BUSINESS)	13A BULLMAN ST. OTTAWA ON K1Y 2S2	NW/231.5	-1.00	<u>471</u>
<u>172</u>	GEN	ARISTOTEC (OUT OF BUSINESS) 03-269	13A BULLMAN ST. OTTAWA ON K1Y 2S2	NW/231.5	-1.00	<u>471</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
172	GEN	CARRIAGE HOUSE RESTORATION & ANTIQUES	13A BULLMAN OTTAWA ON K1Y 2S2	NW/231.5	-1.00	472
172	GEN	2021694	13 bullman street ottawa ON K1Y 2S2	NW/231.5	-1.00	472
172	GEN	2021694	13 bullman street ottawa ON K1Y 2S2	NW/231.5	-1.00	472
173	WWIS		177 ARMSTRONG ST. OTTAWA ON <i>Well ID: 7198934</i>	ENE/234.2	-1.00	473
174	SPL		1 Grant Street Ottawa ON K1Y 2W8	E/234.2	0.00	476
175	WWIS		1145 WELLINGOTN ST. OTTAWA ON <i>Well ID: 7296560</i>	E/236.4	0.25	477
176	CA	TDL GROUP LIMITED	1217-1225 WELLINGTON ST. OTTAWA CITY ON	SSW/236.5	2.00	480
177	ECA	Patrick John Mills	284 Hinchey Ave 286 Hinchey Avenue Ottawa ON K1Y 1M2	NE/238.9	-1.00	480
178	EHS		177 Armstrong Street Ottawa ON K1Y 2W2	ENE/240.0	-1.00	481
178	EHS		177 Armstrong Street Ottawa ON K1Y 2W2	ENE/240.0	-1.00	481
179	EHS		177 Armstrong Ottawa ON	ENE/240.8	-1.00	481
180	EHS		177 & 179 Armstrong Avenue Ottawa ON K1Y 2W2	ENE/240.8	-1.00	481
181	WWIS		177 ARMSTRONG ST. OTTAWA ON	ENE/242.0	-1.00	481

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7198935			
182	SCT	ENTRO BUILDING SYSTEMS INC.	286 HINCHEY AVE OTTAWA ON K1Y 1M2	NNE/242.8	-1.00	485
183	WWIS		ON Well ID: 7380390	NW/243.4	-1.00	485
184	EHS		268-272 Parkdale Avenue Ottawa, ON ON K1Y 1E9	NNW/243.8	-1.00	486
185	SPL	PRIVATE RESIDENCE	RESIDENCE AT 50 PINEHURST OWNED BY MR. MCCARTHY (722-7298) FURNACE OIL TANK OTTAWA CITY ON K1Y 1K4	N/244.7	-1.00	486
186	CA		Grant Street and McCormick Avenue Ottawa ON	E/245.2	0.00	487
186	ECA	City of Ottawa	Grant Street and McCormick Avenue Ottawa ON K1V 6A6	E/245.2	0.00	487
187	GEN	Ottawa Greenbelt Construction Ltd	85 Spencer Street Ottawa ON K1Y 2P7	W/246.1	1.08	487
188	GEN	SPIC & SPAN-VALETOR-CASH CLEANERS	1233 WELLINGTON STREET C/O 1764 WOODWARD DRIVE OTTAWA ON K1Y 2Z9	SSW/247.8	2.00	488
188	GEN	SPIC & SPAN (SEE & USE ON1237703)	1233 WELLINGTON STREET C/O 1764 WOODWARD DRIVE OTTAWA ON K1Y 2Z9	SSW/247.8	2.00	488
188	GEN	SPIC & SPAN (SEE & USE ON1237703) 35-136	1233 WELLINGTON STREET C/O 1764 WOODWARD DRIVE OTTAWA ON K1Y 2Z9	SSW/247.8	2.00	488
188	GEN	V.I.P. DRY CLEANERS 40-266	1233 WELLINGTON AVE., OTTAWA C/O 6008 VOYAGEUR DR. ORLEANS ON K1Y 2Z9	SSW/247.8	2.00	489
188	GEN	898742 ONTARIO INC. 43-453	1233 WELLINGTON STREET OTTAWA ON K1Y 3A3	SSW/247.8	2.00	489

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>188</u>	GEN	898742 ONTARIO INC.	1233 WELLINGTON STREET OTTAWA ON K1Y 3A3	SSW/247.8	2.00	<u>489</u>
<u>188</u>	GEN	Quantum Remediation Inc.	1233 Wellington Street Ottawa ON K1Y 2Z9	SSW/247.8	2.00	<u>490</u>
<u>188</u>	RSC	1592541 Ontario Inc.	1233 WELLINGTON ST, OTTAWA, ON, K1Y 2Z9 Ottawa ON K1Y 2Z9	SSW/247.8	2.00	<u>490</u>
<u>188</u>	EBR	Windmill Development Group	1233 Wellington Street Ottawa K1Y 2Z9 CITY OF OTTAWA ON	SSW/247.8	2.00	<u>491</u>
<u>188</u>	CA	1592541 Ontario Inc.	1233 Wellington St Ottawa ON	SSW/247.8	2.00	<u>491</u>
<u>188</u>	GEN	Apollo Property Management	1227 Wellington Street Ottawa ON	SSW/247.8	2.00	<u>491</u>
<u>188</u>	ECA	1592541 Ontario Inc.	1233 Wellington St Ottawa ON K2H 9G1	SSW/247.8	2.00	<u>492</u>
<u>189</u>	WWIS		1145 WELLINGTON ST. OTTAWA ON Well ID: 7296559	E/248.2	0.00	<u>492</u>
<u>190</u>	SPL	Enbridge Gas Distribution Inc.	305 Hinchey Ave. Ottawa ON	NE/249.1	-1.00	<u>495</u>
<u>190</u>	PINC	TSSA INCIDENTS	305 HINCHEY AVE.,OTTAWA,ON,K1Y 1L7,CA ON	NE/249.1	-1.00	<u>496</u>
<u>191</u>	WWIS		ON Well ID: 7391081	ENE/249.7	-1.00	<u>496</u>

Executive Summary: Summary By Data Source

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 14 CA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA CITY	PARKDALE AVE/ARMSTRONG ST. OTTAWA CITY ON	E	54.22	<u>61</u>
R.M. OF OTTAWA-CARLETON	PARKDALE AVE/ARMSTRONG ST. OTTAWA CITY ON	E	54.22	<u>61</u>
R.M. OF OTTAWA-CARLETON	HAMILTON ST./SPENCER ST. OTTAWA ON	WNW	57.69	<u>68</u>
OTTAWA CITY - PHINEY ST. /HOLLAND AVE.	ARMSTRONG ST./HINTON AVE. N OTTAWA CITY ON	WSW	126.57	<u>105</u>
SUNOCO INC.	390 PARKDALE AVENUE (SWM) OTTAWA CITY ON K1Y 1G6	SE	155.87	<u>120</u>
City of Ottawa	Hamilton Avenue and Bullman Street Ottawa ON	NW	202.41	<u>151</u>
JASAAB HOLDINGS LIMITED	1217 WELLINGTON ST. OTTAWA CITY ON	SSW	220.87	<u>163</u>
TDL GROUP LIMITED	1217-1225 WELLINGTON ST. OTTAWA CITY ON	SSW	236.49	<u>176</u>
	Grant Street and McCormick Avenue Ottawa ON	E	245.20	<u>186</u>
1592541 Ontario Inc.	1233 Wellington St Ottawa ON	SSW	247.77	<u>188</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Lower Elevation	Address	Direction	Distance (m)	Map Key
R.M. OF OTTAWA-CARLETON	PINEHURST AVE./OXFORD ST. OTTAWA ON	NE	128.82	<u>107</u>
OTTAWA CITY - PARKDALE AVE. /SPENCER ST.	OXFORD ST./HINCHEY ST. OTTAWA CITY ON	ENE	209.54	<u>154</u>
OTTAWA CITY - PARKDALE AVENUE	BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	N	231.08	<u>171</u>
OTTAWA CITY - HINCHEY STREET	BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	N	231.08	<u>171</u>

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Feb 28, 2022 has found that there are 15 DTNK site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
785730 ONTARIO INC	1175 WELLINGTON ST OTTAWA ON	SE	150.65	<u>117</u>
785730 ONTARIO INC	1175 WELLINGTON ST OTTAWA ON K1Y 2Y9	SE	150.65	<u>117</u>
6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE	155.87	<u>120</u>
6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE	155.87	<u>120</u>
6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE	155.87	<u>120</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	390 PARKDALE AVE OTTAWA ON K1Y 1G6	SE	155.87	<u>120</u>
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA ON	SE	212.86	<u>157</u>
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON K1Y 2Z5	SE	212.86	<u>157</u>
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON	SE	212.86	<u>157</u>
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON	SE	212.86	<u>157</u>
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON	SE	212.86	<u>157</u>
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA ON	SE	212.86	<u>157</u>
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA ON	SE	212.86	<u>157</u>
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA ON	SE	212.86	<u>157</u>

EASR - Environmental Activity and Sector Registry

A search of the EASR database, dated Oct 2011- Jan 31, 2023 has found that there are 3 EASR site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
HONEYWELL LIMITED/HONEYWELL LIMITEE	229 Armstrong ST Ottawa ON K1Y 2W5	ESE	17.08	<u>12</u>
2145675 ONTARIO INC.	20 Hamilton AV N_FR Ottawa ON K1Y 1B6	S	133.49	<u>110</u>
DORAN CONTRACTORS LIMITED	ON K1Y 1E4	SE	228.66	<u>166</u>

EBR - Environmental Registry

A search of the EBR database, dated 1994 - Jan 31, 2023 has found that there are 2 EBR site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Honeywell Limited	Adjacent to 3 Hamilton Avenue, Ottawa, Ontario CITY OF OTTAWA ON	NNW	14.48	<u>11</u>
Windmill Development Group	1233 Wellington Street Ottawa K1Y 2Z9 CITY OF OTTAWA ON	SSW	247.77	<u>188</u>

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011- Jan 31, 2023 has found that there are 6 ECA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Honeywell Limited	3 Hamilton Ave 223 & 233 Armstrong Street Ottawa ON M2H 3N7	NNW	14.48	<u>11</u>
Anco Homes Ltd.	ON K0A 3K0	SE	26.71	<u>16</u>
City of Ottawa	Hamilton Avenue and Bullman Street Ottawa ON K2G 6J8	NW	202.41	<u>151</u>
City of Ottawa	Grant Street and McCormick Avenue Ottawa ON K1V 6A6	E	245.20	<u>186</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
1592541 Ontario Inc.	1233 Wellington St Ottawa ON K2H 9G1	SSW	247.77	188

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Patrick John Mills	284 Hinchey Ave 286 Hinchey Avenue Ottawa ON K1Y 1M2	NE	238.87	177

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Dec 31, 2022 has found that there are 55 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	341 Parkdale Avenue Ottawa ON K1Y 2W3	ENE	66.16	78
	341 Parkdale Avenue Ottawa ON K1Y 2W3	ENE	66.16	78
	341 Parkdale Avenue Ottawa ON K1Y 2W3	ENE	66.16	78
	323 Parkdall Ave Ottawa ON	NNE	86.68	89
	260 Armstrong Street Ottawa ON K1Y 2W6	SW	87.57	90
	260 Armstrong Street Ottawa ON K1Y 2W6	SW	87.57	90
	262 Armstrong Street Ottawa ON K1Y 2W6	SW	95.51	93

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	262 Armstrong Street Ottawa ON K1Y 2W6	SW	95.51	<u>93</u>
	262 Armstrong Street Ottawa ON K1Y 2W6	SW	95.51	<u>93</u>
	12 Hamilton Ave N Ottawa ON	SSW	98.18	<u>94</u>
	312 Parkdale Avenue Ottawa ON K1Y 4X9	NNW	110.12	<u>96</u>
	7 Hinton Ave N Ottawa ON K1Y4P1	WSW	112.01	<u>97</u>
	7 Hinton Ave N. Ottawa ON K1Y 4P1	WSW	112.12	<u>98</u>
	312 Parkdale Avenue Ottawa ON K1Y 4X9	N	112.90	<u>99</u>
	312 Parkdale Avenue Ottawa ON K1Y 4X9	N	112.90	<u>99</u>
	312 Parkdale Avenue Ottawa ON K1Y 4X9	N	112.90	<u>99</u>
	16 Hamilton Avenue North Ottawa ON K1Y 1B6	SSW	115.55	<u>100</u>
	211 Armstrong Street Ottawa ON K1Y 2W4	E	121.82	<u>101</u>
	211 Armstrong Street Ottawa ON K1Y 2W4	E	121.82	<u>101</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	211 Armstrong Street Ottawa ON K1Y 2W4	E	121.82	<u>101</u>
	79 Hinton Avenue North Ottawa ON K1Y 0Z7	SW	124.78	<u>102</u>
	22 Hamilton Ave N Ottawa ON K1Y 1B6	S	137.67	<u>114</u>
	300 Parkdale Avenue Ottawa ON K1Y 1B4	NNW	153.74	<u>119</u>
	300 Parkdale Avenue Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
	300 Parkdale Avenue Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
	25 Grant Street Ottawa ON K1Y 2W8	E	164.20	<u>126</u>
	25 Grant Street Ottawa ON K1Y 2W8	E	164.20	<u>126</u>
	25 Grant Street Ottawa ON K1Y 2W8	E	164.20	<u>126</u>
	84 Hinton Ave N Ottawa ON K1Y0Z8	SW	172.79	<u>131</u>
	1195 Wellington Street West Ottawa Ontario Ottawa ON K1Y 2Z6	SSE	173.53	<u>132</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1195 Wellington Street West Ottawa Ontario Ottawa ON K1Y 2Z6	SSE	173.53	<u>132</u>
	1195 Wellington Street West Ottawa Ontario Ottawa ON K1Y 2Z6	SSE	173.53	<u>132</u>
	1195 Wellington St W Ottawa ON K1Y2Z6	SSE	175.33	<u>134</u>
	71 Holland Ottawa ON	WSW	180.19	<u>137</u>
	1 Hamilton Avenue North ottawa ON K1Y 1B5	NW	182.30	<u>138</u>
	77 Holland Ave Ottawa ON K1Y 0Y1	WSW	186.76	<u>141</u>
	1560 Scott Street Ottawa ON K1Y	WNW	193.73	<u>149</u>
	1161-1171 Wellington Ave Ottawa ON	ESE	198.39	<u>150</u>
	1161 Wellington St W Ottawa ON K1Y2Z1	ESE	198.39	<u>150</u>
	1188 Wellington St. W Ottawa ON K1Y 2Z5	SSE	204.93	<u>152</u>
	1188 Wellington St. W Ottawa ON K1Y 2Z5	SSE	204.93	<u>152</u>
	1188 Wellington St. W Ottawa ON K1Y 2Z5	SSE	204.93	<u>152</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	91 & 83 Holland Avenue Ottawa ON	SW	209.34	<u>153</u>
	91 & 83 Holland Avenue Ottawa ON	SW	209.34	<u>153</u>
	1194 Wellington St W Ottawa ON Ottawa ON K1Y 2Z5	SSE	213.81	<u>159</u>
	1156 Wellington Street Ottawa ON	ESE	222.76	<u>164</u>
	424 Parkdale Avenue Ottawa ON K1Y 1H1	SE	230.61	<u>170</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	154 Colonnade Rd S Nepean ON K1Y 2R7	ENE	191.24	<u>147</u>
	154 Colonnade Rd S Nepean ON K1Y 2R7	ENE	191.24	<u>147</u>
	154 Colonnade Rd S Nepean ON K1Y 2R7	ENE	191.24	<u>147</u>
	177 Armstrong Street Ottawa ON K1Y 2W2	ENE	239.99	<u>178</u>
	177 Armstrong Street Ottawa ON K1Y 2W2	ENE	239.99	<u>178</u>
	177 Armstrong Ottawa ON	ENE	240.75	<u>179</u>

177 & 179 Armstrong Avenue Ottawa ON K1Y 2W2	ENE	240.80	180

268-272 Parkdale Avenue Ottawa, ON ON K1Y 1E9	NNW	243.78	184

FST - Fuel Storage Tank

A search of the FST database, dated Feb 28, 2022 has found that there are 11 FST site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE	155.87	120
SUNCOR ENERGY PRODUCTS PARTNERSHIP	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE	155.87	120
SUNCOR ENERGY PRODUCTS PARTNERSHIP	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE	155.87	120
6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE	155.87	120
SUNCOR ENERGY PRODUCTS PARTNERSHIP	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE	155.87	120
6205429 CANADA INC	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE	155.87	120
SUNCOR ENERGY PRODUCTS PARTNERSHIP	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	SE	155.87	120
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	SE	212.86	157

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	SE	212.86	157
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	SE	212.86	157
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	SE	212.86	157

FSTH - Fuel Storage Tank - Historic

A search of the FSTH database, dated Pre-Jan 2010* has found that there are 1 FSTH site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
1496030 ONTARIO INC	390 PARKDALE AV OTTAWA ON K1Y 1G6	SE	155.87	120

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Oct 31, 2022 has found that there are 113 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION P.O. BOX 3160,STATION "C" 3 HAMILTON AV OTTAWA ON K1Y 4J4	NNW	14.48	11
HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW	14.48	11
HONEYWELL LIMITED 35-071	SPERRY AEROSPACE DIVISION P.O. BOX 3160,STATION "C" 3 HAMILTON AV OTTAWA ON K1Y 4J4	NNW	14.48	11
SPERRY INC	AEROSPACE & MARINE GROUP 3 HAMILTON AVE. N., P.O. BOX 390 OTTAWA ON K1Y 1B4	NNW	14.48	11

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
SPERRY SEE&USE ON0144004	AEROSPACE & MARINE GROUP 3 HAMILTON AVE. N., P.O. BOX 390 OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
SPERRY SEE&USE ON0144004 35-071	AEROSPACE & MARINE GROUP 3 HAMILTON AVE. N., P.O. BOX 390 OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
SPERRY (SEE&USE ON0144004)	AEROSPACE & MARINE GROUP 3 HAMILTON AVENUE NORTH OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 4J4	NNW	14.48	<u>11</u>
HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
HONEYWELL LIMITED	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
HONEYWELL LIMITED Aerospace Electronic Systems	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
HONEYWELL LIMITED Aerospace Electronic Systems	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
HONEYWELL LIMITED Aerospace Electronic Systems	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
HONEYWELL LIMITED Aerospace Electronic Systems	SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	NNW	14.48	<u>11</u>
GRAPHIC DISPLAY CANADA	DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	NW	66.27	<u>79</u>
GRAPHIC DISPLAY CANADA 18- 125	DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	NW	66.27	<u>79</u>
GRAPHIC DISPLAY CANADA	M.O.M. PRINTING LIMITED, A DIVISION OF 45 SPENCER STREET OTTAWA ON K1Y 2P5	NW	66.27	<u>79</u>
Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	WSW	112.12	<u>98</u>
METCALFE REALTY LIMITED	7 HINTIN AVE., NORTH OTTAWA ON	WSW	112.12	<u>98</u>
Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	WSW	112.12	<u>98</u>
Metcalfe Realty Company Limited	7 Hinton Avenue Ottawa ON	WSW	112.12	<u>98</u>
CAA NORTH & EAST ONTARIO	16 HAMILTON AVENUE OTTAWA ON	SSW	115.55	<u>100</u>
Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE	127.79	<u>106</u>
Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE	127.79	<u>106</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE	127.79	<u>106</u>
GEM Health Care Services (2011) Inc.	383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	ESE	127.79	<u>106</u>
GEM Health Care Services (2011) Inc.	383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	ESE	127.79	<u>106</u>
Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE	127.79	<u>106</u>
Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE	127.79	<u>106</u>
GEM Health Care Services (2011) Inc.	383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	ESE	127.79	<u>106</u>
Rosemount Family Health Organization	Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	ESE	135.75	<u>112</u>
GEM Health Care Services (2011) Inc.	383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	ESE	135.75	<u>112</u>
CYBERMEDIX HEALTH (OUT OF BUSINESS)	44 HINTON AVE OTTAWA ON K1Y 1B3	WSW	137.33	<u>113</u>
M.O.M. PRINTING	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	NNW	156.99	<u>123</u>
M.O.M. PRINTING	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	NNW	156.99	<u>123</u>
M.O.M. PRINTING 25-205	300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	NNW	156.99	<u>123</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
M.O.M. PRINTING	300 Parkdale Ave Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Crop.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Scintrex Trace Corp.	300 Parkdale Ave. Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
Ottawa Community Housing Corp.	395 Parkdale Ave. Ottawa ON K1Y 4V4	SE	167.30	<u>129</u>
VIC'S HARDROCK CYCLE	1203 WELLINGTON STREET OTTAWA ON K1Y 2Z8	S	175.04	<u>133</u>
MARQUARDT PRINTING	1195 WELLINGTON STREET OTTAWA ON K1Y 2Z6	SSE	175.33	<u>134</u>
ONTARIO PETROLEUM PUMP	1 HAMILTON AVE N OTTAWA ON K1Y 1B5	NW	182.30	<u>138</u>
Rexall Pharmacy Group Ltd.	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE	185.78	<u>140</u>
Welldale Limited Partnership	1186-1194 Wellington Street West Ottawa ON K1Y 2Z1	SSE	187.39	<u>142</u>
CCC476	45 Holland Ave. Ottawa ON K1Y 4S3	W	188.69	<u>144</u>
Doran Contractors Limited	1166 Wellington Stree West Ottawa ON K1V 8Y3	SE	211.27	<u>155</u>
Rexall Pharmacy Group Ltd.	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE	211.82	<u>156</u>
Pharma Plus Drugmarts Ltd	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE	211.82	<u>156</u>
Pharma Plus Drugmarts Ltd	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE	211.82	<u>156</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Rexall Pharmacy Group Ltd.	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE	211.82	<u>156</u>
Rexall Pharmacy Group Ltd.	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE	211.82	<u>156</u>
Rexall Pharmacy Group Ltd.	1190 Wellington Street Ottawa ON K1Y 2Z5	SSE	211.82	<u>156</u>
CARVERS DRUG-STORE (1971) LIMITED	1200-B WELLINGTON STREET OTTAWA ON K1Y 2Z7	S	213.27	<u>158</u>
PHARMA PLUS DRUGMARTS LTD.	1200B WELLINGTON STREET OTTAWA ON K1Y 2Z7	S	213.27	<u>158</u>
Colonnade Development Inc.	1600 Scott St Ottawa ON	NW	216.47	<u>161</u>
PHARMA PLUS DRUGS LTD	1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	NW	220.38	<u>162</u>
PHARMA PLUS DRUGS LTD. 31- 660	1620 SCOTT STREET, UNIT 29, OTTAWA C/O 5935 AIRPORT ROAD STE. 500 MISSISSAUGA ON K1Y 4S7	NW	220.38	<u>162</u>
PHARMA PLUS DRUGS LTD.	1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	NW	220.38	<u>162</u>
PHARMA PLUS DRUGS LTD.	1620 SCOTT STREET, UNIT 29 OTTAWA ON K1Y 4S7	NW	220.38	<u>162</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW	220.38	<u>162</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW	220.38	<u>162</u>
Pharma Plus Drugmarts Ltd	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW	220.38	<u>162</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW	220.38	<u>162</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW	220.38	<u>162</u>
Pharma Plus Drugmarts Ltd	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW	220.38	<u>162</u>
Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW	220.38	<u>162</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW	220.38	<u>162</u>
Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW	220.38	<u>162</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW	220.38	<u>162</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW	220.38	<u>162</u>
Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW	220.38	<u>162</u>
Holland Cross Dental Centre	20-1620 Scott Street Ottawa ON K1Y4S7	NW	220.38	<u>162</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Rexall Pharmacy Group Ltd.	1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	NW	220.38	<u>162</u>
OTTAWA UPHOLSTERY	1 MCCORMICK STREET OTTAWA ON K1Y 1M4	E	227.46	<u>165</u>
OTTAWA UPHOLSTERY INC	1 MCCORMICK STREET OTTAWA ON K1Y 1M4	E	227.46	<u>165</u>
Wellington Medical Clinic	1221 Wellington Street West Ottawa ON	SSW	228.99	<u>169</u>
Wellington Medical Clinic	1221 Wellington Street West Ottawa ON K1Y 2Z9	SSW	228.99	<u>169</u>
Wellington Medical Clinic	1221 Wellington Street West Ottawa ON K1Y 2Z9	SSW	228.99	<u>169</u>
Wellington Medical Clinic	1221 Wellington Street West Ottawa ON K1Y 2Z9	SSW	228.99	<u>169</u>
Wellington Medical Clinic	1221 Wellington Street West Ottawa ON K1Y 2Z9	SSW	228.99	<u>169</u>
Wellington Medical Clinic	1221 Wellington Street West Ottawa ON K1Y 2Z9	SSW	228.99	<u>169</u>
Ottawa Greenbelt Construction Ltd	85 Spencer Street Ottawa ON K1Y 2P7	W	246.09	<u>187</u>
V.I.P. DRY CLEANERS 40-266	1233 WELLINGTON AVE., OTTAWA C/O 6008 VOYAGEUR DR. ORLEANS ON K1Y 2Z9	SSW	247.77	<u>188</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
898742 ONTARIO INC. 43-453	1233 WELLINGTON STREET OTTAWA ON K1Y 3A3	SSW	247.77	<u>188</u>
898742 ONTARIO INC.	1233 WELLINGTON STREET OTTAWA ON K1Y 3A3	SSW	247.77	<u>188</u>
Quantum Remediation Inc.	1233 Wellington Street Ottawa ON K1Y 2Z9	SSW	247.77	<u>188</u>
Apollo Property Management	1227 Wellington Street Ottawa ON	SSW	247.77	<u>188</u>
SPIC & SPAN-VALETOR-CASH CLEANERS	1233 WELLINGTON STREET C/O 1764 WOODWARD DRIVE OTTAWA ON K1Y 2Z9	SSW	247.77	<u>188</u>
SPIC & SPAN (SEE & USE ON1237703)	1233 WELLINGTON STREET C/O 1764 WOODWARD DRIVE OTTAWA ON K1Y 2Z9	SSW	247.77	<u>188</u>
SPIC & SPAN (SEE & USE ON1237703) 35-136	1233 WELLINGTON STREET C/O 1764 WOODWARD DRIVE OTTAWA ON K1Y 2Z9	SSW	247.77	<u>188</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
OLIVER, MANGIONE, MCCALLA & ASSOC.	LTD. 154 COLONNADE RD. SOUTH NEPEAN ON K2E 7J5	ENE	191.24	<u>147</u>
OLIVER, MANGIONE, MCCALLA AND	ASSOCIATES LIMITED 154 COLONNADE ROAD SOUTH NEPEAN ON K2E 7J5	ENE	191.24	<u>147</u>
OLIVER, MANGIONE, MCCALLA & ASSOC.29-465	LTD. 154 COLONNADE RD. SOUTH NEPEAN ON K2E 7J5	ENE	191.24	<u>147</u>
OLIVER, MANGIONE, MCCALLA AND	154 COLONNADE ROAD SOUTH NEPEAN ON K2E 7J5	ENE	191.24	<u>147</u>

ARISTOTEC GENERATOR SERVICES INC	13A BULLMAN ST. OTTAWA ON K1Y 2S2	NW	231.55	172
ARISTOTEC (OUT OF BUSINESS)	13A BULLMAN ST. OTTAWA ON K1Y 2S2	NW	231.55	172
ARISTOTEC (OUT OF BUSINESS) 03-269	13A BULLMAN ST. OTTAWA ON K1Y 2S2	NW	231.55	172
CARRIAGE HOUSE RESTORATION & ANTIQUES	13A BULLMAN OTTAWA ON K1Y 2S2	NW	231.55	172
2021694	13 bullman street ottawa ON K1Y 2S2	NW	231.55	172
2021694	13 bullman street ottawa ON K1Y 2S2	NW	231.55	172

HINC - TSSA Historic Incidents

A search of the HINC database, dated 2006-June 2009* has found that there are 1 HINC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	85 HOLLAND AVENUE OTTAWA ON K1Y 0Y1	SW	191.35	148

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated Feb 28, 2022 has found that there are 1 INC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	320 PARKDALE AVE, OTTAWA ON	NNW	56.38	63

PES - Pesticide Register

A search of the PES database, dated Oct 2011- Jan 31, 2023 has found that there are 1 PES site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
HOLISTECH PEST CONTROL INC.	5 GRANT ST.; APT. #2 OTTAWA ON K1Y 2W8	E	214.29	160

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 5 PINC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PIPELINE HIT 1.25"	228 ARMSTRONG ST.,OTTAWA,ON, K1Y 4T1,CA ON	ESE	47.49	50
ENBRIDGE GAS INC	22 HAMILTON AVE N,,OTTAWA,ON, K1Y 1B6,CA ON	S	143.50	115
ENBRIDGE GAS INC	84 HINTON AVE N,,OTTAWA,ON,K1Y 0Z8,CA ON	SW	151.53	118
PIPELINE HIT - 1/2"	72 HOLLAND AVE.,OTTAWA,ON,K1Y 0X6,CA ON	WSW	228.76	168

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
TSSA INCIDENTS	305 HINCHEY AVE.,OTTAWA,ON,K1Y 1L7,CA ON	NE	249.15	190

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 5 PRT site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
785730 ONTARIO INC	1175 WELLINGTON ST OTTAWA ON K1Y 2Y9	SE	150.65	117
785730 ONTARIO INC	1175 WELLINGTON ST OTTAWA ON K1Y2Y9	SE	150.65	117

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PARKDALE SUNOCO	390 PARKDALE AV OTTAWA ON K1Y1G6	SE	155.87	120
	1186 WELLINGTON ST. OTTAWA ON	SE	212.86	157
PARKDALE ESSO RON ASPECK & SON LTD	1186 WELLINGTON ST OTTAWA ON K1Y2Z5	SE	212.86	157

PTTW - Permit to Take Water

A search of the PTTW database, dated 1994 - Jan 31, 2023 has found that there are 1 PTTW site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Honeywell Limited	3 Hamilton Ave, 223 & 233 Armstrong Street CITY OF OTTAWA ON	NNW	14.48	11

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004-Jan 2023 has found that there are 2 RSC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
HAMILTON AVENUE HOLDINGS INC.	20 HAMILTON AVENUE NORTH, OTTAWA, ON K1Y 1B6 Ottawa ON	S	133.49	110
1592541 Ontario Inc.	1233 WELLINGTON ST, OTTAWA, ON, K1Y 2Z9 Ottawa ON K1Y 2Z9	SSW	247.77	188

RST - Retail Fuel Storage Tanks

A search of the RST database, dated 1999-May 31, 2022 has found that there are 3 RST site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PARKDALE SUNOCO FUNFOOD	390 PARKDALE AVE OTTAWA ON K1Y1G6	SE	155.87	<u>120</u>
PARKDALE SUNOCO FUNFOOD	390 PARKDALE AVE OTTAWA ON K1Y1G6	SE	155.87	<u>120</u>
PARKDALE SUNOCO FUNFOOD	390 PARKDALE AVE OTTAWA ON K1Y 1G6	SE	155.87	<u>120</u>

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 19 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
ADD ELECTRONICS INC.	233 Armstrong St Ottawa ON K1Y 2W5	SSW	13.68	<u>10</u>
Canadian Criminal Justice Assn	320 Parkdale Ave Suite 101 Ottawa ON K1Y 4X9	NNW	56.38	<u>63</u>
Artech Studios	6 Hamilton Ave N Suite 250 Ottawa ON K1Y 4R1	WSW	64.57	<u>76</u>
Graphic Display Canada - A St-Joseph Corporation Company	45 Spencer St Ottawa ON K1Y 2P5	NW	66.27	<u>79</u>
GRAPHIC DISPLAY CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	NW	66.27	<u>79</u>
THE ENVELOPE HOUSE	45 SPENCER ST OTTAWA ON K1Y 2P5	NW	66.27	<u>79</u>
FUJI GRAPHIC SYSTEMS CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	NW	66.27	<u>79</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
GRAPHIC DISPLAY CANADA	45 SPENCER ST OTTAWA ON K1Y 2P5	NW	66.27	<u>79</u>
Canadian Arctic Resources Committee Inc.	7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	WSW	112.12	<u>98</u>
CANADIAN ARCTIC RESOURCES COMM	7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	WSW	112.12	<u>98</u>
VOGUE BRASSIERE INC.	7 HINTON AVE N OTTAWA ON K1Y 4P1	WSW	112.12	<u>98</u>
GEM Software Scheduling	383 Parkdale Av Suite 304 Ottawa ON K1Y 4R4	ESE	127.79	<u>106</u>
Myrophen Publications Ltd.	383 Parkdale Ave Suite 402 Ottawa ON K1Y 4R4	ESE	127.79	<u>106</u>
Scintrex Trace Corp.	300 Parkdale Ave Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
ST-JOSEPH M.O.M. PRINTING	300 Parkdale Ave Ottawa ON K1Y 1G2	NNW	156.99	<u>123</u>
M O M PRINTING	300 PARKDALE AVE OTTAWA ON K1Y 1G2	NNW	156.99	<u>123</u>
Merge Business Solutions	1165 Wellington St W Ottawa ON K1Y 2Y9	ESE	176.75	<u>135</u>
Emerald Bakery	1200D Wellington St W Ottawa ON K1Y 2Z7	S	213.27	<u>158</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>

ENTRO BUILDING SYSTEMS INC.	286 HINCHEY AVE OTTAWA ON K1Y 1M2	NNE	242.82	182

SPL - Ontario Spills

A search of the SPL database, dated 1988-Sep 2020; Dec 2020-Mar 2021 has found that there are 21 SPL site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Enbridge Gas Distribution Inc.	infront of 228 Armstrong St Ottawa ON	ESE	47.49	50
	320 Parkdale Ave Ottawa ON	NNW	56.38	63
OTTAWA HYDRO	4 HAMILTON ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	W	57.87	69
UNKNOWN	OFFICE BLDG AT 383 PARKDALE AVE IN THE SUMP PUMP HOLES IN PARKING GARAGE OTTAWA CITY ON K1Y 4R4	ESE	127.79	106
Suncor service station<UNOFFICIAL>	390 Parkdale Ave Ottawa ON	SE	155.87	120
Waste Connections of Canada Inc. as general partner for and on behalf of Ridge	(Chatham) Holdings L.P. 300 Parkdale Ave Ottawa ON	NNW	156.99	123
PRIVATE OWNER	395 PARKDALE TRANSPORT TRUCK (CARGO) OTTAWA ON K1Y 4V4	SE	167.30	129
	Parkdale Ave. & Wellington St. Ottawa ON	SE	183.94	139
PRIVATE RESIDENCE	79 HOLLAND AVENUE FURNACE OIL TANK OTTAWA CITY ON K1Y 0Y1	WSW	188.45	143

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Tomlinson Environmental Services Ltd	83 Holland Ave Ottawa ON	WSW	189.06	<u>145</u>
	1161 Wellington St. W Ottawa ON	ESE	198.39	<u>150</u>
	1166 Wellington Street W Ottawa ON	SE	211.27	<u>155</u>
	1190 Wellington Street Ottawa ON	SSE	211.82	<u>156</u>
IMPERIAL OIL	IMPERIAL OIL GAS STATION 1186 WELLINGTON AT PARKDALE ESSO SERVICE STATION OTTAWA CITY ON K1Y 2Z5	SE	212.86	<u>157</u>
ESSO PETROLEUM CANADA	ESSO STATION AT 1186 WELLINGTON AT PARKDALE SERVICE STATION OTTAWA CITY ON K1Y 2Z5	SE	212.86	<u>157</u>
Enbridge Gas Distribution Inc.	72 Holland Ave Ottawa ON	WSW	228.76	<u>168</u>
	1 Grant Street Ottawa ON K1Y 2W8	E	234.22	<u>174</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PRIVATE RESIDENCE	20 PINEHURST AVE. FURNACE OIL TANK OTTAWA CITY ON K1Y 1K3	NNE	165.73	<u>127</u>
City of Ottawa	329 Hinchey St Ottawa ON	ENE	228.72	<u>167</u>
PRIVATE RESIDENCE	RESIDENCE AT 50 PINEHURST OWNED BY MR. MCCARTHY (722- 7298) FURNACE OIL TANK OTTAWA CITY ON K1Y 1K4	N	244.73	<u>185</u>

Enbridge Gas Distribution Inc.	305 Hinchey Ave. Ottawa ON	NE	249.15	190

WWIS - Water Well Information System

A search of the WWIS database, dated Jun 30 2022 has found that there are 103 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	233 ARMSTRONG Ottawa ON <i>Well ID:</i> 7220783	WNW	3.46	1
	3 Hamilton Ave Ottawa ON <i>Well ID:</i> 7343185	ESE	5.15	2
	229 Armstrong St Ottawa ON <i>Well ID:</i> 7343178	E	6.17	3
	340 PARKDALE AVE Ottawa ON <i>Well ID:</i> 7342140	N	7.88	4
	Ottawa ON <i>Well ID:</i> 7343187	ESE	9.59	5
	366 ARMSTRONG ST Ottawa ON <i>Well ID:</i> 7276808	E	11.41	6
	2323 RIVERSIDE RD Ottawa ON <i>Well ID:</i> 7275422	E	11.41	6
	Parkdale + Hamilton St. Ottawa ON <i>Well ID:</i> 7343184	ESE	11.80	7
	340 PARKDALE AVE Ottawa ON <i>Well ID:</i> 7342139	NE	12.40	8

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2323 RIVERSIDE DR Ottawa ON <i>Well ID: 7275421</i>	ENE	13.54	<u>9</u>
	229 Armstrong St Ottawa ON <i>Well ID: 7343177</i>	SE	18.21	<u>13</u>
	Ottawa ON <i>Well ID: 7343186</i>	ESE	18.49	<u>14</u>
	3 Hamilton Ave Ottawa ON <i>Well ID: 7343183</i>	SE	23.01	<u>15</u>
	3 HAMILTON AVE NORTH ON <i>Well ID: 7041973</i>	N	28.84	<u>17</u>
	Armstrong St. Ottawa ON <i>Well ID: 7343191</i>	ESE	30.76	<u>18</u>
	223 Armstrong St Ottawa ON <i>Well ID: 7343181</i>	ESE	31.02	<u>19</u>
	3 HAMILTON AVE NORTH ON <i>Well ID: 7041962</i>	W	32.98	<u>20</u>
	3 HAMILTON AVE. NORTH ON <i>Well ID: 7107670</i>	E	33.05	<u>21</u>
	3 HAMILTON AVE NORTH ON <i>Well ID: 7042084</i>	ENE	33.08	<u>22</u>
	3 HAMILTON AVE NORTH ON <i>Well ID: 7041961</i>	WSW	33.66	<u>23</u>
	3 HAMILTON AVE NORTH ON	N	33.88	<u>24</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7041974			
	3 HAMILTON AVE NORTH ON	W	33.95	<u>25</u>
	Well ID: 7041963			
	Armstrong St Ottawa ON	SSE	34.20	<u>26</u>
	Well ID: 7343200			
	3 HAMILTON AVE NORTH ON	NE	34.30	<u>27</u>
	Well ID: 7041980			
	3 HAMILTON AVE NORTH ON	E	35.99	<u>28</u>
	Well ID: 7041981			
	3 HAMILTON AVE NORTH ON	W	37.57	<u>29</u>
	Well ID: 7041964			
	3 HAMILTON AVE NORTH ON	SW	38.30	<u>30</u>
	Well ID: 7041960			
	3 HAMILTON AVE NORTH ON	W	38.74	<u>31</u>
	Well ID: 7041976			
	Parkdale Ave Ottawa ON	E	39.30	<u>32</u>
	Well ID: 7343166			
	ON	ESE	39.58	<u>33</u>
	Well ID: 7386176			
	Parkdale Ottawa ON	ENE	40.80	<u>34</u>
	Well ID: 7343163			
	3 HAMILTON AVE NORTH ON	WNW	41.61	<u>35</u>
	Well ID: 7041969			

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	3 HAMILTON AVE NORTH ON	WNW	41.66	<u>36</u>
	<i>Well ID:</i> 7041965			
	3 HAMILTON AVE NORTH ON	NW	42.26	<u>37</u>
	<i>Well ID:</i> 7041970			
	parkdale Ave Ottawa ON	ENE	43.77	<u>38</u>
	<i>Well ID:</i> 7343164			
	366 Parkdale Ave Ottawa ON	ESE	44.24	<u>39</u>
	<i>Well ID:</i> 7343169			
	3 HAMILTON AVE NORTH ON	WNW	44.53	<u>40</u>
	<i>Well ID:</i> 7041968			
	3 HAMILTON AVE NORTH ON	WNW	44.80	<u>41</u>
	<i>Well ID:</i> 7041966			
	PARKDALE AVE Ottawa ON	ESE	44.85	<u>42</u>
	<i>Well ID:</i> 7343193			
	231 ARMSTRONG Ottawa ON	E	45.00	<u>43</u>
	<i>Well ID:</i> 7276809			
	3 HAMILTON AVE NORTH ON	NW	45.28	<u>44</u>
	<i>Well ID:</i> 7041971			
	3 HAMILTON AVE NORTH ON	WNW	45.80	<u>45</u>
	<i>Well ID:</i> 7041967			
	ON	S	46.56	<u>46</u>
	<i>Well ID:</i> 7200459			
	PARKDALE AVE Ottawa ON	E	46.77	<u>47</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7343192			
	Parkdale Ottawa ON	ESE	47.02	<u>48</u>
	Well ID: 7343162			
	3 HAMILTON AVE NORTH ON	NE	47.28	<u>49</u>
	Well ID: 7041978			
	Parkdale Ave Ottawa ON	E	47.87	<u>51</u>
	Well ID: 7343165			
	ON	ESE	48.75	<u>52</u>
	Well ID: 7385911			
	Parkdale Ave Ottawa ON	ENE	48.83	<u>53</u>
	Well ID: 7343190			
	3 HAMILTON AVE NORTH ON	NW	49.22	<u>54</u>
	Well ID: 7041972			
	PARKDALE Ave Ottawa ON	SSE	50.34	<u>55</u>
	Well ID: 7343198			
	PARKDALE Ave Ottawa ON	SE	51.16	<u>56</u>
	Well ID: 7343196			
	Parkdale Ave Ottawa ON	E	51.32	<u>57</u>
	Well ID: 7343189			
	Parkdale Ottawa ON	ESE	51.76	<u>58</u>
	Well ID: 7343180			
	ON	ESE	51.76	<u>58</u>
	Well ID: 7385914			

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	PARKDALE Ottawa ON	SE	53.43	<u>59</u>
	<i>Well ID:</i> 7343194			
	Parkdale Ottawa ON	ESE	54.19	<u>60</u>
	<i>Well ID:</i> 7343179			
	ON	ESE	55.76	<u>62</u>
	<i>Well ID:</i> 7385912			
	PARKDALE Ave Ottawa ON	SE	56.40	<u>64</u>
	<i>Well ID:</i> 7343195			
	7 HINTON AVE Ottawa ON	WSW	56.80	<u>65</u>
	<i>Well ID:</i> 7166778			
	7 HINTON AVE Ottawa ON	W	57.48	<u>66</u>
	<i>Well ID:</i> 7166779			
	366 Parkdale Ave Ottawa ON	ESE	57.64	<u>67</u>
	<i>Well ID:</i> 7343170			
	ON	ESE	58.67	<u>70</u>
	<i>Well ID:</i> 7385913			
	3 HAMILTON AVE NORTH ON	ENE	59.31	<u>71</u>
	<i>Well ID:</i> 7041979			
	PARKDALE Ave Ottawa ON	ESE	61.72	<u>72</u>
	<i>Well ID:</i> 7343197			
	ON	ESE	61.87	<u>73</u>
	<i>Well ID:</i> 7385910			
	3 HAMILTON AVE NORTH ON	NNE	61.94	<u>74</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7041975			
	Parkdale Ave Ottawa ON	E	64.42	<u>75</u>
	Well ID: 7343188			
	PARKDALE Ave Ottawa ON	SE	65.78	<u>77</u>
	Well ID: 7343199			
	Parkdale Ave Ottawa ON	ESE	70.84	<u>80</u>
	Well ID: 7343182			
	366 Parkdale Ave Ottawa ON	SE	70.89	<u>81</u>
	Well ID: 7343168			
	7 HINTON AVE OTTAWA ON	WSW	75.63	<u>82</u>
	Well ID: 7192836			
	Parkdale Ave Ottawa ON	ESE	77.50	<u>83</u>
	Well ID: 7343172			
	ON	SE	80.78	<u>84</u>
	Well ID: 7385915			
	7 HINTON AVE. Ottawa ON	W	82.05	<u>85</u>
	Well ID: 7119461			
	ON	NW	83.01	<u>86</u>
	Well ID: 7383510			
	Parkdale Ave Ottawa ON	ESE	84.52	<u>87</u>
	Well ID: 7343171			
	Parkdale Ave Ottawa ON	SE	84.68	<u>88</u>
	Well ID: 7343167			

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	SE	90.32	<u>92</u>
	Well ID: 7203872			
	ON	NW	100.94	<u>95</u>
	Well ID: 7389506			
	366 PARKDALE AVE. Ottawa ON	SE	125.85	<u>103</u>
	Well ID: 7133809			
	366 PARKDALE AVE. Ottawa ON	SSE	126.38	<u>104</u>
	Well ID: 7133808			
	ON	NW	129.15	<u>108</u>
	Well ID: 7122598			
	6 HINTON AVE. Ottawa ON	WSW	130.22	<u>109</u>
	Well ID: 7126433			
	22 HAMILTON AVE Ottawa ON	S	135.19	<u>111</u>
	Well ID: 7180987			
	ON	S	144.19	<u>116</u>
	Well ID: 7389946			
	6 HINTON AVE. Ottawa ON	WSW	156.22	<u>121</u>
	Well ID: 7126434			
	1195 WELLINGTON ST W Ottawa ON	SSE	156.73	<u>122</u>
	Well ID: 7232122			
	6 HINTON AVE. Ottawa ON	WSW	157.10	<u>124</u>
	Well ID: 7126432			
	1195 WELLINGTON ST W Ottawa ON	SSE	162.75	<u>125</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	<i>Well ID:</i> 7232120			
	7 MINTON AVE OTTAWA ON	WSW	166.04	128
	<i>Well ID:</i> 7192835			
	1195 WELLINGTON ST W Ottawa ON	SSE	168.43	130
	<i>Well ID:</i> 7232121			
	7 HINTON AVE OTTAWA ON	WSW	179.03	136
	<i>Well ID:</i> 7192834			
	1161 WELLINGTON ST OTTAWA ON	E	190.46	146
	<i>Well ID:</i> 7044709			
	1156 WELLINGTON STREET WEST Ottawa ON	SE	211.27	155
	<i>Well ID:</i> 7203873			
	1166 WELLINGTON ST Ottawa ON	SE	211.27	155
	<i>Well ID:</i> 7315271			
	1145 WELLINGOTN ST. OTTAWA ON	E	236.39	175
	<i>Well ID:</i> 7296560			
	1145 WELLINGTON ST. OTTAWA ON	E	248.16	189
	<i>Well ID:</i> 7296559			
 <u>Lower Elevation</u>	 <u>Address</u>	 <u>Direction</u>	 <u>Distance (m)</u>	 <u>Map Key</u>
	3 HAMILTON AVE NORTH ON	NE	88.20	91
	<i>Well ID:</i> 7041977			
	177 ARMSTRONG ST. OTTAWA ON	ENE	234.19	173
	<i>Well ID:</i> 7198934			
	177 ARMSTRONG ST. OTTAWA ON	ENE	241.95	181


Well ID: 7198935

ON	NW	243.41	<u>183</u>

Well ID: 7380390

ON	ENE	249.74	<u>191</u>

Well ID: 7391081

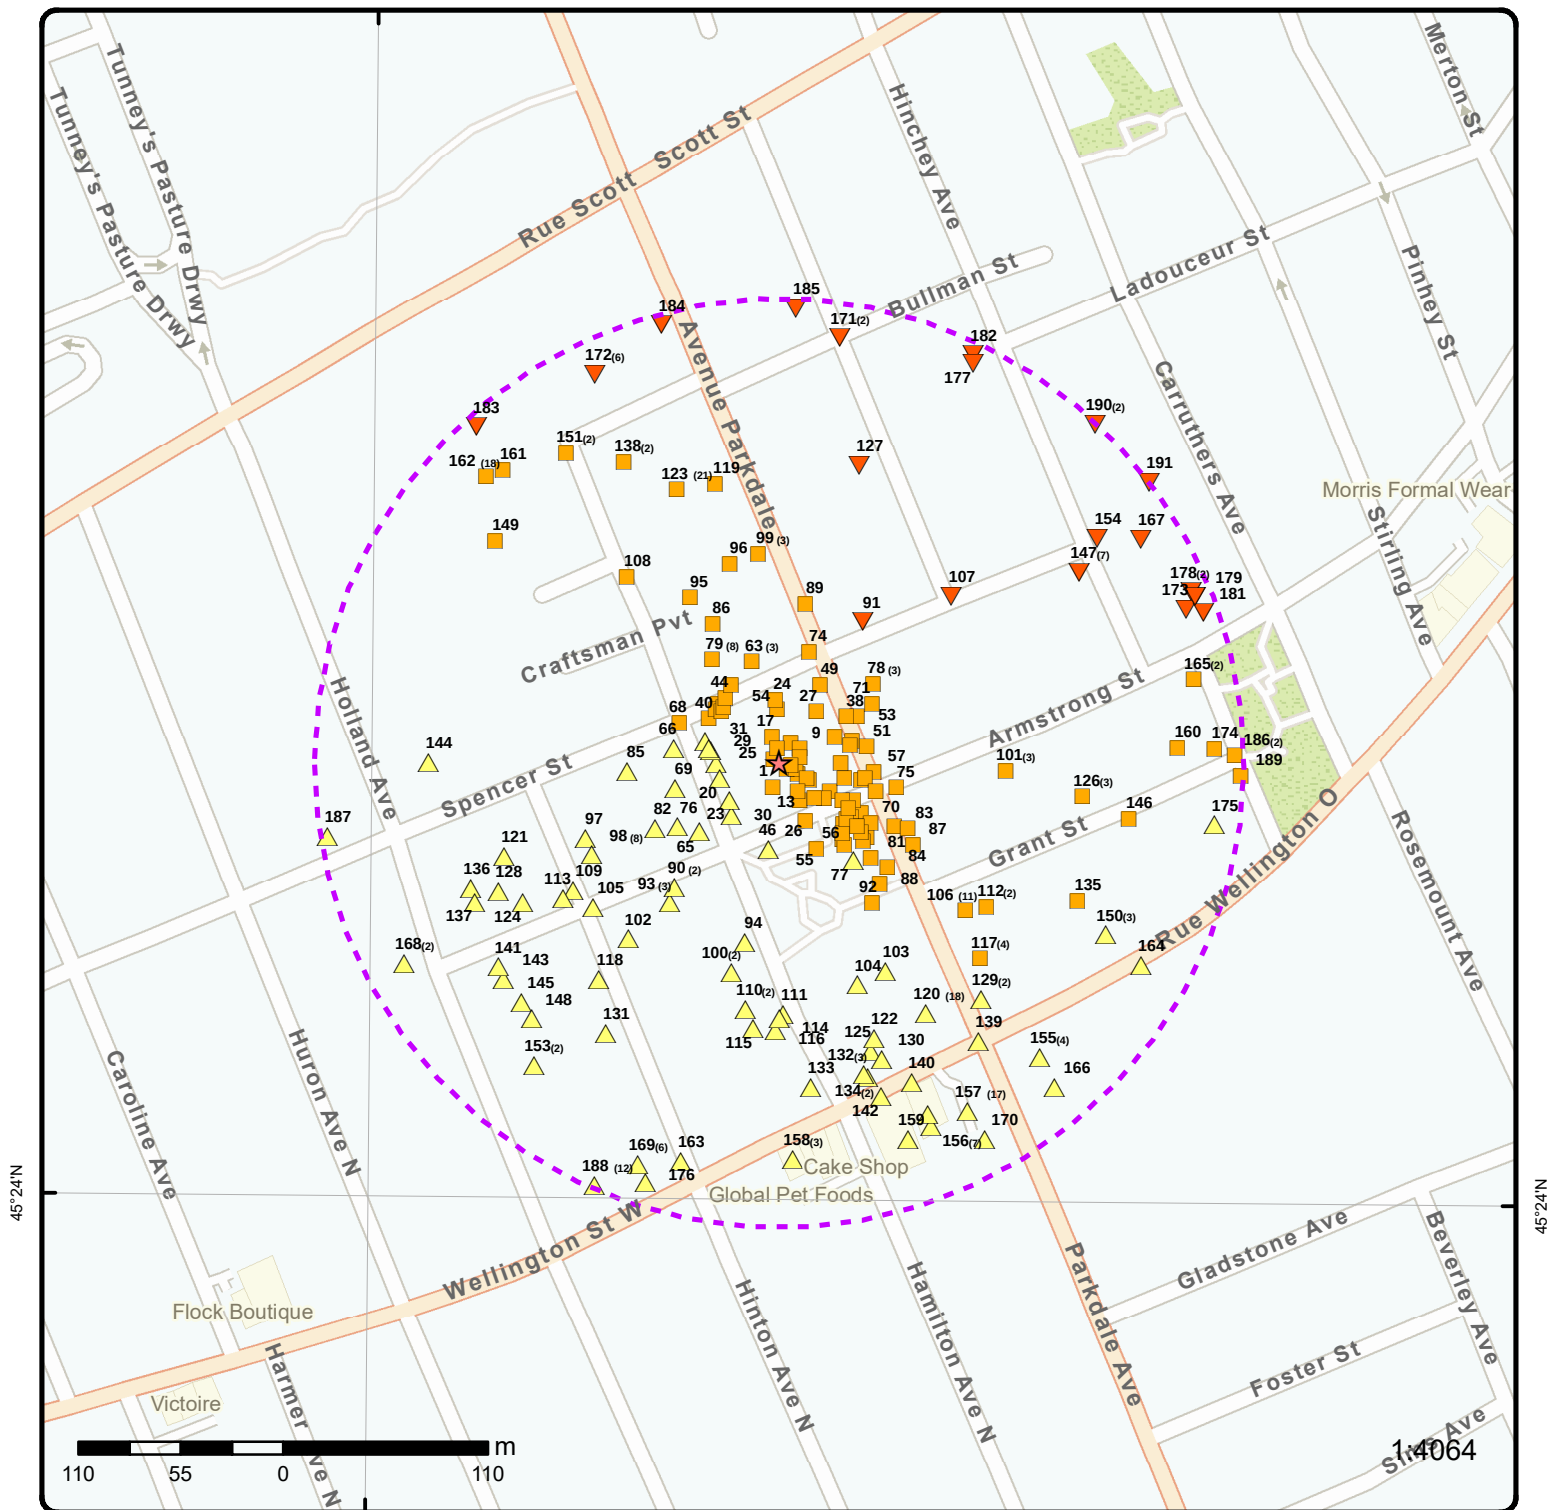

Map: 0.25 Kilometer Radius

Order Number: 23030600564

Address: Hamilton Avenue, Spencer Avenue, Parkdale Avenue and Armstrong Street Block, Ottawa, ...




★ Project Property	Freeways; Highways	Beach	Shopping & Sports Area
⬢ Buffer Outline	Traffic Circle; Ramp	Airport	University/College
▲ Eris Sites with Higher Elevation	Major Arterial; Minor Arterial	Industrial Area	Cemetery; Golf Course
■ Eris Sites with Same Elevation	Local Road	Military Base	Park (National)
▼ Eris Sites with Lower Elevation	Service Road; Traffic Circle; Ramp	Aircraft Roads	Park (City/County)
○ Eris Sites with Unknown Elevation	Rail	Native Reservation	
		Hospital	

75°43'30"W

45°24'N

45°24'N

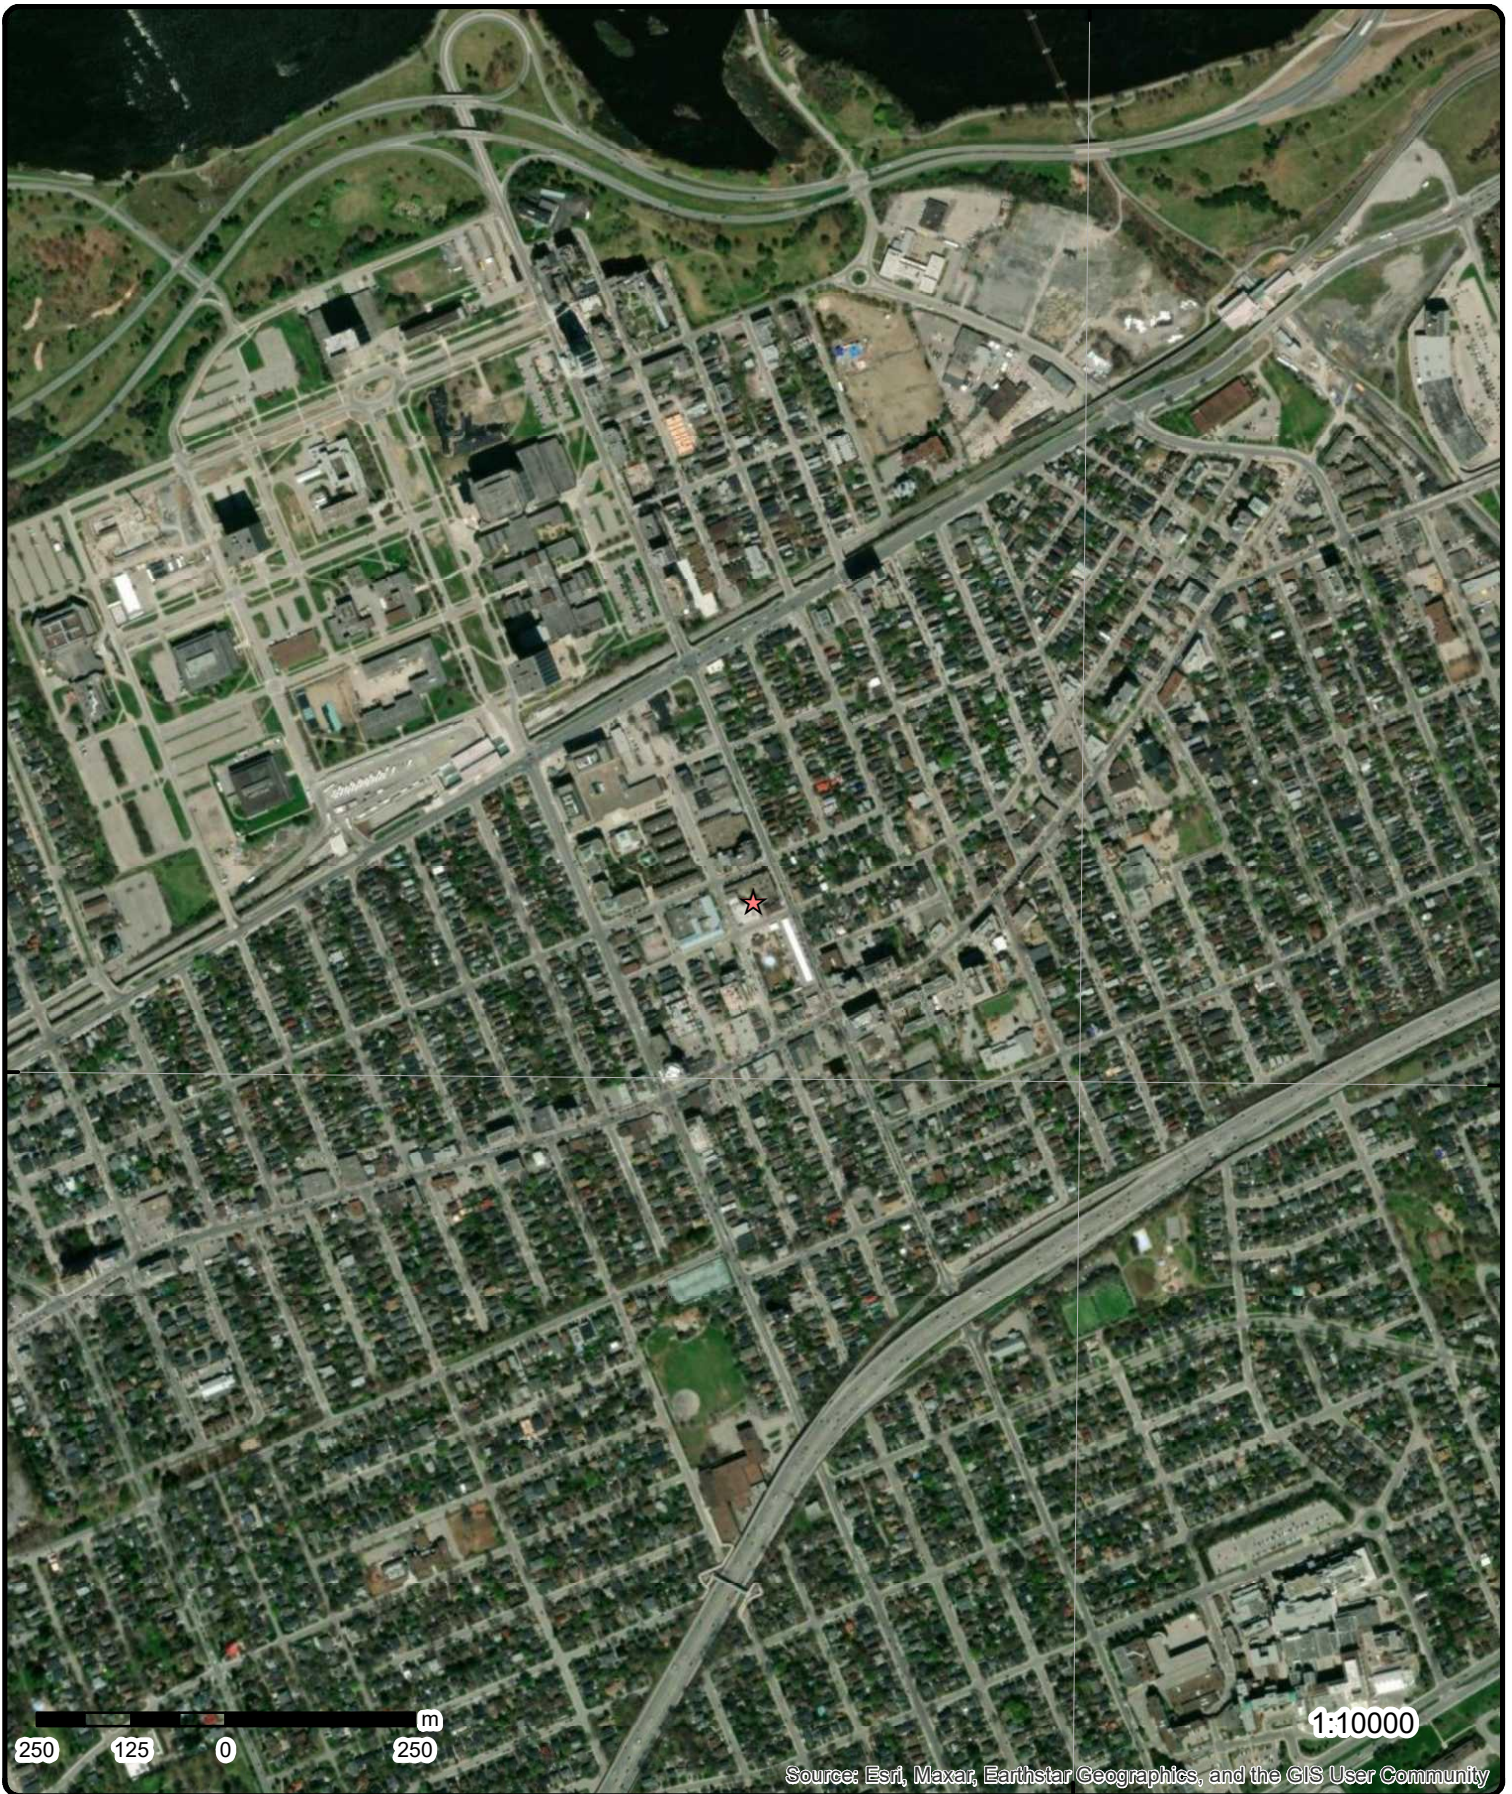

Source: Esri, Maxar, Earthstar Geographics, and the GIS User Community

Aerial

Year: 2022

Order Number: 23030600564

Address: Hamilton Avenue, Spencer Avenue, Parkdale Avenue and Armstrong



1, ON

Source: ESRI World Imagery

© ERIS Information Limited Partnership

75°45'W


75°43'30"W

45°25'30"N

45°25'30"N

45°24'N

45°24'N

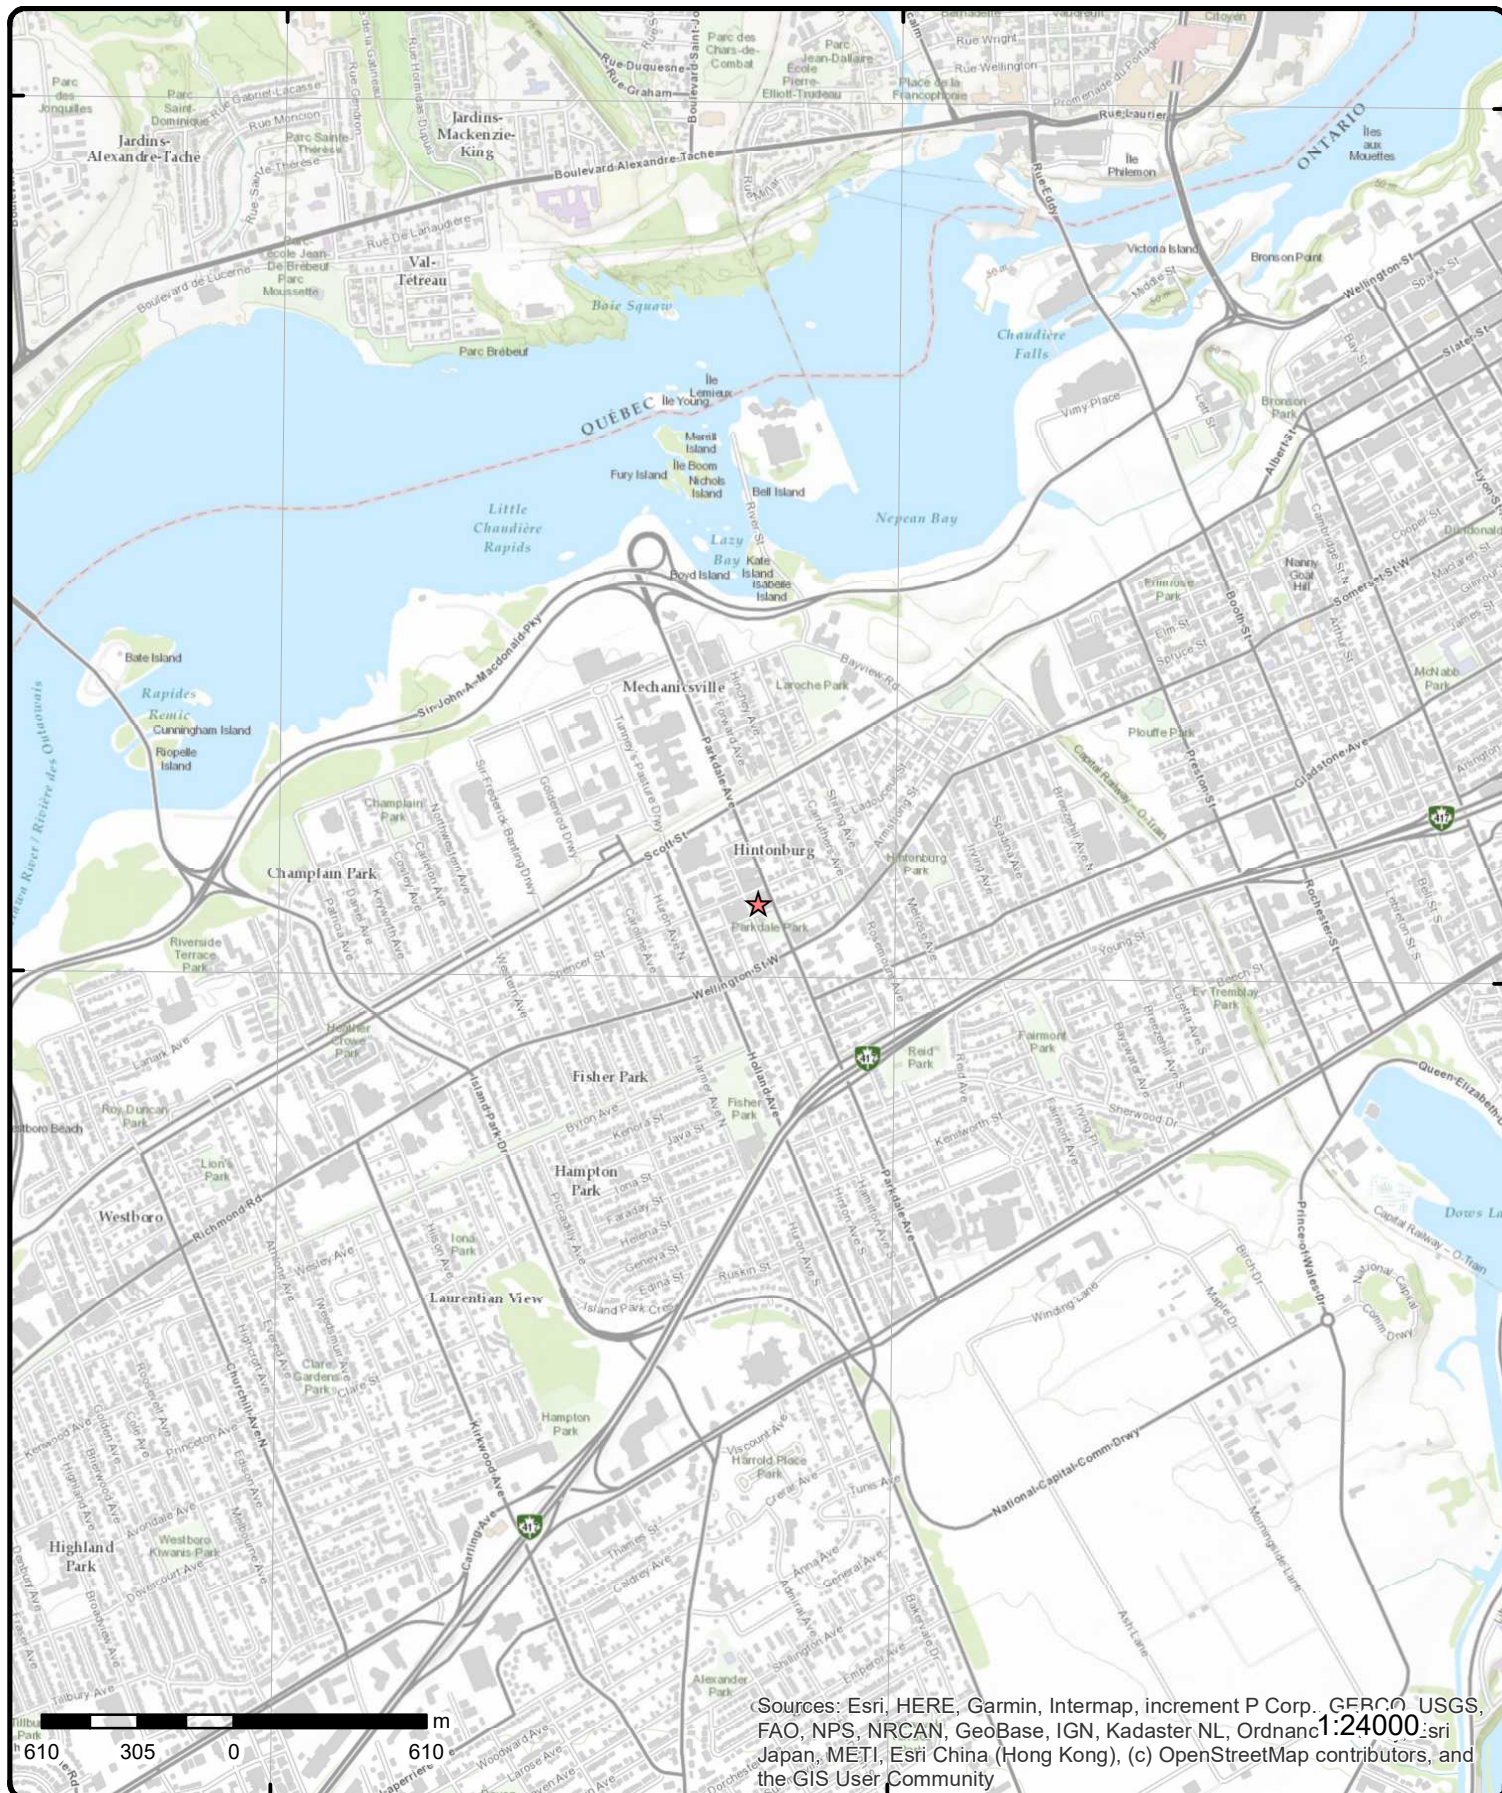

Topographic Map

Order Number: 23030600564

Address: Hamilton Avenue, Spencer Avenue, Parkdale Avenue and Armstrong

Source: ESRI World Topographic Map

© ERIS Information Limited Partnership



Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 1	WNW/3.5	62.9 / 0.00	233 ARMSTRONG Ottawa ON	WWIS
Well ID: 7220783 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z171271 Tag: _NO_TAG Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 27-May-2014 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7328 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date: 2012/11/30 Year Completed: 2012 Depth (m): 22.86 Latitude: 45.402129259439 Longitude: -75.7305587564468 Path:					
Bore Hole Information					
Bore Hole ID: 1004779144 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 30-Nov-2012 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 442825.00 North83: 5027883.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005172406			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		0.5899999737739563			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005172407			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		26			
Mat3 Desc:		ROCK			
Formation Top Depth:		0.5899999737739563			
Formation End Depth:		22.860000610351562			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005172416			
Layer:		1			
Plug From:		0.0			
Plug To:		20.799999237060547			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005172415			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005172405			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005172412			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		21.0			
Casing Diameter:		3.0999999046325684			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005172413			
Layer:		1			
Slot:		10			
Screen Top Depth:		21.0			
Screen End Depth:		22.860000610351562			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		3.799999952316284			
<u>Water Details</u>					
Water ID:		1005172411			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005172409			
Diameter:		10.15999984741211			
Depth From:		11.800000190734863			
Depth To:		20.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005172408			
Diameter:		12.699999809265137			
Depth From:		0.0			
Depth To:		11.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005172410			
Diameter:		7.599999904632568			
Depth From:		20.0			
Depth To:		22.860000610351562			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:		1004779144		Tag No:	_NO_TAG
Depth M:		22.86		Contractor:	7328
Year Completed:		2012		Path:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Dt:	2012/11/30			Latitude:	45.402129259439
Audit No:	Z171271			Longitude:	-75.7305587564468

2	1 of 1	ESE/5.2	62.9 / 0.00	3 Hamilton Ave Ottawa ON	WWIS
Well ID:	7343185			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z231276			Contractor:	7241
Tag:	A265328			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2019/04/02
Year Completed: 2019
Depth (m): 10.9728
Latitude: 45.4020848286664
Longitude: -75.7304687406626
Path:

Bore Hole Information

Bore Hole ID:	1007660790	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442832.00
Code OB Desc:		North83:	5027878.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	02-Apr-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID: 1007846640
Layer: 1

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846641			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		6.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846642			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		6.5			
Formation End Depth:		36.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848099			
Layer:		4			
Plug From:		22.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848100			
Layer:		5			
Plug From:		24.0			
Plug To:		36.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848097			
Layer:		2			
Plug From:		1.0			
Plug To:		6.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848096			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848098			
Layer:		3			
Plug From:		6.5			
Plug To:		22.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849635			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845074			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850362			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		26.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850722			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Slot:		10			
Screen Top Depth:		26.0			
Screen End Depth:		36.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851774			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849063			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		6.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849064			
Diameter:		3.5			
Depth From:		6.5			
Depth To:		36.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007660790			Tag No:	A265328
Depth M:	10.9728			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/04/02			Latitude:	45.4020848286664
Audit No:	Z231276			Longitude:	-75.7304687406626
3	1 of 1	E/6.2	62.9 / 0.00	229 Armstrong St Ottawa ON	WWIS
Well ID:	7343178			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:	Z231280	Contractor:		7241	
Tag:	A265329	Form Version:		7	
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:					
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:			2019/04/02		
Year Completed:			2019		
Depth (m):			18.29		
Latitude:			45.4021029932026		
Longitude:			-75.7304434195653		
Path:					
Bore Hole Information					
Bore Hole ID:			1007660769		
DP2BR:			Elevation:		
Spatial Status:			Elevrc:		
Code OB:			Zone:		18
Code OB Desc:			East83:		442834.00
Open Hole:			North83:		5027880.00
Cluster Kind:			Org CS:		UTM83
Date Completed:			UTMRC:		4
Remarks:			UTMRC Desc:		margin of error : 30 m - 100 m
Loc Method Desc:			Location Method:		wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:			1007846619		
Layer:			1		
Color:			8		
General Color:			BLACK		
Mat1:			27		
Most Common Material:			OTHER		
Mat2:			11		
Mat2 Desc:			GRAVEL		
Mat3:			66		
Mat3 Desc:			DENSE		
Formation Top Depth:			0.0		
Formation End Depth:			0.3100000023841858		
Formation End Depth UOM:			m		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846621			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		18.290000915527344			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846620			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		27			
Mat2 Desc:		OTHER			
Mat3:		35			
Mat3 Desc:		WOOD FRAGMENTS			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848064			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		14.630000114440918			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848063			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848065			
Layer:		3			
Plug From:		14.630000114440918			
Plug To:		18.290000915527344			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849556			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845067			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850355			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		15.239999771118164			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007850930			
Layer:		1			
Slot:		10			
Screen Top Depth:		15.239999771118164			
Screen End Depth:		18.290000915527344			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851767			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849049			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Diameter: 11.430000305175781 Depth From: 0.0 Depth To: 2.130000114440918 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1007849050 Diameter: 8.890000343322754 Depth From: 2.130000114440918 Depth To: 18.290000915527344 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID:	1007660769			Tag No:	A265329
Depth M:	18.29			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/04/02			Latitude:	45.4021029932026
Audit No:	Z231280			Longitude:	-75.7304434195653
<u>4</u>	1 of 1	N/7.9	62.9 / 0.00	340 PARKDALE AVE Ottawa ON	WWIS
Well ID:	7342140			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	23-Jul-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z308416			Contractor:	7241
Tag:	A257662			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/09/15				
Year Completed:	2019				
Depth (m):	7.3152				
Latitude:	45.4021834262257				
Longitude:	-75.7305338993686				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007662903			Elevation:	
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	442827.00
Code OB Desc:				North83:	5027889.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	15-Sep-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008202163			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		4.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008202164			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		4.5			
Formation End Depth:		24.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008202162			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		02			
Most Common Material:		TOPSOIL			
Mat2:		85			
Mat2 Desc:		SOFT			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008202882			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008202883			
Layer:		2			
Plug From:		1.0			
Plug To:		12.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008202884			
Layer:		3			
Plug From:		12.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008203452			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008203451			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1008201276			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008203704			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		14.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008203950			
Layer:		1			
Slot:		10			
Screen Top Depth:		14.0			
Screen End Depth:		24.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Construction Record - Screen</u>					
Screen ID:		1008203951			
Layer:		2			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:					
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008204250			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008203201			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		4.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1008203202			
Diameter:		3.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		4.5			
Depth To:		24.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007662903			Tag No:	A257662
Depth M:	7.3152			Contractor:	7241
Year Completed:	2019			Path:	734\7342140.pdf
Well Completed Dt:	2019/09/15			Latitude:	45.4021834262257
Audit No:	Z308416			Longitude:	-75.7305338993686

5	1 of 1	ESE/9.6	62.9 / 0.00	Ottawa ON	WWIS
Well ID:	7343187			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z308418			Contractor:	7241
Tag:	A265432			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2019/04/15
Year Completed: 2019
Depth (m): 16.1544
Latitude: 45.4020852372063
Longitude: -75.7304048579799
Path:

Bore Hole Information

Bore Hole ID:	1007660796	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442837.00
Code OB Desc:		North83:	5027878.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	15-Apr-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846647			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846646			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846648			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		6.0			
Formation End Depth:		53.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848106			
Layer:		1			
Plug From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848107			
Layer:		2			
Plug From:		1.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848108			
Layer:		3			
Plug From:		6.0			
Plug To:		39.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848109			
Layer:		4			
Plug From:		39.0			
Plug To:		41.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848110			
Layer:		5			
Plug From:		41.0			
Plug To:		53.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849639			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845076			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850364			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		43.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850725			
Layer:		1			
Slot:		10			
Screen Top Depth:		43.0			
Screen End Depth:		53.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851776			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849068			
Diameter:		3.0			
Depth From:		6.0			
Depth To:		53.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849067			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007660796		Tag No:	A265432	
Depth M:	16.1544		Contractor:	7241	
Year Completed:	2019		Path:		
Well Completed Dt:	2019/04/15		Latitude:	45.4020852372063	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:	Z308418			Longitude:	-75.7304048579799
6	1 of 2	E/11.4	62.9 / 0.00	366 ARMSTRONG ST Ottawa ON	WWIS
Well ID:	7276808			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	12-Dec-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z238043			Contractor:	7241
Tag:	A191087			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2016/10/17				
Year Completed:	2016				
Depth (m):	22.32				
Latitude:	45.4021394039607				
Longitude:	-75.730380000773				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006305155			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442839.00
Code OB Desc:				North83:	5027884.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	17-Oct-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1006480701				
Layer:	1				
Color:	6				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006480703			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		2.440000057220459			
Formation End Depth:		22.31999969482422			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006480702			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		1.5			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006480716			
Layer:		4			
Plug From:		18.549999237060547			
Plug To:		22.31999969482422			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006480715			
Layer:		3			
Plug From:		17.06999969482422			
Plug To:		18.549999237060547			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006480713			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006480714			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		17.06999969482422			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006480712			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006480700			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006480708			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		19.219999313354492			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006480709			
Layer:		1			
Slot:		10			
Screen Top Depth:		19.219999313354492			
Screen End Depth:		22.31999969482422			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1006480707			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
 <u>Hole Diameter</u>					
Hole ID:		1006480706			
Diameter:		7.099999904632568			
Depth From:		12.0			
Depth To:		22.31999969482422			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
 <u>Hole Diameter</u>					
Hole ID:		1006480705			
Diameter:		9.0			
Depth From:		3.0999999046325684			
Depth To:		12.0			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
 <u>Hole Diameter</u>					
Hole ID:		1006480704			
Diameter:		11.899999618530273			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
 <u>Links</u>					
Bore Hole ID:	1006305155			Tag No:	A191087
Depth M:	22.32			Contractor:	7241
Year Completed:	2016			Path:	727\7276808.pdf
Well Completed Dt:	2016/10/17			Latitude:	45.4021394039607
Audit No:	Z238043			Longitude:	-75.730380000773
<u>6</u>	2 of 2	E/11.4	62.9 / 0.00	2323 RIVERSIDE RD Ottawa ON	WWIS
Well ID:	7275422			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	22-Nov-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z238042			Contractor:	7241
Tag:	A191053			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:		NEPEAN TOWNSHIP		UTM Reliability:	
Municipality:					
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2016/10/18			
Year Completed:		2016			
Depth (m):		4.27			
Latitude:		45.4021394039607			
Longitude:		-75.730380000773			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006293468			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442839.00
Code OB Desc:				North83:	5027884.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	18-Oct-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006431736				
Layer:	3				
Color:	8				
General Color:	BLACK				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	05				
Mat2 Desc:	CLAY				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	3.0999999046325684				
Formation End Depth:	4.269999980926514				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006431734				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006431735			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006431744			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006431745			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		0.9100000262260437			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006431746			
Layer:		3			
Plug From:		0.9100000262260437			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006431743			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006431733			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1006431739					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 1.2200000286102295					
Casing Diameter: 5.199999809265137					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1006431740					
Layer: 1					
Slot: 10					
Screen Top Depth: 1.2200000286102295					
Screen End Depth: 4.269999980926514					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 6.03000020980835					
<u>Water Details</u>					
Water ID: 1006431738					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1006431737					
Diameter: 15.229999542236328					
Depth From: 0.0					
Depth To: 4.269999980926514					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 1006293468					
Depth M: 4.27					
Year Completed: 2016					
Well Completed Dt: 2016/10/18					
Audit No: Z238042					
Tag No: A191053					
Contractor: 7241					
Path: 727\7275422.pdf					
Latitude: 45.4021394039607					
Longitude: -75.730380000773					
7	1 of 1	ESE/11.8	62.9 / 0.00	Parkdale + Hamilton St. Ottawa ON	WWIS
Well ID: 7343184					
Construction Date:					
Use 1st: Monitoring and Test Hole					
Use 2nd:					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status:					
Data Src:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z231272			Contractor:	7241
Tag:	A265327			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/04/02				
Year Completed:	2019				
Depth (m):	10.9728				
Latitude:	45.4020583172357				
Longitude:	-75.7303917335046				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007660787			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442838.00
Code OB Desc:				North83:	5027875.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	02-Apr-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846638				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	09				
Most Common Material:	MEDIUM SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	12				
Mat3 Desc:	STONES				
Formation Top Depth:	1.0				
Formation End Depth:	6.0				
Formation End Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846639			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		6.0			
Formation End Depth:		36.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846637			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848093			
Layer:		3			
Plug From:		6.0			
Plug To:		22.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848095			
Layer:		5			
Plug From:		24.0			
Plug To:		36.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848094			
Layer:		4			
Plug From:		22.0			
Plug To:		24.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848092			
Layer:		2			
Plug From:		1.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848091			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849631			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845073			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850361			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		26.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850716			
Layer:		1			
Slot:		10			
Screen Top Depth:		26.0			
Screen End Depth:		36.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test ID: 1007851773					
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM: ft					
Rate UOM: GPM					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method: 0					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007849061					
Diameter: 4.5					
Depth From: 0.0					
Depth To: 6.0					
Hole Depth UOM: ft					
Hole Diameter UOM: Inch					
<u>Hole Diameter</u>					
Hole ID: 1007849062					
Diameter: 3.5					
Depth From: 6.0					
Depth To: 36.0					
Hole Depth UOM: ft					
Hole Diameter UOM: Inch					
<u>Links</u>					
Bore Hole ID: 1007660787					
Depth M: 10.9728					
Year Completed: 2019					
Well Completed Dt: 2019/04/02					
Audit No: Z231272					
Tag No: A265327					
Contractor: 7241					
Path:					
Latitude: 45.4020583172357					
Longitude: -75.7303917335046					

<u>8</u>	1 of 1	NE/12.4	62.9 / 0.00	340 PARKDALE AVE Ottawa ON	WWIS
Well ID: 7342139					
Construction Date:					
Use 1st: Monitoring and Test Hole					
Use 2nd:					
Final Well Status: Monitoring and Test Hole					
Water Type:					
Casing Material:					
Audit No: Z308417					
Tag: A265434					
Constructn Method:					
Elevation (m):					
Elevatn Reliabilty:					
Depth to Bedrock:					
Well Depth:					
Overburden/Bedrock:					
Pump Rate:					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status:					
Data Src:					
Date Received: 23-Jul-2019 00:00:00					
Selected Flag: TRUE					
Abandonment Rec:					
Contractor: 7241					
Form Version: 7					
Owner:					
County: OTTAWA-CARLETON					
Lot:					
Concession:					
Concession Name:					
Easting NAD83:					
Northing NAD83:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level: Clear/Cloudy: Municipality: Site Info:			Zone: UTM Reliability:		
OTTAWA CITY					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2019/04/15			
Year Completed:		2019			
Depth (m):		0.3048			
Latitude:		45.402210999897			
Longitude:		-75.7304448114234			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:		1007662900		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		15-Apr-2019 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				wwr	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008202160			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:					
Formation End Depth UOM:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008202161			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2 Desc:		SHALE			
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1008202159			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		02			
Most Common Material:		TOPSOIL			
Mat2:		85			
Mat2 Desc:		SOFT			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008202879			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008202880			
Layer:		2			
Plug From:		1.0			
Plug To:		11.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1008202881			
Layer:		3			
Plug From:		11.0			
Plug To:		23.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1008203450			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID:		1008201275			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008203703			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		13.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1008203949			
Layer:		1			
Slot:		10			
Screen Top Depth:		13.0			
Screen End Depth:		23.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008204249			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1008203200			
Diameter:		3.5			
Depth From:		4.0			
Depth To:		23.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1008203199			
Diameter:		9.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		4.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007662900			Tag No:	A265434
Depth M:	0.3048			Contractor:	7241
Year Completed:	2019			Path:	734\7342139.pdf
Well Completed Dt:	2019/04/15			Latitude:	45.402210999897
Audit No:	Z308417			Longitude:	-75.7304448114234

9	1 of 1	ENE/13.5	62.9 / 0.00	2323 RIVERSIDE DR Ottawa ON	WWIS
Well ID:	7275421			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	22-Nov-2016 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z238041			Contractor:	7241
Tag:	A191054			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2016/10/18
Year Completed: 2016
Depth (m): 4.57
Latitude: 45.4021844067507
Longitude: -75.7303805806632
Path:

Bore Hole Information

Bore Hole ID:	1006293465	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442839.00
Code OB Desc:		North83:	5027889.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	18-Oct-2016 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006431708			
Layer:		3			
Color:		8			
General Color:		BLACK			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		1.8200000524520874			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006431707			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.8200000524520874			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006431706			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:					
Most Common Material:					
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006431718			
Layer:		2			
Plug From:		0.3100000023841858			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		1.2200000286102295			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006431717			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006431719			
Layer:		3			
Plug From:		1.2200000286102295			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006431716			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006431705			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006431711			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Casing Diameter:		5.1999999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Casing</u>					
Casing ID:		1006431712			
Layer:		2			
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1006431713			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.519999809265137			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1006431710			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006431709			
Diameter:		15.229999542236328			
Depth From:		0.0			
Depth To:		4.570000171661377			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1006293465			Tag No:	A191054
Depth M:	4.57			Contractor:	7241
Year Completed:	2016			Path:	727\7275421.pdf
Well Completed Dt:	2016/10/18			Latitude:	45.4021844067507
Audit No:	Z238041			Longitude:	-75.7303805806632
10	1 of 1	SSW/13.7	62.9 / 0.00	ADD ELECTRONICS INC. 233 Armstrong St Ottawa ON K1Y 2W5	SCT
Established:		0000			
Plant Size (ft²):		0			
Employment:		0			
<u>--Details--</u>					
Description:		Other Communications Equipment Manufacturing			
SIC/NAICS Code:		334290			
Description:		Audio and Video Equipment Manufacturing			
SIC/NAICS Code:		334310			
Description:		Semiconductor and Other Electronic Component Manufacturing			
SIC/NAICS Code:		334410			
Description:		Electrical Wiring and Construction Supplies Wholesaler-Distributors			
SIC/NAICS Code:		416110			
Description:		Industrial Machinery, Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		417230			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description: SIC/NAICS Code:		Electronic Components, Navigational and Communications Equipment and Supplies Wholesaler-Distributors 417320			
11	1 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED SPERRY AEROSPACE DIVISION P.O.BOX 3160, STATION "C" 3 HAMILTON AV OTTAWA ON K1Y 4J4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON0144004 3211 AIRCRAFT & PARTS IND 88,89,90 			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		241 HALOGENATED SOLVENTS			
Waste Class: Waste Class Name:		148 INORGANIC LABORATORY CHEMICALS			
Waste Class: Waste Class Name:		212 ALIPHATIC SOLVENTS			
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
Waste Class: Waste Class Name:		251 OIL SKIMMINGS & SLUDGES			
11	2 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON0144004 3211 AIRCRAFT & PARTS IND 92,93,97,98,99,00,01,02,03,04,05,06,07,08 			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		148 INORGANIC LABORATORY CHEMICALS			
Waste Class:		212			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
11	3 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED 35-071 SPERRY AEROSPACE DIVISION P.O.BOX 3160, STATION "C" 3 HAMILTON AV OTTAWA ON K1Y 4J4	GEN
Generator No:		ON0144004			
SIC Code:		3211			
SIC Description:		AIRCRAFT & PARTS IND			
Approval Years:		94,95,96			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
 <u>Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
11	4 of 20	NNW/14.5	62.9 / 0.00	SPERRY INC AEROSPACE & MARINE GROUP 3 HAMILTON AVE. N., P.O. BOX 390 OTTAWA ON K1Y 1B4	GEN
Generator No:		ON0161800			
SIC Code:		3399			
SIC Description:		OTHER ELECT. PROD.			
Approval Years:		86,87			
PO Box No:					
Country:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
11	5 of 20	NNW/14.5	62.9 / 0.00	SPERRY SEE&USE ON0144004 AEROSPACE & MARINE GROUP 3 HAMILTON AVE. N., P.O. BOX 390 OTTAWA ON K1Y 1B4	GEN
Generator No:		ON0161800			
SIC Code:		3399			
SIC Description:		OTHER ELECT. PROD.			
Approval Years:		88,89,90			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
11	6 of 20	NNW/14.5	62.9 / 0.00	SPERRY SEE&USE ON0144004 35-071 AEROSPACE & MARINE GROUP 3 HAMILTON AVE. N., P.O. BOX 390 OTTAWA ON K1Y 1B4	GEN
Generator No:		ON0161800			
SIC Code:		3399			
SIC Description:		OTHER ELECT. PROD.			
Approval Years:		92,93,94,95,96,97			
PO Box No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
11	7 of 20	NNW/14.5	62.9 / 0.00	SPERRY (SEE&USE ON0144004) AEROSPACE & MARINE GROUP 3 HAMILTON AVENUE NORTH OTTAWA ON K1Y 1B4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON0161800 3399 OTHER ELECT. PROD. 98			
11	8 of 20	NNW/14.5	62.9 / 0.00	Honeywell Limited Adjacent to 3 Hamilton Avenue, Ottawa, Ontario CITY OF OTTAWA ON	EBR
EBR Registry No: Ministry Ref No: Notice Type: Notice Stage: Notice Date: Proposal Date: Year: Instrument Type: Off Instrument Name: Posted By: Company Name: Site Address: Location Other: Proponent Name: Proponent Address: Comment Period: URL: Site Location Details: Adjacent to 3 Hamilton Avenue, Ottawa, Ontario CITY OF OTTAWA		IA07E0164 7621-6XSLSG Instrument Decision September 10, 2007 February 01, 2007 2007 (EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air) Posted By: Honeywell Limited 155 Gordon Baker Rd, Toronto Ontario, M2H 3N7			
Decision Posted: Exception Posted: Section: Act 1: Act 2: Site Location Map:					
11	9 of 20	NNW/14.5	62.9 / 0.00	Honeywell Limited 3 Hamilton Ave, 223 & 233 Armstrong Street CITY OF OTTAWA ON	PTTW
EBR Registry No: Ministry Ref No: Notice Type:		IA07E0182 3856-6Y2PSG Instrument Decision			
		Decision Posted: Exception Posted: Section:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Notice Stage: Notice Date: April 12, 2007 Proposal Date: February 02, 2007 Year: 2007 Instrument Type: (OWRA s. 34) - Permit to Take Water Off Instrument Name: Posted By: Company Name: Honeywell Limited Site Address: Location Other: Proponent Name: Proponent Address: 155 Gordon Baker Rd, Toronto Ontario, M2H 3N7 Comment Period: URL: Site Location Details: 3 Hamilton Ave, 223 & 233 Armstrong Street CITY OF OTTAWA					
				Act 1: Act 2: Site Location Map:	

11	10 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	GEN
Generator No: ON0144004 SIC Code: 336410 SIC Description: Aerospace Product and Parts Manufacturing Approval Years: 2010 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: Detail(s) Waste Class: 150 Waste Class Name: INERT INORGANIC WASTES Waste Class: 221 Waste Class Name: LIGHT FUELS Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					

11	11 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	GEN
Generator No: ON0144004 SIC Code: 336410 SIC Description: Aerospace Product and Parts Manufacturing Approval Years: 2011 PO Box No: Country: Status: Co Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
11	12 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 4J4	GEN
Generator No:		ON0144004			
SIC Code:		336410			
SIC Description:		Aerospace Product and Parts Manufacturing			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
11	13 of 20	NNW/14.5	62.9 / 0.00	Honeywell Limited 3 Hamilton Ave 223 & 233 Armstrong Street Ottawa ON M2H 3N7	ECA
Approval No:		8067-76SQVA		MOE District:	Ottawa
Approval Date:		2007-10-03		City:	
Status:		Approved		Longitude:	-75.73057
Record Type:		ECA		Latitude:	45.40224
Link Source:		IDS		Geometry X:	
SWP Area Name:		Rideau Valley		Geometry Y:	
Approval Type:		ECA-AIR			
Project Type:		AIR			
Business Name:		Honeywell Limited			
Address:		3 Hamilton Ave 223 & 233 Armstrong Street			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/7621-6XSLSG-14.pdf			
PDF Site Location:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
11	14 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	GEN
Generator No:		ON0144004			
SIC Code:		336410			
SIC Description:		AEROSPACE PRODUCT AND PARTS MANUFACTURING			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Paul Hurst			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		613-592-9600 Ext.4292			
Contaminated Facility:		Yes			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
11	15 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	GEN
Generator No:		ON0144004			
SIC Code:		336410			
SIC Description:		AEROSPACE PRODUCT AND PARTS MANUFACTURING			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Paul Hurst			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		613-592-9600 Ext.			
Contaminated Facility:		Yes			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		241			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		HALOGENATED SOLVENTS			
11	16 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	GEN
Generator No:		ON0144004			
SIC Code:		336410			
SIC Description:		AEROSPACE PRODUCT AND PARTS MANUFACTURING			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Paul Hurst			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		613-592-9600 Ext.			
Contaminated Facility:		Yes			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
11	17 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED Aerospace Electronic Systems SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	GEN
Generator No:		ON0144004			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		150 L			
Waste Class Name:		Inert organic wastes			
Waste Class:		221 L			
Waste Class Name:		Light fuels			
Waste Class:		241 H			
Waste Class Name:		Halogenated solvents and residues			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: 241 L Waste Class Name: Halogenated solvents and residues Waste Class: 241 T Waste Class Name: Halogenated solvents and residues Waste Class: 251 L Waste Class Name: Waste oils/sludges (petroleum based)					
11	18 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED Aerospace Electronic Systems SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	GEN
Generator No: ON0144004 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 241 T Waste Class Name: Halogenated solvents and residues Waste Class: 241 H Waste Class Name: Halogenated solvents and residues Waste Class: 221 L Waste Class Name: Light fuels Waste Class: 241 L Waste Class Name: Halogenated solvents and residues Waste Class: 150 L Waste Class Name: Inert organic wastes Waste Class: 251 L Waste Class Name: Waste oils/sludges (petroleum based) Waste Class: 135 L Waste Class Name: Wastes containing other reactive anions					
11	19 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED Aerospace Electronic Systems SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	GEN
Generator No: ON0144004 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		Canada Registered			
<u>Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
Waste Class:		241 H			
Waste Class Name:		Halogenated solvents and residues			
Waste Class:		241 T			
Waste Class Name:		Halogenated solvents and residues			
Waste Class:		150 L			
Waste Class Name:		Inert organic wastes			
Waste Class:		241 L			
Waste Class Name:		Halogenated solvents and residues			
Waste Class:		135 L			
Waste Class Name:		Wastes containing other reactive anions			
Waste Class:		221 L			
Waste Class Name:		Light fuels			
11	20 of 20	NNW/14.5	62.9 / 0.00	HONEYWELL LIMITED Aerospace Electronic Systems SPERRY AEROSPACE DIVISION 3 HAMILTON AVENUE OTTAWA ON K1Y 1B4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON0144004 As of Oct 2022			
<u>Detail(s)</u>					
Waste Class:		241 L			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		241 T			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		135 L			
Waste Class Name:		REACTIVE ANION WASTES			
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1007660766			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442838.00
Code OB Desc:				North83:	5027866.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01-Apr-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846618				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:	17				
Mat2 Desc:	SHALE				
Mat3:	74				
Mat3 Desc:	LAYERED				
Formation Top Depth:	1.5199999809265137				
Formation End Depth:	18.290000915527344				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846617				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	27				
Mat2 Desc:	OTHER				
Mat3:	35				
Mat3 Desc:	WOOD FRAGMENTS				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	1.5199999809265137				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846616				
Layer:	1				
Color:	8				
General Color:	BLACK				
Mat1:	27				
Most Common Material:	OTHER				
Mat2:	11				
Mat2 Desc:	GRAVEL				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848060			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848062			
Layer:		3			
Plug From:		14.630000114440918			
Plug To:		18.290000915527344			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848061			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		14.630000114440918			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849781			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845066			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850354			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		15.239999771118164			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1007850926			
Layer:		1			
Slot:		10			
Screen Top Depth:		15.239999771118164			
Screen End Depth:		18.290000915527344			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851766			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849048			
Diameter:		8.890000343322754			
Depth From:		2.130000114440918			
Depth To:		18.290000915527344			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007849047			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1007660766			Tag No:	A189973
Depth M:	18.29			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/04/01			Latitude:	45.4019773122119
Audit No:	Z231281			Longitude:	-75.7303906896917
14	1 of 1	ESE/18.5	62.9 / 0.00	Ottawa ON	WWIS
Well ID:	7343186			Flowing (Y/N):	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z308421			Contractor:	7241
Tag:	A265433			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/04/15				
Year Completed:	2019				
Depth (m):	15.8496				
Latitude:	45.4020318057526				
Longitude:	-75.730314726418				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007660793			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442844.00
Code OB Desc:				North83:	5027872.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	15-Apr-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846645				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:	17				
Mat2 Desc:	SHALE				
Mat3:	73				
Mat3 Desc:	HARD				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		5.5			
Formation End Depth:		52.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846643			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		09			
Mat2 Desc:		MEDIUM SAND			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846644			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		5.5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848103			
Layer:		3			
Plug From:		6.0			
Plug To:		38.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848104			
Layer:		4			
Plug From:		38.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848105			
Layer:		5			
Plug From:		40.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		52.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848102			
Layer:		2			
Plug From:		1.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848101			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849636			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007845075			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007850363			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		42.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007850723			
Layer:		1			
Slot:		10			
Screen Top Depth:		42.0			
Screen End Depth:		52.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851775			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849065			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		5.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849066			
Diameter:		3.5			
Depth From:		5.5			
Depth To:		52.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007660793			Tag No:	A265433
Depth M:	15.8496			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/04/15			Latitude:	45.4020318057526
Audit No:	Z308421			Longitude:	-75.730314726418
15	1 of 1	SE/23.0	62.9 / 0.00	3 Hamilton Ave Ottawa ON	WWIS
Well ID:	7343183			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z231234			Contractor:	7241
Tag:	A265326			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			NEPEAN TOWNSHIP	Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2019/04/02			
Year Completed:		2019			
Depth (m):		11.1252			
Latitude:		45.4019323911223			
Longitude:		-75.7303773332953			
Path:					
Bore Hole Information					
Bore Hole ID:		1007660784		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442839.00
Code OB Desc:				North83:	5027861.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		02-Apr-2019 00:00:00		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock Materials Interval					
Formation ID:		1007846634			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
Overburden and Bedrock Materials Interval					
Formation ID:		1007846636			
Layer:		3			
Color:		2			
General Color:		GREY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.5			
Formation End Depth:		36.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846635			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		5.5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848087			
Layer:		2			
Plug From:		1.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848089			
Layer:		4			
Plug From:		22.5			
Plug To:		24.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848088			
Layer:		3			
Plug From:		6.0			
Plug To:		22.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848086			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848090			
Layer:		5			
Plug From:		24.5			
Plug To:		36.5			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849626			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845072			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850360			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		26.5			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850710			
Layer:		1			
Slot:		10			
Screen Top Depth:		26.5			
Screen End Depth:		36.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851772			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
Hole Diameter					
Hole ID: 1007849059 Diameter: 4.5 Depth From: 0.0 Depth To: 5.5 Hole Depth UOM: ft Hole Diameter UOM: Inch					
Hole Diameter					
Hole ID: 1007849060 Diameter: 3.5 Depth From: 5.5 Depth To: 36.5 Hole Depth UOM: ft Hole Diameter UOM: Inch					
Links					
Bore Hole ID: 1007660784 Depth M: 11.1252 Year Completed: 2019 Well Completed Dt: 2019/04/02 Audit No: Z231234					
Tag No: A265326 Contractor: 7241 Path: Latitude: 45.4019323911223 Longitude: -75.7303773332953					
16	1 of 1	SE/26.7	62.9 / 0.00	Anco Homes Ltd. ON K0A 3K0	ECA
Approval No: A-500-2134970474 Approval Date: June 13, 2022 Status: Active Record Type: ECA Link Source: MOFA SWP Area Name: Rideau Valley Approval Type: ECA-SEWAGE,SEWAGE_MUNICIPAL Project Type: SEWAGE,SEWAGE_MUNICIPAL Business Name: Anco Homes Ltd. Address: Full Address: Full PDF Link: http://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=2659872 PDF Site Location: Lot Number: 29, Concession Number: 1, Geographic Township: ALFRED, Municipality: ALFRED AND PLANTAGENET, County/District: PRESCOTT AND RUSSELL, State/Province: Ontario, Postal/Zip Code: K0A 3K0					
MOE District: Ottawa City: Longitude: -75.73027778 Latitude: 45.40194444 Geometry X: -8430255.9598999992 Geometry Y: 5685022.9350000005					
17	1 of 1	N/28.8	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID: 7041973 Construction Date: Use 1st: Use 2nd:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64907			Contractor:	3651
Tag:	A054053			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041973.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2007/03/15				
Year Completed:	2007				
Depth (m):	6.1				
Latitude:	45.4023724379331				
Longitude:	-75.7305363354339				
Path:	704\7041973.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11764476			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442827.00
Code OB Desc:				North83:	5027910.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095687				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	1.5				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095688			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316040			
Layer:		1			
Plug From:		0.0			
Plug To:		2.4000000953674316			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041973			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772196			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897281			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.4000000953674316			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897282			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.4000000953674316			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To: 6.099999904632568 Casing Diameter: Casing Diameter UOM: cm Casing Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 11850739 Diameter: 25.3999999618530273 Depth From: 0.0 Depth To: 2.4000000953674316 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 11850740 Diameter: 15.199999809265137 Depth From: 2.4000000953674316 Depth To: 6.099999904632568 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 11764476 Depth M: 6.1 Year Completed: 2007 Well Completed Dt: 2007/03/15 Audit No: Z64907					
Tag No: A054053 Contractor: 3651 Path: 704\7041973.pdf Latitude: 45.4023724379331 Longitude: -75.7305363354339					
18	1 of 1	ESE/30.8	62.9 / 0.00	Armstrong St. Ottawa ON	WWIS
Well ID: 7343191 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z231236 Tag: A261270 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info: PDF URL (Map):					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06-Sep-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2019/03/19 Year Completed: 2019 Depth (m): 17.8308					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:		45.4019424536749			
Longitude:		-75.7302113547109			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007660844			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442852.00
Code OB Desc:				North83:	5027862.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	19-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846661				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	27				
Most Common Material:	OTHER				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846663				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:	17				
Mat2 Desc:	SHALE				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	4.0				
Formation End Depth:	58.5				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846662				
Layer:	2				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		13			
Mat2 Desc:		BOULDERS			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848129			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848130			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848133			
Layer:		5			
Plug From:		39.0			
Plug To:		46.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848132			
Layer:		4			
Plug From:		27.0			
Plug To:		39.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848134			
Layer:		6			
Plug From:		46.5			
Plug To:		58.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848131			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		3			
Plug From:		4.0			
Plug To:		27.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849790			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849789			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845080			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850372			
Layer:		2			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		48.5			
Casing Diameter:		1.0499999523162842			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		1007850371			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		28.5			
Casing Diameter:		1.0499999523162842			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850749			
Layer:		2			
Slot:		10			
Screen Top Depth:		48.5			
Screen End Depth:		58.5			
Screen Material:		5			
Screen Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM:		inch			
Screen Diameter:		0.8040000200271606			
<u>Construction Record - Screen</u>					
Screen ID:		1007850748			
Layer:		1			
Slot:		10			
Screen Top Depth:		28.5			
Screen End Depth:		38.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		0.8040000200271606			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851780			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849075			
Diameter:		2.375			
Depth From:		0.0			
Depth To:		4.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849076			
Diameter:		2.375			
Depth From:		4.0			
Depth To:		58.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:		1007660844		Tag No:	A261270
Depth M:		17.8308		Contractor:	7241
Year Completed:		2019		Path:	
Well Completed Dt:		2019/03/19		Latitude:	45.4019424536749
Audit No:		Z231236		Longitude:	-75.7302113547109

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
19	1 of 1	ESE/31.0	62.9 / 0.00	223 Armstrong St Ottawa ON	WWIS
Well ID: 7343181 Construction Date: Use 1st: Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z231233 Tag: A177228 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06-Sep-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2019/04/01 Year Completed: 2019 Depth (m): 10.9728 Latitude: 45.4019787009511 Longitude: -75.730173488973 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007660778 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 01-Apr-2019 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 442855.00 North83: 5027866.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1007846630 Layer: 3 Color: 2 General Color: GREY Mat1: 15 Most Common Material: LIMESTONE					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		4.5			
Formation End Depth:		36.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846629			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		12			
Mat2 Desc:		STONES			
Mat3:		09			
Mat3 Desc:		MEDIUM SAND			
Formation Top Depth:		1.0			
Formation End Depth:		4.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846628			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848078			
Layer:		3			
Plug From:		5.0			
Plug To:		22.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848080			
Layer:		5			
Plug From:		24.0			
Plug To:		36.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID: 1007848076					
Layer: 1					
Plug From: 0.0					
Plug To: 1.0					
Plug Depth UOM: ft					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1007848077					
Layer: 2					
Plug From: 1.0					
Plug To: 5.0					
Plug Depth UOM: ft					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1007848079					
Layer: 4					
Plug From: 22.0					
Plug To: 24.0					
Plug Depth UOM: ft					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1007849621					
Method Construction Code: 7					
Method Construction: Diamond					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1007845070					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1007850358					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 26.0					
Casing Diameter: 1.3799999952316284					
Casing Diameter UOM: Inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1007850699					
Layer: 1					
Slot: 10					
Screen Top Depth: 26.0					
Screen End Depth: 36.0					
Screen Material: 5					
Screen Depth UOM: ft					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851770			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849056			
Diameter:		2.375			
Depth From:		4.5			
Depth To:		36.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849055			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		4.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:		1007660778		Tag No:	A177228
Depth M:		10.9728		Contractor:	7241
Year Completed:		2019		Path:	
Well Completed Dt:		2019/04/01		Latitude:	45.4019787009511
Audit No:		Z231233		Longitude:	-75.730173488973
20	1 of 1	W/33.0	63.2 / 0.31	3 HAMILTON AVE NORTH ON	WWIS
Well ID:		7041962		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Dewatering		Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z47376		Contractor:	3651
Tag:		A054042		Form Version:	3
Constructn Method:				Owner:	

146 erisinfo.com | Environmental Risk Information Services Order No: 23030600564

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.8999999761581421			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316029			
Layer:		1			
Plug From:		0.0			
Plug To:		1.7999999523162842			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041962			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		11772185			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930897260			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		1.7999999523162842			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Casing</u>					
Casing ID:		930897259			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		1.7999999523162842			
Casing Diameter:		15.8999999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		11850717			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		1.7999999523162842			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850718			
Diameter:		15.199999809265137			
Depth From:		1.7999999523162842			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11764465			Tag No:	A054042
Depth M:	6.1			Contractor:	3651
Year Completed:	2007			Path:	704\7041962.pdf
Well Completed Dt:	2007/03/14			Latitude:	45.4020368833386
Audit No:	Z47376			Longitude:	-75.7309281156146

21	1 of 1	E/33.1	62.9 / 0.00	3 HAMILTON AVE. NORTH ON	WWIS
Well ID:	7107670			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Other			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64916			Contractor:	3651
Tag:	A054062			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/710\7107670.pdf				

Additional Detail(s) (Map)

Well Completed Date: 2007/03/14
Year Completed: 2007
Depth (m): 7.6
Latitude: 45.4021141993769
Longitude: -75.7300985688828
Path: 710\7107670.pdf

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1001646254			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442861.00
Code OB Desc:				North83:	5027881.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	14-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1001661266				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	2.5999999046325684				
Formation End Depth:	7.599999904632568				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1001661265				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	2.5999999046325684				
Formation End Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1001661269				
Layer:	1				
Plug From:	0.0				
Plug To:	2.5999999046325684				
Plug Depth UOM:	m				
 <u>Method of Construction & Well</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Use</u>					
Method Construction ID:		1001661274			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1001661264			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1001661271			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.5999999046325684			
Casing Diameter:		15.8999999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1001661272			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1001661270			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1001661268			
Diameter:		15.199999809265137			
Depth From:		2.5999999046325684			
Depth To:		7.599999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1001661267			
Diameter:		25.3999999618530273			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		2.5999999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
Links					
Bore Hole ID:	1001646254			Tag No:	A054062
Depth M:	7.6			Contractor:	3651
Year Completed:	2007			Path:	710\7107670.pdf
Well Completed Dt:	2007/03/14			Latitude:	45.4021141993769
Audit No:	Z64916			Longitude:	-75.7300985688828

22	1 of 1	ENE/33.1	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7042084			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64915			Contractor:	3651
Tag:	A054061			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7042084.pdf				

Additional Detail(s) (Map)

Well Completed Date: 2007/03/14
 Year Completed: 2007
 Depth (m): 7.6
 Latitude: 45.4022399621782
 Longitude: -75.7301385216692
 Path: 704\7042084.pdf

Bore Hole Information

Bore Hole ID:	11764581	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442858.00
Code OB Desc:		North83:	5027895.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	14-Mar-2007 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095984			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		2.5999999046325684			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095983			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		2.5999999046325684			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316195			
Layer:		1			
Plug From:		0.0			
Plug To:		2.9000000953674316			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967042084			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772301			
Casing No:		1			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		930897407			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.9000000953674316			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897408			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.9000000953674316			
Depth To:		7.599999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850882			
Diameter:		15.199999809265137			
Depth From:		2.9000000953674316			
Depth To:		7.599999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850883			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		2.9000000953674316			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11764581			Tag No:	A054061
Depth M:	7.6			Contractor:	3651
Year Completed:	2007			Path:	704\7042084.pdf
Well Completed Dt:	2007/03/14			Latitude:	45.4022399621782
Audit No:	Z64915			Longitude:	-75.7301385216692
23	1 of 1	WSW/33.7	63.9 / 1.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041961			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z47375			Contractor:	3651

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag:	A054041			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041961.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2007/03/14				
Year Completed:	2007				
Depth (m):	7.6				
Latitude:	45.4019292854476				
Longitude:	-75.7308628403436				
Path:	704\7041961.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11764464			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442801.00
Code OB Desc:				North83:	5027861.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	14-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	933095663				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	2.0999999046325684				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		933095664			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		2.0999999046325684			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316028			
Layer:		1			
Plug From:		0.0			
Plug To:		3.4000000953674316			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041961			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772184			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897258			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		3.4000000953674316			
Depth To:		7.599999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897257			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		3.4000000953674316			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Hole Diameter

Hole ID: 11850716
Diameter: 15.199999809265137
Depth From: 3.4000000953674316
Depth To: 7.599999904632568
Hole Depth UOM: m
Hole Diameter UOM: cm

Hole Diameter

Hole ID: 11850715
Diameter: 25.399999618530273
Depth From: 0.0
Depth To: 3.4000000953674316
Hole Depth UOM: m
Hole Diameter UOM: cm

Links

Bore Hole ID:	11764464	Tag No:	A054041
Depth M:	7.6	Contractor:	3651
Year Completed:	2007	Path:	704\7041961.pdf
Well Completed Dt:	2007/03/14	Latitude:	45.4019292854476
Audit No:	Z47375	Longitude:	-75.7308628403436

24	1 of 1	N/33.9	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS

Well ID:	7041974	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	
Use 2nd:		Data Src:	
Final Well Status:	Dewatering	Date Received:	29-Mar-2007 00:00:00
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z64908	Contractor:	3651
Tag:	A054054	Form Version:	3
Constructn Method:		Owner:	
Elevation (m):		County:	OTTAWA-CARLETON
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041974.pdf

Additional Detail(s) (Map)

Well Completed Date: 2007/03/16
Year Completed: 2007
Depth (m): 6.1
Latitude: 45.4024173589993
Longitude: -75.7305496920642
Path: 704\7041974.pdf

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	11764477			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442826.00
Code OB Desc:				North83:	5027915.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	16-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	933095689				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	1.100000023841858				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	933095690				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	1.100000023841858				
Formation End Depth:	6.099999904632568				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	933316041				
Layer:	1				
Plug From:	0.0				
Plug To:	2.200000047683716				
Plug Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:	967041974				
Method Construction Code:	4				
Method Construction:	Rotary (Air)				
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	11772197				
Casing No:	1				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	930897283				
Layer:	1				
Material:	1				
Open Hole or Material:	STEEL				
Depth From:	0.0				
Depth To:	2.200000047683716				
Casing Diameter:	15.8999999618530273				
Casing Diameter UOM:	cm				
Casing Depth UOM:	m				
<u>Construction Record - Casing</u>					
Casing ID:	930897284				
Layer:	2				
Material:	4				
Open Hole or Material:	OPEN HOLE				
Depth From:	2.200000047683716				
Depth To:	6.099999904632568				
Casing Diameter:					
Casing Diameter UOM:	cm				
Casing Depth UOM:	m				
<u>Hole Diameter</u>					
Hole ID:	11850742				
Diameter:	25.3999999618530273				
Depth From:	0.0				
Depth To:	2.200000047683716				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Hole Diameter</u>					
Hole ID:	11850741				
Diameter:	15.199999809265137				
Depth From:	2.200000047683716				
Depth To:	6.099999904632568				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Links</u>					
Bore Hole ID:	11764477			Tag No:	A054054
Depth M:	6.1			Contractor:	3651

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:	2007			Path:	704\7041974.pdf
Well Completed Dt:	2007/03/16			Latitude:	45.4024173589993
Audit No:	Z64908			Longitude:	-75.7305496920642

25	1 of 1	W/33.9	63.2 / 0.31	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041963			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z47377			Contractor:	3651
Tag:	A054043			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041963.pdf

Additional Detail(s) (Map)

Well Completed Date: 2007/03/14
Year Completed: 2007
Depth (m): 6.1
Latitude: 45.4021087242659
Longitude: -75.7309545972135
Path: 704\7041963.pdf

Bore Hole Information

Bore Hole ID:	11764466	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442794.00
Code OB Desc:		North83:	5027881.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	14-Mar-2007 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	www
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID: 933095667

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095668			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316030			
Layer:		1			
Plug From:		0.0			
Plug To:		2.5999999046325684			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041963			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772186			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897262			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.5999999046325684			
Depth To:		6.099999904632568			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter: Casing Diameter UOM: cm Casing Depth UOM: m					
<u>Construction Record - Casing</u>					
Casing ID: 930897261 Layer: 1 Material: 1 Open Hole or Material: STEEL Depth From: 0.0 Depth To: 2.5999999046325684 Casing Diameter: 15.899999618530273 Casing Diameter UOM: cm Casing Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 11850720 Diameter: 15.199999809265137 Depth From: 2.5999999046325684 Depth To: 6.099999904632568 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 11850719 Diameter: 25.399999618530273 Depth From: 0.0 Depth To: 2.5999999046325684 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 11764466 Depth M: 6.1 Year Completed: 2007 Well Completed Dt: 2007/03/14 Audit No: Z47377					
Tag No: A054043 Contractor: 3651 Path: 704\7041963.pdf Latitude: 45.4021087242659 Longitude: -75.7309545972135					
26	1 of 1	SSE/34.2	62.9 / 0.00	Armstrong St Ottawa ON	WWIS
Well ID: 7343200 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z231238 Tag: A191024 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06-Sep-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB				
Clear/Cloudy:		NEPEAN TOWNSHIP		UTM Reliability:					
Municipality:									
Site Info:									
PDF URL (Map):									
<u>Additional Detail(s) (Map)</u>									
Well Completed Date:		2019/03/27							
Year Completed:		2019							
Depth (m):		15.24							
Latitude:		45.4018336300756							
Longitude:		-75.7303377281151							
Path:									
<u>Bore Hole Information</u>									
Bore Hole ID:	1007660897			Elevation:					
DP2BR:				Elevrc:					
Spatial Status:				Zone:	18				
Code OB:				East83:	442842.00				
Code OB Desc:				North83:	5027850.00				
Open Hole:				Org CS:	UTM83				
Cluster Kind:				UTMRC:	4				
Date Completed:	27-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m				
Remarks:				Location Method:	wwr				
Loc Method Desc:	on Water Well Record								
Elevrc Desc:									
Location Source Date:									
Improvement Location Source:									
Improvement Location Method:									
Source Revision Comment:									
Supplier Comment:									
<u>Overburden and Bedrock</u>									
<u>Materials Interval</u>									
Formation ID:	1007846688								
Layer:	1								
Color:	2								
General Color:	GREY								
Mat1:	27								
Most Common Material:	OTHER								
Mat2:	11								
Mat2 Desc:	GRAVEL								
Mat3:	73								
Mat3 Desc:	HARD								
Formation Top Depth:	0.0								
Formation End Depth:	1.0								
Formation End Depth UOM:	ft								
<u>Overburden and Bedrock</u>									
<u>Materials Interval</u>									
Formation ID:	1007846689								
Layer:	2								
Color:	6								
General Color:	BROWN								
Mat1:	09								
Most Common Material:	MEDIUM SAND								
Mat2:	11								
Mat2 Desc:	GRAVEL								

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846690			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.0			
Formation End Depth:		50.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848179			
Layer:		5			
Plug From:		38.0			
Plug To:		50.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848175			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848177			
Layer:		3			
Plug From:		8.0			
Plug To:		36.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848176			
Layer:		2			
Plug From:		1.0			
Plug To:		8.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1007848178			
Layer:		4			
Plug From:		36.0			
Plug To:		38.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849685			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845089			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850381			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		40.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850796			
Layer:		1			
Slot:		10			
Screen Top Depth:		40.0			
Screen End Depth:		50.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851789			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Duration HR: Pumping Duration MIN: Flowing:					
Hole Diameter					
Hole ID:		1007849093			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		5.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
Hole Diameter					
Hole ID:		1007849094			
Diameter:		3.5			
Depth From:		5.0			
Depth To:		50.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
Links					
Bore Hole ID:	1007660897			Tag No:	A191024
Depth M:	15.24			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/27			Latitude:	45.4018336300756
Audit No:	Z231238			Longitude:	-75.7303377281151
27	1 of 1	NE/34.3	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041980			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64914			Contractor:	3651
Tag:	A054060			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041980.pdf				
Additional Detail(s) (Map)					
Well Completed Date:	2007/03/14				
Year Completed:	2007				
Depth (m):	7.6				
Latitude:	45.4023651531702				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Longitude:		-75.7302679108388			
Path:		704\7041980.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	11764483			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442848.00
Code OB Desc:				North83:	5027909.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	14-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095701				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	1.7000000476837158				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095702				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	1.7000000476837158				
Formation End Depth:	7.599999904632568				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	933316047				
Layer:	1				
Plug From:	0.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		2.5999999046325684			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		967041980			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		11772203			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930897295			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.5999999046325684			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Casing</u>					
Casing ID:		930897296			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.5999999046325684			
Depth To:		7.599999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		11850753			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		2.5999999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		11850754			
Diameter:		15.199999809265137			
Depth From:		2.5999999046325684			
Depth To:		7.599999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	11764483			Tag No:	A054060
Depth M:	7.6			Contractor:	3651
Year Completed:	2007			Path:	704\7041980.pdf
Well Completed Dt:	2007/03/14			Latitude:	45.4023651531702
Audit No:	Z64914			Longitude:	-75.7302679108388

28	1 of 1	E/36.0	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041981			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64917			Contractor:	3651
Tag:	A054063			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041981.pdf				

Additional Detail(s) (Map)

Well Completed Date: 2007/03/15
 Year Completed: 2007
 Depth (m): 7.6
 Latitude: 45.4020423582445
 Longitude: -75.7300720883637
 Path: 704\7041981.pdf

Bore Hole Information

Bore Hole ID:	11764484	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442863.00
Code OB Desc:		North83:	5027873.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095704			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.6000000238418579			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095703			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.6000000238418579			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316048			
Layer:		1			
Plug From:		0.0			
Plug To:		2.4000000953674316			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041981			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772204			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897298			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.4000000953674316			
Depth To:		7.599999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Casing</u>					
Casing ID:		930897297			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.4000000953674316			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		11850756			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		2.4000000953674316			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		11850755			
Diameter:		15.199999809265137			
Depth From:		2.4000000953674316			
Depth To:		7.599999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	11764484			Tag No:	A054063
Depth M:	7.6			Contractor:	3651
Year Completed:	2007			Path:	704\7041981.pdf
Well Completed Dt:	2007/03/15			Latitude:	45.4020423582445
Audit No:	Z64917			Longitude:	-75.7300720883637
29	1 of 1	W/37.6	63.2 / 0.31	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041964			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z47378			Contractor:	3651
Tag:	A054044			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):				https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041964.pdf	
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/03/14			
Year Completed:		2007			
Depth (m):		6.1			
Latitude:		45.4021714828591			
Longitude:		-75.7309937393617			
Path:		704\7041964.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11764467		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				442791.00	
Cluster Kind:				North83:	
Date Completed:		14-Mar-2007 00:00:00		5027888.00	
Remarks:				Org CS:	
Loc Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				3	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 10 - 30 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095670			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095669			
Layer:		1			
Color:		6			
General Color:		BROWN			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316031			
Layer:		1			
Plug From:		0.0			
Plug To:		2.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041964			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772187			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897263			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.5			
Casing Diameter:		15.8999999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897264			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.5			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850721			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Diameter:		15.199999809265137			
Depth From:		2.5			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
Hole Diameter					
Hole ID:		11850722			
Diameter:		25.3999999618530273			
Depth From:		0.0			
Depth To:		2.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
Links					
Bore Hole ID:		11764467		Tag No: A054044	
Depth M:		6.1		Contractor: 3651	
Year Completed:		2007		Path: 704\7041964.pdf	
Well Completed Dt:		2007/03/14		Latitude: 45.4021714828591	
Audit No:		Z47378		Longitude: -75.7309937393617	
30	1 of 1	SW/38.3	63.9 / 1.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:		7041960		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Dewatering		Date Received: 29-Mar-2007 00:00:00	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z47374		Contractor: 3651	
Tag:		A054040		Form Version: 3	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041960.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		2007/03/14			
Year Completed:		2007			
Depth (m):		7.6			
Latitude:		45.4018573627425			
Longitude:		-75.7308491354314			
Path:		704\7041960.pdf			
Bore Hole Information					
Bore Hole ID:		11764463		Elevation:	
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	442802.00
Code OB Desc:				North83:	5027853.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		14-Mar-2007 00:00:00		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095661			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095662			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		2.0			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316027			
Layer:		1			
Plug From:		0.0			
Plug To:		3.0			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041960			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772183			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897256			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		3.0			
Depth To:		7.599999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897255			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		3.0			
Casing Diameter:		15.8999999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850714			
Diameter:		25.3999999618530273			
Depth From:		0.0			
Depth To:		3.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850713			
Diameter:		15.199999809265137			
Depth From:		3.0			
Depth To:		7.599999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:		11764463		Tag No:	A054040
Depth M:		7.6		Contractor:	3651
Year Completed:		2007		Path:	704\7041960.pdf
Well Completed Dt:		2007/03/14		Latitude:	45.4018573627425
Audit No:		Z47374		Longitude:	-75.7308491354314

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
31	1 of 1	W/38.7	63.2 / 0.31	3 HAMILTON AVE NORTH ON	WWIS
Well ID:		7041976	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:			Data Entry Status:		
Use 2nd:			Data Src:		
Final Well Status:		Dewatering	Date Received: 29-Mar-2007 00:00:00		
Water Type:			Selected Flag: TRUE		
Casing Material:			Abandonment Rec:		
Audit No:		Z64910	Contractor: 3651		
Tag:		A054056	Form Version: 3		
Constructn Method:			Owner:		
Elevation (m):			County: OTTAWA-CARLETON		
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041976.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/03/15			
Year Completed:		2007			
Depth (m):		6.1			
Latitude:		45.4021804016447			
Longitude:		-75.7310066319937			
Path:		704\7041976.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11764479	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone: 18		
Code OB:			East83: 442790.00		
Code OB Desc:			North83: 5027889.00		
Open Hole:			Org CS: UTM83		
Cluster Kind:			UTMRC: 3		
Date Completed:		15-Mar-2007 00:00:00	UTMRC Desc: margin of error : 10 - 30 m		
Remarks:			Location Method: wwr		
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095693			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:					
Mat2:		GRAVEL	28		
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095694			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316043			
Layer:		1			
Plug From:		0.0			
Plug To:		2.299999952316284			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041976			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772199			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897287			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.299999952316284			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		930897288			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850745			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		2.299999952316284			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850746			
Diameter:		15.199999809265137			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11764479			Tag No:	A054056
Depth M:	6.1			Contractor:	3651
Year Completed:	2007			Path:	704\7041976.pdf
Well Completed Dt:	2007/03/15			Latitude:	45.4021804016447
Audit No:	Z64910			Longitude:	-75.7310066319937
32	1 of 1	E/39.3	62.9 / 0.00	Parkdale Ave Ottawa ON	WWIS
Well ID:	7343166			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302800			Contractor:	7241
Tag:	A261268			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/03/27				
Year Completed:	2019				
Depth (m):	10.2108				
Latitude:	45.4022046132969				
Longitude:	-75.7300358453944				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007660694			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442866.00
Code OB Desc:				North83:	5027891.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	27-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846588				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	27				
Most Common Material:	OTHER				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846589				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	09				
Most Common Material:	MEDIUM SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	12				
Mat3 Desc:	STONES				
Formation Top Depth:	1.0				
Formation End Depth:	3.5				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846590			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		3.5			
Formation End Depth:		33.5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848014			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848016			
Layer:		3			
Plug From:		4.0			
Plug To:		19.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848015			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848018			
Layer:		5			
Plug From:		21.5			
Plug To:		33.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848017			
Layer:		4			
Plug From:		19.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		21.5			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849513			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845055			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850341			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		23.5			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850639			
Layer:		1			
Slot:		10			
Screen Top Depth:		23.5			
Screen End Depth:		33.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851755			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1007849031			
Diameter:		3.5			
Depth From:		3.5			
Depth To:		33.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849030			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		3.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007660694			Tag No:	A261268
Depth M:	10.2108			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/27			Latitude:	45.4022046132969
Audit No:	Z302800			Longitude:	-75.7300358453944
<u>33</u>	1 of 1	ESE/39.6	62.9 / 0.00	ON	WWIS
Well ID:	7386176			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	28-Apr-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z359333			Contractor:	7241
Tag:	A318292			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1008650645			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442862.00
Code OB Desc:				North83:	5027861.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	24-Mar-2021 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Links					
Bore Hole ID:	1008650645			Tag No:	A318292
Depth M:				Contractor:	7241
Year Completed:	2021			Path:	738\7386176.pdf
Well Completed Dt:	2021/03/24			Latitude:	45.4019342698703
Audit No:	Z359333			Longitude:	-75.7300834737276
34	1 of 1	ENE/40.8	62.9 / 0.00	Parkdale Ottawa ON	WWIS
Well ID:	7343163			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z231228			Contractor:	7241
Tag:	A257373			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:	2019/03/27				
Year Completed:	2019				
Depth (m):	15.8496				
Latitude:	45.4022226960768				
Longitude:	-75.7300233006728				
Path:					
Bore Hole Information					
Bore Hole ID:	1007660652			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442867.00
Code OB Desc:				North83:	5027893.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	27-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007846579			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007846580			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		4.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007846581			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		4.5			
Formation End Depth:		52.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007848001			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		4			
Plug From:		38.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007847998			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848002			
Layer:		5			
Plug From:		40.0			
Plug To:		52.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848000			
Layer:		3			
Plug From:		4.0			
Plug To:		38.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007847999			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849496			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007845052			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007850337			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:					
Open Hole or Material:		5			
Depth From:		PLASTIC			
Depth To:		0.0			
Casing Diameter:		42.0			
Casing Diameter UOM:		2.066999912261963			
Casing Depth UOM:		Inch			
Construction Record - Screen					
Screen ID:		1007850623			
Layer:		1			
Slot:		10			
Screen Top Depth:		42.0			
Screen End Depth:		52.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
Results of Well Yield Testing					
Pumping Test Method Desc:					
Pump Test ID:		1007851752			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
Hole Diameter					
Hole ID:		1007849024			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		4.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
Hole Diameter					
Hole ID:		1007849025			
Diameter:		3.5			
Depth From:		4.5			
Depth To:		52.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
Links					
Bore Hole ID:		1007660652		Tag No:	A257373
Depth M:		15.8496		Contractor:	7241

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/27			Latitude:	45.4022226960768
Audit No:	Z231228			Longitude:	-75.7300233006728

35	1 of 1	WNW/41.6	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041969			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64903			Contractor:	3651
Tag:	A054049			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041969.pdf

Additional Detail(s) (Map)

Well Completed Date: 2007/03/16
Year Completed: 2007
Depth (m): 6.1
Latitude: 45.4023609851476
Longitude: -75.7309195173761
Path: 704\7041969.pdf

Bore Hole Information

Bore Hole ID:	11764472	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442797.00
Code OB Desc:		North83:	5027909.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	16-Mar-2007 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	www
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID: 933095679

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095680			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316036			
Layer:		1			
Plug From:		0.0			
Plug To:		2.299999952316284			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041969			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772192			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897274			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter: Casing Diameter UOM: cm Casing Depth UOM: m					
<u>Construction Record - Casing</u>					
Casing ID: 930897273 Layer: 1 Material: 1 Open Hole or Material: STEEL Depth From: 0.0 Depth To: 2.299999952316284 Casing Diameter: 15.8999999618530273 Casing Diameter UOM: cm Casing Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 11850731 Diameter: 15.199999809265137 Depth From: 2.299999952316284 Depth To: 6.099999904632568 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 11850732 Diameter: 25.3999999618530273 Depth From: 0.0 Depth To: 2.299999952316284 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 11764472 Depth M: 6.1 Year Completed: 2007 Well Completed Dt: 2007/03/16 Audit No: Z64903					
Tag No: A054049 Contractor: 3651 Path: 704\7041969.pdf Latitude: 45.4023609851476 Longitude: -75.7309195173761					
36	1 of 1	WNW/41.7	63.2 / 0.31	3 HAMILTON AVE NORTH ON	WWIS
Well ID: 7041965 Construction Date: Use 1st: Use 2nd: Final Well Status: Dewatering Water Type: Casing Material: Audit No: Z47379 Tag: A054045 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 29-Mar-2007 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 3651 Form Version: 3 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:		OTTAWA CITY		UTM Reliability:	
Municipality:					
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041965.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/03/15			
Year Completed:		2007			
Depth (m):		6.1			
Latitude:		45.4022162403246			
Longitude:		-75.7310326494334			
Path:		704\7041965.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11764468		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		15-Mar-2007 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record		wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095672			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095671			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316032			
Layer:		1			
Plug From:		0.0			
Plug To:		2.799999952316284			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041965			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772188			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897265			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.799999952316284			
Casing Diameter:		15.8999999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897266			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.799999952316284			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850723			
Diameter:		15.199999809265137			
Depth From:		2.799999952316284			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:	11850724				
Diameter:	25.399999618530273				
Depth From:	0.0				
Depth To:	2.799999952316284				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Links</u>					
Bore Hole ID:	11764468			Tag No:	A054045
Depth M:	6.1			Contractor:	3651
Year Completed:	2007			Path:	704\7041965.pdf
Well Completed Dt:	2007/03/15			Latitude:	45.4022162403246
Audit No:	Z47379			Longitude:	-75.7310326494334
37	1 of 1	NW/42.3	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041970			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64904			Contractor:	3651
Tag:	A054050			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041970.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2007/03/15				
Year Completed:	2007				
Depth (m):	6.1				
Latitude:	45.4023790680224				
Longitude:	-75.7309069729037				
Path:	704\7041970.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11764473			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442798.00
Code OB Desc:				North83:	5027911.00
Open Hole:				Org CS:	UTM83

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095681				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	1.5				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095682				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	1.5				
Formation End Depth:	6.099999904632568				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	933316037				
Layer:	1				
Plug From:	0.0				
Plug To:	2.299999952316284				
Plug Depth UOM:	m				
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:	967041970				
Method Construction Code:	4				
Method Construction:	Rotary (Air)				
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		11772193			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897276			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897275			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.299999952316284			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850734			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		2.299999952316284			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850733			
Diameter:		15.199999809265137			
Depth From:		2.299999952316284			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11764473			Tag No:	A054050
Depth M:	6.1			Contractor:	3651
Year Completed:	2007			Path:	704\7041970.pdf
Well Completed Dt:	2007/03/15			Latitude:	45.4023790680224
Audit No:	Z64904			Longitude:	-75.7309069729037
38	1 of 1	ENE/43.8	62.9 / 0.00	parkdale Ave Ottawa ON	WWIS
Well ID:	7343164			Flowing (Y/N):	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z231240			Contractor:	7241
Tag:	A257380			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/03/27				
Year Completed:	2019				
Depth (m):	15.8496				
Latitude:	45.4023394583442				
Longitude:	-75.7300631374436				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007660688			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442864.00
Code OB Desc:				North83:	5027906.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	27-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846583				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	09				
Most Common Material:	MEDIUM SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	12				
Mat3 Desc:	STONES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		1.0			
Formation End Depth:		4.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846584			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		4.5			
Formation End Depth:		52.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846582			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		79			
Mat3 Desc:		PACKED			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848003			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848007			
Layer:		5			
Plug From:		40.0			
Plug To:		52.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848004			
Layer:		2			
Plug From:		1.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		5.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848005			
Layer:		3			
Plug From:		5.0			
Plug To:		38.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848006			
Layer:		4			
Plug From:		38.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849501			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007845053			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007850338			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		42.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007850628			
Layer:		1			
Slot:		10			
Screen Top Depth:		42.0			
Screen End Depth:		52.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851753			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849026			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		4.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849027			
Diameter:		3.5			
Depth From:		4.5			
Depth To:		52.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007660688			Tag No:	A257380
Depth M:	15.8496			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/27			Latitude:	45.4023394583442
Audit No:	Z231240			Longitude:	-75.7300631374436
39	1 of 1	ESE/44.2	62.9 / 0.00	366 Parkdale Ave Ottawa ON	WWIS
Well ID:	7343169			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302763			Contractor:	7241
Tag:	A261088			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			NEPEAN TOWNSHIP	Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2019/02/22			
Year Completed:		2019			
Depth (m):		16.76			
Latitude:		45.4018985126325			
Longitude:		-75.7300446805214			
Path:					
Bore Hole Information					
Bore Hole ID:		1007660703		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442865.00
Code OB Desc:				North83:	5027857.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		22-Feb-2019 00:00:00		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock Materials Interval					
Formation ID:		1007846597			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
Overburden and Bedrock Materials Interval					
Formation ID:		1007846599			
Layer:		3			
Color:		2			
General Color:		GREY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		16.760000228881836			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846598			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848031			
Layer:		3			
Plug From:		13.40999984741211			
Plug To:		16.760000228881836			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848032			
Layer:		4			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848030			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		13.40999984741211			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848033			
Layer:		5			
Plug From:					
Plug To:					
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848029			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849517			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845058			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850344			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		13.710000038146973			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007850643			
Layer:		1			
Slot:		10			
Screen Top Depth:		13.710000038146973			
Screen End Depth:		16.760000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851758			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:	0				
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1007849036			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1007849037			
Diameter:		8.890000343322754			
Depth From:		2.130000114440918			
Depth To:		16.760000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	1007660703			Tag No:	A261088
Depth M:	16.76			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/02/22			Latitude:	45.4018985126325
Audit No:	Z302763			Longitude:	-75.7300446805214

40	1 of 1	WNW/44.5	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041968			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64902			Contractor:	3651
Tag:	A054048			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704/7041968.pdf				

Additional Detail(s) (Map)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		2007/03/15			
Year Completed:		2007			
Depth (m):		6.1			
Latitude:		45.4023697404105			
Longitude:		-75.7309579632385			
Path:		704\7041968.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	11764471			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442794.00
Code OB Desc:				North83:	5027910.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095677				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	0.8999999761581421				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095678				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.8999999761581421				
Formation End Depth:	6.099999904632568				
Formation End Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		933316035			
Layer:		1			
Plug From:		0.0			
Plug To:		1.7999999523162842			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		967041968			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		11772191			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930897272			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		1.7999999523162842			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Casing</u>					
Casing ID:		930897271			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		1.7999999523162842			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		11850730			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		1.7999999523162842			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		11850729			
Diameter:		15.199999809265137			
Depth From:		1.7999999523162842			
Depth To:		6.099999904632568			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
Links					
Bore Hole ID:	11764471			Tag No:	A054048
Depth M:	6.1			Contractor:	3651
Year Completed:	2007			Path:	704\7041968.pdf
Well Completed Dt:	2007/03/15			Latitude:	45.4023697404105
Audit No:	Z64902			Longitude:	-75.7309579632385

41	1 of 1	WNW/44.8	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041966			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z47380			Contractor:	3651
Tag:	A054046			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041966.pdf				

Additional Detail(s) (Map)

Well Completed Date: 2007/03/15
 Year Completed: 2007
 Depth (m): 6.1
 Latitude: 45.4023244105501
 Longitude: -75.7310084892421
 Path: 704\7041966.pdf

Bore Hole Information

Bore Hole ID:	11764469	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442790.00
Code OB Desc:		North83:	5027905.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095674			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.8999999761581421			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095673			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.8999999761581421			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316033			
Layer:		1			
Plug From:		0.0			
Plug To:		1.899999976158142			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041966			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772189			
Casing No:		1			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Construction Record - Casing

Casing ID: 930897268
Layer: 2
Material: 4
Open Hole or Material: OPEN HOLE
Depth From: 1.899999976158142
Depth To: 6.099999904632568
Casing Diameter:
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Casing

Casing ID: 930897267
Layer: 1
Material: 1
Open Hole or Material: STEEL
Depth From: 0.0
Depth To: 1.899999976158142
Casing Diameter: 15.8999999618530273
Casing Diameter UOM: cm
Casing Depth UOM: m

Hole Diameter

Hole ID: 11850725
Diameter: 25.3999999618530273
Depth From: 0.0
Depth To: 1.899999976158142
Hole Depth UOM: m
Hole Diameter UOM: cm

Hole Diameter

Hole ID: 11850726
Diameter: 15.199999809265137
Depth From: 1.899999976158142
Depth To: 6.099999904632568
Hole Depth UOM: m
Hole Diameter UOM: cm

Links

Bore Hole ID:	11764469	Tag No:	A054046
Depth M:	6.1	Contractor:	3651
Year Completed:	2007	Path:	704\7041966.pdf
Well Completed Dt:	2007/03/15	Latitude:	45.4023244105501
Audit No:	Z47380	Longitude:	-75.7310084892421

42	1 of 1	ESE/44.8	62.9 / 0.00	PARKDALE AVE Ottawa ON	WWIS
Well ID:	7343193	Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:	Monitoring and Test Hole	Data Entry Status:			
Use 2nd:		Data Src:			
Final Well Status:	Monitoring and Test Hole	Date Received:	06-Sep-2019 00:00:00		
Water Type:		Selected Flag:	TRUE		
Casing Material:		Abandonment Rec:			
Audit No:	Z231232	Contractor:	7241		
Tag:	A257376	Form Version:	7		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:		2019/03/22 2019 10.668 45.4019347598542 -75.7300068147052			
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:		1007660863 22-Mar-2019 00:00:00 on Water Well Record		Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	 18 442868.00 5027861.00 UTM83 4 margin of error : 30 m - 100 m wwr
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Mat2 Desc: Mat3: Mat3 Desc: Formation Top Depth: Formation End Depth: Formation End Depth UOM:		1007846669 3 2 GREY 15 LIMESTONE 17 SHALE 73 HARD 4.0 35.0 ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007846667			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846668			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		08			
Mat2 Desc:		FINE SAND			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		1.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848144			
Layer:		5			
Plug From:					
Plug To:					
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848142			
Layer:		3			
Plug From:		20.0			
Plug To:		23.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848140			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848143			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		4			
Plug From:		23.0			
Plug To:		35.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848141			
Layer:		2			
Plug From:		1.0			
Plug To:		20.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849810			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007845082			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007850374			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		25.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007850765			
Layer:		1			
Slot:		10			
Screen Top Depth:		25.0			
Screen End Depth:		35.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0599999942779541			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851782			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007849080 Diameter: 2.375 Depth From: 4.5 Depth To: 35.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Hole Diameter</u>					
Hole ID: 1007849079 Diameter: 2.875 Depth From: 0.0 Depth To: 4.5 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Links</u>					
Bore Hole ID: 1007660863 Depth M: 10.668 Year Completed: 2019 Well Completed Dt: 2019/03/22 Audit No: Z231232 Tag No: A257376 Contractor: 7241 Path: Latitude: 45.4019347598542 Longitude: -75.7300068147052					
43	1 of 1	E/45.0	62.9 / 0.00	231 ARMSTRONG Ottawa ON	WWIS
Well ID: 7276809 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z238044 Tag: A191126 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 12-Dec-2016 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2016/10/12				
Year Completed:	2016				
Depth (m):	22.32				
Latitude:	45.4020340926319				
Longitude:	-75.7299569836994				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006305158			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442872.00
Code OB Desc:				North83:	5027872.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	12-Oct-2016 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	gis
Loc Method Desc:	from gis				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006480718				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:					
Mat2 Desc:					
Mat3:	77				
Mat3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	0.3100000023841858				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006480720				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	1.2200000286102295				
Formation End Depth:	22.31999969482422				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006480719			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:					
Mat2 Desc:					
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006480732			
Layer:		3			
Plug From:		17.06999969482422			
Plug To:		18.549999237060547			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006480730			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006480733			
Layer:		4			
Plug From:		18.549999237060547			
Plug To:		22.31999969482422			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006480731			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		17.06999969482422			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006480729			
Method Construction Code:		7			
Method Construction:		Diamond			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006480717			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006480725			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		19.219999313354492			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006480726			
Layer:		1			
Slot:		10			
Screen Top Depth:		19.219999313354492			
Screen End Depth:		22.31999969482422			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1006480724			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006480721			
Diameter:		11.399999618530273			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1006480723			
Diameter:		7.099999904632568			
Depth From:		12.0			
Depth To:		22.31999969482422			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1006480722			
Diameter:		9.0			
Depth From:		1.8300000429153442			
Depth To:		12.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1006305158			Tag No:	A191126
Depth M:	22.32			Contractor:	7241
Year Completed:	2016			Path:	727\7276809.pdf
Well Completed Dt:	2016/10/12			Latitude:	45.4020340926319
Audit No:	Z238044			Longitude:	-75.7299569836994
44	1 of 1	NW/45.3	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041971			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64905			Contractor:	3651
Tag:	A054051			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041971.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2007/03/15				
Year Completed:	2007				
Depth (m):	6.1				
Latitude:	45.4024241525656				
Longitude:	-75.7308947766056				
Path:	704\7041971.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11764474			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442799.00
Code OB Desc:				North83:	5027916.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:			Location Method:		
Loc Method Desc:		on Water Well Record			wwr
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095684			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095683			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316038			
Layer:		1			
Plug From:		0.0			
Plug To:		2.299999952316284			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		967041971			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID: 11772194					
Casing No: 1					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 930897278					
Layer: 2					
Material: 4					
Open Hole or Material: OPEN HOLE					
Depth From: 2.299999952316284					
Depth To: 6.099999904632568					
Casing Diameter:					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Casing</u>					
Casing ID: 930897277					
Layer: 1					
Material: 1					
Open Hole or Material: STEEL					
Depth From: 0.0					
Depth To: 2.299999952316284					
Casing Diameter: 15.899999618530273					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 11850735					
Diameter: 15.199999809265137					
Depth From: 2.299999952316284					
Depth To: 6.099999904632568					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 11850736					
Diameter: 25.399999618530273					
Depth From: 0.0					
Depth To: 2.299999952316284					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 11764474		Tag No: A054051			
Depth M: 6.1		Contractor: 3651			
Year Completed: 2007		Path: 704\7041971.pdf			
Well Completed Dt: 2007/03/15		Latitude: 45.4024241525656			
Audit No: Z64905		Longitude: -75.7308947766056			
45	1 of 1	WNW/45.8	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID: 7041967		Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:		Data Entry Status:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64901			Contractor:	3651
Tag:	A054047			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041967.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2007/03/15				
Year Completed:	2007				
Depth (m):	6.1				
Latitude:	45.402396823846				
Longitude:	-75.7309455348453				
Path:	704\7041967.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11764470			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442795.00
Code OB Desc:				North83:	5027913.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095675				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	0.6000000238418579				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095676			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.6000000238418579			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316034			
Layer:		1			
Plug From:		0.0			
Plug To:		1.7000000476837158			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041967			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772190			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897270			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		1.7000000476837158			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897269			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		1.7000000476837158			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850727			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		1.7000000476837158			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850728			
Diameter:		15.199999809265137			
Depth From:		1.7000000476837158			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11764470			Tag No:	A054047
Depth M:	6.1			Contractor:	3651
Year Completed:	2007			Path:	704\7041967.pdf
Well Completed Dt:	2007/03/15			Latitude:	45.402396823846
Audit No:	Z64901			Longitude:	-75.7309455348453
46	1 of 1	S/46.6	63.2 / 0.31	ON	WWIS
Well ID:	7200459			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	17-Apr-2013 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C20576			Contractor:	1844
Tag:	A122972			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/720\7200459.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2012/04/18				
Year Completed:	2012				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth (m): Latitude: 45.4016969874856 Longitude: -75.7305915175555 Path: 720\7200459.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1004275578 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 18-Apr-2012 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 442822.00 North83: 5027835.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Links</u>					
Bore Hole ID: 1004275578 Depth M: Year Completed: 2012 Well Completed Dt: 2012/04/18 Audit No: C20576					
Tag No: A122972 Contractor: 1844 Path: 720\7200459.pdf Latitude: 45.4016969874856 Longitude: -75.7305915175555					
47	1 of 1	E/46.8	62.9 / 0.00	PARKDALE AVE Ottawa ON	WWIS
Well ID: 7343192 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z231231 Tag: A261138 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06-Sep-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2019/03/22 Year Completed: 2019					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth (m):		16.1544			
Latitude:		45.4020432564966			
Longitude:		-75.7299315465527			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007660860			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442874.00
Code OB Desc:				North83:	5027873.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	22-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846664				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	27				
Most Common Material:	OTHER				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	28				
Mat3 Desc:	SAND				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846666				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:	17				
Mat2 Desc:	SHALE				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	4.0				
Formation End Depth:	53.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846665				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		08			
Mat2 Desc:		FINE SAND			
Mat3:		06			
Mat3 Desc:		SILT			
Formation Top Depth:		1.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848139			
Layer:		5			
Plug From:		41.0			
Plug To:		53.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848135			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848138			
Layer:		4			
Plug From:		39.0			
Plug To:		41.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848137			
Layer:		3			
Plug From:		8.0			
Plug To:		39.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848136			
Layer:		2			
Plug From:		1.0			
Plug To:		8.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID:		1007849803			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007845081			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007850373			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		43.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007850759			
Layer:		1			
Slot:		10			
Screen Top Depth:		43.0			
Screen End Depth:		53.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851781			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1007849077			
Diameter:		4.0			
Depth From:		0.0			
Depth To:		4.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849078			
Diameter:		3.5			
Depth From:		4.0			
Depth To:		53.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007660860			Tag No:	A261138
Depth M:	16.1544			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/22			Latitude:	45.4020432564966
Audit No:	Z231231			Longitude:	-75.7299315465527

48	1 of 1	ESE/47.0	62.9 / 0.00	Parkdale Ottawa ON	WWIS
Well ID:		7343162		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z231239		Contractor:	7241
Tag:		A170618		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2019/03/27
Year Completed: 2019
Depth (m): 14.9352
Latitude: 45.4018444276133
Longitude: -75.7300567614636
Path:

Bore Hole Information

Bore Hole ID: 1007660649
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:

Elevation:
Elevrc:
Zone: 18
East83: 442864.00
North83: 5027851.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed: 27-Mar-2019 00:00:00				UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:				1007846576	
Layer:				1	
Color:				8	
General Color:				BLACK	
Mat1:				27	
Most Common Material:				OTHER	
Mat2:				27	
Mat2 Desc:				OTHER	
Mat3:				11	
Mat3 Desc:				GRAVEL	
Formation Top Depth:				0.0	
Formation End Depth:				1.0	
Formation End Depth UOM:				ft	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:				1007846578	
Layer:				3	
Color:				2	
General Color:				GREY	
Mat1:				15	
Most Common Material:				LIMESTONE	
Mat2:				17	
Mat2 Desc:				SHALE	
Mat3:				73	
Mat3 Desc:				HARD	
Formation Top Depth:				5.5	
Formation End Depth:				49.0	
Formation End Depth UOM:				ft	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:				1007846577	
Layer:				2	
Color:				6	
General Color:				BROWN	
Mat1:				09	
Most Common Material:				MEDIUM SAND	
Mat2:				11	
Mat2 Desc:				GRAVEL	
Mat3:				12	
Mat3 Desc:				STONES	
Formation Top Depth:				1.0	
Formation End Depth:				5.5	
Formation End Depth UOM:				ft	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007847993			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007847997			
Layer:		5			
Plug From:		37.0			
Plug To:		49.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007847994			
Layer:		2			
Plug From:		1.0			
Plug To:		7.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007847995			
Layer:		3			
Plug From:		7.0			
Plug To:		34.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007847996			
Layer:		4			
Plug From:		34.0			
Plug To:		37.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849492			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845051			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1007850336			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		39.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850620			
Layer:		1			
Slot:		10			
Screen Top Depth:		39.0			
Screen End Depth:		49.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851751			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849022			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		5.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849023			
Diameter:		3.5			
Depth From:		5.5			
Depth To:		49.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Links</u>					
Bore Hole ID:	1007660649			Tag No:	A170618
Depth M:	14.9352			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/27			Latitude:	45.4018444276133
Audit No:	Z231239			Longitude:	-75.7300567614636
49	1 of 1	NE/47.3	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041978			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64912			Contractor:	3651
Tag:	A054058			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041978.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2007/03/14				
Year Completed:	2007				
Depth (m):	7.6				
Latitude:	45.4024913243562				
Longitude:	-75.7302439810414				
Path:	704\7041978.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	11764481			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442850.00
Code OB Desc:				North83:	5027923.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	14-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095697			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.8999999761581421			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095698			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.8999999761581421			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316045			
Layer:		1			
Plug From:		0.0			
Plug To:		1.7999999523162842			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041978			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772201			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897291			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		1.7999999523162842			
Casing Diameter:		15.8999999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897292			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		1.7999999523162842			
Depth To:		7.599999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850749			
Diameter:		15.199999809265137			
Depth From:		1.7999999523162842			
Depth To:		7.599999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850750			
Diameter:		25.3999999618530273			
Depth From:		0.0			
Depth To:		1.7999999523162842			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:		11764481		Tag No:	A054058
Depth M:		7.6		Contractor:	3651
Year Completed:		2007		Path:	704\7041978.pdf
Well Completed Dt:		2007/03/14		Latitude:	45.4024913243562
Audit No:		Z64912		Longitude:	-75.7302439810414

50	1 of 2	ESE/47.5	62.9 / 0.00	Enbridge Gas Distribution Inc. infront of 228 Armstrong St Ottawa ON	SPL
Ref No:0187-AZVPBG Site No:NA Incident Dt:2018/06/19 Year: Incident Cause: Incident Event:Leak/Break Contaminant Code:35 Contaminant Name:NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1:1075 Environment Impact:					
Discharger Report: Material Group: Health/Env Conseq:2 - Minor Environment Client Type:Corporation Sector Type:Miscellaneous Communal Agency Involved: Nearest Watercourse: Site Address:infront of 228 Armstrong St Site District Office:Ottawa Site Postal Code: Site Region:Eastern Site Municipality:Ottawa					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Nature of Impact: Receiving Medium: Receiving Env: Air MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2018/06/19 Dt Document Closed:				Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Pipeline/Components Source Type:	
Incident Reason: Operator/Human Error Site Name: residential<UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: TSSAfsb: 1.25" ip pl line strike -made safe- Contaminant Qty: 0 other - see incident description					

50	2 of 2	ESE/47.5	62.9 / 0.00	PIPELINE HIT 1.25" 228 ARMSTRONG ST,,OTTAWA,ON,K1Y 4T1,CA ON	PINC
Incident Id: Incident No: 2330408 Incident Reported Dt: 6/20/2018 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: PIPELINE HIT 1.25" Incident Address: 228 ARMSTRONG ST,,OTTAWA,ON,K1Y 4T1,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:				Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:	

51	1 of 1	E/47.9	62.9 / 0.00	Parkdale Ave Ottawa ON	WWIS
Well ID: 7343165 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z302840 Tag: A178490 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth:				Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06-Sep-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2019/03/07			
Year Completed:		2019			
Depth (m):		12.192			
Latitude:		45.40219634765			
Longitude:		-75.7299207404051			
Path:					
Bore Hole Information					
Bore Hole ID:		1007660691		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		07-Mar-2019 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record		wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007846585			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		79			
Mat3 Desc:		PACKED			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007846586			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		11			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		GRAVEL			
Mat2:		12			
Mat2 Desc:		STONES			
Mat3:		08			
Mat3 Desc:		FINE SAND			
Formation Top Depth:		1.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846587			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		7.0			
Formation End Depth:		40.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848012			
Layer:		5			
Plug From:		27.0			
Plug To:		29.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848009			
Layer:		2			
Plug From:		1.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848011			
Layer:		4			
Plug From:		15.0			
Plug To:		27.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848008			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848010			
Layer:		3			
Plug From:		6.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848013			
Layer:		6			
Plug From:		29.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849507			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849508			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845054			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850340			
Layer:		2			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		30.0			
Casing Diameter:		0.8240000009536743			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		1007850339			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		16.0			
Casing Diameter:		0.8240000009536743			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850633			
Layer:		1			
Slot:		10			
Screen Top Depth:		16.0			
Screen End Depth:		26.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0499999523162842			
<u>Construction Record - Screen</u>					
Screen ID:		1007850634			
Layer:		2			
Slot:		10			
Screen Top Depth:		30.0			
Screen End Depth:		40.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0499999523162842			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851754			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849028			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		10.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849029			
Diameter:		2.375			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		10.0			
Depth To:		40.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007660691			Tag No:	A178490
Depth M:	12.192			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/07			Latitude:	45.40219634765
Audit No:	Z302840			Longitude:	-75.7299207404051

52	1 of 1	ESE/48.7	62.9 / 0.00	ON	WWIS
Well ID:	7385911			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	28-Apr-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z359299			Contractor:	7241
Tag:	A318302			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					

Bore Hole Information

Bore Hole ID:	1008653846	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442867.00
Code OB Desc:		North83:	5027852.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	13-Apr-2021 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Links

Bore Hole ID:	1008653846	Tag No:	A318302
Depth M:		Contractor:	7241
Year Completed:	2021	Path:	
Well Completed Dt:	2021/04/13	Latitude:	45.4018536731616

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:	Z359299			Longitude:	-75.7300185479325
53	1 of 1	ENE/48.8	62.9 / 0.00	Parkdale Ave Ottawa ON	WWIS
Well ID:	7343190			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302755			Contractor:	7241
Tag:	A261271			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/03/12				
Year Completed:	2019				
Depth (m):	12.3444				
Latitude:	45.4023399483178				
Longitude:	-75.7299864778729				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007660841			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442870.00
Code OB Desc:				North83:	5027906.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	12-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1007846660				
Layer:	3				
Color:	2				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		7.0			
Formation End Depth:		40.5			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846659			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		1.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846658			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		28			
Mat3 Desc:		SAND			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848124			
Layer:		2			
Plug From:		1.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848123			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848125			
Layer:		3			
Plug From:		5.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848127			
Layer:		5			
Plug From:		27.0			
Plug To:		29.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848126			
Layer:		4			
Plug From:		15.0			
Plug To:		27.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848128			
Layer:		6			
Plug From:		29.5			
Plug To:		40.5			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849657			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849656			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845079			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1007850370			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		16.0			
Casing Diameter:		0.8240000009536743			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		1007850369			
Layer:		2			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		30.5			
Casing Diameter:		0.8240000009536743			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850742			
Layer:		1			
Slot:		10			
Screen Top Depth:		16.0			
Screen End Depth:		26.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0499999523162842			
<u>Construction Record - Screen</u>					
Screen ID:		1007850743			
Layer:		2			
Slot:		10			
Screen Top Depth:		30.5			
Screen End Depth:		40.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0499999523162842			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851779			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849073			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		8.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849074			
Diameter:		2.375			
Depth From:		8.0			
Depth To:		40.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:		1007660841	Tag No:		A261271
Depth M:		12.3444	Contractor:		7241
Year Completed:		2019	Path:		
Well Completed Dt:		2019/03/12	Latitude:		45.4023399483178
Audit No:		Z302755	Longitude:		-75.7299864778729
54	1 of 1	NW/49.2	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:		7041972	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:			Data Entry Status:		
Use 2nd:			Data Src:		
Final Well Status:		Dewatering	Date Received:		29-Mar-2007 00:00:00
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z64906	Contractor:		3651
Tag:		A054052	Form Version:		3
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041972.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/03/15			
Year Completed:		2007			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth (m):		6.1			
Latitude:		45.4024874017343			
Longitude:		-75.7308572591547			
Path:		704\7041972.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	11764475			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442802.00
Code OB Desc:				North83:	5027923.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	15-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095686			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.2000000476837158			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933095685			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.2000000476837158			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933316039			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Plug From:		0.0			
Plug To:		2.0999999046325684			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		967041972			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		11772195			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930897280			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.0999999046325684			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Casing</u>					
Casing ID:		930897279			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.0999999046325684			
Casing Diameter:		15.899999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		11850737			
Diameter:		15.199999809265137			
Depth From:		2.0999999046325684			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		11850738			
Diameter:		25.399999618530273			
Depth From:		0.0			
Depth To:		2.0999999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Links					
Bore Hole ID:	11764475			Tag No:	A054052
Depth M:	6.1			Contractor:	3651
Year Completed:	2007			Path:	704\7041972.pdf
Well Completed Dt:	2007/03/15			Latitude:	45.4024874017343
Audit No:	Z64906			Longitude:	-75.7308572591547
55	1 of 1	SSE/50.3	62.9 / 0.00	PARKDALE Ave Ottawa ON	WWIS
Well ID:	7343198			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z231227			Contractor:	7241
Tag:	A261269			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:	2019/03/25				
Year Completed:	2019				
Depth (m):	11.2776				
Latitude:	45.4016991118464				
Longitude:	-75.7302593298722				
Path:					
Bore Hole Information					
Bore Hole ID:	1007660891			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442848.00
Code OB Desc:				North83:	5027835.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	25-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846683			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846684			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.0			
Formation End Depth:		37.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846682			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		27			
Mat2 Desc:		OTHER			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848169			
Layer:		5			
Plug From:		25.0			
Plug To:		37.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1007848168			
Layer:		4			
Plug From:		23.0			
Plug To:		25.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848166			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848165			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848167			
Layer:		3			
Plug From:		4.0			
Plug To:		23.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1007849674			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845087			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850379			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		27.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1007850785			
Layer:		1			
Slot:		10			
Screen Top Depth:		27.0			
Screen End Depth:		37.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851787			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849089			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		5.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849090			
Diameter:		3.5			
Depth From:		5.0			
Depth To:		37.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007660891			Tag No:	A261269
Depth M:	11.2776			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/25			Latitude:	45.4016991118464
Audit No:	Z231227			Longitude:	-75.7302593298722
56	1 of 1	SE/51.2	62.9 / 0.00	PARKDALE Ave Ottawa ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7343196			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z231229			Contractor:	7241
Tag:	A191187			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/03/25				
Year Completed:	2019				
Depth (m):	11.2776				
Latitude:	45.401772259807				
Longitude:	-75.7300813869963				
Path:					
 <u>Bore Hole Information</u>					
Bore Hole ID:	1007660872			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442862.00
Code OB Desc:				North83:	5027843.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	25-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1007846678				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	09				
Most Common Material:	MEDIUM SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		5.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846676			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		27			
Mat2 Desc:		OTHER			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846677			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.5			
Formation End Depth:		37.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848157			
Layer:		3			
Plug From:		6.0			
Plug To:		23.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848156			
Layer:		2			
Plug From:		1.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848159			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		5			
Plug From:		25.0			
Plug To:		37.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848155			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848158			
Layer:		4			
Plug From:		23.0			
Plug To:		25.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849666			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007845085			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007850377			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		27.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007850777			
Layer:		1			
Slot:		10			
Screen Top Depth:		27.0			
Screen End Depth:		37.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1007851785				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:	0				
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1007849085				
Diameter:	4.5				
Depth From:	0.0				
Depth To:	5.5				
Hole Depth UOM:	ft				
Hole Diameter UOM:	Inch				
<u>Hole Diameter</u>					
Hole ID:	1007849086				
Diameter:	3.5				
Depth From:	5.5				
Depth To:	37.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	Inch				
<u>Links</u>					
Bore Hole ID:	1007660872			Tag No:	A191187
Depth M:	11.2776			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/25			Latitude:	45.401772259807
Audit No:	Z231229			Longitude:	-75.7300813869963
57	1 of 1	E/51.3	62.9 / 0.00	Parkdale Ave Ottawa ON	WWIS
Well ID:	7343189			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302754			Contractor:	7241
Tag:	A261140			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		NEPEAN TOWNSHIP		Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:		2019/03/05 2019 12.192 45.4020706664134 -75.729868011598			
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1007660802 05-Mar-2019 00:00:00 on Water Well Record		Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	18 442879.00 5027876.00 UTM83 4 margin of error : 30 m - 100 m wwr	
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Mat2 Desc: Mat3: Mat3 Desc: Formation Top Depth: Formation End Depth: Formation End Depth UOM:	1007846657 5 2 GREY 15 LIMESTONE 7.0 40.0 ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: Layer: Color:	1007846655 3 2				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		13			
Mat3 Desc:		BOULDERS			
Formation Top Depth:		3.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846656			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		12			
Most Common Material:		STONES			
Mat2:		08			
Mat2 Desc:		FINE SAND			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		4.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846654			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		08			
Most Common Material:		FINE SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		06			
Mat3 Desc:		SILT			
Formation Top Depth:		1.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846653			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848122			
Layer:		6			
Plug From:		29.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848118			
Layer:		2			
Plug From:		1.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848120			
Layer:		4			
Plug From:		15.0			
Plug To:		27.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848121			
Layer:		5			
Plug From:		27.0			
Plug To:		29.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848117			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848119			
Layer:		3			
Plug From:		6.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849649			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1007849648				
Method Construction Code:	D				
Method Construction:	Direct Push				
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1007845078				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1007850368				
Layer:	2				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0.0				
Depth To:	30.0				
Casing Diameter:	0.8240000009536743				
Casing Diameter UOM:	Inch				
Casing Depth UOM:	ft				
<u>Construction Record - Casing</u>					
Casing ID:	1007850367				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0.0				
Depth To:	16.0				
Casing Diameter:	0.8240000009536743				
Casing Diameter UOM:	Inch				
Casing Depth UOM:	ft				
<u>Construction Record - Screen</u>					
Screen ID:	1007850736				
Layer:	2				
Slot:	10				
Screen Top Depth:	30.0				
Screen End Depth:	40.0				
Screen Material:	5				
Screen Depth UOM:	ft				
Screen Diameter UOM:	inch				
Screen Diameter:	1.0499999523162842				
<u>Construction Record - Screen</u>					
Screen ID:	1007850735				
Layer:	1				
Slot:	10				
Screen Top Depth:	16.0				
Screen End Depth:	26.0				
Screen Material:	5				
Screen Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM: inch					
Screen Diameter: 1.0499999523162842					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID: 1007851778					
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM: ft					
Rate UOM: GPM					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method: 0					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007849071					
Diameter: 2.875					
Depth From: 0.0					
Depth To: 8.0					
Hole Depth UOM: ft					
Hole Diameter UOM: Inch					
<u>Hole Diameter</u>					
Hole ID: 1007849072					
Diameter: 2.375					
Depth From: 8.0					
Depth To: 40.0					
Hole Depth UOM: ft					
Hole Diameter UOM: Inch					
<u>Links</u>					
Bore Hole ID: 1007660802					
Depth M: 12.192					
Year Completed: 2019					
Well Completed Dt: 2019/03/05					
Audit No: Z302754					
Tag No: A261140					
Contractor: 7241					
Path:					
Latitude: 45.4020706664134					
Longitude: -75.729868011598					
58	1 of 2	ESE/51.8	62.9 / 0.00	Parkdale Ottawa ON	WWIS
Well ID: 7343180					
Construction Date:					
Use 1st: Monitoring and Test Hole					
Use 2nd:					
Final Well Status: Monitoring and Test Hole					
Water Type:					
Casing Material:					
Audit No: Z302887					
Tag: A211293					
Constructn Method:					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status:					
Data Src:					
Date Received: 06-Sep-2019 00:00:00					
Selected Flag: TRUE					
Abandonment Rec:					
Contractor: 7241					
Form Version: 7					
Owner:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			NEPEAN TOWNSHIP	County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	OTTAWA-CARLETON
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2019/04/01			
Year Completed:		2019			
Depth (m):		16.764			
Latitude:		45.4018720825668			
Longitude:		-75.7299548973224			
Path:					
Bore Hole Information					
Bore Hole ID:		1007660775		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		01-Apr-2019 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				wwr	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007846627			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.0			
Formation End Depth:		55.0			
Formation End Depth UOM:		ft			
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007846626			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		12			
Mat2 Desc:		STONES			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		1.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007846625			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848072			
Layer:		2			
Plug From:		1.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848073			
Layer:		3			
Plug From:		5.0			
Plug To:		41.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848074			
Layer:		4			
Plug From:		41.0			
Plug To:		43.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848071			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848075			
Layer:		5			
Plug From:		43.0			
Plug To:		55.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849616			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007845069			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007850357			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		45.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007850694			
Layer:		1			
Slot:		10			
Screen Top Depth:		45.0			
Screen End Depth:		55.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851769			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007849053 Diameter: 4.5 Depth From: 0.0 Depth To: 5.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Hole Diameter</u>					
Hole ID: 1007849054 Diameter: 3.5 Depth From: 5.0 Depth To: 55.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Links</u>					
Bore Hole ID: 1007660775 Depth M: 16.764 Year Completed: 2019 Well Completed Dt: 2019/04/01 Audit No: Z302887					
Tag No: A211293 Contractor: 7241 Path: Latitude: 45.4018720825668 Longitude: -75.7299548973224					
58	2 of 2	ESE/51.8	62.9 / 0.00	ON	WWIS
Well ID: 7385914 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z359297 Tag: A318140 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 28-Apr-2021 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID: 1008653855 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 12-Apr-2021 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 442872.00 North83: 5027854.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
Links					
Bore Hole ID: 1008653855 Depth M: Year Completed: 2021 Well Completed Dt: 2021/04/12 Audit No: Z359297 Tag No: A318140 Contractor: 7241 Path: 738\7385914.pdf Latitude: 45.4018720825668 Longitude: -75.7299548973224					
59	1 of 1	SE/53.4	62.9 / 0.00	PARKDALE Ottawa ON	WWIS
Well ID: 7343194 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z231235 Tag: A261139 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06-Sep-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date: 2019/03/22 Year Completed: 2019 Depth (m): 17.0688 Latitude: 45.4017452581293 Longitude: -75.7300810392095 Path:					
Bore Hole Information					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1007660866			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442862.00
Code OB Desc:				North83:	5027840.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	22-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846671				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	09				
Most Common Material:	MEDIUM SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	06				
Mat3 Desc:	SILT				
Formation Top Depth:	1.0				
Formation End Depth:	5.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846672				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:	19				
Mat2 Desc:	SLATE				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	5.0				
Formation End Depth:	56.0				
Formation End Depth UOM:	ft				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846670				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	27				
Most Common Material:	OTHER				
Mat2:	11				
Mat2 Desc:	GRAVEL				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848145			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848146			
Layer:		2			
Plug From:		1.0			
Plug To:		7.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848147			
Layer:		3			
Plug From:		7.0			
Plug To:		41.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848149			
Layer:		5			
Plug From:		44.0			
Plug To:		56.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848148			
Layer:		4			
Plug From:		41.0			
Plug To:		44.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849815			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Method of Construction & Well</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Use</u>					
Method Construction ID:		1007849814			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:		HYDROFRAC			
<u>Pipe Information</u>					
Pipe ID:		1007845083			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850375			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		46.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850770			
Layer:		1			
Slot:		10			
Screen Top Depth:		46.0			
Screen End Depth:		56.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851783			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849082			
Diameter:		3.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		5.0			
Depth To:		56.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849081			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		5.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007660866			Tag No:	A261139
Depth M:	17.0688			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/22			Latitude:	45.4017452581293
Audit No:	Z231235			Longitude:	-75.7300810392095
60	1 of 1	ESE/54.2	62.9 / 0.00	Parkdale Ottawa ON	WWIS
Well ID:		7343179		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z302865		Contractor:	7241
Tag:		A190994		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2019/04/01			
Year Completed:		2019			
Depth (m):		10.9728			
Latitude:		45.4018089153412			
Longitude:		-75.7299796389097			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:		1007660772		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	442870.00
Code OB Desc:				North83:	5027847.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01-Apr-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007846623			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		4.5			
Formation End Depth:		36.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007846622			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		27			
Mat2 Desc:		OTHER			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007846624			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		4.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848070			
Layer:		5			
Plug From:		24.0			
Plug To:		36.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848067			
Layer:		2			
Plug From:		1.0			
Plug To:		4.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848069			
Layer:		4			
Plug From:		22.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848066			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848068			
Layer:		3			
Plug From:		4.5			
Plug To:		22.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849603			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845068			
Casing No:		0			
Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850356			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		26.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850676			
Layer:		1			
Slot:		10			
Screen Top Depth:		26.0			
Screen End Depth:		36.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851768			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849051			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		4.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849052			
Diameter:		3.5			
Depth From:		4.5			
Depth To:		36.0			
Hole Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:	1007660772			Tag No:	A190994
Depth M:	10.9728			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/04/01			Latitude:	45.4018089153412
Audit No:	Z302865			Longitude:	-75.7299796389097
61	1 of 2	E/54.2	62.9 / 0.00	OTTAWA CITY PARKDALE AVE/ARMSTRONG ST. OTTAWA CITY ON	CA
Certificate #:		3-0775-99-			
Application Year:		99			
Issue Date:		7/14/1999			
Approval Type:		Municipal sewage			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
61	2 of 2	E/54.2	62.9 / 0.00	R.M. OF OTTAWA-CARLETON PARKDALE AVE/ARMSTRONG ST. OTTAWA CITY ON	CA
Certificate #:		7-0521-99-			
Application Year:		99			
Issue Date:		7/14/1999			
Approval Type:		Municipal water			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
62	1 of 1	ESE/55.8	62.9 / 0.00	ON	WWIS
Well ID:	7385912			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	28-Apr-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z359300			Contractor:	7241
Tag:	A318296			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
OTTAWA CITY					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008653849 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 13-Apr-2021 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:				Elevation: Elevrc: Zone: 18 East83: 442872.00 North83: 5027847.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr	
<u>Links</u>					
Bore Hole ID: 1008653849 Depth M: Year Completed: 2021 Well Completed Dt: 2021/04/13 Audit No: Z359300				Tag No: A318296 Contractor: 7241 Path: 738\7385912.pdf Latitude: 45.4018090786513 Longitude: -75.7299540859584	
63	1 of 3	NNW/56.4	62.9 / 0.00	Canadian Criminal Justice Assn 320 Parkdale Ave Suite 101 Ottawa ON K1Y 4X9	SCT
Established: Plant Size (ft²): Employment:		01-JAN-19			
<u>--Details--</u>					
Description: SIC/NAICS Code:		Professional Organizations 813920			
63	2 of 3	NNW/56.4	62.9 / 0.00	320 Parkdale Ave Ottawa ON	SPL
Ref No: 8422-AEMNB7 Site No: NA Incident Dt: 10/11/2016 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 15 Contaminant Name: OIL (PETROLEUM BASED, NOT SPECIFIED) Contaminant Limit 1: Contam Limit Freq 1:				Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Miscellaneous Communal Agency Involved: Nearest Watercourse: Site Address: 320 Parkdale Ave Site District Office: Site Postal Code:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 10/11/2016 Dt Document Closed: Incident Reason: Equipment Failure Site Name: condo<UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: TSSA: leaking fuel oil tank Contaminant Qty: 0 other - see incident description Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Source Type:					
63	3 of 3	NNW/56.4	62.9 / 0.00	320 PARKDALE AVE, OTTAWA ON	INC
Incident No: 1956922 Incident ID: Instance No: Status Code: Attribute Category: FS-Perform L1 Incident Insp Context: Date of Occurrence: 2016/10/11 00:00:00 Time of Occurrence: 13:18:00 Incident Created On: Instance Creation Dt: Instance Install Dt: Occur Insp Start Date: 2016/10/11 00:00:00 Approx Quant Rel: Tank Capacity: Fuels Occur Type: Leak Fuel Type Involved: Fuel Oil Enforcement Policy: NULL Prc Escalation Req: NULL Tank Material Type: Tank Storage Type: Tank Location Type: Pump Flow Rate Cap: Task No: 6376731 Notes: Drainage System: Sub Surface Contam.: Aff Prop Use Water: Contam. Migrated: Contact Natural Env: Incident Location: 320 PARKDALE AVE, OTTAWA - LEAK Occurence Narrative: Fuel oil leaking from piping at the fuel oil storage tank. Operation Type Involved: Multi-unit Residential Item: Item Description: Device Installed Location: Any Health Impact: No Any Enviro Impact: Yes Service Interrupted: Yes Was Prop Damaged: Yes Reside App. Type: Commer App. Type: Indus App. Type: Institut App. Type: Venting Type: Vent Conn Mater: Vent Chimney Mater: Pipeline Type: Pipeline Involved: Pipe Material: Depth Ground Cover: Regulator Location: Regulator Type: Operation Pressure: Liquid Prop Make: Liquid Prop Model: Liquid Prop Serial No: Liquid Prop Notes: Equipment Type: Equipment Model: Serial No: Cylinder Capacity: Cylinder Cap Units: Cylinder Mat Type: Near Body of Water:					
64	1 of 1	SE/56.4	62.9 / 0.00	PARKDALE Ave Ottawa ON	WWIS
Well ID: 7343195 Construction Date: Flowing (Y/N): Flow Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z231237			Contractor:	7241
Tag:	A170634			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/03/25				
Year Completed:	2019				
Depth (m):	11.2776				
Latitude:	45.4017183381184				
Longitude:	-75.7300679149682				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007660869			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442863.00
Code OB Desc:				North83:	5027837.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	25-Mar-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1007846675				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:	17				
Mat2 Desc:	SHALE				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	5.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		37.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007846674			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007846673			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		27			
Mat2 Desc:		OTHER			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007848153			
Layer:		4			
Plug From:		23.0			
Plug To:		25.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007848154			
Layer:		5			
Plug From:		25.0			
Plug To:		37.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007848150			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848151			
Layer:		2			
Plug From:		1.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848152			
Layer:		3			
Plug From:		5.0			
Plug To:		23.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849662			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845084			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850376			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		27.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850773			
Layer:		1			
Slot:		10			
Screen Top Depth:		27.0			
Screen End Depth:		37.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method Desc:					
Pump Test ID:	1007851784				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:	0				
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1007849084				
Diameter:	3.5				
Depth From:	5.0				
Depth To:	37.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	Inch				
<u>Hole Diameter</u>					
Hole ID:	1007849083				
Diameter:	4.5				
Depth From:	0.0				
Depth To:	5.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	Inch				
<u>Links</u>					
Bore Hole ID:	1007660869			Tag No:	A170634
Depth M:	11.2776			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/25			Latitude:	45.4017183381184
Audit No:	Z231237			Longitude:	-75.7300679149682
65	1 of 1	WSW/56.8	63.9 / 1.00	7 HINTON AVE Ottawa ON	WWIS
Well ID:	7166778			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	05-Aug-2011 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z111755			Contractor:	7241
Tag:	A099842			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7166778.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2011/07/16			
Year Completed:		2011			
Depth (m):		6.1			
Latitude:		45.4017749677069			
Longitude:		-75.731065290883			
Path:		716\7166778.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003546016		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		16-Jul-2011 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record		wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003896274			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003896275			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		2.440000057220459			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003896273			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		12			
Most Common Material:		STONES			
Mat2:		73			
Mat2 Desc:		HARD			
Mat3:		68			
Mat3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003896284			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003896286			
Layer:		3			
Plug From:		1.8300000429153442			
Plug To:		3.0999999046325684			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003896285			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003896287			
Layer:		4			
Plug From:		3.0999999046325684			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1003896283				
Method Construction Code:	7				
Method Construction:	Diamond				
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1003896272				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1003896279				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0.0				
Depth To:	3.3499999046325684				
Casing Diameter:	3.450000047683716				
Casing Diameter UOM:	cm				
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1003896280				
Layer:	1				
Slot:	10				
Screen Top Depth:	3.3499999046325684				
Screen End Depth:	6.099999904632568				
Screen Material:	5				
Screen Depth UOM:	m				
Screen Diameter UOM:	cm				
Screen Diameter:	4.210000038146973				
<u>Water Details</u>					
Water ID:	1003896278				
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
<u>Hole Diameter</u>					
Hole ID:	1003896277				
Diameter:	5.710000038146973				
Depth From:	2.440000057220459				
Depth To:	6.099999904632568				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Hole Diameter</u>					
Hole ID:	1003896276				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Diameter:		8.25			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:		1003546016		Tag No:	A099842
Depth M:		6.1		Contractor:	7241
Year Completed:		2011		Path:	716\7166778.pdf
Well Completed Dt:		2011/07/16		Latitude:	45.4017749677069
Audit No:		Z111755		Longitude:	-75.731065290883
66	1 of 1	W/57.5	63.9 / 1.00	7 HINTON AVE Ottawa ON	WWIS
Well ID:		7166779		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Test Hole		Date Received:	05-Aug-2011 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z111754		Contractor:	7241
Tag:		A094087		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7166779.pdf			
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2011/07/16			
Year Completed:		2011			
Depth (m):		5.55			
Latitude:		45.4021788477213			
Longitude:		-75.7312493865558			
Path:		716\7166779.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:		1003546018		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442771.00
Code OB Desc:				North83:	5027889.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		16-Jul-2011 00:00:00		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003896321			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		1.8300000429153442			
Formation End Depth:		5.550000190734863			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003896319			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003896320			
Layer:		2			
Color:		8			
General Color:		BLACK			
Mat1:		02			
Most Common Material:		TOPSOIL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		68			
Mat3 Desc:		DRY			
Formation Top Depth:		1.5			
Formation End Depth:		1.8300000429153442			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003896330			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003896332			
Layer:		3			
Plug From:		1.5			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003896333			
Layer:		4			
Plug From:		2.740000009536743			
Plug To:		5.550000190734863			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003896331			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003896329			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003896318			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003896325			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID: 1003896326					
Layer: 1					
Slot: 10					
Screen Top Depth: 3.0999999046325684					
Screen End Depth: 5.550000190734863					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 4.210000038146973					
<u>Water Details</u>					
Water ID: 1003896324					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1003896322					
Diameter: 8.25					
Depth From: 0.0					
Depth To: 1.8300000429153442					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1003896323					
Diameter: 5.710000038146973					
Depth From: 1.8300000429153442					
Depth To: 5.550000190734863					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID:	1003546018			Tag No:	A094087
Depth M:	5.55			Contractor:	7241
Year Completed:	2011			Path:	716\7166779.pdf
Well Completed Dt:	2011/07/16			Latitude:	45.4021788477213
Audit No:	Z111754			Longitude:	-75.7312493865558
67	1 of 1	ESE/57.6	62.9 / 0.00	366 Parkdale Ave Ottawa ON	WWIS
Well ID:	7343170			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302762			Contractor:	7241
Tag:	A261089			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
		NEPEAN TOWNSHIP			
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:					
Year Completed:					
Depth (m):		16.76			
Latitude:		45.401782076973			
Longitude:		-75.7299537382317			
Path:					
Bore Hole Information					
Bore Hole ID:		1007660706		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442872.00
Code OB Desc:				North83:	5027844.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:				UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007846601			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007846602			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		16.760000228881836			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846600			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848037			
Layer:		4			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848035			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		13.40999984741211			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848034			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848036			
Layer:		3			
Plug From:		13.40999984741211			
Plug To:		16.760000228881836			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848038			
Layer:		5			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849520			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845059			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850345			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		13.710000038146973			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007850646			
Layer:		1			
Slot:		10			
Screen Top Depth:		13.710000038146973			
Screen End Depth:		16.760000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851759			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007849038 Diameter: 11.430000305175781 Depth From: 0.0 Depth To: 2.130000114440918 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1007849039 Diameter: 8.850000381469727 Depth From: 2.130000114440918 Depth To: 16.760000228881836 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 1007660706 Depth M: 16.76 Year Completed: Well Completed Dt: Audit No: Z302762					
Tag No: A261089 Contractor: 7241 Path: Latitude: 45.401782076973 Longitude: -75.7299537382317					
68	1 of 1	WNW/57.7	62.9 / 0.00	R.M. OF OTTAWA-CARLETON HAMILTON ST./SPENCER ST. OTTAWA ON	CA
Certificate #: 7-0914-98- Application Year: 98 Issue Date: 9/14/1998 Approval Type: Municipal water Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
69	1 of 1	W/57.9	63.9 / 1.00	OTTAWA HYDRO 4 HAMILTON ST. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SPL
Ref No: 86490 Site No: Incident Dt: 6/3/1993 Year: Incident Cause: PIPE/HOSE LEAK					
Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Event:				Agency Involved:	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	NOT ANTICIPATED			Site Municipality:	OTTAWA CITY
Nature of Impact:				Site Lot:	
Receiving Medium:	LAND			Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	6/4/1993			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason:	OVERSTRESS/OVERPRESSURE			Source Type:	
Site Name:					
Site County/District:					
Municipality No:	20101				
Site Geo Ref Meth:					
Incident Summary:	OTTAWA HYDRO - 1 L OF HYDRAULIC OIL TO GROUND				
Contaminant Qty:					

70	1 of 1	ESE/58.7	62.9 / 0.00	ON	WWIS
Well ID:	7385913			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	28-Apr-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z359285			Contractor:	7241
Tag:	A318295			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					

Bore Hole Information

Bore Hole ID:	1008653852	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442877.00
Code OB Desc:		North83:	5027849.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	30-Mar-2021 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
Links					
Bore Hole ID:	1008653852			Tag No:	A318295
Depth M:				Contractor:	7241
Year Completed:	2021			Path:	
Well Completed Dt:	2021/03/30			Latitude:	45.4018274880206
Audit No:	Z359285			Longitude:	-75.7298904353768
71	1 of 1	ENE/59.3	62.9 / 0.00	3 HAMILTON AVE NORTH ON	WWIS
Well ID:	7041979			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Dewatering			Date Received:	29-Mar-2007 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z64913			Contractor:	3651
Tag:	A054059			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041979.pdf				
Additional Detail(s) (Map)					
Well Completed Date:	2007/03/14				
Year Completed:	2007				
Depth (m):	7.6				
Latitude:	45.4024036054465				
Longitude:	-75.7298850764103				
Path:	704\7041979.pdf				
Bore Hole Information					
Bore Hole ID:	11764482			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442878.00
Code OB Desc:				North83:	5027913.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	14-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095699			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095700			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		1.5			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316046			
Layer:		1			
Plug From:		0.0			
Plug To:		2.5999999046325684			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041979			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772202			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 930897294					
Layer: 2					
Material: 4					
Open Hole or Material: OPEN HOLE					
Depth From: 2.5999999046325684					
Depth To: 7.599999904632568					
Casing Diameter:					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
Construction Record - Casing					
Casing ID: 930897293					
Layer: 1					
Material: 1					
Open Hole or Material: STEEL					
Depth From: 0.0					
Depth To: 2.5999999046325684					
Casing Diameter: 15.899999618530273					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
Hole Diameter					
Hole ID: 11850752					
Diameter: 15.199999809265137					
Depth From: 2.5999999046325684					
Depth To: 7.599999904632568					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
Hole Diameter					
Hole ID: 11850751					
Diameter: 25.399999618530273					
Depth From: 0.0					
Depth To: 2.5999999046325684					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
Links					
Bore Hole ID: 11764482		Tag No: A054059			
Depth M: 7.6		Contractor: 3651			
Year Completed: 2007		Path: 704\7041979.pdf			
Well Completed Dt: 2007/03/14		Latitude: 45.4024036054465			
Audit No: Z64913		Longitude: -75.7298850764103			
72	1 of 1	ESE/61.7	62.9 / 0.00	PARKDALE Ave Ottawa ON	WWIS
Well ID: 7343197		Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st: Monitoring and Test Hole		Data Entry Status:			
Use 2nd:		Data Src:			
Final Well Status: Monitoring and Test Hole		Date Received: 06-Sep-2019 00:00:00			
Water Type:		Selected Flag: TRUE			
Casing Material:		Abandonment Rec:			
Audit No: Z231230		Contractor: 7241			
Tag: A199427		Form Version: 7			
Constructn Method:		Owner:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:		
NEPEAN TOWNSHIP					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:			2019/03/25		
Year Completed:			2019		
Depth (m):			17.3736		
Latitude:			45.4017371558283		
Longitude:			-75.7299403822289		
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:			1007660875		
DP2BR:			Elevation:		
Spatial Status:			Elevrc:		
Code OB:			Zone:		
Code OB Desc:			East83:		
Open Hole:			North83:		
Cluster Kind:			Org CS:		
Date Completed:			UTMRC:		
Remarks:			UTMRC Desc:		
Loc Method Desc:			Location Method:		
Elevrc Desc:			18		
Location Source Date:			442873.00		
Improvement Location Source:			5027839.00		
Improvement Location Method:			UTM83		
Source Revision Comment:			4		
Supplier Comment:			margin of error : 30 m - 100 m wwr		
on Water Well Record					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			1007846679		
Layer:			1		
Color:			8		
General Color:			BLACK		
Mat1:			27		
Most Common Material:			OTHER		
Mat2:			27		
Mat2 Desc:			OTHER		
Mat3:			11		
Mat3 Desc:			GRAVEL		
Formation Top Depth:			0.0		
Formation End Depth:			1.0		
Formation End Depth UOM:			ft		
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			1007846681		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		6.0			
Formation End Depth:		57.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007846680			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848160			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848161			
Layer:		2			
Plug From:		1.0			
Plug To:		10.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848162			
Layer:		3			
Plug From:		10.0			
Plug To:		43.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007848163			
Layer:		4			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		43.0			
Plug To:		45.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848164			
Layer:		5			
Plug From:		45.0			
Plug To:		57.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849671			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845086			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850378			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		47.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850782			
Layer:		1			
Slot:		10			
Screen Top Depth:		47.0			
Screen End Depth:		57.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851786			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007849087 Diameter: 4.5 Depth From: 0.0 Depth To: 6.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Hole Diameter</u>					
Hole ID: 1007849088 Diameter: 3.5 Depth From: 6.0 Depth To: 57.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
<u>Links</u>					
Bore Hole ID: 1007660875 Depth M: 17.3736 Year Completed: 2019 Well Completed Dt: 2019/03/25 Audit No: Z231230					
Tag No: A199427 Contractor: 7241 Path: Latitude: 45.4017371558283 Longitude: -75.7299403822289					
73	1 of 1	ESE/61.9	62.9 / 0.00	ON	WWIS
Well ID: 7385910 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z359296 Tag: A318303 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 28-Apr-2021 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	11764478			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442844.00
Code OB Desc:				North83:	5027941.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	16-Mar-2007 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095692				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	1.2000000476837158				
Formation End Depth:	6.099999904632568				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	933095691				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	11				
Most Common Material:	GRAVEL				
Mat2:	28				
Mat2 Desc:	SAND				
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	1.2000000476837158				
Formation End Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	933316042				
Layer:	1				
Plug From:	0.0				
Plug To:	2.200000047683716				
Plug Depth UOM:	m				
 <u>Method of Construction & Well</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Use</u>					
Method Construction ID:		967041975			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772198			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897286			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.200000047683716			
Depth To:		6.099999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897285			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.200000047683716			
Casing Diameter:		15.8999999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850744			
Diameter:		15.199999809265137			
Depth From:		2.200000047683716			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		11850743			
Diameter:		25.3999999618530273			
Depth From:		0.0			
Depth To:		2.200000047683716			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	11764478		Tag No:	A054055	
Depth M:	6.1		Contractor:	3651	
Year Completed:	2007		Path:	704\7041975.pdf	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Dt:	2007/03/16			Latitude:	45.4026528442428
Audit No:	Z64909			Longitude:	-75.7303227282798

75	1 of 1	E/64.4	62.9 / 0.00	Parkdale Ave Ottawa ON	WWIS
Well ID:	7343188			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302753			Contractor:	7241
Tag:	A261125			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2019/03/05
Year Completed: 2019
Depth (m): 12.192
Latitude: 45.4019996415666
Longitude: -75.7297137662006
Path:

Bore Hole Information

Bore Hole ID:	1007660799	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442891.00
Code OB Desc:		North83:	5027868.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	05-Mar-2019 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID: 1007846651
Layer: 3

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		2			
General Color:		GREY			
Mat1:		13			
Most Common Material:		BOULDERS			
Mat2:		12			
Mat2 Desc:		STONES			
Mat3:		08			
Mat3 Desc:		FINE SAND			
Formation Top Depth:		4.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846652			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		6.0			
Formation End Depth:		40.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846650			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		08			
Mat2 Desc:		FINE SAND			
Mat3:		06			
Mat3 Desc:		SILT			
Formation Top Depth:		1.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846649			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848115			
Layer:		5			
Plug From:		27.0			
Plug To:		29.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848112			
Layer:		2			
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848114			
Layer:		4			
Plug From:		15.0			
Plug To:		27.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848113			
Layer:		3			
Plug From:					
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848116			
Layer:		6			
Plug From:		29.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848111			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849643			
Method Construction Code:		7			
Method Construction:		Diamond			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849642			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845077			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850365			
Layer:		2			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		30.0			
Casing Diameter:		0.8240000009536743			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		1007850366			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		16.0			
Casing Diameter:		0.8240000009536743			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850730			
Layer:		2			
Slot:		10			
Screen Top Depth:		30.0			
Screen End Depth:		40.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0499999523162842			
<u>Construction Record - Screen</u>					
Screen ID:		1007850729			
Layer:		1			
Slot:		10			
Screen Top Depth:		16.0			
Screen End Depth:		26.0			
Screen Material:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0499999523162842			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851777			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849070			
Diameter:		2.375			
Depth From:		8.0			
Depth To:		40.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849069			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		8.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Links</u>					
Bore Hole ID:		1007660799		Tag No:	A261125
Depth M:		12.192		Contractor:	7241
Year Completed:		2019		Path:	
Well Completed Dt:		2019/03/05		Latitude:	45.4019996415666
Audit No:		Z302753		Longitude:	-75.7297137662006
76	1 of 1	WSW/64.6	63.9 / 1.00	Artech Studios 6 Hamilton Ave N Suite 250 Ottawa ON K1Y 4R1	SCT
Established:		01-DEC-82			
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:		Doll, Toy and Game Manufacturing			
SIC/NAICS Code:		339930			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
77	1 of 1	SE/65.8	63.0 / 0.15	PARKDALE Ave Ottawa ON	WWIS
Well ID: 7343199 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z302888 Tag: A261130 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info: PDF URL (Map): Additional Detail(s) (Map) Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06-Sep-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Well Completed Date: 2019/03/25 Year Completed: 2019 Depth (m): 11.2776 Latitude: 45.4016467419556 Longitude: -75.7300031053624 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007660894 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 25-Mar-2019 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 442868.00 North83: 5027829.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1007846686 Layer: 2 Color: 6					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007846685			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		27			
Mat2 Desc:		OTHER			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007846687			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.0			
Formation End Depth:		37.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007848172			
Layer:		3			
Plug From:		7.0			
Plug To:		23.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007848174			
Layer:		5			
Plug From:		25.0			
Plug To:		37.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848170			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848173			
Layer:		4			
Plug From:		23.0			
Plug To:		25.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848171			
Layer:		2			
Plug From:		1.0			
Plug To:		7.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849679			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845088			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850380			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		27.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850790			
Layer:		1			
Slot:		10			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Top Depth:		27.0			
Screen End Depth:		37.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851788			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1007849092			
Diameter:		3.5			
Depth From:		5.0			
Depth To:		37.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
 <u>Hole Diameter</u>					
Hole ID:		1007849091			
Diameter:		4.5			
Depth From:		0.0			
Depth To:		5.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
 <u>Links</u>					
Bore Hole ID:	1007660894			Tag No:	A261130
Depth M:	11.2776			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/03/25			Latitude:	45.4016467419556
Audit No:	Z302888			Longitude:	-75.7300031053624
<u>78</u>	1 of 3	ENE/66.2	62.9 / 0.00	341 Parkdale Avenue Ottawa ON K1Y 2W3	EHS
Order No:	21120100012			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	06-DEC-21			Search Radius (km):	.25
Date Received:	01-DEC-21			X:	-75.729878
Previous Site Name:				Y:	45.4024998

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Lot/Building Size: Additional Info Ordered:					
78	2 of 3	ENE/66.2	62.9 / 0.00	341 Parkdale Avenue Ottawa ON K1Y 2W3	EHS
Order No: 21120100012 Status: C Report Type: Standard Report Report Date: 06-DEC-21 Date Received: 01-DEC-21 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.729878 Y: 45.4024998			
78	3 of 3	ENE/66.2	62.9 / 0.00	341 Parkdale Avenue Ottawa ON K1Y 2W3	EHS
Order No: 21120100012 Status: C Report Type: Standard Report Report Date: 06-DEC-21 Date Received: 01-DEC-21 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.729878 Y: 45.4024998			
79	1 of 8	NW/66.3	62.9 / 0.00	GRAPHIC DISPLAY CANADA 45 SPENCER ST OTTAWA ON K1Y 2P5	SCT
Established: 1979 Plant Size (ft²): 0 Employment: 9 --Details-- Description: Other Printing SIC/NAICS Code: 323119 Description: Showcase, Partition, Shelving and Locker Manufacturing SIC/NAICS Code: 337215 Description: Sign Manufacturing SIC/NAICS Code: 339950					
79	2 of 8	NW/66.3	62.9 / 0.00	FUJI GRAPHIC SYSTEMS CANADA 45 SPENCER ST OTTAWA ON K1Y 2P5	SCT
Established: 0000 Plant Size (ft²): 0 Employment: 2 --Details-- Description: Industrial Machinery, Equipment and Supplies Wholesaler-Distributors SIC/NAICS Code: 417230					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		Office and Store Machinery and Equipment Wholesaler-Distributors			
SIC/NAICS Code:		417910			
Description:		Stationery and Office Supplies Wholesaler-Distributors			
SIC/NAICS Code:		418210			
Description:		All Other Industrial Machinery Manufacturing			
SIC/NAICS Code:		333299			
79	3 of 8	NW/66.3	62.9 / 0.00	THE ENVELOPE HOUSE 45 SPENCER ST OTTAWA ON K1Y 2P5	SCT
Established:		1979			
Plant Size (ft²):		8000			
Employment:		5			
--Details--					
Description:		Stationery Product Manufacturing			
SIC/NAICS Code:		322230			
Description:		Other Printing			
SIC/NAICS Code:		323119			
Description:		ENVELOPES			
SIC/NAICS Code:		2677			
79	4 of 8	NW/66.3	62.9 / 0.00	GRAPHIC DISPLAY CANADA 45 SPENCER ST OTTAWA ON K1Y 2P5	SCT
Established:		1979			
Plant Size (ft²):		0			
Employment:		9			
--Details--					
Description:		COMMERCIAL PRINTING, NOT ELSEWHERE CLASSIFIED			
SIC/NAICS Code:		2759			
Description:		SIGNS AND ADVERTISING SPECIALTIES			
SIC/NAICS Code:		3993			
79	5 of 8	NW/66.3	62.9 / 0.00	Graphic Display Canada - A St-Joseph Corporation Company 45 Spencer St Ottawa ON K1Y 2P5	SCT
Established:		1979			
Plant Size (ft²):		10000			
Employment:		9			
79	6 of 8	NW/66.3	62.9 / 0.00	GRAPHIC DISPLAY CANADA DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	GEN
Generator No:		ON0272301			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: 2819 SIC Description: OTHER COMM. PRINTING Approval Years: 86,87,88,89,90,92,93,97 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
79	7 of 8	NW/66.3	62.9 / 0.00	GRAPHIC DISPLAY CANADA 18-125 DIVISION OF M.O.M. PRINTING LTD. 45 SPENCER STREET OTTAWA ON K1Y 2P5	GEN
Generator No: ON0272301 SIC Code: 2819 SIC Description: OTHER COMM. PRINTING Approval Years: 94,95,96 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
79	8 of 8	NW/66.3	62.9 / 0.00	GRAPHIC DISPLAY CANADA M.O.M. PRINTING LIMITED, A DIVISION OF 45 SPENCER STREET OTTAWA ON K1Y 2P5	GEN
Generator No: ON0272301 SIC Code: 2819 SIC Description: OTHER COMM. PRINTING Approval Years: 98,99,00,01 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
80	1 of 1	ESE/70.8	62.9 / 0.00	Parkdale Ave Ottawa ON	WWIS
Well ID: 7343182 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z231226 Tag: A189794 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06-Sep-2019 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 2019/04/01 Year Completed: 2019 Depth (m): 16.4592 Latitude: 45.4018105481849 Longitude: -75.7297241093865 Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007660781 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 01-Apr-2019 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 442890.00 North83: 5027847.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1007846631 Layer: 1 Color: 8 General Color: BLACK					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		27			
Mat2 Desc:		OTHER			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846633			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.0			
Formation End Depth:		54.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846632			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		09			
Most Common Material:		MEDIUM SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		12			
Mat3 Desc:		STONES			
Formation Top Depth:		1.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848081			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848085			
Layer:		5			
Plug From:		42.0			
Plug To:		54.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848083			
Layer:		3			
Plug From:		5.0			
Plug To:		39.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848084			
Layer:		4			
Plug From:		39.0			
Plug To:		42.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848082			
Layer:		2			
Plug From:		1.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849625			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845071			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850359			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		44.0			
Casing Diameter:		2.066999912261963			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850702			
Layer:		1			
Slot:		10			
Screen Top Depth:		44.0			
Screen End Depth:		54.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Material:	5				
Screen Depth UOM:	ft				
Screen Diameter UOM:	inch				
Screen Diameter:	2.375				
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1007851771				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:	0				
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:	1007849058				
Diameter:	3.5				
Depth From:	5.0				
Depth To:	54.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	Inch				
 <u>Hole Diameter</u>					
Hole ID:	1007849057				
Diameter:	4.5				
Depth From:	0.0				
Depth To:	5.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	Inch				
 <u>Links</u>					
Bore Hole ID:	1007660781			Tag No:	A189794
Depth M:	16.4592			Contractor:	7241
Year Completed:	2019			Path:	
Well Completed Dt:	2019/04/01			Latitude:	45.4018105481849
Audit No:	Z231226			Longitude:	-75.7297241093865

81	1 of 1	SE/70.9	62.9 / 0.00	366 Parkdale Ave Ottawa ON	WWIS
Well ID:	7343168			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302764			Contractor:	7241

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag:	A261091			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date: 2019/02/20					
Year Completed: 2019					
Depth (m): 16.76					
Latitude: 45.4016564773874					
Longitude: -75.7298882333071					
Path:					
Bore Hole Information					
Bore Hole ID: 1007660700					
DP2BR:					
Spatial Status:					
Code OB:					
Code OB Desc:					
Open Hole:					
Cluster Kind:					
Date Completed: 20-Feb-2019 00:00:00					
Remarks:					
Loc Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID: 1007846594					
Layer: 1					
Color: 8					
General Color: BLACK					
Mat1: 27					
Most Common Material: OTHER					
Mat2: 11					
Mat2 Desc: GRAVEL					
Mat3: 66					
Mat3 Desc: DENSE					
Formation Top Depth: 0.0					
Formation End Depth: 0.3100000023841858					
Formation End Depth UOM: m					
Overburden and Bedrock					
Materials Interval					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007846595			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.8300000429153442			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846596			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		1.8300000429153442			
Formation End Depth:		16.760000228881836			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848024			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848026			
Layer:		3			
Plug From:		13.40999984741211			
Plug To:		16.760000228881836			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848027			
Layer:		4			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1007848028			
Layer:		5			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848025			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		13.40999984741211			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849516			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007845057			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007850343			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		13.710000038146973			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007850642			
Layer:		1			
Slot:		10			
Screen Top Depth:		13.710000038146973			
Screen End Depth:		16.760000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851757			
Pump Set At:					
Static Level:					
Final Level After Pumping:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: m Rate UOM: LPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007849035 Diameter: 8.890000343322754 Depth From: 2.130000114440918 Depth To: 16.760000228881836 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1007849034 Diameter: 11.430000305175781 Depth From: 0.0 Depth To: 2.130000114440918 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 1007660700 Depth M: 16.76 Year Completed: 2019 Well Completed Dt: 2019/02/20 Audit No: Z302764					
Tag No: A261091 Contractor: 7241 Path: Latitude: 45.4016564773874 Longitude: -75.7298882333071					
82	1 of 1	WSW/75.6	63.9 / 1.00	7 HINTON AVE OTTAWA ON	WWIS
Well ID: 7192836 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z154401 Tag: A133466 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 04-Dec-2012 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2012/11/17				
Year Completed:	2012				
Depth (m):	6.1				
Latitude:	45.4017910057398				
Longitude:	-75.731372158292				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1004215644			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442761.00
Code OB Desc:				North83:	5027846.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	17-Nov-2012 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1004544766				
Layer:	5				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	3.6600000858306885				
Formation End Depth:	6.099999904632568				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1004544764				
Layer:	3				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	85				
Mat3 Desc:	SOFT				
Formation Top Depth:	0.6100000143051147				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004544762			
Layer:		1			
Color:		2			
General Color:		GREY			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004544763			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:					
Mat2 Desc:					
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		0.6100000143051147			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004544765			
Layer:		4			
Color:		2			
General Color:		GREY			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		2.440000057220459			
Formation End Depth:		3.6600000858306885			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004544776			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004544775			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004544777			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004544774			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004544761			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004544770			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.570000171661377			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004544771			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.570000171661377			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1004544769			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
 <u>Hole Diameter</u>					
Hole ID:		1004544768			
Diameter:		5.710000038146973			
Depth From:		3.6600000858306885			
Depth To:		6.099999904632568			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
 <u>Hole Diameter</u>					
Hole ID:		1004544767			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		3.6600000858306885			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
 <u>Links</u>					
Bore Hole ID:	1004215644			Tag No:	A133466
Depth M:	6.1			Contractor:	7241
Year Completed:	2012			Path:	719\7192836.pdf
Well Completed Dt:	2012/11/17			Latitude:	45.4017910057398
Audit No:	Z154401			Longitude:	-75.731372158292
83	1 of 1	ESE/77.5	62.9 / 0.00	Parkdale Ave Ottawa ON	WWIS
Well ID:	7343172			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302787			Contractor:	7241
Tag:	A261265			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/02/22				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:		2019			
Depth (m):		12.192			
Latitude:		45.4018021189851			
Longitude:		-75.7296345581899			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007660712			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442897.00
Code OB Desc:				North83:	5027846.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	22-Feb-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846607				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	27				
Most Common Material:	OTHER				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846610				
Layer:	4				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:	17				
Mat2 Desc:	SHALE				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	4.0				
Formation End Depth:	40.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007846609			
Layer:		3			
Color:		6			
General Color:		BROWN			
Mat1:		08			
Most Common Material:		FINE SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		06			
Mat3 Desc:		SILT			
Formation Top Depth:		2.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846608			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		08			
Mat2 Desc:		FINE SAND			
Mat3:		06			
Mat3 Desc:		SILT			
Formation Top Depth:		1.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848048			
Layer:		4			
Plug From:		15.0			
Plug To:		27.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848046			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848049			
Layer:		5			
Plug From:		27.0			
Plug To:		29.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848050			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		6			
Plug From:		29.0			
Plug To:		40.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848045			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848047			
Layer:		3			
Plug From:		4.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849534			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849533			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007845061			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007850349			
Layer:		2			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		30.0			
Casing Diameter:		0.8240000009536743			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID:		1007850348			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		16.0			
Casing Diameter:		0.8240000009536743			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850904			
Layer:		2			
Slot:		10			
Screen Top Depth:		30.0			
Screen End Depth:		40.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0499999523162842			
<u>Construction Record - Screen</u>					
Screen ID:		1007850903			
Layer:		1			
Slot:		10			
Screen Top Depth:		16.0			
Screen End Depth:		26.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0499999523162842			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851761			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849043			
Diameter:		2.375			
Depth From:		4.0			
Depth To:		40.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Hole Diameter

Hole ID: 1007849042
Diameter: 2.875
Depth From: 0.0
Depth To: 4.0
Hole Depth UOM: ft
Hole Diameter UOM: Inch

Links

Bore Hole ID:	1007660712	Tag No:	A261265
Depth M:	12.192	Contractor:	7241
Year Completed:	2019	Path:	
Well Completed Dt:	2019/02/22	Latitude:	45.4018021189851
Audit No:	Z302787	Longitude:	-75.7296345581899

84	1 of 1	SE/80.8	62.9 / 0.00	ON	WWIS

Well ID: 7385915 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z359286 Tag: A318294 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:	Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 28-Apr-2021 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:

Bore Hole Information

Bore Hole ID: 1008653858 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 30-Mar-2021 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	Elevation: Elevrc: Zone: 18 East83: 442886.00 North83: 5027825.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr

Links

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:		711\7119461.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7119461.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2009/01/21			
Year Completed:		2009			
Depth (m):					
Latitude:		45.4019643065077			
Longitude:		-75.7310166226552			
Path:		711\7119461.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1002743328		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:		This is a record from cluster log sheet		UTMRC:	
Date Completed:		21-Jan-2009 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002743332			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1002743331			
Method Construction Code:					
Method Construction:					
Other Method Construction:		AIR PERCUSSION			
<u>Pipe Information</u>					
Pipe ID:		1002743333			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002743335			
Layer:					
Material:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		2.0			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1002743334			
Layer:					
Slot:					
Screen Top Depth:		2.0			
Screen End Depth:		4.5			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002743336			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1002743330			
Diameter:		5.0			
Depth From:					
Depth To:		4.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1002743346			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442746.00
Code OB Desc:				North83:	5027877.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	20-Jan-2009 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002743350			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002743349			
Method Construction Code:					
Method Construction:					
Other Method Construction:		AIR PERCUSSION			
<u>Pipe Information</u>					
Pipe ID:		1002743351			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002743353			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.0			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002743352			
Layer:					
Slot:					
Screen Top Depth:		3.0			
Screen End Depth:		10.0			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002743354			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1002743348			
Diameter:		5.0			
Depth From:					
Depth To:		6.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002018852			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442788.00
Code OB Desc:				North83:	5027866.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	27-Jan-2009 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002743356			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		25			
Mat3 Desc:		OVERBURDEN			
Formation Top Depth:		0.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1002743357			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		26			
Mat3 Desc:		ROCK			
Formation Top Depth:		2.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002743361			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		5.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002743360			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002743362			
Layer:		3			
Plug From:		5.5			
Plug To:		10.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002743366			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002743355			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002743363			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		6.0			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002743364			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Hole Diameter</u>					
Hole ID:		1002743359			
Diameter:		5.0			
Depth From:		2.0			
Depth To:		10.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1002743358			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		2.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002743337			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442744.00
Code OB Desc:				North83:	5027877.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	20-Jan-2009 00:00:00			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1002743341			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1002743340				
Method Construction Code:					
Method Construction:					
Other Method Construction:	AIR PERCUSSION				
<u>Pipe Information</u>					
Pipe ID:	1002743342				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1002743344				
Layer:					
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:	7.0				
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1002743343				
Layer:					
Slot:					
Screen Top Depth:	7.0				
Screen End Depth:	10.0				
Screen Material:					
Screen Depth UOM:	m				
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1002743345				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID:		1002743339			
Diameter:		5.0			
Depth From:					
Depth To:		10.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	1002743337			Tag No:	A080380
Depth M:				Contractor:	7241
Year Completed:	2009			Path:	711\7119461.pdf
Well Completed Dt:	2009/01/20			Latitude:	45.4020686319595
Audit No:	M03849			Longitude:	-75.7315929594843
 <u>Links</u>					
Bore Hole ID:	1002743328			Tag No:	A080380
Depth M:				Contractor:	7241
Year Completed:	2009			Path:	711\7119461.pdf
Well Completed Dt:	2009/01/21			Latitude:	45.4019643065077
Audit No:	M03849			Longitude:	-75.7310166226552
 <u>Links</u>					
Bore Hole ID:	1002743346			Tag No:	A080380
Depth M:				Contractor:	7241
Year Completed:	2009			Path:	711\7119461.pdf
Well Completed Dt:	2009/01/20			Latitude:	45.4020687956312
Audit No:	M03849			Longitude:	-75.7315674064251
 <u>Links</u>					
Bore Hole ID:	1002018852			Tag No:	A080380
Depth M:	10			Contractor:	7241
Year Completed:	2009			Path:	711\7119461.pdf
Well Completed Dt:	2009/01/27			Latitude:	45.4019732252913
Audit No:	M03849			Longitude:	-75.7310295152432
<u>86</u>	1 of 1	NW/83.0	62.9 / 0.00	ON	WWIS
Well ID:	7383510			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	30-Mar-2021 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z343925			Contractor:	6964
Tag:	A307592			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1008645764			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442792.00
Code OB Desc:				North83:	5027956.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	15-Mar-2021 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Links</u>					
Bore Hole ID:	1008645764			Tag No:	A307592
Depth M:				Contractor:	6964
Year Completed:	2021			Path:	738\7383510.pdf
Well Completed Dt:	2021/03/15			Latitude:	45.4027836024557
Audit No:	Z343925			Longitude:	-75.7309888559302
87	1 of 1	ESE/84.5	62.9 / 0.00	Parkdale Ave Ottawa ON	WWIS
Well ID:	7343171			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z302788			Contractor:	7241
Tag:	A254622			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2019/02/20				
Year Completed:	2019				
Depth (m):	11.7348				
Latitude:	45.4017213587905				
Longitude:	-75.7295951860977				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1007660709			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442900.00
Code OB Desc:				North83:	5027837.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	20-Feb-2019 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846603				
Layer:	1				
Color:	2				
General Color:	GREY				
Mat1:	27				
Most Common Material:	OTHER				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	73				
Mat3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846605				
Layer:	3				
Color:	6				
General Color:	BROWN				
Mat1:	08				
Most Common Material:	FINE SAND				
Mat2:	06				
Mat2 Desc:	SILT				
Mat3:	12				
Mat3 Desc:	STONES				
Formation Top Depth:	2.0				
Formation End Depth:	5.5				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007846606				
Layer:	4				
Color:	2				
General Color:	GREY				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		5.5			
Formation End Depth:		38.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007846604			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		08			
Mat2 Desc:		FINE SAND			
Mat3:		06			
Mat3 Desc:		SILT			
Formation Top Depth:		1.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848040			
Layer:		2			
Plug From:		1.0			
Plug To:		3.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848043			
Layer:		5			
Plug From:		24.0			
Plug To:		27.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848039			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848044			
Layer:		6			
Plug From:		27.5			
Plug To:		38.5			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848041			
Layer:		3			
Plug From:		12.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848042			
Layer:		4			
Plug From:		24.0			
Plug To:		24.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849526			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849525			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845060			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850346			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		13.0			
Casing Diameter:		0.8240000009536743			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		1007850347			
Layer:		2			
Material:		5			
Open Hole or Material:		PLASTIC			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		28.5			
Casing Diameter:		0.8240000009536743			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007850653			
Layer:		2			
Slot:		10			
Screen Top Depth:		28.5			
Screen End Depth:		38.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0499999523162842			
<u>Construction Record - Screen</u>					
Screen ID:		1007850652			
Layer:		1			
Slot:		10			
Screen Top Depth:		13.0			
Screen End Depth:		23.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.0499999523162842			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851760			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849040			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007849041			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Diameter:		2.375			
Depth From:		6.0			
Depth To:		38.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
Links					
Bore Hole ID:		1007660709		Tag No:	A254622
Depth M:		11.7348		Contractor:	7241
Year Completed:		2019		Path:	
Well Completed Dt:		2019/02/20		Latitude:	45.4017213587905
Audit No:		Z302788		Longitude:	-75.7295951860977
88	1 of 1	SE/84.7	62.9 / 0.00	Parkdale Ave Ottawa ON	WWIS
Well ID:		7343167		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	06-Sep-2019 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z302765		Contractor:	7241
Tag:		A261090		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2019/02/19			
Year Completed:		2019			
Depth (m):		16.76			
Latitude:		45.4015308777597			
Longitude:		-75.7298227286758			
Path:					
Bore Hole Information					
Bore Hole ID:		1007660697		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442882.00
Code OB Desc:				North83:	5027816.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		19-Feb-2019 00:00:00		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007846592			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007846593			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:		17			
Mat2 Desc:		SHALE			
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		16.760000228881836			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007846591			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		27			
Most Common Material:		OTHER			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007848021			
Layer:		3			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		13.40999984741211			
Plug To:		16.760000228881836			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848020			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		13.40999984741211			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848022			
Layer:		4			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848019			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007848023			
Layer:		5			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007849515			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007845056			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007850342			
Layer:		1			
Material:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		13.710000038146973			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007850641			
Layer:		1			
Slot:		10			
Screen Top Depth:		13.710000038146973			
Screen End Depth:		16.760000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007851756			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007849032			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007849033			
Diameter:		8.890000343322754			
Depth From:		2.130000114440918			
Depth To:		16.760000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:		1007660697		Tag No:	A261090
Depth M:		16.76		Contractor:	7241
Year Completed:		2019		Path:	

346 erisinfo.com | Environmental Risk Information Services Order No: 23030600564

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7041977.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/03/16			
Year Completed:		2007			
Depth (m):		7.6			
Latitude:		45.4027992217539			
Longitude:		-75.7299540595762			
Path:		704\7041977.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11764480		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				442873.00	
Cluster Kind:				North83:	
Date Completed:		16-Mar-2007 00:00:00		5027957.00	
Remarks:				Org CS:	
Loc Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				3	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 10 - 30 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095695			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.2000000476837158			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933095696			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3 Desc:					
Formation Top Depth:		1.2000000476837158			
Formation End Depth:		7.599999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933316044			
Layer:		1			
Plug From:		0.0			
Plug To:		2.4000000953674316			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967041977			
Method Construction Code:		4			
Method Construction:		Rotary (Air)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11772200			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930897289			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.4000000953674316			
Casing Diameter:		15.8999999618530273			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		930897290			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:		2.4000000953674316			
Depth To:		7.599999904632568			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		11850747			
Diameter:		25.3999999618530273			
Depth From:		0.0			
Depth To:		2.4000000953674316			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:	11850748				
Diameter:	15.199999809265137				
Depth From:	2.4000000953674316				
Depth To:	7.599999904632568				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Links</u>					
Bore Hole ID:	11764480			Tag No:	A054057
Depth M:	7.6			Contractor:	3651
Year Completed:	2007			Path:	704\7041977.pdf
Well Completed Dt:	2007/03/16			Latitude:	45.4027992217539
Audit No:	Z64911			Longitude:	-75.7299540595762
92	1 of 1	SE/90.3	62.9 / 0.00	ON	WWIS
Well ID:	7203872			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	25-Jun-2013 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C15836			Contractor:	1844
Tag:	A122970			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2012/03/08				
Year Completed:	2012				
Depth (m):					
Latitude:	45.4014405455933				
Longitude:	-75.7298726753807				
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1004377482			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442878.00
Code OB Desc:				North83:	5027806.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	5

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Completed: 08-Mar-2012 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
UTMRC Desc: margin of error : 100 m - 300 m Location Method: www					
Links					
Bore Hole ID: 1004377482 Depth M: Year Completed: 2012 Well Completed Dt: 2012/03/08 Audit No: C15836					
Tag No: A122970 Contractor: 1844 Path: Latitude: 45.4014405455933 Longitude: -75.7298726753807					
93	1 of 3	SW/95.5	63.9 / 1.00	262 Armstrong Street Ottawa ON K1Y 2W6	EHS
Order No: 21032500098 Status: C Report Type: Standard Report Report Date: 30-MAR-21 Date Received: 25-MAR-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; Title Searches					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7312634 Y: 45.4014309					
93	2 of 3	SW/95.5	63.9 / 1.00	262 Armstrong Street Ottawa ON K1Y 2W6	EHS
Order No: 21032500098 Status: C Report Type: Standard Report Report Date: 30-MAR-21 Date Received: 25-MAR-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; Title Searches					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7312634 Y: 45.4014309					
93	3 of 3	SW/95.5	63.9 / 1.00	262 Armstrong Street Ottawa ON K1Y 2W6	EHS
Order No: 21032500098 Status: C Report Type: Standard Report Report Date: 30-MAR-21 Date Received: 25-MAR-21 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; Title Searches					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7312634 Y: 45.4014309					
94	1 of 1	SSW/98.2	63.9 / 1.00	12 Hamilton Ave N Ottawa ON	EHS
Order No: 20160808116 Status: C					
Nearest Intersection: Municipality: ottawa					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type: Standard Report Report Date: 15-AUG-16 Date Received: 08-AUG-16 Previous Site Name: Lot/Building Size: Additional Info Ordered: City Directory; Aerial Photos					
Client Prov/State: ON Search Radius (km): .25 X: -75.730748 Y: 45.401244					
95	1 of 1	NW/100.9	62.9 / 0.00	ON	WWIS
Well ID: 7389506 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z349613 Tag: A307606 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 16-Jun-2021 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6964 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008702050 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 09-Jun-2021 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 442780.00 North83: 5027970.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Links</u>					
Bore Hole ID: 1008702050 Depth M: Year Completed: 2021 Well Completed Dt: 2021/06/09 Audit No: Z349613					
Tag No: A307606 Contractor: 6964 Path: 738\7389506.pdf Latitude: 45.4029086288795 Longitude: -75.7311438016624					

96	1 of 1	NNW/110.1	62.9 / 0.00	312 Parkdale Avenue Ottawa ON K1Y 4X9	EHS
Order No: 20190121144 Nearest Intersection:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Standard Report Report Date: 28-JAN-19 Date Received: 21-JAN-19 Previous Site Name: Unknown Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory; Aerial Photos					
Municipality: Ottawa Client Prov/State: ON Search Radius (km): .25 X: -75.731046 Y: 45.402961					
97	1 of 1	WSW/112.0	63.9 / 1.00	7 Hinton Ave N Ottawa ON K1Y4P1	EHS
Order No: 20130918002 Status: C Report Type: Standard Report Report Date: 26-SEP-13 Date Received: 18-SEP-13 Previous Site Name: Lot/Building Size: Additional Info Ordered: City Directory					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.731851 Y: 45.401741					
98	1 of 8	WSW/112.1	63.9 / 1.00	VOGUE BRASSIERE INC. 7 HINTON AVE N OTTAWA ON K1Y 4P1	SCT
Established: 1953 Plant Size (ft²): 0 Employment: 110					
--Details-- Description: BRASSIERES, GIRDLES, AND ALLIED GARMENTS SIC/NAICS Code: 2342 Description: Cut and Sew Clothing Contracting SIC/NAICS Code: 315210 Description: Women's and Girls' Cut and Sew Lingerie, Loungewear and Nightwear Manufacturing SIC/NAICS Code: 315231					
98	2 of 8	WSW/112.1	63.9 / 1.00	CANADIAN ARCTIC RESOURCES COMM 7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	SCT
Established: 1971 Plant Size (ft²): 0 Employment: 4					
--Details-- Description: Periodical Publishers SIC/NAICS Code: 511120 Description: Book Publishers SIC/NAICS Code: 511130 Description: Other Publishers SIC/NAICS Code: 511190					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
98	3 of 8	WSW/112.1	63.9 / 1.00	Canadian Arctic Resources Committee Inc. 7 Hinton Ave N Suite 200 Ottawa ON K1Y 4P1	SCT
Established:		1971			
Plant Size (ft²):					
Employment:		4			
98	4 of 8	WSW/112.1	63.9 / 1.00	Metcalf Realty Company Limited 7 Hinton Avenue Ottawa ON	GEN
Generator No:		ON5223737			
SIC Code:		531310			
SIC Description:		Real Estate Property Managers			
Approval Years:		06			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
98	5 of 8	WSW/112.1	63.9 / 1.00	7 Hinton Ave N. Ottawa ON K1Y 4P1	EHS
Order No:		20090616008	Nearest Intersection:		Hinton Ave N. & Spencer St.
Status:		C	Municipality:		
Report Type:		Standard Report	Client Prov/State:		ON
Report Date:		6/24/2009	Search Radius (km):		0.25
Date Received:		6/16/2009	X:		-75.73185
Previous Site Name:			Y:		45.40174
Lot/Building Size:					
Additional Info Ordered:					
98	6 of 8	WSW/112.1	63.9 / 1.00	METCALFE REALTY LIMITED 7 HINTIN AVE., NORTH OTTAWA ON	GEN
Generator No:		ON4988188			
SIC Code:		315210			
SIC Description:		Cut and Sew Clothing Contracting			
Approval Years:		2009			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
98	7 of 8	WSW/112.1	63.9 / 1.00	Metcalfe Realty Company Limited 7 Hinton Avenue Ottawa ON	GEN
Generator No:		ON5223737			
SIC Code:		531310			
SIC Description:		Real Estate Property Managers			
Approval Years:		2009			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
98	8 of 8	WSW/112.1	63.9 / 1.00	Metcalfe Realty Company Limited 7 Hinton Avenue Ottawa ON	GEN
Generator No:		ON5223737			
SIC Code:		531310			
SIC Description:		Real Estate Property Managers			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
99	1 of 3	N/112.9	62.9 / 0.00	312 Parkdale Avenue Ottawa ON K1Y 4X9	EHS
Order No:		20200806163		Nearest Intersection:	
Status:		C		Municipality:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type: Standard Report Report Date: 11-AUG-20 Date Received: 06-AUG-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Client Prov/State: ON Search Radius (km): .25 X: -75.7306797 Y: 45.4031231					
99	2 of 3	N/112.9	62.9 / 0.00	312 Parkdale Avenue Ottawa ON K1Y 4X9	EHS
Order No: 20200806163 Status: C Report Type: Standard Report Report Date: 11-AUG-20 Date Received: 06-AUG-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7306797 Y: 45.4031231					
99	3 of 3	N/112.9	62.9 / 0.00	312 Parkdale Avenue Ottawa ON K1Y 4X9	EHS
Order No: 20200806163 Status: C Report Type: Standard Report Report Date: 11-AUG-20 Date Received: 06-AUG-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7306797 Y: 45.4031231					
100	1 of 2	SSW/115.6	63.9 / 1.00	CAA NORTH & EAST ONTARIO 16 HAMILTON AVENUE OTTAWA ON	GEN
Generator No: ON0890503 SIC Code: 6399 SIC Description: OTHER VEH. SERVICES Approval Years: 99,00,01 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
100	2 of 2	SSW/115.6	63.9 / 1.00	16 Hamilton Avenue North Ottawa ON K1Y 1B6	EHS
Order No: 20090305022 Status: C Report Type: Standard Report					
Nearest Intersection: Wellington and Parkdale Municipality: Hintonburg Client Prov/State: ON					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Date: 3/16/2009 Date Received: 3/5/2009 Previous Site Name: Lot/Building Size: Additional Info Ordered: Supplementary Anderson Report					
101	1 of 3	E/121.8	62.9 / 0.00	211 Armstrong Street Ottawa ON K1Y 2W4	EHS
Order No: 21102700713 Status: C Report Type: Standard Report Report Date: 01-NOV-21 Date Received: 27-OCT-21 Previous Site Name: Lot/Building Size: 0.04 hectares Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7289649 Y: 45.4020851					
101	2 of 3	E/121.8	62.9 / 0.00	211 Armstrong Street Ottawa ON K1Y 2W4	EHS
Order No: 21102700713 Status: C Report Type: Standard Report Report Date: 01-NOV-21 Date Received: 27-OCT-21 Previous Site Name: Lot/Building Size: 0.04 hectares Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7289649 Y: 45.4020851					
101	3 of 3	E/121.8	62.9 / 0.00	211 Armstrong Street Ottawa ON K1Y 2W4	EHS
Order No: 21102700713 Status: C Report Type: Standard Report Report Date: 01-NOV-21 Date Received: 27-OCT-21 Previous Site Name: Lot/Building Size: 0.04 hectares Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7289649 Y: 45.4020851					
102	1 of 1	SW/124.8	63.9 / 1.00	79 Hinton Avenue North Ottawa ON K1Y 0Z7	EHS
Order No: 20070313035 Status: C Report Type: CAN - Complete Report Report Date: 3/22/2007 Date Received: 3/13/2007 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Wellington Street West/Armstrong Municipality: Client Prov/State: Search Radius (km): 0.25 X: -75.7314 Y: 45.40125					
103	1 of 1	SE/125.9	63.9 / 1.00	366 PARKDALE AVE. Ottawa ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7133809			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	13-Nov-2009 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z106671			Contractor:	7241
Tag:	A090935			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:	WKQ-001799				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7133809.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2009/01/01				
Year Completed:	2009				
Depth (m):	6.1				
Latitude:	45.4011080963242				
Longitude:	-75.7297789530939				
Path:	713\7133809.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1002816257			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442885.00
Code OB Desc:				North83:	5027769.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01-Jan-2009 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1003009597				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	26				
Most Common Material:	ROCK				
Mat2:					
Mat2 Desc:					
Mat3:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Mat3 Desc:					
Formation Top Depth:		2.440000057220459			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003009596			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.6000000238418579			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003009595			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.6000000238418579			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003009602			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003009601			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003009600			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003009608			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003009594			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003009604			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003009605			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
 <u>Water Details</u>					
Water ID:		1003009603			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1003009599			
Diameter:		5.710000038146973			
Depth From:		2.4400000057220459			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1003009598			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1002816257			Tag No:	A090935
Depth M:	6.1			Contractor:	7241
Year Completed:	2009			Path:	713\7133809.pdf
Well Completed Dt:	2009/01/01			Latitude:	45.4011080963242
Audit No:	Z106671			Longitude:	-75.7297789530939
104	1 of 1	SSE/126.4	63.9 / 1.00	366 PARKDALE AVE. Ottawa ON	WWIS
Well ID:	7133808			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	13-Nov-2009 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z106669			Contractor:	7241
Tag:	A090933			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:	WKQ-001799				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7133808.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2009/01/01				
Year Completed:	2009				
Depth (m):	5.18				
Latitude:	45.4010438677439				
Longitude:	-75.7299697865013				
Path:	713\7133808.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1002816254			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442870.00
Code OB Desc:				North83:	5027762.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01-Jan-2009 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:		Location Method:			WWF
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003009507			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		06			
Mat2 Desc:		SILT			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.6000000238418579			
Formation End Depth:		3.3499999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003009508			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		26			
Most Common Material:		ROCK			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		3.3499999046325684			
Formation End Depth:		5.179999828338623			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003009506			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.6000000238418579			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID: 1003009512					
Layer: 3					
Plug From: 1.8300000429153442					
Plug To: 5.179999828338623					
Plug Depth UOM: m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1003009510					
Layer: 1					
Plug From: 0.0					
Plug To: 0.30000001192092896					
Plug Depth UOM: m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1003009511					
Layer: 2					
Plug From: 0.30000001192092896					
Plug To: 1.8300000429153442					
Plug Depth UOM: m					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1003009518					
Method Construction Code: D					
Method Construction: Direct Push					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1003009505					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1003009514					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 2.130000114440918					
Casing Diameter: 3.450000047683716					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1003009515					
Layer: 1					
Slot: 10					
Screen Top Depth: 2.130000114440918					
Screen End Depth: 5.179999828338623					
Screen Material: 5					
Screen Depth UOM: m					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM: cm Screen Diameter: 4.210000038146973					
<u>Water Details</u>					
Water ID: 1003009513 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1003009509 Diameter: Depth From: Depth To: Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID: 1002816254 Depth M: 5.18 Year Completed: 2009 Well Completed Dt: 2009/01/01 Audit No: Z106669 Tag No: A090933 Contractor: 7241 Path: 713\7133808.pdf Latitude: 45.4010438677439 Longitude: -75.7299697865013					
105	1 of 1	WSW/126.6	63.9 / 1.00	OTTAWA CITY - PHINEY ST./HOLLAND AVE. ARMSTRONG ST./HINTON AVE. N OTTAWA CITY ON	CA
Certificate #: 3-0416-92- Application Year: 92 Issue Date: 5/1/1992 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
106	1 of 11	ESE/127.8	62.9 / 0.00	UNKNOWN OFFICE BLDG AT 383 PARKDALE AVE IN THE SUMP PUMP HOLES IN PARKING GARAGE OTTAWA CITY ON K1Y 4R4	SPL
Ref No: 2477 Site No: Incident Dt: 4/15/1988 Year: Incident Cause: UNKNOWN Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: WATER Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 4/16/1988 Dt Document Closed: Incident Reason: UNKNOWN Site Name: Site County/District: Municipality No: 20101 Site Geo Ref Meth: Incident Summary: GASOLINE ODOUR IN OFFICE BLDG FROM SUMP PUMP AREA IN THE PARKING GARAGE. Contaminant Qty:					
Site Postal Code: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
106	2 of 11	ESE/127.8	62.9 / 0.00	Myropen Publications Ltd. 383 Parkdale Ave Suite 402 Ottawa ON K1Y 4R4	SCT
Established: 1932 Plant Size (ft²): Employment: 5 --Details-- Description: Periodical Publishers SIC/NAICS Code: 511120					
106	3 of 11	ESE/127.8	62.9 / 0.00	GEM Software Scheduling 383 Parkdale Av Suite 304 Ottawa ON K1Y 4R4	SCT
Established: Plant Size (ft²): Employment:					
106	4 of 11	ESE/127.8	62.9 / 0.00	Rosemount Family Health Organization Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	GEN
Generator No: ON3346215 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2015 PO Box No: Country: Canada Status: Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u> Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					

365 erisinfo.com | Environmental Risk Information Services Order No: 23030600564

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
106	8 of 11	ESE/127.8	62.9 / 0.00	GEM Health Care Services (2011) Inc. 383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	GEN
Generator No:		ON8857995			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
106	9 of 11	ESE/127.8	62.9 / 0.00	Rosemount Family Health Organization Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	GEN
Generator No:		ON3346215			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
106	10 of 11	ESE/127.8	62.9 / 0.00	Rosemount Family Health Organization Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	GEN
Generator No:		ON3346215			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
106	11 of 11	ESE/127.8	62.9 / 0.00	GEM Health Care Services (2011) Inc. 383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	GEN
Generator No:		ON8857995			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
107	1 of 1	NE/128.8	61.9 / -1.00	R.M. OF OTTAWA-CARLETON PINEHURST AVE./OXFORD ST. OTTAWA ON	CA
Certificate #:		7-0425-98-			
Application Year:		98			
Issue Date:		5/29/1998			
Approval Type:		Municipal water			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
108	1 of 1	NW/129.1	62.9 / 0.00	ON	WWIS
Well ID:		7122598		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		0		Date Received: 11-Mar-2009 00:00:00	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:				Contractor: 6894	

368 erisinfo.com | Environmental Risk Information Services Order No: 23030600564

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7126433			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	29-Jul-2009 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z93059			Contractor:	7241
Tag:	A087222			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/712\7126433.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2009/06/24				
Year Completed:	2009				
Depth (m):					
Latitude:	45.4014903862811				
Longitude:	-75.731930487475				
Path:	712\7126433.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1002578941			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442717.00
Code OB Desc:				North83:	5027813.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	24-Jun-2009 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1002638071				
Layer:	1				
Plug From:	0.0				
Plug To:	1.0				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1002638073			
Layer:		3			
Plug From:		4.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002638072			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002638079			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1002638068			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002638075			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1002638076			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.25			
<u>Water Details</u>					
Water ID:		1002638074			
Layer:					
Kind Code:					
Kind:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth: Water Found Depth UOM:ft					
Hole Diameter					
Hole ID:1002638070					
Diameter:3.25					
Depth From:0.0					
Depth To:15.0					
Hole Depth UOM:ft					
Hole Diameter UOM:inch					
Links					
Bore Hole ID:1002578941					
Depth M:					
Year Completed:2009					
Well Completed Dt:2009/06/24					
Audit No:Z93059					
Tag No:A087222					
Contractor:7241					
Path:712\7126433.pdf					
Latitude:45.4014903862811					
Longitude:-75.731930487475					
110	1 of 2	S/133.5	63.9 / 1.00	2145675 ONTARIO INC. 20 Hamilton AV N_FR Ottawa ON K1Y 1B6	EASR
Approval No:R-009-3113289504					
Status:REGISTERED					
Date:2021-06-24					
Record Type:EASR					
Link Source:MOFA					
Project Type:Water Taking - Construction Dewatering					
Full Address:					
Approval Type:EASR-Water Taking - Construction Dewatering					
SWP Area Name:Rideau Valley					
PDF URL:					
PDF Site Location:					
110	2 of 2	S/133.5	63.9 / 1.00	HAMILTON AVENUE HOLDINGS INC. 20 HAMILTON AVENUE NORTH, OTTAWA, ON K1Y 1B6 Ottawa ON	RSC
RSC ID:230968					
RA No:					
RSC Type:Phase 1 and 2 RSC					
Curr Property Use:Commercial					
Ministry District:Ottawa District Office					
Filing Date:2022/03/29					
Date Ack:					
Date Returned:					
Restoration Type:					
Soil Type:					
Criteria:					
CPU Issued Sect 1686:					
Asmt Roll No:061407370172600000					
Prop ID No (PIN):04035-0236 (LT)					
Property Municipal Address:16 HAMILTON AVENUE NORTH, OTTAWA, ON K1Y 1B6, 20 HAMILTON AVENUE NORTH, OTTAWA, ON K1Y 1B6					
Mailing Address:					
Latitude & Latitude:					
UTM Coordinates:					
Consultant:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Legal Desc: Measurement Method: Applicable Standards: RSC PDF: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=160637&fileName=BROWNFIELDS-E.pdf					
<u>Document(s) Detail</u>					
Document Heading: Supporting Documents Document Name: Hamilton Avenue - Certificates Combined.pdf Document Type: Certificate of Status Document Link: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=160633&fileName=Hamilton+Avenue+-+Certificates+Combined.pdf					
Document Heading: Supporting Documents Document Name: Transfer.pdf Document Type: Copy of any deed(s), transfer(s) or other document(s) Document Link: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=160636&fileName=Transfer.pdf					
Document Heading: Supporting Documents Document Name: 2 Current and Past Use Table.pdf Document Type: Table of Current and Past Property Use Document Link: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=160634&fileName=2+Current+and+Past+Use+Table.pdf					
Document Heading: Supporting Documents Document Name: 3 Hamilton CSM.pdf Document Type: Phase 2 Conceptual Site Model Document Link: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=160639&fileName=3+Hamilton+CSM.pdf					
Document Heading: Supporting Documents Document Name: Survey Plan.pdf Document Type: A Current plan of Survey Document Link: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=160640&fileName=Survey+Plan.pdf					
Document Heading: Supporting Documents Document Name: 2A APEC Table.pdf Document Type: Area(s) of Potential Environmental Concern Document Link: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=160631&fileName=2A+APEC+Table.pdf					
Document Heading: Supporting Documents Document Name: Lawyer Letter - Hamilton Ave.pdf Document Type: Lawyer's letter consisting of a legal description of the property Document Link: https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/viewDocument.action?attachmentId=160641&fileName=Lawyer+Letter+-+Hamilton+Ave.pdf					

111	1 of 1	S/135.2	63.9 / 1.00	22 HAMILTON AVE Ottawa ON	WWIS
Well ID: 7180987 Construction Date: Use 1st: Test Hole Use 2nd: Final Well Status: 0 Water Type: Casing Material: Audit No: Z134685 Tag: A132244 Constructn Method: Elevation (m): Elevatn Reliability:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 17-May-2012 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 6964 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:		NEPEAN TOWNSHIP		Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:		2012/03/30 2012 3.7 45.4008965914735 -75.730478982761			
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1003781316			Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	18 442830.00 5027746.00 UTM83 4 margin of error : 30 m - 100 m wwr
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: Layer: Color: General Color: Mat1: Most Common Material: Mat2: Mat2 Desc: Mat3: Mat3 Desc: Formation Top Depth: Formation End Depth: Formation End Depth UOM:	1004310002 4 2 GREY 06 SILT				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: Layer: Color:	1004309999 1				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
60					
CEMENTED					
0.0					
0.05999999865889549					
m					
1004310001					
3					
6					
BROWN					
06					
SILT					
81					
SANDY					
65					
DARK-COLOURED					
0.15000000596046448					
0.6200000047683716					
m					
1004310000					
2					
11					
GRAVEL					
0.05999999865889549					
0.15000000596046448					
m					
1004310004					
6					
13					
BOULDERS					
2.450000047683716					
3.700000047683716					
m					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004310003			
Layer:		5			
Color:		2			
General Color:		GREY			
Mat1:		05			
Most Common Material:		CLAY			
Mat2:		84			
Mat2 Desc:		SILTY			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.450000047683716			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004310011			
Layer:		1			
Plug From:		0.0			
Plug To:		1.2999999523162842			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004310012			
Layer:		2			
Plug From:		1.2999999523162842			
Plug To:		3.700000047683716			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004310010			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004309998			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004310007			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		3.5			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1004310008			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		3.700000047683716			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.099999904632568			
<u>Water Details</u>					
Water ID:		1004310006			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		2.5199999809265137			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004310005			
Diameter:		7.5			
Depth From:		0.0			
Depth To:		3.700000047683716			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1003781316			Tag No:	A132244
Depth M:	3.7			Contractor:	6964
Year Completed:	2012			Path:	
Well Completed Dt:	2012/03/30			Latitude:	45.4008965914735
Audit No:	Z134685			Longitude:	-75.730478982761
<u>112</u>	1 of 2	ESE/135.7	62.9 / 0.00	Rosemount Family Health Organization Suite 309 - 383 Parkdale Avenue Ottawa ON K1Y 4R4	GEN
Generator No:		ON3346215			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
112	2 of 2	ESE/135.7	62.9 / 0.00	GEM Health Care Services (2011) Inc. 383 Parkdale Avenue, Suite 304 Ottawa ON K1Y 4R4	GEN
Generator No:		ON8857995			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
113	1 of 1	WSW/137.3	63.9 / 1.00	CYBERMEDIX HEALTH (OUT OF BUSINESS) 44 HINTON AVE OTTAWA ON K1Y 1B3	GEN
Generator No:		ON0064801			
SIC Code:		8681			
SIC Description:		MEDICAL LABORATORIES			
Approval Years:		98			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
114	1 of 1	S/137.7	63.9 / 1.00	22 Hamilton Ave N Ottawa ON K1Y 1B6	EHS
Order No:		20120312021	Nearest Intersection:		
Status:		C	Municipality:		Ottawa
Report Type:		Standard Report	Client Prov/State:		ON
Report Date:		3/21/2012 2:55:11 PM	Search Radius (km):		0.25
Date Received:		3/12/2012 2:52:27 PM	X:		-75.730504
Previous Site Name:			Y:		45.400874
Lot/Building Size:		4500 sq ft			
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; Title Searches			
115	1 of 1	S/143.5	63.9 / 1.00	ENBRIDGE GAS INC 22 HAMILTON AVE N,,OTTAWA,ON,K1Y 1B6,CA ON	PINC
Incident Id:			Pipe Material:		
Incident No:		3057482	Fuel Category:		
Incident Reported Dt:		6/1/2021	Health Impact:		
Type:		FS-Pipeline Incident	Environment Impact:		
Status Code:			Property Damage:		
Tank Status:		Pipeline Damage Reason Est	Service Interrupt:		
Task No:			Enforce Policy:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID: 1008686568 Depth M: Year Completed: 2021 Well Completed Dt: 2021/05/27 Audit No: C52848 Tag No: A307238 Contractor: 7328 Path: Latitude: 45.40081525958 Longitude: -75.7305290438666					
117	1 of 4	SE/150.7	62.9 / 0.00	785730 ONTARIO INC 1175 WELLINGTON ST OTTAWA ON K1Y 2Y9	PRT
Location ID: 11139 Type: retail Expiry Date: 1990-08-31 Capacity (L): 19380 Licence #: 0055276001					
117	2 of 4	SE/150.7	62.9 / 0.00	785730 ONTARIO INC 1175 WELLINGTON ST OTTAWA ON K1Y2Y9	PRT
Location ID: 11139 Type: retail Expiry Date: 1991-03-31 Capacity (L): 5000 Licence #: 0034246001					
117	3 of 4	SE/150.7	62.9 / 0.00	785730 ONTARIO INC 1175 WELLINGTON ST OTTAWA ON	DTNK
<u>Delisted Expired Fuel Safety Facilities</u> Instance No: 9650943 Status: EXPIRED Instance ID: 392220 Instance Type: FS Facility Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Expired Date: Max Hazard Rank: Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		Fuels Safety Propane Filling Plant > 5000 USW			
Original Source:		EXP			
Record Date:		Up to Mar 2012			

117

SE/150.7

785730 ONTARIO INC
1175 WELLINGTON ST
OTTAWA ON K1Y 2Y9

Delisted Expired Fuel Safety Facilities

Instance No:	9809517
Status:	EXPIRED
Instance ID:	
Instance Type:	FS Facility
Instance Creation Dt:	
Instance Install Dt:	
Item Description:	
Manufacturer:	
Model:	
Serial No:	
ULC Standard:	
Quantity:	
Unit of Measure:	
Overfill Prot Type:	
Creation Date:	
Next Periodic Str DT:	
TSSA Base Sched Cycle 2:	
TSSAMax Hazard Rank 1:	
TSSA Risk Based Periodic Yn:	
TSSA Volume of Directives:	
TSSA Periodic Exempt:	
TSSA Statutory Interval:	
TSSA Recd Insp Interva:	
TSSA Recd Tolerance:	
TSSA Program Area:	
TSSA Program Area 2:	
Description:	
Original Source:	
Record Date:	

Expired Date: 9/1/1990
Max Hazard Rank:
Facility Location:
Facility Type:
Fuel Type 2:
Fuel Type 3:
Panam Related:
Panam Venue Nm:
External Identifier:
Item:
Piping Steel:
Piping Galvanized:
Tank Single Wall St:
Piping Underground:
Tank Underground:
Source:

118

Incident Id:	3151680
Incident No:	12/16/2021
Incident Reported Dt:	FS-Pipeline Incident
Type:	
Status Code:	
Tank Status:	Pipeline Damage Reason Est
Task No:	
Spills Action Centre:	
Fuel Type:	
Fuel Occurrence Tp:	
Date of Occurrence:	
Occurrence Start Dt:	
Depth:	
Customer Acct Name:	ENBRIDGE GAS IN
Incident Address:	84 HINTON AVE N,
Operation Type:	
Pipeline Type:	

Pipe Material:
Fuel Category:
Health Impact:
Environment Impact:
Property Damage:
Service Interrupt:
Enforce Policy:
Public Relation:
Pipeline System:
PSIG:
Attribute Category:
Regulator Location:
Method Details:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
119	1 of 1	NNW/153.7	62.9 / 0.00	300 Parkdale Avenue Ottawa ON K1Y 1B4	EHS
Order No: 23021300330 Status: C Report Type: Standard Express Report Report Date: 13-FEB-23 Date Received: 13-FEB-23 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7309779 Y: 45.4034589			
120	1 of 18	SE/155.9	63.9 / 1.00	PARKDALE SUNOCO 390 PARKDALE AV OTTAWA ON K1Y1G6	PRT
Location ID: 11038 Type: retail Expiry Date: 1995-11-30 Capacity (L): 20000 Licence #: 0053946001					
120	2 of 18	SE/155.9	63.9 / 1.00	SUNOCO INC. 390 PARKDALE AVENUE (SWM) OTTAWA CITY ON K1Y 1G6	CA
Certificate #: 3-1265-96- Application Year: 96 Issue Date: 11/7/1996 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
120	3 of 18	SE/155.9	63.9 / 1.00	PARKDALE SUNOCO FUNFOOD 390 PARKDALE AVE OTTAWA ON K1Y 1G6	RST
Headcode: 01186800 Headcode Desc: SERVICE STATIONS-GASOLINE, OIL & NATURAL GAS Phone: List Name: Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
120	4 of 18	SE/155.9	63.9 / 1.00	Suncor service station<UNOFFICIAL> 390 Parkdale Ave Ottawa ON	SPL
Ref No: 0862-6PBUH5 Site No: Incident Dt: 4/28/2006 Year: Incident Cause: Incident Event: Contaminant Code: 12 Contaminant Name: GASOLINE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Not Anticipated Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 4/29/2006 Dt Document Closed: Incident Reason: Error- Operator error Site Name: Suncor service station<UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: Suncor- 10 L gas to pad, 1L to cb, customer overfill Contaminant Qty: 10 L Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: 390 Parkdale Ave Site District Office: Ottawa Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type: Other Motor Vehicle					
120	5 of 18	SE/155.9	63.9 / 1.00	1496030 ONTARIO INC 390 PARKDALE AV OTTAWA ON K1Y 1G6	FSTH
License Issue Date: 11/10/2008 11:42:00 AM Tank Status: Licensed Tank Status As Of: December 2008 Operation Type: Retail Fuel Outlet Facility Type: Gasoline Station - Self Serve --Details-- Status: Active Year of Installation: 1996 Corrosion Protection: Capacity: 50000 Tank Fuel Type: Liquid Fuel Double Wall UST - Gasoline Status: Active Year of Installation: 1996 Corrosion Protection: Capacity: 25000 Tank Fuel Type: Liquid Fuel Double Wall UST - Gasoline Status: Active Year of Installation: 1996 Corrosion Protection: Capacity: 25000 Tank Fuel Type: Liquid Fuel Double Wall UST - Gasoline					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
120	6 of 18	SE/155.9	63.9 / 1.00	SUNCOR ENERGY PRODUCTS PARTNERSHIP 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	FST
Instance No: 64524976 Status: Cont Name: Instance Type: FS Liquid Fuel Tank Item: Item Description: FS Liquid Fuel Tank Tank Type: Double Wall UST Install Date: 4/18/2012 2:49:33 PM Install Year: 2009 Years in Service: Model: NULL Description: Capacity: 50000 Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: FS Gasoline Station - Self Serve Facility Location: Device Installed Location: 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: Gasoline Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: SUNCOR ENERGY PRODUCTS PARTNERSHIP Item: FS LIQUID FUEL TANK					
120	7 of 18	SE/155.9	63.9 / 1.00	SUNCOR ENERGY PRODUCTS PARTNERSHIP 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	FST
Instance No: 64524975 Status: Cont Name: Instance Type: FS Liquid Fuel Tank Item: Item Description: FS Liquid Fuel Tank Tank Type: Double Wall UST Install Date: 4/18/2012 2:49:33 PM Install Year: 2009 Years in Service: Model: NULL Description: Capacity: 50000 Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: FS Gasoline Station - Self Serve Facility Location: Device Installed Location: 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: SUNCOR ENERGY PRODUCTS PARTNERSHIP Item: FS LIQUID FUEL TANK					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
120	8 of 18	SE/155.9	63.9 / 1.00	PARKDALE SUNOCO FUNFOOD 390 PARKDALE AVE OTTAWA ON K1Y1G6	RST

Headcode: 01186800
Headcode Desc: SERVICE STATIONS GASOLINE OIL & NATURAL
Phone: 6137291091
List Name:
Description:

120	9 of 18	SE/155.9	63.9 / 1.00	6205429 CANADA INC 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11477178	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	NULL
Instance ID:		Facility Location:	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA
Instance Type:		Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	7/19/2000 8:15:15 PM	Fuel Type 2:	NULL
Instance Install Dt:	5/22/2009	Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank	Panam Related:	NULL
Manufacturer:	NULL	Panam Venue Nm:	NULL
Model:	NULL	External Identifier:	NULL
Serial No:	NULL	Item:	
ULC Standard:	NULL	Piping Steel:	
Quantity:	1	Piping Galvanized:	
Unit of Measure:	EA	Tank Single Wall St:	
Overfill Prot Type:	NULL	Piping Underground:	
Creation Date:	7/5/2009 1:25:34 AM	Tank Underground:	
Next Periodic Str DT:	NULL	Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL		
TSSAMax Hazard Rank 1:	NULL		
TSSA Risk Based Periodic Yn:	NULL		
TSSA Volume of Directives:	NULL		
TSSA Periodic Exempt:	NULL		
TSSA Statutory Interval:	NULL		
TSSA Recd Insp Interva:	NULL		
TSSA Recd Tolerance:	NULL		
TSSA Program Area:	NULL		
TSSA Program Area 2:	NULL		
Description:	2009VBS		
Original Source:	EXP		
Record Date:	31-JUL-2020		

120	10 of 18	SE/155.9	63.9 / 1.00	6205429 CANADA INC 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11477172	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	NULL
Instance ID:		Facility Location:	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA
Instance Type:		Facility Type:	FS LIQUID FUEL TANK

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Instance Creation Dt: 7/19/2000 8:15:15 PM Instance Install Dt: 5/22/2009 Item Description: FS Liquid Fuel Tank Manufacturer: NULL Model: NULL Serial No: NULL ULC Standard: NULL Quantity: 1 Unit of Measure: EA Overfill Prot Type: NULL Creation Date: 7/5/2009 1:25:36 AM Next Periodic Str DT: NULL TSSA Base Sched Cycle 2: NULL TSSAMax Hazard Rank 1: NULL TSSA Risk Based Periodic Yn: NULL TSSA Volume of Directives: NULL TSSA Periodic Exempt: NULL TSSA Statutory Interval: NULL TSSA Recd Insp Interva: NULL TSSA Recd Tolerance: NULL TSSA Program Area: NULL TSSA Program Area 2: NULL Description: 2009VBS Original Source: EXP Record Date: 31-JUL-2020					
Fuel Type 2: NULL Fuel Type 3: NULL Panam Related: NULL Panam Venue Nm: NULL External Identifier: NULL Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source: FS Liquid Fuel Tank					

120	11 of 18	SE/155.9	63.9 / 1.00	6205429 CANADA INC 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	DTNK

**Delisted Expired Fuel Safety
Facilities**

Instance No: 11477187 Status: EXPIRED Instance ID:		Expired Date: Max Hazard Rank: NULL Facility Location: 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA			
Instance Type: Instance Creation Dt: 7/19/2000 8:15:15 PM Instance Install Dt: 5/22/2009 Item Description: FS Liquid Fuel Tank Manufacturer: NULL Model: NULL Serial No: NULL ULC Standard: NULL Quantity: 1 Unit of Measure: EA Overfill Prot Type: NULL Creation Date: 7/5/2009 1:25:38 AM Next Periodic Str DT: NULL TSSA Base Sched Cycle 2: NULL TSSAMax Hazard Rank 1: NULL TSSA Risk Based Periodic Yn: NULL TSSA Volume of Directives: NULL TSSA Periodic Exempt: NULL TSSA Statutory Interval: NULL TSSA Recd Insp Interva: NULL TSSA Recd Tolerance: NULL TSSA Program Area: NULL TSSA Program Area 2: NULL Description: 2009VBS Original Source: EXP Record Date: 31-JUL-2020		Facility Type: FS LIQUID FUEL TANK Fuel Type 2: NULL Fuel Type 3: NULL Panam Related: NULL Panam Venue Nm: NULL External Identifier: NULL Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source: FS Liquid Fuel Tank			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
120	12 of 18	SE/155.9	63.9 / 1.00	PARKDALE SUNOCO FUNFOOD 390 PARKDALE AVE OTTAWA ON K1Y1G6	RST
Headcode: 01186800 Headcode Desc: SERVICE STATIONS GASOLINE OIL & NATURAL GAS Phone: 6137291091 List Name: INFO-DIRECT(TM) BUSINESS FILE Description:					
120	13 of 18	SE/155.9	63.9 / 1.00	6205429 CANADA INC 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	FST
Instance No: 11477178 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Double Wall UST Install Date: 5/22/2009 Install Year: 1996 Years in Service: Model: NULL Description: Capacity: 25000 Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA					
Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: 6205429 CANADA INC Item: FS LIQUID FUEL TANK					
120	14 of 18	SE/155.9	63.9 / 1.00	SUNCOR ENERGY PRODUCTS PARTNERSHIP 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	FST
Instance No: 64961544 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Double Wall UST Install Date: 4/6/2020 8:29:06 AM Install Year: 2020 Years in Service: Model: NULL Description: Capacity: 50000 Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protect:					
Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Facility Type:		FS Liquid Fuel Tank			
Parent Facility Type:					
Facility Location:					
Device Installed Location:		390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA			
<u>Liquid Fuel Tank Details</u>					
Overfill Protection:					
Owner Account Name:		SUNCOR ENERGY PRODUCTS PARTNERSHIP			
Item:		FS LIQUID FUEL TANK			

120	15 of 18	SE/155.9	63.9 / 1.00	390 PARKDALE AVE OTTAWA ON K1Y 1G6	DTNK

Delisted Fuel Storage Tank

Instance No:	9776462	Creation Date:	
Status:	Active	Overfill Prot Type:	
Instance Type:		Facility Location:	
Fuel Type:		Piping SW Steel:	0
Cont Name:		Piping SW Galvan:	0
Capacity:		Tanks SW Steel:	0
Tank Material:		Piping Underground:	2
Corrosion Prot:		No Underground:	2
Tank Type:		Max Hazard Rank:	
Install Year:		Max Hazard Rank 1:	
Facility Type:		Nxt Period Start Dt:	
Device Installed Loc:		Program Area 1:	
Fuel Type 2:		Program Area 2:	
Fuel Type 3:		Nxt Period Strt Dt 2:	
Item:	FS GASOLINE STATION - SELF SERVE	Risk Based Periodic:	
Item Description:		Vol of Directives:	
Model:		Years in Service:	
Description:		Created Date:	
Instance Creation Dt:		Federal Device:	
Instance Install Dt:		Periodic Exempt:	
Manufacturer:		Statutory Interval:	
Serial No:		Rcomnd Insp Interval:	
ULC Standard:		Recommended Toler:	
Quantity:		Panam Venue Name:	
Unit of Measure:		External Identifier:	
Parent Fac Type:			
TSSA Base Sched Cycle 1:			
TSSA Base Sched Cycle 2:			
Original Source:	FST		
Record Date:	31-MAY-2021		

120	16 of 18	SE/155.9	63.9 / 1.00	6205429 CANADA INC 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	FST

Instance No:	11477172	Manufacturer:	
Status:		Serial No:	
Cont Name:		Ulc Standard:	
Instance Type:		Quantity:	
Item:		Unit of Measure:	
Item Description:	FS Liquid Fuel Tank	Fuel Type:	Gasoline
Tank Type:	Double Wall UST	Fuel Type2:	NULL
Install Date:	5/22/2009	Fuel Type3:	NULL
Install Year:	1996	Piping Steel:	
Years in Service:		Piping Galvanized:	
Model:	NULL	Tanks Single Wall St:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description: Capacity: 50000 Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: 6205429 CANADA INC Item: FS LIQUID FUEL TANK					
120	17 of 18	SE/155.9	63.9 / 1.00	6205429 CANADA INC 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	FST
Instance No: 11477187 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Double Wall UST Install Date: 5/22/2009 Install Year: 1996 Years in Service: Model: NULL Description: Capacity: 25000 Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
<u>Liquid Fuel Tank Details</u>					
Overfill Protection: Owner Account Name: 6205429 CANADA INC Item: FS LIQUID FUEL TANK					
120	18 of 18	SE/155.9	63.9 / 1.00	SUNCOR ENERGY PRODUCTS PARTNERSHIP 390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA ON	FST
Instance No: 64961545 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Double Wall UST Install Date: 4/6/2020 8:29:06 AM Install Year: 2020 Years in Service: Model: NULL Description: Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: Gasoline Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Capacity:	65000			No Underground:	
Tank Material:	Fiberglass (FRP)			Panam Related:	
Corrosion Protect:	Fiberglass			Panam Venue:	
Overfill Protect:					
Facility Type:	FS Liquid Fuel Tank				
Parent Facility Type:					
Facility Location:					
Device Installed Location:	390 PARKDALE AVE OTTAWA K1Y 1G6 ON CA				

Liquid Fuel Tank Details

Overfill Protection:
Owner Account Name: SUNCOR ENERGY PRODUCTS PARTNERSHIP
Item: FS LIQUID FUEL TANK

121	1 of 1	WSW/156.2	63.9 / 1.00	6 HINTON AVE. Ottawa ON	WWIS
Well ID:	7126434			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	29-Jul-2009 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z100300			Contractor:	7241
Tag:	A087223			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/712\7126434.pdf

Additional Detail(s) (Map)

Well Completed Date: 2009/07/05
Year Completed: 2009
Depth (m): 4.572
Latitude: 45.4016493659435
Longitude: -75.7324053075195
Path: 712\7126434.pdf

Bore Hole Information

Bore Hole ID:	1002578944	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442680.00
Code OB Desc:		North83:	5027831.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	05-Jul-2009 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002638156			
Layer:		2			
Color:		2			
General Color:		GREY			
Mat1:		21			
Most Common Material:		GRANITE			
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		5.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002638155			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		01			
Most Common Material:		FILL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		05			
Mat3 Desc:		CLAY			
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002638158			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002638159			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1002638160			
Layer:		3			
Plug From:		4.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002638165			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002638154			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002638162			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1002638163			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.25			
<u>Water Details</u>					
Water ID:		1002638161			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1002638157			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1002578944			Tag No:	A087223
Depth M:	4.572			Contractor:	7241
Year Completed:	2009			Path:	712\7126434.pdf
Well Completed Dt:	2009/07/05			Latitude:	45.4016493659435
Audit No:	Z100300			Longitude:	-75.7324053075195

122	1 of 1	SSE/156.7	63.9 / 1.00	1195 WELLINGTON ST W Ottawa ON	WWIS
Well ID:	7232122			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	21-Nov-2014 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z186907			Contractor:	7241
Tag:	A157947			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):					

Additional Detail(s) (Map)

Well Completed Date: 2014/10/16
 Year Completed: 2014
 Depth (m): 5.18
 Latitude: 45.4007835863052
 Longitude: -75.7298514389801
 Path:

Bore Hole Information

Bore Hole ID:	1005229367	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442879.00
Code OB Desc:		North83:	5027733.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	16-Oct-2014 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005431444			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		3.6600000858306885			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005431443			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:					
Most Common Material:					
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005431445			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		3.6600000858306885			
Formation End Depth:		5.179999828338623			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005431453			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005431454			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005431455			
Layer:		3			
Plug From:		1.5199999809265137			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005431452			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005431442			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005431448			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005431449			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.130000114440918			
Screen End Depth:		5.179999828338623			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1005431447			
Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind Code: Kind: Water Found Depth: Water Found Depth UOM:					
		m			
<u>Hole Diameter</u>					
Hole ID:		1005431446			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		5.179999828338623			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1005229367			Tag No:	A157947
Depth M:	5.18			Contractor:	7241
Year Completed:	2014			Path:	723\7232122.pdf
Well Completed Dt:	2014/10/16			Latitude:	45.4007835863052
Audit No:	Z186907			Longitude:	-75.7298514389801
123	1 of 21	NNW/157.0	62.9 / 0.00	M O M PRINTING 300 PARKDALE AVE OTTAWA ON K1Y 1G2	SCT
Established:	1963				
Plant Size (ft²):	0				
Employment:	132				
--Details--					
Description:	COMMERCIAL PRINTING, LITHOGRAPHIC				
SIC/NAICS Code:	2752				
Description:	COMMERCIAL PRINTING, NOT ELSEWHERE CLASSIFIED				
SIC/NAICS Code:	2759				
123	2 of 21	NNW/157.0	62.9 / 0.00	ST-JOSEPH M.O.M. PRINTING 300 Parkdale Ave Ottawa ON K1Y 1G2	SCT
Established:	1963				
Plant Size (ft²):	58000				
Employment:	150				
--Details--					
Description:	Quick Printing				
SIC/NAICS Code:	323114				
Description:	Digital Printing				
SIC/NAICS Code:	323115				
Description:	Other Printing				
SIC/NAICS Code:	323119				
123	3 of 21	NNW/157.0	62.9 / 0.00	M.O.M. PRINTING 300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON0272300 SIC Code: 2819 SIC Description: OTHER COMM. PRINTING Approval Years: 86,87,88,89 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
123	4 of 21	NNW/157.0	62.9 / 0.00	M.O.M. PRINTING 300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	GEN
Generator No: ON0272300 SIC Code: 2819 SIC Description: OTHER COMM. PRINTING Approval Years: 90,97,98,99,00,01 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
123	5 of 21	NNW/157.0	62.9 / 0.00	M.O.M. PRINTING 25-205 300 PARKDALE AVENUE OTTAWA ON K1Y 1G2	GEN
Generator No: ON0272300 SIC Code: 2819 SIC Description: OTHER COMM. PRINTING Approval Years: 92,93,94,95,96 PO Box No: Country:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
123	6 of 21	NNW/157.0	62.9 / 0.00	M.O.M. PRINTING 300 Parkdale Ave Ottawa ON K1Y 1G2	GEN
Generator No: ON0272300 SIC Code: SIC Description: Approval Years: 02,03,04 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
123	7 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Crop. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No: ON9092863 SIC Code: 811210 SIC Description: Electronic & Precision Equipment R&M Approval Years: 03,04,05,06,07,08 PO Box No: Country: Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
123	8 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Corp. 300 Parkdale Ave Ottawa ON K1Y 1G2	SCT
Established:		01-AUG-01			
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:		Measuring, Medical and Controlling Devices Manufacturing			
SIC/NAICS Code:		334512			
Description:		Measuring, Medical and Controlling Devices Manufacturing			
SIC/NAICS Code:		334512			
123	9 of 21	NNW/157.0	62.9 / 0.00	300 Parkdale Avenue Ottawa ON K1Y 1G2	EHS
Order No:	20061030008			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	11/7/2006			Search Radius (km):	0.35
Date Received:	10/30/2006			X:	-75.730856
Previous Site Name:				Y:	45.403412
Lot/Building Size:					
Additional Info Ordered:	Title Search				
123	10 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Crop. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No:	ON9092863				
SIC Code:	811210				
SIC Description:	Electronic and Precision Equipment Repair and Maintenance				
Approval Years:	2009				
PO Box No:					
Country:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
123	11 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Crop. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No: ON9092863 SIC Code: 811210 SIC Description: Electronic and Precision Equipment Repair and Maintenance Approval Years: 2010 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
123	12 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Crop. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No: ON9092863 SIC Code: 811210 SIC Description: Electronic and Precision Equipment Repair and Maintenance Approval Years: 2011 PO Box No: Country: Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>123</u>	13 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Corp. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No:		ON9092863			
SIC Code:		811210			
SIC Description:		ELECTRONIC AND PRECISION EQUIPMENT REPAIR AND MAINTENANCE			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Lorie Mills			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		2241061 Ext.229			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>123</u>	14 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Corp. 300 Parkdale Ave.	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ottawa ON K1Y 1G2					
Generator No:		ON9092863			
SIC Code:		811210			
SIC Description:		ELECTRONIC AND PRECISION EQUIPMENT REPAIR AND MAINTENANCE			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Lorie Mills			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		2241061 Ext.229			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
123	15 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Corp. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No:		ON9092863			
SIC Code:		811210			
SIC Description:		ELECTRONIC AND PRECISION EQUIPMENT REPAIR AND MAINTENANCE			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Lorie Mills			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		2241061 Ext.229			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		121 ALKALINE WASTES - HEAVY METALS			
123	16 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Corp. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No:		ON9092863			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
Waste Class:		113 C			
Waste Class Name:		Acid solutions - containing other metals and non-metals			
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
Waste Class:		148 I			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		212 B			
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 B			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 C			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
123	17 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Corp. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No:		ON9092863			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
Waste Class:		263 B			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		148 I			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
Waste Class:		113 C			
Waste Class Name:		Acid solutions - containing other metals and non-metals			
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		212 B			
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		263 C			
Waste Class Name:		Misc. waste organic chemicals			
123	18 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Corp. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No:		ON9092863			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		113 C			
Waste Class Name:		Acid solutions - containing other metals and non-metals			
Waste Class:		212 B			
Waste Class Name:		Aliphatic solvents and residues			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		331 I Waste compressed gases including cylinders			
Waste Class: Waste Class Name:		263 B Misc. waste organic chemicals			
Waste Class: Waste Class Name:		263 A Misc. waste organic chemicals			
Waste Class: Waste Class Name:		121 C Alkaline slutions - containing heavy metals			
Waste Class: Waste Class Name:		263 I Misc. waste organic chemicals			
Waste Class: Waste Class Name:		112 C Acid solutions - containing heavy metals			
Waste Class: Waste Class Name:		263 C Misc. waste organic chemicals			
Waste Class: Waste Class Name:		148 I Misc. wastes and inorganic chemicals			

123	19 of 21	NNW/157.0	62.9 / 0.00	Waste Connections of Canada Inc. as general partner for and on behalf of Ridge (Chatham) Holdings L.P. 300 Parkdale Ave Ottawa ON	SPL
Ref No:	6468-BNBSEE			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	2020/04/03			Health/Env Conseq:	3 - Minor Health Corporation
Year:				Client Type:	Unknown / N/A
Incident Cause:				Sector Type:	
Incident Event:	Leak/Break			Agency Involved:	
Contaminant Code:	15			Nearest Watercourse:	
Contaminant Name:	HYDRAULIC OIL			Site Address:	300 Parkdale Ave
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:	n/a			Site Region:	Eastern
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Land			Northing:	5028074.22
MOE Response:	No			Easting:	442786.3
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	Map
MOE Reported Dt:	2020/04/03			Site Map Datum:	
Dt Document Closed:	2020/07/17			SAC Action Class:	Land Spills
Incident Reason:	Equipment Failure			Source Type:	Motor Vehicle
Site Name:	Asphalt lot<UNOFFICIAL>				
Site County/District:					
Municipality No:					
Site Geo Ref Meth:	10 -100 metres eg. Topographic Map				
Incident Summary:	Waste Connections: 40L hydraulic oil to asphalt, cleaned				
Contaminant Qty:	40 L				

123	20 of 21	NNW/157.0	62.9 / 0.00	Scintrex Trace Corp. 300 Parkdale Ave. Ottawa ON K1Y 1G2	GEN
Generator No: SIC Code: SIC Description:	ON9092863				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: As of Oct 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 112 C Waste Class Name: ACID WASTE - HEAVY METALS					
Waste Class: 263 B Waste Class Name: ORGANIC LABORATORY CHEMICALS					
Waste Class: 263 C Waste Class Name: ORGANIC LABORATORY CHEMICALS					
Waste Class: 263 A Waste Class Name: ORGANIC LABORATORY CHEMICALS					
Waste Class: 148 I Waste Class Name: INORGANIC LABORATORY CHEMICALS					
Waste Class: 263 I Waste Class Name: ORGANIC LABORATORY CHEMICALS					
Waste Class: 113 C Waste Class Name: ACID WASTE - OTHER METALS					
Waste Class: 331 I Waste Class Name: WASTE COMPRESSED GASES					
Waste Class: 121 C Waste Class Name: ALKALINE WASTES - HEAVY METALS					
Waste Class: 212 B Waste Class Name: ALIPHATIC SOLVENTS					
123	21 of 21	NNW/157.0	62.9 / 0.00	300 Parkdale Avenue Ottawa ON K1Y 1G2	EHS
Order No: 23010900169 Status: C Report Type: Standard Report Report Date: 12-JAN-23 Date Received: 09-JAN-23 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7312419 Y: 45.4034317					
124	1 of 1	WSW/157.1	63.9 / 1.00	6 HINTON AVE. Ottawa ON	WWIS
Well ID: 7126432 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 29-Jul-2009 00:00:00					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z100285			Contractor:	7241
Tag:	A086742			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/712\7126432.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2009/06/25			
Year Completed:		2009			
Depth (m):					
Latitude:		45.4014251712685			
Longitude:		-75.7322746362757			
Path:		712\7126432.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002578938			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442690.00
Code OB Desc:				North83:	5027806.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	25-Jun-2009 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1002638058				
Layer:	1				
Plug From:	0.0				
Plug To:	1.0				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1002638060				
Layer:	3				
Plug From:	6.0				
Plug To:	12.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002638059			
Layer:		2			
Plug From:		1.0			
Plug To:		6.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002638065			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002638055			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002638062			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		7.0			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1002638063			
Layer:		1			
Slot:		10			
Screen Top Depth:		7.0			
Screen End Depth:		12.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.25			
<u>Water Details</u>					
Water ID:		1002638061			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: 1002638057 Diameter: 3.25 Depth From: 0.0 Depth To: 12.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
Links					
Bore Hole ID: 1002578938 Depth M: Year Completed: 2009 Well Completed Dt: 2009/06/25 Audit No: Z100285					
Tag No: A086742 Contractor: 7241 Path: 712\7126432.pdf Latitude: 45.4014251712685 Longitude: -75.7322746362757					
125	1 of 1	SSE/162.7	63.9 / 1.00	1195 WELLINGTON ST W Ottawa ON	WWIS
Well ID: 7232120 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z186915 Tag: A169736 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 21-Nov-2014 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date: 2014/10/15 Year Completed: 2014 Depth (m): 4.88 Latitude: 45.4007204190923 Longitude: -75.7298761802231 Path:					
Bore Hole Information					
Bore Hole ID: 1005229361 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 15-Oct-2014 00:00:00 Remarks:					
Elevation: Elevrc: Zone: 18 East83: 442877.00 North83: 5027726.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005431402			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		3.6600000858306885			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005431403			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		3.6600000858306885			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005431401			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:					
Most Common Material:					
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1005431411			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005431413			
Layer:		3			
Plug From:		1.5199999809265137			
Plug To:		4.800000190734863			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005431412			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1005431410			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1005431400			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1005431406			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1005431407			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		4.880000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1005431405			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005431404			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		4.880000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:		1005229361		Tag No:	A169736
Depth M:		4.88		Contractor:	7241
Year Completed:		2014		Path:	723\7232120.pdf
Well Completed Dt:		2014/10/15		Latitude:	45.4007204190923
Audit No:		Z186915		Longitude:	-75.7298761802231
126	1 of 3	E/164.2	62.9 / 0.00	25 Grant Street Ottawa ON K1Y 2W8	EHS
Order No:		20200107181		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		10-JAN-20		Search Radius (km): .25	
Date Received:		07-JAN-20		X: -75.7284336	
Previous Site Name:				Y: 45.401964	
Lot/Building Size:					
Additional Info Ordered:					
126	2 of 3	E/164.2	62.9 / 0.00	25 Grant Street Ottawa ON K1Y 2W8	EHS
Order No:		20200107181		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		10-JAN-20		Search Radius (km): .25	
Date Received:		07-JAN-20		X: -75.7284336	
Previous Site Name:				Y: 45.401964	
Lot/Building Size:					
Additional Info Ordered:					
126	3 of 3	E/164.2	62.9 / 0.00	25 Grant Street Ottawa ON K1Y 2W8	EHS
Order No:		20200107181		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		10-JAN-20		Search Radius (km): .25	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Received: 07-JAN-20				X: -75.7284336	
Previous Site Name:				Y: 45.401964	
Lot/Building Size:					
Additional Info Ordered:					
127	1 of 1	NNE/165.7	61.9 / -1.00	PRIVATE RESIDENCE 20 PINEHURST AVE. FURNACE OIL TANK OTTAWA CITY ON K1Y 1K3	SPL
Ref No: 60045				Discharger Report:	
Site No:				Material Group:	
Incident Dt: 11/21/1991				Health/Env Conseq:	
Year:				Client Type:	
Incident Cause: VALVE/FITTING LEAK OR FAILURE				Sector Type:	
Incident Event:				Agency Involved: WORKS DEPT, MCCR.	
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact: NOT ANTICIPATED				Site Municipality: OTTAWA CITY	
Nature of Impact: Surface Water Pollution				Site Lot:	
Receiving Medium: WATER				Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt: 11/21/1991				Site Map Datum:	
Dt Document Closed:				SAC Action Class:	
Incident Reason: EQUIPMENT FAILURE				Source Type:	
Site Name:					
Site County/District:					
Municipality No: 20101					
Site Geo Ref Meth:					
Incident Summary: PRIVATE RESIDENCE-FURNACE OIL LEAK IN THE BASEMENT & INTO DRAIN.					
Contaminant Qty:					
128	1 of 1	WSW/166.0	63.9 / 1.00	7 MINTON AVE OTTAWA ON	WWIS
Well ID: 7192835				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st: Monitoring and Test Hole				Data Entry Status:	
Use 2nd: 0				Data Src:	
Final Well Status: Test Hole				Date Received: 04-Dec-2012 00:00:00	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: Z157157				Contractor: 7241	
Tag: A135054				Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: NEPEAN TOWNSHIP					
Site Info:					
PDF URL (Map):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2012/11/14			
Year Completed:		2012			
Depth (m):		6.1			
Latitude:		45.4014781096132			
Longitude:		-75.732441427059			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1004215641			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	442677.00
Code OB Desc:				North83:	5027812.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	14-Nov-2012 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004544748				
Layer:	2				
Color:	6				
General Color:	BROWN				
Mat1:	28				
Most Common Material:	SAND				
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	85				
Mat3 Desc:	SOFT				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	1.5199999809265137				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004544747				
Layer:	1				
Color:	6				
General Color:	BROWN				
Mat1:	02				
Most Common Material:	TOPSOIL				
Mat2:	85				
Mat2 Desc:	SOFT				
Mat3:	77				
Mat3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	0.3100000023841858				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004544749			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004544760			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004544759			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004544758			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004544757			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004544746			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 1004544753					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 3.0999999046325684					
Casing Diameter: 4.050000190734863					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1004544754					
Layer: 1					
Slot: 10					
Screen Top Depth: 3.0999999046325684					
Screen End Depth: 6.099999904632568					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 4.820000171661377					
<u>Water Details</u>					
Water ID: 1004544752					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1004544750					
Diameter: 11.430000305175781					
Depth From: 0.0					
Depth To: 2.130000114440918					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1004544751					
Diameter: 7.619999885559082					
Depth From: 2.130000114440918					
Depth To: 6.099999904632568					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>Links</u>					
Bore Hole ID:	1004215641			Tag No:	A135054
Depth M:	6.1			Contractor:	7241
Year Completed:	2012			Path:	719\7192835.pdf
Well Completed Dt:	2012/11/14			Latitude:	45.4014781096132
Audit No:	Z157157			Longitude:	-75.732441427059
129	1 of 2	SE/167.3	63.9 / 1.00	PRIVATE OWNER 395 PARKDALE TRANSPORT TRUCK (CARGO) OTTAWA ON K1Y 4V4	SPL

416 erisinfo.com | Environmental Risk Information Services Order No: 23030600564

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	OTTAWA-CARLETON
PDF URL (Map):					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: Path:					
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:				Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	 <

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:					
Most Common Material:					
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005431417			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		3.66000000858306885			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005431425			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005431426			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005431427			
Layer:		3			
Plug From:		1.5199999809265137			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1005431424			
Method Construction Code:		D			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1005431414				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1005431420				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0.0				
Depth To:	1.8300000429153442				
Casing Diameter:	4.03000020980835				
Casing Diameter UOM:	cm				
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1005431421				
Layer:	1				
Slot:	10				
Screen Top Depth:	1.8300000429153442				
Screen End Depth:	4.880000114440918				
Screen Material:	5				
Screen Depth UOM:	m				
Screen Diameter UOM:	cm				
Screen Diameter:	4.820000171661377				
<u>Water Details</u>					
Water ID:	1005431419				
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
<u>Hole Diameter</u>					
Hole ID:	1005431418				
Diameter:	8.25				
Depth From:	0.0				
Depth To:	4.880000114440918				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Links</u>					
Bore Hole ID:	1005229364			Tag No:	A169735
Depth M:	4.88			Contractor:	7241
Year Completed:	2014			Path:	723\7232121.pdf
Well Completed Dt:	2014/10/15			Latitude:	45.400684906681
Audit No:	Z186906			Longitude:	-75.729799059319

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
131	1 of 1	SW/172.8	64.9 / 2.00	84 Hinton Ave N Ottawa ON K1Y0Z8	EHS
Order No: 20140402005		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Custom Report		Client Prov/State: ON			
Report Date: 07-APR-14		Search Radius (km): .25			
Date Received: 02-APR-14		X: -75.731695			
Previous Site Name:		Y: 45.400796			
Lot/Building Size:					
Additional Info Ordered: Topographic Maps					
132	1 of 3	SSE/173.5	63.9 / 1.00	1195 Wellington Street West Ottawa ON K1Y 2Z6	EHS
Order No: 21082400227		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Standard Report		Client Prov/State: ON			
Report Date: 27-AUG-21		Search Radius (km): .25			
Date Received: 24-AUG-21		X: -75.7299216			
Previous Site Name:		Y: 45.4006093			
Lot/Building Size:					
Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
132	2 of 3	SSE/173.5	63.9 / 1.00	1195 Wellington Street West Ottawa ON K1Y 2Z6	EHS
Order No: 21082400227		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Standard Report		Client Prov/State: ON			
Report Date: 27-AUG-21		Search Radius (km): .25			
Date Received: 24-AUG-21		X: -75.7299216			
Previous Site Name:		Y: 45.4006093			
Lot/Building Size:					
Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
132	3 of 3	SSE/173.5	63.9 / 1.00	1195 Wellington Street West Ottawa ON K1Y 2Z6	EHS
Order No: 21082400227		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Standard Report		Client Prov/State: ON			
Report Date: 27-AUG-21		Search Radius (km): .25			
Date Received: 24-AUG-21		X: -75.7299216			
Previous Site Name:		Y: 45.4006093			
Lot/Building Size:					
Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
133	1 of 1	S/175.0	63.9 / 1.00	VIC'S HARDROCK CYCLE 1203 WELLINGTON STREET OTTAWA ON K1Y 2Z8	GEN
Generator No: ON1974700					
SIC Code: 6542					
SIC Description: BICYCLE SHOPS					
Approval Years: 95,96,97,98,99,00,01					
PO Box No:					
Country:					
Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>134</u>	1 of 2	SSE/175.3	63.9 / 1.00	MARQUARDT PRINTING 1195 WELLINGTON STREET OTTAWA ON K1Y 2Z6	GEN
Generator No:		ON1860500			
SIC Code:		2811			
SIC Description:		BUSINESS FORMS PRINT			
Approval Years:		94,95,96,97,98,99,00,01			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>134</u>	2 of 2	SSE/175.3	63.9 / 1.00	1195 Wellington St W Ottawa ON K1Y2Z6	EHS
Order No:		20140708004		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		11-JUL-14		Search Radius (km):	.25
Date Received:		08-JUL-14		X:	-75.729894
Previous Site Name:				Y:	45.400598
Lot/Building Size:					
Additional Info Ordered:					
<u>135</u>	1 of 1	ESE/176.8	62.9 / 0.00	Merge Business Solutions 1165 Wellington St W Ottawa ON K1Y 2Y9	SCT
Established:		2004			
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:		Quick Printing			
SIC/NAICS Code:		323114			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		Digital Printing			
SIC/NAICS Code:		323115			
Description:		Other Printing			
SIC/NAICS Code:		323119			

136	1 of 1	WSW/179.0	63.9 / 1.00	7 HINTON AVE OTTAWA ON	WWIS	
Well ID:		7192834		Flowing (Y/N):		
Construction Date:				Flow Rate:		
Use 1st:		Monitoring and Test Hole		Data Entry Status:		
Use 2nd:		0		Data Src:		
Final Well Status:		Test Hole		Date Received:	04-Dec-2012 00:00:00	
Water Type:				Selected Flag:	TRUE	
Casing Material:				Abandonment Rec:		
Audit No:		Z157158		Contractor:	7241	
Tag:		A135055		Form Version:	7	
Constructn Method:				Owner:		
Elevation (m):				County:	OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:		
Depth to Bedrock:				Concession:		
Well Depth:				Concession Name:		
Overburden/Bedrock:				Easting NAD83:		
Pump Rate:				Northing NAD83:		
Static Water Level:				Zone:		
Clear/Cloudy:				UTM Reliability:		
Municipality:		NEPEAN TOWNSHIP				
Site Info:						

PDF URL (Map):

Additional Detail(s) (Map)

Well Completed Date: 2012/11/17
Year Completed: 2012
Depth (m): 6.1
Latitude: 45.4014948815909
Longitude: -75.7326333056294
Path:

Bore Hole Information

Bore Hole ID:	1004215638	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	442662.00
Code OB Desc:		North83:	5027814.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	17-Nov-2012 00:00:00	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Loc Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1004544732			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		02			
Most Common Material:		TOPSOIL			
Mat2:		85			
Mat2 Desc:		SOFT			
Mat3:		77			
Mat3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004544734			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		73			
Mat3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004544733			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004544744			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1004544745			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004544743			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004544742			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1004544731			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004544738			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1004544739			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
 <u>Water Details</u>					
Water ID:		1004544737			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004544736			
Diameter:		7.619999885559082			
Depth From:		2.130000114440918			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1004544735			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:	1004215638			Tag No:	A135055
Depth M:	6.1			Contractor:	7241
Year Completed:	2012			Path:	719\7192834.pdf
Well Completed Dt:	2012/11/17			Latitude:	45.4014948815909
Audit No:	Z157158			Longitude:	-75.7326333056294
137	1 of 1	WSW/180.2	63.9 / 1.00	71 Holland Ottawa ON	EHS
Order No:	20160316116			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Express Report			Client Prov/State:	ON
Report Date:	16-MAR-16			Search Radius (km):	.25
Date Received:	16-MAR-16			X:	-75.732607
Previous Site Name:				Y:	45.401427
Lot/Building Size:					
Additional Info Ordered:	City Directory				
138	1 of 2	NW/182.3	62.9 / 0.00	1 Hamilton Avenue North ottawa ON K1Y 1B5	EHS
Order No:	20050527006			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:				Client Prov/State:	ON
Report Date:	6/6/2005			Search Radius (km):	0.25
Date Received:	5/27/2005			X:	-75.731696
Previous Site Name:				Y:	45.403636
Lot/Building Size:					
Additional Info Ordered:					
138	2 of 2	NW/182.3	62.9 / 0.00	ONTARIO PETROLEUM PUMP 1 HAMILTON AVE N OTTAWA ON K1Y 1B5	GEN
Generator No:	ON8207850				
SIC Code:	541620				
SIC Description:	Environmental Consulting Services				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 05 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 221 Waste Class Name: LIGHT FUELS					
<u>139</u>	1 of 1	SE/183.9	63.9 / 1.00	Parkdale Ave. & Wellington St. Ottawa ON	SPL
Ref No: 2015-6G7JHK Site No: Incident Dt: 9/13/2005 Year: Incident Cause: Valve / Fitting Leak Or Failure Incident Event: Contaminant Code: Contaminant Name: GASOLINE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Not Anticipated Nature of Impact: Soil Contamination Receiving Medium: Land Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 9/13/2005 Dt Document Closed: Incident Reason: Equipment Failure Site Name: Sunoco Gas Station<UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: Spill of gasoline, at a Sunoco in Ottawa Contaminant Qty:					
Discharger Report: 0 Material Group: Oil Health/Env Conseq: Client Type: Sector Type: Unknown Agency Involved: Nearest Watercourse: Site Address: Site District Office: Ottawa Site Postal Code: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Spills to Land Source Type:					
<u>140</u>	1 of 1	SSE/185.8	63.9 / 1.00	Rexall Pharmacy Group Ltd. 1190 Wellington Street Ottawa ON K1Y 2Z5	GEN
Generator No: ON5868520 SIC Code: SIC Description: Approval Years: As of Oct 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
Waste Class:		261 A			
Waste Class Name:		PHARMACEUTICALS			
141	1 of 1	WSW/186.8	63.9 / 1.00	77 Holland Ave Ottawa ON K1Y 0Y1	EHS
Order No:	20130430005			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	06-MAY-13			Search Radius (km):	.25
Date Received:	30-APR-13			X:	0
Previous Site Name:				Y:	0
Lot/Building Size:					
Additional Info Ordered:					
142	1 of 1	SSE/187.4	63.9 / 1.00	Welldale Limited Partnership 1186-1194 Wellington Street West Ottawa ON K1Y 2Z1	GEN
Generator No:	ON5720964				
SIC Code:					
SIC Description:					
Approval Years:	As of Nov 2021				
PO Box No:					
Country:	Canada				
Status:	Registered				
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		221 L			
Waste Class Name:		Light fuels			
143	1 of 1	WSW/188.5	64.9 / 2.00	PRIVATE RESIDENCE 79 HOLLAND AVENUE FURNACE OIL TANK OTTAWA CITY ON K1Y 0Y1	SPL
Ref No:	243082			Discharger Report:	
Site No:				Material Group:	
Incident Dt:	10/23/2002			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	OTHER CONTAINER LEAK			Sector Type:	
Incident Event:				Agency Involved:	T.S.S.A. - F.S.B.
Contaminant Code:				Nearest Watercourse:	
Contaminant Name:				Site Address:	
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:	POSSIBLE			Site Municipality:	OTTAWA CITY
Nature of Impact:	Soil contamination			Site Lot:	
Receiving Medium:	LAND			Site Conc:	
Receiving Env:				Northing:	
MOE Response:				Easting:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Dt MOE Arvl on Scn: MOE Reported Dt: 10/23/2002 Dt Document Closed: Incident Reason: CORROSION Site Name: Site County/District: Municipality No: 20107 Site Geo Ref Meth: Incident Summary: PRIVATE RESIDENCE: 450L OF FUEL OIL TO FLOOR OF GRAVEL BASEMENT Contaminant Qty:					
Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
144	1 of 1	W/188.7	63.9 / 1.00	CCC476 45 Holland Ave. Ottawa ON K1Y 4S3	GEN
Generator No: ON5891121 SIC Code: 531120 SIC Description: Lessors of Non-Residential Buildings (except Mini-Warehouses) Approval Years: 07,08 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
145	1 of 1	WSW/189.1	64.9 / 2.00	Tomlinson Environmental Services Ltd 83 Holland Ave Ottawa ON	SPL
Ref No: 4486-B9USJB Site No: NA Incident Dt: 3/1/2019 Year: Incident Cause: Incident Event: Fire/Explosion Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 3/1/2019 Dt Document Closed: 3/4/2019 Incident Reason: Unknown / N/A Site Name: fire water<UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: Ottawa: fire water flooded basement to be pumped					
Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Corporation Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: 83 Holland Ave Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5027731 Easting: 442673 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Notifications Source Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Qty:					
146	1 of 1	E/190.5	62.9 / 0.00	1161 WELLINGTON ST OTTAWA ON	WWIS
Well ID:		7044709	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Not Used	Data Entry Status:		
Use 2nd:			Data Src:		
Final Well Status:		Observation Wells	Date Received:		14-Jun-2007 00:00:00
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z66218	Contractor:		7241
Tag:		A056016	Form Version:		3
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7044709.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		2007/05/04			
Year Completed:		2007			
Depth (m):		6			
Latitude:		45.4018568242085			
Longitude:		-75.7281147353548			
Path:		704\7044709.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11767195	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		18
Code OB:			East83:		443016.00
Code OB Desc:			North83:		5027851.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		3
Date Completed:		04-May-2007 00:00:00	UTMRC Desc:		margin of error : 10 - 30 m
Remarks:			Location Method:		wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		933103733			
Laver:		3			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		2			
General Color:		GREY			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		91			
Mat3 Desc:		WATER-BEARING			
Formation Top Depth:		4.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933103732			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		06			
Most Common Material:		SILT			
Mat2:		05			
Mat2 Desc:		CLAY			
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.6000000238418579			
Formation End Depth:		4.0			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		933103731			
Layer:		1			
Color:		6			
General Color:		BROWN			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:		28			
Mat2 Desc:		SAND			
Mat3:		01			
Mat3 Desc:		FILL			
Formation Top Depth:		0.0			
Formation End Depth:		0.6000000238418579			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933320683			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933320685			
Layer:		3			
Plug From:		2.4000000953674316			
Plug To:		6.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933320684			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		2.4000000953674316			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		967044709			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11774885			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930900580			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0			
Casing Diameter:		3.799999952316284			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933424864			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		6.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.300000190734863			
<u>Hole Diameter</u>					
Hole ID:		11853812			
Diameter:		10.0			
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID: 11767195 Depth M: 6 Year Completed: 2007 Well Completed Dt: 2007/05/04 Audit No: Z66218 Tag No: A056016 Contractor: 7241 Path: 704\7044709.pdf Latitude: 45.4018568242085 Longitude: -75.7281147353548					
147	1 of 7	ENE/191.2	61.9 / -1.00	OLIVER, MANGIONE, MCCALLA & ASSOC. LTD. 154 COLONNADE RD. SOUTH NEPEAN ON K2E 7J5	GEN
Generator No: ON1231100 SIC Code: 7752 SIC Description: ENGINEER OFFICES Approval Years: 89 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 122 Waste Class Name: ALKALINE WASTES - OTHER METALS					
147	2 of 7	ENE/191.2	61.9 / -1.00	OLIVER, MANGIONE, MCCALLA AND ASSOCIATES LIMITED 154 COLONNADE ROAD SOUTH NEPEAN ON K2E 7J5	GEN
Generator No: ON1231100 SIC Code: 7752 SIC Description: ENGINEER OFFICES Approval Years: 92,93,97,98 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 122 Waste Class Name: ALKALINE WASTES - OTHER METALS					
147	3 of 7	ENE/191.2	61.9 / -1.00	OLIVER, MANGIONE, MCCALLA & ASSOC.29- 465 LTD. 154 COLONNADE RD. SOUTH NEPEAN ON K2E 7J5	GEN
Generator No: ON1231100 SIC Code: 7752 SIC Description: ENGINEER OFFICES Approval Years: 94,95,96 PO Box No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			

147	4 of 7	ENE/191.2	61.9 / -1.00	OLIVER, MANGIONE, MCCALLA AND 154 COLONNADE ROAD SOUTH NEPEAN ON K2E 7J5	GEN
Generator No:		ON1231100			
SIC Code:		7752			
SIC Description:		ENGINEER OFFICES			
Approval Years:		99,00,01			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			

147	5 of 7	ENE/191.2	61.9 / -1.00	154 Colonnade Rd S Nepean ON K1Y 2R7	EHS
Order No:		21101200217		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	
Report Date:		15-OCT-21		Search Radius (km):	
Date Received:		12-OCT-21		X:	
Previous Site Name:				Y:	
Lot/Building Size:					
Additional Info Ordered:					

147	6 of 7	ENE/191.2	61.9 / -1.00	154 Colonnade Rd S Nepean ON K1Y 2R7	EHS
Order No:		21101200217		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	
Report Date:		15-OCT-21		Search Radius (km):	
Date Received:		12-OCT-21		X:	
Previous Site Name:				Y:	
Lot/Building Size:					
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
147	7 of 7	ENE/191.2	61.9 / -1.00	154 Colonnade Rd S Nepean ON K1Y 2R7	EHS
Order No: 21101200217		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Standard Report		Client Prov/State: ON			
Report Date: 15-OCT-21		Search Radius (km): .25			
Date Received: 12-OCT-21		X: -75.7284689			
Previous Site Name:		Y: 45.4030476			
Lot/Building Size:					
Additional Info Ordered:					
148	1 of 1	SW/191.4	64.7 / 1.85	85 HOLLAND AVENUE OTTAWA ON K1Y 0Y1	HINC
External File Num:		FS INC 0704-01839			
Fuel Occurrence Type:		Fire			
Date of Occurrence:		4/21/2007			
Fuel Type Involved:		Regulated Fuel Not Involved			
Status Desc:		Completed - No Action Required			
Job Type Desc:		Incident/Near-Miss Occurrence (FS)			
Oper. Type Involved:		Commercial (e.g. restaurant, business unit, etc)			
Service Interruptions:		Yes			
Property Damage:		No			
Fuel Life Cycle Stage:		Utilization			
Root Cause:					
Reported Details:					
Fuel Category:		Unknown			
Occurrence Type:		Incident			
Affiliation:		Emergency Services (Fire, Police,etc)			
County Name:		Ottawa			
Approx. Quant. Rel:					
Nearby body of water:					
Enter Drainage Syst.:					
Approx. Quant. Unit:					
Environmental Impact:					
149	1 of 1	WNW/193.7	62.9 / 0.00	1560 Scott Street Ottawa ON K1Y	EHS
Order No: 22080900337		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Standard Report		Client Prov/State: ON			
Report Date: 12-AUG-22		Search Radius (km): .25			
Date Received: 09-AUG-22		X: -75.7324871			
Previous Site Name:		Y: 45.4031725			
Lot/Building Size:					
Additional Info Ordered:					
150	1 of 3	ESE/198.4	63.9 / 1.00	1161-1171 Wellington Ave Ottawa ON	EHS
Order No: 20070322011		Nearest Intersection:		Wellington & Parkdale Ave	
Status: C		Municipality:			
Report Type: CAN - Custom Report		Client Prov/State:			
Report Date: 3/30/2007		Search Radius (km): 0.25			
Date Received: 3/22/2007		X: -75.728347			
Previous Site Name:		Y: 45.401258			
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps And /or Site Plans			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
150	2 of 3	ESE/198.4	63.9 / 1.00	1161 Wellington St W Ottawa ON K1Y2Z1	EHS
Order No: 20150130067 Status: C Report Type: Custom Report Report Date: 05-FEB-15 Date Received: 30-JAN-15 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.728267 Y: 45.401296			
150	3 of 3	ESE/198.4	63.9 / 1.00	1161 Wellington St. W Ottawa ON	SPL
Ref No: 3862-BP6QVT Site No: NA Incident Dt: 2020/04/30 Year: Incident Cause: Incident Event: Leak/Break Contaminant Code: 15 Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: n/a Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: Land MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 2020/04/30 Dt Document Closed: Incident Reason: Equipment Failure Site Name: Hydraulic Oil to catchbasin & city street<UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: City of Ottawa: hyraulic oil to street & cb's - Wellington St. W Contaminant Qty: 1 n/a		Discharger Report: Material Group: Health/Env Conseq: 2 - Minor Environment Client Type: Sector Type: Miscellaneous Industrial Agency Involved: Nearest Watercourse: Site Address: 1161 Wellington St. W Site District Office: Ottawa Site Postal Code: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Northing: 5027787 Easting: 443025 Site Geo Ref Accu: Site Map Datum: SAC Action Class: Land Spills Source Type: Truck - Transport/Hauling			
151	1 of 2	NW/202.4	62.9 / 0.00	City of Ottawa Hamilton Avenue and Bullman Street Ottawa ON	CA
Certificate #: 3200-6AKNDM Application Year: 2005 Issue Date: 3/21/2005 Approval Type: Municipal and Private Sewage Works Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
151	2 of 2	NW/202.4	62.9 / 0.00	City of Ottawa Hamilton Avenue and Bullman Street Ottawa ON K2G 6J8	ECA
Approval No: 3200-6AKNDM Approval Date: 2005-03-21 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: City of Ottawa Address: Hamilton Avenue and Bullman Street Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/8688-6AGSJ2-14.pdf PDF Site Location:		MOE District: Ottawa City: Longitude: -75.7298 Latitude: 45.3968 Geometry X: Geometry Y:			
152	1 of 3	SSE/204.9	63.9 / 1.00	1188 Wellington St. W Ottawa ON K1Y 2Z5	EHS
Order No: 20200601182 Status: C Report Type: Standard Report Report Date: 04-JUN-20 Date Received: 01-JUN-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7294776 Y: 45.4004213			
152	2 of 3	SSE/204.9	63.9 / 1.00	1188 Wellington St. W Ottawa ON K1Y 2Z5	EHS
Order No: 20200601182 Status: C Report Type: Standard Report Report Date: 04-JUN-20 Date Received: 01-JUN-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7294776 Y: 45.4004213			
152	3 of 3	SSE/204.9	63.9 / 1.00	1188 Wellington St. W Ottawa ON K1Y 2Z5	EHS
Order No: 20200601182 Status: C Report Type: Standard Report Report Date: 04-JUN-20 Date Received: 01-JUN-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7294776 Y: 45.4004213			
153	1 of 2	SW/209.3	64.9 / 2.00	91 & 83 Holland Avenue Ottawa ON	EHS
Order No: 22041900119		Nearest Intersection:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Standard Report Report Date: 22-APR-22 Date Received: 19-APR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7321877 Y: 45.4006395					
153	2 of 2	SW/209.3	64.9 / 2.00	91 & 83 Holland Avenue Ottawa ON	EHS
Order No: 22041900119 Status: C Report Type: Standard Report Report Date: 22-APR-22 Date Received: 19-APR-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7321877 Y: 45.4006395					
154	1 of 1	ENE/209.5	61.9 / -1.00	OTTAWA CITY - PARKDALE AVE./SPENCER ST. OXFORD ST./HINCHEY ST. OTTAWA CITY ON	CA
Certificate #: 3-0970-91- Application Year: 91 Issue Date: 7/10/1991 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
155	1 of 4	SE/211.3	63.9 / 1.00	1156 WELLINGTON STREET WEST Ottawa ON	WWIS
Well ID: 7203873 Construction Date: Use 1st: Monitoring Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z171306 Tag: A142507 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 25-Jun-2013 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7328 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/720\7203873.pdf				
Additional Detail(s) (Map)					
Well Completed Date:	2013/04/30				
Year Completed:	2013				
Depth (m):	7.68				
Latitude:	45.4007008410333				
Longitude:	-75.7287131958914				
Path:	720\7203873.pdf				
Bore Hole Information					
Bore Hole ID:	1004377485		Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		
Code OB:			East83:		
Code OB Desc:			North83:		
Open Hole:			Org CS:		
Cluster Kind:			UTMRC:		
Date Completed:	30-Apr-2013 00:00:00		UTMRC Desc:		
Remarks:			Location Method:		
Loc Method Desc:	on Water Well Record		wwr		
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:	1004969010				
Layer:	2				
Color:	2				
General Color:	GREY				
Mat1:	26				
Most Common Material:	ROCK				
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:	7.679999828338623				
Formation End Depth UOM:	m				
Overburden and Bedrock					
Materials Interval					
Formation ID:	1004969011				
Layer:	3				
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		7.679999828338623			
Formation End Depth:					
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004969009			
Layer:	1				
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:					
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004969022			
Layer:	1				
Plug From:	0.0				
Plug To:	1.100000023841858				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004969023			
Layer:	2				
Plug From:	1.100000023841858				
Plug To:	3.299999952316284				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004969020			
Layer:	1				
Plug From:	0.0				
Plug To:	0.6899999976158142				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004969021			
Layer:	2				
Plug From:	0.6899999976158142				
Plug To:	1.7999999523162842				
Plug Depth UOM:	m				
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004969019			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004969008			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004969015			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.809999942779541			
Casing Diameter:		3.200000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Casing</u>					
Casing ID:		1004969016			
Layer:		2			
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:		1.25			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004969017			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.809999942779541			
Screen End Depth:		7.650000095367432			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1004969014			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004969012			
Diameter:		20.299999237060547			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To: 1.7999999523162842 Hole Depth UOM: m Hole Diameter UOM: cm <u>Hole Diameter</u> Hole ID: 1004969013 Diameter: 7.599999904632568 Depth From: 1.7999999523162842 Depth To: 7.650000095367432 Hole Depth UOM: m Hole Diameter UOM: cm <u>Links</u> Bore Hole ID: 1004377485 Depth M: 7.68 Year Completed: 2013 Well Completed Dt: 2013/04/30 Audit No: Z171306 Tag No: A142507 Contractor: 7328 Path: 720\7203873.pdf Latitude: 45.4007008410333 Longitude: -75.7287131958914					
155	2 of 4	SE/211.3	63.9 / 1.00	Doran Contractors Limited 1166 Wellington Stree West Ottawa ON K1V 8Y3	GEN
Generator No: ON8467703 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: <u>Detail(s)</u> Waste Class: 221 L Waste Class Name: Light fuels					
155	3 of 4	SE/211.3	63.9 / 1.00	1166 WELLINGTON ST Ottawa ON	WWIS
Well ID: 7315271 Construction Date: Use 1st: Use 2nd: Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: Z171349 Tag: A142507 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 27-Jul-2018 00:00:00 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7320 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level: Clear/Cloudy: Municipality: Site Info:			Zone: UTM Reliability:		
NEPEAN TOWNSHIP					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2018/05/09			
Year Completed:		2018			
Depth (m):					
Latitude:		45.4007008410333			
Longitude:		-75.7287131958914			
Path:					
Bore Hole Information					
Bore Hole ID:		1007217850		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		09-May-2018 00:00:00		UTMRC Desc:	
Remarks:				Location Method:	
Loc Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				wwr	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1007412059			
Layer:					
Color:					
General Color:					
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		m			
Annular Space/Abandonment					
Sealing Record					
Plug ID:		1007412066			
Layer:		2			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
Annular Space/Abandonment					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1007412065			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007412064			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007412058			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007412062			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007412063			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1007412061			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007412060			
Diameter:					
Depth From:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To: Hole Depth UOM: m Hole Diameter UOM: cm					
Links					
Bore Hole ID:	1007217850			Tag No:	A142507
Depth M:				Contractor:	7320
Year Completed:	2018			Path:	731\7315271.pdf
Well Completed Dt:	2018/05/09			Latitude:	45.4007008410333
Audit No:	Z171349			Longitude:	-75.7287131958914

155	4 of 4	SE/211.3	63.9 / 1.00	1166 Wellington Street W Ottawa ON	SPL
Ref No:	4138-BJEKVC			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	2019/11/30			Health/Env Conseq:	2 - Minor Environment
Year:				Client Type:	
Incident Cause:				Sector Type:	Miscellaneous Industrial
Incident Event:	Leak/Break			Agency Involved:	
Contaminant Code:	35			Nearest Watercourse:	
Contaminant Name:	NATURAL GAS (METHANE)			Site Address:	1166 Wellington Street W
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:	1075			Site Region:	Eastern
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Air			Northing:	
MOE Response:	No			Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	2019/11/30			Site Map Datum:	
Dt Document Closed:	2020/05/16			SAC Action Class:	TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill
Incident Reason:	Unknown / N/A			Source Type:	Unknown / N/A
Site Name:	five story commercial building under construction<UNOFFICIAL>				
Site County/District:					
Municipality No:					
Site Geo Ref Meth:					
Incident Summary:	TSSA 4 inch steel damage, made safe				
Contaminant Qty:	0 other - see incident description				

156	1 of 7	SSE/211.8	63.9 / 1.00	1190 Wellington Street Ottawa ON	SPL
Ref No:	0664-9U9PHB			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	3/2/2015			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:	Leak/Break			Sector Type:	
Incident Event:				Agency Involved:	
Contaminant Code:	38			Nearest Watercourse:	
Contaminant Name:	FREON R-22 (CFC)			Site Address:	1190 Wellington Street
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:	Air			Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:				Northing:	
MOE Response:	N			Easting:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Dt MOE Arvl on Scn: MOE Reported Dt: 3/3/2015 Dt Document Closed: Incident Reason: Unknown / N/A Site Name: Rexall Drug Store<UNOFFICIAL> Site Geo Ref Meth: Incident Summary: Rexall: R22 refrigerant to atm Contaminant Qty: 3.5 kg Site Geo Ref Accu: Site Map Datum: SAC Action Class: Air Spills - Gases and Vapours Source Type:					
156	2 of 7	SSE/211.8	63.9 / 1.00	Rexall Pharmacy Group Ltd. 1190 Wellington Street Ottawa ON K1Y 2Z5	GEN
Generator No: ON5868520 SIC Code: 446110 SIC Description: 446110 Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Erik Botines Choice of Contact: CO_ADMIN Phone No Admin: 905-502-5965 Ext. Contaminated Facility: No MHSW Facility: No					
Detail(s)					
Waste Class: 261 Waste Class Name: PHARMACEUTICALS Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
156	3 of 7	SSE/211.8	63.9 / 1.00	Pharma Plus Drugmarts Ltd 1190 Wellington Street Ottawa ON K1Y 2Z5	GEN
Generator No: ON5868520 SIC Code: 446110 SIC Description: 446110 Approval Years: 2015 PO Box No: Country: Canada Status: Co Admin: Erik Botines Choice of Contact: CO_ADMIN Phone No Admin: 905-502-5965 Ext. Contaminated Facility: No MHSW Facility: No					
Detail(s)					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
156	4 of 7	SSE/211.8	63.9 / 1.00	Pharma Plus Drugmarts Ltd 1190 Wellington Street Ottawa ON K1Y 2Z5	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON5868520 SIC Code: 446110 SIC Description: 446110 Approval Years: 2014 PO Box No: Country: Canada Status: Co Admin: Aaron Schrama Choice of Contact: CO_ADMIN Phone No Admin: 905-502-5965 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
156	5 of 7	SSE/211.8	63.9 / 1.00	Rexall Pharmacy Group Ltd. 1190 Wellington Street Ottawa ON K1Y 2Z5	GEN
Generator No: ON5868520 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 261 A Waste Class Name: Pharmaceuticals Waste Class: 312 P Waste Class Name: Pathological wastes					
156	6 of 7	SSE/211.8	63.9 / 1.00	Rexall Pharmacy Group Ltd. 1190 Wellington Street Ottawa ON K1Y 2Z5	GEN
Generator No: ON5868520 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name: 261 A Pharmaceuticals Waste Class: Waste Class Name: 312 P Pathological wastes					
156	7 of 7	SSE/211.8	63.9 / 1.00	Rexall Pharmacy Group Ltd. 1190 Wellington Street Ottawa ON K1Y 2Z5	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: ON5868520 As of Nov 2021 Canada Registered					
<u>Detail(s)</u>					
Waste Class: Waste Class Name: 312 P Pathological wastes Waste Class: Waste Class Name: 261 A Pharmaceuticals					
157	1 of 17	SE/212.9	63.9 / 1.00	ESSO PETROLEUM CANADA ESSO STATION AT 1186 WELLINGTON AT PARKDALE SERVICE STATION OTTAWA CITY ON K1Y 2Z5	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: Contaminant Qty: 68417 3/26/1992 UNDERGROUND TANK LEAK CONFIRMED Multi-media Pollution LAND 3/26/1992 CORROSION 20101 ESSO STATION - 3000 L OF FURNACE OIL TO GROUND FROM UNDERGROUND TANK. Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type: MCCR OTTAWA CITY					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
157	2 of 17	SE/212.9	63.9 / 1.00	IMPERIAL OIL IMPERIAL OIL GAS STATION 1186 WELLINGTON AT PARKDALE ESSO SERVICE STATION OTTAWA CITY ON K1Y 2Z5	SPL
Ref No: 88499 Site No: Incident Dt: // Year: Incident Cause: UNDERGROUND TANK LEAK Incident Event: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: CONFIRMED Nature of Impact: Soil contamination Receiving Medium: LAND Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: 7/15/1993 Dt Document Closed: Incident Reason: CORROSION Site Name: Site County/District: Municipality No: 20101 Site Geo Ref Meth: Incident Summary: IMPERIAL OIL GAS STATION - GASOLINE TO SOIL FROM UNDERGROUND FUEL TANK Contaminant Qty: Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address: Site District Office: Site Postal Code: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type:					
157	3 of 17	SE/212.9	63.9 / 1.00	PARKDALE ESSO RON ASPECK & SON LTD 1186 WELLINGTON ST OTTAWA ON K1Y2Z5	PRT
Location ID: 22423 Type: retail Expiry Date: 1995-07-31 Capacity (L): 17972 Licence #: 0026193001					
157	4 of 17	SE/212.9	63.9 / 1.00	1186 WELLINGTON ST. OTTAWA ON	PRT
Location ID: 11140 Type: retail Expiry Date: Capacity (L): Licence #:					
157	5 of 17	SE/212.9	63.9 / 1.00	PARKDALE ESSO RON ASPECK & SON LTD 1186 WELLINGTON ST OTTAWA ON K1Y 2Z5	DTNK

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:	10061431			Expired Date:	9/2/1993
Status:	EXPIRED			Max Hazard Rank:	
Instance ID:				Facility Location:	
Instance Type:	FS Facility			Facility Type:	
Instance Creation Dt:				Fuel Type 2:	
Instance Install Dt:				Fuel Type 3:	
Item Description:				Panam Related:	
Manufacturer:				Panam Venue Nm:	
Model:				External Identifier:	
Serial No:				Item:	
ULC Standard:				Piping Steel:	
Quantity:				Piping Galvanized:	
Unit of Measure:				Tank Single Wall St:	
Overfill Prot Type:				Piping Underground:	
Creation Date:				Tank Underground:	
Next Periodic Str DT:				Source:	
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:					
Original Source:		EXP			
Record Date:		Up to May 2013			

157	6 of 17	SE/212.9	63.9 / 1.00	PARKDALE ESSO RON ASPECK & SON LTD 1186 WELLINGTON ST OTTAWA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11232219	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	74179	Facility Location:	
Instance Type:	FS Piping	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Piping Original Source: EXP Record Date: Up to Mar 2012					
157	7 of 17	SE/212.9	63.9 / 1.00	PARKDALE ESSO RON ASPECK & SON LTD 1186 WELLINGTON ST OTTAWA ON	DTNK

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ULC Standard:				Piping Steel:	
Quantity:				Piping Galvanized:	
Unit of Measure:				Tank Single Wall St:	
Overfill Prot Type:				Piping Underground:	
Creation Date:				Tank Underground:	
Next Periodic Str DT:				Source:	
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:		FS Piping			
Original Source:		EXP			
Record Date:		Up to Mar 2012			

Delisted Expired Fuel Safety Facilities

Instance No:	11232107	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	74987	Facility Location:	
Instance Type:	FS Piping	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS Piping		
Original Source:	EXP		
Record Date:	Up to Mar 2012		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:	11232162			Expired Date:	
Status:	EXPIRED			Max Hazard Rank:	NULL
Instance ID:				Facility Location:	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA
Instance Type:				Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	10/2/1989			Fuel Type 2:	NULL
Instance Install Dt:	10/2/1989			Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank			Panam Related:	NULL
Manufacturer:	NULL			Panam Venue Nm:	NULL
Model:	NULL			External Identifier:	NULL
Serial No:	NULL			Item:	
ULC Standard:	NULL			Piping Steel:	
Quantity:	1			Piping Galvanized:	
Unit of Measure:	EA			Tank Single Wall St:	
Overfill Prot Type:	NULL			Piping Underground:	
Creation Date:	7/5/2009 1:24:20 AM			Tank Underground:	
Next Periodic Str DT:	NULL			Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL				
TSSAMax Hazard Rank 1:	NULL				
TSSA Risk Based Periodic Yn:	NULL				
TSSA Volume of Directives:	NULL				
TSSA Periodic Exempt:	NULL				
TSSA Statutory Interval:	NULL				
TSSA Recd Insp Interva:	NULL				
TSSA Recd Tolerance:	NULL				
TSSA Program Area:	NULL				
TSSA Program Area 2:	NULL				
Description:	UNDERGROUND TANK				
Original Source:	EXP				
Record Date:	31-JUL-2020				

[157](#)

11 of 17

SE/212.9

63.9 / 1.00

PARKDALE ESSO RON ASPECK & SON LTD
1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA
ON

DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11232200			Expired Date:	
Status:	EXPIRED			Max Hazard Rank:	NULL
Instance ID:				Facility Location:	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA
Instance Type:				Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	10/2/1989			Fuel Type 2:	NULL
Instance Install Dt:	10/2/1989			Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank			Panam Related:	NULL
Manufacturer:	NULL			Panam Venue Nm:	NULL
Model:	NULL			External Identifier:	NULL
Serial No:	NULL			Item:	
ULC Standard:	NULL			Piping Steel:	
Quantity:	1			Piping Galvanized:	
Unit of Measure:	EA			Tank Single Wall St:	
Overfill Prot Type:	NULL			Piping Underground:	
Creation Date:	7/5/2009 1:24:25 AM			Tank Underground:	
Next Periodic Str DT:	NULL			Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL				
TSSAMax Hazard Rank 1:	NULL				
TSSA Risk Based Periodic Yn:	NULL				
TSSA Volume of Directives:	NULL				
TSSA Periodic Exempt:	NULL				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
TSSA Statutory Interval:		NULL			
TSSA Recd Insp Interva:		NULL			
TSSA Recd Tolerance:		NULL			
TSSA Program Area:		NULL			
TSSA Program Area 2:		NULL			
Description:		UNDERGROUND TANK			
Original Source:		EXP			
Record Date:		31-JUL-2020			

[157](#) 12 of 17 SE/212.9 63.9 / 1.00 PARKDALE ESSO RON ASPECK & SON LTD 1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA ON DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11232088	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	NULL
Instance ID:		Facility Location:	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA
Instance Type:		Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	10/2/1989	Fuel Type 2:	NULL
Instance Install Dt:	10/2/1989	Fuel Type 3:	NULL
Item Description:	FS Liquid Fuel Tank	Panam Related:	NULL
Manufacturer:	NULL	Panam Venue Nm:	NULL
Model:	NULL	External Identifier:	NULL
Serial No:	NULL	Item:	
ULC Standard:	NULL	Piping Steel:	
Quantity:	1	Piping Galvanized:	
Unit of Measure:	EA	Tank Single Wall St:	
Overfill Prot Type:	NULL	Piping Underground:	
Creation Date:	7/5/2009 1:24:17 AM	Tank Underground:	
Next Periodic Str DT:	NULL	Source:	FS Liquid Fuel Tank
TSSA Base Sched Cycle 2:	NULL		
TSSAMax Hazard Rank 1:	NULL		
TSSA Risk Based Periodic Yn:	NULL		
TSSA Volume of Directives:	NULL		
TSSA Periodic Exempt:	NULL		
TSSA Statutory Interval:	NULL		
TSSA Recd Insp Interva:	NULL		
TSSA Recd Tolerance:	NULL		
TSSA Program Area:	NULL		
TSSA Program Area 2:	NULL		
Description:	UNDERGROUND TANK		
Original Source:	EXP		
Record Date:	31-JUL-2020		

[157](#) 13 of 17 SE/212.9 63.9 / 1.00 PARKDALE ESSO RON ASPECK & SON LTD 1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA ON DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11232123	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	NULL
Instance ID:		Facility Location:	1186 WELLINGTON ST OTTAWA K1Y 2Z5 ON CA
Instance Type:		Facility Type:	FS LIQUID FUEL TANK
Instance Creation Dt:	10/2/1989	Fuel Type 2:	NULL
Instance Install Dt:	10/2/1989	Fuel Type 3:	NULL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Item Description: FS Liquid Fuel Tank Manufacturer: NULL Model: NULL Serial No: NULL ULC Standard: NULL Quantity: 1 Unit of Measure: EA Overfill Prot Type: NULL Creation Date: 7/5/2009 1:24:19 AM Next Periodic Str DT: NULL TSSA Base Sched Cycle 2: NULL TSSAMax Hazard Rank 1: NULL TSSA Risk Based Periodic Yn: NULL TSSA Volume of Directives: NULL TSSA Periodic Exempt: NULL TSSA Statutory Interval: NULL TSSA Recd Insp Interva: NULL TSSA Recd Tolerance: NULL TSSA Program Area: NULL TSSA Program Area 2: NULL Description: UNDERGROUND TANK Original Source: EXP Record Date: 31-JUL-2020 Panam Related: NULL Panam Venue Nm: NULL External Identifier: NULL Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source: FS Liquid Fuel Tank					

157	14 of 17	SE/212.9	63.9 / 1.00	PARKDALE ESSO RON ASPECK & SON LTD 1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	FST
Instance No: 11232162 Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 10/2/1989 Install Year: 1979 Years in Service: Model: NULL Description: Capacity: 13600 Tank Material: Steel Corrosion Protect: Sacrificial anode Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA Manufacturer: Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					
Liquid Fuel Tank Details Overfill Protection: Owner Account Name: PARKDALE ESSO RON ASPECK & SON LTD Item: FS LIQUID FUEL TANK					

157	15 of 17	SE/212.9	63.9 / 1.00	PARKDALE ESSO RON ASPECK & SON LTD 1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	FST
Instance No: 11232088 Status: Manufacturer: Serial No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 10/2/1989 Install Year: 1979 Years in Service: Model: NULL Description: Capacity: 22700 Tank Material: Steel Corrosion Protect: Sacrificial anode Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA				Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:	
<u>Liquid Fuel Tank Details</u>					
Overfill Protection:					
Owner Account Name:		PARKDALE ESSO RON ASPECK & SON LTD			
Item:		FS LIQUID FUEL TANK			

157

16 of 17

SE/212.9

63.9 / 1.00

PARKDALE ESSO RON ASPECK & SON LTD

1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON

CA

ON

FST

Instance No:

11232200

Status:

Cont Name:

Instance Type:

Item:

Item Description:

FS Liquid Fuel Tank

Tank Type:

Liquid Fuel Single Wall UST

Install Date:

10/2/1989

Install Year:

1979

Years in Service:

Model:

NULL

Description:

Capacity:

22700

Tank Material:

Steel

Corrosion Protect:

Sacrificial anode

Overfill Protect:

Facility Type:

FS Liquid Fuel Tank

Parent Facility Type:

Facility Location:

Device Installed Location:

1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA

Manufacturer:

Serial No:

Ulc Standard:

Quantity:

Unit of Measure:

Fuel Type:

Gasoline

Fuel Type2:

NULL

Fuel Type3:

NULL

Piping Steel:

Piping Galvanized:

Tanks Single Wall St:

Piping Underground:

No Underground:

Panam Related:

Panam Venue:

Liquid Fuel Tank Details

Overfill Protection:

Owner Account Name:

PARKDALE ESSO RON ASPECK & SON LTD

Item:

FS LIQUID FUEL TANK

157	17 of 17	SE/212.9	63.9 / 1.00	PARKDALE ESSO RON ASPECK & SON LTD 1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA ON	FST
Instance No: 11232123 Manufacturer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Cont Name: Instance Type: Item: Item Description: FS Liquid Fuel Tank Tank Type: Liquid Fuel Single Wall UST Install Date: 10/2/1989 Install Year: 1979 Years in Service: Model: NULL Description: Capacity: 22700 Tank Material: Steel Corrosion Protect: Sacrificial anode Overfill Protect: Facility Type: FS Liquid Fuel Tank Parent Facility Type: Facility Location: Device Installed Location: 1186 WELLINGTON ST W OTTAWA K1Y 2Z5 ON CA					
Serial No: Ulc Standard: Quantity: Unit of Measure: Fuel Type: Gasoline Fuel Type2: NULL Fuel Type3: NULL Piping Steel: Piping Galvanized: Tanks Single Wall St: Piping Underground: No Underground: Panam Related: Panam Venue:					

Liquid Fuel Tank Details

Overfill Protection:
Owner Account Name: PARKDALE ESSO RON ASPECK & SON LTD
Item: FS LIQUID FUEL TANK

158	1 of 3	S/213.3	64.2 / 1.31	CARVERS DRUG-STORE (1971) LIMITED 1200-B WELLINGTON STREET OTTAWA ON K1Y 2Z7	GEN
Generator No: ON1565716 SIC Code: 6031 SIC Description: PHARMACIES Approval Years: 00,01 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 261 Waste Class Name: PHARMACEUTICALS Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					

158	2 of 3	S/213.3	64.2 / 1.31	PHARMA PLUS DRUGMARTS LTD. 1200B WELLINGTON STREET OTTAWA ON K1Y 2Z7	GEN
Generator No: ON2654903 SIC Code: 6031 SIC Description: PHARMACIES Approval Years: 01 PO Box No: Country: Status: Co Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
158	3 of 3	S/213.3	64.2 / 1.31	Emerald Bakery 1200D Wellington St W Ottawa ON K1Y 2Z7	SCT
Established:		1994			
Plant Size (ft²):		2			
Employment:					
--Details--					
Description:		All Other Food Manufacturing			
SIC/NAICS Code:		311990			
159	1 of 1	SSE/213.8	63.9 / 1.00	1194 Wellington St W Ottawa ON Ottawa ON K1Y 2Z5	EHS
Order No:		20180801008		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		07-AUG-18		Search Radius (km): .25	
Date Received:		01-AUG-18		X: -75.729613	
Previous Site Name:				Y: 45.400298	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
160	1 of 1	E/214.3	62.9 / 0.00	HOLISTECH PEST CONTROL INC. 5 GRANT ST.; APT. #2 OTTAWA ON K1Y 2W8	PES
Detail Licence No:		Operator Box:			
Licence No:		Operator Class:			
Status:		Operator No:			
Approval Date:		Operator Type:			
Report Source:		Oper Area Code:			
Licence Type:		Oper Phone No:			
Licence Type Code:		Operator Ext:			
Licence Class:		Operator Lot:			
Licence Control:		Oper Concession:			
Latitude:		Operator Region:			
Longitude:		Operator District:			
Lot:		Operator County:			
Concession:		Op Municipality:			
Region:		Post Office Box:			
District:		MOE District:			
County:		SWP Area Name:			
Trade Name:					
PDF URL:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
161	1 of 1	NW/216.5	62.9 / 0.00	Colonnade Development Inc. 1600 Scott St Ottawa ON	GEN
Generator No:		ON3845096			
SIC Code:		531310			
SIC Description:		Real Estate Property Managers			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
162	1 of 18	NW/220.4	62.9 / 0.00	PHARMA PLUS DRUGS LTD 1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	GEN
Generator No:		ON1553307			
SIC Code:		6031			
SIC Description:		PHARMACIES			
Approval Years:		92,93,97			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
162	2 of 18	NW/220.4	62.9 / 0.00	PHARMA PLUS DRUGS LTD. 31-660 1620 SCOTT STREET, UNIT 29, OTTAWA C/O 5935 AIRPORT ROAD STE. 500 MISSISSAUGA ON K1Y 4S7	GEN
Generator No:		ON1553307			
SIC Code:		6031			
SIC Description:		PHARMACIES			
Approval Years:		94,95,96			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		261 PHARMACEUTICALS			
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
162	3 of 18	NW/220.4	62.9 / 0.00	PHARMA PLUS DRUGS LTD. 1620 SCOTT STREET UNIT 29 OTTAWA ON K1Y 4S7	GEN
Generator No:		ON1553307			
SIC Code:		6031			
SIC Description:		PHARMACIES			
Approval Years:		98			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
162	4 of 18	NW/220.4	62.9 / 0.00	PHARMA PLUS DRUGS LTD. 1620 SCOTT STREET, UNIT 29 OTTAWA ON K1Y 4S7	GEN
Generator No:		ON1553307			
SIC Code:		6031			
SIC Description:		PHARMACIES			
Approval Years:		99,00,01			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
162	5 of 18	NW/220.4	62.9 / 0.00	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:		ON2588173			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: 621210, 621210 SIC Description: OFFICES OF DENTISTS, OFFICES OF DENTISTS Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
162	6 of 18	NW/220.4	62.9 / 0.00	Rexall Pharmacy Group Ltd. 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No: ON9502205 SIC Code: 446110 SIC Description: 446110 Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Erik Botines Choice of Contact: CO_ADMIN Phone No Admin: 905-502-5965 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
Waste Class: 261 Waste Class Name: PHARMACEUTICALS					
162	7 of 18	NW/220.4	62.9 / 0.00	Pharma Plus Drugmarts Ltd 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No: ON9502205 SIC Code: 446110 SIC Description: 446110 Approval Years: 2015 PO Box No: Country: Canada Status: Co Admin: Erik Botines Choice of Contact: CO_ADMIN Phone No Admin: 905-502-5965 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		PATHOLOGICAL WASTES			
162	8 of 18	NW/220.4	62.9 / 0.00	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:		ON2588173			
SIC Code:		621210, 621210			
SIC Description:		OFFICES OF DENTISTS, OFFICES OF DENTISTS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
162	9 of 18	NW/220.4	62.9 / 0.00	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:		ON2588173			
SIC Code:		621210, 621210			
SIC Description:		OFFICES OF DENTISTS, OFFICES OF DENTISTS			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
162	10 of 18	NW/220.4	62.9 / 0.00	Pharma Plus Drugmarts Ltd 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No:		ON9502205			
SIC Code:		446110			
SIC Description:		446110			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Aaron Schrama			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		905-502-5965 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
162	11 of 18	NW/220.4	62.9 / 0.00	Rexall Pharmacy Group Ltd. 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No:		ON9502205			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
162	12 of 18	NW/220.4	62.9 / 0.00	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:		ON2588173			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
162	13 of 18	NW/220.4	62.9 / 0.00	Rexall Pharmacy Group Ltd. 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No:		ON9502205			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 P Waste Class Name: Pathological wastes Waste Class: 261 A Waste Class Name: Pharmaceuticals					
162	14 of 18	NW/220.4	62.9 / 0.00	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No: ON2588173 SIC Code: SIC Description: Approval Years: As of Oct 2019 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 148 B Waste Class Name: Misc. wastes and inorganic chemicals Waste Class: 312 P Waste Class Name: Pathological wastes Waste Class: 146 T Waste Class Name: Other specified inorganic sludges, slurries or solids					
162	15 of 18	NW/220.4	62.9 / 0.00	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No: ON2588173 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
162	16 of 18	NW/220.4	62.9 / 0.00	Rexall Pharmacy Group Ltd. 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No:		ON9502205			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
162	17 of 18	NW/220.4	62.9 / 0.00	Holland Cross Dental Centre 20-1620 Scott Street Ottawa ON K1Y4S7	GEN
Generator No:		ON2588173			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
162	18 of 18	NW/220.4	62.9 / 0.00	Rexall Pharmacy Group Ltd. 1620 Scott Street, Unit 29 Ottawa ON K1Y 4S7	GEN
Generator No:		ON9502205			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		Registered			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		261 A PHARMACEUTICALS			
Waste Class: Waste Class Name:		312 P PATHOLOGICAL WASTES			
163	1 of 1	SSW/220.9	64.9 / 2.00	JASAAB HOLDINGS LIMITED 1217 WELLINGTON ST. OTTAWA CITY ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		3-1154-99- 99 10/21/1999 Municipal sewage Approved			
164	1 of 1	ESE/222.8	63.9 / 1.00	1156 Wellington Street Ottawa ON	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20140612002 C Standard Report 20-JUN-14 12-JUN-14		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y: ON .25 -75.728023 45.401152	
165	1 of 2	E/227.5	62.9 / 0.00	OTTAWA UPHOLSTERY 1 MCCORMICK STREET OTTAWA ON K1Y 1M4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON2687200 6213 FURN. REFINISHING 01			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
165	2 of 2	E/227.5	62.9 / 0.00	OTTAWA UPHOLSTERY INC 1 MCCORMICK STREET OTTAWA ON K1Y 1M4	GEN
Generator No:		ON2687200			
SIC Code:					
SIC Description:					
Approval Years:		02,03,04			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
166	1 of 1	SE/228.7	63.9 / 1.00	DORAN CONTRACTORS LIMITED ON K1Y 1E4	EASR
Approval No:		R-009-1110579155	MOE District:		Ottawa
Status:		REGISTERED	Municipality:		
Date:		2018-09-12	Latitude:		45.40055556
Record Type:		EASR	Longitude:		-75.72861111
Link Source:		MOFA	Geometry X:		
Project Type:		Water Taking - Construction Dewatering	Geometry Y:		
Full Address:					
Approval Type:		EASR-Water Taking - Construction Dewatering			
SWP Area Name:		Rideau Valley			
PDF URL:					
PDF Site Location:					
167	1 of 1	ENE/228.7	61.9 / -1.00	City of Ottawa 329 Hinchey St Ottawa ON	SPL
Ref No:		8781-8X6TGK	Discharger Report:		
Site No:			Material Group:		
Incident Dt:		14-AUG-12	Health/Env Conseq:		
Year:			Client Type:		
Incident Cause:		Unknown	Sector Type:		Other
Incident Event:			Agency Involved:		
Contaminant Code:		27	Nearest Watercourse:		
Contaminant Name:		PAINT OR PAINT RELATED N.O.S.	Site Address:		329 Hinchey St
Contaminant Limit 1:			Site District Office:		
Contam Limit Freq 1:			Site Postal Code:		
Contaminant UN No 1:			Site Region:		
Environment Impact:		Confirmed	Site Municipality:		Ottawa
Nature of Impact:		Surface Water Pollution	Site Lot:		

168	1 of 2	WSW/228.8	63.9 / 1.00	PIPELINE HIT - 1/2" 72 HOLLAND AVE,,OTTAWA,ON,K1Y 0X6,CA ON	PINC
Incident Id:				Pipe Material:	
Incident No:		1726052		Fuel Category:	
Incident Reported Dt:		9/24/2015		Health Impact:	
Type:		FS-Pipeline Incident		Environment Impact:	
Status Code:				Property Damage:	
Tank Status:		Pipeline Damage Reason Est		Service Interrupt:	
Task No:				Enforce Policy:	
Spills Action Centre:				Public Relation:	
Fuel Type:				Pipeline System:	
Fuel Occurrence Tp:				PSIG:	
Date of Occurrence:				Attribute Category:	
Occurrence Start Dt:				Regulator Location:	
Depth:				Method Details:	
Customer Acct Name:		PIPELINE HIT - 1/2"			
Incident Address:		72 HOLLAND AVE,,OTTAWA,ON,K1Y 0X6,CA			
Operation Type:					
Pipeline Type:					
Regulator Type:					
Summary:					
Reported By:					
Affiliation:					
Occurrence Desc:					
Damage Reason:					
Notes:					

168	2 of 2	WSW/228.8	63.9 / 1.00	Enbridge Gas Distribution Inc. 72 Holland Ave Ottawa ON	SPL
Ref No:	1854-A2MR4S			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	9/23/2015			Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:				Sector Type:	Other
Incident Event:				Agency Involved:	
Contaminant Code:	35			Nearest Watercourse:	
Contaminant Name:	NATURAL GAS (METHANE)			Site Address:	72 Holland Ave
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:				Northing:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MOE Response: No Dt MOE Arvl on Scn: MOE Reported Dt: 9/23/2015 Dt Document Closed: 10/3/2015 Incident Reason: Operator/Human Error Site Name: Work site<UNOFFICIAL> Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: TSSA 1/2" line damage Made Safe Contaminant Qty: 0 other - see incident description Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Source Type:					
169	1 of 6	SSW/229.0	64.9 / 2.00	Wellington Medical Clinic 1221 Wellington Street West Ottawa ON	GEN
Generator No: ON3547091 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2013 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: Detail(s) Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
169	2 of 6	SSW/229.0	64.9 / 2.00	Wellington Medical Clinic 1221 Wellington Street West Ottawa ON K1Y 2Z9	GEN
Generator No: ON3547091 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Dawn Lemay Choice of Contact: CO_OFFICIAL Phone No Admin: 613-695-1221 Ext. Contaminated Facility: No MHSW Facility: No Detail(s) Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
169	3 of 6	SSW/229.0	64.9 / 2.00	Wellington Medical Clinic 1221 Wellington Street West Ottawa ON K1Y 2Z9	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON3547091 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2015 PO Box No: Country: Canada Status: Co Admin: Dawn Lemay Choice of Contact: CO_OFFICIAL Phone No Admin: 613-695-1221 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
169	4 of 6	SSW/229.0	64.9 / 2.00	Wellington Medical Clinic 1221 Wellington Street West Ottawa ON K1Y 2Z9	GEN
Generator No: ON3547091 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2014 PO Box No: Country: Canada Status: Co Admin: Rosemee Cantave Choice of Contact: CO_OFFICIAL Phone No Admin: 613-695-1221 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
169	5 of 6	SSW/229.0	64.9 / 2.00	Wellington Medical Clinic 1221 Wellington Street West Ottawa ON K1Y 2Z9	GEN
Generator No: ON3547091 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 P Waste Class Name: Pathological wastes					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
169	6 of 6	SSW/229.0	64.9 / 2.00	Wellington Medical Clinic 1221 Wellington Street West Ottawa ON K1Y 2Z9	GEN
Generator No:		ON3547091			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2019			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
170	1 of 1	SE/230.6	63.9 / 1.00	424 Parkdale Avenue Ottawa ON K1Y 1H1	EHS
Order No:		20081223003		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State: ON	
Report Date:		1/6/2009		Search Radius (km): 0.25	
Date Received:		12/23/2008		X: -75.729084	
Previous Site Name:				Y: 45.400301	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
171	1 of 2	N/231.1	61.9 / -1.00	OTTAWA CITY - PARKDALE AVENUE BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	CA
Certificate #:		3-0870-91-			
Application Year:		91			
Issue Date:		6/21/1991			
Approval Type:		Municipal sewage			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
171	2 of 2	N/231.1	61.9 / -1.00	OTTAWA CITY - HINCHEY STREET BULLMAN ST./PINEHURST ST. OTTAWA CITY ON	CA
Certificate #:		7-0698-91-			
Application Year:		91			
Issue Date:		6/21/1991			
Approval Type:		Municipal water			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
172	1 of 6	NW/231.5	61.9 / -1.00	ARISTOTEC GENERATOR SERVICES INC 13A BULLMAN ST. OTTAWA ON K1Y 2S2	GEN
Generator No: ON0869200 SIC Code: 9949 SIC Description: OTHER REPAIR SERV. Approval Years: 86,87 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
172	2 of 6	NW/231.5	61.9 / -1.00	ARISTOTEC (OUT OF BUSINESS) 13A BULLMAN ST. OTTAWA ON K1Y 2S2	GEN
Generator No: ON0869200 SIC Code: 9949 SIC Description: OTHER REPAIR SERV. Approval Years: 88,89,90 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
172	3 of 6	NW/231.5	61.9 / -1.00	ARISTOTEC (OUT OF BUSINESS) 03-269 13A BULLMAN ST. OTTAWA ON K1Y 2S2	GEN
Generator No: ON0869200 SIC Code: 9949 SIC Description: OTHER REPAIR SERV.					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		92,93,94,95,96,97,98			
172	4 of 6	NW/231.5	61.9 / -1.00	CARRIAGE HOUSE RESTORATION & ANTIQUES 13A BULLMAN OTTAWA ON K1Y 2S2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON2664200 2619 OTHER HOUSEHOLD FURN. 01,02,03,04			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		145 PAINT/PIGMENT/COATING RESIDUES			
172	5 of 6	NW/231.5	61.9 / -1.00	2021694 13 bullman street ottawa ON K1Y 2S2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON9259687 06			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		145 PAINT/PIGMENT/COATING RESIDUES			
172	6 of 6	NW/231.5	61.9 / -1.00	2021694 13 bullman street ottawa ON K1Y 2S2	GEN
Generator No: SIC Code: SIC Description: Approval Years:		ON9259687 100000			
		2009			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
173	1 of 1	ENE/234.2	61.9 / -1.00	177 ARMSTRONG ST. OTTAWA ON	WWIS
Well ID:		7198934		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Test Hole		Date Received:	
Water Type:				20-Mar-2013 00:00:00	
Casing Material:				Selected Flag:	
Audit No:		Z152990		TRUE	
Tag:		A141815		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				7241	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				7	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				OTTAWA-CARLETON	
Static Water Level:				Lot:	
Clear/Cloudy:				Concession:	
Municipality:		NEPEAN TOWNSHIP		Concession Name:	
Site Info:				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/719\7198934.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		2013/01/23			
Year Completed:		2013			
Depth (m):		6.1			
Latitude:		45.4028764120249			
Longitude:		-75.7277317220606			
Path:		719\7198934.pdf			
Bore Hole Information					
Bore Hole ID:		1004265459		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				443047.00	
Cluster Kind:				North83:	
Date Completed:		23-Jan-2013 00:00:00		5027964.00	
				Org CS:	
				UTM83	
				UTMRC:	
				4	
				UTMRC Desc:	
				margin of error : 30 m - 100 m	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:		Location Method:			WWF
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004918584			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004918582			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:					
Most Common Material:					
Mat2:					
Mat2 Desc:					
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004918583			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID: 1004918592					
Layer: 1					
Plug From: 0.0					
Plug To: 0.3100000023841858					
Plug Depth UOM: m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1004918594					
Layer: 3					
Plug From: 2.740000009536743					
Plug To: 6.099999904632568					
Plug Depth UOM: m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1004918593					
Layer: 2					
Plug From: 0.3100000023841858					
Plug To: 2.740000009536743					
Plug Depth UOM: m					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1004918591					
Method Construction Code: 5					
Method Construction: Air Percussion					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1004918581					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1004918588					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 3.0999999046325684					
Casing Diameter: 4.03000020980835					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1004918589					
Layer: 1					
Slot: 10					
Screen Top Depth: 3.0999999046325684					
Screen End Depth: 6.099999904632568					
Screen Material: 5					
Screen Depth UOM: m					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1004918587			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004918585			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1004918586			
Diameter:		7.619999885559082			
Depth From:		1.5199999809265137			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Links</u>					
Bore Hole ID:		1004265459		Tag No:	A141815
Depth M:		6.1		Contractor:	7241
Year Completed:		2013		Path:	719\7198934.pdf
Well Completed Dt:		2013/01/23		Latitude:	45.4028764120249
Audit No:		Z152990		Longitude:	-75.7277317220606
174	1 of 1	E/234.2	62.9 / 0.00	1 Grant Street Ottawa ON K1Y 2W8	SPL
Ref No:		4541-8GBSEG		Discharger Report:	
Site No:				Material Group:	
Incident Dt:		4/27/2011		Health/Env Conseq:	
Year:				Client Type:	
Incident Cause:		Other Discharges		Sector Type:	Motor Vehicle
Incident Event:				Agency Involved:	
Contaminant Code:		12		Nearest Watercourse:	
Contaminant Name:		GASOLINE		Site Address:	1 Grant Street
Contaminant Limit 1:				Site District Office:	
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:				Site Region:	
Environment Impact:		Not Anticipated		Site Municipality:	Ottawa
Nature of Impact:		Other Impact(s); Surface Water Pollution		Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:				Northing:	
MOE Response:		No Field Response		Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:		4/27/2011		Site Map Datum:	
Dt Document Closed:		5/31/2011		SAC Action Class:	Land Spills
Incident Reason:				Source Type:	
Site Name:		Catch Basin<UNOFFICIAL>			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: 20L Gasoline to Catchbasin Contaminant Qty: 40 L					
175	1 of 1	E/236.4	63.1 / 0.25	1145 WELLINGTON ST. OTTAWA ON	WWIS
Well ID: 7296560 Construction Date: Use 1st: Test Hole Use 2nd: Monitoring Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z206492 Tag: A182665 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: PDF URL (Map): Additional Detail(s) (Map) Well Completed Date: 2017/09/13 Year Completed: 2017 Depth (m): 3.715512 Latitude: 45.4018335676094 Longitude: -75.727526670107 Path:					
Bore Hole Information Bore Hole ID: 1006759218 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 13-Sep-2017 00:00:00 Remarks: Loc Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Overburden and Bedrock					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 05-Oct-2017 00:00:00 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Elevation: Elevrc: Zone: 18 East83: 443062.00 North83: 5027848.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1006952960			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:		11			
Most Common Material:		GRAVEL			
Mat2:					
Mat2 Desc:					
Mat3:		66			
Mat3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006952961			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		12			
Mat2 Desc:		STONES			
Mat3:		11			
Mat3 Desc:		GRAVEL			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006952962			
Layer:		3			
Color:		2			
General Color:		GREY			
Mat1:		15			
Most Common Material:		LIMESTONE			
Mat2:					
Mat2 Desc:					
Mat3:		74			
Mat3 Desc:		LAYERED			
Formation Top Depth:		2.130000114440918			
Formation End Depth:		12.1899995803833			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006952971			
Layer:		1			
Plug From:		0.0			
Plug To:		3.0999999046325684			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1006952972			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		8.84000015258789			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006952973			
Layer:		3			
Plug From:		8.84000015258789			
Plug To:		12.1899995803833			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006952970			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006952959			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006952966			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		8.140000343322754			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1006952967			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.140000343322754			
Screen End Depth:		12.1899995803833			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		4.820000171661377			
 <u>Water Details</u>					
Water ID:		1006952965			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006952964			
Diameter:		7.619999885559082			
Depth From:		2.440000057220459			
Depth To:		12.1899995803833			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1006952963			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Links</u>					
Bore Hole ID:	1006759218			Tag No:	A182665
Depth M:	3.715512			Contractor:	7241
Year Completed:	2017			Path:	729\7296560.pdf
Well Completed Dt:	2017/09/13			Latitude:	45.4018335676094
Audit No:	Z206492			Longitude:	-75.727526670107
176	1 of 1	SSW/236.5	64.9 / 2.00	TDL GROUP LIMITED 1217-1225 WELLINGTON ST. OTTAWA CITY ON	CA
Certificate #:	8-4004-97-				
Application Year:	97				
Issue Date:	2/4/1997				
Approval Type:	Industrial air				
Status:	Cancelled				
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:	KITCHEN EXHAUST FOR TIM HORTON'S				
Contaminants:					
Emission Control:					
177	1 of 1	NE/238.9	61.9 / -1.00	Patrick John Mills 284 Hinchey Ave 286 Hinchey Avenue Ottawa ON K1Y 1M2	ECA
Approval No:	9227-A5WQHU			MOE District:	
Approval Date:	2016-01-25			City:	
Status:	Approved			Longitude:	
Record Type:	ECA			Latitude:	
Link Source:	IDS			Geometry X:	
SWP Area Name:				Geometry Y:	
Approval Type:	ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS				
Project Type:	MUNICIPAL AND PRIVATE SEWAGE WORKS				
Business Name:	Patrick John Mills				
Address:	284 Hinchey Ave 286 Hinchey Avenue				
Full Address:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/9841-A58KDF-14.pdf			
PDF Site Location:					
178	1 of 2	ENE/240.0	61.9 / -1.00	177 Armstrong Street Ottawa ON K1Y 2W2	EHS
Order No:		22042700665		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	
Report Date:		02-MAY-22		Search Radius (km):	
Date Received:		27-APR-22		X:	
Previous Site Name:				Y:	
Lot/Building Size:					
Additional Info Ordered:					
178	2 of 2	ENE/240.0	61.9 / -1.00	177 Armstrong Street Ottawa ON K1Y 2W2	EHS
Order No:		22042700665		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	
Report Date:		02-MAY-22		Search Radius (km):	
Date Received:		27-APR-22		X:	
Previous Site Name:				Y:	
Lot/Building Size:					
Additional Info Ordered:					
179	1 of 1	ENE/240.8	61.9 / -1.00	177 Armstrong Ottawa ON	EHS
Order No:		20140429104		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	
Report Date:		08-MAY-14		Search Radius (km):	
Date Received:		29-APR-14		X:	
Previous Site Name:				Y:	
Lot/Building Size:					
Additional Info Ordered:		City Directory			
180	1 of 1	ENE/240.8	61.9 / -1.00	177 & 179 Armstrong Avenue Ottawa ON K1Y 2W2	EHS
Order No:		20190624121		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	
Report Date:		02-JUL-19		Search Radius (km):	
Date Received:		24-JUN-19		X:	
Previous Site Name:				Y:	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; City Directory			
181	1 of 1	ENE/242.0	61.9 / -1.00	177 ARMSTRONG ST. OTTAWA ON	WWIS
Well ID:		7198935		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	20-Mar-2013 00:00:00
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z152989			Contractor:	7241
Tag:	A141816			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/719\7198935.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	2013/01/23				
Year Completed:	2013				
Depth (m):	6.1				
Latitude:	45.4028591435009				
Longitude:	-75.7276165004707				
Path:	719\7198935.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1004265462			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	443056.00
Code OB Desc:				North83:	5027962.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	23-Jan-2013 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Loc Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004918604				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:	74				
Mat3 Desc:	LAYERED				
Formation Top Depth:	0.9100000262260437				
Formation End Depth:	6.099999904632568				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004918602			
Layer:		1			
Color:		8			
General Color:		BLACK			
Mat1:					
Most Common Material:					
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:					
Mat3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004918603			
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		11			
Mat2 Desc:		GRAVEL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004918614			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004918613			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004918615			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004918612			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004918601			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004918608			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004918609			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1004918607			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004918605			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.2200000286102295			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: 1004918606 Diameter: 7.619999885559082 Depth From: 1.2200000286102295 Depth To: 6.099999904632568 Hole Depth UOM: m Hole Diameter UOM: cm					
Links					
Bore Hole ID: 1004265462 Tag No: A141816 Depth M: 6.1 Contractor: 7241 Year Completed: 2013 Path: 719\7198935.pdf Well Completed Dt: 2013/01/23 Latitude: 45.4028591435009 Audit No: Z152989 Longitude: -75.7276165004707					
182	1 of 1	NNE/242.8	61.9 / -1.00	ENTRO BUILDING SYSTEMS INC. 286 HINCHEY AVE OTTAWA ON K1Y 1M2	SCT
Established: 1988 Plant Size (ft²): 2300 Employment: 5					
--Details--					
Description: MILLWORK SIC/NAICS Code: 2431					
Description: GLASS PRODUCTS, MADE OF PURCHASED GLASS SIC/NAICS Code: 3231					
Description: HARDWARE, NOT ELSEWHERE CLASSIFIED SIC/NAICS Code: 3429					
Description: METAL DOORS, SASH, FRAMES, MOLDING, AND TRIM SIC/NAICS Code: 3442					
Description: Wood Window and Door Manufacturing SIC/NAICS Code: 321911					
Description: Glass Product Manufacturing from Purchased Glass SIC/NAICS Code: 327215					
Description: Metal Window and Door Manufacturing SIC/NAICS Code: 332321					
Description: Hardware Manufacturing SIC/NAICS Code: 332510					
183	1 of 1	NW/243.4	61.9 / -1.00	ON	WWIS
Well ID: 7380390 Flowing (Y/N): Construction Date: Flow Rate: Use 1st: Data Entry Status: Yes Use 2nd: Data Src: Final Well Status: Date Received: 17-Feb-2021 00:00:00 Water Type: Selected Flag: TRUE Casing Material: Abandonment Rec: Audit No: Z336023 Contractor: 7323 Tag: A259030 Form Version: 7 Constructn Method: Owner: Elevation (m): County: OTTAWA-CARLETON					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
		OTTAWA CITY			
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Loc Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:					
	1008630806			18 442665.00 5028062.00 UTM83 4 margin of error : 30 m - 100 m wwr	
	09-Jul-2020 00:00:00				
	on Water Well Record				
<u>Links</u>					
Bore Hole ID: Depth M: Year Completed: Well Completed Dt: Audit No: Tag No: Contractor: Path: Latitude: Longitude:					
	1008630806			A259030 7323 738\7380390.pdf 45.4037272645378 -75.7326238272255	
	2020				
	2020/07/09				
	Z336023				
184	1 of 1	NNW/243.8	61.9 / -1.00	268-272 Parkdale Avenue Ottawa, ON ON K1Y 1E9	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:					
	20100610027			Scott St. and Parkdale Ave.	
	C				
	Standard Select Report				
	6/14/2010			ON	
	6/10/2010			0.25	
				-75.731356	
				45.404227	
	Fire Insur. Maps and/or Site Plans				
185	1 of 1	N/244.7	61.9 / -1.00	PRIVATE RESIDENCE RESIDENCE AT 50 PINEHURST OWNED BY MR. MCCARTHY (722-7298) FURNACE OIL TANK OTTAWA CITY ON K1Y 1K4	SPL
Ref No: Site No: Incident Dt: Year: Incident Cause: Incident Event: Contaminant Code: Contaminant Name: Discharger Report: Material Group: Health/Env Conseq: Client Type: Sector Type: Agency Involved: Nearest Watercourse: Site Address:					
	87812				
	7/1/1993				
	ABOVE-GROUND TANK LEAK				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Environment Impact: Nature of Impact: Receiving Medium: Receiving Env: MOE Response: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Incident Reason: Site Name: Site County/District: Municipality No: Site Geo Ref Meth: Incident Summary: Contaminant Qty: NOT ANTICIPATED Other LAND 7/1/1993 CORROSION 20101 PRIVATE RESIDENCE - 25 L OF FURNACE OIL TO EARTHEN FLOOR IN BASEMENT. Site District Office: Site Postal Code: Site Region: Site Municipality: Site Lot: Site Conc: Northing: Easting: Site Geo Ref Accu: Site Map Datum: SAC Action Class: Source Type: OTTAWA CITY					
186	1 of 2	E/245.2	62.9 / 0.00	Grant Street and McCormick Avenue Ottawa ON	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control: 1552-5C6KFG 02 7/22/02 Municipal & Private water Approved New Certificate of Approval City of Ottawa 1495 Heron Road Ottawa K1V 6A6 This application is for the construction of watermains on Grant Street from Parkdale Avenue to McCormick Street, and on McCormick Street from Grant Street to Wellington Street.					
186	2 of 2	E/245.2	62.9 / 0.00	City of Ottawa Grant Street and McCormick Avenue Ottawa ON K1V 6A6	ECA
Approval No: Approval Date: Status: Record Type: Link Source: SWP Area Name: Approval Type: Project Type: Business Name: Address: Full Address: Full PDF Link: PDF Site Location: 1552-5C6KFG 2002-07-22 Approved ECA IDS Rideau Valley ECA-Municipal and Private Water Works Municipal and Private Water Works City of Ottawa Grant Street and McCormick Avenue MOE District: City: Longitude: Latitude: Geometry X: Geometry Y: Ottawa -75.7298 45.3968					
187	1 of 1	W/246.1	64.0 / 1.08	Ottawa Greenbelt Construction Ltd 85 Spencer Street Ottawa ON K1Y 2P7	GEN
Generator No: ON5245307					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: 238910 SIC Description: SITE PREPARATION CONTRACTORS Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 221 Waste Class Name: LIGHT FUELS					
188	1 of 12	SSW/247.8	64.9 / 2.00	SPIC & SPAN-VALETOR-CASH CLEANERS 1233 WELLINGTON STREET C/O 1764 WOODWARD DRIVE OTTAWA ON K1Y 2Z9	GEN
Generator No: ON0573403 SIC Code: 9721 SIC Description: POWER LAUND./CLEANERS Approval Years: 86,87,88,89 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
188	2 of 12	SSW/247.8	64.9 / 2.00	SPIC & SPAN (SEE & USE ON1237703) 1233 WELLINGTON STREET C/O 1764 WOODWARD DRIVE OTTAWA ON K1Y 2Z9	GEN
Generator No: ON0573403 SIC Code: 9721 SIC Description: POWER LAUND./CLEANER Approval Years: 90 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
188	3 of 12	SSW/247.8	64.9 / 2.00	SPIC & SPAN (SEE & USE ON1237703) 35-136 1233 WELLINGTON STREET C/O 1764 WOODWARD DRIVE OTTAWA ON K1Y 2Z9	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON0573403 SIC Code: 9721 SIC Description: POWER LAUND./CLEANER Approval Years: 92,93,94,95,96,97,98 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
188	4 of 12	SSW/247.8	64.9 / 2.00	V.I.P. DRY CLEANERS 40-266 1233 WELLINGTON AVE., OTTAWA C/O 6008 VOYAGEUR DR. ORLEANS ON K1Y 2Z9	GEN
Generator No: ON1237703 SIC Code: 9721 SIC Description: POWER LAUND./CLEANER Approval Years: 92,93,94,95,96,97,98 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
188	5 of 12	SSW/247.8	64.9 / 2.00	898742 ONTARIO INC. 43-453 1233 WELLINGTON STREET OTTAWA ON K1Y 3A3	GEN
Generator No: ON1477700 SIC Code: 9721 SIC Description: POWER LAUND./CLEANER Approval Years: 92,93,94,95,96,97,98 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
188	6 of 12	SSW/247.8	64.9 / 2.00	898742 ONTARIO INC. 1233 WELLINGTON STREET OTTAWA ON K1Y 3A3	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON1477700 SIC Code: 9721 SIC Description: POWER LAUND./CLEANERS Approval Years: 99,00,01 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
188	7 of 12	SSW/247.8	64.9 / 2.00	Quantum Remediation Inc. 1233 Wellington Street Ottawa ON K1Y 2Z9	GEN
Generator No: ON1010235 SIC Code: 238990 SIC Description: All Other Specialty Trade Contractors Approval Years: 05 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
188	8 of 12	SSW/247.8	64.9 / 2.00	1592541 Ontario Inc. 1233 WELLINGTON ST, OTTAWA, ON, K1Y 2Z9 Ottawa ON K1Y 2Z9	RSC
RSC ID: 2736 RA No: RSC Type: Curr Property Use: Commercial Ministry District: OTTAWA Filing Date: 30-Dec-05 Date Ack: Date Returned: Restoration Type: Soil Type: Criteria: CPU Issued Sect 1686: No Asmt Roll No: Prop ID No (PIN): 04035-0014LT Property Municipal Address: 1233 WELLINGTON ST, OTTAWA, ON, K1Y 2Z9 Mailing Address: 15 FITZGERALD RD, NEPEAN, ON, K2H 9G1 Latitude & Longitude: 45.39994190N 75.73197440W (converted from UTM)					
Cert Date: 9-Dec-05 Cert Prop Use No: No CPU Intended Prop Use: Residential Qual Person Name: Mr. Jonathan Westeinde Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): Yes Accuracy Estimate: 6 to 10 meters Telephone: 613-8205600x158 Fax: Email: jonathan@windmilldevelopments.com					

491 erisinfo.com | Environmental Risk Information Services Order No: 23030600564

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
188	12 of 12	SSW/247.8	64.9 / 2.00	1592541 Ontario Inc. 1233 Wellington St Ottawa ON K2H 9G1	ECA
Approval No:		3385-7MLKFT		MOE District: Ottawa	
Approval Date:		2009-03-25		City:	
Status:		Approved		Longitude: -75.731514	
Record Type:		ECA		Latitude: 45.400032	
Link Source:		IDS		Geometry X:	
SWP Area Name:		Rideau Valley		Geometry Y:	
Approval Type:		ECA-AIR			
Project Type:		AIR			
Business Name:		1592541 Ontario Inc.			
Address:		1233 Wellington St			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/1338-7FAPSU-14.pdf			
PDF Site Location:					
189	1 of 1	E/248.2	62.9 / 0.00	1145 WELLINGTON ST. OTTAWA ON	WWIS
Well ID:		7296559		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Monitoring		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received: 05-Oct-2017 00:00:00	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z206493		Contractor: 7241	
Tag:		A211318		Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):					
Additional Detail(s) (Map)					
Well Completed Date:		2017/09/13			
Year Completed:		2017			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth (m):		9.14			
Latitude:		45.4020687214933			
Longitude:		-75.7273508021622			
Path:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1006759215			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	443076.00
Code OB Desc:				North83:	5027874.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	13-Sep-2017 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006952945				
Layer:	1				
Color:	8				
General Color:	BLACK				
Mat1:					
Most Common Material:					
Mat2:	11				
Mat2 Desc:	GRAVEL				
Mat3:	66				
Mat3 Desc:	DENSE				
Formation Top Depth:	0.0				
Formation End Depth:	0.3100000023841858				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006952947				
Layer:	3				
Color:	2				
General Color:	GREY				
Mat1:	15				
Most Common Material:	LIMESTONE				
Mat2:					
Mat2 Desc:					
Mat3:	74				
Mat3 Desc:	LAYERED				
Formation Top Depth:	1.2200000286102295				
Formation End Depth:	9.140000343322754				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006952946				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:		6			
General Color:		BROWN			
Mat1:		28			
Most Common Material:		SAND			
Mat2:		01			
Mat2 Desc:		FILL			
Mat3:		85			
Mat3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006952956			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006952957			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		5.789999961853027			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006952958			
Layer:		3			
Plug From:		5.789999961853027			
Plug To:		9.140000343322754			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006952955			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006952944			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006952951			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		6.099999904632568			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1006952952			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.099999904632568			
Screen End Depth:		9.140000343322754			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
 <u>Water Details</u>					
Water ID:		1006952950			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1006952949			
Diameter:		7.619999885559082			
Depth From:		1.5199999809265137			
Depth To:		9.140000343322754			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1006952948			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Links</u>					
Bore Hole ID:	1006759215			Tag No:	A211318
Depth M:	9.14			Contractor:	7241
Year Completed:	2017			Path:	729\7296559.pdf
Well Completed Dt:	2017/09/13			Latitude:	45.4020687214933
Audit No:	Z206493			Longitude:	-75.7273508021622
190	1 of 2	NE/249.1	61.9 / -1.00	Enbridge Gas Distribution Inc. 305 Hinchey Ave. Ottawa ON	SPL
Ref No:	8073-B6ALYS			Discharger Report:	
Site No:	NA			Material Group:	
Incident Dt:	2018/11/07			Health/Env Conseq:	2 - Minor Environment Corporation
Year:				Client Type:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Cause:				Sector Type:	Miscellaneous Industrial
Incident Event:	Leak/Break			Agency Involved:	
Contaminant Code:	35			Nearest Watercourse:	
Contaminant Name:	NATURAL GAS (METHANE)			Site Address:	305 Hinchey Ave.
Contaminant Limit 1:				Site District Office:	Ottawa
Contam Limit Freq 1:				Site Postal Code:	
Contaminant UN No 1:	1075			Site Region:	Eastern
Environment Impact:				Site Municipality:	Ottawa
Nature of Impact:				Site Lot:	
Receiving Medium:				Site Conc:	
Receiving Env:	Air			Northing:	
MOE Response:	No			Easting:	
Dt MOE Arvl on Scn:				Site Geo Ref Accu:	
MOE Reported Dt:	2018/11/07			Site Map Datum:	
Dt Document Closed:				SAC Action Class:	TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill
Incident Reason:	Operator/Human Error			Source Type:	Pipeline/Components
Site Name:	Residential<UNOFFICIAL>				
Site County/District:					
Municipality No:					
Site Geo Ref Meth:					
Incident Summary:	TSSA FSB: Enbridge: 1/2" plastic IP nat gas line to atm, made safe				
Contaminant Qty:	0 other - see incident description				

190	2 of 2	NE/249.1	61.9 / -1.00	TSSA INCIDENTS 305 HINCHEY AVE,,OTTAWA,ON,K1Y 1L7,CA ON	PINC
Incident Id:				Pipe Material:	
Incident No:	2435638			Fuel Category:	
Incident Reported Dt:	11/7/2018			Health Impact:	
Type:	FS-Pipeline Incident			Environment Impact:	
Status Code:				Property Damage:	
Tank Status:	Pipeline Damage Reason Est			Service Interrupt:	
Task No:				Enforce Policy:	
Spills Action Centre:				Public Relation:	
Fuel Type:				Pipeline System:	
Fuel Occurrence Tp:				PSIG:	
Date of Occurrence:				Attribute Category:	
Occurrence Start Dt:				Regulator Location:	
Depth:				Method Details:	
Customer Acct Name:	TSSA INCIDENTS				
Incident Address:	305 HINCHEY AVE,,OTTAWA,ON,K1Y 1L7,CA				
Operation Type:					
Pipeline Type:					
Regulator Type:					
Summary:					
Reported By:					
Affiliation:					
Occurrence Desc:					
Damage Reason:					
Notes:					

191	1 of 1	ENE/249.7	61.9 / -1.00	ON	WWIS
Well ID:	7391081			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	29-Jun-2021 00:00:00
Water Type:				Selected Flag:	TRUE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Material:					
Audit No:	C35514			Abandonment Rec:	
Tag:	A267588			Contractor:	1844
Constructn Method:				Form Version:	8
Elevation (m):				Owner:	
Elevatn Reliabilty:				County:	OTTAWA-CARLETON
Depth to Bedrock:				Lot:	
Well Depth:				Concession:	
Overburden/Bedrock:				Concession Name:	
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Clear/Cloudy:				Zone:	
Municipality:		NEPEAN TOWNSHIP		UTM Reliability:	
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1008702267			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	443027.00
Code OB Desc:				North83:	5028032.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	20-May-2021 00:00:00			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Loc Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Links</u>					
Bore Hole ID:	1008702267			Tag No:	A267588
Depth M:				Contractor:	1844
Year Completed:	2021			Path:	
Well Completed Dt:	2021/05/20			Latitude:	45.4034868217679
Audit No:	C35514			Longitude:	-75.7279951174933

Unplottable Summary

Total: **88** Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	City of Ottawa	Wellington St W	Ottawa ON	
CA	City of Ottawa	Wellington Street	Ottawa ON	
CA	City of Ottawa	Wellington St W	Ottawa ON	
CA	Quantum Remediation (Ontario) Inc.	Mobile Facility	Ottawa ON	
CA	Colonnade Development Incorporated		Ottawa ON	
CA	City of Ottawa	Wellington St W	Ottawa ON	
CA	Quantum Remediation Inc.	Mobile Unit	Ottawa ON	
CA	Quantum Remediation Inc.	Mobile System	Ottawa ON	
CA	Quantum Remediation (Ontario) Inc.	Mobile System	Ottawa ON	
CA	City of Ottawa	Hamilton Avenue	Ottawa ON	
CA	Quantum Remediation Inc.	Mobile System	Ottawa ON	
CA	Quantum Remediation Inc.	Mobile Facility	Ottawa ON	
CA	Quantum Remediation Inc.	Mobile Unit	Ottawa ON	
CA	City of Ottawa	Parkdale Avenue	Ottawa ON	
CA	Colonnade Development Incorporated		Ottawa ON	
CA	Quantum Remediation (Ontario) Inc.	Mobile Facility	Ottawa ON	
CA	Quantum Remediation (Ontario) Inc.	Mobile Facility	Ottawa ON	
CA	Quantum Remediation (Ontario) Inc.	Mobile Facility	Ottawa ON	

CA	Garden of the Provinces Park	Wellington Street	Ottawa ON	
CA		Wellington Street	Ottawa ON	
CA	CITY	HINTON AVE.S.	OTTAWA ON	
CA	R.M. OF OTTAWA-CARLETON	HINTO ST./SPENCER ST/OXFORD ST	OTTAWA CITY ON	
CA	R.M. OF OTTAWA-CARLETON	WELLINGTON ST. COMBINED SEWER	OTTAWA CITY ON	
CA	R.M. OF OTTAWA-CARLETON	WELLINGTON ST., VORTEX/DIV.CH.	OTTAWA CITY ON	
CA	OTTAWA CITY	WELLINGTON ST. COMBINED SEWER	OTTAWA CITY ON	
CA	OTTAWA CITY	HAMILTON AVE. S.	OTTAWA CITY ON	
CA	OTTAWA CITY	WELLINGTON STREET	OTTAWA CITY ON	
CONV	IMPERIAL OIL LIMITED		DON MILLS ON	
CONV	IMPERIAL OIL LIMITED		NORTH YORK ON	
EBR	Tomlinson Environmental Services Ltd.	Ottawa Part:5 & 6 Plan:5R-6582 CITY OF OTTAWA	ON	
EBR	Quantum Remediation (Ontario) Inc.	Mobile System Ottawa Ontario Ottawa	ON	
EBR	Quantum Remediation Inc.	Mobile Ottawa Ontario Ottawa	ON	
EBR	Quantum Remediation (Ontario) Inc.	Mobile Unit Ottawa Ontario Ottawa	ON	
EBR	Quantum Remediation (Ontario) Inc.	Mobile Ottawa Ontario Ottawa	ON	
EBR	Quantum Remediation (Ontario) Inc.	Mobile Unit Ottawa Ontario Ottawa	ON	
EBR	Quantum Remediation Inc.	Mobile Unit Ottawa CITY OF OTTAWA	ON	
EBR	Tomlinson Environmental Services Ltd.	Mobile Facility Ottawa CITY OF OTTAWA	ON	
EBR	Quantum Remediation (Ontario) Inc.	Mobile System Ottawa Ontario Ottawa	ON	
EBR	Quantum Remediation Inc.	Mobile Facility Street Ottawa CITY OF OTTAWA	ON	
ECA	Quantum Remediation (Ontario) Inc.	Mobile Facility	Ottawa ON	K2H 9G1

ECA	Quantum Remediation Inc.	Mobile Unit	Ottawa ON	K2H 9G1
ECA	Quantum Remediation (Ontario) Inc.	Mobile Facility	Ottawa ON	K2H 9G1
ECA	Quantum Remediation (Ontario) Inc.	Mobile Facility	Ottawa ON	K2H 9G1
ECA	Quantum Remediation (Ontario) Inc.	Mobile System	Ottawa ON	K2H 9G1
ECA	Quantum Remediation Inc.	Mobile System	Ottawa ON	K2H 9G1
ECA	Quantum Remediation Inc.	Mobile Unit	Ottawa ON	K2H 9G1
ECA	City of Ottawa	Spencer St	Ottawa ON	K1P 1J1
ECA	Tomlinson Environmental Services Ltd.	Mobile Facility	Ottawa ON	K1G 3N4
ECA	Quantum Remediation (Ontario) Inc.	Mobile Facility	Ottawa ON	K2H 9G1
ECA	Tomlinson Environmental Services Ltd.	Mobile Facility	Ottawa ON	K2R 6K7
ECA	Quantum Remediation Inc.	Mobile Facility	Ottawa ON	K2H 9G1
ECA	Quantum Remediation Inc.	Mobile System	Ottawa ON	K2H 9G1
EHS		Hamilton Ave North	Ottawa ON	
GEN	CONSUMER AND CORPORATE AFFAIRS 09-314	LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE.	OTTAWA ON	K1A 0C9
GEN	GVT. OF CANADA-INDUSTRY CANADA	STANDARDS BUILDING TUNNEY'S PASTURE, HOLLAND AVE.	OTTAWA ON	
GEN	GVT. OF CANADA-MEASUREMENT CANADA	HOLLAND AVE., STANDARDS BLDG., (BLDG. #4), TUNNEY'S PASTURE	OTTAWA ON	
GEN	GVT. OF CANADA-MEASUREMENT CANADA	HOLLAND AVENUE, STANDARDS BUILDING BUILDING 4, TUNNEY'S PASTURE	OTTAWA ON	
GEN	GVT. OF CANADA-MEASUREMENT CANADA	HOLLAND AVENUE STANDARDS BUILDING TUNNEY'S PASTURE	OTTAWA ON	K1A 0C9
GEN	CONSUMER AND CORPORATE AFFAIRS	LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE.	OTTAWA ON	K1A 0C9
GEN	CONSUMER (SEE & USE ON1993100) 09-314	LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE.	OTTAWA ON	K1A 0C9
GEN	PCL Construction Canada INC	Wellington street	ottawa ON	L1A0A4
GEN	CONSUMER & CORPORATE AFFAIRS	SCIENTIFIC LAB. STANDARDS BLDG TUNNEY'S PASTURE, HOLLAND AVE/140 PROMENADE DU	PORTAGE, PHASE IV, OTTAWA ON	K1A 0M3

GEN	CONSUMER & CORPORATE AFFAIRS CAN. 18-261	SCIENTIFIC LAB. STANDARDS BLDG TUNNEY'S PASTURE, HOLLAND AVE/140 PROMENADE DU	PORTAGE, PHASE IV, OTTAWA ON	K1A 0M3
GEN	GVT. OF CAN.-PUBLIC WORKS CANADA	PARLIAMENT HILL-EAST, WEST & CENTRE BLK & LIBRARY, WELLINGTON ST./O'CONNOR	OTTAWA ON	K1A 0M3
GEN	Tomlinson Environmental Services	All Catch Basins in the City of Ottawa Serviced by TES-Industrial Waste Division	Ottawa ON	K1N 1J1
LIMO		Lot 37 Concession 1 ON OTTAWA RIVER NEPEAN Ottawa	ON	
NPCB	HEALTH AND WELFARE CANADA	LAB. CENTRE FOR DISEASE CONT.; HOLLAND AVE.	OTTAWA ON	K1A 0L2
SPL	Louis Bray Construction Limited<UNOFFICIAL>	Wellington St. under the Plaza Bridge.	Ottawa ON	
SPL		2-3 blocks down from Wellington	Ottawa ON	
SPL		Southbound lanes on Holland Avenue, south of Wellington Str.	Ottawa ON	
SPL	Tomlinson Environmental Services Ltd.	Carp	Ottawa ON	NA
SPL	Tomlinson Environmental Services Ltd.		Ottawa ON	
SPL	Esso Petroleum Canada, A Division of Imperial Oil Limited	Nepean	Ottawa ON	
SPL	PRIVATE OWNER	LOT 36 CONC 1 CUMBERLAND ORLEANS STORAGE TANK/BARREL	OTTAWA CITY ON	
SPL	ESSO PETROLEUM CANADA	BULK STATION	OTTAWA CITY ON	
SPL	ESSO PETROLEUM CANADA	TRANSPORT TRUCK (CARGO)	OTTAWA CITY ON	
SPL	ESSO PETROLEUM CANADA	TANK TRUCK (CARGO)	OTTAWA CITY ON	
SPL	ESSO PETROLEUM CANADA	ESSO DISTRIBUTION STATION BULK STATION	OTTAWA CITY ON	
SPL	O.C. TRANSP0	PARKDALE ROAD (BETWEEN HOLLAND AND WELLINGTON) OTTAWA SITE 1500 ST. LAURENT BOULEVARD	OTTAWA CITY ON	
SPL	City of Ottawa	Wellington St and Hamilton ST; Wellington St. and Parkdale ST	Ottawa; Ottawa ON	
WDS	Tomlinson Environmental Services Ltd.	Carp	Ottawa ON	K1G 1H3
WDS	Quantum Remediation (Ontario) Inc.	Mobile Facility	Ottawa ON	K2H 9G1
WDS	Tomlinson Environmental Services Ltd.	Carp	Ottawa ON	K0A 1L0

WDS	Tomlinson Environmental Services Ltd.	Carp	Ottawa ON	K1G 1H3
WDS	Tomlinson Environmental Services Ltd.	Carp	Ottawa ON	K0A 1L0
WDS	Tomlinson Environmental Services Ltd.	Carp	Ottawa ON	K1G 3N4
WDS	Quantum Remediation (Ontario) Inc.	Mobile Facility	Ottawa ON	K2H 9G1
WWIS		BULLMAN ST WEST OF PARKDALE	OTTAWA ON	

Unplottable Report

Site: City of Ottawa
Wellington St W Ottawa ON

Database:
CA

Certificate #: 9949-7QUP3J
Application Year: 2009
Issue Date: 4/6/2009
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: City of Ottawa
Wellington Street Ottawa ON

Database:
CA

Certificate #: 9625-65WJYS
Application Year: 2005
Issue Date: 2/7/2005
Approval Type: Air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: City of Ottawa
Wellington St W Ottawa ON

Database:
CA

Certificate #: 9444-7DAKHD
Application Year: 2008
Issue Date: 4/1/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Quantum Remediation (Ontario) Inc.
Mobile Facility Ottawa ON

Database:
CA

Certificate #: 8749-5MJUFH
Application Year: 2003

Issue Date: 5/15/2003
Approval Type: Air
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Colonnade Development Incorporated
Ottawa ON

Database:
CA

Certificate #: 8748-7DGQCH
Application Year: 2008
Issue Date: 4/25/2008
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: City of Ottawa
Wellington St W Ottawa ON

Database:
CA

Certificate #: 8722-7D3S8L
Application Year: 2008
Issue Date: 3/27/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Quantum Remediation Inc.
Mobile Unit Ottawa ON

Database:
CA

Certificate #: 8305-6EBJRY
Application Year: 2005
Issue Date: 9/12/2005
Approval Type: Waste Management Systems
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Quantum Remediation Inc.
Mobile System Ottawa ON

Database:
CA

Certificate #: 8125-6UUKPC
Application Year: 2006
Issue Date: 12/5/2006
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Quantum Remediation (Ontario) Inc.
Mobile System Ottawa ON

Database:
CA

Certificate #: 7422-64ZRHQ
Application Year: 2004
Issue Date: 9/20/2004
Approval Type: Air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: City of Ottawa
Hamilton Avenue Ottawa ON

Database:
CA

Certificate #: 7365-5NNLC2
Application Year: 2003
Issue Date: 6/24/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Quantum Remediation Inc.
Mobile System Ottawa ON

Database:
CA

Certificate #: 3583-7M7RX8
Application Year: 2009
Issue Date: 1/28/2009
Approval Type: Air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:

Contaminants:
Emission Control:

Site: Quantum Remediation Inc.
Mobile Facility Ottawa ON

Database:
CA

Certificate #: 3444-7CFKR7
Application Year: 2008
Issue Date: 3/10/2008
Approval Type: Air
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Quantum Remediation Inc.
Mobile Unit Ottawa ON

Database:
CA

Certificate #: 3202-6NTJ9A
Application Year: 2006
Issue Date: 5/16/2006
Approval Type: Industrial Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: City of Ottawa
Parkdale Avenue Ottawa ON

Database:
CA

Certificate #: 1490-6ENNR6
Application Year: 2005
Issue Date: 7/27/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Colonnade Development Incorporated
Ottawa ON

Database:
CA

Certificate #: 1314-7Z8TPU
Application Year: 2010
Issue Date: 1/4/2010
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:

Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Quantum Remediation (Ontario) Inc.
Mobile Facility Ottawa ON

Database:
CA

Certificate #: 0800-5PAFXG
Application Year: 2003
Issue Date: 7/9/2003
Approval Type: Industrial Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Quantum Remediation (Ontario) Inc.
Mobile Facility Ottawa ON

Database:
CA

Certificate #: 0757-5LLKWS
Application Year: 2003
Issue Date: 5/23/2003
Approval Type: Industrial Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Quantum Remediation (Ontario) Inc.
Mobile Facility Ottawa ON

Database:
CA

Certificate #: 0693-5MJTNJ
Application Year: 2003
Issue Date: 5/15/2003
Approval Type: Air
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Garden of the Provinces Park
Wellington Street Ottawa ON

Database:
CA

Certificate #: 5387-4SNPYM

Application Year: 01
Issue Date: 3/1/01
Approval Type: Industrial air
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the City of Ottawa
Client Address: 111 Lisgar St., Heritage Bldg., 1st Fl., N/W Office
Client City: Ottawa
Client Postal Code: K2P 2L7
Project Description: This application is for a Certificate of Approval to install a granulated activated carbon (GAC) Scrubber, induced draft fan and ancillary equipment to draw air from the Garden of the Provinces shaft and treat the odourous exhaust gases prior to release into the environment.
Contaminants:
Emission Control:

Site: Wellington Street Ottawa ON **Database:** CA

Certificate #: 6456-4MDJXD
Application Year: 00
Issue Date: 7/25/00
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Corporation of the City of Ottawa
Client Address: 111 Sussex Drive, 7th Floor
Client City: Ottawa
Client Postal Code: K1N 5A1
Project Description: Construction of storm sewers on Wellington Street from Clarenton Avenue to Parkdale Avenue and on Wellington Street from Carruthers Avenue to Irving Avenue.
Contaminants:
Emission Control:

Site: CITY HINTON AVE.S. OTTAWA ON **Database:** CA

Certificate #: 3-0162-85-006
Application Year: 85
Issue Date: 3/11/85
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF OTTAWA-CARLETON HINTO ST./SPENCER ST/OXFORD ST OTTAWA CITY ON **Database:** CA

Certificate #: 3-0929-96-
Application Year: 96
Issue Date: 10/8/1996
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:

Emission Control:

Site: R.M. OF OTTAWA-CARLETON
WELLINGTON ST. COMBINED SEWER OTTAWA CITY ON

Database:
CA

Certificate #: 3-0126-97-
Application Year: 97
Issue Date: 4/15/1997
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: R.M. OF OTTAWA-CARLETON
WELLINGTON ST., VORTEX/DIV.CH. OTTAWA CITY ON

Database:
CA

Certificate #: 3-0125-97-
Application Year: 97
Issue Date: 4/27/1998
Approval Type: Municipal sewage
Status:
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: OTTAWA CITY
WELLINGTON ST. COMBINED SEWER OTTAWA CITY ON

Database:
CA

Certificate #: 3-0124-97-
Application Year: 97
Issue Date: 3/27/1997
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: OTTAWA CITY
HAMILTON AVE. S. OTTAWA CITY ON

Database:
CA

Certificate #: 3-1599-89-
Application Year: 89
Issue Date: 8/11/1989
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:

Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: OTTAWA CITY
WELLINGTON STREET OTTAWA CITY ON

Database:
CA

Certificate #: 3-1102-89-
Application Year: 89
Issue Date: 6/12/1989
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: IMPERIAL OIL LIMITED
DON MILLS ON

Database:
CONV

File No:
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: FAILED TO COMPLY WITH CONDITIONS OF C. OF A.
Background:
URL:

Location:
Region: EASTERN REGION
Ministry District:

Additional Details

Publication Date:
Count: 1
Act: OWRA
Regulation:
Section: 66(3)
Act/Regulation/Section: OWRA- -66(3)
Date of Offence:
Date of Conviction:
Date Charged: 6/4/93
Charge Disposition:
Fine: \$6,000
Synopsis:

Site: IMPERIAL OIL LIMITED
NORTH YORK ON

Database:
CONV

File No:
Crown Brief No:
Court Location:
Publication City:

Location:
Region: EASTERN REGION
Ministry District:

Publication Title:**Act:****Act(s):****First Matter:****Second Matter:****Investigation 1:****Investigation 2:****Penalty Imposed:****Description:**

FAILED TO INSPECT OIL/WATER SEPARATOR WEEKLY & MAINTAIN LOG BOOK AT SITE

Background:**URL:****Additional Details****Publication Date:****Count:**

1

Act:

OWRA

Regulation:**Section:**

66(3)

Act/Regulation/Section:

OWRA- -66(3)

Date of Offence:**Date of Conviction:****Date Charged:**

6/4/93

Charge Disposition:**Fine:**

\$4,000

Synopsis:**Additional Details****Publication Date:****Count:**

1

Act:

OWRA

Regulation:**Section:**

66(3)

Act/Regulation/Section:

OWRA- -66(3)

Date of Offence:**Date of Conviction:****Date Charged:**

6/4/93

Charge Disposition:**Fine:**

\$1,000

Synopsis:**Site:** Tomlinson Environmental Services Ltd.
Ottawa Part:5 & 6 Plan:5R-6582 CITY OF OTTAWA ON**Database:**
[EBR](#)**EBR Registry No:** 012-5951
Ministry Ref No: 5776-A4DKE9
Notice Type: Instrument Decision
Notice Stage:
Notice Date: March 07, 2018
Proposal Date: December 03, 2015
Year: 2015**Decision Posted:**
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:**Instrument Type:** (EPA Part II.1-air) - Environmental Compliance Approval (project type: air)**Off Instrument Name:****Posted By:****Company Name:** Tomlinson Environmental Services Ltd.**Site Address:****Location Other:****Proponent Name:****Proponent Address:** 970 Moodie Drive, Ottawa Ontario, Canada K2R 1H3**Comment Period:****URL:****Site Location Details:**

Ottawa Part:5 & 6 Plan:5R-6582 CITY OF OTTAWA

Site: **Quantum Remediation (Ontario) Inc.**
Mobile System Ottawa Ontario Ottawa ON

Database:
EBR

EBR Registry No: IA05E0851
Ministry Ref No: 4406-6CGJ62
Notice Type: Instrument Decision
Notice Stage:
Notice Date: November 13, 2014
Proposal Date: May 26, 2005
Year: 2005
Instrument Type: (EPA Part II.1-air) - Environmental Compliance Approval (project type: air)
Off Instrument Name:
Posted By:
Company Name: Quantum Remediation (Ontario) Inc.
Site Address:
Location Other:
Proponent Name:
Proponent Address: 15 Fitzgerald Road, Suite 200, Ottawa Ontario, K2H 9G1
Comment Period:
URL:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Mobile System Ottawa Ontario Ottawa

Site: **Quantum Remediation Inc.**
Mobile Ottawa Ontario Ottawa ON

Database:
EBR

EBR Registry No: IA06E0450
Ministry Ref No: 0705-6MVK2E
Notice Type: Instrument Decision
Notice Stage:
Notice Date: May 17, 2006
Proposal Date: April 13, 2006
Year: 2006
Instrument Type: (OWRA s. 53(1)) - Approval for sewage works
Off Instrument Name:
Posted By:
Company Name: Quantum Remediation Inc.
Site Address:
Location Other:
Proponent Name:
Proponent Address: 15 Fitzgerald Road , 200, Ottawa Ontario, K2H 9G1
Comment Period:
URL:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Mobile Ottawa Ontario Ottawa

Site: **Quantum Remediation (Ontario) Inc.**
Mobile Unit Ottawa Ontario Ottawa ON

Database:
EBR

EBR Registry No: IA03E0405
Ministry Ref No: 5121-5KEM5P
Notice Type: Instrument Decision
Notice Stage:
Notice Date: May 20, 2003
Proposal Date: March 24, 2003
Year: 2003
Instrument Type: (EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)
Off Instrument Name:
Posted By:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Company Name: Quantum Remediation (Ontario) Inc.
Site Address:
Location Other:
Proponent Name:
Proponent Address: 15 Fitzgerald Road, Suite 200, Ottawa Ontario, K2H 9G1
Comment Period:
URL:

Site Location Details:

Mobile Unit Ottawa Ontario Ottawa

Site: **Quantum Remediation (Ontario) Inc.**
Mobile Ottawa Ontario Ottawa ON

Database:
EBR

EBR Registry No: IA03E0305
Ministry Ref No: 7743-5K6LAD
Notice Type: Instrument Decision
Notice Stage:
Notice Date: May 29, 2003
Proposal Date: March 06, 2003
Year: 2003
Instrument Type: (OWRA s. 53(1)) - Approval for sewage works
Off Instrument Name:
Posted By:
Company Name: Quantum Remediation (Ontario) Inc.
Site Address:
Location Other:
Proponent Name:
Proponent Address: 15 Fitzgerald Road, Suite 200, Ottawa Ontario, K2H 9G1
Comment Period:
URL:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Mobile Ottawa Ontario Ottawa

Site: **Quantum Remediation (Ontario) Inc.**
Mobile Unit Ottawa Ontario Ottawa ON

Database:
EBR

EBR Registry No: IA03E0404
Ministry Ref No: 2160-5KEM28
Notice Type: Instrument Decision
Notice Stage:
Notice Date: May 20, 2003
Proposal Date: March 24, 2003
Year: 2003
Instrument Type: (EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)
Off Instrument Name:
Posted By:
Company Name: Quantum Remediation (Ontario) Inc.
Site Address:
Location Other:
Proponent Name:
Proponent Address: 15 Fitzgerald Road, Suite 200, Ottawa Ontario, K2H 9G1
Comment Period:
URL:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Mobile Unit Ottawa Ontario Ottawa

Site: Quantum Remediation Inc.
Mobile Unit Ottawa CITY OF OTTAWA ON

Database:
EBR

EBR Registry No: 010-0040
Ministry Ref No: 8857-6YFJSB
Notice Type: Instrument Decision
Notice Stage:
Notice Date: December 09, 2014
Proposal Date: March 12, 2007
Year: 2007
Instrument Type: (EPA Part II.1-air) - Environmental Compliance Approval (project type: air)
Off Instrument Name:
Posted By:
Company Name: Quantum Remediation Inc.
Site Address:
Location Other:
Proponent Name:
Proponent Address: 15 Fitzgerald Road , Unit 200, Ottawa Ontario, Canada K2H 9G1
Comment Period:
URL:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Mobile Unit Ottawa CITY OF OTTAWA

Site: Tomlinson Environmental Services Ltd.
Mobile Facility Ottawa CITY OF OTTAWA ON

Database:
EBR

EBR Registry No: 011-5279
Ministry Ref No: 7519-8P2K34
Notice Type: Instrument Decision
Notice Stage:
Notice Date: February 11, 2016
Proposal Date: December 05, 2011
Year: 2011
Instrument Type: (EPA Part II.1-air) - Environmental Compliance Approval (project type: air)
Off Instrument Name:
Posted By:
Company Name: Tomlinson Environmental Services Ltd.
Site Address:
Location Other:
Proponent Name:
Proponent Address: 5597 Power Road, Ottawa Ontario, Canada K1G 3N4
Comment Period:
URL:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Mobile Facility Ottawa CITY OF OTTAWA

Site: Quantum Remediation (Ontario) Inc.
Mobile System Ottawa Ontario Ottawa ON

Database:
EBR

EBR Registry No: IA04E0054
Ministry Ref No: 7151-5UZTCN
Notice Type: Instrument Decision
Notice Stage:
Notice Date: September 22, 2004
Proposal Date: January 14, 2004
Year: 2004
Instrument Type: (EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)
Off Instrument Name:
Posted By:
Company Name: Quantum Remediation (Ontario) Inc.
Site Address:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Location Other:**Proponent Name:****Proponent Address:** 15 Fitzgerald Road, Suite 200, Ottawa Ontario, K2H 9G1**Comment Period:****URL:****Site Location Details:**

Mobile System Ottawa Ontario Ottawa

Site: Quantum Remediation Inc.
Mobile Facility Street Ottawa CITY OF OTTAWA ON**Database:**
EBR

EBR Registry No: 010-0263
Ministry Ref No: 3444-6YCQGH
Notice Type: Instrument Decision
Notice Stage:
Notice Date: March 17, 2008
Proposal Date: April 10, 2007
Year: 2007
Instrument Type: (EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)
Off Instrument Name:
Posted By:
Company Name: Quantum Remediation Inc.
Site Address:
Location Other:
Proponent Name:
Proponent Address: 15 Fitzgerald Road , 200, Ottawa Ontario, Canada K2H 9G1
Comment Period:
URL:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Mobile Facility Street Ottawa CITY OF OTTAWA

Site: Quantum Remediation (Ontario) Inc.
Mobile Facility Ottawa ON K2H 9G1**Database:**
ECA

Approval No: 8749-5MJUFH
Approval Date: 2003-05-15
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Quantum Remediation (Ontario) Inc.
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/5121-5KEM5P-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: Quantum Remediation Inc.
Mobile Unit Ottawa ON K2H 9G1**Database:**
ECA

Approval No: 3202-6NTJ9A
Approval Date: 2006-05-16
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Business Name: Quantum Remediation Inc.
Address: Mobile Unit
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/0705-6MVK2E-14.pdf>
PDF Site Location:

Site: **Quantum Remediation (Ontario) Inc.**
Mobile Facility **Ottawa ON K2H 9G1**

Database:
ECA

Approval No: 0800-5PAFXG
Approval Date: 2003-07-09
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Business Name: Quantum Remediation (Ontario) Inc.
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/7753-5NTMDW-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Quantum Remediation (Ontario) Inc.**
Mobile Facility **Ottawa ON K2H 9G1**

Database:
ECA

Approval No: 0693-5MJTNJ
Approval Date: 2003-05-15
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Quantum Remediation (Ontario) Inc.
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/2160-5KEM28-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Quantum Remediation (Ontario) Inc.**
Mobile System **Ottawa ON K2H 9G1**

Database:
ECA

Approval No: 7422-64ZRHQ
Approval Date: 2004-09-20
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Quantum Remediation (Ontario) Inc.
Address: Mobile System
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/7151-5UZTCN-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Quantum Remediation Inc.**
Mobile System **Ottawa ON K2H 9G1**

Database:
ECA

Approval No: 8125-6UUKPC
Approval Date: 2006-12-05
Status: Approved

MOE District:
City:
Longitude:

Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Business Name: Quantum Remediation Inc.
Address: Mobile System
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/7473-6TRJMB-14.pdf>
PDF Site Location:

Latitude:
Geometry X:
Geometry Y:

Site: **Quantum Remediation Inc.**
Mobile Unit **Ottawa ON K2H 9G1**

Database:
ECA

Approval No: 8305-6EBJRY
Approval Date: 2005-09-12
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-WASTE MANAGEMENT SYSTEMS
Project Type: WASTE MANAGEMENT SYSTEMS
Business Name: Quantum Remediation Inc.
Address: Mobile Unit
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/1349-6EAP8B-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **City of Ottawa**
Spencer St **Ottawa ON K1P 1J1**

Database:
ECA

Approval No: 5318-A8TJM9
Approval Date: 2016-04-08
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Spencer St
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/5482-A8AQK-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Tomlinson Environmental Services Ltd.**
Mobile Facility **Ottawa ON K1G 3N4**

Database:
ECA

Approval No: 1685-A6EJ97
Approval Date: 2016-02-03
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Tomlinson Environmental Services Ltd.
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/7519-8P2K34-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Quantum Remediation (Ontario) Inc.**

Database:
ECA

Mobile Facility Ottawa ON K2H 9G1

Approval No: 0757-5LLKWS
Approval Date: 2003-05-23
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Business Name: Quantum Remediation (Ontario) Inc.
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/7743-5K6LAD-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Tomlinson Environmental Services Ltd.**
Mobile Facility Ottawa ON K2R 6K7

Database:
ECA

Approval No: 7083-BXLJKZ
Approval Date: 2021-03-15
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Business Name: Tomlinson Environmental Services Ltd.
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/5994-BVEHYM-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Quantum Remediation Inc.**
Mobile Facility Ottawa ON K2H 9G1

Database:
ECA

Approval No: 3444-7CFKR7
Approval Date: 2008-03-10
Status: Revoked and/or Replaced
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Quantum Remediation Inc.
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/3444-6YCQGH-13.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Quantum Remediation Inc.**
Mobile System Ottawa ON K2H 9G1

Database:
ECA

Approval No: 3583-7M7RX8
Approval Date: 2009-01-28
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Quantum Remediation Inc.
Address: Mobile System
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/4406-6CGJ62-14.pdf>

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Hamilton Ave North Ottawa ON** **Database:** **EHS**

Order No: 20011212010 **Nearest Intersection:**
Status: C **Municipality:**
Report Type: Custom Report **Client Prov/State:** ON
Report Date: 1/14/02 **Search Radius (km):** 0.25
Date Received: 12/12/01 **X:** -75.72978
Previous Site Name: **Y:** 45.400477
Lot/Building Size:
Additional Info Ordered:

Site: **CONSUMER AND CORPORATE AFFAIRS 09-314** **Database:** **GEN**
LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE. OTTAWA ON K1A 0C9

Generator No: ON0224703
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 94
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Site: **GVT. OF CANADA-INDUSTRY CANADA** **Database:** **GEN**
STANDARDS BUILDING TUNNEY'S PASTURE, HOLLAND AVE. OTTAWA ON

Generator No: ON1993100
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 95,96
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Class: 221
Waste Class Name: LIGHT FUELS

Site: GVT. OF CANADA-MEASUREMENT CANADA
HOLLAND AVE., STANDARDS BLDG., (BLDG. #4), TUNNEY'S PASTURE OTTAWA ON

Database:
GEN

Generator No: ON1993100
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 97,98
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 121
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Class: 253
Waste Class Name: EMULSIFIED OILS

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Class: 241
Waste Class Name: HALOGENATED SOLVENTS

Site: GVT. OF CANADA-MEASUREMENT CANADA
HOLLAND AVENUE, STANDARDS BUILDING BUILDING 4, TUNNEY'S PASTURE OTTAWA ON

Database:
GEN

Generator No: ON1993100
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 99,00,01
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS
Waste Class:	145
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Waste Class:	263
Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Waste Class:	241
Waste Class Name:	HALOGENATED SOLVENTS
Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS
Waste Class:	253
Waste Class Name:	EMULSIFIED OILS
Waste Class:	331
Waste Class Name:	WASTE COMPRESSED GASES
Waste Class:	148
Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS
Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES
Waste Class:	221
Waste Class Name:	LIGHT FUELS

Site: GVT. OF CANADA-MEASUREMENT CANADA
HOLLAND AVENUE STANDARDS BUILDING TUNNEY'S PASTURE OTTAWA ON K1A 0C9

Database:
[GEN](#)

Generator No: ON1993100
SIC Code:
SIC Description:
Approval Years: 02,03,04
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Site: CONSUMER AND CORPORATE AFFAIRS
LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE. OTTAWA ON K1A 0C9

Database:
[GEN](#)

Generator No: ON0224703
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 89,90
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Class: 221
Waste Class Name: LIGHT FUELS

Site: CONSUMER (SEE & USE ON1993100) 09-314
LEGAL METROLOGY BR., STANDARDS BLDG. TUNNEY'S PASTURE, HOLLAND AVE. OTTAWA ON K1A 0C9

Database:
GEN

Generator No: ON0224703
SIC Code: 8125
SIC Description: REGULATORY SERV.
Approval Years: 92,93,95,96,97
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Class: 221
Waste Class Name: LIGHT FUELS

Site: PCL Construction Canada INC
Wellington street ottawa ON L1A0A4

Database:
GEN

Generator No: ON6026033
SIC Code:
SIC Description:
Approval Years: As of Dec 2018
PO Box No:
Country: Canada
Status: Registered
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 212 L
Waste Class Name: Aliphatic solvents and residues

Site: CONSUMER & CORPORATE AFFAIRS
SCIENTIFIC LAB. STANDARDS BLDG TUNNEY'S PASTURE, HOLLAND AVE/140 PROMENADE DU PORTAGE,
PHASE IV, OTTAWA ON K1A 0M3

Database:
GEN

Generator No: ON0224702
SIC Code: 8129
SIC Description: OTHER PROTECT. SERV.
Approval Years: 88
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:

Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Site: CONSUMER & CORPORATE AFFAIRS CAN. 18-261
SCIENTIFIC LAB. STANDARDS BLDG TUNNEY'S PASTURE, HOLLAND AVE/140 PROMENADE DU PORTAGE,
PHASE IV, OTTAWA ON K1A 0M3

Database:
GEN

Generator No: ON0224702
SIC Code: 8129
SIC Description: OTHER PROTECT. SERV.
Approval Years: 92,93,94,95,96,97
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Class: 241
Waste Class Name: HALOGENATED SOLVENTS

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Site: GVT. OF CAN.-PUBLIC WORKS CANADA
PARLIAMENT HILL-EAST, WEST & CENTRE BLK & LIBRARY, WELLINGTON ST./O'CONNOR OTTAWA ON K1A
0M3

Database:
GEN

Generator No: ON0144723
SIC Code: 8159
SIC Description: OTHER GEN. ADMIN.
Approval Years: 92,93,94,95,96,97
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 113
Waste Class Name: ACID WASTE - OTHER METALS

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Class: 243
Waste Class Name: PCB'S

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Site: Tomlinson Environmental Services
 All Catch Basins in the City of Ottawa Serviced by TES-Industrial Waste Division Ottawa ON K1N 1J1

Database:
 GEN

Generator No: ON6691940
SIC Code: 562110, 562990
SIC Description: WASTE COLLECTION, ALL OTHER WASTE MANAGEMENT SERVICES
Approval Years: 2015
PO Box No:
Country: Canada
Status:
Co Admin:
Choice of Contact: CO_OFFICIAL
Phone No Admin:
Contaminated Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

Site: Lot 37 Concession 1 ON OTTAWA RIVER NEPEAN Ottawa ON

Database:
 LIMO

ECA/Instrument No: X1111	Natural Attenuation:
Operation Status: Historic	Liners:
C of A Issue Date:	Cover Material:
C of A Issued to:	Leachate Off-Site:
Lndfl Gas Mgmt (P):	Leachate On Site:
Lndfl Gas Mgmt (F):	Req Coll Lndfl Gas:
Lndfl Gas Mgmt (E):	Lndfl Gas Coll:
Lndfl Gas Mgmt Sys:	Total Waste Rec:
Landfill Gas Mntr:	TWR Methodology:
Leachate Coll Sys:	TWR Unit:
ERC Est Vol (m3):	Tot Aprv Cap Unit:
ERC Volume Unit:	Financial Assurance:
ERC Dt Last Det:	Last Report Year:
Landfill Type:	Region:
Source File Type: Historic and Closed Landfills	District Office:
Fill Rate:	Site County:
Fill Rate Unit:	Lot:
Tot Fill Area (ha):	Concession:
Tot Site Area (ha):	Latitude:

Footprint:
Tot Apprv Cap (m3):
Contam Atten Zone:
Grndwtr Mntr:
Surf Wtr Mntr:
Air Emis Monitor:
Approved Waste Type:
Client Site Name:
ERC Methodology:
Site Name:
Site Location Details: Lot 37 Concession 1 ON OTTAWA RIVER NEPEAN

Ottawa
Service Area:
Page URL:

Longitude:
Easting:
Northing:
UTM Zone:
Data Source:

Site: HEALTH AND WELFARE CANADA
LAB. CENTRE FOR DISEASE CONT.; HOLLAND AVE. OTTAWA ON K1A 0L2

Database:
NPCB

Company Code: O3162
Industry: Public Works Canada
Site Status:
Transaction Date: 5/30/1990
Inspection Date:

Site: Louis Bray Construction Limited<UNOFFICIAL>
Wellington St. under the Plaza Bridge. Ottawa ON

Database:
SPL

Ref No:	0134-7NYKZZ	Discharger Report:	
Site No:		Material Group:	
Incident Dt:		Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Container Leak (Fuel Tank Barrels)	Sector Type:	Other
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:	MUD	Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	Not Anticipated	Site Municipality:	Ottawa
Nature of Impact:		Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	
MOE Response:	No Field Response	Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	2/5/2009	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Watercourse Spills
Incident Reason:	Equipment Failure	Source Type:	
Site Name:	#8 Ottawa Lock System<UNOFFICIAL>		
Site County/District:			
Municipality No:			
Site Geo Ref Meth:			
Incident Summary:	Louis Bray Const: 1ft ³ drilling slurry to Ottawa Locks		
Contaminant Qty:	1 ft3		

Site: 2-3 blocks down from Wellington Ottawa ON

Database:
SPL

Ref No:	2413-8U7NEB	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	11-MAY-12	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:		Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:	15	Nearest Watercourse:	

Contaminant Name:	OIL (PETROLEUM BASED, NOT SPECIFIED)	Site Address:	2-3 blocks down from Wellington
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	Not Anticipated	Site Municipality:	Ottawa
Nature of Impact:		Site Lot:	
Receiving Medium:	Sewage - Municipal/Private and Commercial	Site Conc:	
Receiving Env:		Northing:	
MOE Response:	No Field Response	Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	11-MAY-12	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Pollution Incident Reports (PIRs) and 2Other2 calls
Incident Reason:		Source Type:	
Site Name:	Merton Road<UNOFFICIAL>		
Site County/District:			
Municipality No:			
Site Geo Ref Meth:			
Incident Summary:	PIR: oil spill on Merton Street, Ottawa		
Contaminant Qty:			

Site:	Southbound lanes on Holland Avenue, south of Wellington Str. Ottawa ON		Database: SPL
Ref No:	2841-A49QLB	Discharger Report:	
Site No:	NA	Material Group:	
Incident Dt:	11/14/2015	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:		Sector Type:	Miscellaneous Industrial
Incident Event:		Agency Involved:	
Contaminant Code:	27	Nearest Watercourse:	
Contaminant Name:	COOLANT N.O.S.	Site Address:	Southbound lanes on Holland Avenue, south of Wellington Str.
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:		Site Municipality:	Ottawa
Nature of Impact:		Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	5027650
MOE Response:	No	Easting:	442807
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	11/14/2015	Site Map Datum:	
Dt Document Closed:	11/23/2015	SAC Action Class:	Land Spills
Incident Reason:	Equipment Failure	Source Type:	
Site Name:	Coolant Spill site<UNOFFICIAL>		
Site County/District:			
Municipality No:			
Site Geo Ref Meth:			
Incident Summary:	Ottawa Transit, 25 l coolant on road, cntd & clng		
Contaminant Qty:	25 L		

Site:	Tomlinson Environmental Services Ltd. Carp Ottawa ON NA		Database: SPL
Ref No:	5601-9YDPU5	Discharger Report:	
Site No:	2865-5FNRSP	Material Group:	
Incident Dt:	7/12/2015	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:		Sector Type:	Unknown / N/A
Incident Event:		Agency Involved:	
Contaminant Code:	31	Nearest Watercourse:	
Contaminant Name:	SMOKE	Site Address:	Carp
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	NA
Contaminant UN No 1:		Site Region:	
Environment Impact:		Site Municipality:	Ottawa

Nature of Impact:
Receiving Medium:
Receiving Env:
MOE Response: Yes
Dt MOE Arvl on Scn: 7/16/2015
MOE Reported Dt: 7/13/2015
Dt Document Closed: 9/16/2015
Incident Reason: Unknown / N/A
Site Name: 106 Westhunt Drive
Site County/District:
Municipality No:
Site Geo Ref Meth: NA
Incident Summary: Minor fire at waste transfer station
Contaminant Qty: 0 other - see incident description

Site Lot:
Site Conc:
Northing: 5016191
Easting: 423717
Site Geo Ref Accu: NA
Site Map Datum: NAD83
SAC Action Class: Air Spills - Fires
Source Type:

Site: Tomlinson Environmental Services Ltd.
 Ottawa ON

Database:
 SPL

Ref No: 0701-9KKJ43
Site No: NA
Incident Dt: 2014/05/29
Year:
Incident Cause: Unknown / N/A
Incident Event:
Contaminant Code: 15
Contaminant Name: OIL (PETROLEUM BASED, NOT SPECIFIED)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Environment Impact: Not Anticipated
Nature of Impact: Other Impact(s); Soil Contamination
Receiving Medium:
Receiving Env:
MOE Response: No Field Response
Dt MOE Arvl on Scn:
MOE Reported Dt: 2014/05/29
Dt Document Closed: 2014/11/07
Incident Reason: Unknown / N/A
Site Name: 5555 power Road<UNOFFICIAL>
Site County/District:
Municipality No:
Site Geo Ref Meth:
Incident Summary: Tomlinson Env: 100L oily water to lot, clnd
Contaminant Qty: 100 L

Discharger Report:
Material Group:
Health/Env Conseq:
Client Type:
Sector Type: Unknown / N/A
Agency Involved:
Nearest Watercourse:
Site Address:
Site District Office:
Site Postal Code:
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Northing:
Easting:
Site Geo Ref Accu:
Site Map Datum:
SAC Action Class: Land Spills
Source Type:

Site: Esso Petroleum Canada, A Division of Imperial Oil Limited
 Nepean Ottawa ON

Database:
 SPL

Ref No: 0874-78WNRU
Site No:
Incident Dt:
Year:
Incident Cause: Pipe Or Hose Leak
Incident Event:
Contaminant Code: 13
Contaminant Name: DIESEL FUEL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Environment Impact: Confirmed
Nature of Impact: soil contamiination
Receiving Medium: Land
Receiving Env:
MOE Response: No Field Response
Dt MOE Arvl on Scn:
MOE Reported Dt: 11/13/2007
Dt Document Closed: 11/16/2007

Discharger Report:
Material Group: Oil
Health/Env Conseq:
Client Type:
Sector Type: Tank Truck
Agency Involved:
Nearest Watercourse:
Site Address:
Site District Office:
Site Postal Code:
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Northing:
Easting:
Site Geo Ref Accu:
Site Map Datum:
SAC Action Class:

Incident Reason: Equipment Failure
Site Name: 1961 Merivale Rd<UNOFFICIAL>
Site County/District:
Municipality No:
Site Geo Ref Meth:
Incident Summary: Errentom Tanklines - 8L diesel to grd
Contaminant Qty: 8 L

Source Type:

Site: PRIVATE OWNER
LOT 36 CONC 1 CUMBERLAND ORLEANS STORAGE TANK/BARREL OTTAWA CITY ON

Database:
[SPL](#)

Ref No: 227995
Site No:
Incident Dt:
Year:
Incident Cause: UNKNOWN
Incident Event:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Environment Impact: CONFIRMED
Nature of Impact: Soil contamination
Receiving Medium: LAND
Receiving Env:
MOE Response:
Dt MOE Arvl on Scn:
MOE Reported Dt: 6/12/2002
Dt Document Closed:
Incident Reason: UNKNOWN
Site Name:
Site County/District:
Municipality No: 20107
Site Geo Ref Meth:
Incident Summary: UNKNOWN OWNER- 100 L OF TRANSFORMER OIL TO GRD FROM DRUM.
Contaminant Qty:

Discharger Report:
Material Group:
Health/Env Conseq:
Client Type:
Sector Type:
Agency Involved:
Nearest Watercourse:
Site Address:
Site District Office:
Site Postal Code:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Northing:
Easting:
Site Geo Ref Accu:
Site Map Datum:
SAC Action Class:
Source Type:

Site: ESSO PETROLEUM CANADA
BULK STATION OTTAWA CITY ON

Database:
[SPL](#)

Ref No: 155190
Site No:
Incident Dt: 5/1/1998
Year:
Incident Cause: OTHER CAUSE (N.O.S.)
Incident Event:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Environment Impact: NOT ANTICIPATED
Nature of Impact:
Receiving Medium: LAND
Receiving Env:
MOE Response:
Dt MOE Arvl on Scn:
MOE Reported Dt: 5/1/1998
Dt Document Closed:
Incident Reason: NEGLIGENCE (APPARENT)
Site Name:
Site County/District:
Municipality No: 20101
Site Geo Ref Meth:
Incident Summary: ESSO-156 L DIESEL TO LOT,LOADING ARM NOT IN TRUCKSCOMPARTMENT,PUMP STARTED.
Contaminant Qty:

Discharger Report:
Material Group:
Health/Env Conseq:
Client Type:
Sector Type:
Agency Involved:
Nearest Watercourse:
Site Address:
Site District Office:
Site Postal Code:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Northing:
Easting:
Site Geo Ref Accu:
Site Map Datum:
SAC Action Class:
Source Type:

Site: ESSO PETROLEUM CANADA
TRANSPORT TRUCK (CARGO) OTTAWA CITY ON

Database:
[SPL](#)

Ref No:	59519	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	11/7/1991	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	PIPE/HOSE LEAK	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	NOT ANTICIPATED	Site Municipality:	OTTAWA CITY
Nature of Impact:		Site Lot:	
Receiving Medium:	LAND	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	11/7/1991	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	ERROR	Source Type:	
Site Name:			
Site County/District:			
Municipality No:	20101		
Site Geo Ref Meth:			
Incident Summary:	ESSO-3 LITRES DIESEL FUEL TO GRND UNDER LOADING RACK, COUPLING NOT CLOSED		
Contaminant Qty:			

Site: ESSO PETROLEUM CANADA
TANK TRUCK (CARGO) OTTAWA CITY ON

Database:
[SPL](#)

Ref No:	47843	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	3/19/1991	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	PIPE/HOSE LEAK	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	NOT ANTICIPATED	Site Municipality:	OTTAWA CITY
Nature of Impact:		Site Lot:	
Receiving Medium:	LAND	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	3/20/1991	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	ERROR	Source Type:	
Site Name:			
Site County/District:			
Municipality No:	20101		
Site Geo Ref Meth:			
Incident Summary:	ESSO HOME COMFORT - TANK TRUCK SPILLED APPROX 1 L. HEATING OIL ON GROUND		
Contaminant Qty:			

Site: ESSO PETROLEUM CANADA
ESSO DISTRIBUTION STATION BULK STATION OTTAWA CITY ON

Database:
[SPL](#)

Ref No:	46877	Discharger Report:	

Site No:		Material Group:	
Incident Dt:	2/21/1991	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	CONTAINER OVERFLOW	Sector Type:	
Incident Event:		Agency Involved:	
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	NOT ANTICIPATED	Site Municipality:	OTTAWA CITY
Nature of Impact:		Site Lot:	
Receiving Medium:	LAND	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	2/21/1991	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	ERROR	Source Type:	
Site Name:			
Site County/District:			
Municipality No:	20101		
Site Geo Ref Meth:			
Incident Summary:	ESSO DISTRIB. STATION - 50 L FURNACE OIL SPILLED TO LOADING DOCK. OV/FILL.		
Contaminant Qty:			

Site: O.C. TRANSPO
PARKDALE ROAD (BETWEEN HOLLAND AND WELLINGTON) OTTAWA SITE 1500 ST. LAURENT BOULEVARD
OTTAWA CITY ON

Database:
SPL

Ref No:	110312	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	2/23/1995	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	VALVE/FITTING LEAK OR FAILURE	Sector Type:	
Incident Event:		Agency Involved:	WORKS
Contaminant Code:		Nearest Watercourse:	
Contaminant Name:		Site Address:	
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	NOT ANTICIPATED	Site Municipality:	OTTAWA CITY
Nature of Impact:		Site Lot:	
Receiving Medium:	LAND	Site Conc:	
Receiving Env:		Northing:	
MOE Response:		Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	2/23/1995	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	
Incident Reason:	EQUIPMENT FAILURE	Source Type:	
Site Name:			
Site County/District:			
Municipality No:	20101		
Site Geo Ref Meth:			
Incident Summary:	O.C. TRANSPO BUS: 20 L TRANSMISSION OIL TO ROAD-WAY; CLEANED UP: WORKS		
Contaminant Qty:			

Site: City of Ottawa
Wellington St and Hamilton ST; Wellington St. and Parkdale ST Ottawa; Ottawa ON

Database:
SPL

Ref No:	7731-9CFP6F	Discharger Report:	
Site No:		Material Group:	
Incident Dt:	2013/10/13	Health/Env Conseq:	
Year:		Client Type:	
Incident Cause:	Leak/Break	Sector Type:	Motor Vehicle
Incident Event:		Agency Involved:	
Contaminant Code:	27	Nearest Watercourse:	

Contaminant Name:	COOLANT (N.O.S.)	Site Address:	Wellington St and Hamilton ST; Wellington St. and Parkdale ST
Contaminant Limit 1:		Site District Office:	
Contam Limit Freq 1:		Site Postal Code:	
Contaminant UN No 1:		Site Region:	
Environment Impact:	Possible	Site Municipality:	Ottawa; Ottawa
Nature of Impact:	Surface Water Pollution	Site Lot:	
Receiving Medium:		Site Conc:	
Receiving Env:		Northing:	
MOE Response:	No Field Response	Easting:	
Dt MOE Arvl on Scn:		Site Geo Ref Accu:	
MOE Reported Dt:	2013/10/13	Site Map Datum:	
Dt Document Closed:		SAC Action Class:	Primary Assessment of Spills
Incident Reason:	Other	Source Type:	
Site Name:	Sewer<UNOFFICIAL>; Sewer<UNOFFICIAL>		
Site County/District:			
Municipality No:			
Site Geo Ref Meth:			
Incident Summary:	OC Transpo - coolant to sewer		
Contaminant Qty:	10 L		

Site: Tomlinson Environmental Services Ltd.
Carp Ottawa ON K1G 1H3

Database:
WDS

Approval No:	A461010	Total Area (ha):	
Mob Unit Cert No:		Landfill Cap (m³):	
EBR Registry No:		Transfer Area (ha):	
Status:	Revoked and/or Replaced	Transfer Cap (m³):	
Facility Type:		Transfer Cert No:	
Record Type:	ECA	Inciner. Area (ha):	
Link Source:	IDS	Inciner. Cap (t):	
Project Type:	WASTE DISPOSAL SITES	Process Area (m³):	
Application Status:		Process Cap (m³/d):	
Issue Date:	2015-09-25	Process Vol (m³):	
Input Date:		Process Feed (m³):	
Date Received:		Site Concession:	
Est Closure Date:		Site Region/County:	
Mobile Capacity:		SWP Area Name:	
Mobile Units:		MOE District:	
Mobile Description:		District Office:	
Prop City:		Latitude:	
Prop Postal:		Longitude:	
Prop Phone:		Geometry X:	
Serial Link:		Geometry Y:	
Approval Type:	ECA-WASTE DISPOSAL SITES		
Proponent:			
Prop Address:			
Proponent County/District:			
Full Address:	Carp		
Site Lot:			
Waste Class Code:			
Waste Class:			
Waste Type:			
Waste Type Other:			
Waste Description:			
Landfill Monitoring:			
Landfill Ctrl Type:			
Site Closing Description:			
Project Description:			
Municipalities Served:			
Approval Description:			
Other Approvals/Permits:			
PDF URL:	https://www.accessenvironment.ene.gov.on.ca/instruments/6272-9UPJDZ-14.pdf		
PDF Site Location:			

Site: Quantum Remediation (Ontario) Inc.
Mobile Facility Ottawa ON K2H 9G1

Database:
WDS

Approval No:	6416-5YBQ9R	Total Area (ha):
Mob Unit Cert No:		Landfill Cap (m³):
EBR Registry No:		Transfer Area (ha):
Status:	Approved	Transfer Cap (m³):
Facility Type:		Transfer Cert No:
Record Type:	ECA	Inciner. Area (ha):
Link Source:	IDS	Inciner. Cap (t):
Project Type:	WASTE DISPOSAL SITES	Process Area (m³):
Application Status:		Process Cap (m³/d):
Issue Date:	2004-05-26	Process Vol (m³):
Input Date:		Process Feed (m³):
Date Received:		Site Concession:
Est Closure Date:		Site Region/County:
Mobile Capacity:		SWP Area Name:
Mobile Units:		MOE District:
Mobile Description:		District Office:
Prop City:		Latitude:
Prop Postal:		Longitude:
Prop Phone:		Geometry X:
Serial Link:		Geometry Y:
Approval Type:	ECA-WASTE DISPOSAL SITES	
Proponent:		
Prop Address:		
Proponent County/District:		
Full Address:	Mobile Facility	
Site Lot:		
Waste Class Code:		
Waste Class:		
Waste Type:		
Waste Type Other:		
Waste Description:		
Landfill Monitoring:		
Landfill Ctrl Type:		
Site Closing Description:		
Project Description:		
Municipalities Served:		
Approval Description:		
Other Approvals/Permits:		
PDF URL:	https://www.accessenvironment.ene.gov.on.ca/instruments/9811-5UPSE8-14.pdf	
PDF Site Location:		

Site: Tomlinson Environmental Services Ltd.
Carp Ottawa ON K0A 1L0

Database:
WDS

Approval No:	A461010	Total Area (ha):
Mob Unit Cert No:		Landfill Cap (m³):
EBR Registry No:		Transfer Area (ha):
Status:	Revoked and/or Replaced	Transfer Cap (m³):
Facility Type:		Transfer Cert No:
Record Type:	ECA	Inciner. Area (ha):
Link Source:	IDS	Inciner. Cap (t):
Project Type:	WASTE DISPOSAL SITES	Process Area (m³):
Application Status:		Process Cap (m³/d):
Issue Date:	2011-02-02	Process Vol (m³):
Input Date:		Process Feed (m³):
Date Received:		Site Concession:
Est Closure Date:		Site Region/County:
Mobile Capacity:		SWP Area Name:
Mobile Units:		MOE District:
Mobile Description:		District Office:
Prop City:		Latitude:
Prop Postal:		Longitude:
Prop Phone:		Geometry X:
Serial Link:		Geometry Y:
Approval Type:	ECA-WASTE DISPOSAL SITES	
Proponent:		
Prop Address:		

Proponent County/District:
Full Address: Carp
Site Lot:
Waste Class Code:
Waste Class:
Waste Type:
Waste Type Other:
Waste Description:
Landfill Monitoring:
Landfill Ctrl Type:
Site Closing Description:
Project Description:
Municipalities Served:
Approval Description:
Other Approvals/Permits:
PDF URL:
PDF Site Location:

Site: Tomlinson Environmental Services Ltd.
Carp Ottawa ON K1G 1H3

Database:
[WDS](#)

Approval No:	A461010	Total Area (ha):
Mob Unit Cert No:		Landfill Cap (m³):
EBR Registry No:		Transfer Area (ha):
Status:	Approved	Transfer Cap (m³):
Facility Type:		Transfer Cert No:
Record Type:	ECA	Inciner. Area (ha):
Link Source:	IDS	Inciner. Cap (t):
Project Type:	WASTE DISPOSAL SITES	Process Area (m³):
Application Status:		Process Cap (m³/d):
Issue Date:	2017-06-09	Process Vol (m³):
Input Date:		Process Feed (m³):
Date Received:		Site Concession:
Est Closure Date:		Site Region/County:
Mobile Capacity:		SWP Area Name:
Mobile Units:		MOE District:
Mobile Description:		District Office:
Prop City:		Latitude:
Prop Postal:		Longitude:
Prop Phone:		Geometry X:
Serial Link:		Geometry Y:
Approval Type:	ECA-WASTE DISPOSAL SITES	
Proponent:		
Prop Address:		
Proponent County/District:		
Full Address:	Carp	
Site Lot:		
Waste Class Code:		
Waste Class:		
Waste Type:		
Waste Type Other:		
Waste Description:		
Landfill Monitoring:		
Landfill Ctrl Type:		
Site Closing Description:		
Project Description:		
Municipalities Served:		
Approval Description:		
Other Approvals/Permits:		
PDF URL:	https://www.accessenvironment.ene.gov.on.ca/instruments/6468-A4CR4U-14.pdf	
PDF Site Location:		

Site: Tomlinson Environmental Services Ltd.
Carp Ottawa ON K0A 1L0

Database:
[WDS](#)

Approval No:	A461010	Total Area (ha):
Mob Unit Cert No:		Landfill Cap (m³):

EBR Registry No:		Transfer Area (ha):	
Status:	Revoked and/or Replaced	Transfer Cap (m³):	
Facility Type:		Transfer Cert No:	
Record Type:	ECA	Inciner. Area (ha):	
Link Source:	IDS	Inciner. Cap (t):	
Project Type:	WASTE DISPOSAL SITES	Process Area (m³):	
Application Status:		Process Cap (m³/d):	
Issue Date:	2011-02-02	Process Vol (m³):	
Input Date:		Process Feed (m³):	
Date Received:		Site Concession:	
Est Closure Date:		Site Region/County:	Mississippi Valley
Mobile Capacity:		SWP Area Name:	Ottawa
Mobile Units:		MOE District:	
Mobile Description:		District Office:	
Prop City:		Latitude:	
Prop Postal:		Longitude:	
Prop Phone:		Geometry X:	
Serial Link:		Geometry Y:	
Approval Type:	ECA-WASTE DISPOSAL SITES		
Proponent:			
Prop Address:			
Proponent County/District:			
Full Address:	Carp		
Site Lot:			
Waste Class Code:			
Waste Class:			
Waste Type:			
Waste Type Other:			
Waste Description:			
Landfill Monitoring:			
Landfill Ctrl Type:			
Site Closing Description:			
Project Description:			
Municipalities Served:			
Approval Description:			
Other Approvals/Permits:			
PDF URL:			
PDF Site Location:			

Site: Tomlinson Environmental Services Ltd.
Carp Ottawa ON K1G 3N4

Database:
WDS

Approval No:	A461010	Total Area (ha):	
Mob Unit Cert No:		Landfill Cap (m³):	
EBR Registry No:		Transfer Area (ha):	
Status:	Revoked and/or Replaced	Transfer Cap (m³):	
Facility Type:		Transfer Cert No:	
Record Type:	ECA	Inciner. Area (ha):	
Link Source:	IDS	Inciner. Cap (t):	
Project Type:	WASTE DISPOSAL SITES	Process Area (m³):	
Application Status:		Process Cap (m³/d):	
Issue Date:	2012-04-11	Process Vol (m³):	
Input Date:		Process Feed (m³):	
Date Received:		Site Concession:	
Est Closure Date:		Site Region/County:	
Mobile Capacity:		SWP Area Name:	
Mobile Units:		MOE District:	
Mobile Description:		District Office:	
Prop City:		Latitude:	
Prop Postal:		Longitude:	
Prop Phone:		Geometry X:	
Serial Link:		Geometry Y:	
Approval Type:	ECA-WASTE DISPOSAL SITES		
Proponent:			
Prop Address:			
Proponent County/District:			
Full Address:	Carp		
Site Lot:			

Waste Class Code:
Waste Class:
Waste Type:
Waste Type Other:
Waste Description:
Landfill Monitoring:
Landfill Ctrl Type:
Site Closing Description:
Project Description:
Municipalities Served:
Approval Description:
Other Approvals/Permits:
PDF URL: <https://www.accessenvironment.ene.gov.on.ca/instruments/3389-8KCR2M-14.pdf>
PDF Site Location:

Site: **Quantum Remediation (Ontario) Inc.**
Mobile Facility **Ottawa ON K2H 9G1**

Database:
WDS

Approval No:	3023-6BWNMH	Total Area (ha):	
Mob Unit Cert No:		Landfill Cap (m³):	
EBR Registry No:		Transfer Area (ha):	
Status:	Approved	Transfer Cap (m³):	
Facility Type:		Transfer Cert No:	
Record Type:	ECA	Inciner. Area (ha):	
Link Source:	IDS	Inciner. Cap (t):	
Project Type:	WASTE DISPOSAL SITES	Process Area (m³):	
Application Status:		Process Cap (m³/d):	
Issue Date:	2005-05-24	Process Vol (m³):	
Input Date:		Process Feed (m³):	
Date Received:		Site Concession:	
Est Closure Date:		Site Region/County:	
Mobile Capacity:		SWP Area Name:	
Mobile Units:		MOE District:	
Mobile Description:		District Office:	
Prop City:		Latitude:	
Prop Postal:		Longitude:	
Prop Phone:		Geometry X:	
Serial Link:		Geometry Y:	
Approval Type:	ECA-WASTE DISPOSAL SITES		
Proponent:			
Prop Address:			
Proponent County/District:			
Full Address:	Mobile Facility		

Site Lot:
Waste Class Code:
Waste Class:
Waste Type:
Waste Type Other:
Waste Description:
Landfill Monitoring:
Landfill Ctrl Type:
Site Closing Description:
Project Description:
Municipalities Served:
Approval Description:
Other Approvals/Permits:
PDF URL: <https://www.accessenvironment.ene.gov.on.ca/instruments/4176-5WXJFN-14.pdf>
PDF Site Location:

Site: **BULLMAN ST WEST OF PARKDALE OTTAWA ON**

Database:
WWIS

Well ID:	1535116	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	
Use 2nd:		Data Src:	1
Final Well Status:	Observation Wells	Date Received:	28-Oct-2004 00:00:00

Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z19303	Contractor:	1844
Tag:	A011934	Form Version:	3
Constructn Method:		Owner:	
Elevation (m):		County:	OTTAWA-CARLETON
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	OTTAWA CITY		
Site Info:			

Bore Hole Information

Bore Hole ID:	11172868	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	06-Oct-2004 00:00:00	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Loc Method Desc:	Not Applicable i.e. no UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	932969010
Layer:	2
Color:	2
General Color:	GREY
Mat1:	15
Most Common Material:	LIMESTONE
Mat2:	
Mat2 Desc:	
Mat3:	
Mat3 Desc:	
Formation Top Depth:	0.699999988079071
Formation End Depth:	4.5
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	932969009
Layer:	1
Color:	6
General Color:	BROWN
Mat1:	11
Most Common Material:	GRAVEL
Mat2:	
Mat2 Desc:	
Mat3:	
Mat3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	0.699999988079071

Formation End Depth UOM: m

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933253284
Layer: 1
Plug From: 1.2000000476837158
Plug To: 1.5
Plug Depth UOM: m

**Method of Construction & Well
Use**

Method Construction ID: 961535116
Method Construction Code: 7
Method Construction: Diamond
Other Method Construction:

Pipe Information

Pipe ID: 11181387
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930843185
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From: 0.0
Depth To: 2.5
Casing Diameter: 50.0
Casing Diameter UOM: cm
Casing Depth UOM: m

Construction Record - Screen

Screen ID: 933409114
Layer: 1
Slot: 10
Screen Top Depth: 1.5
Screen End Depth: 4.5
Screen Material: 5
Screen Depth UOM: m
Screen Diameter UOM: cm
Screen Diameter: 70.0

Hole Diameter

Hole ID: 11306039
Diameter: 10.0
Depth From: 0.0
Depth To: 4.5
Hole Depth UOM: m
Hole Diameter UOM: cm

Appendix: Database Descriptions

Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.

Abandoned Aggregate Inventory:

Provincial

[AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial

[AGR](#)

The Ontario Ministry of Northern Development, Mines, Natural Resources and Forestry (ONDMNRF) maintains this database of pits and quarries. The database provides information regarding the registered owner/operator, location name, operation type, approval type, and maximum annual tonnage.

Government Publication Date: Up to Oct 2022

Abandoned Mine Information System:

Provincial

[AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Mar 2022

Anderson's Waste Disposal Sites:

Private

[ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial

[AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private

[AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-May 31, 2022

Borehole:

Provincial

[BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2020

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-May 31, 2022

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -Sep 2022

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Nov 2022

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Jan 31, 2023

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database contains information on more than 113,000 percussion, overburden, sonic and diamond drill holes from assessment files on record with the department of Mines and Minerals. Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted to the MNDM. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Oct 2022

Delisted Fuel Tanks:

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Feb 28, 2022

Environmental Activity and Sector Registry:

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011- Jan 31, 2023

Environmental Registry:

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Jan 31, 2023

Environmental Compliance Approval:

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011- Jan 31, 2023

Environmental Effects Monitoring:

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Dec 31, 2022

Environmental Issues Inventory System:

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2021

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Dec 2022

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: May 31, 2018

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Oct 31, 2022

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Dec 2019

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing is a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 21, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2022

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2021

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Apr 2018

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Jun 30, 2021

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

[NEES](#)

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

[NPCB](#)

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

[NPRI](#)

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

[OGWE](#)

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-Nov 30, 2022**Ontario Oil and Gas Wells:**

Provincial

[OOGW](#)

In 1998, the MNR handed over to the Ontario Oil, Gas and Salt Resources Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database include well owner/operator, location, permit issue date, and well cap date, license No., status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provide for each well record.

Government Publication Date: 1800-Aug 2021**Inventory of PCB Storage Sites:**

Provincial

[OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

[ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Jan 31, 2023**Canadian Pulp and Paper:**

Private

[PAP](#)

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014**Parks Canada Fuel Storage Tanks:**

Federal

[PCFT](#)

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011- Jan 31, 2023

Pipeline Incidents:

Provincial PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Private and Retail Fuel Storage Tanks:

Provincial PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Jan 31, 2023

Ontario Regulation 347 Waste Receivers Summary:

Provincial REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2019

Record of Site Condition:

Provincial RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up.

RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09).

Government Publication Date: 1997-Sept 2001, Oct 2004-Jan 2023

Retail Fuel Storage Tanks:

Private RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-May 31, 2022

Scott's Manufacturing Directory:

Private SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial SPL

List of spills and incidents made available the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X. The Ministry of the Environment, Conservation and Parks cites the coronavirus pandemic as an explanation for delays in releasing data pursuant to requests.

Government Publication Date: 1988-Sep 2020; Dec 2020-Mar 2021

Wastewater Discharger Registration Database:

Provincial

SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2020

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2020

Variances for Abandonment of Underground Storage Tanks:

Provincial

VAR

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

WDS

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011- Jan 31, 2023

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

WDSH

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30th, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERIS's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

WWIS

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Jun 30 2022

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.



HISTORICAL AERIALS

Project Property: Hamilton Avenue, Spencer

Avenue, Parkdale Avenue and Armstrong Street Block

Hamilton Avenue, Spencer Avenue, Parkdale Avenue and Armstrong

Ottawa ON K1Y 1B4

Project No: 122170424.600

Requested By: Stantec Consulting Ltd.

Order No: 23030600564

Date Completed: March 10, 2023

Aerial Maps included in this report are produced by the sources listed above and are to be used for research purposes including a phase I report. Maps are not to be resold as commercial property. ERIS provides no warranty of accuracy or liability. The information contained in this report has been produced using aerial photos listed in above sources by ERIS Information Inc. (in the US) and ERIS Information Limited Partnership (in Canada), both doing business as 'ERIS'. The maps contained in this report do not purport to be and do not constitute a guarantee of the accuracy of the information contained herein. Although ERIS has endeavored to present information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

Date	Source	Scale	Comments
2021	MAXAR TECHNOLOGIES	10,000	
1981	National Air Photo Library	10,000	
1946	National Air Photo Library	10,000	Adjacent Frame Unavailable
1932	National Air Photo Library	10,000	Adjacent Frame Unavailable

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

0 1 cm 2 3



Year: 2021
Source: MAXAR
Scale: 10,000
Comment:

Address: Hamilton Avenue, Spencer Avenue, Parkdale
Avenue and Armstrong Street Block, Ottawa, ON
Approx Center: -75.7305209,45.4021131

Order No: 23030600564



0 1 cm 2 3



Year: 1981
Source: NAPL
Scale: 10,000
Comment:

Address: Hamilton Avenue, Spencer Avenue, Parkdale
Avenue and Armstrong Street Block, Ottawa, ON
Approx Center: -75.7305209,45.4021131

Order No: 23030600564



0 1 cm 2 3



Year: 1946
Source: NAPL
Scale: 10,000
Comment: Adjacent Frame Unavailable

Address: Hamilton Avenue, Spencer Avenue, Parkdale
Avenue and Armstrong Street Block, Ottawa, ON
Approx Center: -75.7305209,45.4021131

Order No: 23030600564



0 1 cm 2 3



Year: 1932
Source: NAPL
Scale: 10,000
Comment: Adjacent Frame Unavailable

Address: Hamilton Avenue, Spencer Avenue, Parkdale
Avenue and Armstrong Street Block, Ottawa, ON
Approx Center: -75.7305209,45.4021131

Order No: 23030600564





CITY DIRECTORY

Project Property: *Hamilton Avenue, Spencer Avenue, Parkdale Avenue and
Armstrong Street Block
Hamilton Avenue, Spencer Avenue, Parkdale Avenue and
Armstrong Street Block
Ottawa, ON K1Y 1B4*

Project No: *122170424.600*

Requested By: *Stantec Consulting Ltd.*

Order No: *23030600564*

Date Completed: *April 11, 2023*

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

April 11, 2023

RE: CITY DIRECTORY RESEARCH

Hamilton Avenue, Spencer Avenue, Parkdale Avenue and Armstrong Street Block
Ottawa, ON K1Y 1B4

Thank you for contacting ERIS for an City Directory Search for the site described above. Our staff has conducted a reverse listing City Directory search to determine prior occupants of the subject site and adjacent properties. We have provided the nearest addresses(s) when adjacent addresses are not listed. If we have searched a range of addresses, all addresses in that range found in the Directory are included.

Note: Reverse Listing Directories generally are focused on more highly developed areas. Newly developed areas may be covered in the more recent years, but the older directories will tend to cover only the "central" parts of the city. To complete the search, we have either utilized the ACPL, Library of Congress, State Archives, and/or a regional library or history center as well as multiple digitized directories. These do not claim to be a complete collection of all reverse listing city directories produced.

ERIS has made every effort to provide accurate and complete information but shall not be held liable for missing, incomplete or inaccurate information. To complete this search we used the general range(s) below to search for relevant findings. If you believe there are additional addresses or streets that require searching please contact us at 866-517-5204.

Search Criteria:

229 of Armstrong Street
233 of Armstrong Street
223 of Armstrong Street
6 of Hamilton Avenue North
12 of Hamilton Avenue North
5 of Hamilton Avenue North
4 of Hamilton Avenue North
3 of Hamilton Avenue North
324 of Parkdale Avenue
340 of Parkdale Avenue
45 of Spencer Street

Search Notes:

Search Results Summary

Date	Source	Comment
2021	DIGITAL BUSINESS DIRECTORY	
2017	DIGITAL BUSINESS DIRECTORY	
2012	DIGITAL BUSINESS DIRECTORY	
2000	POLKS	
1993/94	POLKS	
1988/89	MIGHTS	
1984	MIGHTS	
1979	MIGHTS	
1974	MIGHTS	
1970	MIGHTS	
1966	MIGHTS	
1960	MIGHTS	
1955	MIGHTS	
1950	MIGHTS	
1945	MIGHTS	
1940	MIGHTS	
1934	MIGHTS	
1929	MIGHTS	
1924	MIGHTS	
1920	MIGHTS	

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

- 223ATM...AUTOMATED TELLER MACHINES
- 223CARLETON TAVERN...BARS
- 229PARKDALE GALLERY...ART GALLERIES & DEALERS
- 233FORE SPORTS PLUS...SPORTING GOODS-WHOLESALE

- 3RAILBENDER TATTOO STUDIO-ART...TATTOOING
- 5BEYOND THE PALE BREWING CO...BEER & ALE-RETAIL
- 5JAMARI...CONVENIENCE STORES
- 6DNA 11...ART GALLERIES & DEALERS
- 6VECTOR MEDIA...MARKETING PROGRAMS & SERVICES

340

CROSSFIT HINTONBURG...HEALTH CLUBS STUDIOS & GYMNASIUMS

340

JACK'S UPHOLSTERY...AIRCRAFT UPHOLSTERERS

340

P G ORTHO INC...ARTIFICIAL LIMBS

340

PARKDALE MINI STGE MAILBOXES...STORAGE

NO LISTING FOUND

223

CARLETON TAVERN...DRINKING PLACES, ALCOHOLIC BEVERAGES

233

FORE SPORTS PLUS...SPORTING GOODS MERCHANT WHOLS

3

J D UPHOLSTERY...REUPHOLSTERY & FURNITURE REPAIR

5

BEYOND THE PALE BREWING CO...BREWERIES

6

ARTECH DIGITAL ENTERTAINMENTS...CUSTOM COMPUTER PROGRAMMING SVCS

6

B B M MEDIA...ADVERTISING AGENCIES

6

BIDDLE MC GILLRAY ADVERTISING...MARKETING CONSULTING SVCS

6

CLEAN CODE...COMPUTER SYSTEMS DESIGN SVCS

6

PAT CROTEAU DIGITAL IMAGING...UNCLASSIFIED

6

RTR MEDIA...UNCLASSIFIED

6

VECTOR MEDIA...ADVERTISING AGENCIES

340

P G ORTHO INC...ALL OTHER HEALTH & PERSONAL CARE STORES

340

PARKDALE MINI STORAGE MLBXS...MINIWAREHOUSE & SELFSTORAGE UNIT OPERATORS

45

ELECTRIC MEDIALAND...COMPUTER SYSTEMS DESIGN SVCS

45

RTR MEDIA...ALL OTHER PUBLISHERS

223 CARLETON TAVERN...DRINKING PLACES, ALCOHOLIC BEVERAGES
229 CARLETON STEAK HOUSE...FULL-SERVICE RESTAURANTS
233 ADD ELECTRONICS...RADIO, TV & OTHER ELECTRONICS STORES

3 J D UPHOLSTERY...REUPHOLSTERY & FURNITURE REPAIR
6 ARTECH DIGITAL ENTERTAINMENTS...CUSTOM COMPUTER PROGRAMMING
SVCS
6 BIDDLE MC GILLRAY ADVERTISING...MARKETING CONSULTING SVCS
6 CLEANCODE LIMITED...CUSTOM COMPUTER PROGRAMMING SVCS
6 RTR MEDIA...UNCLASSIFIED

340

KEFALONIA...PAINT & WALL COVERING CONTRS

340

PARKDALE MINI STORAGE & MAIL...MINIWAREHOUSE & SELF-STORAGE UNIT OPERATORS

45

R T R MEDIA...ALL OTHER PUBLISHERS

2000 ARMSTRONG STREET

SOURCE: POLKS

223	CARLETON TAVERN
229	ADDRESS NOT LISTED
233	ADD ELECTRONICS INC

2000 HAMILTON AVENUE NORTH

SOURCE: POLKS

3	HONEYWELL LTD
4	FREDA'S SEWING SERVICES LTD
5	ADDRESS NOT LISTED
6	ARTECH DIGITAL ENTERTAINMENTS
6	RIDEAUWOOD ADDICTION & FAMILY SERVICES
6	RIDEAUWOOD GAMBLING PROGRAM
12	ADDRESS NOT LISTED

2000 PARKDALE AVENUE

SOURCE: POLKS

324 ADDRESS NOT LISTED
340 ADDRESS NOT LISTED

2000 SPENCER STREET

SOURCE: POLKS

45 EXPOSYSTEMS CANADA
45 FUJI GRAPHIC SYSTEMS CANADA INC
45 GRAPHIC DISPLAY CANADA
45 THE ENVELOPE HOUSE

223 CARLETON TAVERN
229 CARLETON STEAK HOUSE
233 NOT VERIFIED

3 HONEYWELL SPERRY AEROSPACE INC
4 FREDA'S SEWING SERVICES LTD
5 ADDRESS NOT LISTED
6 ADDRESS NOT LISTED
12 NOT VERIFIED

324 ADDRESS NOT LISTED
340 VACANT

45 ADDRESS NOT LISTED

223 CARLETON TAVERN
229 CARLETON STEAK HOUSE
233 BILLY'S APPLIANCES SALES & SERVICE LTD

3 HONEYWELL SPERRY AEROSPACE LTD
4 FREDA'S SEWING SERVICES
5 ADDRESS NOT LISTED
6 ADDRESS NOT LISTED
12 NO RETURN

324 ADDRESS NOT LISTED
340 HONEYWELL

45 GRAPHIC DISPLAY CANADA

223

CARLETON TAVERN

229

CARLETON STEAK HOUSE

233

JAGUAR BEAUTY SUPPLY LTD

3

SPERRY GYROSCOPE OTTAWA LTD

4

ADDRESS NOT LISTED

5

ADDRESS NOT LISTED

6

ADDRESS NOT LISTED

12

NO RETURN

324
340

ADDRESS NOT LISTED
SPERRY GYROSCOPE OTT LTD

45

GRAPHIC DISPLAY CANADA

1979 ARMSTRONG STREET

SOURCE: MIGHTS

223 CARLETON TAVERN
229 CARLETON STEAK HOUSE
233 RIDEAU BEAUTY SUPPLY LTD

1979 HAMILTON AVENUE NORTH

SOURCE: MIGHTS

3 SPERRY GYROSCOPE OTTAWA LTD
4 ADDRESS NOT LISTED
5 ADDRESS NOT LISTED
6 ADDRESS NOT LISTED
12 HABITAT

324
340

ADDRESS NOT LISTED
SPERRY GYROSCOPE OTTAWA LTD

45

ADDRESS NOT LISTED

1974 ARMSTRONG STREET*SOURCE: MIGHTS*

223	CARLETON TAVERN
229	CARLETON STEAK HOUSE
233	LACHARITY BEAUTY SUPPLY LTD
233	PRESENTY ENGINEERING PRODUCTS LTD

1974 HAMILTON AVENUE NORTH*SOURCE: MIGHTS*

3	SPERRY GYROSCOPE OTTAWA LTD
4	ADDRESS NOT LISTED
5	ADDRESS NOT LISTED
6	ADDRESS NOT LISTED
12	RESIDENTIAL (1 TENANT)

324

ADDRESS NOT LISTED

340

SPERRY GYROSCOPE OTTAWA LTD

45

ADDRESS NOT LISTED

1970 ARMSTRONG STREET*SOURCE: MIGHTS*

223	CARLETON TAVERN
229	CARLETON STEAK HOUSE
233	BEAUTICIAN'S SUPPLY LTD
233	PRESENTY ENGINEERING PRODUCTS LTD
233	RENOLD CANADA LTD

1970 HAMILTON AVENUE NORTH*SOURCE: MIGHTS*

3	SPERRY GYROSCOPE OTTAWA LTD
4	ADDRESS NOT LISTED
5	ADDRESS NOT LISTED
6	ADDRESS NOT LISTED
12	RESIDENTIAL (1 TENANT)

1970

PARKDALE AVENUE

SOURCE: MIGHTS

324
340

ADDRESS NOT LISTED
SPERRY GYROSCOPE OTTAWA LTD

1970

SPENCER STREET

SOURCE: MIGHTS

45

ADDRESS NOT LISTED

1966 ARMSTRONG STREET*SOURCE: MIGHTS*

223	CARLETON TAVERN
229	CARLETON STEAK HOUSE
233	BEAUTICIAN'S SUPPLY LTD
233	PRESENTY ENGINEERING PRODUCTS LTD

1966 HAMILTON AVENUE NORTH*SOURCE: MIGHTS*

3	SPERRY GYROSCOPE OTTAWA LTD
4	ADDRESS NOT LISTED
5	ADDRESS NOT LISTED
6	ADDRESS NOT LISTED
12	RESIDENTIAL (2 TENANTS)

324
340

ADDRESS NOT LISTED
SPERRY GYROSCOPE OTTAWA LTD

45

ADDRESS NOT LISTED

1960

ARMSTRONG STREET

SOURCE: MIGHTS

223	CARLETON TAVERN
229	CARLETON STEAK HOUSE
233	HENDERSON FURNITURE REPAIR LTD

1960

HAMILTON AVENUE NORTH

SOURCE: MIGHTS

3	SPERRY GYROSCOPE OTTAWA LTD
4	ADDRESS NOT LISTED
5	ADDRESS NOT LISTED
6	RESIDENTIAL (2 TENANTS)
12	RESIDENTIAL (1 TENANT)

324

340

ADDRESS NOT LISTED

ADDRESS NOT LISTED

45

ADDRESS NOT LISTED

1955

ARMSTRONG STREET

SOURCE: MIGHTS

223	CARLETON TAVERN
229	CARLETON STEAK HOUSE
233	OTTAWA SHOE MANUFACTURING CO LTD

1955

HAMILTON AVENUE NORTH

SOURCE: MIGHTS

3	SPERRY GYROSCOPE OTTAWA LTD
4	ADDRESS NOT LISTED
5	ADDRESS NOT LISTED
6	RESIDENTIAL (2 TENANTS)
12	RESIDENTIAL (1 TENANT)

324

ADDRESS NOT LISTED

340

ADDRESS NOT LISTED

45

ADDRESS NOT LISTED

1950

ARMSTRONG STREET

SOURCE: MIGHTS

223	CARLETON HOUSE
229	CARLETON SWEETS
233	STUBBY BEVERAGES

1950

HAMILTON AVENUE NORTH

SOURCE: MIGHTS

3	ONTARIO HUGHES-OWENS CO LTD
4	ADDRESS NOT LISTED
5	BALLENTINE WL CO LTD
5	PORTER JD & SON
6	RESIDENTIAL (3 TENANTS)
12	RESIDENTIAL (1 TENANT)

324

ADDRESS NOT LISTED

340

ADDRESS NOT LISTED

45

ADDRESS NOT LISTED

223 CARLETON HOTEL
229 RESIDENTIAL (1 TENANT)
233 STUBBY BEVERAGES

3 ONTARIO HUGHES OWEN CO
4 ADDRESS NOT LISTED
5 RESIDENTIAL (1 TENANT)
6 RESIDENTIAL (2 TENANTS)
12 RESIDENTIAL (1 TENANT)

324

ADDRESS NOT LISTED

340

ADDRESS NOT LISTED

223

CARLETON HOTEL (223-225)

229

SINGLE TENANT RESIDENTIAL

233

SINGLE TENANT RESIDENTIAL

3	ADDRESS NOT LISTED
4	ADDRESS NOT LISTED
5	ADDRESS NOT LISTED
6	SINGLE TENANT RESIDENTIAL
12	SINGLE TENANT RESIDENTIAL

324	ADDRESS NOT LISTED
340	ADDRESS NOT LISTED

45ADDRESS NOT LISTED

223SINGLE TENANT RESIDENTIAL
229SINGLE TENANT RESIDENTIAL
233VACANT

3ADDRESS NOT LISTED

4ADDRESS NOT LISTED

5ADDRESS NOT LISTED

6SINGLE TENANT RESIDENTIAL

12SINGLE TENANT RESIDENTIAL

324ADDRESS NOT LISTED

340ADDRESS NOT LISTED

45ADDRESS NOT LISTED

223VACANT
229SINGLE TENANT RESIDENTIAL
233ADDRESS NOT LISTED

3	ADDRESS NOT LISTED
4	ADDRESS NOT LISTED
5	ADDRESS NOT LISTED
6	SINGLE TENANT RESIDENTIAL
12	SINGLE TENANT RESIDENTIAL

324	ADDRESS NOT LISTED
340	ADDRESS NOT LISTED

45NOT BUILT UPON

223SINGLE TENANT RESIDENTIAL
229ADDRESS NOT LISTED
233ADDRESS NOT LISTED

3ADDRESS NOT LISTED

4ADDRESS NOT LISTED

5ADDRESS NOT LISTED

6SINGLE TENANT RESIDENTIAL

12SINGLE TENANT RESIDENTIAL

324ADDRESS NOT LISTED

340ADDRESS NOT LISTED

45NOT BUILT UPON

223VACANT
229ADDRESS NOT LISTED
233ADDRESS NOT LISTED

3	ADDRESS NOT LISTED
4	CAPITAL WIRE CLOTH MFG CO, LTD (2-4)
5	ADDRESS NOT LISTED
6	SINGLE TENANT RESIDENTIAL
12	SINGLE TENANT RESIDENTIAL

324	ADDRESS NOT LISTED
340	ADDRESS NOT LISTED

45

NOT BUILT UPON



LAND
REGISTRY
OFFICE #4

04035-0144 (LT)

PAGE 1 OF 7
PREPARED FOR Hope0001
ON 2022/11/07 AT 09:31:56

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

PROPERTY DESCRIPTION: LT 1156, PL 157 ; LTS 1158 & 1159, PL 157 ; LT 1161, PL 157 ; OTTAWA

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK NP133

PIN CREATION DATE:

1996/05/27

OWNERS' NAMES

1000147699 ONTARIO INC.

CAPACITY SHARE

ROWN

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
EFFECTIVE	2000/07/29	THE NOTATION OF THE	"BLOCK IMPLEMENTATION DATE" OF 1996/05/27 ON THIS PIN			
WAS REPLACED WITH THE		"PIN CREATION DATE" OF 1996/05/27				
** PRINTOUT	INCLUDES ALL DOCUMENT TYPES AND	DELETED INSTRUMENTS SINCE 1996/05/24 **				
**SUBJECT,	ON FIRST REGISTRATION UNDER THE	LAND TITLES ACT, TO:				
**	SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES	*				
**	AND ESCHEATS OR FORFEITURE TO THE CROWN.					
**	THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF					
**	IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY					
**	CONVENTION.					
**	ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES.					
**DATE OF CONVERSION TO	LAND TITLES: 1996/05/27 **					
N381536	1987/04/01	TRANSFER		*** COMPLETELY DELETED ***	HONEYWELL LIMITED	
LT1350525	2000/12/21	TRANSFER		*** COMPLETELY DELETED *** HONEYWELL LIMITED	SPENCEDALE PROPERTIES LIMITED	
LT1350526	2000/12/21	NOTICE		HONEYWELL LIMITED		C
	REMARKS: LT1350525.					
OC373808	2004/08/25	CHARGE		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED	LEPAGE, MARC HUOT, LOUISE	
OC373809	2004/08/25	NO ASSGN RENT GEN		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED	LEPAGE, MARC HUOT, LOUISE	

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
OC373810	2004/08/25	NO ASSGN RENT GEN		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED	LEPAGE, MARC HUOT, LOUISE	
OC566288	2006/02/24	CHARGE		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED	EDWARDS, JOANNE	
OC906105	2008/09/23	CHARGE		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED	C.A. BANCORP G.P. INC. C.A.B. REALTY FINANCE L.P.	
OC906106	2008/09/23	NO ASSGN RENT GEN		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED	C.A. BANCORP G.P. INC. C.A.B. REALTY FINANCE L.P.	
	REMARKS: OC906105					
OC906274	2008/09/23	POSTPONEMENT		*** COMPLETELY DELETED *** EDWARDS, JOANNE	C.A. BANCORP G.P. INC. C.A.B. REALTY FINANCE L.P.	
	REMARKS: OC566288 POSTPONED TO OC906105					
OC906277	2008/09/23	DISCH OF CHARGE		*** COMPLETELY DELETED *** LEPAGE, MARC HUOT, LOUISE		
	REMARKS: RE: OC373808					
OC1232182	2011/05/06	TRANSFER OF CHARGE		*** COMPLETELY DELETED *** C.A. BANCORP G.P. INC. C.A.B. REALTY FINANCE L.P.	2018298 ONTARIO INC. NELLCO INC. DELATTRE, MARCEL DELATTRE, JOELLE	
	REMARKS: OC906105.					
OC1232183	2011/05/06	TRANSFER OF CHARGE		*** COMPLETELY DELETED *** EDWARDS, JOANNE	2018298 ONTARIO INC. NELLCO INC. DELATTRE, MARCEL DELATTRE, JOELLE	
	REMARKS: OC566288.					
OC1303770	2011/11/08	CHARGE		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED	2018298 ONTARIO INC.	

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
OC1303858	2011/11/08	DISCH OF CHARGE		MARKTON PROPERTIES LIMITED REMARKS: THIS DOCUMENT WAS RE-INSTATED ON 2016/04/05 AT 13:11 BY GRAY, MARILYN. *** COMPLETELY DELETED *** 2018298 ONTARIO INC. NELLCO INC. DELATTRE, MARCEL DELATTRE, JOELLE	NELLCO INC. DELATTRE, MARCEL DELATTRE, JOELLE	
OC1303860	2011/11/08	DISCH OF CHARGE		*** COMPLETELY DELETED *** 2018298 ONTARIO INC. NELLCO INC. DELATTRE, MARCEL DELATTRE, JOELLE		
OC1407721	2012/09/11	NOTICE	\$2,600	CITY OF OTTAWA	SPENCEDALE PROPERTIES LIMITED	C
OC1536188	2013/11/12	NO ASSGN RENT GEN		*** COMPLETELY DELETED *** MARKTON PROPERTIES LIMITED SPENCEDALE PROPTIES LIMITED	DELATTRE, MARCEL DELATTRE, JOELLE 2018298 ONTARIO INC. NELLCO INC.	
OC1565973	2014/03/18	TRANSFER OF CHARGE		*** COMPLETELY DELETED *** NELLCO INC.	DELATTRE, MARCEL DELATTRE, JOELLE	
OC1568617	2014/03/28	CHARGE		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	LALCO (1985) INC. DELATTRE, MARCEL DELATTRE, JOELLE	
OC1568621	2014/03/28	NO ASSGN RENT GEN		*** COMPLETELY DELETED *** MARKTON PROPERTIES LIMITED SPENCEDALE PROPERTIES LIMITED	LALCO (1985) INC. DELATTRE, MARCEL DELATTRE, JOELLE	
REMARKS: OC1568617						

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
OC1674418	2015/04/17	CAU AGR PUR & SALE		*** COMPLETELY DELETED *** MARKTON PROPERTIES LIMITED SPENCEDALE PROPERTIES LIMITED	TEGA HOMES (ATTIKA) INC.	
REMARKS: 60 DAYS FROM 2015/06/16. EXPIRED - DELETED BY				BULLETIN 89004, 9 MARCH 2016. MW		
OC1690052	2015/06/12	CERTIFICATE		*** COMPLETELY DELETED *** TEGA HOMES (ATTIKA) INC.		
REMARKS: CERTIFICATE OF PENDING LITIGATION						
OC1773734	2016/03/23	CHARGE	\$3,150,000	SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	B & M HANDELMAN INVESTMENTS LTD. 5K INVESTMENTS INC. GRAFSTEIN, DIANE POLLOCK, RONALD POLLOCK, JUDY TEPERMAN, MARVIN BAMBURGH HOLDINGS LTD. CELMAR INVESTMENTS CORP. YERUSHA INVESTMENTS INC. C.S. EISENSTAT ASSOCIATES INC. NATIONAL TIRE SALES AND SERVICE (2011) LTD. 4055845 CANADA INC. GORDON, BEVERLEY SOUTHERN ATLANTIC SERVICE (ONTARIO) LTD. 1886404 ONTARIO INC. SALEM, AMANDA 673830 ONTARIO LIMITED THE BANK OF NOVA SCOTIA TRUST COMPANY THE BANK OF NOVA SCOTIA TRUST COMPANY 593651 ONTARIO LTD. 2227046 ONTARIO LIMITED	C
REMARKS: SEE REGISTRATION OC1773734 FOR SHARES BREAKDOWN						
OC1773735	2016/03/23	NO ASSGN RENT GEN		SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	B & M HANDELMAN INVESTMENTS LTD. 5K INVESTMENTS INC. GRAFSTEIN, DIANE POLLOCK, RONALD POLLOCK, JUDY TEPERMAN, MARVIN BAMBURGH HOLDINGS LTD. CELMAR INVESTMENTS CORP. YERUSHA INVESTMENTS INC. C.S. EISENSTAT ASSOCIATES INC.	C

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

LAND
REGISTRY
OFFICE #4

04035-0144 (LT)

PAGE 5 OF 7
PREPARED FOR Hope0001
ON 2022/11/07 AT 09:31:56

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
					NATIONAL TIRE SALES AND SERVICE (2011) LTD. 4055845 CANADA INC. GORDON, BEVERLEY SOUTHERN ATLANTIC SERVICE (ONTARIO) LTD. 1886404 ONTARIO INC. SALEM, AMANDA 673830 ONTARIO LIMITED THE BANK OF NOVA SCOTIA TRUST COMPANY THE BANK OF NOVA SCOTIA TRUST COMPANY 593651 ONTARIO LTD. 2227046 ONTARIO LIMITED	
OC1773736	2016/03/23	POSTPONEMENT		*** COMPLETELY DELETED *** TEGA HOMES (ATTIKA) INC.		
					B & M HANDELMAN INVESTMENTS LTD. 5K INVESTMENTS INC. GRAFSTEIN, DIANE POLLOCK, RONALD POLLOCK, JUDY TEPERMAN, MARVIN BAMBURGH HOLDINGS LTD. CELMAR INVESTMENTS CORP. YERUSHA INVESTMENTS INC. C.S. EISENSTAT ASSOCIATES INC. NATIONAL TIRE SALES AND SERVICE (2011) LTD. 4055845 CANADA INC. GORDON, BEVERLEY SOUTHERN ATLANTIC SERVICE (ONTARIO) LTD. 1886404 ONTARIO INC. SALEM, AMANDA 673830 ONTARIO LIMITED THE BANK OF NOVA SCOTIA TRUST COMPANY THE BANK OF NOVA SCOTIA TRUST COMPANY 593651 ONTARIO LTD. 2227046 ONTARIO LIMITED	
OC1773820	2016/03/23	DISCH OF CHARGE		*** COMPLETELY DELETED *** DELATTRE, MARCEL DELATTRE, JOELLE		
OC1773821	2016/03/23	DISCH OF CHARGE		*** COMPLETELY DELETED ***		

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
				LALCO (1985) INC. DELATTRE, MARCEL DELATTRE, JOELLE		
OC2066168	2018/12/19	DISCH OF CHARGE		*** COMPLETELY DELETED *** DELATTRE, MARCEL DELATTRE, JOELLE 2018298 ONTARIO INC.		
OC2435806	2021/12/15	TRANSFER OF CHARGE		B & M HANDELMAN INVESTMENTS LTD. 5K INVESTMENTS INC. GRAFSTEIN, DIANE POLLOCK, RONALD POLLOCK, JUDY TEPERMAN, MARVIN BAMBURGH HOLDINGS LTD. CELMAR INVESTMENTS CORP. YERUSHA INVESTMENTS INC. C.S. EISENSTAT ASSOCIATES INC. NATIONAL TIRE SALES AND SERVICE (2011) LTD. 4055845 CANADA INC. GORDON, BEVERLEY SOUTHERN ATLANTIC SERVICE (ONTARIO) LTD. 1886404 ONTARIO INC. SALEM, AMANDA 673830 ONTARIO LIMITED THE BANK OF NOVA SCOTIA TRUST COMPANY THE BANK OF NOVA SCOTIA TRUST COMPANY 593651 ONTARIO LTD. 2227046 ONTARIO LIMITED	TAGGART LAND HOLDINGS (GROUP 1) LTD.	C
OC2435973	2021/12/15	NOTICE		TAGGART LAND HOLDINGS (GROUP 1) LTD.	SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	C
OC2535075	2022/09/12	TRANSFER	\$4,250,000	SPENCEDALE PROPERTIES LIMITED	1000147699 ONTARIO INC.	C
OC2535077	2022/09/12	NOTICE	\$1	TAGGART LAND HOLDINGS (GROUP 1) LTD.	1000147699 ONTARIO INC.	C

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
OC2535078	2022/09/12	CHARGE	\$2,707,430	1000147699 ONTARIO INC.	SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	C
OC2535079	2022/09/12	CHARGE	\$6,000,000	1000147699 ONTARIO INC.	TAGGART LAND HOLDINGS (GROUP 1) LTD.	C
OC2535173	2022/09/12	APL AMEND ORDER		*** COMPLETELY DELETED *** COURT OF APPEAL OF ONTARIO	SPENCEDALE PROPERTIES LIMITED	
		REMARKS: OC1690052 AND OC1773736				
OC2536109	2022/09/14	APL DEL EXECUTION		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED		
		REMARKS: 22-0000370				

LAND
REGISTRY
OFFICE #4

04035-0145 (LT)

PAGE 1 OF 7
PREPARED FOR Hope0001
ON 2022/11/07 AT 09:32:33

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

PROPERTY DESCRIPTION: LT 1163, PL 157 ; LT 1165, PL 157 ; OTTAWA

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK NP133

PIN CREATION DATE:

1996/05/27

OWNERS' NAMES

1000147699 ONTARIO INC.

CAPACITY SHARE

ROWN

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
EFFECTIVE	2000/07/29	THE NOTATION OF THE	"BLOCK IMPLEMENTATION DATE" OF 1996/05/27 ON THIS PIN			
WAS REPLACED WITH THE	"PIN CREATION DATE" OF 1996/05/27					
** PRINTOUT	INCLUDES ALL DOCUMENT TYPES AND	DELETED INSTRUMENTS	SINCE 1996/05/24 **			
**SUBJECT,	ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO:					
**	SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES	*				
**	AND ESCHEATS OR FORFEITURE TO THE CROWN.					
**	THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF					
**	IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY					
**	CONVENTION.					
**	ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES.					
**DATE OF CONVERSION TO	LAND TITLES: 1996/05/27 **					
CR347372	1956/06/08	MECHANICS LIEN		*** COMPLETELY DELETED ***		
CR349289	1956/07/27	CERTIFICATE		*** COMPLETELY DELETED ***		
CR369885	1958/05/24	LEASE		*** COMPLETELY DELETED ***	OTTAWA SHOE MANUFACTURING COMPANY LIMITED	
CR419168	1961/02/20	ASSIGNMENT LEASE		*** COMPLETELY DELETED ***	BROWN, ROBERT H.	
CR424480	1961/06/01	TRANSFER		*** COMPLETELY DELETED ***	LACHARITY, JUNE DAVIDSON	
LT1011376	1996/11/18	APL COURT ORDER		*** COMPLETELY DELETED ***		

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
				LACHARITY, JUNE DAVIDSON		
	REMARKS: DELETING CR347372 AND CR349289					
LT1015415	1996/12/06	TRANSFER		*** COMPLETELY DELETED *** LACHARITY, JUNE DAVIDSON	LACHARITY, EARL GARY	
LT1030006	1997/03/03	CHARGE		*** COMPLETELY DELETED *** LACHARITY, EARL GARY	ROYAL BANK OF CANADA	
LT1030007	1997/03/03	APL (GENERAL)		*** COMPLETELY DELETED *** LACHARITY, EARL GARY		
	REMARKS: DELETING CR369885					
LT1075935	1997/09/23	CHARGE		*** COMPLETELY DELETED *** LACHARITY, EARL GARY	ROYAL BANK OF CANADA	
LT1081957	1997/10/16	DISCH OF CHARGE		*** COMPLETELY DELETED *** ROYAL BANK OF CANADA		
	REMARKS: RE: LT1030006					
OC84065	2002/06/21	CERT TAX ARREARS		*** COMPLETELY DELETED *** CITY OF OTTAWA		
OC97256	2002/07/23	DECLARATION		*** COMPLETELY DELETED *** CITY OF OTTAWA		
	REMARKS: OC84065					
OC583672	2006/04/21	TRANSFER OF CHARGE		*** COMPLETELY DELETED *** ROYAL BANK OF CANADA	STRONGTON HOLDINGS LIMITED	
	REMARKS: LT1075935					
OC590171	2006/05/09	CT TAX ARREAR CANC		*** COMPLETELY DELETED ***	CITY OF OTTAWA	
	REMARKS: RE: OC84065 & OC97256					
OC594513	2006/05/24	CERT TAX ARREARS		*** COMPLETELY DELETED *** CITY OF OTTAWA		
OC672429	2006/12/19	TRANS POWER SALE	\$360,000	STRONGTON HOLDINGS LIMITED	MARKTON PROPERTIES LIMITED	C
	REMARKS: SUBJECT TO EXECUTION 02-0000307 AGAINST LACHARITY, EARL GARY (IF ENFORCEABLE) ; SALE PAPERS UNDER LT1075935 AND OC583672 . . EXECUTION NO. 02-0000307 DELETED UNDER OC874641.					
OC736700	2007/06/28	CT TAX ARREAR CANC		*** COMPLETELY DELETED ***		

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
		REMARKS: RE: OC594513			CITY OF OTTAWA	
OC874641	2008/07/14	APL (GENERAL)		*** COMPLETELY DELETED *** MARKTON PROPERTIES LIMITED		
OC906116	2008/09/23	CHARGE		*** COMPLETELY DELETED *** MARKTON PROPERTIES LIMITED	C.A. BANCORP G.P. INC. C.A.B. REALTY FINANCE L.P.	
OC906117	2008/09/23	NO ASSGN RENT GEN		*** COMPLETELY DELETED *** MARKTON PROPERTIES LIMITED	C.A. BANCORP G.P. INC. C.A.B. REALTY FINANCE L.P.	
		REMARKS: OC906116				
OC1232181	2011/05/06	TRANSFER OF CHARGE		*** COMPLETELY DELETED *** C.A. BANCORP G.P. INC. C.A.B. REALTY FINANCE L.P.	2018298 ONTARIO INC. NELLCO INC. DELATTRE, MARCEL DELATTRE, JOELLE	
		REMARKS: OC906116.				
OC1303770	2011/11/08	CHARGE		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	2018298 ONTARIO INC. NELLCO INC. DELATTRE, MARCEL DELATTRE, JOELLE	
		REMARKS: THIS DOCUMENT WAS RE-INSTATED ON 2016/04/05 AT 13:11 BY GRAY, MARILYN.				
OC1303859	2011/11/08	DISCH OF CHARGE		*** COMPLETELY DELETED *** NELLCO INC. 2018298 ONTARIO INC. DELATTRE, MARCEL DELATTRE, JOELLE		
		REMARKS: OC906116.				
OC1536188	2013/11/12	NO ASSGN RENT GEN		*** COMPLETELY DELETED *** MARKTON PROPERTIES LIMITED SPENCEDALE PROPRTIES LIMITED	DELATTRE, MARCEL DELATTRE, JOELLE 2018298 ONTARIO INC. NELLCO INC.	
		REMARKS: THIS DOCUMENT WAS RE-INSTATED ON 2016/04/05 AT 13:13 BY GRAY, MARILYN.				

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
OC1565973	2014/03/18	TRANSFER OF CHARGE		*** COMPLETELY DELETED *** NELLCO INC.	DELATTRE, MARCEL DELATTRE, JOELLE	
REMARKS: OC1303770. THIS DOCUMENT WAS RE-INSTATED ON 2016/04/05 AT 13:12 BY GRAY, MARILYN.						
OC1568617	2014/03/28	CHARGE		*** COMPLETELY DELETED *** SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	LALCO (1985) INC. DELATTRE, MARCEL DELATTRE, JOELLE	
OC1568621	2014/03/28	NO ASSGN RENT GEN		*** COMPLETELY DELETED *** MARKTON PROPERTIES LIMITED SPENCEDALE PROPERTIES LIMITED	LALCO (1985) INC. DELATTRE, MARCEL DELATTRE, JOELLE	
REMARKS: OC1568617						
OC1581310	2014/05/21	LIEN		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF ONTARIO AS REPRESENTED BY THE MINISTER OF FINANCE		
REMARKS: TAX LIEN						
OC1658167	2015/02/06	DISCHARGE INTEREST		*** COMPLETELY DELETED *** HER MAJESTY THE QUEEN IN RIGHT OF ONTARIO AS REPRESENTED BY THE MINISTER OF FINANCE		
REMARKS: OC1581310.						
OC1674418	2015/04/17	CAU AGR PUR & SALE		*** COMPLETELY DELETED *** MARKTON PROPERTIES LIMITED SPENCEDALE PROPERTIES LIMITED	TEGA HOMES (ATTIKA) INC.	
REMARKS: 60 DAYS FROM 2015/06/16. EXPIRED - DELETED BY BULLETIN 89004, 9 MARCH 2016. MW						
OC1690053	2015/06/12	CERTIFICATE		*** COMPLETELY DELETED *** TEGA HOMES (ATTIKA) INC.		
REMARKS: CERTIFICATE OF PENDING LITIGATION						
OC1773734	2016/03/23	CHARGE	\$3,150,000	SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	B & M HANDELMAN INVESTMENTS LTD. 5K INVESTMENTS INC. GRAFSTEIN, DIANE POLLOCK, RONALD POLLOCK, JUDY TEPERMAN, MARVIN BAMBURGH HOLDINGS LTD. CELMAR INVESTMENTS CORP.	C

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
OC1773735	2016/03/23	NO ASSGN RENT GEN		SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	YERUSHA INVESTMENTS INC. C.S. EISENSTAT ASSOCIATES INC. NATIONAL TIRE SALES AND SERVICE (2011) LTD. 4055845 CANADA INC. GORDON, BEVERLEY SOUTHERN ATLANTIC SERVICE (ONTARIO) LTD. 1886404 ONTARIO INC. SALEM, AMANDA 673830 ONTARIO LIMITED THE BANK OF NOVA SCOTIA TRUST COMPANY THE BANK OF NOVA SCOTIA TRUST COMPANY 593651 ONTARIO LTD. 2227046 ONTARIO LIMITED	C
					B & M HANDELMAN INVESTMENTS LTD. 5K INVESTMENTS INC. GRAFSTEIN, DIANE POLLOCK, RONALD POLLOCK, JUDY TEPERMAN, MARVIN BAMBURGH HOLDINGS LTD. CELMAR INVESTMENTS CORP. YERUSHA INVESTMENTS INC. C.S. EISENSTAT ASSOCIATES INC. NATIONAL TIRE SALES AND SERVICE (2011) LTD. 4055845 CANADA INC. GORDON, BEVERLEY SOUTHERN ATLANTIC SERVICE (ONTARIO) LTD. 1886404 ONTARIO INC. SALEM, AMANDA 673830 ONTARIO LIMITED THE BANK OF NOVA SCOTIA TRUST COMPANY THE BANK OF NOVA SCOTIA TRUST COMPANY 593651 ONTARIO LTD. 2227046 ONTARIO LIMITED	
OC1773737	2016/03/23	POSTPONEMENT		*** COMPLETELY DELETED *** TEGA HOMES (ATTIKA) INC.	B & M HANDELMAN INVESTMENTS LTD. 5K INVESTMENTS INC. GRAFSTEIN, DIANE POLLOCK, RONALD	



PARCEL REGISTER (ABBREVIATED) FOR PROPERTY IDENTIFIER

LAND
REGISTRY
OFFICE #4

04035-0145 (LT)

PAGE 6 OF 7

PREPARED FOR Hope0001

ON 2022/11/07 AT 09:32:33

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
					POLLOCK, JUDY TEPERMAN, MARVIN BAMBURGH HOLDINGS LTD. CELMAR INVESTMENTS CORP. YERUSHA INVESTMENTS INC. C.S. EISENSTAT ASSOCIATES INC. NATIONAL TIRE SALES AND SERVICE (2011) LTD. 4055845 CANADA INC. GORDON, BEVERLEY SOUTHERN ATLANTIC SERVICE (ONTARIO) LTD. 1886404 ONTARIO INC. SALEM, AMANDA 673830 ONTARIO LIMITED THE BANK OF NOVA SCOTIA TRUST COMPANY THE BANK OF NOVA SCOTIA TRUST COMPANY 593651 ONTARIO LTD. 2227046 ONTARIO LIMITED	
	REMARKS: OC1690053 TO OC1773734					
OC1773820	2016/03/23	DISCH OF CHARGE		*** COMPLETELY DELETED *** DELATTRE, MARCEL DELATTRE, JOELLE		
	REMARKS: OC1303770. OC1536188,OC1565973 THIS DOCUMENT WAS RE-INSTATED ON 2016/04/05 AT 13:15 BY GRAY, MARILYN.					
OC1773821	2016/03/23	DISCH OF CHARGE		*** COMPLETELY DELETED *** LALCO (1985) INC. DELATTRE, MARCEL DELATTRE, JOELLE		
	REMARKS: OC1568617. OC1568621					
OC2066168	2018/12/19	DISCH OF CHARGE		*** COMPLETELY DELETED *** DELATTRE, MARCEL DELATTRE, JOELLE 2018298 ONTARIO INC.		
	REMARKS: OC1303770.					
OC2435806	2021/12/15	TRANSFER OF CHARGE		B & M HANDELMAN INVESTMENTS LTD. 5K INVESTMENTS INC. GRAFSTEIN, DIANE POLLOCK, RONALD POLLOCK, JUDY TEPERMAN, MARVIN BAMBURGH HOLDINGS LTD.	TAGGART LAND HOLDINGS (GROUP 1) LTD.	C

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
				CELMAR INVESTMENTS CORP. YERUSHA INVESTMENTS INC. C.S. EISENSTAT ASSOCIATES INC. NATIONAL TIRE SALES AND SERVICE (2011) LTD. 4055845 CANADA INC. GORDON, BEVERLEY SOUTHERN ATLANTIC SERVICE (ONTARIO) LTD. 1886404 ONTARIO INC. SALEM, AMANDA 673830 ONTARIO LIMITED THE BANK OF NOVA SCOTIA TRUST COMPANY THE BANK OF NOVA SCOTIA TRUST COMPANY 593651 ONTARIO LTD. 2227046 ONTARIO LIMITED		
	REMARKS: OC1773734.					
OC2435973	2021/12/15	NOTICE		TAGGART LAND HOLDINGS (GROUP 1) LTD.	SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	C
	REMARKS: OC1773734					
OC2535076	2022/09/12	TRANSFER	\$4,250,000	MARKTON PROPERTIES LIMITED	1000147699 ONTARIO INC.	C
	REMARKS: PLANNING ACT STATEMENTS.					
OC2535077	2022/09/12	NOTICE	\$1	TAGGART LAND HOLDINGS (GROUP 1) LTD.	1000147699 ONTARIO INC.	C
	REMARKS: OC1773734					
OC2535078	2022/09/12	CHARGE	\$2,707,430	1000147699 ONTARIO INC.	SPENCEDALE PROPERTIES LIMITED MARKTON PROPERTIES LIMITED	C
OC2535079	2022/09/12	CHARGE	\$6,000,000	1000147699 ONTARIO INC.	TAGGART LAND HOLDINGS (GROUP 1) LTD.	C
OC2535172	2022/09/12	APL AMEND ORDER		*** COMPLETELY DELETED *** COURT OF APPEAL FOR ONTARIO	MARKTON PROPERTIES LIMITED	
	REMARKS: OC1690053 AND OC1773737					
OC2536110	2022/09/14	APL DEL EXECUTION		*** COMPLETELY DELETED *** MARKTON PROPERTIES LIMITED		
	REMARKS: 22-0000370					

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.

NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

LAND
REGISTRY
OFFICE #4

04035-0146 (LT)

PAGE 1 OF 2
PREPARED FOR Hope0001
ON 2022/08/08 AT 10:11:05

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

PROPERTY DESCRIPTION: PT LT 1160, PL 157 ; PT LT 1162, PL 157 , PART 2 & 3 , 4R1186 ; S/T CR664868 ; OTTAWA

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK NP133

PIN CREATION DATE:

1996/05/27

OWNERS' NAMES

SAIKALEY, LINDA

CAPACITY SHARE

ROWN

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
EFFECTIVE	2000/07/29	THE NOTATION OF THE	"BLOCK IMPLEMENTATION DATE" OF 1996/05/27 ON THIS PIN			
WAS REPLACED WITH THE	"PIN CREATION DATE" OF 1996/05/27					
** PRINTOUT	INCLUDES ALL DOCUMENT TYPES AND	DELETED INSTRUMENTS	SINCE 1996/05/24 **			
**SUBJECT,	ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO:					
**	SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES	*				
**	AND ESCHEATS OR FORFEITURE TO THE CROWN.					
**	THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF					
**	IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY					
**	CONVENTION.					
**	ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES.					
**DATE OF CONVERSION TO	LAND TITLES: 1996/05/27 **					
4R1186	1974/12/20	PLAN REFERENCE				C
CR664868	1975/01/03	TRANSFER	\$80,000		SAIKALEY, TOUFFIC SAIKALEY, LINDA	C
CR664868Z	1975/01/03	REST COV APL ANNEX		*** COMPLETELY DELETED ***		
	REMARKS: DELETED PURSUANT TO BULLETIN 89004 ON 2022/03/11, AMCNICOL.					
NS89155	1980/06/25	TRANSFER		*** DELETED AGAINST THIS PROPERTY ***	CARLETON TAVERN (OTTAWA) LIMITED	
N484962	1989/05/01	CHARGE		*** COMPLETELY DELETED ***	THE TORONTO-DOMINION BANK	
N532984	1990/05/03	CHARGE		*** COMPLETELY DELETED ***		

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
OC696404	2007/03/15	DISCH OF CHARGE		*** COMPLETELY DELETED *** THE TORONTO-DOMINION BANK	THE TORONTO-DOMINION BANK	
OC696407	2007/03/15	DISCH OF CHARGE		*** COMPLETELY DELETED *** THE TORONTO-DOMINION BANK		
OC1227333	2011/04/21	APL OF SURV-LAND		SAIKALEY, TOUFFIC	SAIKALEY, LINDA	C
OC2504444	2022/06/21	APL (GENERAL)		*** COMPLETELY DELETED *** SAIKALEY, LINDA		

LAND
REGISTRY
OFFICE #4

04035-0147 (LT)

PAGE 1 OF 2
PREPARED FOR MacGregor
ON 2022/02/09 AT 08:32:49

* CERTIFIED IN ACCORDANCE WITH THE LAND TITLES ACT * SUBJECT TO RESERVATIONS IN CROWN GRANT *

PROPERTY DESCRIPTION: PT LT 1160, PL 157 ; PT LT 1162, PL 157 ; PT 1, 4R1186 ; AS IN NS89155 EXCEPT CR664868, T/W CR664868 ; OTTAWA

PROPERTY REMARKS:

ESTATE/QUALIFIER:

FEE SIMPLE
LT CONVERSION QUALIFIED

RECENTLY:

FIRST CONVERSION FROM BOOK NP133

PIN CREATION DATE:

1996/05/27

OWNERS' NAMES

CARLETON TAVERN (OTTAWA) LIMITED

CAPACITY SHARE

BENO

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
EFFECTIVE 2000/07/29 THE NOTATION OF THE "BLOCK IMPLEMENTATION DATE" OF 1996/05/27 ON THIS PIN **WAS REPLACED WITH THE "PIN CREATION DATE" OF 1996/05/27** ** PRINTOUT INCLUDES ALL DOCUMENT TYPES AND DELETED INSTRUMENTS SINCE 1996/05/24 ** **SUBJECT, ON FIRST REGISTRATION UNDER THE LAND TITLES ACT, TO: ** SUBSECTION 44(1) OF THE LAND TITLES ACT, EXCEPT PARAGRAPH 11, PARAGRAPH 14, PROVINCIAL SUCCESSION DUTIES * ** AND ESCHEATS OR FORFEITURE TO THE CROWN. ** THE RIGHTS OF ANY PERSON WHO WOULD, BUT FOR THE LAND TITLES ACT, BE ENTITLED TO THE LAND OR ANY PART OF ** IT THROUGH LENGTH OF ADVERSE POSSESSION, PRESCRIPTION, MISDESCRIPTION OR BOUNDARIES SETTLED BY ** CONVENTION. ** ANY LEASE TO WHICH THE SUBSECTION 70(2) OF THE REGISTRY ACT APPLIES. **DATE OF CONVERSION TO LAND TITLES: 1996/05/27 **						
4R1186	1974/12/20	PLAN REFERENCE				C
NS89155	1980/06/25	TRANSFER	\$61,250		CARLETON TAVERN (OTTAWA) LIMITED	C
N485399	1989/05/01	CHARGE		*** COMPLETELY DELETED ***	THE TORONTO-DOMINION BANK	
N532983	1990/05/03	CHARGE		*** COMPLETELY DELETED ***	THE TORONTO-DOMINION BANK	
OC696402	2007/03/15	DISCH OF CHARGE		*** COMPLETELY DELETED *** THE TORONTO-DOMINION BANK		
REMARKS: RE: N532983						
OC696403	2007/03/15	DISCH OF CHARGE		*** COMPLETELY DELETED *** THE TORONTO-DOMINION BANK		

NOTE: ADJOINING PROPERTIES SHOULD BE INVESTIGATED TO ASCERTAIN DESCRIPTIVE INCONSISTENCIES, IF ANY, WITH DESCRIPTION REPRESENTED FOR THIS PROPERTY.
NOTE: ENSURE THAT YOUR PRINTOUT STATES THE TOTAL NUMBER OF PAGES AND THAT YOU HAVE PICKED THEM ALL UP.

REG. NUM.	DATE	INSTRUMENT TYPE	AMOUNT	PARTIES FROM	PARTIES TO	CERT/ CHKD
REMARKS: RE: N4		85399				

Ministry of the Environment, Conservation and Parks

Freedom of Information Request for Property Information

Instructions

Use this form to:

- submit and pay for a new FOI request for access to records/information about a property
- pay for a deposit or a final fee on an existing FOI request

Fields marked with an asterisk (*) are mandatory.

Are you: *

- ☒ Submitting a new FOI Request for Property Information
- ☐ Paying a deposit or final fee for an existing FOI Request for Property Information

Section 1 – Description of Records Requested

Time Period for Records Requested

From (yyyy/mm/dd) *

To (yyyy/mm/dd) *

1800/01/01

2023/03/19

Type of Record(s) *

- ☒ All environmental records relating to the identified property/site exclusive of Environmental Approvals and Registrations
- ☒ Environmental Approvals and Registrations (e.g. Environmental Compliance Approvals; Certificate of Approval; Renewable Energy Approvals; Environmental Activity and Sector Registry Registrations)

Select only if you are seeking access to an Approval or Registration that is not publicly available or if you are also seeking supporting documents relating to the Approval or Registration.

Operator and vendor Pesticide Licenses from September 4, 2018, final Approvals and Registrations are publicly available on the Access Environment website at:

<https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/GoSearch.action?search=basic&lang=en>.

Records of Site Condition (RSC) records are publicly available on the Brownfields Environmental Site Registry (BSER).

- RSC records between 2004 to June 30, 2011 are available at:
<https://www.lrcsde.lrc.gov.on.ca/besrWebPublic/generalSearch>
- RSC records filed after July 2011 are available at:
https://www.lrcsde.lrc.gov.on.ca/BFISWebPublic/pub/earchFiledRsc_search?request_locale=en

☐ Other Specific Document(s)

Type of Approval/Registration *

- ☒ Drinking Water Licenses
- ☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents
- ☒ Pesticide Licenses

Only pesticide licenses post September 2018 are available. Prior to September 2018, only Pesticide license applications and supporting documentation is available

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Permits to Take Water

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

Water Source *

☒ Groundwater ☒ Surface Water

☒ Noise Vibrations Approvals/Registrations

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Air Emissions Approvals/Registrations

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Water Approvals/Registrations - Ontario Water Resources Commission, treatment, ground level, standpipes & elevated storage, pumping stations (local & booster), mains

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Sewage – Treatment, Stormwater, Storm, Leachate & Leachate Treatment & Sewage pump stations, Sanitary

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Waste Water - Industrial discharge

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Waste Sites - Disposal, Landfill sites, Transfer stations, Processing sites, Incinerator sites

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

☒ Waste Management Systems - haulers: sewage, non-hazardous & hazardous waste, mobile waste processing units, Polychlorinated Biphenyls (PCBs) storage, transfer or destruction, Waste Generator Systems)

☐ No Supporting Documents ☒ All Supporting Documents ☐ Some Supporting Documents

Company Name

☒ Waste Generator Registration - number/class

List any record(s) that should be excluded from the scope of your request (e.g. email correspondences; records originating from your organization/business; records already in your possession, prior year(s) annual reports for approvals)

Please provide any additional relevant information relating to your request. For example, does your request relate to any other ministry business? Please note that this information is being requested only in order to provide contextual information to the Access and Privacy Office and will not in any way affect or expedite the status of any related ministry business identified.

This request is being made for a Phase One ESA in support of the filing of a Record of Site Condition.

Section 2 – Requester Information

Last Name *

Gonsalves

First Name *

Romeet

Middle Initial

E

Business/Organization Name (if applicable or indicate "N/A") *

Stantec Consulting Ltd.

Project/Reference Number (if applicable)

122170424.600

Are you submitting this request on behalf of a client? *

☐ Yes ☒ No

Mailing Address

Unit Number

300

Street Number *

1331

Street Name *

Clyde Avenue

PO Box

City/Town *

Ottawa

Province *

ON

Postal Code *

K2C 0A9

Telephone Number *

613-301-6782

ext.

Email Address *

romeet.gonsalves@stantec.com

Is there an alternate contact (e.g. office admin)? *

☐ Yes ☒ No

Section 3 – Current Property Address Information

Is the property a:

☐ Park ☐ Lake ☐ First Nation Band ☐ Wind Farm ☐ Federal Land ☐ Island ☐ Unsurveyed Land

Are you requesting information about multiple addresses? *

☒ Yes ☐ No

Please only submit a request with multiple addresses if the property is one site. To be considered one site, addresses must be adjacent to each other and owned by the same owner(s).

Do the multiple addresses belong to one site? *

☒ Yes ☐ No

Please submit a separate FOI request for each address.

Site Name

Taggart Realty Management Block (Hamilton Ave N, Parkdale Ave, Armstrong St, Spencer St)

Property Address

Address 1

Unit Number

Street Number

Street Name

3

Hamilton Avenue North

Full Lot Number

Concession

Geographic Township

City/Town/Village *

Ottawa

Closest Intersection

Hamilton Avenue North and Spencer Street

Address 2

Unit Number

Street Number

Street Name

233

Armstrong Street

Full Lot Number

Concession

Geographic Township

City/Town/Village *

Ottawa

Closest Intersection

Hamilton Avenue North and Armstrong Street

Address 3

Unit Number

Street Number

Street Name

223

Armstrong Street

Full Lot Number

Concession

Geographic Township

City/Town/Village *

Ottawa

Closest Intersection

Armstrong Street and Parkdale Avenue

Address 4

Unit Number

Street Number

Street Name

229

Armstrong Street

Full Lot Number

Concession

Geographic Township

City/Town/Village *

Ottawa

Closest Intersection

Armstrong Street and Parkdale Avenue

Section 4 – Previous Property Address Information

Do you want the ministry to search all prior historical addresses for this property/site for the time period of the records requested? *

☐ Yes ☒ No

Section 5 – Owner Information

Please provide all present and previous property owner and/or tenant names for the search years requested.

Current Property Owner/Tenant

Address 1

3 Hamilton Avenue North

Ottawa

Owner Name

Taggart Realty Management Inc.

Date of Ownership (yyyy/mm/dd)

Tenant Name

Address 2

233 Armstrong Street
Ottawa

Owner Name

Taggart Realty Management Inc.

Date of Ownership (yyyy/mm/dd)

Tenant Name

Address 3

223 Armstrong Street
Ottawa

Owner Name

Taggart Realty Management Inc.

Date of Ownership (yyyy/mm/dd)

Tenant Name

Address 4

229 Armstrong Street
Ottawa

Owner Name

Taggart Realty Management Inc.

Date of Ownership (yyyy/mm/dd)

Tenant Name

Section 6 – Supporting Documents

Please upload any documents (e.g. Maps) that are relevant to your FOI request.

The total size of all attachments must not be more than 8 MB.

1. File Name

Taggart Block.PNG

Total File Size

2.18 MB

Payment confirmation number: 25658554

**Ministry of the Environment,
Conservation and Parks**

Access and Privacy Office

12th Floor
40 St. Clair Avenue West
Toronto ON M4V 1M2
Tel: (416) 314-4075

**Ministère de l'Environnement, de la
Protection de la nature et des Parcs**

Bureau de l'accès à l'information et
de la protection de la vie privée

12^e étage
40, avenue St. Clair ouest
Toronto ON M4V 1M2
Tél. : (416) 314-4075



May 3, 2023

Romeet Gonsalves
Stantec Consulting Ltd.
400 - 1331 Clyde Avenue
Ottawa, Ontario K2C 3G4
romeet.gonsalves@stantec.com

Dear Romeet Gonsalves:

RE: MECP FOI A-2023-01769, Your Reference #: 122170424.600 – Fee Estimate Letter

This letter is in response to your request made pursuant to the Freedom of Information and Protection of Privacy Act (the Act) relating to 3 Hamilton Avenue North, 223, 229 and 233 Armstrong Street, Ottawa.

After a thorough search through the files of the ministry's Ottawa District Office, and Environmental Monitoring and Reporting Branch (EMRB), records were located in response to your request.

Although a final decision has not been made regarding access, the following exemptions under the Act may apply to the records at issue: section 21 personal information and/or section 17 third party information which will require notice to the third party under section 28.

In accordance with Section 57 of the Act, the estimated fee is:

Search Time 44.08 hours @ \$30/hour ○ Time taken to locate and retrieve records	\$1,322.50
Preparation Time 5.42 hours @ \$30/hour ○ Time taken to scan 6500 hardcopy pages (1,200 pages/hour) ¹	\$162.50
Total Fee Estimate	\$1,485.00
Payment Required (50% of fee estimate)	\$742.50

The exemptions applied and the fees are subject to revision upon completion of review. Any revision in excess of \$1485.00 will be submitted for your approval.

¹ Office of the Information and Privacy Commission/Ontario (IPC) Order PO-3621.

Regulation 460 states that where the fee estimate is over \$100.00, an institution may request a deposit equal to 50% of the estimated fee. Your request will continue once your fee deposit is received in the amount of \$742.50. Please send the deposit by **June 2, 2023**. Do **not** send the full estimate at this time. If payment has not been received by this date, we will consider your request abandoned and close the file. Once the file is closed, you will be required to submit a new request.

The ministry's Ottawa District Office and Environmental Assessment and Permissions Division (EAPD) has advised that there are inactive records in the Records Centre, Mississauga, and below is a description of these records:

- ECA #, Media Type, Proponent name, ECA Status, Record location, File storage, Year 8067-76SQVA, Air, Honeywell Limited, Approved, offsite, 0034, 2007

If you would like us to retrieve these files, please submit a separate request quoting this file number. The \$5 application fee will be applied towards any costs incurred with the retrieval of the records from the Records Centre.

Payment(s) may be made by one of the following options:

- Pay online through the [Freedom of Information Request for Property Information Form https://forms.mgcs.gov.on.ca/en/dataset/012-2146](https://forms.mgcs.gov.on.ca/en/dataset/012-2146). Both the pdf download or "HTML" versions provide access to the payment option.
- Mail money order or cheque made payable to the "Minister of Finance (FOI)" or provide credit card information through the mail-in version of the form mentioned above.

Please **do not** mail cash or send your payment information via email.

Please be advised that the ministry may seek additional time in order to complete your request due to a large volume of records that must be searched or reviewed, approximately 7618 pages.

If you disagree with any aspect of the fee or wish to revise / narrow the scope of your request, **please contact us** quoting the request number.

You may request a review of my decision within 30 days from the date of this letter by contacting the Information and Privacy Commissioner/Ontario at <http://www.ipc.on.ca>. Please note there may be a fee associated with submitting the appeal.

If you have any questions, please contact Tolani Abraham at Tolani.Abraham2@ontario.ca.

Yours truly,

ORIGINAL SIGNED BY

Ryan Gunn
Manager (A), Access and Privacy Office



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1.877.682.8772
www.tssa.org

31 March 2023

**Romeet Gonsalves
Stantec Consulting
Ltd.
1331 Clyde Avenue
Ottawa, Ontario**

**Subject: 223 ARMSTRONG STREET, OTTAWA, ON
Your File No.: 122170424.600
WO No.: 8285928**

Dear Madam/Sir:

We are in receipt of your correspondence wherein you requested the release of information regarding the above noted address.

A search of TSSA public records **did not** locate any records relating to the following Program(s):

<u>Program</u>	<u>No Record</u>
Fuels Safety	☒
Boiler/Pressure Vessel	☐
Elevating & Amusement Devices	☐

**For BPV, if it has been indicated that records have been located but are not attached, it is likely that TSSA may not be the keeper of the records you are looking for, see note below.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

Should you have any questions, please contact Public Information at publicinformationservices@tssa.org.

Yours truly,

N. Carty

Nicola Carty
Public Information Services

Limitations and Notices:

General:

TSSA, as a safety regulator, uses inspection resources to address the greatest harm posed to the public. Thus, inspection only follows-up on safety orders it issues based on the degree of risk posed by the non-compliance identified in the order(s). All high-risk orders will result in a follow-up inspection by TSSA until the non-compliance is resolved. TSSA no longer follows-up on low or medium risk orders referred to as safety tasks, therefore, TSSA can no longer provide you with a report indicating the safety tasks (low and medium-risk orders) have been resolved. This information should be obtained from the device/facility owner or their contractor. One can also engage a third-party contractor to confirm device/facility compliance.

The Public Information Department, (PID), can only provide **existing** records for a specific location, facility, or device. If an inspection or any other type of record does not exist, PID cannot instruct TSSA to do work, such as an inspection, to create a record. TSSA, as an outcome-based regulator, deploys all of its resources, including, inspections to address the greatest harm posed to the public; and as such, cannot deploy resources to create records to satisfy an inquiry.

Please Note: While the PID provides existing records for a specific location, facility, or device; it does not interpret or provide further explanations of the content contained in the document.

TSSA Fuels Safety:

If you have environmental concerns regarding this property, you should consider hiring an environmental consultant to conduct an environmental assessment of the property in question.

- Sites that have not been licensed since 1987 may not be in TSSA records.
- Be advised, TSSA Fuels Safety Division did not register:
 - private fuel underground/ aboveground storage tanks prior to January of 1990; and
 - furnace oil tanks prior to May 1, 2002.
- Fuels Safety Division does not register
 - private waste oil tanks in apartments, office buildings, residences etc.; and
 - aboveground gas or diesel tanks.
- The *Technical Standards and Safety Act* and associated regulations do not require the registration of private fuel outlets, nor does it require that any documentation on these facilities be submitted to or reviewed or approved by TSSA. As a result, TSSA has limited information on these facilities. TSSA cautions that any information provided may be inaccurate, incomplete or out of date.

TSSA Elevating & Amusement Devices Program Notice:

- All orders and/or directions issued by the TSSA Inspector have a compliance date and the owner or designated contractor are required to comply within the specified time limit. Compliance is the responsibility of the owner or operator of the device.
- All written declarations of compliance (where eligible) should be sent to TSSA. Once a declaration of compliance has been received, the outstanding order will be resolved.
- Each report shows the details and date of the inspection conducted by TSSA at the requested location.
- The Ontario Amusement Devices Regulation (O. Reg. 221/01) was adopted in 2001. Since that time, TSSA retains copies of technical dossiers of new amusement devices in Ontario (as per TSSA's retention policy). However, for rides that existed prior to the adoption of the Regulation, which were

subject to a “grandfathering-in” clause, technical dossiers were not required to be filed with the TSSA. However, if the amusement ride remains in operation, as per ASTM requirements, the owner/licensee must possess an operations document for the device in question.

Federal Elevators

- Please be advised that without the express written consent of the owner, the TSSA does not release any information with respect to federal elevators or federal elevating equipment. The TSSA is a provincial regulator for the province of Ontario and federal elevators do not fall within the scope of TSSA's provincial mandate and the *Technical Standards and Safety Act* and associated Regulations. Further, the TSSA's Access and Privacy Code only applies to information collected, used, or disclosed by the TSSA in the course of TSSA's administration of the *Act*. Therefore, information with respect to federal elevators or federal elevator equipment is outside of the administration of the *Act*, and outside of the scope of the TSSA's Access and Privacy Codes.

Indigenous Lands

- Please be advised that the TSSA does not release any information with respect to indigenous lands, which are outside of the TSSA's mandate, without the express written permission from the Band. The *Technical Standards and Safety Act*, associated regulations, and TSSA's Access and Privacy Code does not apply to indigenous lands.

TSSA Boilers and Pressure Vessels (BPVs) Program Notice:

- Be advised, TSSA does not typically periodically inspect BPVs. These inspections are usually performed by insurance companies.
- **Inspection reports may not be submitted to TSSA by insurance companies; therefore, while TSSA may have some evidence of a BPV at a location on file, there may be no inspection records pertaining to BPVs located at the address provided.
- As of July 1, 2018, BPVs in Ontario may not be operated unless the Director has issued a current certificate of inspection (COI) to the owner or operator. A COI will be issued to the owner or operator of the BPV by TSSA after TSSA has received a Record of Inspection (ROI) from the insurer/third-party inspector, the associated fees have been paid and the BPV has passed a periodic inspection.
- Please note that if the BPV in question is insured, the insurance company may have additional inspection records. Please contact the insurer directly should you wish to obtain further information.



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1.877.682.8772
www.tssa.org

31 March 2023

**Romeet Gonsalves
Stantec Consulting
Ltd.
1331 Clyde Avenue
Ottawa, Ontario**

**Subject: 229 ARMSTRONG STREET, OTTAWA, ON
Your File No.: 122170424.600
WO No.: 8285930**

Dear Madam/Sir:

We are in receipt of your correspondence wherein you requested the release of information regarding the above noted address.

A search of TSSA public records **did not** locate any records relating to the following Program(s):

<u>Program</u>	<u>No Record</u>
Fuels Safety	☒
Boiler/Pressure Vessel	☐
Elevating & Amusement Devices	☐

**For BPV, if it has been indicated that records have been located but are not attached, it is likely that TSSA may not be the keeper of the records you are looking for, see note below.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

Should you have any questions, please contact Public Information at publicinformationservices@tssa.org.

Yours truly,

N. Carty

Nicola Carty
Public Information Services

Limitations and Notices:

General:

TSSA, as a safety regulator, uses inspection resources to address the greatest harm posed to the public. Thus, inspection only follows-up on safety orders it issues based on the degree of risk posed by the non-compliance identified in the order(s). All high-risk orders will result in a follow-up inspection by TSSA until the non-compliance is resolved. TSSA no longer follows-up on low or medium risk orders referred to as safety tasks, therefore, TSSA can no longer provide you with a report indicating the safety tasks (low and medium-risk orders) have been resolved. This information should be obtained from the device/facility owner or their contractor. One can also engage a third-party contractor to confirm device/facility compliance.

The Public Information Department, (PID), can only provide **existing** records for a specific location, facility, or device. If an inspection or any other type of record does not exist, PID cannot instruct TSSA to do work, such as an inspection, to create a record. TSSA, as an outcome-based regulator, deploys all of its resources, including, inspections to address the greatest harm posed to the public; and as such, cannot deploy resources to create records to satisfy an inquiry.

Please Note: While the PID provides existing records for a specific location, facility, or device; it does not interpret or provide further explanations of the content contained in the document.

TSSA Fuels Safety:

If you have environmental concerns regarding this property, you should consider hiring an environmental consultant to conduct an environmental assessment of the property in question.

- Sites that have not been licensed since 1987 may not be in TSSA records.
- Be advised, TSSA Fuels Safety Division did not register:
 - private fuel underground/ aboveground storage tanks prior to January of 1990; and
 - furnace oil tanks prior to May 1, 2002.
- Fuels Safety Division does not register
 - private waste oil tanks in apartments, office buildings, residences etc.; and
 - aboveground gas or diesel tanks.
- The *Technical Standards and Safety Act* and associated regulations do not require the registration of private fuel outlets, nor does it require that any documentation on these facilities be submitted to or reviewed or approved by TSSA. As a result, TSSA has limited information on these facilities. TSSA cautions that any information provided may be inaccurate, incomplete or out of date.

TSSA Elevating & Amusement Devices Program Notice:

- All orders and/or directions issued by the TSSA Inspector have a compliance date and the owner or designated contractor are required to comply within the specified time limit. Compliance is the responsibility of the owner or operator of the device.
- All written declarations of compliance (where eligible) should be sent to TSSA. Once a declaration of compliance has been received, the outstanding order will be resolved.
- Each report shows the details and date of the inspection conducted by TSSA at the requested location.
- The Ontario Amusement Devices Regulation (O. Reg. 221/01) was adopted in 2001. Since that time, TSSA retains copies of technical dossiers of new amusement devices in Ontario (as per TSSA's retention policy). However, for rides that existed prior to the adoption of the Regulation, which were

subject to a “grandfathering-in” clause, technical dossiers were not required to be filed with the TSSA. However, if the amusement ride remains in operation, as per ASTM requirements, the owner/licensee must possess an operations document for the device in question.

Federal Elevators

- Please be advised that without the express written consent of the owner, the TSSA does not release any information with respect to federal elevators or federal elevating equipment. The TSSA is a provincial regulator for the province of Ontario and federal elevators do not fall within the scope of TSSA's provincial mandate and the *Technical Standards and Safety Act* and associated Regulations. Further, the TSSA's Access and Privacy Code only applies to information collected, used, or disclosed by the TSSA in the course of TSSA's administration of the *Act*. Therefore, information with respect to federal elevators or federal elevator equipment is outside of the administration of the *Act*, and outside of the scope of the TSSA's Access and Privacy Codes.

Indigenous Lands

- Please be advised that the TSSA does not release any information with respect to indigenous lands, which are outside of the TSSA's mandate, without the express written permission from the Band. The *Technical Standards and Safety Act*, associated regulations, and TSSA's Access and Privacy Code does not apply to indigenous lands.

TSSA Boilers and Pressure Vessels (BPVs) Program Notice:

- Be advised, TSSA does not typically periodically inspect BPVs. These inspections are usually performed by insurance companies.
- **Inspection reports may not be submitted to TSSA by insurance companies; therefore, while TSSA may have some evidence of a BPV at a location on file, there may be no inspection records pertaining to BPVs located at the address provided.
- As of July 1, 2018, BPVs in Ontario may not be operated unless the Director has issued a current certificate of inspection (COI) to the owner or operator. A COI will be issued to the owner or operator of the BPV by TSSA after TSSA has received a Record of Inspection (ROI) from the insurer/third-party inspector, the associated fees have been paid and the BPV has passed a periodic inspection.
- Please note that if the BPV in question is insured, the insurance company may have additional inspection records. Please contact the insurer directly should you wish to obtain further information.



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1.877.682.8772
www.tssa.org

31 March 2023

**Romeet Gonsalves
Stantec Consulting
Ltd.
1331 Clyde Avenue
Ottawa, Ontario**

**Subject: 233 ARMSTRONG STREET, OTTAWA, ON
Your File No.: 122170424.600
WO No.: 8285934**

Dear Madam/Sir:

We are in receipt of your correspondence wherein you requested the release of information regarding the above noted address.

A search of TSSA public records **did not** locate any records relating to the following Program(s):

<u>Program</u>	<u>No Record</u>
Fuels Safety	☒
Boiler/Pressure Vessel	☐
Elevating & Amusement Devices	☐

**For BPV, if it has been indicated that records have been located but are not attached, it is likely that TSSA may not be the keeper of the records you are looking for, see note below.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

Should you have any questions, please contact Public Information at publicinformationservices@tssa.org.

Yours truly,

N. Carty

Nicola Carty
Public Information Services

Limitations and Notices:

General:

TSSA, as a safety regulator, uses inspection resources to address the greatest harm posed to the public. Thus, inspection only follows-up on safety orders it issues based on the degree of risk posed by the non-compliance identified in the order(s). All high-risk orders will result in a follow-up inspection by TSSA until the non-compliance is resolved. TSSA no longer follows-up on low or medium risk orders referred to as safety tasks, therefore, TSSA can no longer provide you with a report indicating the safety tasks (low and medium-risk orders) have been resolved. This information should be obtained from the device/facility owner or their contractor. One can also engage a third-party contractor to confirm device/facility compliance.

The Public Information Department, (PID), can only provide **existing** records for a specific location, facility, or device. If an inspection or any other type of record does not exist, PID cannot instruct TSSA to do work, such as an inspection, to create a record. TSSA, as an outcome-based regulator, deploys all of its resources, including, inspections to address the greatest harm posed to the public; and as such, cannot deploy resources to create records to satisfy an inquiry.

Please Note: While the PID provides existing records for a specific location, facility, or device; it does not interpret or provide further explanations of the content contained in the document.

TSSA Fuels Safety:

If you have environmental concerns regarding this property, you should consider hiring an environmental consultant to conduct an environmental assessment of the property in question.

- Sites that have not been licensed since 1987 may not be in TSSA records.
- Be advised, TSSA Fuels Safety Division did not register:
 - private fuel underground/ aboveground storage tanks prior to January of 1990; and
 - furnace oil tanks prior to May 1, 2002.
- Fuels Safety Division does not register
 - private waste oil tanks in apartments, office buildings, residences etc.; and
 - aboveground gas or diesel tanks.
- The *Technical Standards and Safety Act* and associated regulations do not require the registration of private fuel outlets, nor does it require that any documentation on these facilities be submitted to or reviewed or approved by TSSA. As a result, TSSA has limited information on these facilities. TSSA cautions that any information provided may be inaccurate, incomplete or out of date.

TSSA Elevating & Amusement Devices Program Notice:

- All orders and/or directions issued by the TSSA Inspector have a compliance date and the owner or designated contractor are required to comply within the specified time limit. Compliance is the responsibility of the owner or operator of the device.
- All written declarations of compliance (where eligible) should be sent to TSSA. Once a declaration of compliance has been received, the outstanding order will be resolved.
- Each report shows the details and date of the inspection conducted by TSSA at the requested location.
- The Ontario Amusement Devices Regulation (O. Reg. 221/01) was adopted in 2001. Since that time, TSSA retains copies of technical dossiers of new amusement devices in Ontario (as per TSSA's retention policy). However, for rides that existed prior to the adoption of the Regulation, which were

subject to a “grandfathering-in” clause, technical dossiers were not required to be filed with the TSSA. However, if the amusement ride remains in operation, as per ASTM requirements, the owner/licensee must possess an operations document for the device in question.

Federal Elevators

- Please be advised that without the express written consent of the owner, the TSSA does not release any information with respect to federal elevators or federal elevating equipment. The TSSA is a provincial regulator for the province of Ontario and federal elevators do not fall within the scope of TSSA's provincial mandate and the *Technical Standards and Safety Act* and associated Regulations. Further, the TSSA's Access and Privacy Code only applies to information collected, used, or disclosed by the TSSA in the course of TSSA's administration of the *Act*. Therefore, information with respect to federal elevators or federal elevator equipment is outside of the administration of the *Act*, and outside of the scope of the TSSA's Access and Privacy Codes.

Indigenous Lands

- Please be advised that the TSSA does not release any information with respect to indigenous lands, which are outside of the TSSA's mandate, without the express written permission from the Band. The *Technical Standards and Safety Act*, associated regulations, and TSSA's Access and Privacy Code does not apply to indigenous lands.

TSSA Boilers and Pressure Vessels (BPVs) Program Notice:

- Be advised, TSSA does not typically periodically inspect BPVs. These inspections are usually performed by insurance companies.
- **Inspection reports may not be submitted to TSSA by insurance companies; therefore, while TSSA may have some evidence of a BPV at a location on file, there may be no inspection records pertaining to BPVs located at the address provided.
- As of July 1, 2018, BPVs in Ontario may not be operated unless the Director has issued a current certificate of inspection (COI) to the owner or operator. A COI will be issued to the owner or operator of the BPV by TSSA after TSSA has received a Record of Inspection (ROI) from the insurer/third-party inspector, the associated fees have been paid and the BPV has passed a periodic inspection.
- Please note that if the BPV in question is insured, the insurance company may have additional inspection records. Please contact the insurer directly should you wish to obtain further information.



345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel.: 416.734.3300
Fax: 416.231.1626
Toll Free: 1.877.682.8772
www.tssa.org

31 March 2023

**Romeet Gonsalves
Stantec Consulting
Ltd.
1331 Clyde Avenue
Ottawa, Ontario**

**Subject: 3 HAMILTON AVENUE NORTH, OTTAWA, ON
Your File No.: 122170424.600
WO No.: 8283933**

Dear Madam/Sir:

We are in receipt of your correspondence wherein you requested the release of information regarding the above noted address.

A search of TSSA public records **did not** locate any records relating to the following Program(s):

<u>Program</u>	<u>No Record</u>
Fuels Safety	☒
Boiler/Pressure Vessel	☐
Elevating & Amusement Devices	☐

**For BPV, if it has been indicated that records have been located but are not attached, it is likely that TSSA may not be the keeper of the records you are looking for, see note below.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

Should you have any questions, please contact Public Information at publicinformationservices@tssa.org.

Yours truly,

N. Carty

Nicola Carty
Public Information Services

Limitations and Notices:

General:

TSSA, as a safety regulator, uses inspection resources to address the greatest harm posed to the public. Thus, inspection only follows-up on safety orders it issues based on the degree of risk posed by the non-compliance identified in the order(s). All high-risk orders will result in a follow-up inspection by TSSA until the non-compliance is resolved. TSSA no longer follows-up on low or medium risk orders referred to as safety tasks, therefore, TSSA can no longer provide you with a report indicating the safety tasks (low and medium-risk orders) have been resolved. This information should be obtained from the device/facility owner or their contractor. One can also engage a third-party contractor to confirm device/facility compliance.

The Public Information Department, (PID), can only provide **existing** records for a specific location, facility, or device. If an inspection or any other type of record does not exist, PID cannot instruct TSSA to do work, such as an inspection, to create a record. TSSA, as an outcome-based regulator, deploys all of its resources, including, inspections to address the greatest harm posed to the public; and as such, cannot deploy resources to create records to satisfy an inquiry.

Please Note: While the PID provides existing records for a specific location, facility, or device; it does not interpret or provide further explanations of the content contained in the document.

TSSA Fuels Safety:

If you have environmental concerns regarding this property, you should consider hiring an environmental consultant to conduct an environmental assessment of the property in question.

- Sites that have not been licensed since 1987 may not be in TSSA records.
- Be advised, TSSA Fuels Safety Division did not register:
 - private fuel underground/ aboveground storage tanks prior to January of 1990; and
 - furnace oil tanks prior to May 1, 2002.
- Fuels Safety Division does not register
 - private waste oil tanks in apartments, office buildings, residences etc.; and
 - aboveground gas or diesel tanks.
- The *Technical Standards and Safety Act* and associated regulations do not require the registration of private fuel outlets, nor does it require that any documentation on these facilities be submitted to or reviewed or approved by TSSA. As a result, TSSA has limited information on these facilities. TSSA cautions that any information provided may be inaccurate, incomplete or out of date.

TSSA Elevating & Amusement Devices Program Notice:

- All orders and/or directions issued by the TSSA Inspector have a compliance date and the owner or designated contractor are required to comply within the specified time limit. Compliance is the responsibility of the owner or operator of the device.
- All written declarations of compliance (where eligible) should be sent to TSSA. Once a declaration of compliance has been received, the outstanding order will be resolved.
- Each report shows the details and date of the inspection conducted by TSSA at the requested location.
- The Ontario Amusement Devices Regulation (O. Reg. 221/01) was adopted in 2001. Since that time, TSSA retains copies of technical dossiers of new amusement devices in Ontario (as per TSSA's retention policy). However, for rides that existed prior to the adoption of the Regulation, which were

subject to a “grandfathering-in” clause, technical dossiers were not required to be filed with the TSSA. However, if the amusement ride remains in operation, as per ASTM requirements, the owner/licensee must possess an operations document for the device in question.

Federal Elevators

- Please be advised that without the express written consent of the owner, the TSSA does not release any information with respect to federal elevators or federal elevating equipment. The TSSA is a provincial regulator for the province of Ontario and federal elevators do not fall within the scope of TSSA's provincial mandate and the *Technical Standards and Safety Act* and associated Regulations. Further, the TSSA's Access and Privacy Code only applies to information collected, used, or disclosed by the TSSA in the course of TSSA's administration of the *Act*. Therefore, information with respect to federal elevators or federal elevator equipment is outside of the administration of the *Act*, and outside of the scope of the TSSA's Access and Privacy Codes.

Indigenous Lands

- Please be advised that the TSSA does not release any information with respect to indigenous lands, which are outside of the TSSA's mandate, without the express written permission from the Band. The *Technical Standards and Safety Act*, associated regulations, and TSSA's Access and Privacy Code does not apply to indigenous lands.

TSSA Boilers and Pressure Vessels (BPVs) Program Notice:

- Be advised, TSSA does not typically periodically inspect BPVs. These inspections are usually performed by insurance companies.
- **Inspection reports may not be submitted to TSSA by insurance companies; therefore, while TSSA may have some evidence of a BPV at a location on file, there may be no inspection records pertaining to BPVs located at the address provided.
- As of July 1, 2018, BPVs in Ontario may not be operated unless the Director has issued a current certificate of inspection (COI) to the owner or operator. A COI will be issued to the owner or operator of the BPV by TSSA after TSSA has received a Record of Inspection (ROI) from the insurer/third-party inspector, the associated fees have been paid and the BPV has passed a periodic inspection.
- Please note that if the BPV in question is insured, the insurance company may have additional inspection records. Please contact the insurer directly should you wish to obtain further information.