

Phase I-Environmental Site Assessment

1740, 1746 and 1754 Carling Avenue, 828 Boyd Avenue
and 1755 Kerr Avenue
Ottawa, Ontario

Prepared for Kerr Broadview Properties Ltd.

Report: PE4425-1

July 16, 2025

TABLE OF CONTENTS

EXECUTIVE SUMMARY	ii
1.0 INTRODUCTION	1
2.0 PHASE I PROPERTY INFORMATION.....	2
3.0 SCOPE OF INVESTIGATION	3
4.0 RECORDS REVIEW	4
4.1 General.....	4
4.2 Environmental Source Information	7
4.3 Physical Setting Sources	12
5.0 INTERVIEWS	14
6.0 SITE RECONNAISSANCE.....	15
6.1 General Requirements.....	15
6.2 Site Inspection Observations	15
7.0 REVIEW AND EVALUATION OF INFORMATION	21
7.1 Land Use History	21
7.2 Conceptual Site Model.....	23
8.0 CONCLUSIONS	26
8.1 Assessment.....	26
8.2 Recommendations.....	27
9.0 STATEMENT OF LIMITATIONS	24
10.0 REFERENCES	25

List of Figures

Figure 1 - Key Plan
Figure 2 - Topographic Map
Drawing PE4425-1 - Site Plan
Drawing PE4425-2 - Surrounding Land Use Plan

List of Appendices

Appendix 1 Aerial Photographs
Site Photographs

Appendix 2 MECP Freedom of Information
MECP Well Records
HLUI Request
TSSA Response
ERIS Report

Appendix 3 Qualifications of Assessors

EXECUTIVE SUMMARY

Assessment

Paterson Group was retained by Kerr Broadview Properties Ltd. to carry out a Phase I-Environmental Site Assessment (ESA) for the property addressed 1740, 1746 and 1754 Carling Avenue, 828 Boyd Avenue and 1755 Kerr Avenue, in the City of Ottawa, Ontario (the Phase I Property). The purpose of this Phase I-ESA was to research the past and current use of the site and study area and to identify any environmental concerns with the potential to have impacted the subject property.

According to the historical research, the Phase I Property was first developed for commercial and residential purposes prior to the 1950s, while surrounding properties were used for a combination of commercial, community and residential purposes.

One historical potentially contaminating activity (PCAs) was identified during the research portion of this assessment, a former on-site underground diesel tank on the northern portion of the Phase I ESA (1746 Carling Avenue). The presence of the former underground diesel storage tank is considered to have resulted in an area of potential environmental concern (APEC) on the Phase I Property.

According to the historical research, a former RFO located at 1784 Carling Avenue was present immediately north of the western portion of the Phase I Property. Auto service garages were identified at 843 Boyd Avenue, 840 Boyd Avenue and 1702 Carling Avenue, approximately 30m southeast, 30m south and 20m east of the Phase I Property. These properties were also considered to represent APECs on the Phase I Property.

Additional off-site historical PCAs identified within the Phase I Study Area were not considered to represent PCAs on the Phase I Property based on their separation distances and/or orientations relative to the subject land.

Following the historical review, a site visit was conducted. The northeastern corner of the Phase I Property is occupied by a commercial retail building. The northern portion of the Phase I Property is occupied by two auto service garages. The presence of the auto service garages is considered to pose an APEC on the Phase I Property.

Three off-site automotive service garages were identified during the site visit for the surrounding properties located at 814 Boyd Avenue (immediately southeast of the eastern portion of the Phase I ESA), 1772 and 1784 Carling Avenue (immediately north of the western portion of the Phase I ESA, respectively). These properties were also considered to represent APECs on the Phase I Property. The remainder of the surrounding properties consist of commercial or residential properties. Several potentially contaminating

activities were identified during the site visit, within the Phase I Study Area and were not considered to represent areas of potential environmental concern on the subject site due to their separation distances and/or orientations relative to the subject land.

Recommendations

Based on the results of the Phase I-ESA, **in our opinion, a Phase II-Environmental Site Assessment is required for the Phase I Property.**

It is our understanding that the subject site is to be redeveloped in the future. Based on the potential presence of hazardous building materials and designated substances within the subject buildings, it is recommended that a designated substance survey be conducted prior to any demolition activities, in accordance with Ontario Regulation 490/09, under the Occupational Health and Safety Act, if one has not already been completed.

1.0 INTRODUCTION

At the request of Kerr Broadview Properties Ltd., Paterson Group (Paterson) carried out a Phase I-Environmental Site Assessment (Phase I-ESA) for the properties addressed 1740, 1746 and 1754 Carling Avenue, 828 Boyd Avenue and 1755 Kerr Avenue, in the City of Ottawa, Ontario, herein referred to as the Phase I Property. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and properties within the 250m Phase I Study Area to identify any potentially contaminating activities (PCAs) that would result in areas of potential environmental concern (APECs) on the Phase I Property.

Paterson was engaged to conduct this Phase I-ESA by Mr. Andrew Glass with Kerr Broadview Properties Ltd. Mr. Glass can be reached at [\(613\) 237-2425](tel:6132372425).

This report has been prepared specifically and solely for the above noted project which is described herein. It contains all our findings and results of the environmental conditions at this site.

This Phase I-ESA report has been prepared under the supervision of a Qualified Person, in general accordance with Ontario Regulation (O.Reg.) 153/04, as amended under the Environmental Protection Act, and CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I-ESA are based on a review of readily available geological, historical, and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial, and federal agencies and was limited within the scope-of-work, time, and budget of the project herein.

2.0 PHASE I PROPERTY INFORMATION

Address: 1740, 1746 and 1754 Carling Avenue, 828 Boyd Avenue and 1755 Kerr Avenue, Ottawa, Ontario.

Location: The Phase I Property is located at the southwestern corner of the Carling and Boyd Avenues intersection in the City of Ottawa, Ontario. Refer to Figure 1 - Key Plan in the Figures section following the text.

Latitude and Longitude: 45° 22' 39.0036" N, 75° 45' 8.9568" W

Site Description:

Configuration: Irregular

Area: 1.04 ha (approximately)

Zoning: AM10 – Arterial Mainstreet Zone

Current Use: The Phase I Property is currently occupied by a multi-unit commercial building on the northern portion of the Phase I Property and a sporting goods store on the northeastern portion of the Phase I Property, the remaining parcels are currently vacant and used as parking lot or as laneways.

Services: The Phase I Property is situated in a municipally serviced area.

3.0 SCOPE OF INVESTIGATION

The scope of work for this Phase I – Environmental Site Assessment was as follows:

- ☐ Determine the historical activities on the Phase I Property and study area by conducting a review of readily available records, reports, photographs, plans, mapping, databases, and regulatory agencies.
- ☐ Investigate the existing conditions present at the Phase I Property and study area by conducting site reconnaissance.
- ☐ Conduct interviews with persons knowledgeable of current and historic operations on the Phase I Property, and if warranted, neighbouring properties.
- ☐ Present the results of our findings in a comprehensive report in general accordance with the requirements O.Reg. 153/04 as amended under the Environmental Protection Act and in compliance with the requirements of CSA Z768-01 (reaffirmed 2022).
- ☐ Provide a preliminary environmental site evaluation based on our findings.
- ☐ Provide preliminary remediation recommendations and further investigative work if contamination is suspected or encountered.

4.0 RECORDS REVIEW

4.1 General

Phase I-ESA Study Area Determination

A radius of approximately 250m was determined to be appropriate as a Phase I Study Area for this assignment. Properties outside the 250m radius are not considered to have impacted the Phase I Property based on their significant separation distance.

First Developed Use Determination

Based on a review of available historical information, the Phase I Property was first developed for commercial and residential purposes prior to 1958. The Phase I Property was solely used for commercial purposes since the 1960s.

Fire Insurance Plans

Fire Insurance Plans (FIPs) from 1956 were reviewed as part of this assessment. The northeastern portion of the Phase I Property addressed 1740 Carling Avenue appears to be occupied by a wall and floor coverings shop. The northern portion of the Phase I Property addressed 1746 and 1754 Carling Avenue appear to be occupied by a moving and storage on 1746 Carling Avenue and a residential dwelling on 1754 Carling Avenue. The southeastern and southwestern portions addressed 828 Boyd and 1755 Kerr Avenues appear to be occupied by residential dwellings.

The neighbouring properties in the general area of the Phase I Property were occupied by residential dwellings or commercial properties at this time. Carling Avenue can be seen to the north in the 1956 FIPs. No FIPs exist for the neighbouring properties to the north (opposite side of Carling Avenue). No specific concerns were observed in the 1957 FIPs regarding the Phase I or adjacent properties.

National Archives

City directories were reviewed from 1931 to 2010 at approximately 10-year intervals. From 1931 until 1950 the Phase I Property was not listed in the directories. The northeastern portion addressed 1740 Carling Avenue was occupied by a floor and wall covering store from 1955 until 1980, followed by a speciality bicycle store and sporting goods store until 2010, the last year available. The northwestern portion addressed 1754 Carling Avenue was occupied by automotive service garages from 1980 until 2010. The central portion of the Phase I Property addressed 1740 Carling Avenue was occupied by a warehouse from the

early 1950s until 2003. The southeastern portion of the Phase I Property addressed 828 Boyd Avenue was occupied by a residential dwelling from the early 1950s until the 1990s. The southwestern portion of the Phase I Property addressed 1755 Kerr Avenue was occupied by a residential dwelling in the 1950s and was listed as vacant since the 1950s until 2010.

The presence of the automotive service garages at 1754 Carling Avenue throughout the years reviewed is considered to pose an environmental concern to the Phase I Property.

Several Potentially Contaminating Activities (PCA) were identified at properties within the Phase I-ESA. These PCAs are summarized in Table 1 below:

Table 1: City Directories Summary – PCAs in Phase I-ESA Study Area			
Address	Listed Activity (years listed)	Distance / Orientation from site	Potential Environmental Concern (Y / N)
Boyd Avenue			
814	Bob's Auto Body / McConnell Automotive (1980-2010) Boyd Avenue Auto Service (2000)	Immediately southeast	Y
819	Glidden Paint Center (2000)	20m E	N
840	Ike's Auto Center (2010)	30m S	Y
843	Green's Automotive Transmission (1960-1980)	30m SE	Y
Campbell Avenue			
815	Auto Locate (1992)	105m E	N
820	Seven Two Seven Transmission Service Inc. (2003)	20m E	Y
825	Import Car Center (2011-1992)	108m E	N
841	Top Hat Chimney Sweep (1992) Hopewell-Ballatune Fuels and Heating Supplies (1971)	110m SE	N
849	J&L Automotive (2011) AK Automotive Service (1992)	120m SE	N
851	Import Motors (2003-2010) The Car Shop (1992)	114m SE	N
856	Cockwell's Bodyshop (1982-1961)	105m SE	N

Table 1: City Directories Summary – PCAs in Phase I-ESA Study Area			
Address	Listed Activity (years listed)	Distance / Orientation from site	Potential Environmental Concern (Y / N)
Carling Avenue			
1660	Turpin Pontiac Buick GMC (2000-1980)	190m E	N
1688	Mister Muffler / Clyde Auto (2010-2000) Custom Muffler Ltd. (1989-1980) Carling Muffler Ltd. (1970)	145m E	N
1722	Ottawa Car Sales Ltd (2000-1980) Langley's Cleaners (1970)	25m E	N
1772	Midas Auto Service Experts (2010-2000) Midas Muffler & Brake Shop (1989-1980) Midas Muffler Shops (1970)	Immediately North	Y
1784	Sunoco Gas Bar (2010-2000) Sunoco Broadview Service Center (1989) Desforges BP Service Station (1970)	Immediately North	Y
1810	Kealy Printing Inc. (1990-2010)	Immediately West	N
Clyde Avenue			
822	Henry's Auto Center (2000)	145m E	N
826	General Auto Glass & Upholstery (2011)	145m E	N
842	Andre Awad Auto Center (2000) Bemac Auto Body (1980-1970)	150m SW	N
848	Mannion's Pump House Ltd. (2011)	150m SW	N
856	SOS Power Sales (2011)	170m SW	N
Doheny Street			
1690	Edsons Auto Repair (2011) Ali Mehdi Auto Repair (2003)	150m SW	N
1700	J&J Auto Shine (2011) Western Elevator Ltd. Maintenance (1982)	110m SW	N

The historical use of the properties addressed 814, 840 and 843 Boyd Avenue, 820 Campbell Avenue, 1722, 1772 and 1784 Carling Avenue as automotive service garages, dry cleaners or retail fuel outlets (RFOs) are considered to represent PCAs that result in APECs on the Phase I Property.

All other identified PCAs, are not considered to result in APECs on the Phase I Property based on their separation distances, and/or inferred cross- or down-gradient orientations with respect to the Phase I Property.

Chain of Title

Paterson did not request a Chain of Title for the Phase I Property as it was determined that sufficient information was gathered from other sources, such as FIPs, aerial photographs, city directories, and personal interviews.

Previous Engineering Reports

- ☐ Phase I-II Environmental Site Assessment, 1740 Carling Avenue, Existing Commercial Property, Ottawa, Ontario, prepared by Paterson Group, dated January 2014.
- ☐ Supplemental Phase II Environmental Site Assessment, 1740 Carling Avenue, Ottawa, Ontario, prepared by Paterson Group Inc., dated August 29, 2014.
- ☐ Phase II Environmental Site Assessment, 1746 Carling Avenue and 828 Boyd Avenue, Ottawa, Ontario, prepared by Paterson Group Inc., dated May 27, 2015.
- ☐ Phase I-II Environmental Site Assessment, 1755 Kerr Avenue, Vacant Lot, Ottawa, Ontario, prepared by Paterson Group, dated July 24, 2015.
- ☐ Site Monitoring Report, 1755 Kerr Avenue, Ottawa, ON, prepared by Terrapex.

Multiple Phase I and Phase II ESAs have been conducted for the Phase I Property or various parts of it. The findings of these reports are summarized in this Phase I ESA and a Phase II ESA provided under separate cover. One area of potential concern (APEC) was identified for the Phase I Property portion addressed 1740 Carling Avenue and it pertains to a former underground diesel tank located on the northern portion of the Phase I Property.

4.2 Environmental Source Information

National Pollutant Release Inventory

A search of the National Pollutant Release Inventory (NPRI) was conducted as part of this assessment. No records of any pollutant releases were identified for the Phase I Property or for any properties situated within the Phase I Study Area.

PCB Waste Storage Site Inventory

A search of provincial PCB waste storage sites was conducted. No PCB waste storage sites were documented for the Phase I Property. No current or former PCB waste storage sites were identified within the Phase I study area.

MECP Coal Gasification Plant Inventory

The Ontario Ministry of Environment, Conservation and Parks document entitled, *"Municipal Coal Gasification Plant Site Inventory, 1991"* was reviewed as part of this assessment. This document provides a reference to the locations of former plants with respect to the Phase I Property. A review of this document did not identify any former coal gasification plants located on the Phase I Property or within the Phase I Study Area.

MECP Waste Disposal Site Inventory

The Ontario Ministry of Environment, Conservation and Parks document entitled, *"Waste Disposal Site Inventory in Ontario, 1991"* was reviewed as part of this assessment. This document includes all recorded active and closed waste disposal sites, industrial manufactured gas plants, and coal tar distillation plants situated in the Province of Ontario.

A review of this document did not identify any relevant records pertaining to the Phase I Property or for properties located within the Phase I Study Area.

MECP Submissions

Requests were submitted to the MECP Freedom of Information office for information with respect to reports related to environmental conditions for the Phase I Property. A response from the MECP had not been received prior to the issuance of this report.

MECP Instruments

A request was submitted to the MECP Freedom of Information (FOI) office for information with respect to certificates of approval, permits to take water, certificates of property use or any other similar MECP issued instruments for the Phase I Property. A response from the MECP had not been received prior to the issuance of this report.

According to the ERIS report, twelve (12) certificates of approval and eight (8) environmental compliance approvals (ECAs) were issued for properties within the Phase I Study Area. The CAs and ECAs were issued for Municipal and Sewer Works or air releases. One permit to take water record was identified for the

property addressed 1705 Carling Avenue. Based on the nature of these approvals, they are not considered to represent potentially contaminating activities.

No other certificates of approval, permits to take water, certificates of property use or any other similar MECP issued instruments were identified for the Phase I Property or properties within the Phase I Study Area. A copy of the ERIS report is provided in Appendix 2.

MECP Incident Reports

A request was submitted to the MECP Freedom of Information office for information with respect to records concerning environmental incidents, orders, offences, spills, discharges of contaminants, or inspections maintained by the MECP for the Phase I Property or neighbouring properties. A response from the MECP had not been received prior to the issuance of this report.

According to the ERIS report, no records were reported for the Phase I Property.

The ERIS report identified thirty-four (34) Ontario Spills records within the Phase I Study Area. The records pertain primarily to minimal oil, gas, grease or lint spills/leaks contained within a small perimeter of the spill area. Due to the nature of most of the spills, they are not considered to be of any significant concern and are not discussed further. Larger spills include a 100L fuel oil spill at the property addressed 843 Boyd Avenue, located approximately 30 m southeast of the Phase I Property. Additionally, one 210L diesel spill was identified for the property addressed 1845 Carling Avenue, approximately 145m northwest of the Phase I Property.

The Ontario Spills records are not considered to represent APECs on the Phase I Property due to the nature of the spills, their respective separation distances and/or cross- or down- gradient orientation with respect to the Phase I Property.

MECP Waste Management Records

A request was submitted to the MECP Freedom of Information office for information with respect to waste management records for the Phase I Property. A response from the MECP had not been received prior to the issuance of this report.

According to the ERIS report, six waste generators were identified on the Phase I Property and they associated with a demolition company located at 1752 Carling Avenue and the sporting goods store located at 1740 Carling Avenue. Due to the nature of these businesses, these records are not considered to pose a potential environmental concern to the Phase I Property.

The ERIS report identified 213 waste generators the Phase I Study Area. Several waste generators are associated with the historical surrounding automotive service garages and retail fuel outlets. The waste classes documented generally include light fuels, detergent/soap heavy fuels, waste oils and lubricants. As mentioned above, multiple historical and current automotive service garages, retail fuel outlets and dry cleaners are considered to be potentially contaminating activities (PCAs) that are considered to have resulted in areas of potential environmental concern (APECs) on the Phase I Property. The remaining waste generators are not considered to represent APECs on the Phase I Property due to their respective separation distances and/or cross- or down- gradient orientations relative to the subject land.

MECP Brownfields Environmental Site Registry

A search of the MECP Brownfields Environmental Site Registry was conducted as part of this assessment for the site, neighbouring properties, and the general area of the site. No Records of Site Condition (RSCs) were filed for the Phase I Property. Two RSCs were filed within the Phase I Study Area.

One RSC was filed for the property addressed 1705 Carling Avenue. No soil or groundwater was remediated as part of the RSC submission; based on the information provided in the Environmental Site Registry, the property at 1705 Carling Avenue is not considered to represent an APEC on the Phase I Property.

One RSC was filed for the property addressed 1650 and 1666 Carling Avenue, approximately 195m east of the Phase I Property. Due to its distance away, this property is not considered to pose a potential environmental concern to the Phase I Property.

OMNRF Areas of Natural Significance

A search for areas of natural and scientific interest within the Phase I Study Area was conducted electronically on the Ontario Ministry of Natural Resources and Forestry (OMNRF) website. The search did not identify any natural features or areas of natural significance within the 250m Phase I Study Area.

Technical Standards and Safety Authority (TSSA)

The TSSA Fuels Safety Branch in Toronto was contacted electronically, as part of this assessment, to inquire about current and former underground fuel storage tanks for the Phase I and neighbouring properties.

The response from the TSSA indicated that no records were identified pertaining to the Phase I Property or the neighbouring properties. A copy of the correspondence with the TSSA is included in Appendix 2.

City of Ottawa Landfill Document

The document prepared by Golder Associates entitled, “*Old Landfill Management Strategy, Phase I - Identification of Sites, City of Ottawa*”, was reviewed as part of this assessment. No former landfill sites were identified on the Phase I Property, or within a 250 m radius of the Phase I Property.

City of Ottawa Former Industrial Site Document

The document prepared by Intera Technologies Limited entitled, “*Mapping and Assessment of Former Industrial Sites, City of Ottawa*”, was reviewed as part of this assessment. No former industrial sites were identified on the Phase I Property or within the Phase I study area.

City of Ottawa Historical Land Use Inventory (HLUI) Database

As part of this assessment, a requisition form was submitted to the City of Ottawa to request information from the City’s Historical Land Use Inventory (HLUI) database for any environmental records pertaining to the Phase I Property as well as any properties situated within the Phase I study area.

A response from the City had not been received prior to the issuance of this report. A copy of the response will be forwarded to the client should it contain any pertinent information. A copy of the submission request has been included in Appendix 2.

Environmental Risk Information Service Ltd. (ERIS)

A database report, prepared by ERIS (Environmental Risk Information Service) dated November 1, 2024, was acquired and reviewed as part of this assessment. The ERIS report includes information that would normally be obtained through the MECP FOI, a TSSA search, MECP well records search as well as several other records (i.e. incident reports, waste generators, etc.). The complete ERIS report has been included in Appendix 2.

Records identified within the Phase I Study Area include borehole records, certificate of approval (CA) records, commercial fuel oil tank, delisted fuel oil tanks, environmental registry, environmental compliance approval, ERIS historical searches, expired fuels safety facilities, fuel storage tank, fuel storage tank-historic, O.Reg 347 Waste Generators Summary, TSSA Historic Incidents, Fuel Oil Spills and Leaks, National PCB inventory, national pollutant release inventory 1993-

2020, Inventory of PCB Storage Sites, Pesticide Register, pipeline incidents, Private and Retail Fuel Storage Tanks, permit to take water, RSC, Retail Fuel Storage Tanks, Scott's Manufacturing records, Ontario spills and WWIS records.

The ERIS Report identified eleven (11) on-site records pertaining to waste generators, water wells and Scott's manufacturing directory. As mentioned above, the waste generator and Scott's manufacturing directory records are not considered to pose a potential environmental concern to the Phase I Property.

Multiple Commercial Fuel Oil Tanks, Delisted Fuel Tanks, List of Expired Fuels Safety Facilities, Fuel Storage Tank – Historic, Waste Generators, Retail Fuel Storage Tanks, Ontario Spills and Private and Retail Fuel Storage Tanks were documented for properties located in the immediate vicinity of the Phase I Property and addressed 1772 and 1782 Carling Avenue, 814, 835, 843 and 847 Boyd Avenue. These records were documented for the historical or present operations of automotive service garages or retail fuel outlets. These properties are considered to pose potentially contaminating activities (PCAs) that are considered to have resulted in areas of potential environmental concern (APECs) on the Phase I Property.

Based on their nature, separation distances and/or inferred cross/down gradient orientation with respect to the Phase I Property, the remaining records are not considered to result in APECs on the Phase I Property.

4.3 Physical Setting Sources

Aerial Photographs

Historical air photos from the National Air Photo Library were reviewed in approximate ten (10) year intervals. Based on the review, the following observations have been made:

1958	The Phase I Property appears to be occupied by a commercial building on the northeastern portion, a warehouse on the central portion and two residential dwellings on the central-western portion of the Phase I Property. Two laneways/right-of-ways are also present on the western portion of the Phase I Property. Surrounding properties are occupied by residential or commercial properties at this time.
1965	The northwestern portion of the Phase I Property appears to have been redeveloped with a commercial building. A retail fuel outlet is now present north of the western portion of the Phase I Property. A

- community building has been constructed southwest of the Phase I Property.
- 1976 No significant changes are apparent with respect to the Phase I Property. Two commercial buildings have been constructed east and north of the Phase I Property.
- 1999 No significant changes are apparent with respect to the Phase I Property. A portion of the property adjacent to the east of the Phase I property, across Boyd Avenue, appears to have been redeveloped with a commercial building and a parking lot. What appears to be a large community building has been constructed south of the Phase I Property, across Kerr Avenue. A parking lot has been constructed further southeast of the Phase I Property. A commercial building has been constructed further southeast of the Phase I Property.
- 2008 The former warehouse on the central portion of the Phase I Property has been demolished; this portion of the site is currently used as a parking lot. The community building to the southwest of the Phase I Property has been removed and replaced by a larger building.
- 2022 No significant changes have been made to the Phase I or surrounding properties at this time.

Copies of the aerial photographs reviewed are included in Appendix 1.

Water Bodies

No water bodies are present on the Phase I Property. The closest water body is the Ottawa River, located approximately 1.5km north of the Phase I Property.

Physiographic Maps

A physiographic map was reviewed from the Natural Resources Canada – The Atlas of Canada website, as a part of this assessment. According to the publication and mapping information, the Phase I Property is situated within the St. Lawrence Lowlands. According to the description provided: *“The lowlands are plain-like areas that were affected by the Pleistocene glaciations and are therefore covered by surficial deposits and other features associated with the ice sheets.”* The Phase I Property is specifically located within the Central St. Lawrence Lowland area, which is rarely more than 150m above sea level.

Topographic Maps

Topographic maps were obtained from Natural Resources Canada – The Atlas of Canada website and from the City of Ottawa website. The topographic maps indicate that the regional topography is generally flat, sloping down to the north. An illustration of the referenced topographic map is presented on Figure 2 – Topographic Map, appended to this report.

Geological Maps

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on this information, the bedrock in the area of the Phase I Property consists of interbedded limestone and dolomite of the Gull River Formation. Overburden soils are shown as glacial till, with a drift thickness on the order of 2 to 10m.

Water Well Records

A search of the MECP's website for all drilled well records within a 250 m radius of the Phase I Property was conducted as part of this assessment. Three well records were documented for the Phase I Property and pertain to wells that were installed between 1951 and 2022. The wells were installed for water supply and in conjunction with the previously Phase II – ESAs that were completed following the identification of APECs on the Phase I Property. Seventy-one (71) well records were identified within the Phase I Study Area. These records pertain to wells used for water supply, monitoring or groundwater observation purposes. Based on the availability of municipal services, no drinking water wells are expected to be currently in use within the Phase I Study Area.

The identified off-site monitoring wells are not considered to be indicative of the potential for environmental impacts on the Phase I Property. The well records have been included in Appendix 2.

5.0 INTERVIEWS

Property Representative

Mr. Andrew Glass, with Kerr Broadview Properties Ltd., was interviewed in-person at the time of the site inspection. Mr. Glass indicated that on-site automotive service garages are limited to oil changes, car repair services and tire changes. New oil and waste oil are stored on site. Mr. Glass also indicated that 1740 has been used only for commercial retail purposes. Mr. Glass was unsure of when the warehouse on 1746 Carling Avenue was removed. Mr. Glass was unaware of any

potential environmental concerns on the Phase I Property or neighbouring properties, other than those identified in historical reports.

6.0 SITE RECONNAISSANCE

6.1 General Requirements

A site visit was conducted on November 18, 2024 by Mr. Mohammed Ramadan with Paterson's Environmental Department. The uses of neighbouring properties within the Phase I Study Area were also assessed at the time of the site visit, from publicly accessible areas.

6.2 Site Inspection Observations

Buildings and Structures

The parcel of land addressed 1740 Carling Avenue is occupied by a one-storey slab-on-grade building occupied by Valiquette's Source for Sports, a sporting goods store. The building, considered to have been constructed in the early 1950s, is of concrete block construction with exterior brick and metal siding finishes and a flat, tar-and-gravel style roof. The building is heated with roof top natural gas fired HVAC units.

The parcel of land addressed 1754 Carling Avenue is occupied by a one-storey slab-on-grade multi-unit commercial building that consists of two auto repair garages and one auto detailing and glass replacement shop. The building, considered to have been constructed in the early 1950s, is of concrete block construction with exterior brick and metal siding finishes and a flat, tar-and-gravel style roof. The building is heated with roof top natural gas fired HVAC units.

The parcel of lands addressed 1746 Carling Avenue and 828 Boyd Avenue consist of two (2) attached vacant parcels of land. These parcels are currently vacant and used as a surface parking lot. The majority of the 1746 Carling Avenue is covered with a concrete slab, which is the floor slab from the former on-site warehouse building. The remainder of 1746 Carling Avenue and 828 Boyd Avenue are gravel covered

The parcel of land addressed 1755 Kerr Avenue is a paved parking lot, with an attached laneway/right-of-way running north to Carling Avenue and a detached laneway/right-of-way running west to Broadview Avenue. Concrete retaining walls are present on the north side of the parking lot, in part on the west side of the

attached laneway heading north and in part on the north side of the detached laneway heading west.

Site Features

The commercial building addressed 1740 Carling Avenue fronts onto Boyd Avenue and occupies the northeastern portion of the Phase I Property. The remainder of the site is covered with an asphaltic concrete parking lot. A waste bin used to store domestic, non-hazardous waste and recycling is present at the front of the property.

The commercial building addressed 1754 Carling Avenue fronts onto Carling Avenue and occupies the northern portion of the Phase I Property. The remainder of the site is covered with asphaltic concrete. No aboveground storage tanks (ASTs) or evidence of underground storage tanks (USTs) or other fuels or chemicals were observed on the exterior of the property. One monitoring well was observed at the time of the site visit situated to the west of the building.

The remainder of the properties are currently vacant and used as laneways or parking lots. Site drainage typically occurs through sheet flow to catch basins located along the adjacent streets with infiltration occurring over the gravelled areas. The site is relatively flat and at the grade of adjacent streets. The regional topography slopes down to the north towards the Ottawa River. The groundwater is also expected to flow towards the northwest.

No potential sources of PCBs were identified on the exterior of the Phase I Property at the time of the site inspection. No signs of stressed vegetation, surficial staining or evidence of fill material were noted on the Phase I Property. A depiction of the Phase I Property is illustrated on Drawing PE4425-1 – Site Plan, in the Figures section of this report.

Interior Assessment

1754 Carling Avenue

The building addressed 1754 Carling Avenue is occupied by two auto service garages and one auto detailing and glass replacement shop. A general description of the interior building finishes are as follows:

- ☐ Floors consist of poured concrete;
- ☐ Walls consist of concrete blocks with drywall finish in the office area;
- ☐ Ceilings consist of unfinished steel decking, with acoustic ceiling tiles in the office area;

- ❑ Lighting is provided by fluorescent and incandescent fixtures.

Heating is provided by a natural gas-fired suspended furnace. The auto service garage that's occupying the western portion of the property has two aboveground electrical hoists. Two floor drains leading to an oil-water separator were observed in the garage. The drains were observed to contain cloudy water at the time of the site visit.

One 910L aboveground waste oil storage tank was observed inside this unit. Three (3) 208L drums containing new motor oil were observed inside the garage, in addition to multiple containers (less than 10L) of motor oil, windshield waster fluid, brake fluid and transmission fluid in sealed containers were properly stored on shelves. No areas of staining were observed on the concrete floor throughout the garage. The concrete floor was in good condition at the time of the site assessment.

The auto service garage that's occupying the central-south portion of the property has two aboveground electrical hoists. One floor drain leading to an oil-water separator was observed in the garage. The drain was observed to be dry at the time of the site visit.

One 910L aboveground waste oil storage tank was observed inside this unit. Multiple containers (less than 10L) of motor oil, windshield fluid, brake fluid and transmission fluid in sealed containers properly stored on shelves. Small areas of staining were observed on the concrete floor throughout this unit. The concrete floor was in good condition at the time of the site assessment.

The auto detailing and glass replacement shop that's occupying the central-north and eastern portions of the property have of one aboveground electrical hoist. One floor drain leading to an oil-water separator was observed in the shop. The drain was observed to contain soapy water at the time of the site visit.

No waste or new motor oil tanks, totes or drums were observed inside this unit. Multiple buckets of water and car detailing soap were observed throughout this area. No staining was observed on the concrete floor throughout this unit. The concrete floor was in good condition at the time of the site assessment.

Based on the age of the building (constructed in the 1960's) potential asbestos containing materials (ACMs) observed at the time of the site assessment include drywall joint compound and acoustic ceiling tiles. Lead-based paints (LBPs) may be present on older painted surfaces and beneath more recent coats of paint.

Potential ACMs and LBPs were generally in good condition at the time of the site visit.

1740 Carling Avenue

The building addressed 1740 Carling Avenue (Valiquette's Source For Sports) is occupied by a Sporting goods store. A general description of the interior building finishes are as follows:

- ☐ Floors consist of carpet and poured concrete;
- ☐ Walls consist of drywall;
- ☐ Ceilings are finished with drywall;
- ☐ Lighting is provided by fluorescent and incandescent fixtures.

The building is heated with roof top natural gas fired HVAC units. No aboveground storage tanks (ASTs) or signs of underground storage tanks (USTs) were observed on the interior of the property at the time of the site visit.

Based on age of the building (constructed in the 1950's) potential asbestos containing materials (ACMs) observed at the time of the site assessment include drywall joint compound. Lead-based paints (LBPs) may be present on older painted surfaces and beneath more recent coats of paint. Potential ACMs and LBPs were generally in good condition at the time of the site visit. It is considered likely that any polychlorinated biphenyl (PCB) – containing light ballasts would by now have been replaced by PCB-free ballasts.

Fuel and Chemical Storage

The subject buildings are heated with natural gas-fired equipment. Two 910L aboveground waste oil storage tanks were observed inside 1754 Carling Avenue at the time of the site visit. No obvious signs of staining were observed around the waste oil storage area.

Three (3) 208L drums containing new motor oil were observed on the interior of the automotive service garage at 1754 Carling Avenue, in addition to multiple containers (less than 10L in volume) of various motor oils, washer fluid, brake fluid and transmission oil. Areas of staining were noted on the concrete floor throughout the south-central portion of 1754 Carling Avenue at the time of the site visit. The concrete floor was observed to be in good condition at the time of the site visit.

No chemicals, with the exception of common household cleaning and maintenance chemicals, were observed inside 1740 Carling Avenue.

Wastewater Discharge

Wastewater discharged from the Phase I Property includes wash water and sewage. The floor drains within 1754 Carling Avenue were reported to lead to an oil-water separator and ultimately drain to the municipal sewer system. According to the property tenant, the oil-water separator is cleaned out by a licenced contractor on a yearly basis.

Waste Management

Non-hazardous waste and recycling are stored in a bin on the east side of 1740 Carling Avenue and collected by a licensed contractor on a regular basis. Tires, waste oil and filters stored at 1754 Carling Avenue are collected and disposed off-site by contractors licenced for these works, on an as-needed basis.

Neighbouring Properties

An inspection of the neighbouring properties was conducted from publicly accessible areas at the time of the site visits. Land use adjacent to the Phase I Property was as follows:

- ☐ North – Carling Avenue, followed by residential and commercial properties;
- ☐ South: Kerr Avenue, followed by commercial properties;
- ☐ East: Boyd Avenue, followed by commercial properties; and
- ☐ West: Commercial and residential properties, followed by Broadview Avenue.

Two car repair garages located immediately north of the Phase I Property are currently present at 1772 and 1784 Carling Avenue. The presence of these auto repair garages is considered to pose a potential environmental concern to the Phase I Property. Several automotive service garages and retail fuel outlets are present within the Phase I Study Area, however, due to their significant distance away of at least 100m, these properties are not considered to pose a potential environmental concern to the Phase I Property. Surrounding land use within the Phase I Study Area is presented on Drawing PE4425-2 – Surrounding Land Use Plan.

6.3 Enhanced Investigation Area

Operations at the Property, Including Processing or Manufacturing

The property addressed 1754 Carling Avenue, which occupies the northern portion of the Phase I Property, has been operated as several automotive service garages

since the 1980's. Mr. Andrew Glass, indicated that he is unfamiliar with historical operations at the site, however current repair services include mechanical, suspension, undercarriage and brake repair, as well as oil changes, tire changes and wheel replacements, and transmission and brake flushes.

Hazardous Materials Used or Stored at the Phase I Property

As previously noted, two 910L aboveground waste oil tanks and four (4) 208L new oil drums were observed on the interior of the automotive service garages at 1754 Carling Avenue, in addition to multiple containers (less than 10L in volume) of various motor oils, washer fluid, brake fluid and transmission oil. Limited areas of staining were noted on the concrete floor throughout the garages at the time of the site visit, however, the concrete floor was observed to be in good condition, with minimal cracks and pitting noted at the time of the site visit.

Products Manufactured at the Phase I Property

No products are manufactured at the Phase I Property.

By-Products and Waste at the Phase I Property

Two 910L aboveground waste oil tanks and four (4) 208L new oil drums were observed on the interior of the property addressed 1954 Carling Avenue. Minimal areas of staining were observed on the concrete floor in the vicinity of the waste and new oil tanks and drums. The waste oil is reportedly collected and disposed off-site by a licenced contractor as needed.

Used tires, waste oil drum/tote and filters stored at 1754 Carling Avenue are collected and disposed off-site by contractors licenced for these works, on an as-needed basis. It should be noted that the waste oil drum/tote and filter containers are situated on a concrete slab.

Raw Materials Handling and Storage Locations at the Phase I Property

No raw materials are handled or stored on the Phase I Property.

Details of Drums, Totes and Bins at the Phase I Property

Two 910L aboveground waste oil tanks and four (4) 208L new oil drums were observed on the interior of the property addressed 1754 Carling Avenue. No other drums, bins or totes were observed at the time of the site visit.

Details of Oil-Water Separators at the Phase I Property

The floor drains within the automotive service garages at 1754 Carling Avenue were reported to lead to an oil-water separator and ultimately drain to the municipal sewer system. According to the property tenant, the oil-water separator is cleaned out by a licenced contractor on an as-needed basis.

The approximate location of the oil-water separator is shown on Drawing PE4425-1 – Site Plan. The date of installation is unknown.

Vehicle and Equipment Maintenance Areas at the Phase I Property

The automotive service garages, which occupies the majority of the subject building addressed 1954 Carling Avenue, have five aboveground electric hoists. The approximate locations of the vehicle and equipment maintenance areas, including the locations of maintenance, fluid storage and waste storage areas are shown on Drawing PE4425-1 – Site Plan.

Spills at the Phase I Property

Based on the historical review, interviews and site visit, no records of spills were identified.

7.0 REVIEW AND EVALUATION OF INFORMATION

7.1 Land Use History

Based on a review of available historical information, the Phase I Property was first developed for commercial and residential purposes prior to 1958. The Phase I Property was solely used for commercial purposes since the late 1950s.

Potentially Contaminating Activities (PCAs) and Areas of Potential Environmental Concern (APECs)

Based on the findings of this Phase I ESA, four on-site and seven off-site potentially contaminating activities (PCAs), were deemed to result in areas of potential environmental concern (APECs) with respect to the subject site. These APECs include:

- ☐ APEC 1: Resulting from the importation of fill material of unknown quality (PCA #30);

- ☐ APEC 2: Application of road salt for the removal of snow and de-icing purposes (PCA #NA)
- ☐ APEC 3: Resulting from the presence of a former on-site underground storage tank (UST) (PCA #28);
- ☐ APEC 4: Resulting from the presence of on-site automotive service garages (PCA #52);
- ☐ APEC 5: Resulting from the presence of off-site automotive service garage (PCA #52);
- ☐ APEC 6: Resulting from the presence of off-site automotive service garage (PCA #52);
- ☐ APEC 7: Resulting from the Former Retail Fuel Outlet and current Automotive Service Garage (PCAs #28 and #58);
- ☐ APEC 8: Resulting from the presence of a former automotive service garage (PCA#52);
- ☐ APEC 9: Resulting from the presence of off-site automotive service garage (PCA #52);
- ☐ APEC 10: Resulting from the former use of halogenated solvents on the adjacent property to the east (PCA #37);
- ☐ APEC 11: Resulting from the former use of halogenated solvents on the adjacent property to the southeast (PCA #37);

All APECs identified on the Phase I Property are presented on Drawing PE4425-1-Site Plan.

Contaminants of Potential Concern

Contaminants of Potential Concern (CPCs) associated with the APECs identified at the Phase I Property include BTEX, VOCs, PHCs, Metals, CrVI, Hg, PAHs in the soil and/or PHCs in the groundwater.

7.2 Conceptual Site Model

Geological and Hydrogeological Setting

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on this information, the bedrock in the area of the Phase I Property consists of interbedded limestone and dolomite of the Gull River Formation. Overburden soils are shown as glacial till, with a drift thickness on the order of 2 to 10m.

Groundwater is anticipated to flow in a northwesterly direction, towards the Ottawa River.

Existing Buildings and Structures

The northern portion of the Phase I Property is occupied by a one-storey multi-unit commercial building and the northeastern portion is occupied by a one-storey commercial retail building.

Water Bodies and Areas of Natural and Scientific Interest

No water bodies are present on the Phase I Property. The closest water body is the Ottawa River, located approximately 1.5km north of the Phase I Property.

No areas of natural scientific interest were identified within the Phase I Study Area.

Water Well Records

Based on the availability of municipal services, no drinking water wells are expected to be currently in use within the Phase I Study Area.

Neighbouring Land Use

The neighbouring lands within the Phase I Study Area are residential, commercial and community land use. Current land use is shown on Drawing PE4425-2 – Surrounding Land Use Plan, in the Figures section of this report.

Potentially Contaminating Activities and Areas of Potential Environmental Concern

Based on the findings of this Phase I ESA Update, four on-site and seven off-site potentially contaminating activities (PCAs), were deemed to result in areas of potential environmental concern (APECs) with respect to the Phase I Property. These APECs and associated PCAs and CPCs are presented in Table 5 below.

Table 1 - Areas of Potential Environmental Concern

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern with respect to Phase I Property	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 1 Importation of Fill Material of Unknown Quality	Entire Phase I Property	"Item 30 – Importation of Fill Material of Unknown Quality"	On-site	Metals Hg CrVI PAHs BTEX PHCs (F ₁ –F ₄)	Soil
APEC 2 Application of road salt for snow removal and de-icing purposes	Entire Phase I Property	N/A	On-site	EC/SAR	Soil and Groundwater
APEC 3 Former underground diesel storage tank	Northern portion of the Phase II Property	"Item 28 – Gasoline and Associated Products Storage in Fixed Tanks"	On-site	BTEX PHCs (F ₁ –F ₄)	Soil Groundwater
APEC 4 Current on-site automotive service garages	Northwestern portion of the Phase II Property	"Item 52 – Storage, Maintenance, Fueling and Repair of Equipment Vehicles, and Material Used to Maintain Transportation Systems"	On-site	BTEX PHCs (F ₁ –F ₄) PAHs VOCs	Soil Groundwater
APEC 5 Current automotive service garage	Northeastern portion of the Phase I Property	"Item 52 – Storage, Maintenance, Fueling and Repair of Equipment Vehicles, and Material Used to Maintain Transportation Systems"	Off-site	BTEX PHCs (F ₁ –F ₄) PAHs VOCs	Soil Groundwater
APEC 6 Current Automotive Service Garage	Western portion of the Phase I Property	"Item 52 – Storage, Maintenance, Fueling and Repair of Equipment Vehicles, and Material Used to Maintain Transportation Systems"	North of the Phase I Property	BTEX PHCs (F ₁ –F ₄) PAHs VOCs	Soil Groundwater

Table 1 - Areas of Potential Environmental Concern

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern with respect to Phase I Property	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 7 Former Retail Fuel Outlet and Current Automotive Service Garage	Western portion of the Phase I Property	"Item 28 – Gasoline and Associated Products Storage in Fixed Tanks" "Item 52 – Storage, Maintenance, Fueling and Repair of Equipment Vehicles, and Material Used to Maintain Transportation Systems"	North of the Phase I Property	VOCs PHCs (F1–F4) PAHs	Soil Groundwater
APEC 8 Former auto-service garage	Southeastern portion of the Phase I Property	"Item 52 – Storage, Maintenance, Fueling and Repair of Equipment Vehicles, and Material Used to Maintain Transportation Systems"	Southeast of the Phase I Property	PHCs BTEX VOCs	Soil and/or Groundwater
APEC 9 Former automotive service garage	Southern portion of the Phase I Property	"Item 52 – Storage, Maintenance, Fueling and Repair of Equipment Vehicles, and Material Used to Maintain Transportation Systems"	Off-site	BTEX PHCs (F1–F4) PAHs VOCs	Soil Groundwater
APEC 10 The former use of halogenated solvent	Eastern portion of the Phase I Property	"Item 37 – Operation of Dry-Cleaning Equipment (where chemicals are used)"and other	Off-site	VOCs	Soil Groundwater
APEC 11 The former use of halogenated solvent	Eastern portion of the Phase I Property	"Item 37 – Operation of Dry-Cleaning Equipment (where chemicals are used)"and other	Off-site	VOCs	Soil Groundwater
1 – In accordance with Section 49.1 of O.Reg. 153/04 standards are deemed to be met if an applicable site condition standard is exceeded at a property solely because the qualified person has determined that a substance has been applied to surfaces for the safety of vehicular or pedestrian traffic under conditions of snow or ice or both. The exemption outlined in Section 49.1 is being relied up with respect to the RSC property.					

Assessment of Uncertainty and/or Absence of Information

The information available for review as part of the preparation of the Phase I-ESA is considered to be sufficient to conclude that there are on-site and off-site PCAs that have resulted in APECs on the Phase I Property.

Additional off-site PCAs identified within the study area are not considered to represent APECs on the Phase I Property based on their separation distances and/or orientations relative to the subject land.

A variety of independent sources were consulted as part of this assessment, and as such, the conclusions of this report are not affected by uncertainty which may be present with respect to the individual sources.

8.0 CONCLUSIONS

8.1 Assessment

Paterson Group was retained by Kerr Broadview Properties Ltd. to carry out a Phase I-Environmental Site Assessment (ESA) for the property addressed 1740, 1746 and 1754 Carling Avenue, 828 Boyd Avenue and 1755 Kerr Avenue, in the City of Ottawa, Ontario (the Phase I Property). The purpose of this Phase I-ESA was to research the past and current use of the site and study area and to identify any environmental concerns with the potential to have impacted the subject property.

According to the historical research, the Phase I Property was first developed for commercial and residential purposes prior to the 1950s, while surrounding properties were used for a combination of commercial, community and residential purposes.

One historical potentially contaminating activity (PCAs) was identified during the research portion of this assessment, a former on-site underground diesel tank on the northern portion of the Phase I ESA (1746 Carling Avenue). The presence of the former underground diesel storage tank is considered to have resulted in an area of potential environmental concern (APEC) on the Phase I Property.

According to the historical research, a former RFO located at 1784 Carling Avenue was present immediately north of the western portion of the Phase I Property. Auto service garages were identified at 843 Boyd Avenue, 840 Boyd Avenue and 1702 Carling Avenue, approximately 30m southeast, 30m south and 20m east of the

Phase I Property. These properties were also considered to represent APECs on the Phase I Property.

Additional off-site historical PCAs identified within the Phase I Study Area were not considered to represent PCAs on the Phase I Property based on their separation distances and/or orientations relative to the subject land.

Following the historical review, a site visit was conducted. The northeastern corner of the Phase I Property is occupied by a commercial retail building. The northern portion of the Phase I Property is occupied by two auto service garages. The presence of the auto service garages is considered to pose an APEC on the Phase I Property.

Three off-site automotive service garages were identified during the site visit for the surrounding properties located at 814 Boyd Avenue (immediately southeast of the eastern portion of the Phase I ESA), 1772 and 1784 Carling Avenue (immediately north of the western portion of the Phase I ESA, respectively). These properties were also considered to represent APECs on the Phase I Property. The remainder of the surrounding properties consist of commercial or residential properties. Several potentially contaminating activities were identified during the site visit, within the Phase I Study Area and were not considered to represent areas of potential environmental concern on the subject site due to their separation distances and/or orientations relative to the subject land.

8.2 Recommendations

Based on the results of the Phase I-ESA, **in our opinion, a Phase II-Environmental Site Assessment is required for the Phase I Property.**

It is our understanding that the subject site is to be redeveloped in the future. Based on the potential presence of hazardous building materials and designated substances within the subject buildings, it is recommended that a designated substance survey be conducted prior to any demolition activities, in accordance with Ontario Regulation 490/09, under the Occupational Health and Safety Act, if one has not already been completed.

9.0 STATEMENT OF LIMITATIONS

This Phase I - Environmental Site Assessment report has been prepared under the supervision of a Qualified Person, in general accordance with O.Reg. 153/04, as amended, and meets the requirements of CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I - ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

Should any conditions be encountered at the Phase I Property and/or historical information that differ from our findings, we request that we be notified immediately in order to allow for a reassessment.

This report was prepared for the sole use of Kerr Broadview Properties Ltd. Permission and notification from the above noted party and Paterson will be required to release this report to any other party.

Paterson Group Inc.



Mohammed Ramadan, B.Sc.



Mark D'Arcy, P.Eng, QP_{ESA}



Report Distribution:

- ☐ Kerr Broadview Properties Ltd.
- ☐ Paterson Group

10.0 REFERENCES

Federal Records

Air photos at the Energy Mines and Resources Air Photo Library.
National Archives.
Maps and photographs (Geological Survey of Canada surficial and subsurface mapping).
Natural Resources Canada – The Atlas of Canada.
Environment Canada, National Pollutant Release Inventory.
PCB Waste Storage Site Inventory.

Provincial Records

MECP Freedom of Information and Privacy Office.
MECP Municipal Coal Gasification Plant Site Inventory, 1991.
MECP document titled “Waste Disposal Site Inventory in Ontario”.
MECP Brownfields Environmental Site Registry.
Office of Technical Standards and Safety Authority, Fuels Safety Branch.
MNR Areas of Natural Significance.
MECP Water Well Record Inventory.
Chapman, L.J., and Putnam, D.F., 1984: ‘The Physiography of Southern Ontario, Third Edition’, Ontario Geological Survey Special Volume 2.

Municipal Records

City of Ottawa Document “Old Landfill Management Strategy, Phase I - Identification of Sites.”, prepared by Golder Associates, 2004.
Intera Technologies Limited Report “Mapping and Assessment of Former Industrial Sites, City of Ottawa”, 1988.
geoOttawa: City of Ottawa electronic mapping website.
City of Ottawa Historical Land Use Inventory (HLUI) Database

Local Information Sources

Personal Interviews.

Public Information Sources

Google Earth.
Google Maps/Street View.

Private Information Sources

ERIS Report (2024)

FIGURES

FIGURE 1 – KEY PLAN

FIGURE 2 – TOPOGRAPHIC MAP

DRAWING PE4425-1 – SITE PLAN

DRAWING PE4425-2 – SURROUNDING LAND USE PLAN

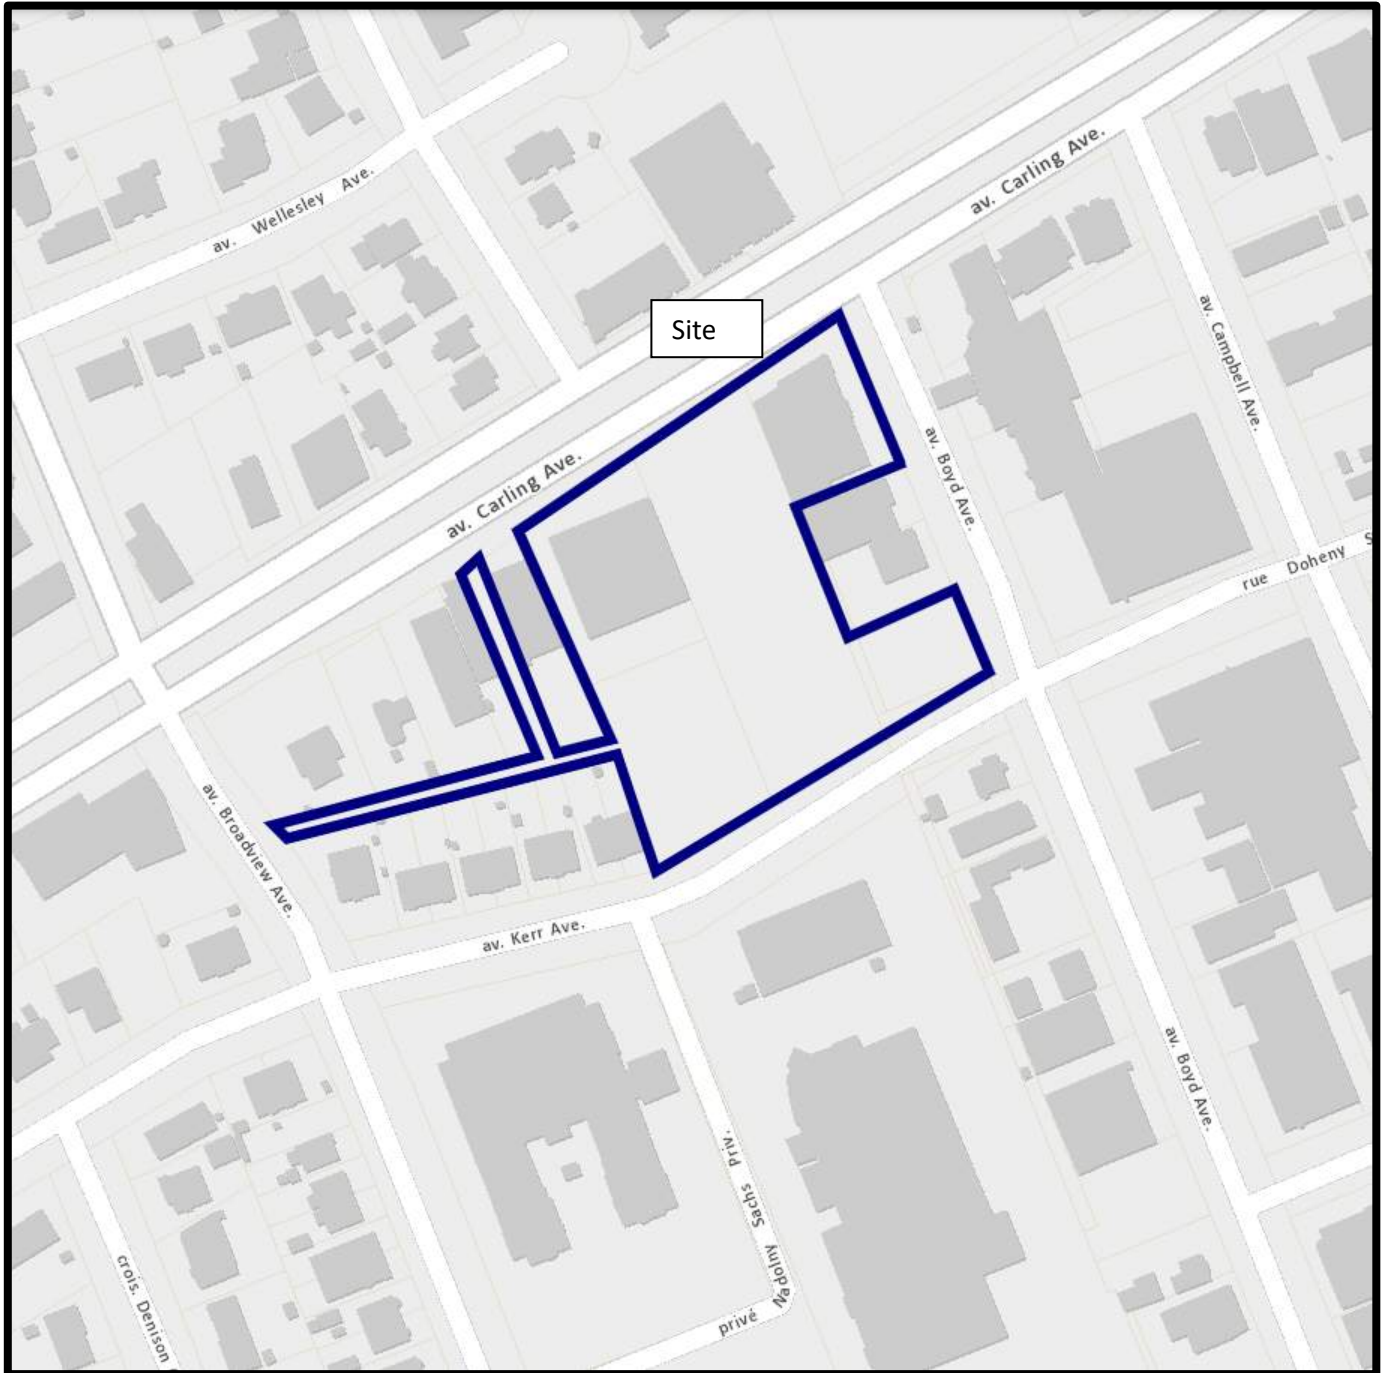


FIGURE 1
KEY PLAN



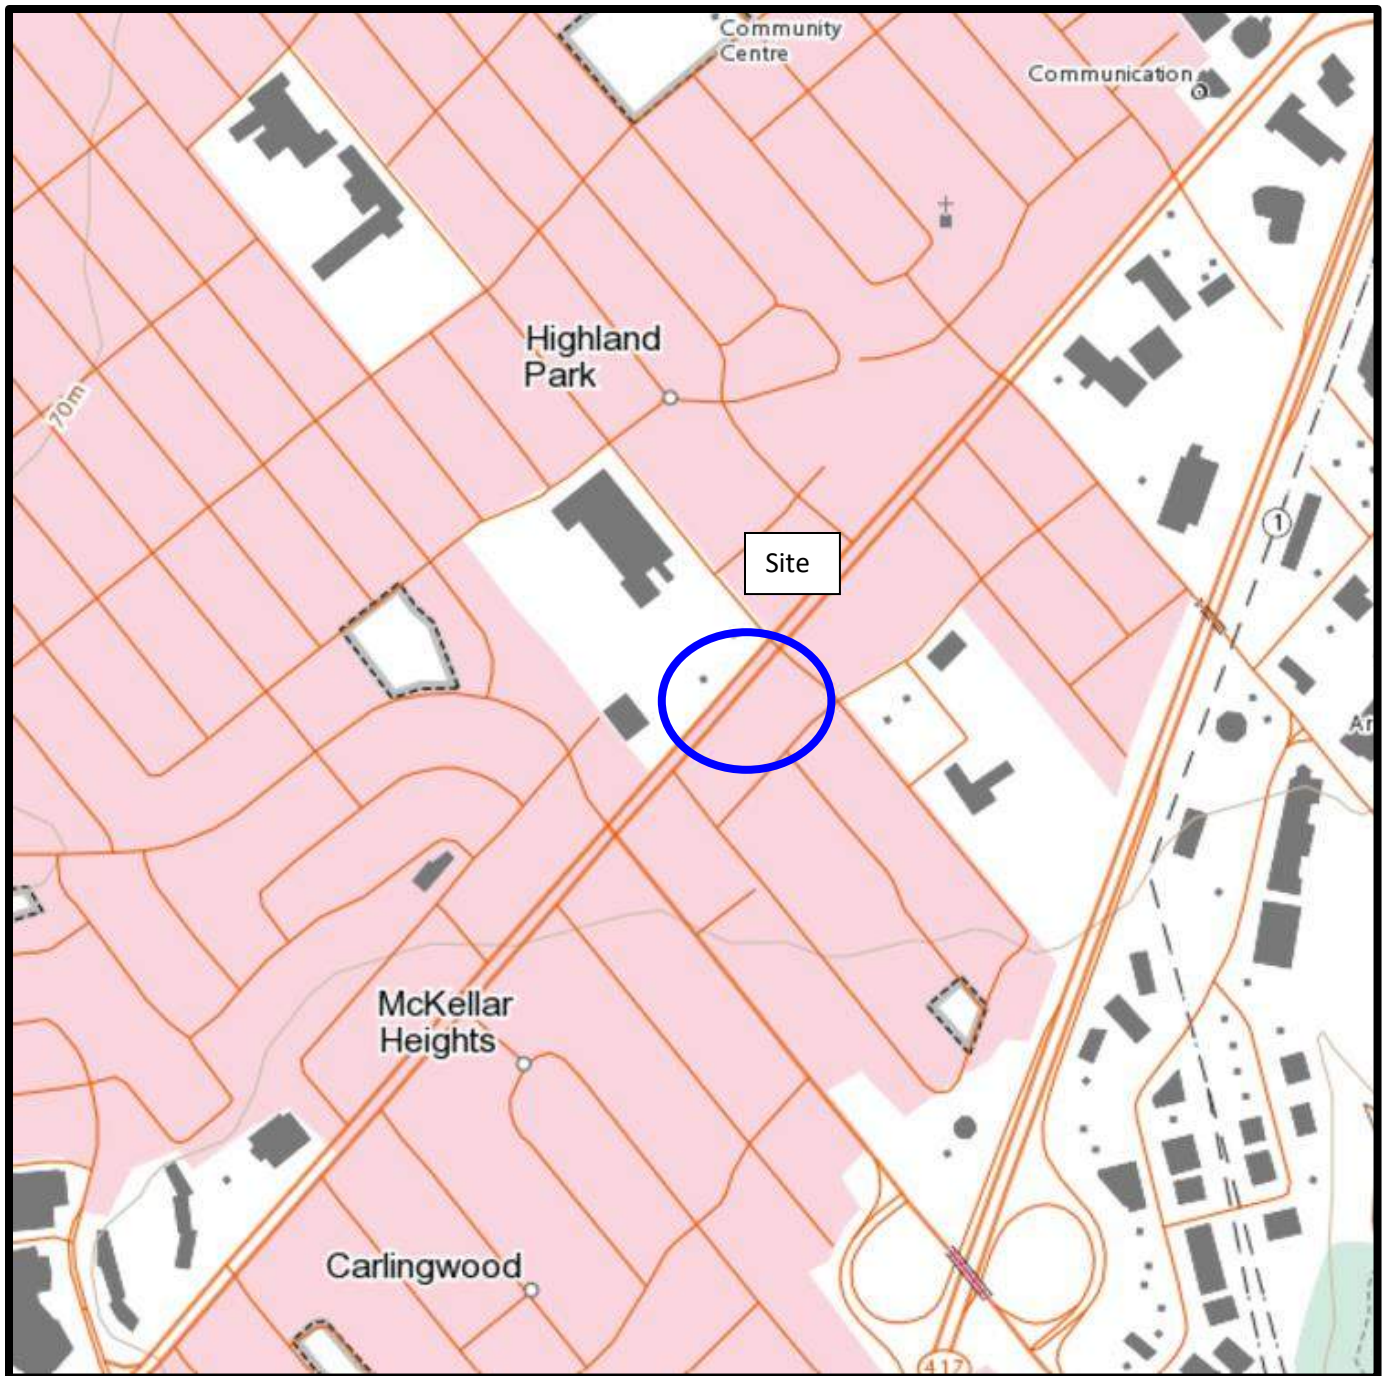


FIGURE 2
TOPOGRAPHIC MAP

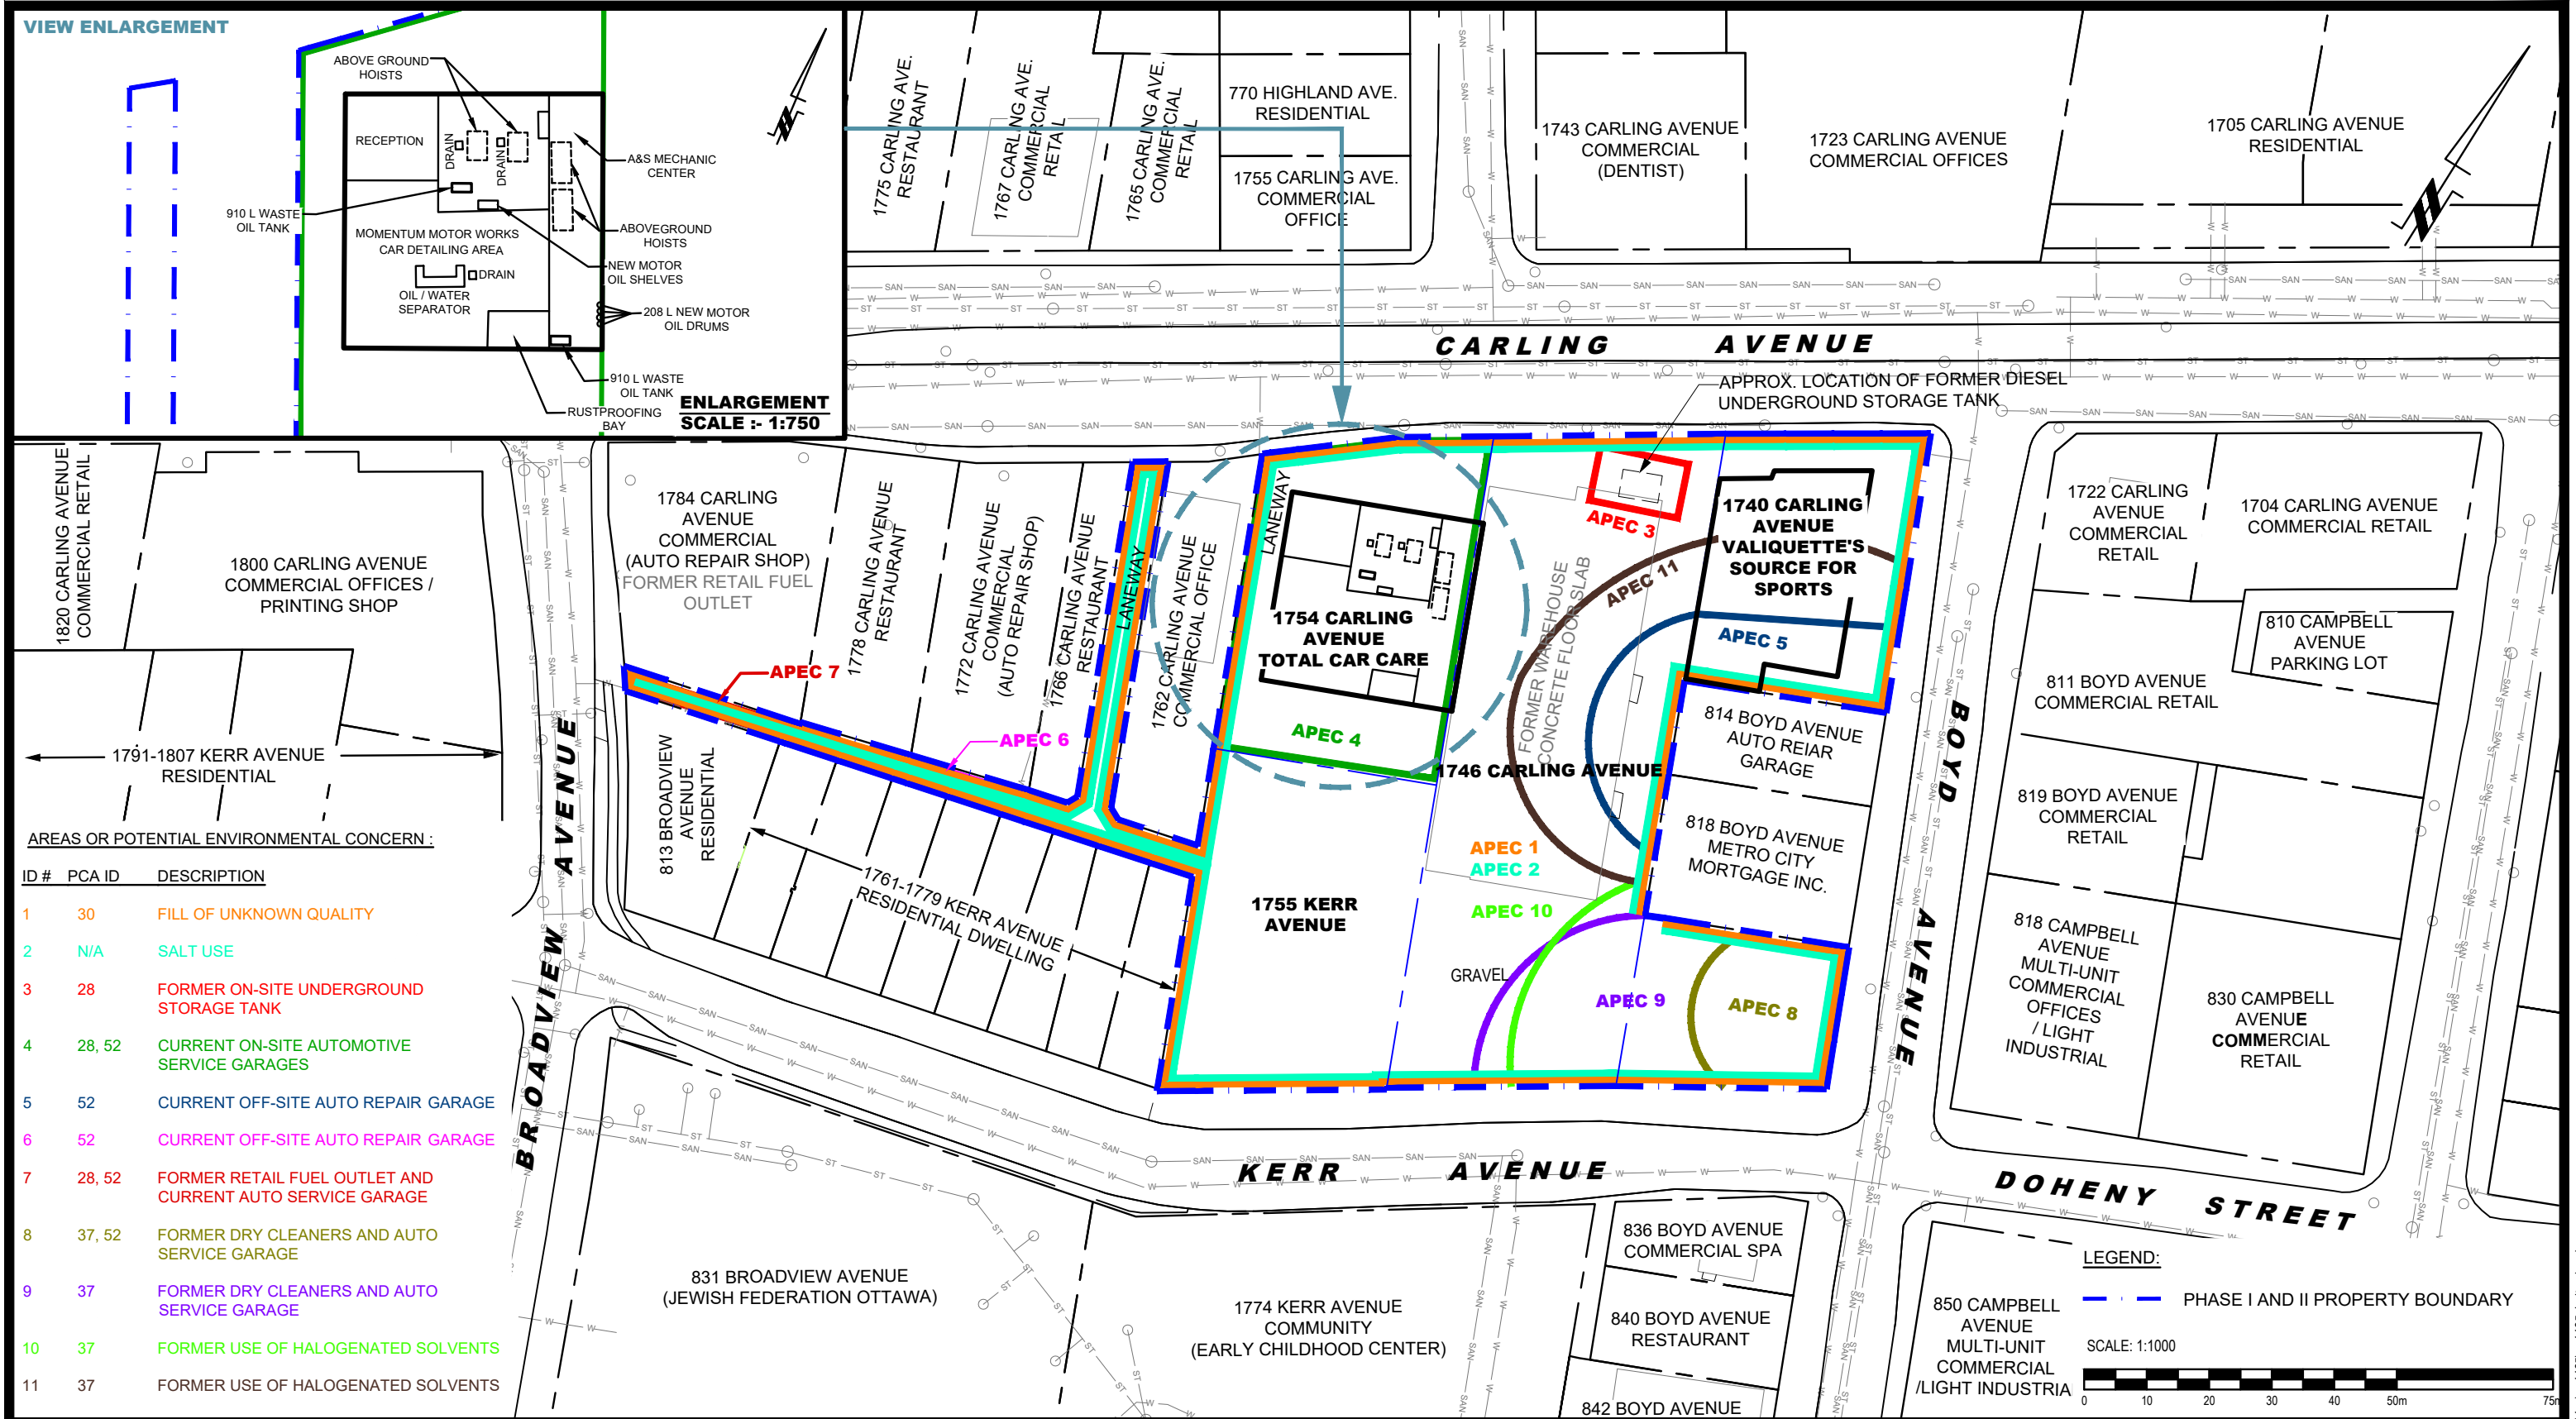

 9 AURIGA DRIVE OTTAWA, ON K2E 7T9 TEL: (613) 226-7381	KERR BROADVIEW PROPERTIES LTD				Scale: 1:1000		Date: 07/2025
	PHASE I - ENVIRONMENTAL SITE ASSESSMENT				Drawn by: GK		Report No.: PE4425-1
	1740, 1746 & 1754 CARLING AVENUE & 828 BOYD AVENUE & 1755 KERR AVENUE				Checked by: MR		Dwg. No.: PE4425-1
	OTTAWA, ONTARIO				Approved by: MSD		Revision No.:
	Title: SITE PLAN						
NO.		REVISIONS	DATE	INITIAL			

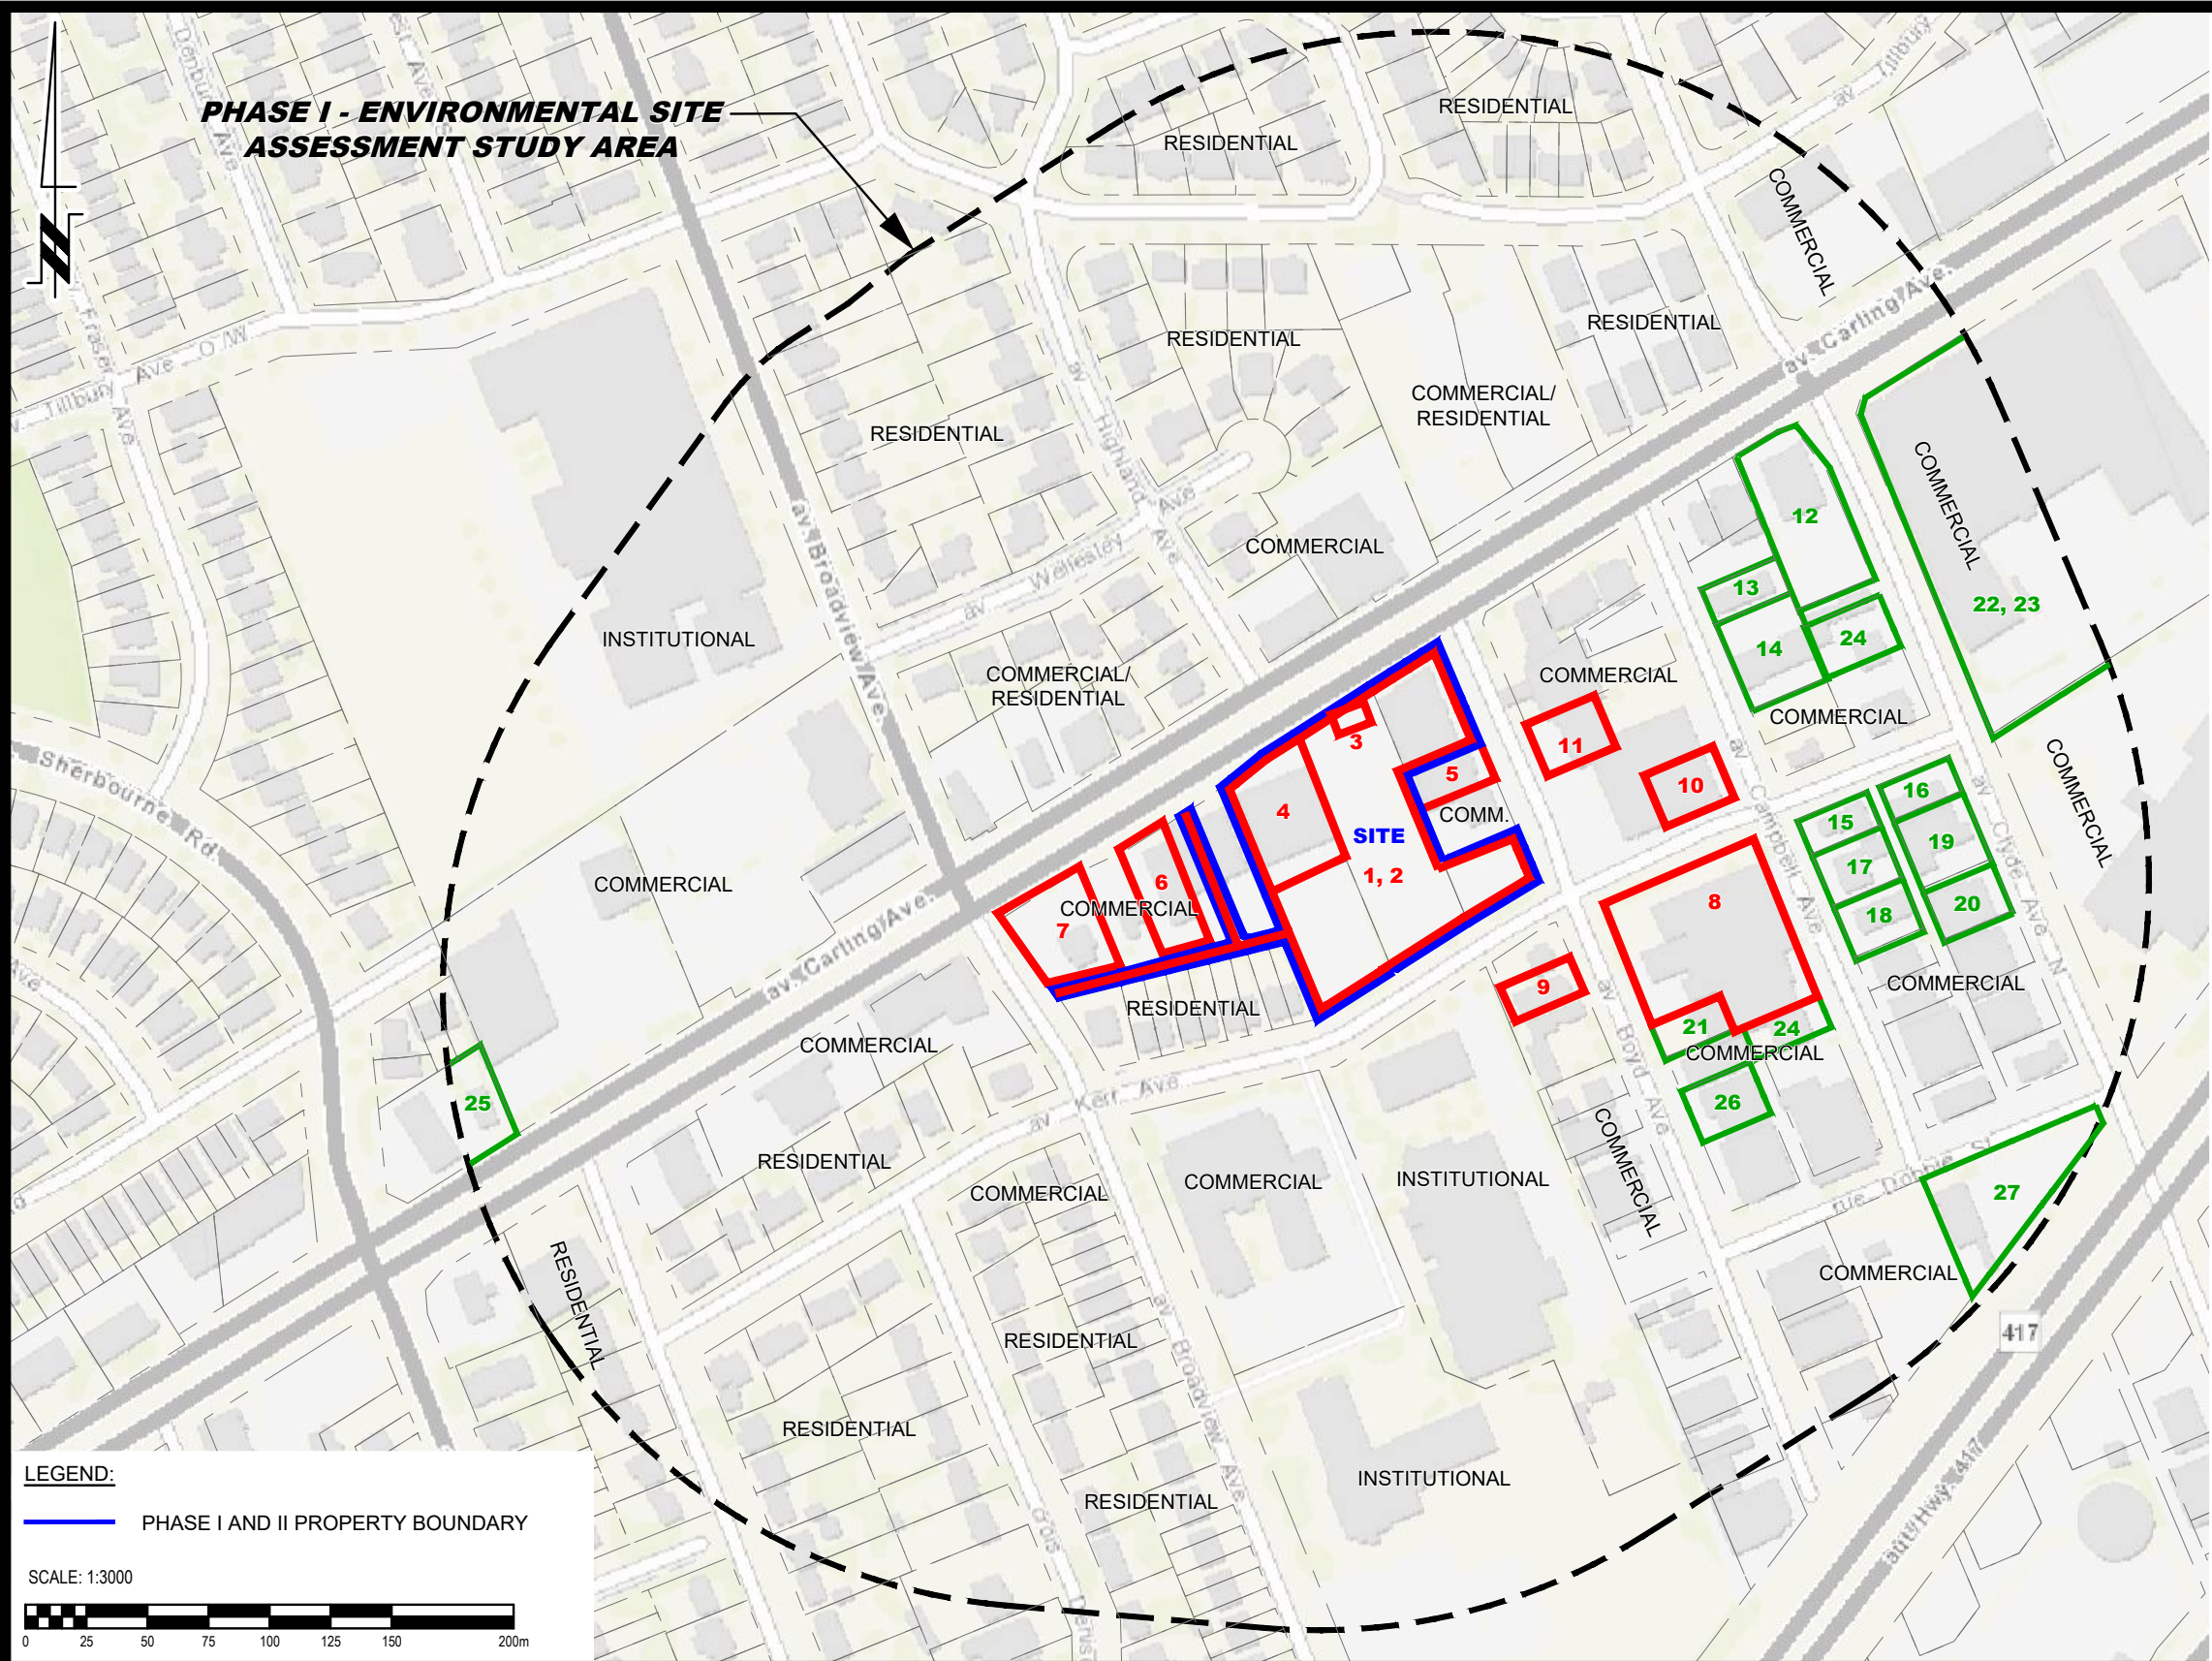


POTENTIALLY CONTAMINATING ACTIVITIES :			
ID #	PCA ID	ADDRESS	DESCRIPTION
1	30	1746 CARLING AVE.	FILL OF UNKNOWN QUALITY
2	N/A	1746 CARLING AVE.	SALT USE
3	28	1746 CARLING AVE.	FORMER ON-SITE UNDERGROUND STORAGE TANK
4	28, 52	1754 CARLING AVE.	CURRENT ON-SITE AUTOMOTIVE SERVICE GARAGES
5	52	814 BOYD AVE.	CURRENT OFF-SITE AUTO REPAIR GARAGE
6	52	1771 CARLING AVE.	CURRENT OFF-SITE AUTO REPAIR GARAGE
7	28, 52	1784 CARLING AVE.	FORMER RETAIL FUEL OUTLET AND CURRENT AUTO SERVICE GARAGE
8	37, 52	843 BOYD AVE.	FORMER DRY CLEANERS AND AUTO SERVICE GARAGE
9	37, 52	840 BOYD AVE.	FORMER DRY CLEANERS AND AUTO SERVICE GARAGE
10	52	819 BOYD AVE	FORMER USE OF HALOGENATED SOLVENTS
11	52	830 CAMPBELL AVE.	FORMER USE OF HALOGENATED SOLVENTS
12.	52	1688 CARLING AVE.	MEINEKE AUTOMOTIVE SERVICE GARAGE
13.	52	815 CAMPBELL AVE.	IMPORT CAR CENTER AUTOMOTIVE SERVICE GARAGE
14.	52	825 CAMPBELL AVE.	PARADISE AUTO REPAIR AUTOMOTIVE SERVICE GARAGE
15.	52	1700 DOHENY ST.	JJ AUTOSHINE CAR DETAILING GARAGE
16.	52	1690 DOHENY ST.	EDSONS AUTO AUTOMOTIVE SERVICE GARAGE
17.	52	851 CAMPBELL AVE.	IMPORTS MOTOR AUTOMOTIVE SERVICE GARAGE
18.	52	849 CAMPBELL AVE.	J & L AUTOMOTIVE AUTOMOTIVE SERVICE GARAGE
19.	8	848 CLYDE AVE.	THE PUMP HOUSE INDUSTRIAL EQUIPMENT SUPPLIER
20.	52	856 CLYDE AVE.	S.O.S POWER SALES OR SERVICE LTD. SMALL ENGINE REPAIR SHOP
21.	52	849 BOYD AVE.	SMRO AUTO REPAIR AUTOMOTIVE SERVICE GARAGE
22.	52	1660 CARLING AVE.	FORMER SATURN, SAAB, ISUZU CAR DEALERSHIP (2000) (FORMERLY 1650 CARLING AVENUE)
23.	52	1660 CARLING AVE.	FORMER PONTIAC, BUICK, GMC CAR DEALERSHIP (2000) (FORMERLY 1666 CARLING AVENUE)
24.	52	856 CAMPBELL AVE.	AUTOMOTIVE SERVICE GARAGE
25.	52	822 CLYDE AVE.	FORMER AUTO SALES
26.	52	1859 CARLING AVE.	CURRENT RETAIL FUEL OUTLET
27.	52	849 BOYD AVE.	CURRENT AUTO SERVICE GARAGE

 9 AURIGA DRIVE OTTAWA, ON K2E 7T9 TEL: (613) 226-7381					KERR BROADVIEW PROPERTIES LTD PHASE II - ENVIRONMENTAL SITE ASSESSMENT 1740, 1746 & 1754 CARLING AVENUE & 828 BOYD AVENUE & 1755 KERR AVENUE OTTAWA, ONTARIO	Scale:	1:3000	Date:	10/2024
						Drawn by:	GK	Report No.:	PE4425-1
						Checked by:	MR	Dwg. No.:	PE4425-2
						Approved by:	MSD	Revision No.:	
	NO.	REVISIONS	DATE	INITIAL					


APPENDIX 1

AERIAL PHOTOGRAPHS

SITE PHOTOGRAPHS

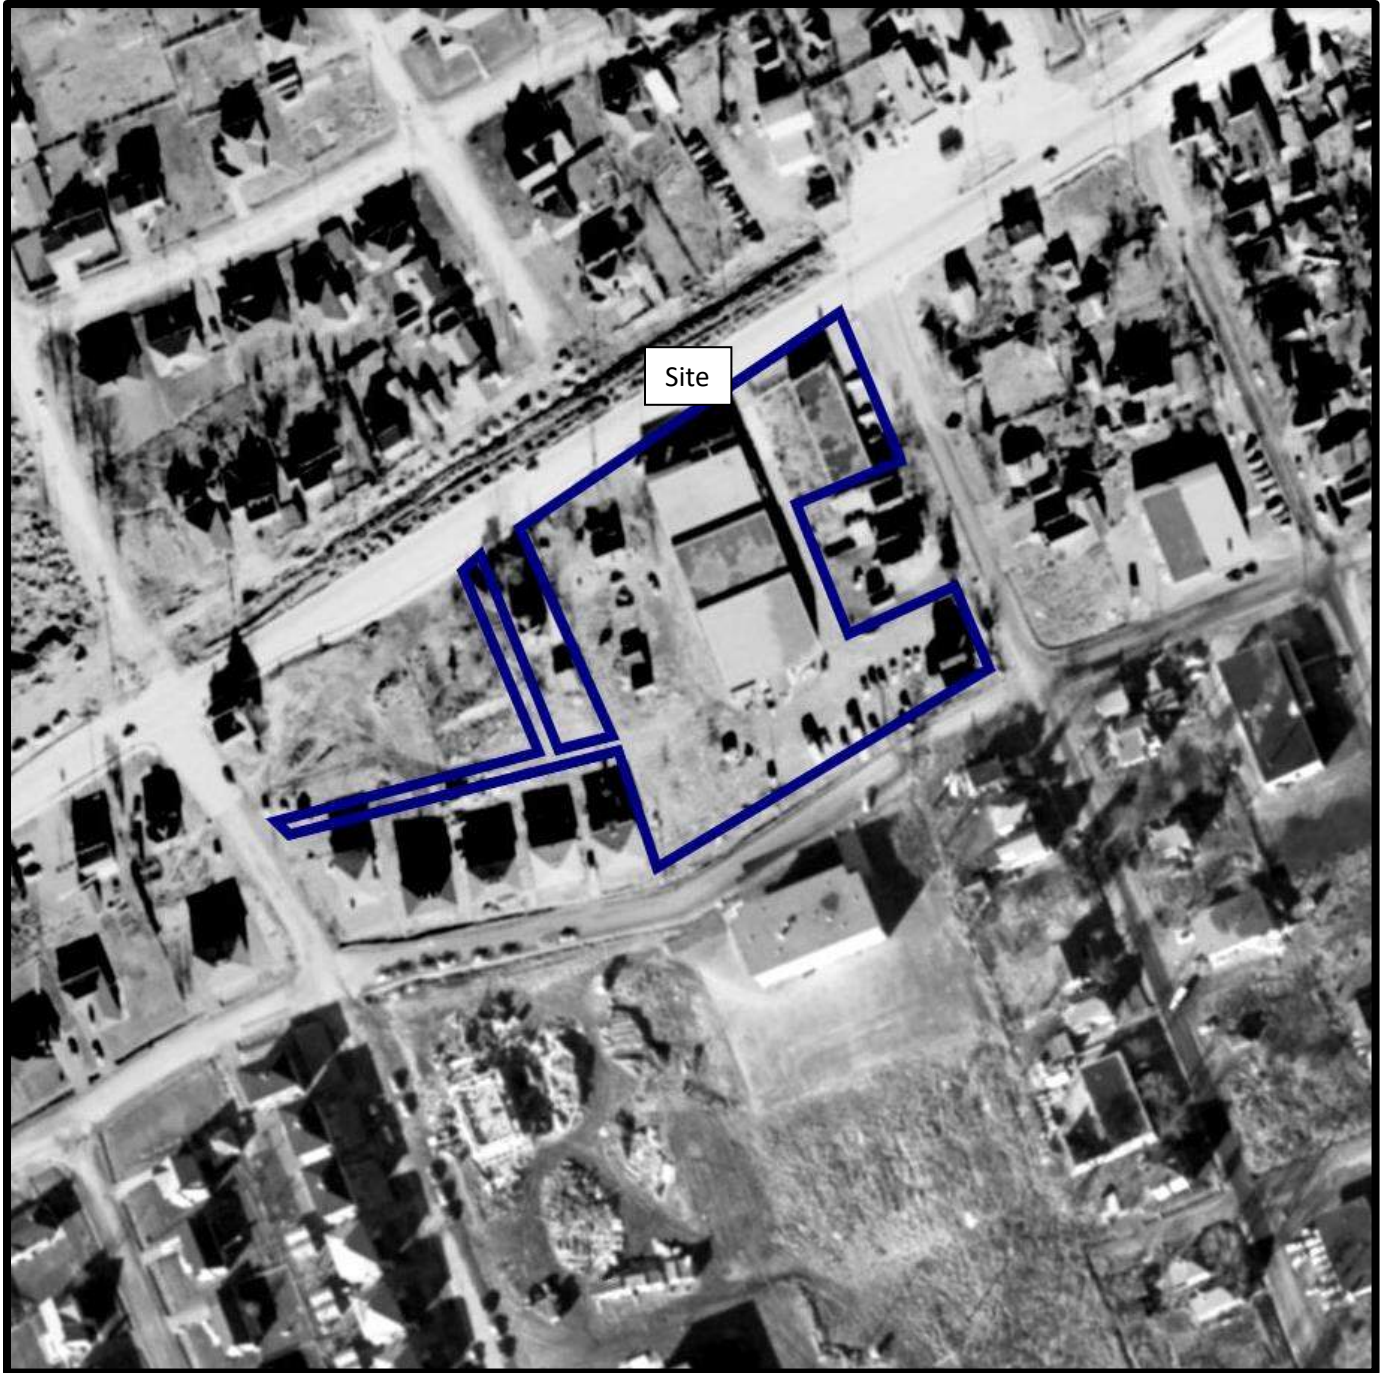


AERIAL PHOTOGRAPH
1958

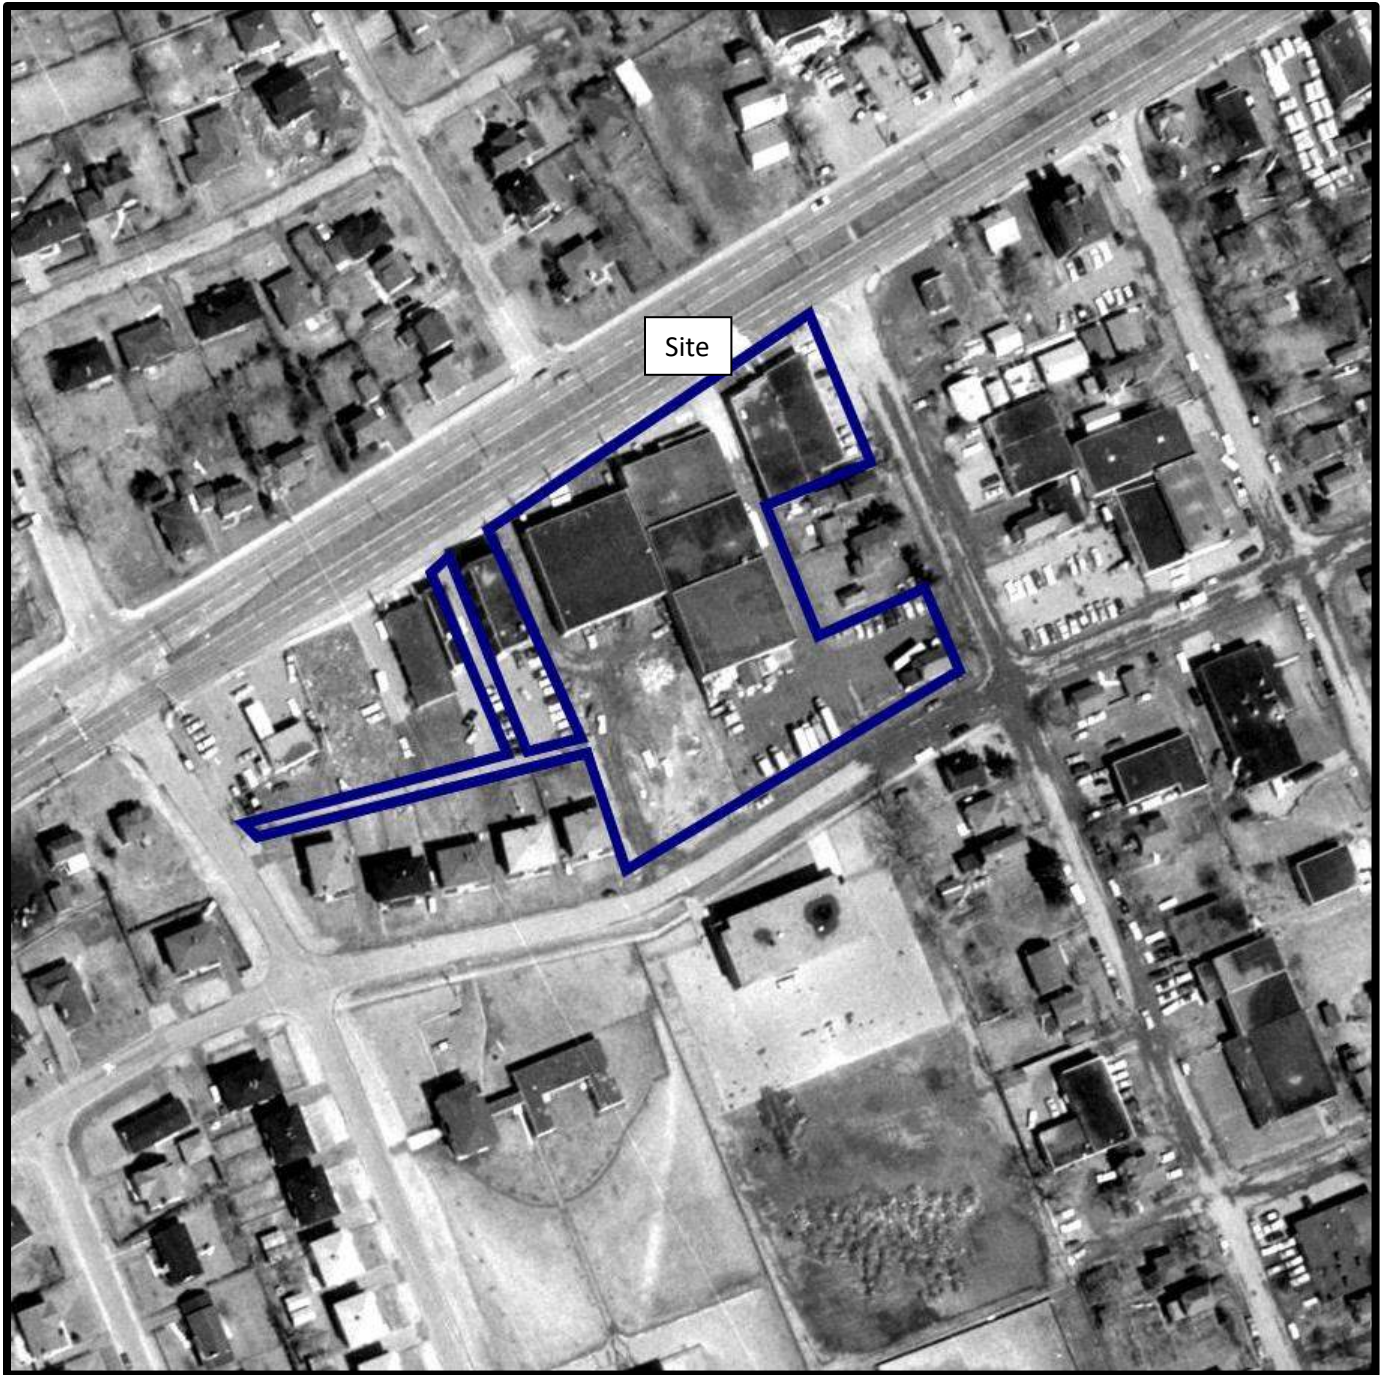


AERIAL PHOTOGRAPH
1965



AERIAL PHOTOGRAPH
1976

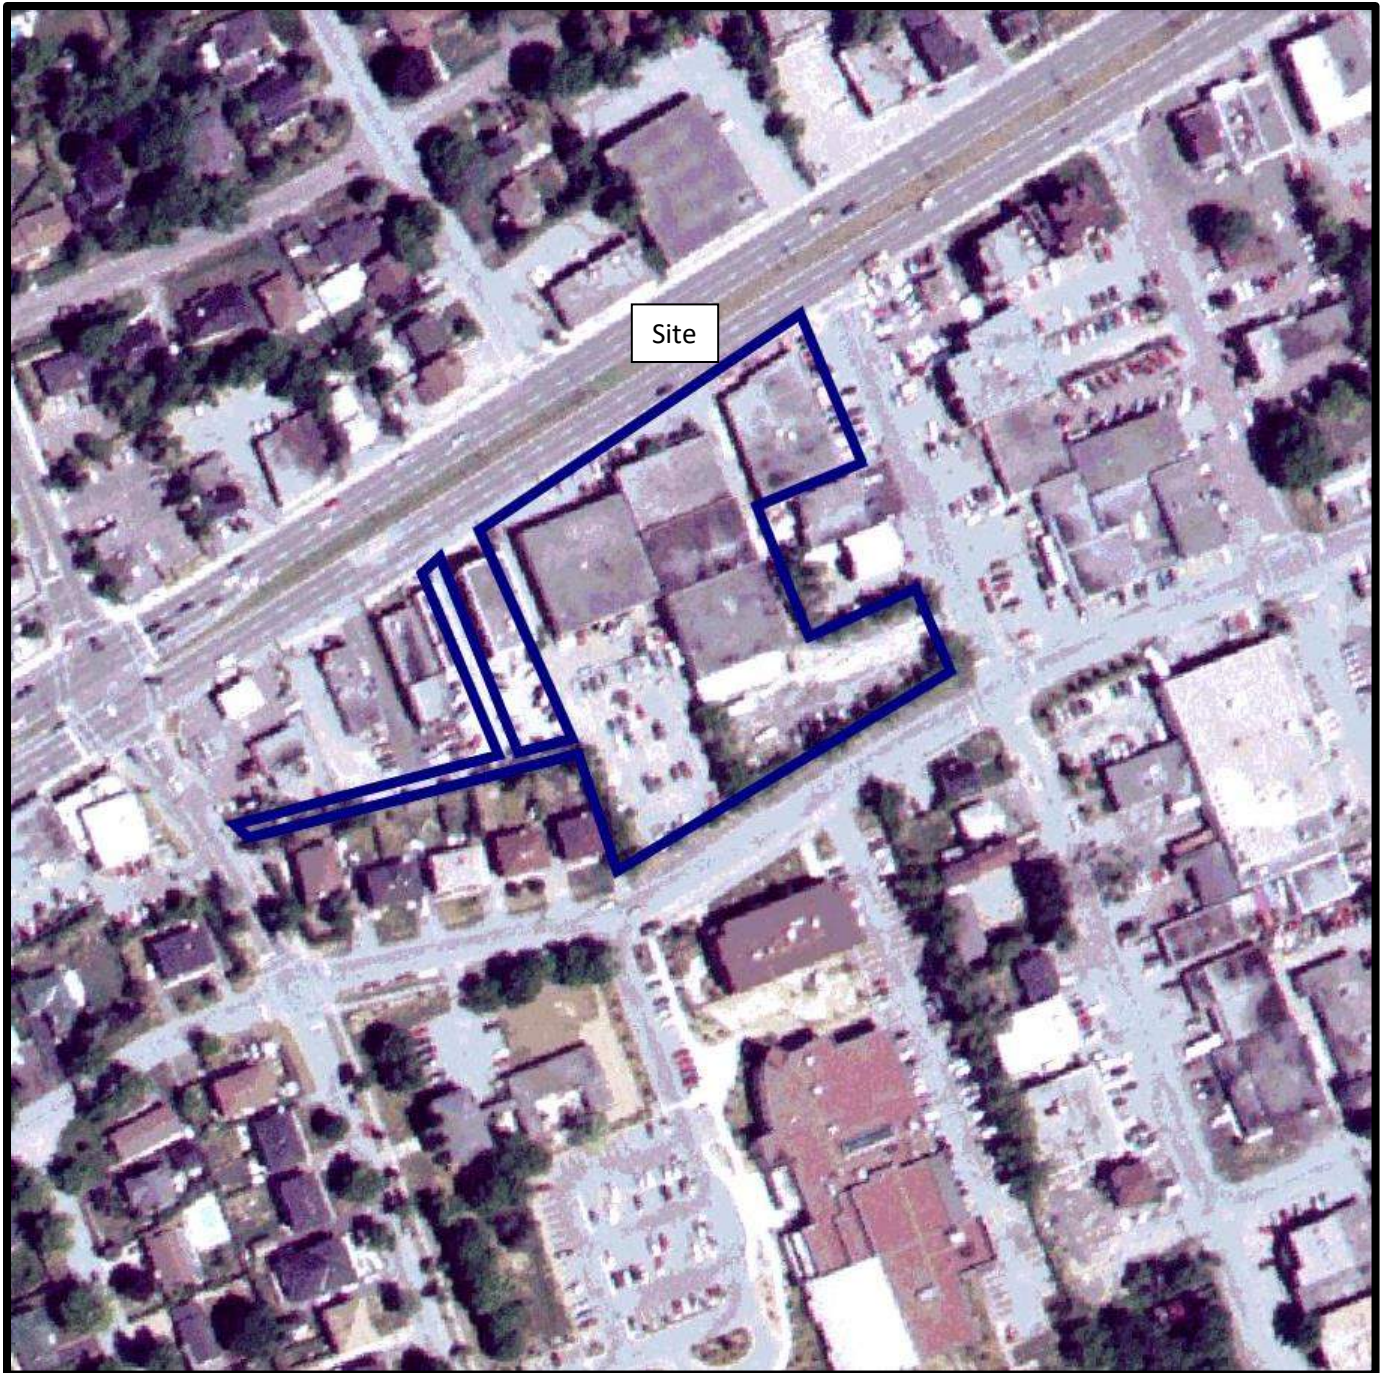

AERIAL PHOTOGRAPH
1999

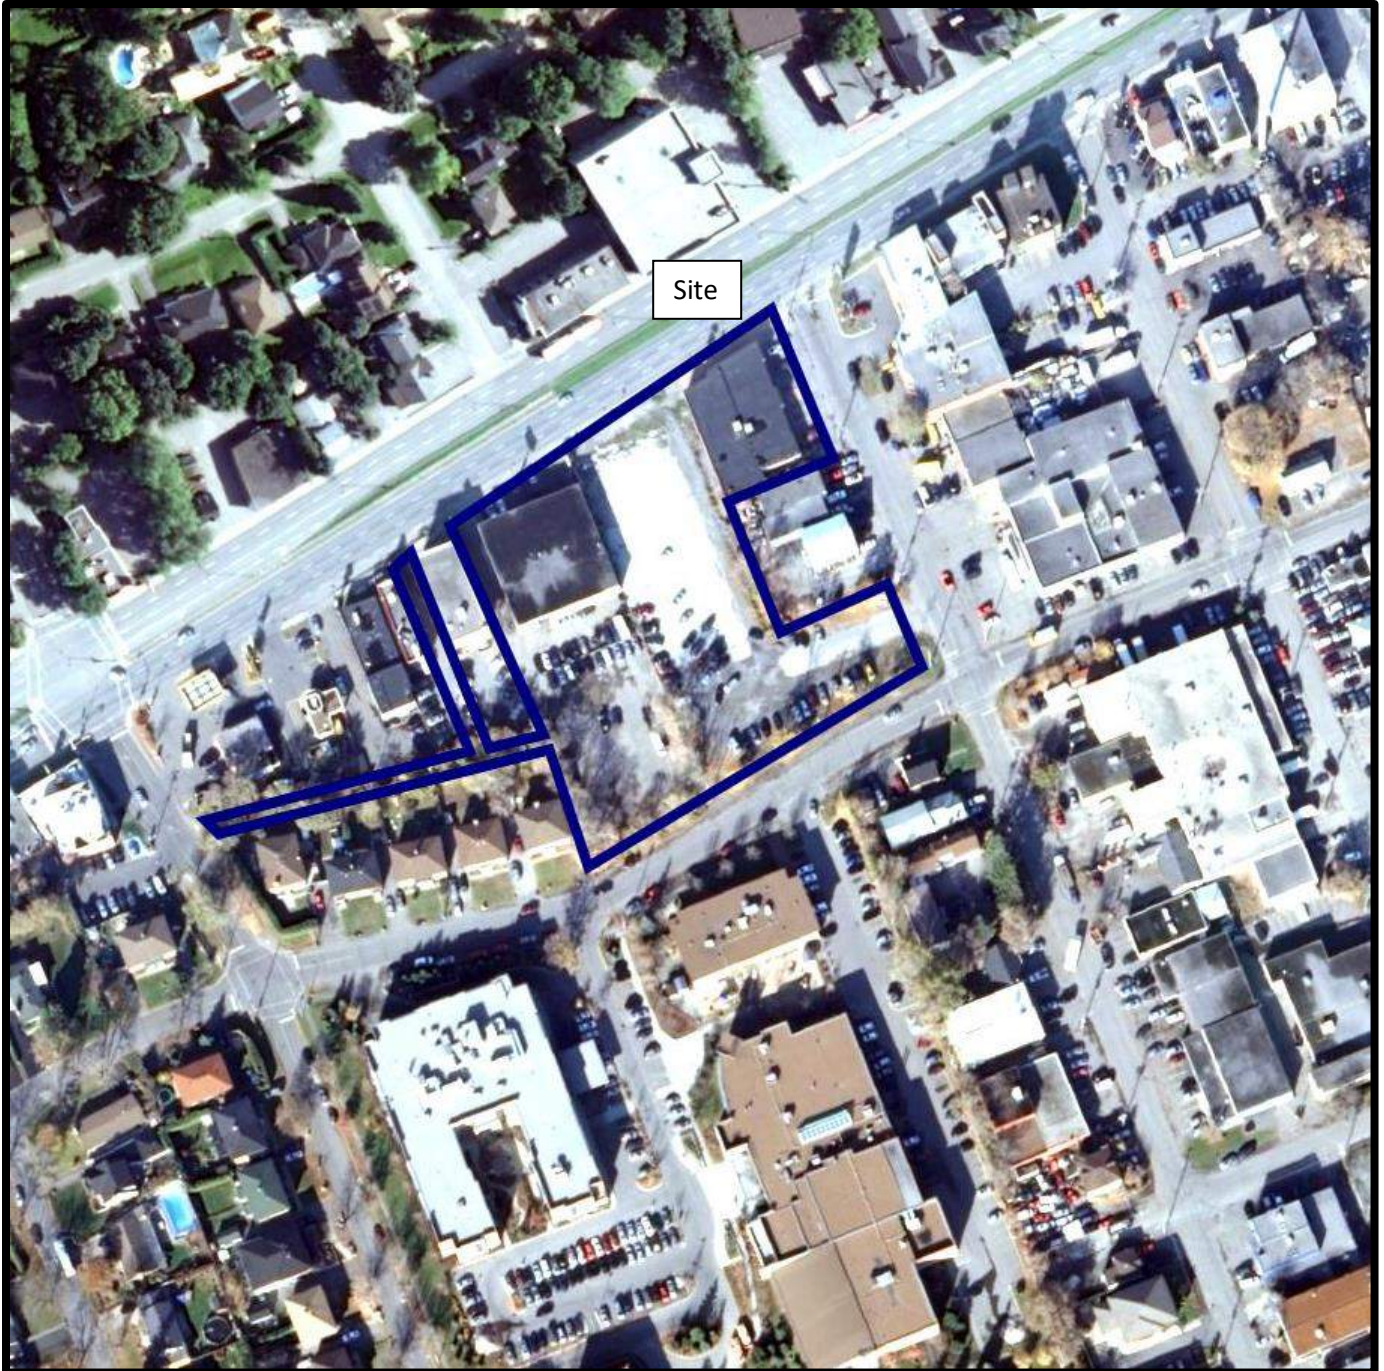

AERIAL PHOTOGRAPH
2008



AERIAL PHOTOGRAPH
2022

Site Photographs

PE4425

Carling/Kerr/Boyd, Ottawa, ON

November 18, 2024



Photograph 1: View of the front side of 1740 Carling Avenue, facing south.



Photograph 2: View of 1746 Carling Avenue, facing north.

Site Photographs

PE4425

Carling/Kerr/Boyd, Ottawa, ON

November 18, 2024



Photograph 3: View of inside the unit at 1754 Carling Avenue, facing south.

Site Photographs

PE4425

Carling/Kerr/Boyd, Ottawa, ON

November 18, 2024



Photograph 4: View of one of the 910L waste oil tanks inside 1754 Carling Avenue.

APPENDIX 2

MECP FREEDOM OF INFORMATION

MECP WELL RECORDS

TSSA RESPONSE

CITY OF OTTAWA HLUI SEARCH

ERIS REPORT

Submission summary

Thank you. Your application has been submitted.

Form name:	MECP Freedom of Information
Form number:	012-2146E
Card type:	VISA
Transaction type:	Purchase
Payment total:	\$5.00 CAD
Payment status:	Successful
Payment confirmation:	32412752
Date/time:	April 10, 2025 1:40 PM
Submission confirmation number:	48716909
Submitted to:	Information Management and Access Branch

More information

Should you have any questions or comments regarding your application, please call or email the contact listed above. Every effort is made to ensure that the online form is successfully delivered; however, making sure that the document was received remains the responsibility of the user.

[Privacy](#)


[Accessibility](#)

[Contact us](#)

[Terms of use](#)

[© King's Printer for Ontario, 2023](#)

UTM 118Z 44110810E
9R 502419210N
Elev. 9R 0255
Basin 25

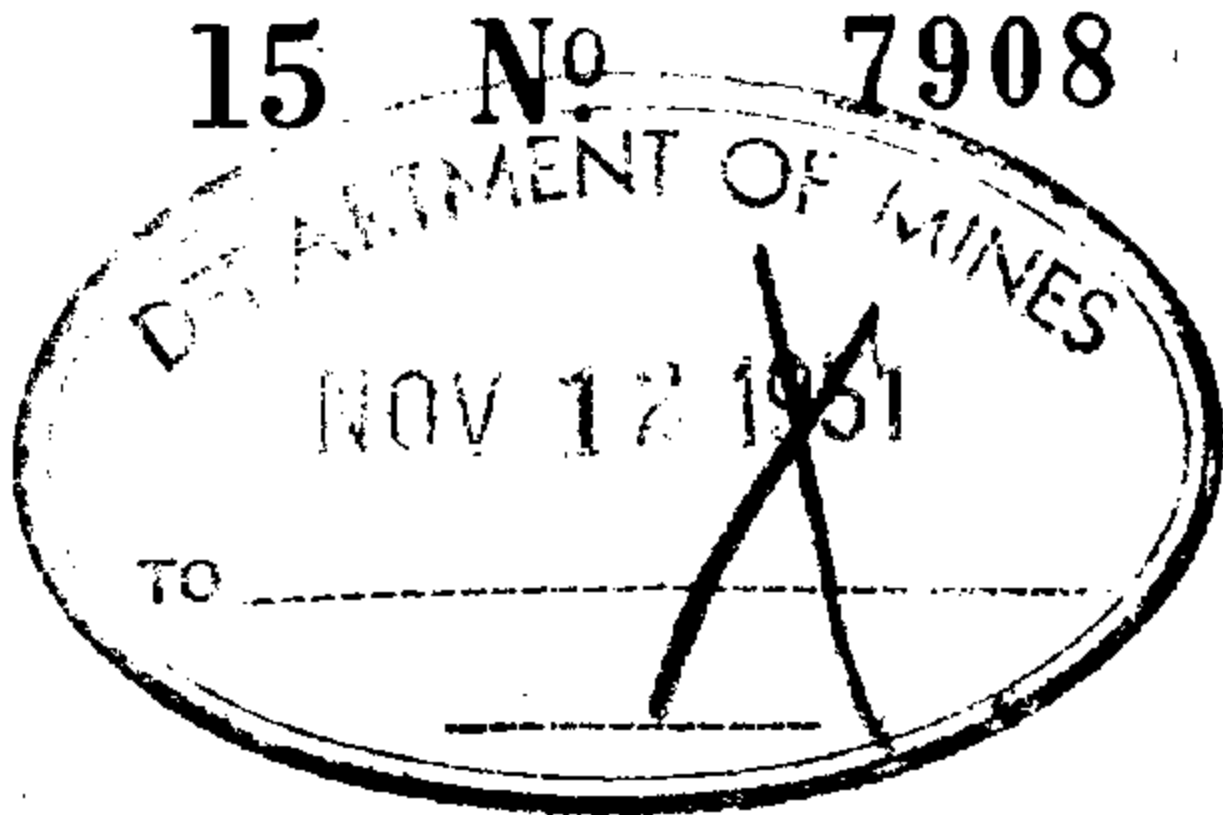

The Well Drillers Act
Department of Mines, Province of Ontario

Water Well Record

City of Ottawa
County or Territorial District Carleton Township, Village, Town or City Nepean
City Ottawa Lot 178 Street and Number (if in Village, Town or City) Boyd Ave
Owner [Redacted] Address Starva
Date Completed Nov 4/51 Cost of Well (excluding pump) [Redacted]
(day) (month) (year)

Pipe and Casing Record

Pumping Test

Casing diameter(s) 2" Date Nov 4/51
Length(s) of casing(s) 30 ft Static level 3 ft
Type of screen [Redacted] Pumping level 30 ft
Length of screen [Redacted] Pumping rate 25 gpm
Distance from top of screen to ground level [Redacted] Duration of test 2 hours
Is well a gravel-wall type? Rock Distance from cylinder or bowls to ground level [Redacted]

Water Record

Kind (fresh or mineral) <u>fresh</u>	Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises
Quality (hard, soft, contains iron, sulphur, etc.) <u>soft</u>			
Appearance (clear, cloudy, coloured) <u>clear</u>	<u>58</u>	<u>fresh</u>	<u>55</u>
For what purpose(s) is the water to be used? <u>household</u>			
How far is well from possible source of contamination? <u>50 ft</u>			
What is the source of contamination? <u>septic tank</u>			
Enclose a copy of any mineral analysis that has been made of water			

Well Log


Overburden and Bedrock Record

From To
0 ft. ft.

Clay 0 3
Spill limestone 3 62

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

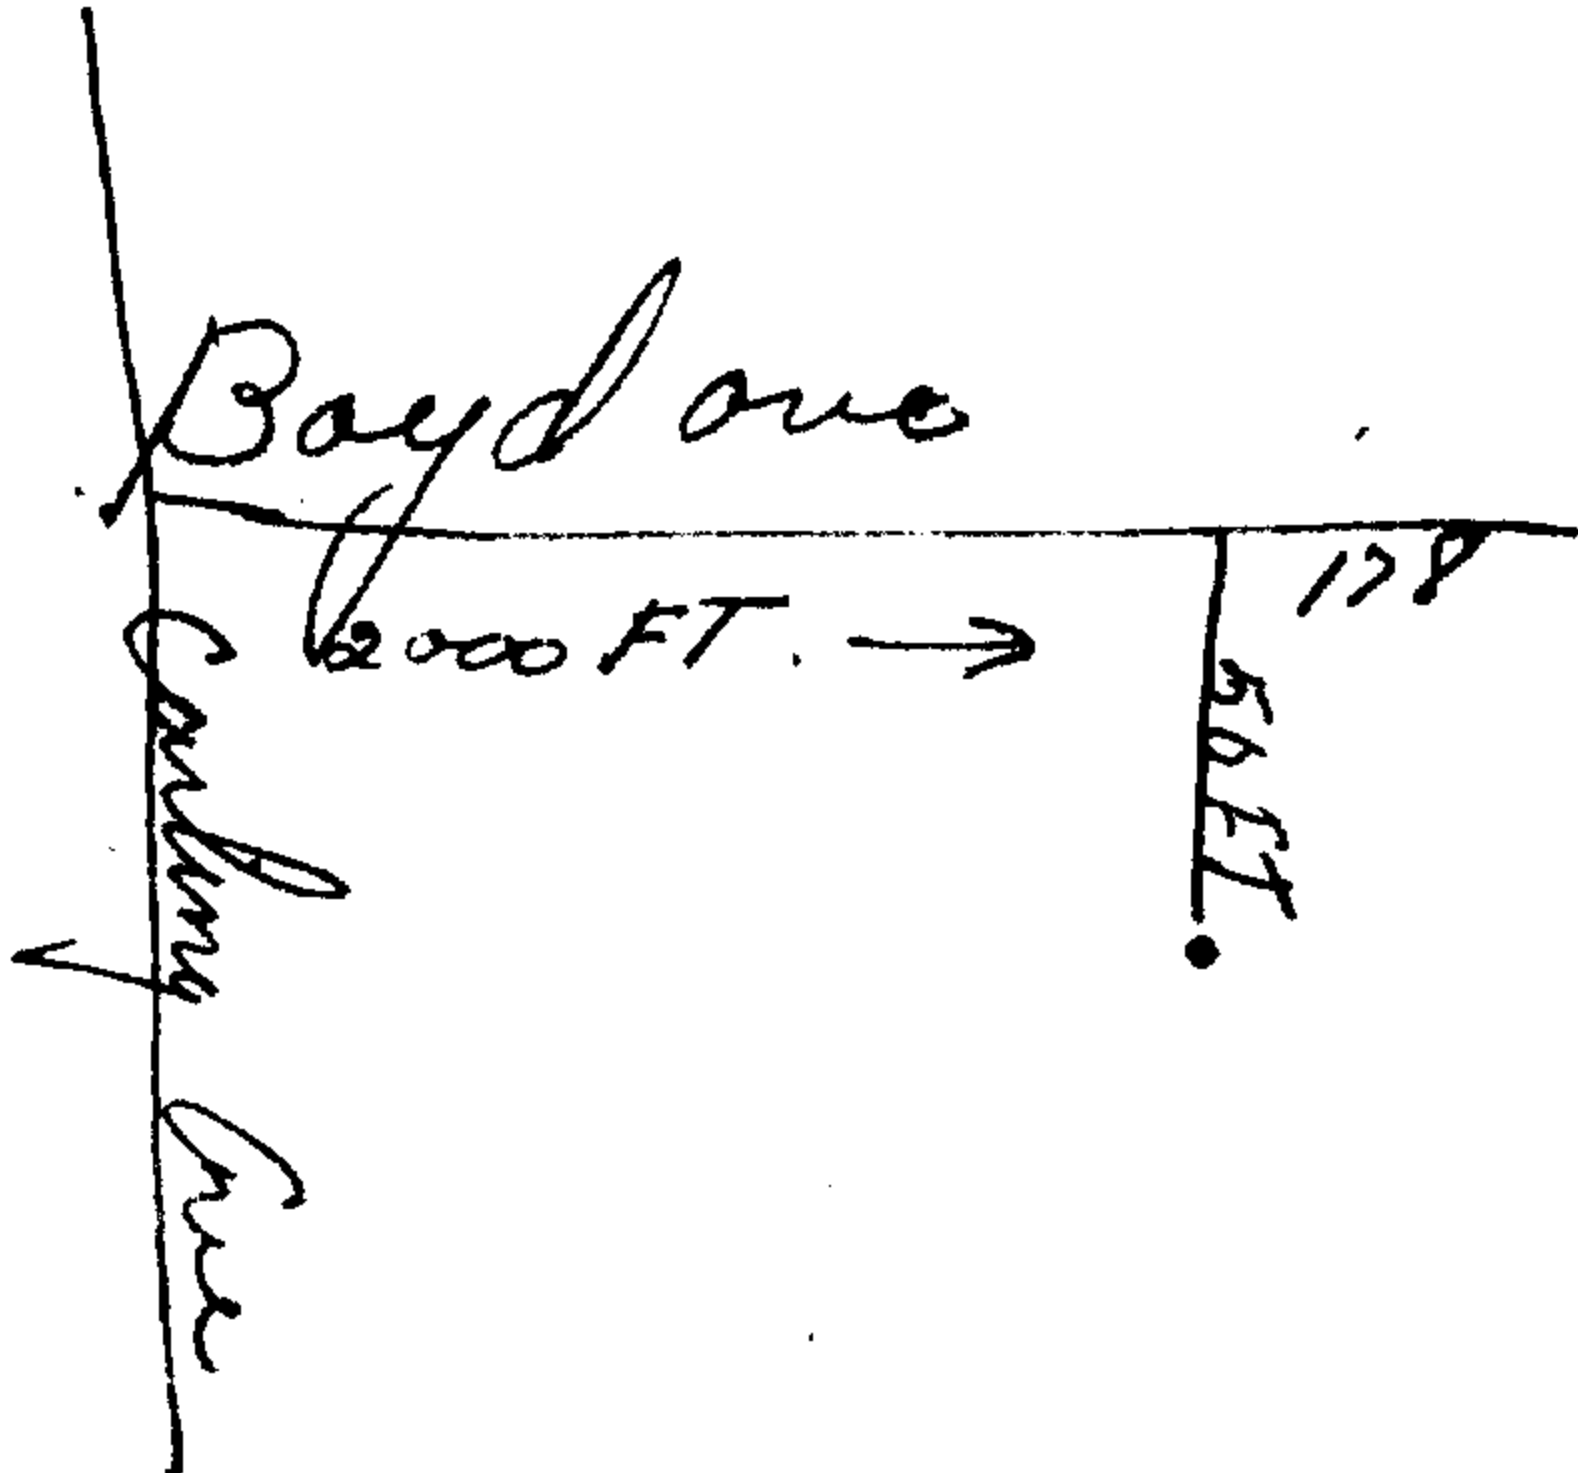


Situation: Is well on upland, in valley, or on hillside? valley
Drilling Firm J. B. Sullivan
Address 1187 Larchway
Name of Driller W. Roy Address [Redacted]
Date Nov 4/51 Licence Number 89

Signature of Licensee

UTM 118 2 44109110 E
5 R 510247105 N
Elev. 4 R 02610
Basin 25



The Water-well Drillers Act, 1954
Department of Mines

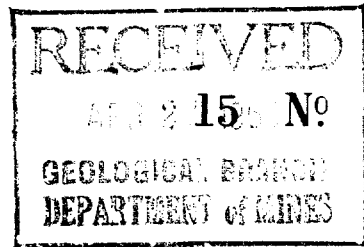

8095

Water-Well Record

County or Territorial District Carleton Township Village, Town or City Ottawa
 Village, Town or City
Address 555 Ridgwood St
(day) (month) (year)

Pipe and Casing Record

Pumping Test


Casing diameter(s) <u>4"</u>	Static level <u>10'</u>
Length(s) <u> </u>	Pumping rate <u>250 GPM</u>
Type of screen <u> </u>	Pumping level <u>10'</u>
Length of screen <u> </u>	Duration of test <u>1 hr</u>

Well Log

Water Record

Overburden and Bedrock Record	From ft.	To ft.	Depth (s) at which water (s) found	No. of feet water rises	Kind of water (fresh, salty, or sulphur)
<u>Clay</u>	<u>1'</u>	<u>10'</u>			
<u>Gravel</u>	<u>10'</u>	<u>12'</u>			
<u>Limestone</u>	<u>10'</u>	<u>120'</u>	<u>95'</u>	<u>25'</u>	<u>fresh</u>

For what purpose(s) is the water to be used? Domestic
Is water clear or cloudy? clear
Is well on upland, in valley, or on hillside? valley
Drilling firm M. M. Magner
Address 639 Ridgwood Ave
Name of Driller M. M. Magner
Address
Licence Number 171
I certify that the foregoing statements of fact are true.
Date Feb 2 M. M. Magner
Signature of Licensee

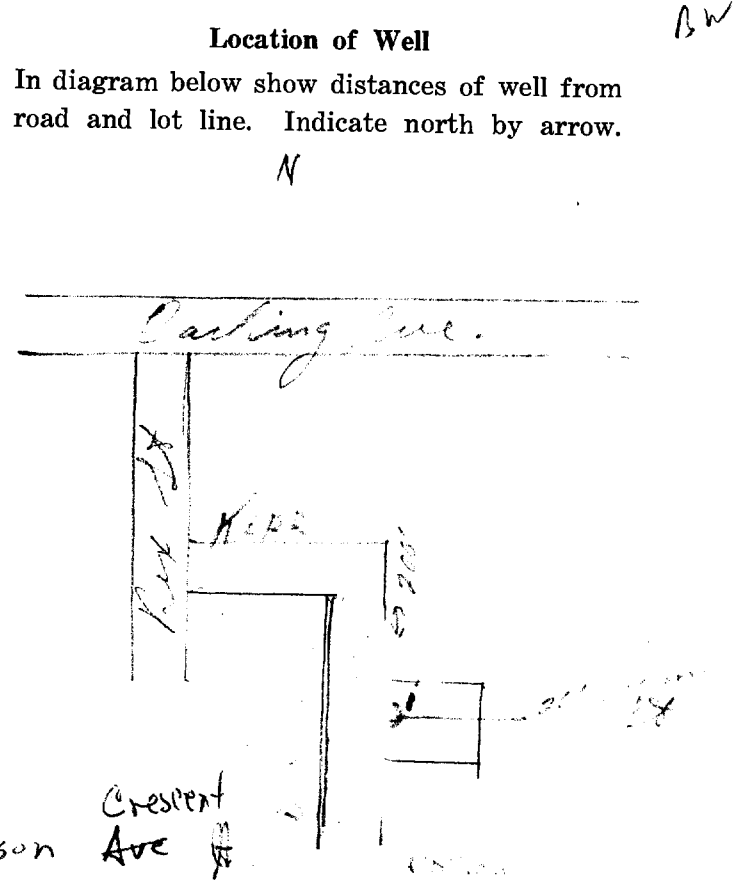

Basin 25 | | | |



15 № 8300

RECEIVED

NO. 200-100000

**GEOLOGICAL BRANCH
DEPARTMENT OF MINES**

The Well Drillers Act
Department of Mines, Province of Ontario

Water Well Record

County of San Diego, State of California, Village, Town or City V. Marwa
 _____, Town or City) _____
 _____, _____
 Date Completed Feb 10 _____ Cost of Well (excluding pump) _____
 (day) (month) (year)

Pipe and Casing Record

Pumping Test

Casing diameter(s).....	4"	Date.....	Feb. 50
Length(s) of casing(s).....	10 ft.	Static level.....	14 ft. ✓
Type of screen.....		Pumping level.....	
Length of screen.....		Pumping rate.....	not tested
Distance from top of screen to ground level.....		Duration of test.....	
Is well a gravel-wall type?.....	no	Distance from cylinder or bowls to ground level.....	

Water Record

Kind (fresh or mineral) *fresh*

Quality (hard, soft, contains iron, sulphur, etc.) *unknown*

Appearance (clear, cloudy, coloured) *clear*

For what purpose(s) is the water to be used? *household*

How far is well from possible source of contamination? *35 ft.*

What is the source of contamination? *septic tank*

Enclose a copy of any mineral analysis that has been made of water

Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises
47 ~~50~~ 70	fresh	30 ~~30~~ ~~50~~

Well Log

Overburden and Bedrock Record

From	To
0 ft.	ft.

topsoil	0	5
limestone	5	70

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

Carling Ave. Broadview
← 75' → N
10'
Highland

Situation: Is well on upland, in valley, or on hillside? *upland*
Drilling Firm. *H. Sparks*
Address.
Name of Driller *H. Sparks* Address *Glendon Ave.*
Date. *Sept. 10/57* Licence Number. *1*

Signature of Licensee


WELL COMPLETED
440955
UTM 18 7 2 1 1 1 E
9 R 50 25 0 25 N
Elev. 9 R 0250
Basin 025



No 37

15 No 8801

The Well Drillers Act
Department of Mines, Province of Ontario

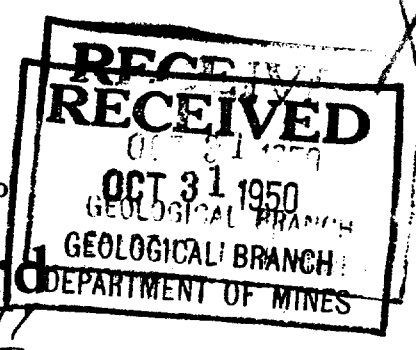

Water Well Record

Ottawa City

Con. Lot. Pt. Lot. Acres.

Cost of well (not including pump)

Pipe and Casing Record

Pumping Test

Casing diameter(s) 4 INCH	Date OCT 7/50
Length(s) of casing(s) 25 FEET	Developed Capacity 650 GPM
Length of screen	Duration of Test 1 HOUR
Type of screen	Pumping Rate 450 GPM
Type of pump	Drawdown 3 FEET
Capacity of pump	Static level of completed well 9 FEET
Depth of pump setting	Is well a gravel-wall type?

Water Record

Kind (fresh or mineral)	Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises
Kind (fresh or mineral) FRESH			
Quality (hard, soft, contains iron, sulphur etc.) HARD	50	Good	30
Appearance (clear, cloudy, coloured) CLEAR	70	"	50
For what purpose(s) is the water to be used? HOUSEHOLD	92	"	83
How far is well from possible source of contamination? 200 FT.			
What is source of contamination? SEPTIC TANK			
Enclose a copy of any mineral analysis that has been made of water			

Well Log


Drift and Bedrock Record

From To
0 ft. 2 ft.

SILT
LOOSE SHALE
LIMESTONE

Location of Well

In diagram below show distances of well from road and lot line

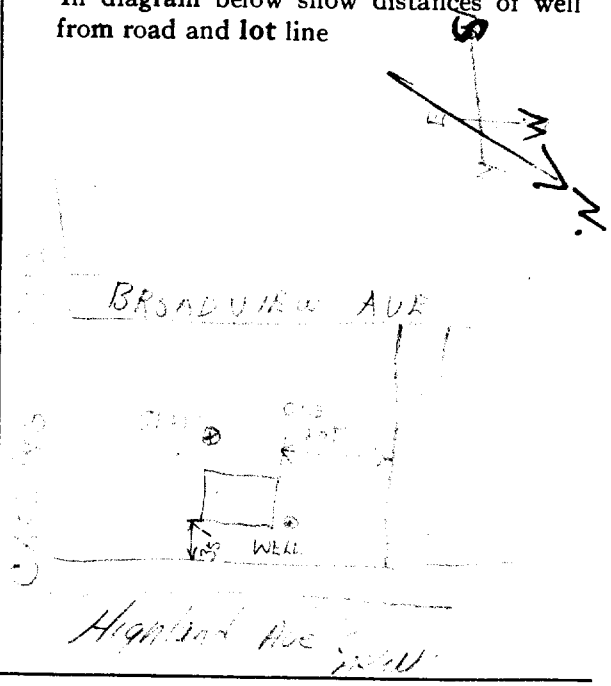

Situation: Is well on upland, in valley, or on hillside? UPLAND
Drilling Firm F.A. McLEAY & SON
Address 185 JAMES ST. OTTAWA. ONT.
Recorded by McLEAY, N. D.
Date Oct 7/50
Licence Number 08038


HIGHLAND AVE

27
UTM 4618 2 4140 1910 0 E
9 R 51025 11610 N
Elev. 918 802510
Basin 215



15 No 8302

The Well Drillers Act
Department of Mines, Province of Ontario

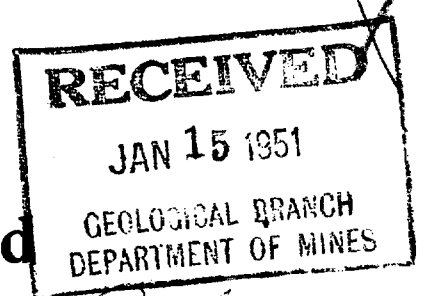

Water Well Record

County or Territorial District Carleton Place Township, Village, Town or City Ottawa
531 Edison Ave
Date Completed Dec 27 (day) 1950 (month) 1950 (year) Cost of Well (excluding pump) 240

Pipe and Casing Record

Pumping Test

Casing diameter(s) <u>5"</u>	Date <u>Dec 27 1950</u>
Length(s) of casing(s) <u>14'</u>	Static level <u>15 Feet</u>
Type of screen	Pumping level <u>25 Feet</u>
Length of screen	Pumping rate <u>300 G.P.M.</u>
Distance from top of screen to ground level	Duration of test <u>30 MIN</u>
Is well a gravel-wall type? <u>No</u>	Distance from cylinder or bowls to ground level

Water Record

Kind (fresh or mineral) <u>Fresh</u>	Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises
Quality (hard, soft, contains iron, sulphur, etc.) <u>Hard</u>	<u>78'</u>	<u>Good</u>	<u>63'</u>
Appearance (clear, cloudy, coloured) <u>Clear</u>			
For what purpose(s) is the water to be used? <u>Household</u>			
How far is well from possible source of contamination? <u>50 Feet</u>			
What is the source of contamination? <u>Septic Tank</u>			
Enclose a copy of any mineral analysis that has been made of water			

Well Log


Overburden and Bedrock Record

From	To
0 ft.	13 ft.
13'	78'

Clay
Limestone

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

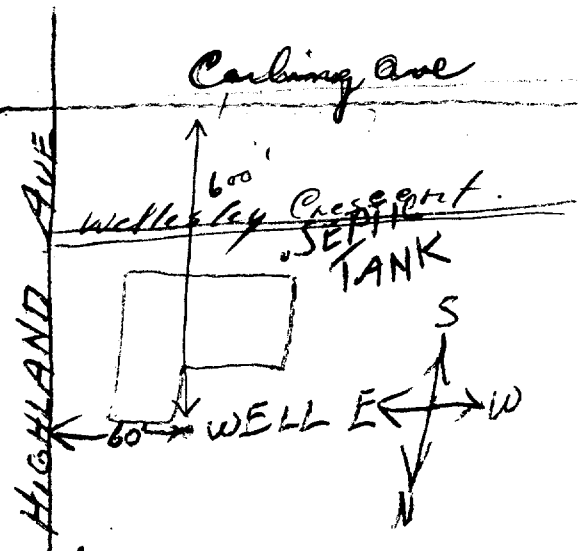

Situation: Is well on upland, in valley, or on hillside? Upland
Drilling Firm J. & Kellman
Address 578 Westminster Ave Ottawa
Name of Driller J. & Kellman Address 578 Westminster
Date Dec 27 1950 Licence Number 243
J. & Kellman
Signature of Licensee

HIGHLAND AVE

37

U.S.M. 1182 441000 E
9 R 5025040 N
Elev. 9 R 0255
Basin 25



No. 8303

The Well Drillers Act
Department of Mines, Province of Ontario

Water Well Record

County or Territorial District... Carleton Township, Village, Town or City... Ottawa
Town or City... Ottawa
Cost of Well (excluding pump)...
(day) (month) (year)

Pipe and Casing Record

Pumping Test

Casing diameter(s)..... <u>3"</u>	Date..... <u>May 30 1951</u>
Length(s) of casing(s)..... <u>12'</u>	Static level..... <u>6'</u>
Type of screen.....	Pumping level..... <u>10'</u>
Length of screen.....	Pumping rate..... <u>4.00 G.P.H.</u>
Distance from top of screen to ground level.....	Duration of test..... <u>30 MIN</u>
Is well a gravel-wall type?..... <u>No</u>	Distance from cylinder or bowls to ground level.....

Water Record

Kind (fresh or mineral)..... <u>Fresh</u>	Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises
Quality (hard, soft, contains iron, sulphur, etc.)... <u>Hard</u>			
Appearance (clear, cloudy, coloured)..... <u>Clear</u>	<u>55'</u>	<u>Good</u>	<u>49'</u>
For what purpose(s) is the water to be used?..... <u>Household</u>			
How far is well from possible source of contamination?..... <u>50 Feet</u>			
What is the source of contamination?..... <u>Septic Tank</u>			
Enclose a copy of any mineral analysis that has been made of water.....			

Well Log


Overburden and Bedrock Record

From To

<u>Gravel</u>	0 ft.	3. ft.
<u>Limestone</u>	3'	55

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

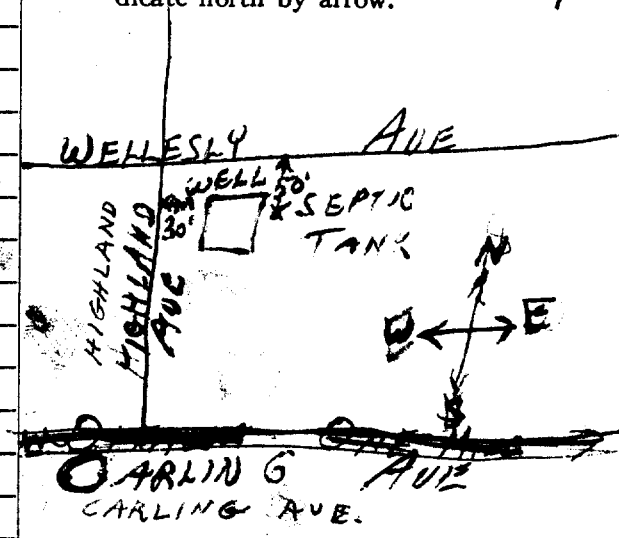


Situation: Is well on upland, in valley, or on hillside?..... Upland
Drilling Firm..... D. R. Wellman
Address..... 578 Westminster
Name of Driller..... D. R. Wellman Address..... 578 Westminster
Date..... May 30 1951 Licence Number..... 242
Signature of Licensee..... D. R. Wellman

HIGHLAND AVE

Basin 25



The Water-well Drillers Act, 1954
Department of Mines

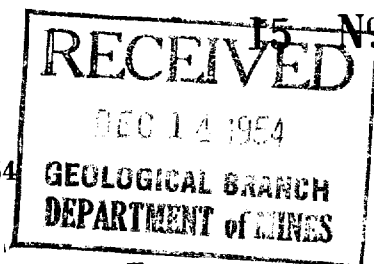

8379

Water-Well Record

County or Territorial District.....*Carleton*.....~~Township, Village, Town or City~~.....*Ottawa*.....

Village, Town or City) Ham Cove.

Address St Clair Gardens

Date completed
(day) (month) (year)

Pipe and Casing Record

Pumping Test

Casing diameter(s) 4"

Length (s) 76

Type of screen

Length of screen

Static level 15.1

Pumping rate 200 g/l/hr

Pumping level 20' 20'

Duration of test 12

Well Log

Water Record

[illegible]

For what purpose(s) is the water to be used?

Residential

Is water clear or cloudy?.....clear.....

Is well on upland, in valley, or on hillside? valley

Drilling firm Mr. McGeagher

Address 1517 Ashua St

Name of Driller *M. M. Leager*

Address

Licence Number. 191.....

I certify that the foregoing
statements of fact are true.


Date Oct 2 M. Meeker

Signature of Licensee

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

M

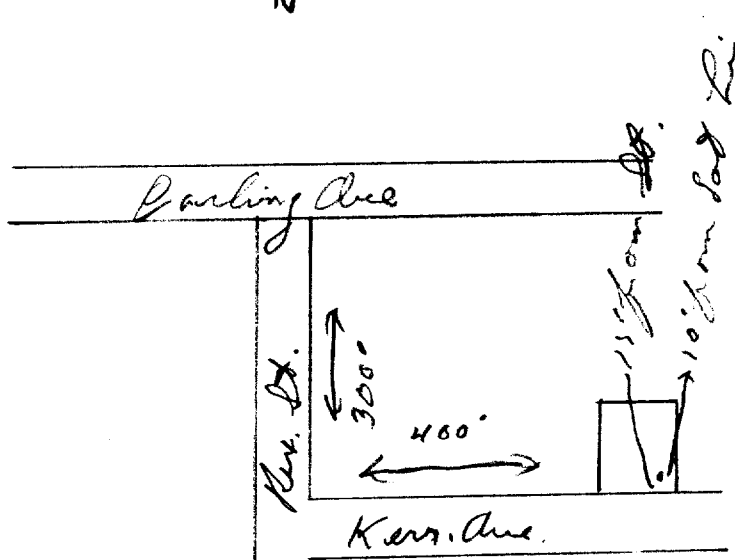



A 053418

11053418

Instructions for Completing Form

- For use in the **Province of Ontario** only. This document is a permanent **legal** document. Please retain for future reference.
- All Sections **must** be completed in full to avoid delays in processing. Further instructions and explanations are available on the back of this form.
- Questions regarding completing this application can be directed to the Water Well Management Coordinator at 416-235-6203.
- All **metre** measurements shall be reported to 1/10th of a metre.
- Please print clearly in blue or black ink only.

Ministry Use Only

Address of Well Location (County/District/Municipality)

1666 Carling Ave

Township

Ottawa

Lot

Concession

RR#/Street Number/Name

City/Town/Village

Site/Compartment/Block/Tract etc.

Canadian Tire Site

GPS Reading

NAD

Zone

Easting

Northing

Unit Make/Model

Mode of Operation:

☐ Undifferentiated

☐ Averaged

813

18T05341806EN49845916

Eagle

Explorer

☐ Differentiated, specify

Log of Overburden and Bedrock Materials (see instructions)

General Colour	Most common material	Other Materials	General Description	Depth		Metres
				From	To	
gray	Gravel		loose	0	2'	
gray	Sand	full	compacted	0	4'	
gray	Sand	silt	loose wet	4	8'	
gray	limestone	clay seams		8	19'	
SMW Set in Cluster						
Well tag on MW4 - 18'						

Hole Diameter			Construction Record				Test of Well Yield									
Depth	Metres	Diameter	Inside diam centimetres	Material	Wall thickness centimetres	Depth		Pumping test method	Draw Down							
From	To	Centimetres				From	To		Time	Water Level						
0	8'	8"							min <th>Metres</th>	Metres						
8	18'	4"							min <th>Metres</th>	Metres						
Water Record			Casing				Test of Well Yield									
Water found at	Metres	Kind of Water	2"	☒ Steel ☐ Fibreglass	.25"	0										
☐ m ☐ Fresh ☐ Sulphur		☐ Gas ☐ Salty ☐ Minerals		☒ Plastic ☐ Concrete												
☐ Other:				☐ Galvanized												
☐ m ☐ Fresh ☐ Sulphur		☐ Gas ☐ Salty ☐ Minerals		☐ Steel ☐ Fibreglass												
☐ Other:				☐ Plastic ☐ Concrete												
☐ m ☐ Fresh ☐ Sulphur		☐ Gas ☐ Salty ☐ Minerals		☐ Galvanized												
☐ Other:				☐ Steel ☐ Fibreglass												
☐ m ☐ Fresh ☐ Sulphur		☐ Gas ☐ Salty ☐ Minerals		☐ Plastic ☐ Concrete												
☐ Other:				☐ Galvanized												
After test of well yield, water was			Screen													
☐ Clear and sediment free			2.25"	☒ Steel ☐ Fibreglass	.10	9'	18'									
☐ Other, specify				☐ Plastic ☐ Concrete												
☐ Chlorinated ☐ Yes ☐ No				☐ Galvanized												
			No Casing or Screen													
			☐ Open hole													

Plugging and Sealing Record			☐ Annular space	☐ Abandonment						
Depth set at - Metres	From	To	Material and type (bentonite slurry, neat cement slurry) etc.		Volume Placed (cubic metres)					
18'	9.5'		Silica Sand							
9.5'	6'		3/8 bentonite chips							
6'	0'		Silica Sand							
Method of Construction										
☐ Cable Tool	☐ Rotary (air)	☐ Diamond	☐ Digging							
☐ Rotary (conventional)	☐ Air percussion	☐ Jetting	☐ Other							
☐ Rotary (reverse)	☒ Boring	☐ Driving								
Water Use										
☐ Domestic	☐ Industrial	☐ Public Supply	☐ Other							
☐ Stock	☐ Commercial	☐ Not used								
☐ Irrigation	☐ Municipal	☐ Cooling & air conditioning								
Final Status of Well										
☐ Water Supply	☐ Recharge well	☐ Unfinished	☒ Abandoned, (Other)							
☐ Observation well	☐ Abandoned, insufficient supply	☐ Dewatering								
☐ Test Hole	☐ Abandoned, poor quality	☐ Replacement well								
Well Contractor/Technician Information										
Name of Well Contractor			Well Contractor's Licence No.							
CAN ENVIR DRILLING-T3315			7323							
Business Address (street name, number, city etc.)										
2778 Round Lake Rd										
Name of Well Technician (last name, first name)			Well Technician's Licence No.							
J. Fillion			7323							
Signature of Technician/Contractor			Date Submitted							
			2007-05-19							

Location of Well	
In diagram below show distances of well from road, lot line, and building. Indicate north by arrow.	
Carling Ave	
Audit No.	Date Well Completed
2 45298	2007-05-19
Was the well owner's information package delivered?	Date Delivered
☐ Yes ☐ No	2007-05-29
Ministry Use Only	
Data Source	Contractor
	7323
Date Received	Date of Inspection
YYYY MM DD	YYYY MM DD
MAY 30 2007	
Remarks	Well Record Number



A053418

Abandoned

Regulation 903 Ontario Water Resources Act

page of

Instructions for Completing Form

- For use in the **Province of Ontario** only. This document is a permanent **legal** document. Please retain for future reference.
 • All Sections **must** be completed in full to avoid delays in processing. Further instructions and explanations are available on the back of this form.
 • Questions regarding completing this application can be directed to the Water Well Management Coordinator at 416-235-6203.
 • **All metre measurements shall be reported to 1/10th of a metre.**
 • Please print clearly in blue or black ink only.
- | | |
|--|--------------------------|
| | Ministry Use Only |
|--|--------------------------|

Ministry Use Only

Address of Well Location (County/District/Municipality)

Township

Lot

Concession

1666 Carling Avenue

Ottawa

Site/Compartment/Block/Tract etc.

RR#/Street Number/Name

City/Town/Village

Site/Compartment/Block/Tract etc
Canadian Fire Site

GPS Reading

NAD

Zone

Easting

Northing

Unit Make/Model

Mode of Operation:

☐ Undifferentiated☐ Averaged

83

10

523 206

A984591

Factor

5/10/00

☐ Differentiated, s

☐ Averaged

Log of Overburden and Bedrock Materials (see instructions)

General Colour	Most common material	Other Materials	General Description	Depth From	Metres To
			Abandoned wells include mw07-1, mw07-2, mw07-3 mw07-4 and mw07-5		

Hole Diameter			Construction Record				Test of Well Yield										
Depth	Metres	Diameter	Inside diam centimetres	Material	Wall thickness centimetres	Depth		Pumping test method	Draw Down		Recovery						
From	To	Centimetres				From	To		Time min	Water Level Metres	Time min	Water Level Metres					
			Casing				Pump intake set at - (metres)	Static Level									
			☐ Steel ☐ Fibreglass ☐ Plastic ☐ Concrete ☐ Galvanized					Pumping rate - (litres/min)	1		1						
								Duration of pumping ____ hrs + ____ min	2		2						
								Final water level end of pumping _____ metres	3		3						
Water Record			☐ Steel ☐ Fibreglass ☐ Plastic ☐ Concrete ☐ Galvanized					Recommended pump type.	4		4						
Water found at ____ Metres	Kind of Water							☐ Shallow ☐ Deep	Recommended pump depth. _____ metres	5		5					
☐ m ☐ Fresh ☐ Sulphur ☐ Gas ☐ Salty ☐ Minerals ☐ Other: _____									Recommended pump rate.	10		10					
☐ m ☐ Fresh ☐ Sulphur ☐ Gas ☐ Salty ☐ Minerals ☐ Other: _____			Screen	Outside diam	☐ Steel ☐ Fibreglass ☐ Plastic ☐ Concrete ☐ Galvanized	Slot No.		(litres/min)	15		15						
After test of well yield, water was								No Casing or Screen	☐ Open hole				If flowing give rate - (litres/min)	20		20	
☐ Clear and sediment free ☐ Other, specify _____													25		25		
Chlorinated ☐ Yes ☐ No							If pumping discontin- ued, give reason.	30		30							
								40		40							
								50		50							
								60		60							

Plugging and Sealing Record		☐ Annular space	☒ Abandonment
Depth set at - Metres		Material and type (bentonite slurry, neat cement slurry) etc.	Volume Placed (cubic metres)
From	To		
0	0.3	Crushed stone	
0.3	0.8	hole plug	
0.8	5.6	Cement bentonite grout	257 litres

Method of Construction			
☐ Cable Tool	☐ Rotary (air)	☐ Diamond	☐ Digging
☐ Rotary (conventional)	☐ Air percussion	☐ Jetting	☐ Other
☐ Rotary (reverse)	☐ Boring	☐ Driving	_____


Water Use			
☐ Domestic	☐ Industrial	☐ Public Supply	☐ Other
☐ Stock	☐ Commercial	☐ Not used	
☐ Irrigation	☐ Municipal	☐ Cooling & air conditioning	

Final Status of Well			
☐ Water Supply	☐ Recharge well	☐ Unfinished	☒ Abandoned, (Other)
☐ Observation well	☐ Abandoned, insufficient supply	☐ Dewatering	
☐ Test Hole	☐ Abandoned, poor quality	☐ Replacement well	

Well Contractor/Technician Information			
Name of Well Contractor OGS Inc.		Well Contractor's Licence No. 6964	
Business Address (street name, number, city etc.) 5518 Appleton Side Road, Almonte Ontario K0A 1A0			
Name of Well Technician (last name, first name) Ohlmann, Paul		Well Technician's Licence No. T2594	
Signature of Technician/Contractor [Signature]		Date Submitted 2007	
		YYYY	MM DD
		2007	1-27

Location of Well			
In diagram below show distances of well from road, lot line, and building. Indicate north by arrow. GPS reading taken on MW07-5 Site plan and area map enclosed			
Audit No.	2	34854	Date Well Completed YYYY 2007 MM 06 DD 16
Was the well owner's information package delivered?	☐ Yes ☐ No	Date Delivered YYYY 2007 MM 06 DD 27	

Ministry Use Only			
Data Source	Contractor		
Date Received	YYYY	MM	DD
Remarks	Well Record Number		

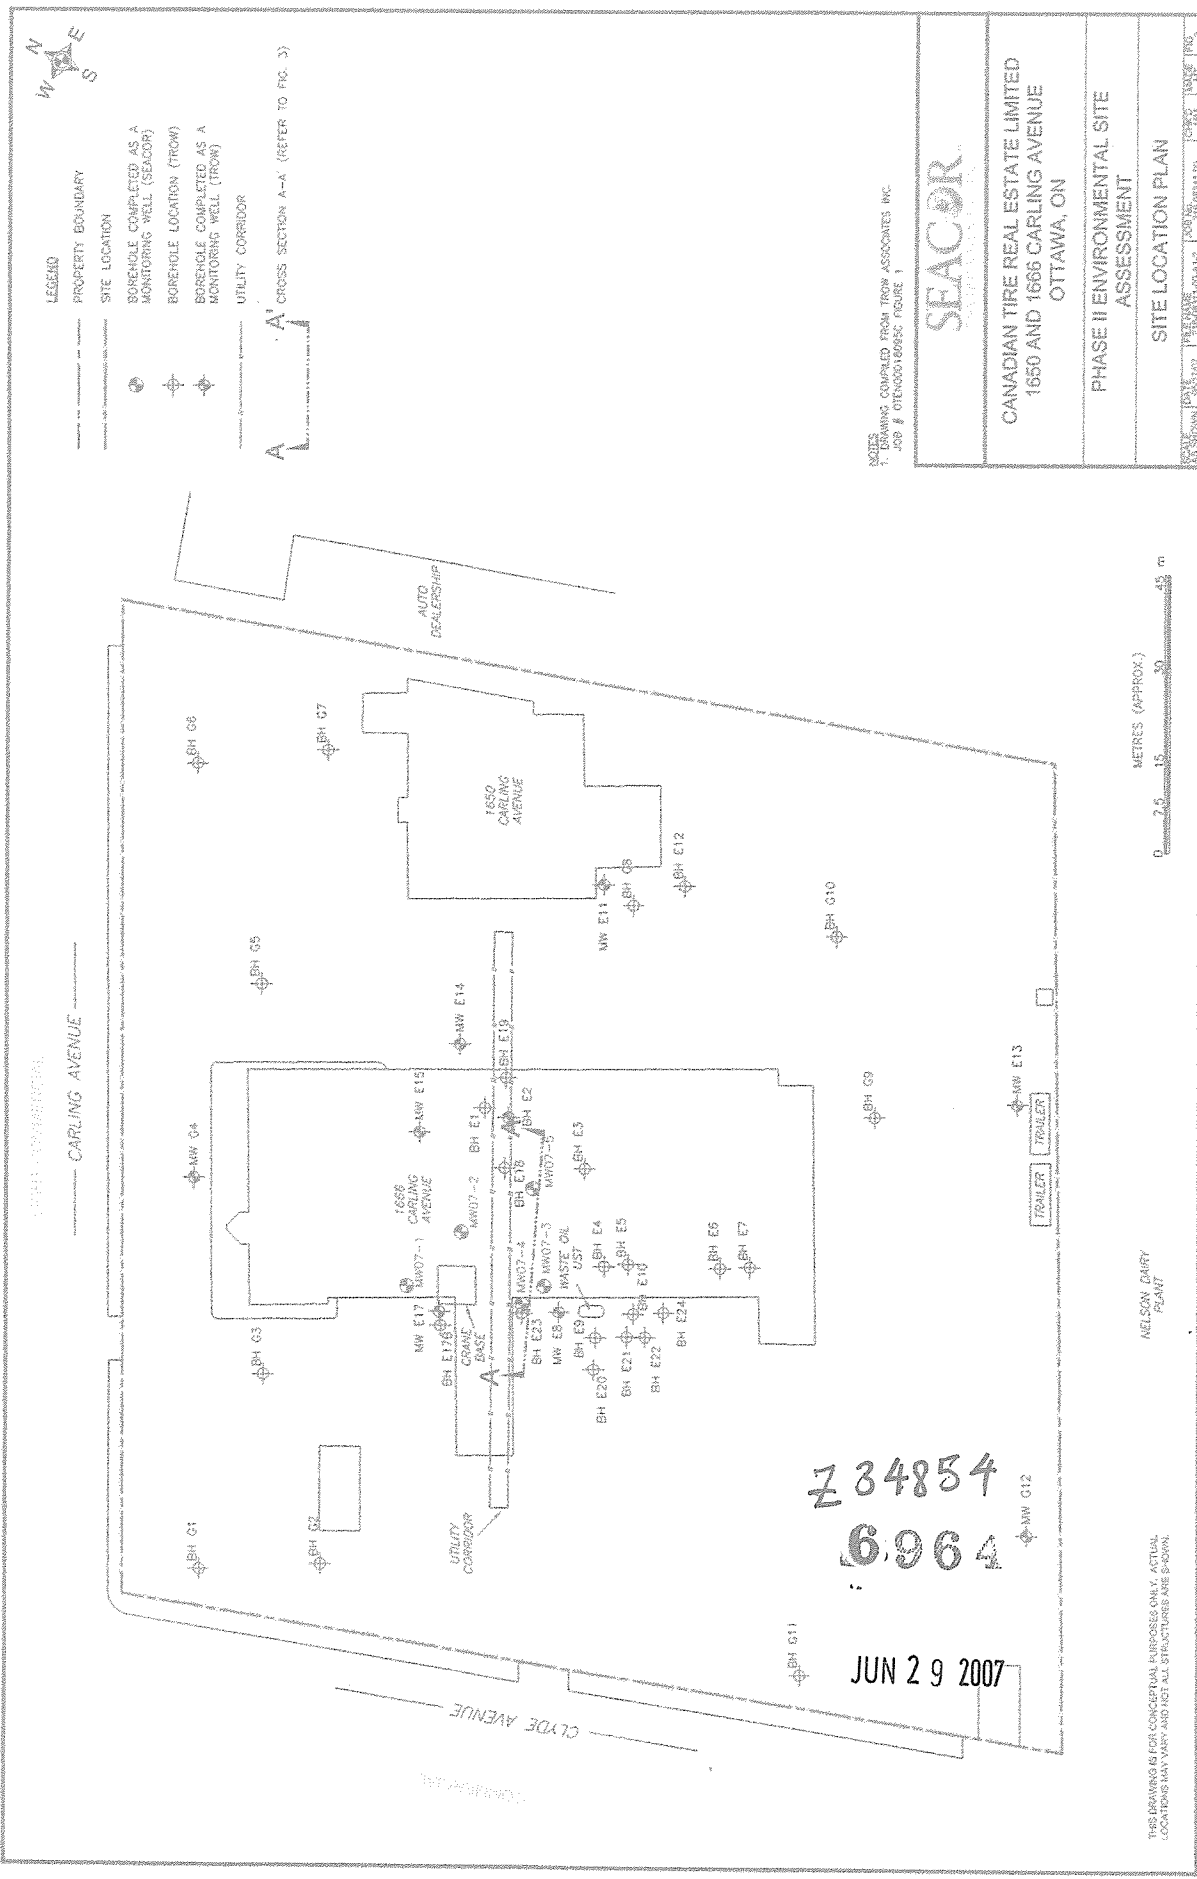

NOTES
1. DRAWING COMPILED FROM TROW ASSOCIATES INC.
JOB # OTEN001609SC FIGURE 1

SEACOR

CANADIAN TIRE REAL ESTATE LIMITED
1650 AND 1666 CARLING AVENUE
OTTAWA, ON

PHASE II ENVIRONMENTAL SITE
ASSESSMENT

SITE LOCATION PLAN

NO.	DATE	BY	CHKD	APPD	REV
1	2007-06-29	SEACOR			1

Z34854
6964

JUN 29 2007

NELSON DARTY
PLANT


THIS DRAWING IS FOR CONCEPTUAL PURPOSES ONLY. ACTUAL
LOCATIONS MAY VARY AND NOT ALL STRUCTURES ARE SHOWN.



200

34854
6.964

JUN 29 2007



Well Tag No. for Master Well (Place Sticker and/or Print Below)

AC79081 A 079081

Regulation 903 Ontario Water Resources Act

Page 1 of 5

Page 1 of 3

Master Well Owner's and Land Owner's Information

First Name Marto Allison Neilson Daity		Last Name		E-mail Address	
Mailing Address (Street Number/Name, RR) 841 Clyde Ave		Municipality Ottawa		Province ON	Postal Code K1Z5A4
				Telephone No. (inc. area code) 764 9304	

Location and Construction of the Master Well in the Cluster

Address of Well Location (Street Number/Name, RR) <i>861 Clyde Ave</i>	Township	Lot	Concession
County/District/Municipality	City/Town/Village <i>Ottawa</i>	Province Ontario	Postal Code

UTM Coordinates	Zone	Easting	Northing	GPS Unit Make	Model	Mode of Operation:	☐ Undifferentiated	☒ Averaged
NAD 83	18	441387	5025174	Garmin	Etrex	☐ Differentiated, specify		

Overburden and Bedrock Materials (see instructions on the back of this form)

[illegible]

Hole Details

Depth (Metres)		Diameter (Centimetres)
From	To	
0'	5.5'	4.0 "
5.5'	18'	3.5 "

Water Use

☐ Public	☐ Industrial	☐ Not used	☐ Other, specify _____
☐ Domestic	☐ Commercial	☐ Dewatering	
☐ Livestock	☐ Municipal	☒ Monitoring	
☐ Irrigation	☐ Test Hole	☐ Cooling & Air Conditioning	

Method of Construction

☐ Cable Tool	☐ Air Percussion	☐ Digging
☐ Rotary (Conventional)	☒ Diamond	☐ Boring
☐ Rotary (Reverse)	☐ Jetting	☐ Other, specify
☐ Rotary (Air)	☐ Driving	

Status of Well

☒ Test Hole	☐ Abandoned, Insufficient Supply
☐ Replacement Well	☐ Abandoned, Poor Water Quality
☐ Dewatering Well	☐ Other, <i>specify</i>
☐ Alteration (Construction)	☐ Abandoned, other, <i>specify</i>

No Casing and Screen Used

☐ Yes	☐ No				Metres

Static Water Level Test

Screen

☐ Galvanized ☐ Steel ☐ Fibreglass ☐ Concrete ☒ Plastic

Outside Diameter (Centimetres)	Slot No.
1.25''	10

Water Details

Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Disinfected ☐ Yes ☐ No If no, provide reason:	Date Master Well Completed (yyyy/mm/dd)

Cluster Information (Please also fill out the additional Cluster Well Information for Well Construction for each parcel of land and cluster.)

Total Wells in Cluster	Please indicate Number of Cluster Well Information Log Sheets Submitted
Total Wells on this Property	

Location of Well Cluster

Detailed Map must be provided as an attachment no larger than legal size (8.5" x 14"). Sketches are not allowed.

☐ Check box to confirm detailed map is provided as per Section 11.1 (3)

Consent to release additional information concerning the cluster to the Director upon request

Well Contractor and Well Technician Information

Business Name of Well Contractor Strata Soil Sampling		Well Contractor's Licence No. 7241	
Business Address (Street No./Name, number, RR) 2-147 West Beaver Creek Dr		Municipality Richmond Hill	
Province ON	Postal Code L4B1C6	Business E-mail Address strata Soil.com	
Bus. Telephone No. (inc. area code) 9057449304		Name of Well Technician (Last Name, First Name) Mair, Mike	
Well Technician's Licence No. 3448	Signature of Technician <i>Mike Mair</i>		Date Submitted (yyyy/mm/dd)

Audit No. M 00443	Well Contractor No.
Date Received (yyyy/mm/dd) NOV 12 2008	Date of Inspection (yyyy/mm/dd)
Remarks C 00448	



Well Tag No. for Master Well (Print Well Tag No.)

A 079081 A079081

Cluster Well Information for Cluster Well Construction

Regulation 903 Ontario Water Resources Act

513 Page 2 of 3

Property Owner's Information

First Name Mario Allison	Last Name Neilson Daity	Mailing Address (Street No./Name, RR) 861 Clyde Ave	Municipality Ottawa
Province ON	Postal Code K1Z5A4	E-mail Address	Telephone No. (inc. area code) 6137281751

Cluster Well Information

Address of Well Location (Street Number/Name, RR) 861 Clyde Ave			Lot	Concession	Township	County/District/Municipality	
City/Town/Village Ottawa	Province Ontario	Postal Code K1Z 5A4	GPS Unit Make Garmin	Model Etrex	Unit Mode of Operation ☐ Differentiated, specify:	☐ Undifferentiated	☒ Averaged

upon request

Signature of Technician/Contractor	Date (yyyy/mm/dd)

[illegible]

Well Contractor and Well Technician Information

Business Name of Well Contractor Strata Soil Sampling		Business Address (Street Number/Name, RR) 2-147 West Beaver Creek Dr		Municipality Richmond Hill	Province ON
Postal Code L4B1C6	Business Telephone No. (inc. area code) 9057449304	Well Contractor's Licence No. 7241	Business E-mail Address strataSoil.com		
Name of Well Technician (First Name, Last Name) Mike Muir		Well Technician's Licence No. 3448	Date Submitted (yyyy/mm/dd)	Signature of Technician 	


Date 1st Well in Cluster Constructed (yyyy/mm/dd) 2008/10/09	Date Last Well in Cluster Constructed (yyyy/mm/dd)

Ministry Use Only

Date Received (yyyy/mm/dd) NOV 12 2008	Date Inspected (yyyy/mm/dd)
Audit No. C 00448	Remarks M 00443




Projet Réf.	Fait par: Vérifié par: Révisé par:	Date: Feuille de

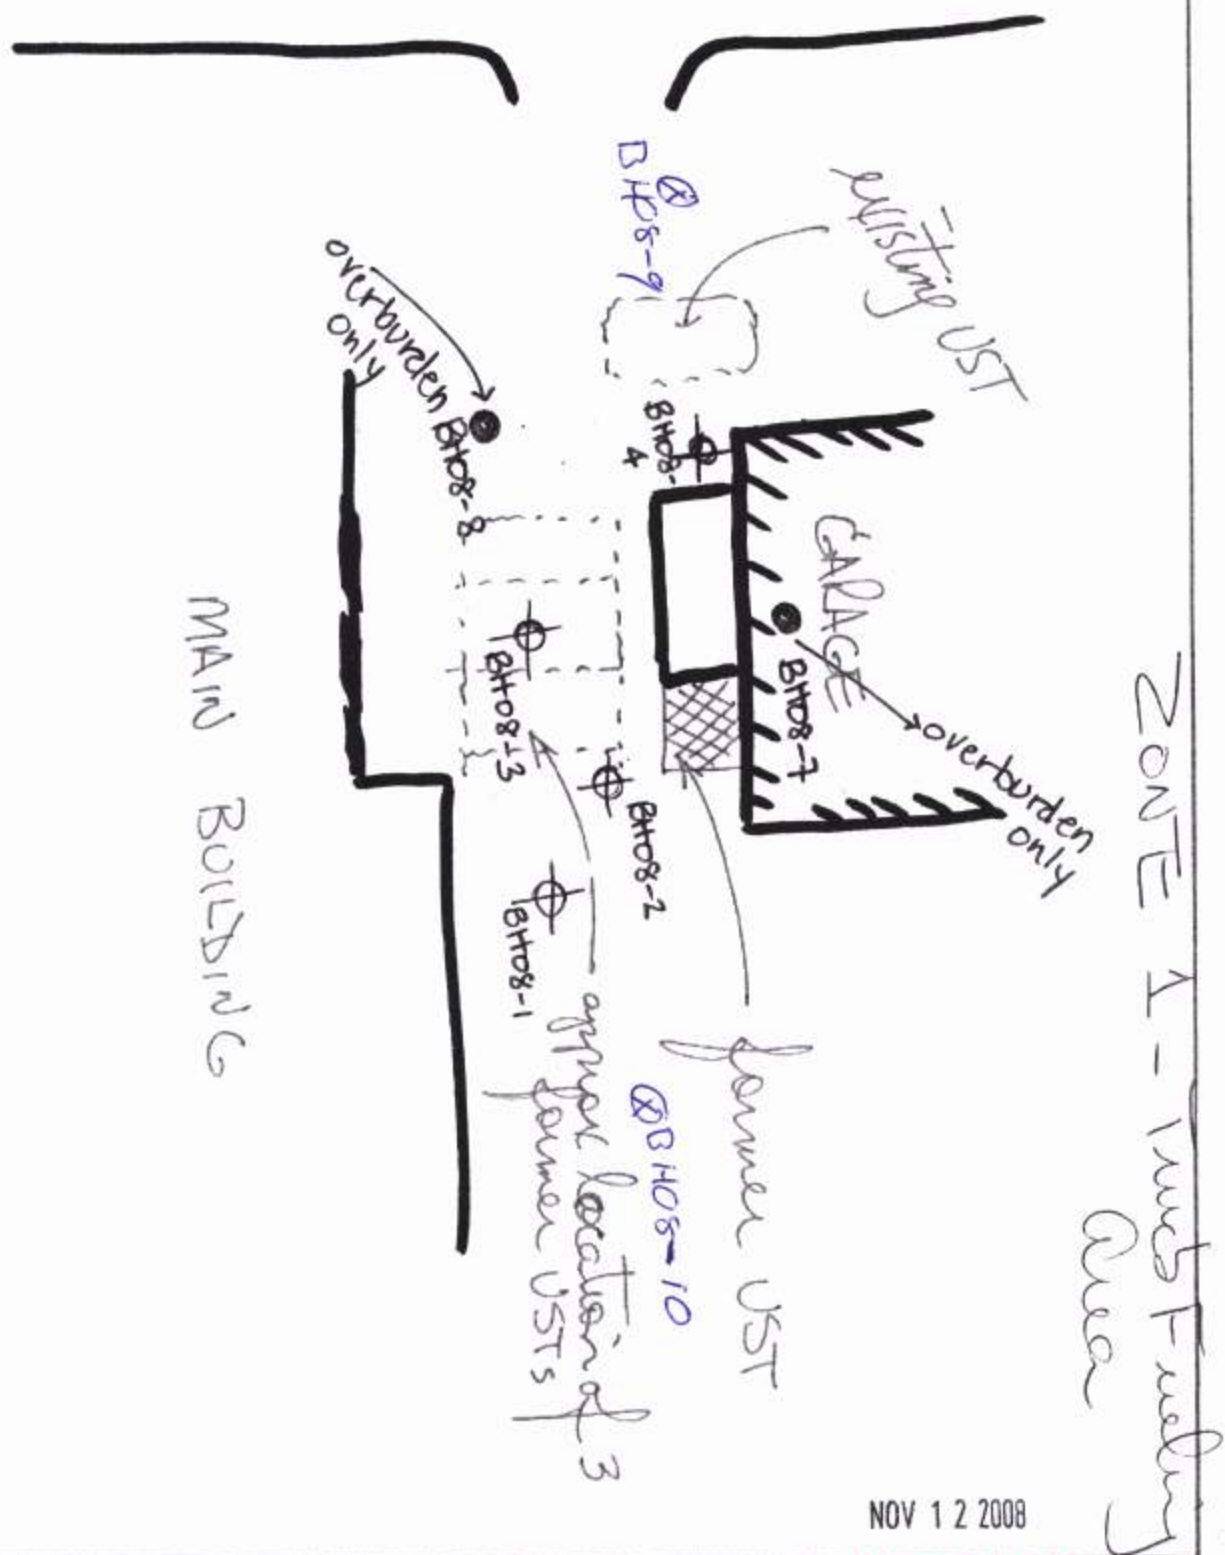

NOV 12 2008

M 00443
C 00448



Well Tag No. for Master Well (Place Sticker and/or Print Below)

AC79081 A 079081

Regulation 903 Ontario Water Resources Act

Page 1 of 5

Page 1 of 5

Master Well Owner's and Land Owner's Information

First Name Marto Allison Neilson Daity		Last Name		E-mail Address	
Mailing Address (Street Number/Name, RR) 841 Clyde Ave		Municipality Ottawa		Province ON	Postal Code K1J2S4
				Telephone No. (inc. area code) 49057649304	

Location and Construction of the Master Well in the Cluster

Address of Well Location (Street Number/Name, RR) <i>861 Clyde Ave</i>	Township	Lot	Concession
County/District/Municipality	City/Town/Village <i>Ottawa</i>	Province Ontario	Postal Code

UTM Coordinates	Zone	Easting	Northing	GPS Unit Make	Model	Mode of Operation:	☐ Undifferentiated	☒ Averaged
NAD 83	18	441387	5025174	Garmin	Etrex	☐ Differentiated, specify		

Overburden and Bedrock Materials (see instructions on the back of this form)

[illegible]

Hole Details

Depth (Metres)		Diameter (Centimetres)
From	To	
0'	5.5'	4.0 "
5.5'	18'	3.5 "

Water Use

☐ Public	☐ Industrial	☐ Not used	☐ Other, specify _____
☐ Domestic	☐ Commercial	☐ Dewatering	
☐ Livestock	☐ Municipal	☒ Monitoring	
☐ Irrigation	☐ Test Hole	☐ Cooling & Air Conditioning	

Method of Construction

☐ Cable Tool	☐ Air Percussion	☐ Digging
☐ Rotary (Conventional)	☒ Diamond	☐ Boring
☐ Rotary (Reverse)	☐ Jetting	☐ Other, specify
☐ Rotary (Air)	☐ Driving	

Status of Well

☒ Test Hole	☐ Abandoned, Insufficient Supply
☐ Replacement Well	☐ Abandoned, Poor Water Quality
☐ Dewatering Well	☐ Other, <i>specify</i>
☐ Alteration (Construction)	☐ Abandoned, other, <i>specify</i>

No Casing and Screen Used

Open Hole					Metres
☐ Yes ☐ No					

Static Water Level Test

Screen

☐ Galvanized ☐ Steel ☐ Fibreglass ☐ Concrete ☒ Plastic

Outside Diameter (Centimetres)	Slot No.
1.25"	10

Water Details

Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth Metres ☐ Gas	Kind of Water ☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Disinfected ☐ Yes ☐ No If no, provide reason:	Date Master Well Completed (yyyy/mm/dd)

Cluster Information (Please also fill out the additional Cluster Well Information for Well Construction for each parcel of land and cluster.)

Total Wells in Cluster	Please indicate Number of Cluster Well Information Log Sheets Submitted
Total Wells on this Property	

Location of Well Cluster

Detailed Map must be provided as an attachment no larger than legal size (8.5" x 14"). Sketches are not allowed.

☐ Check box to confirm detailed map is provided as per Section 11.1 (3)

Consent to release additional information concerning the cluster to the Director upon request

Well Contractor and Well Technician Information

Business Name of Well Contractor Stata Soil Sampling		Well Contractor's Licence No. 7241	
Business Address (Street No./Name, number, RR) 2-147 West Beaver Creek Dr		Municipality Richmond Hill	
Province ON	Postal Code L4B1 4G	Business E-mail Address statasoil.com	
Bus. Telephone No. (inc. area code) 9057649304		Name of Well Technician (Last Name, First Name) Muir, Mike	
Well Technician's Licence No. 3448	Signature of Technician <i>Mike Muir</i>		Date Submitted (yyyy/mm/dd)

Audit No. M 00443	Well Contractor No.
Date Received (yyyy/mm/dd) NOV 12 2008	Date of Inspection (yyyy/mm/dd)
Remarks C 00448	



Well Tag No. for Master Well (Print Well Tag No.)

A 079081 A079081

Cluster Well Information for Cluster Well Construction

Regulation 903 Ontario Water Resources Act

513 Page 2 of 3

Property Owner's Information

First Name Mario Allison		Last Name Neilson Daity		Mailing Address (Street No./Name, RR) 861 Clyde Ave		Municipality Ottawa	
Province ON		Postal Code K1Z5A4		E-mail Address		Telephone No. (inc. area code) 6137281751	

Cluster Well Information

Address of Well Location (Street Number/Name, RR) 861 Clyde Ave			Lot	Concession	Township	County/District/Municipality	
City/Town/Village Ottawa	Province Ontario	Postal Code K1Z 5A4	GPS Unit Make Garmin	Model Etrex	Unit Mode of Operation ☐ Differentiated, specify:	☐ Undifferentiated	☒ Averaged

upon request

Signature of Technician/Contractor	Date (yyyy/mm/dd)

[illegible]

Well Contractor and Well Technician Information

Business Name of Well Contractor Strata Soil Sampling				Business Address (Street Number/Name, RR) 2-147 West Beaver Creek Dr				Municipality Richmond Hill		Province ON	
Postal Code L4B1C6		Business Telephone No. (inc. area code) 9057449304		Well Contractor's Licence No. 7241		Business E-mail Address stratasoil.com					
Name of Well Technician (First Name, Last Name) Mike Muir				Well Technician's Licence No. 3448		Date Submitted (yyyy/mm/dd)		Signature of Technician 			


Date 1st Well in Cluster Constructed (yyyy/mm/dd) 2008/10/09	Date Last Well in Cluster Constructed (yyyy/mm/dd)

Ministry Use Only

Date Received (yy/mm/dd) NOV 12 2008	Date Inspected (yyyy/mm/dd)
Audit No. C 00448	Remarks M 00443



Projet Réf.	Fait par: Vérifié par: Révisé par:	Date: Feuille de

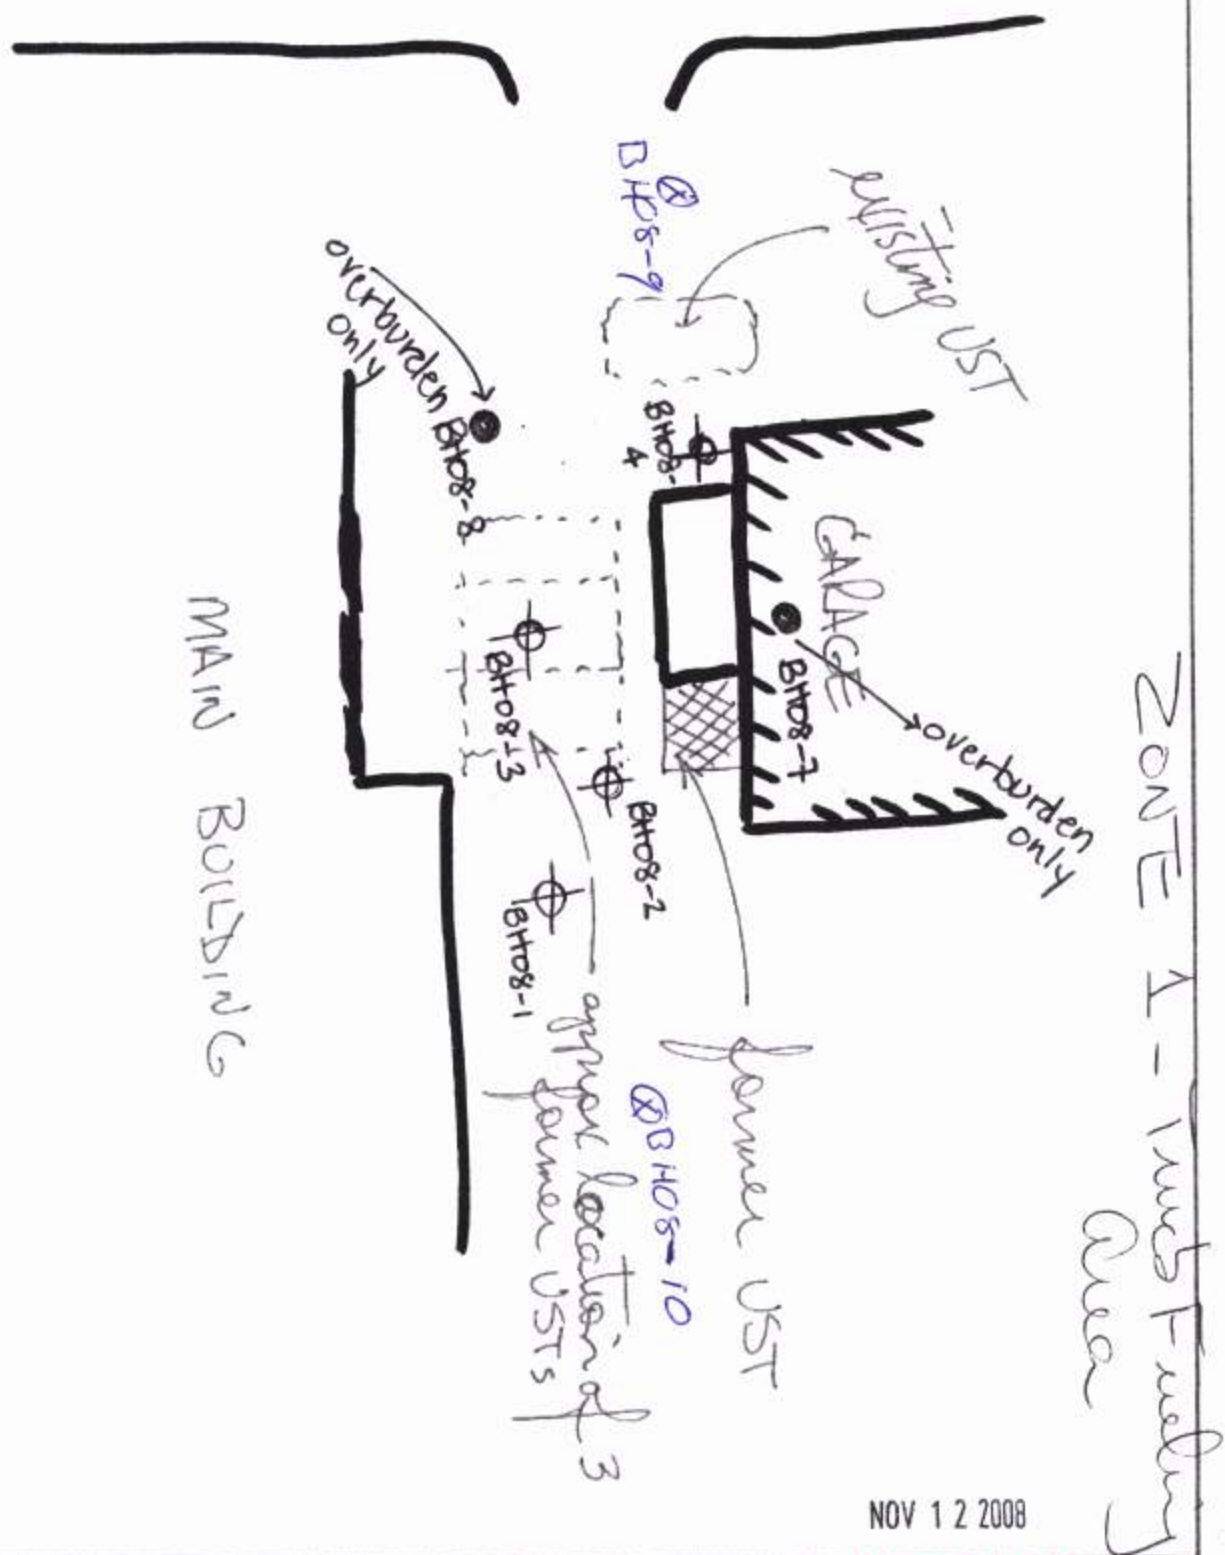

NOV 12 2008

M 00443
C 00448

UTM 1182 440820E

9R 5025 1110N


Elev. 9R 0250

Basin 25



ONTARIO

The Well Drillers Act
Department of Mines, Province of Ontario

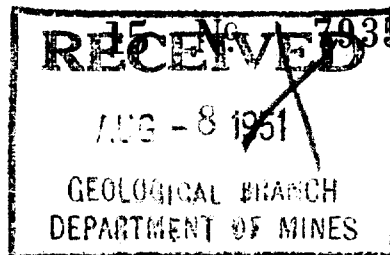

Water Well Record

County or Territorial District Cataraugus Township, Village, Town or City O.T. Town City
Town or City)
Date Completed Aug 1 1951 Cost of Well (excluding pump) 200.00
(day) (month) (year)

Pipe and Casing Record

Pumping Test

Casing diameter(s) <u>6</u>	Date <u>Aug 1 1951</u>
Length(s) of casing(s) <u>33</u>	Static level <u>7</u>
Type of screen <u>1/2"</u>	Pumping level <u>11</u>
Length of screen <u>11</u>	Pumping rate <u>10 gpm</u>
Distance from top of screen to ground level <u>11</u>	Duration of test <u>1 hr</u>
Is well a gravel-wall type? <u>No</u>	Distance from cylinder or bowls to ground level <u>11</u>

Water Record

Kind (fresh or mineral)	Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises
<u>fresh</u>			
Quality (hard, soft, contains iron, sulphur, etc.) <u>hard</u>			
Appearance (clear, cloudy, coloured) <u>clear</u>			
For what purpose(s) is the water to be used? <u>drinking</u>	<u>60</u>	<u>drinking</u>	<u>53</u>
How far is well from possible source of contamination? <u>1/2 mi</u>			
What is the source of contamination? <u>road</u>			
Enclose a copy of any mineral analysis that has been made of water			

Well Log

Overburden and Bedrock Record

From To
0 ft. ft.

Clay

1 18

Gravel


10 19

limestone

19 80

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

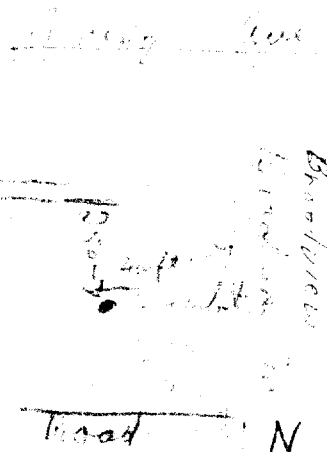

Situation: Is well on upland, in valley, or on hillside? in valley
Drilling Firm Gordon Mulligan
Address 1000 Main St. Buffalo, N.Y.
Name of Driller John J. Mulligan Address 1000 Main St. Buffalo, N.Y.
Date Aug 1 1951 Licence Number 12345



Ministry of
the Environment

Well Tag No. for Master Well (Print Well Tag No.)

A 075469 *A075469*

Cluster Well Information for Cluster Well Construction

Regulation 903 Ontario Water Resources Act

6010 Page _____ of _____

Property Owner's Information

First Name <i>Western Foods (Canada) Inc.</i>	Last Name	Mailing Address (Street No./Name, RR) <i>Suit 800</i>	Municipality <i>Toronto</i>
Province <i>ON</i>	Postal Code <i>M7T2S5</i>	E-mail Address	Telephone No. (inc. area code) <i>416 922 1383</i>

Cluster Well Information

Address of Well Location (Street Number/Name, RR) <i>861 Clyde Ave</i>	Lot	Concession	Township	County/District/Municipality
City/Town/Village <i>Ottawa</i>	Province <i>Ontario</i>	Postal Code	GPS Unit Make <i>Garmin</i>	Model <i>Etrex</i>
Unit Mode of Operation		☐ Undifferentiated ☒ Averaged		
☐ Differentiated, specify:				

Consent

Property Owner's Consent to use cluster form

Signature	Date (yyyy/mm/dd)

Consent to release additional information to the Director upon request

Signature of Technician/Contractor	Date (yyyy/mm/dd)

Well # on Sketch	UTM Coordinates		Full Depth of Hole (metres)	Hole Diameter (cm)	Method of Construction	Casing Material	Casing Length (metres)	Screen Interval (metres)		Annular Space Sealant Used	Static Water Level (metres)	Abandonment Sealant Used	Comments	Date of Completion (yyyy/mm/dd)
	Zone	Easting						From	To					
#1	1844	14395025211	12'	3.5"	coring	PVC	2.5'	2.5'	12'	Bentonite				2008/12/03
#2	1844	14585025196	10'	3.5"	coring	PVC	2.5'	2.5'	10'	Bentonite				2008/12/03
#22	1844	13945025151	13.5'	3.5"	coring	PVC	2.5'	2.5'	13.5'	Bentonite				2008/12/03
#23	1844	14075025159	9'	3.5"	coring	PVC	2.5'	2.5'	9'	Bentonite				2008/12/04
#24	1844	14065025165	10'	3.5"	coring	PVC	2.5'	2.5'	10'	Bentonite				2008/12/04
#25	1844	13715025146	14'	3.5"	coring	PVC	2.5'	2.5'	14'	Bentonite				2008/12/04
#26	1844	13925025131	13'	3.5"	coring	PVC	2.5'	2.5'	13'	Bentonite				2008/12/05
#27	1844	14045025138	13'	3.5"	coring	PVC	3.0'	3.0'	13'	Bentonite				2008/12/05
#21	1844	14265025102	15'	3.5"	coring	PVC	2.5'	2.5'	15'	Bentonite				2008/12/05

Well Contractor and Well Technician Information

Business Name of Well Contractor <i>Strata Soil Sampling</i>	Business Address (Street Number/Name, RR) <i>2-147 West Beaver Creek Dr</i>	Municipality <i>Richmond Hill</i>	Province <i>ONT</i>
Postal Code <i>L4B 1C6</i>	Business Telephone No. (inc. area code) <i>905 764 9304</i>	Well Contractor's Licence No. <i>7241</i>	Business E-mail Address <i>stratasoil.com</i>
Name of Well Technician (First Name, Last Name) <i>Muir, Mike</i>		Well Technician's Licence No. <i>3448</i>	Date Submitted (yyyy/mm/dd) <i>2008/12/08</i>
		Signature of Technician <i>[Signature]</i>	

Date 1st Well in Cluster Constructed (yyyy/mm/dd)	Date Last Well in Cluster Constructed (yyyy/mm/dd)

Ministry Use Only

Date Received (yyyy/mm/dd) <i>JAN 9 2009</i>	Date Inspected (yyyy/mm/dd)
Audit No. C 01669	Remarks

A 075469

A075469

Imperial

6010 Page _____ of _____

Property Owner's Information

First Name Weston Foods (Canada) Inc.	Last Name	Mailing Address (Street No./Name, RR) 22 St. Clair Ave E - Suite 200	Municipality Toronto
Province ON	Postal Code M7T 2S5	E-mail Address	Telephone No. (inc. area code) ~~416-221-2027~~ 416-221-2073

Cluster Well Information

Address of Well Location (Street Number/Name, RR) 861 Clyde Ave., Ottawa		Lot	Concession	Township	County/District/Municipality
City/Town/Village Ottawa	Province Ontario	Postal Code	GPS Unit Make Garmin	Model Etrex	Unit Mode of Operation ☐ Undifferentiated ☒ Averaged ☐ Differentiated, specify: _____

Consent

Property Owner's Consent to use cluster form

Signature	Date (yyyy/mm/dd)

Consent to release additional information to the Director upon request

Signature of Technician/Contractor	Date (yyyy/mm/dd)

Well # on Sketch	Zone	Easting	UTM Coordinates Northing	Full Depth of Hole (metres)	Hole Diameter (cm)	Method of Construction	Casing Material	Casing Length (metres)	Screen Interval (metres) From To	Annular Space Sealant Used	Static Water Level (metres)	Abandonment Sealant Used	Comments	Date of Completion (yyyy/mm/dd)
11		18441377	5025131	11.5'	3.5"	Coring	PVC	9.5'	9.5' 11.5'	Bentonite				2008/12/01
5		18441401	5025176	10'	3.5"	Diamond coring	PVC	2.5'	2.5' 10'	Bentonite				2008/12/02
6		18441395	5025163	10.5'	3.5"	Coring	PVC	2.5'	2.5' 10.5'	Bentonite				" " "
8		18441373	5025124	13'	3.5"	Coring	PVC	2.5'	2.5' 13'	Bentonite				" " "
9		18441367	5025147	14'	3.5"	Coring	PVC	2.5'	2.5' 14'	Bentonite				" " "
10		18441361	5025154	14'	3.5"	Coring	PVC	2.5'	2.5' 14'	Bentonite				" " "
12		18441428	5025185	7'	3.5"	Direct Push	PVC	2.0'	2.0' 7'	Bentonite				" " "
7		18441392	5025149	7'	3.5"	Push	PVC	2.0'	2.0' 7'	Bentonite				" " "
4		18441404	5025189	9'	3.5"	Coring	PVC	2.5'	2.5' 9'	Bentonite				2008/12/03
General contractor: Worley Parsons Komex														

Well Contractor and Well Technician Information

Business Name of Well Contractor Strata Soil Sampling Inc.		Business Address (Street Number/Name, RR) 147-2 West Beaver Creek Road		Municipality Richmond Hill	Province Ontario
Postal Code L4B 1C6	Business Telephone No. (inc. area code) 905-764-9304	Well Contractor's Licence No. 7 2 4 1	Business E-mail Address wrecords@stratasoil.com		
Name of Well Technician (First Name, Last Name) Mike Muir		Well Technician's Licence No. 3 4 4 8	Date Submitted (yyyy/mm/dd) Dec 2008/12/05	Signature of Technician <i>[Signature]</i>	

Date 1st Well in Cluster Constructed (yyyy/mm/dd)	Date Last Well in Cluster Constructed (yyyy/mm/dd)

Ministry Use Only

Date Received (yyyy/mm/dd) JAN 9 2009	Date Inspected (yyyy/mm/dd)
Audit No. C 03807	Remarks

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .

[Go Back to Map](#)

Well ID

Well ID Number: 7119477

Well Audit Number: M03311

Well Tag Number: A080404

This table contains information from the original well record and any subsequent updates.

This well is part of a well cluster.

The information below is extracted from the cluster well record.

More information on the cluster well record (related to other wells in the cluster) is also available.

Well Location

Address of Well Location	861 CLYDE AVE	
Township	OTTAWA CITY	
Lot		
Concession		
County/District/Municipality	OTTAWA-CARLETON	
City/Town/Village	Ottawa	
Province	ON	
Postal Code	n/a	
UTM Coordinates	NAD83 — Zone 18 Easting: 441346.00 Northing: 5025189.00	
Municipal Plan and Sublot Number		
Other		

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
		BENTONITE		

Method of Construction & Well Use

Method of Construction	Well Use	
DIAMOND	Monitoring	

Status of Well

Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
	PLASTIC		3 m	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	
		3 m	13 m	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		

Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	

5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter
	13 m	3.5 cm


Audit Number: M03311**Date Well Completed:** January 12, 2009**Date Well Record Received by MOE:** February 23, 2009**Related**

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014



Ministry of
the Environment

Well Tag No. (Place Sticker and/or Print Below)

Well Record

Measurements recorded in: ☒ Metric ☐ Imperial

A097278

A 097278

Regulation 903 Ontario Water Resources Act

7962 Page 3 of 4

Well Owner's Information

First Name	Last Name / Organization	E-mail Address	☐ Well Constructed by Well Owner
Saputo Dairy Products			
Mailing Address (Street Number/Name)	Municipality	Province	Postal Code
861 Clyde St	Ottawa	ON	
Telephone No. (inc. area code)			

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession
861 Clyde			
County/District/Municipality	City/Town/Village	Province	Postal Code
	Ottawa	Ontario	
UTM Coordinates	Zone	Easting	Northing
NAD 83	18	441376	5025142
Municipal Plan and Sublot Number			
Other			

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)
BRN				From To
BRN	clay		soft	0 .91
GRY	limestone		hard	.91 1.83
				1.83 3.96

Annular Space		
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From To		
0 .91	Benseal/concrete	
.91 3.96	filter sand	

Method of Construction	Well Use
☐ Cable Tool	☐ Public
☐ Rotary (Conventional)	☐ Domestic
☐ Rotary (Reverse)	☐ Livestock
☐ Boring	☐ Irrigation
☒ Air percussion	☐ Industrial
☐ Other, specify	☐ Other, specify
☐ Diamond	☐ Commercial
☐ Jetting	☐ Not used
☐ Driving	☐ Dewatering
☐ Digging	☒ Test Hole
	☒ Monitoring
	☐ Cooling & Air Conditioning

Construction Record - Casing			Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)	
			From To	
3.45	PVC	.356	0 1.22	☐ Water Supply
				☐ Replacement Well
				☒ Test Hole
				☐ Recharge Well
				☐ Dewatering Well
				☒ Observation and/or Monitoring Hole
				☐ Alteration (Construction)
				☐ Abandoned, Insufficient Supply
				☐ Abandoned, Poor Water Quality
				☐ Abandoned, other, specify
				☐ Other, specify

Construction Record - Screen			Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From To	
4.21	open hole PVC	10	1.22 3.96	☐ Water Supply
				☐ Replacement Well
				☒ Test Hole
				☐ Recharge Well
				☐ Dewatering Well
				☒ Observation and/or Monitoring Hole
				☐ Alteration (Construction)
				☐ Abandoned, Insufficient Supply
				☐ Abandoned, Poor Water Quality
				☐ Abandoned, other, specify
				☐ Other, specify

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft)	Diameter (cm/in)
		From To	
		0 1.83	8.25
		1.82 3.96	5.71

Business Name of Well Contractor		Well Contractor's Licence No.
Strata Soil Sampling Inc		72411
Business Address (Street Number/Name)		Municipality
147-2 West Beaver Creek Rd		Richmond Hill
Province	Postal Code	Business E-mail Address
Ontario	L4B1C6	wrecords@stratasoil.com
Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)	
905-764-9304	Mike Brown	
Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted
72977		2006/11/04

Results of Well Yield Testing			
After test of well yield, water was:		Draw Down	
☐ Clear and sand free		Time (min)	Water Level (m/ft)
☐ Other, specify			
If pumping discontinued, give reason:		Static Level	
Pump intake set at (m/ft)		1	1
Pumping rate (l/min / GPM)		2	2
Duration of pumping hrs + min		3	3
Final water level end of pumping (m/ft)		4	4
If flowing give rate (l/min / GPM)		5	5
Recommended pump depth (m/ft)		10	10
Recommended pump rate (l/min / GPM)		15	15
Well production (l/min / GPM)		20	20
Disinfected? ☐ Yes ☐ No		25	25
		30	30
		40	40
		50	50
		60	60

Map of Well Location	
Please provide a map below following instructions on the back.	
Comments:	
Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered Y Y Y Y M M D D
Date Work Completed	20101028
Ministry Use Only	
Audit No. z116189	
Received	

Address of Well Location (Street Number/Name, RR) 877 Boyd Ave.				Township				Lot		Concession	
County/District/Municipality				City/Town/Village Oshawa				Province Ontario		Postal Code	
UTM Coordinates NAD 83		Zone 18	Easting 441251	Northings 5024956	GPS Unit Make Garmin	Model Gtrex	Mode of Operation: ☐ Undifferentiated ☒ Averaged ☐ Differentiated, specify				

Overburden and Bedrock Materials (see instructions on the back of this form)					Hole Details		
General Colour	Most Common Material	Other Materials	General Description	Depth (Metres) From To	Depth (Metres) From To	Diameter (Centimetres)	
BLK	Asphalt	gravel		0 .31	0 1.83	8.25	
BRN	sand	gravel	soft, wet	.31 1.83	1.83 7.62	5.71	
GRY	limestone		hard, dry	1.83 5.18			
GRY	limestone		hard, wet	5.18 7.62			

Water Use			
☐ Public	☐ Industrial	☐ Not used	☐ Other, specify
☐ Domestic	☐ Commercial	☐ Dewatering	
☐ Livestock	☐ Municipal	☒ Monitoring	
☐ Irrigation	☒ Test Hole	☐ Cooling & Air Conditioning	

Method of Construction			
☐ Cable Tool	☒ Air Percussion	☐ Digging	
☐ Rotary (Conventional)	☐ Diamond	☐ Boring	
☐ Rotary (Reverse)	☐ Jetting	☐ Other, specify	
☐ Rotary (Air)	☐ Driving		

Status of Well			
☒ Test Hole	☐ Abandoned, Insufficient Supply		
☐ Replacement Well	☐ Abandoned, Poor Water Quality		
☐ Dewatering Well	☐ Other, specify		
☐ Alteration (Construction)	☐ Abandoned, other, specify		

Construction Details				
Inside Diameter (Centimetres) 4.21	Material (steel, plastic, fibreglass, concrete, galvanized) PVC	Wall Thickness .356	Depth (Metres) From To 0 3.05	
	PVC Screen		3.05 7.62	

No Casing and Screen Used		Static Water Level Test	
Open Hole	☐ Yes ☒ No		Metres

Screen	
☐ Galvanized ☐ Steel ☐ Fibreglass ☐ Concrete ☒ Plastic	
Outside Diameter (Centimetres) 4.21	Slot No. 10

Annular Space/Abandonment Sealing Record			
Depth Set at (Metres) From To	Type of Sealant Used (Material and Type)	Volume Used (Cubic Metres)	
0 .31	concrete flushmount		
.31 2.74	ben seal		
2.74 7.62	filter sand		

Water found at Depth		Kind of Water
Metres	☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth		Kind of Water
Metres	☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth		Kind of Water
Metres	☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Disinfected ☐ Yes ☐ No	If no, provide reason:	Date Master Well Completed (yyyy/mm/dd) 2010/12/22

Cluster Information (Please also fill out the additional Cluster Well Information for Well Construction for each parcel of land and cluster.)	
Total Wells in Cluster 3	Please indicate Number of Cluster Well Information Log Sheets Submitted 1
Total Wells on this Property 3	

Well Contractor and Well Technician Information			
Business Name of Well Contractor Strata Soil Sampling Inc		Well Contractor's Licence No. 7121411	
Business Address (Street No./Name, number, RR) 147-2 West Beaver Creek Rd Richmond Hill		Municipality	
Province Ontario	Postal Code L4B1C6	Business E-mail Address wrecords@stratasoil.com	
Bus. Telephone No. (inc. area code) 905-1764-9301		Name of Well Technician (Last Name, First Name) Beatty Brian	
Well Technician's Licence No. 316116	Signature of Technician	Date Submitted (yyyy/mm/dd)	

Ministry Use Only	
Audit No. 03224	Well Contractor No.
Date Received (yyyy/mm/dd) JAN 24 2011	Date of Inspection (yyyy/mm/dd)
Remarks	

Address of Well Location (Street Number/Name, RR) 877 Boyd Ave.										Lot		Concession		Township		County/District/Municipality	
City/Town/Village Oshawa				Province Ontario		Postal Code		GPS Unit Make Garmin		Model Etrex		Unit Mode of Operation ☐ Undifferentiated ☒ Averaged ☐ Differentiated, specify:		Signature of Technician/Contractor		Date (yyyy/mm/dd)	

Well # on Sketch	UTM Coordinates		Full Depth of Hole (metres)	Hole Diameter (cm)	Method of Construction	Casing Material	Casing Length (metres)	Screen Interval (metres)		Annular Space Sealant Used	Static Water Level (metres)	Abandonment Sealant Used	Comments	Date of Completion (yyyy/mm/dd)
	Zone	Easting						North	East					
2	18	441125	95024978	7.62	5.71	Air Percussion	PVC	3.05	3.05	7.62	Bensea			2010/12/22
3	18	441127	65024976	7.62	5.71	"	PVC	3.05	3.05	7.62	Bensea			2010/12/22

Well Contractor and Well Technician Information											
Business Name of Well Contractor Strata Soil Sampling Inc.				Business Address (Street Number/Name, RR) 147-2 West Beaver Creek Road				Municipality Richmond Hill		Province Ontario	
Postal Code L4B 1C6		Business Telephone No. (inc. area code) 905-764-9304		Well Contractor's Licence No. 7 2 4 1		Business E-mail Address wrecords@stratasoil.com					
Name of Well Technician (First Name, Last Name) Brian Beatty				Well Technician's Licence No. 3 6 1 6		Date Submitted (yyyy/mm/dd)		Signature of Technician			

Date 1st Well in Cluster Constructed (yyyy/mm/dd) 2010/12/22		Date Last Well in Cluster Constructed (yyyy/mm/dd) 2010/12/22	
Ministry Use Only			
Date Received (yyyy/mm/dd) JAN 24 2011		Date Inspected (yyyy/mm/dd)	
Audit No. C 02489		Remarks m03224	



Measurements recorded in: ☒ Metric ☐ Imperial

Address of Well Location (Street Number/Name) 877 Boyd Avenue		Township	Lot	Concession
County/District/Municipality		City/Town/Village Ottawa	Province Ontario	Postal Code
UTM Coordinates	Zone Easting	North	Municipal Plan and Sublot Number	
NAD 83	18	441275	5	024968
Other			WKQ-003456 A 0 - A 01	

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From To
BAN	sand	silt, stones	soft	0 1.52
GRY	limestone		hard, dry	1.52 7.62

Depth Set at (m/ft) From To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0 2.74	Benseal	
2.74 7.62	Filter sand	

Method of Construction	Well Use
☐ Cable Tool	☐ Public
☐ Rotary (Conventional)	☐ Commercial
☐ Rotary (Reverse)	☐ Domestic
☐ Boring	☐ Municipal
☐ Air percussion	☒ Test Hole
☒ Other, specify Direct Push	☐ Cooling & Air Conditioning
	☐ Not used
	☐ Dewatering
	☐ Monitoring
	☐ Industrial
	☐ Other, specify

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From To	Status of Well
3.45	PVC	.356	0 3.05	☒ Water Supply
				☐ Replacement Well
				☐ Test Hole
				☐ Recharge Well
				☐ Dewatering Well
				☐ Observation and/or Monitoring Hole
				☐ Alteration (Construction)
				☐ Abandoned, Insufficient Supply
				☐ Abandoned, Poor Water Quality
				☐ Abandoned, other, specify
				☐ Other, specify

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From To
4.21	PVC	10	3.05 7.62

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft) From To	Diameter (cm/in)
(m/ft) ☐ Gas ☐ Other, specify		0 1.52	8.25
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested	1.52 7.62	5.71
(m/ft) ☐ Gas ☐ Other, specify			
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested		
(m/ft) ☐ Gas ☐ Other, specify			

Business Name of Well Contractor Strata Soil Sampling Inc.		Well Contractor's Licence No. 7 2 4 1
Business Address (Street Number/Name) 147-2 West Beaver Creek Road Richmond Hill		Municipality
Province Ontario	Postal Code L4B 1C6	Business E-mail Address wrecords@stratasoil.com
Bus. Telephone No. (inc. area code) 905-764-9304		Name of Well Technician (Last Name, First Name) Beatty Brian
Well Technician's Licence No. 3 6 1 6	Signature of Technician and/or Contractor	Date Submitted 2011 01 24

After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
	2		2	
	3		3	
Pump intake set at (m/ft)	4		4	
Pumping rate (l/min / GPM)	5		5	
Duration of pumping hrs + min	10		10	
Final water level end of pumping (m/ft)	15		15	
If flowing give rate (l/min / GPM)	20		20	
Recommended pump depth (m/ft)	25		25	
Recommended pump rate (l/min / GPM)	30		30	
Well production (l/min / GPM)	40		40	
Disinfected? ☐ Yes ☐ No	50		50	
	60		60	

Please provide a map below following instructions on the back.	
Comments: General contractor: Pinchin Environmental	
Well owner's information package delivered ☐ Yes ☒ No	Date Package Delivered 2011 01 20 Date Work Completed 2011 01 20
Ministry Use Only Audit No. z127944 Received 17 2011	

Address of Well Location (Street Number/Name) 877 Boyd Avenue		Township	Lot	Concession
County/District/Municipality		City/Town/Village Ottawa	Province Ontario	Postal Code
UTM Coordinates	Zone Easting	North	Municipal Plan and Sublot Number	
NAD 83	18441274	5024978	Other WKQ-003456 A 0 - A 01	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)				
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From To
BRN	sand	silt stones	soft	0 1.52
GRY	limestone		hard, dry	1.52 7.62

Annular Space			Results of Well Yield Testing			
Depth Set at (m/ft) From To	Type of Sealant Used (Material and Type)	Volume Placed (m ³ /ft ³)	After test of well yield, water was:		Draw Down	Recovery
0 2.74	Benseal		☐ Clear and sand free	☐ Other, specify	Time (min)	Water Level (m/ft)
2.74 7.62	filter sand		If pumping discontinued, give reason:		Static Level	
					1	1
			Pump intake set at (m/ft)		2	2
			Pumping rate (l/min / GPM)		3	3
			Duration of pumping hrs + min		4	4
			Final water level end of pumping (m/ft)		5	5
			If flowing give rate (l/min / GPM)		10	10
			Recommended pump depth (m/ft)		15	15
			Recommended pump rate (l/min / GPM)		20	20
			Well production (l/min / GPM)		25	25
			Disinfected?		30	30
			☐ Yes ☐ No		40	40
					50	50
					60	60

Method of Construction		Well Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Xest Hole
☐ Boring	☐ Digging	☐ Irrigation	☐ Monitoring
☐ Air percussion	☐ Digging	☐ Industrial	☐ Cooling & Air Conditioning
☒ Other, specify	Direct Push	☐ Other, specify	

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From To	☐ Water Supply	☐ Replacement Well
3.45	PVC	3.56	0 3.05	☒ Xest Hole	☐ Recharge Well
				☐ Dewatering Well	☐ Observation and/or Monitoring Hole
				☐ Alteration (Construction)	☐ Abandoned, Insufficient Supply
				☐ Abandoned, Poor Water Quality	☐ Abandoned, other, specify
				☐ Other, specify	

Construction Record - Screen			
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From To
4.21	PVC	10	3.05 7.62

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From To	Diameter (cm/in)
		0 1.52	8.25
		1.52 7.62	5.71

Well Contractor and Well Technician Information			
Business Name of Well Contractor Strata Soil Sampling Inc.		Well Contractor's Licence No. 7 2 4 1	
Business Address (Street Number/Name) 147-2 West Beaver Creek Road		Municipality Richmond Hill	
Province Ontario	Postal Code L4B 1C6	Business E-mail Address wrecords@stratasoil.com	
Bus. Telephone No. (inc. area code) 905-764-9304	Name of Well Technician (Last Name, First Name) Beatty Brian		
Well Technician's Licence No. 3 6 1 6	Signature of Technician and/or Contractor [Signature]		
Date Submitted 2011/01/24			

Map of Well Location

Please provide a map below following instructions on the back.

Comments: General contractor: Pinchin Environmental

Ministry Use Only	
Audit No. z127943	Received 17 2011
Well owner's information package delivered ☐ Yes ☒ No	Date Package Delivered 2011/01/20
Date Work Completed 2011/01/20	

A109123
Master Well Owner's and Land Owner's Information

First Name	Last Name	E-mail Address
Executor for the Estate of Robert Bonsall		
Mailing Address (Street Number/Name, RR)	Municipality	Province
16 Harris Place	Ottawa	ON
Postal Code	Telephone No. (inc. area code)	
K2G 2P2G1B	2285236	

Location and Construction of the Master Well in the Cluster

Address of Well Location (Street Number/Name, RR)	Township	Lot	Concession
814 Boyd Ave	CITY OF OTTAWA		
County/District/Municipality	City/Town/Village	Province	Postal Code
Ottawa - Carleton	OTTAWA	Ontario	K2A2C8
UTM Coordinates	Zone	Easting	Northing
NAD 83	18	441138	5025180
GPS Unit Make	Model	Mode of Operation:	
Garmin	MAP 76	☐ Undifferentiated ☒ Averaged	
☐ Differentiated, specify			

Overburden and Bedrock Materials (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (Metres)
				From To
Brown Sand	clay	fill		0 0.60
Brown clay	Sand	Dense		0.60 1.37
Grey limestone	shale	fracture		1.37 4.87

Hole Details

Depth (Metres)	Diameter (Centimetres)
From To	
0 1.37	15.24
1.37 4.87	11.43

Water Use

☐ Public	☐ Industrial	☐ Not used	☐ Other, specify
☐ Domestic	☐ Commercial	☐ Dewatering	
☐ Livestock	☐ Municipal	☒ Monitoring	
☐ Irrigation	☒ Test Hole	☐ Cooling & Air Conditioning	

Method of Construction

☐ Cable Tool	☒ Air Percussion	☐ Digging
☐ Rotary (Conventional)	☐ Diamond	☒ Boring
☐ Rotary (Reverse)	☐ Jetting	☐ Other, specify
☐ Rotary (Air)	☐ Driving	

Status of Well

☒ Test Hole	☐ Abandoned, Insufficient Supply
☐ Replacement Well	☐ Abandoned, Poor Water Quality
☐ Dewatering Well	☐ Other, specify
☐ Alteration (Construction)	☐ Abandoned, other, specify

No Casing and Screen Used

Open Hole	Static Water Level Test
☐ Yes ☒ No	N/A Metres

Screen

☐ Galvanized	☐ Steel	☐ Fibreglass	☐ Concrete	☒ Plastic
Outside Diameter (Centimetres)	Slot No.			
5.08	0.10			

Water Details

Water found at Depth	Kind of Water
2.62 Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth	Kind of Water
☐ Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals
Water found at Depth	Kind of Water
☐ Metres ☐ Gas	☐ Fresh ☐ Salty ☐ Sulphur ☐ Minerals

Disinfected ☐ Yes ☒ No	Date Master Well Completed (yyyy/mm/dd)
Test Hole	2011 01 06

Cluster Information (Please also fill out the additional Cluster Well Information for Well Construction for each parcel of land and cluster.)

Total Wells in Cluster	Please indicate Number of Cluster Well Information Log Sheets Submitted
Four	ONE
Total Wells on this Property	
Four	

Location of Well Cluster

Detailed Map must be provided as an attachment no larger than legal size (8.5" x 14"). Sketches are not allowed.
☐ Check box to confirm detailed map is provided as per Section 11.1 (3)

Consent to release additional information concerning the cluster to the Director upon request

Signature of Technician/Contractor	Date (yyyy/mm/dd)
	2011 03 25

Master Well Owner's/Land Owner's consent to use Cluster Form

Signature	Date (yyyy/mm/dd)
N/A	-

Ministry Use Only

Audit No.	Well Contractor No.
M 06272	
Date Received (yyyy/mm/dd)	Date of Inspection (yyyy/mm/dd)
APR 28 2011	
Remarks	

Construction Details

Inside Diameter (Centimetres)	Material (steel, plastic, fibreglass, concrete, galvanized)	Wall Thickness	Depth (Metres)
			From To
5.08	Plastic Casing	SC40	0 1.82
5.08	Plastic Screen	SC40	1.82 4.87


Annular Space/Abandonment Sealing Record

Depth Set at (Metres)	Type of Sealant Used (Material and Type)	Volume Used (Cubic Metres)
From To		
0 0.30	Flush mount Cover w/cement	
0.30 1.67	Bentonite chips	
1.67 4.87	#3 Sand	

Well Contractor and Well Technician Information

Business Name of Well Contractor	Well Contractor's Licence No.
G.E.T. Drilling LTD.	7 0 8 5
Business Address (Street No./Name, number, RR)	Municipality
278 Drive-in Rd	Napanee
Province	Postal Code
ON	K7B3G1
Business E-mail Address	
getdrilling@mycanda.ca	
Bus Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)
6133544767	HARRISON, Tim
Well Technician's Licence No.	Signature of Technician
2251	
Date Submitted (yyyy/mm/dd)	
2011 03 25	

TAG # A109123

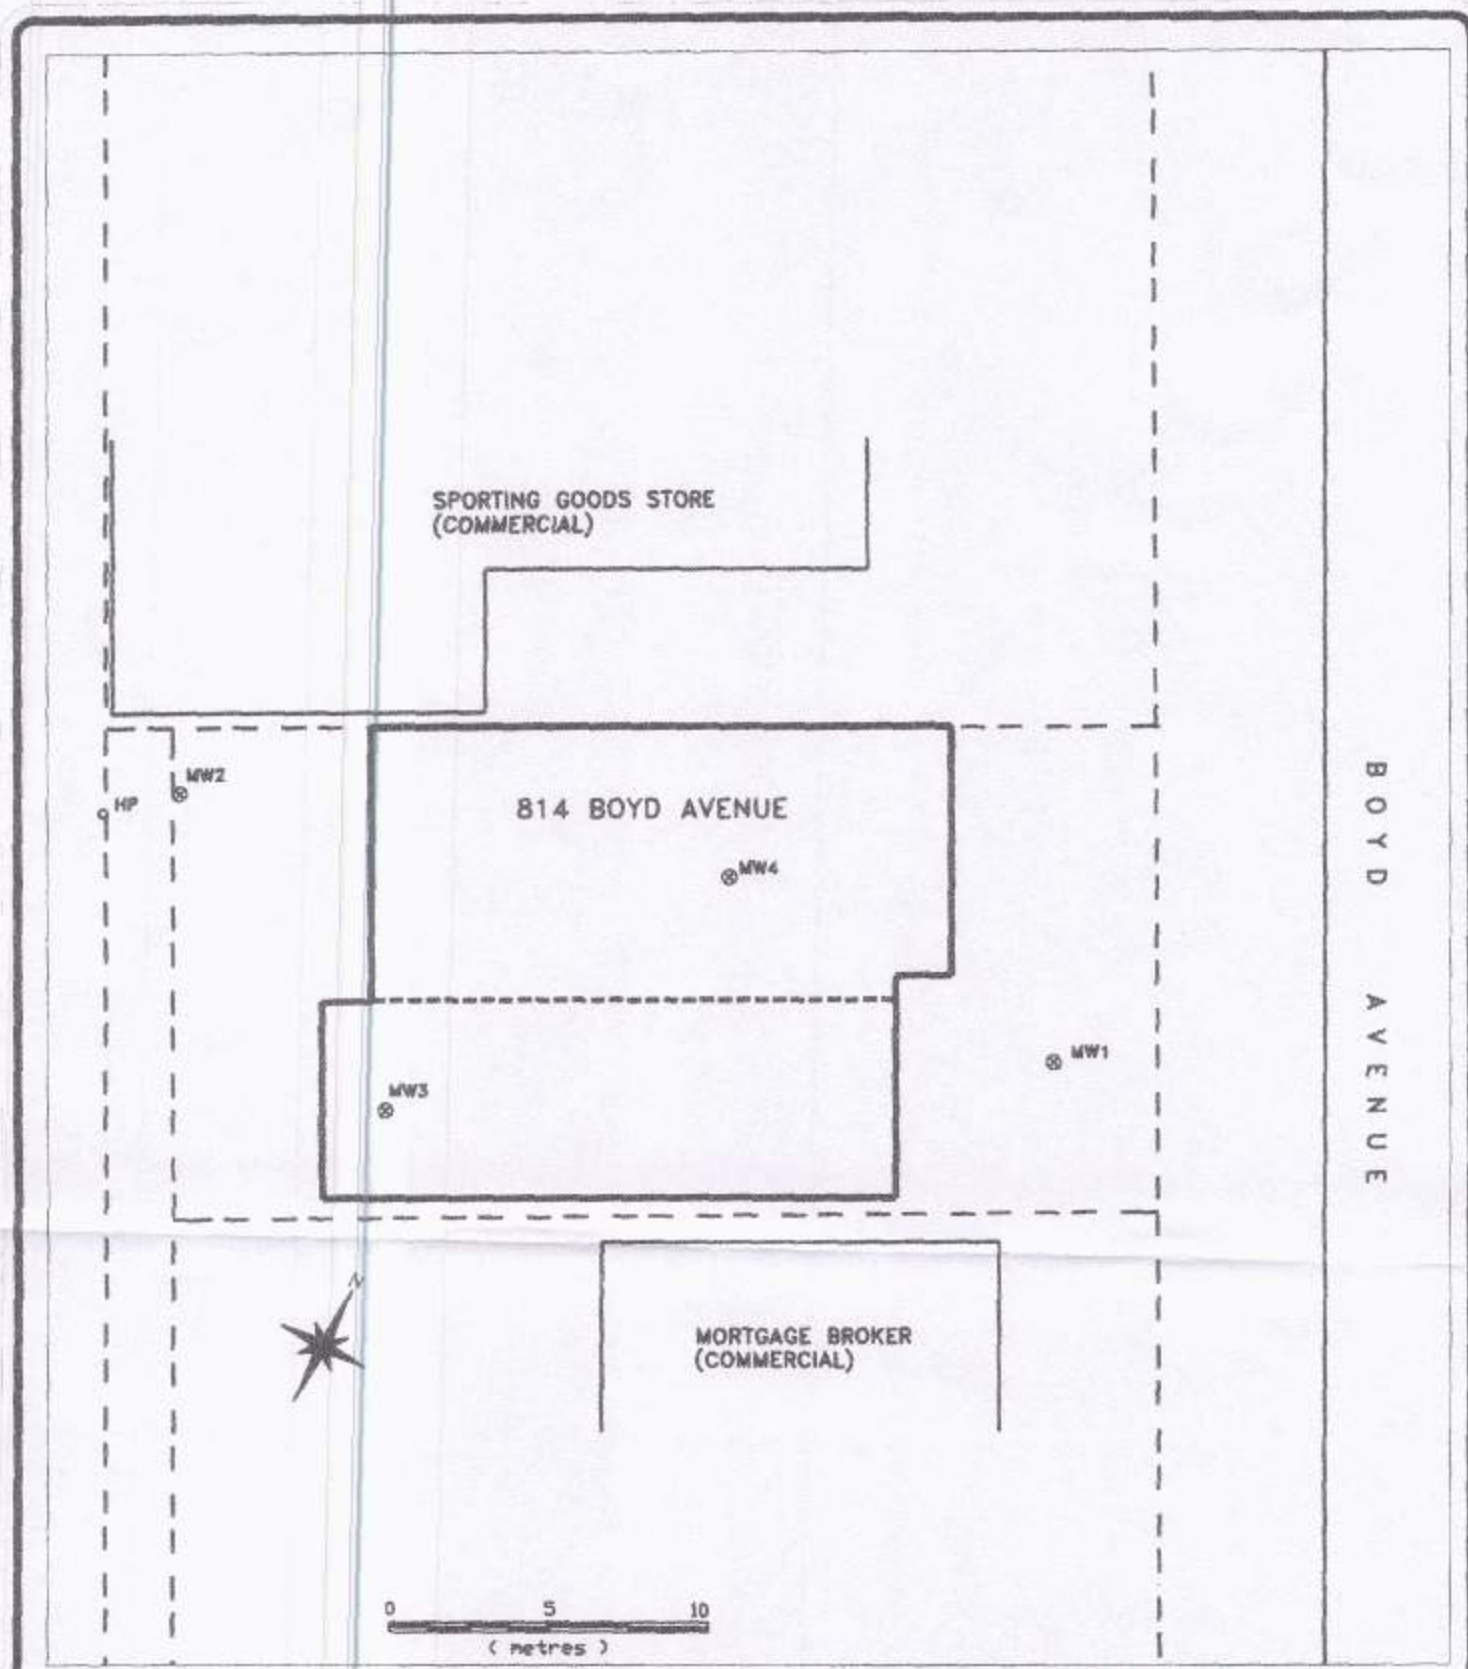

LEGEND:

- ⊗ BOREHOLE/MONITORING WELL LOCATION
- - - PROPERTY BOUNDARY

FIGURE 2

SITE LAYOUT

814 BOYD AVENUE
OTTAWA, ONTARIO

C-7085
M06272
C01279

APR 28 2011

Well Location

Address of Well Location (Street Number/Name) 877 Boyd Ave. Township Ontario Lot Concession

County/District/Municipality City/Town/Village Province Ontario Postal Code

UTM Coordinates Zone 18 Easting 44125 Northing 75024957 Municipal Plan and Sublot Number Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
From	To			From	To
<u>BLK</u>	<u>gravel fill</u>		<u>loose</u>	<u>0</u>	<u>.31</u>
<u>BRN</u>	<u>sand</u>	<u>stones</u>	<u>soft</u>	<u>.31</u>	<u>1.52</u>
<u>GRY</u>	<u>limestone</u>		<u>hard</u>	<u>1.52</u>	<u>9.14</u>

Annular Space			Results of Well Yield Testing			
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	Draw Down		Recovery	
From	To		Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
<u>0</u>	<u>.31</u>	<u>concrete/flushmount</u>				
<u>.31</u>	<u>2.74</u>	<u>hole plug</u>				
<u>2.74</u>	<u>9.14</u>	<u>filter sand</u>				

Method of Construction	Well Use		
☐ Cable Tool ☐ Rotary (Conventional) ☐ Rotary (Reverse) ☒ Boring ☐ Air percussion ☐ Other, specify <u> </u>	☐ Diamond ☐ Jetting ☐ Driving ☐ Digging	☐ Public ☐ Domestic ☐ Livestock ☐ Irrigation ☐ Industrial ☐ Other, specify <u> </u>	☐ Commercial ☐ Municipal ☒ Test Hole ☐ Cooling & Air Conditioning ☐ Not used ☐ Dewatering ☒ Monitoring

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
From	To				
<u>5.20</u>	<u>PVC</u>	<u>.390</u>	<u>0</u>	<u>3.05</u>	☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify <u> </u> ☐ Other, specify <u> </u>

Construction Record - Screen				Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)		
From	To				
<u>6.03</u>	<u>PVC</u>	<u>10</u>	<u>3.05</u>	<u>9.14</u>	☐ Other, specify <u> </u>

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify <u> </u>	Depth (m/ft)	Diameter (cm/in)
From	To		
<u>0</u>	<u>1.52</u>	<u>11.43</u>	
<u>1.52</u>	<u>9.14</u>	<u>7.62</u>	

Well Contractor and Well Technician Information					
Business Name of Well Contractor <u>Strata Soil Sampling</u>	Well Contractor's Licence No. <u>7241</u>				
Business Address (Street Number/Name) <u>147-2 West Beaver Creek Road Richmond Hill</u>	Municipality <u> </u>				
Province <u>Ontario</u> Postal Code <u>L4B1K6</u> Business E-mail Address <u>Wrecords@stratasoil.com</u>					
Bus. Telephone No. (inc. area code) <u>9057649304</u> Name of Well Technician (Last Name, First Name) <u>Beatty Brian</u>					
Well Technician's Licence No. <u>3616</u> Signature of Technician and/or Contractor <u>[Signature]</u> Date Submitted <u>20110509</u>					

Map of Well Location

Please provide a map below following instructions on the back.

Boyd Ave. Dobbie St.

15m 5m 877

Comments:

Well owner's information package delivered	Date Package Delivered	Ministry Use Only	
☐ Yes ☐ No	<u>20110426</u>	Audit No. <u>z123948</u>	Received <u>JUN 2 2011</u>

Measurements recorded in: ☒ Metric ☐ Imperial

Address of Well Location (Street Number/Name) 877 Boyd Ave.		Township	Lot	Concession
County/District/Municipality		City/Town/Village Ottawa	Province Ontario	Postal Code
UTM Coordinates NAD 83	Zone 18	Easting 441258	Northings 5024959	Municipal Plan and Sublot Number

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)				
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From To
BLK	gravel fill		loose	0 .31
BRN	sand	stones	soft	.31 1.52
GRY	limestone		hard	1.52 9.14

Annular Space			Results of Well Yield Testing			
Depth Set at (m/ft) From To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify	Draw Down Time (min) Water Level (m/ft)	Recovery Time (min) Water Level (m/ft)	
0 .31	concrete flushmount					
.31 2.74	hole plug					
2.74 9.14	filter sand					

Method of Construction		Well Use		
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☐ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☒ Air percussion		☐ Industrial		
☐ Other, specify		☐ Other, specify		

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From To		
5.20	PVC	.390	0 3.05	☐ Water Supply	☒ Replacement Well
				☒ Test Hole	☐ Recharge Well
				☐ Dewatering Well	☒ Observation and/or Monitoring Hole
				☐ Alteration (Construction)	☐ Abandoned, Insufficient Supply
				☐ Abandoned, Poor Water Quality	☐ Abandoned, other, specify
				☐ Other, specify	

Construction Record - Screen				Map of Well Location	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From To		
6.03	PVC	10	3.05 9.14		

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From To	Diameter (cm/in)
		0 1.52	11.43
		1.52 9.14	7.62


Business Name of Well Contractor Strata Soil Sampling		Well Contractor's Licence No. 7241	
Business Address (Street Number/Name) 147-2 West Beaver Creek Rd Richmond Hill		Municipality	
Province Ontario	Postal Code L4B1C6	Business E-mail Address wrecords@stratasoil.com	
Bus. Telephone No. (inc. area code) 9057649304		Name of Well Technician (Last Name, First Name) Beatty Brian	
Well Technician's Licence No. 3616		Signature of Technician and/or Contractor [Signature]	
		Date Submitted 20110509	

Please provide a map below following instructions on the back.

Comments:

Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered Y Y Y Y M M D D 2011 04 26	Date Work Completed Y Y Y Y M M D D 2011 04 26

Ministry Use Only	
Audit No. Z123947	Received JUN 02 2011



Measurements recorded in: ☒ Metric ☐ Imperial

Well Tag No. (Place Sticker and/or Print Below)

A113553

A113553

Regulation 903 Ontario Water Resources Act

8547 Page 3 of 3

Address of Well Location (Street Number/Name)

Township

Lot	

Concession

877 Boyd Ave

County/District/Municipality

City/Town/Village

Отсюда

Province

Ontario

Postal Code

UTM Coordinates

Zone , Easting

Northing

Municipal Plan and Sublot Number

Other

NAD 83 184412745024980

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

[illegible]

Annular Space

Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From	To		
0	.31	concrete flush mount	
.31	2.74	hole plug	
2.74	9.14	filter sand	

Results of Well Yield Testing

After test of well yield, water was:		Draw Down		Recovery	
		Time (min)	Water Level (mvt)	Time (min)	Water Level (mvt)
☐ Clear and sand free	☐ Other, <i>specify</i> _____	Static Level			
		1		1	
If pumping discontinued, give reason:		2		2	
Pump intake set at (mvt)		3		3	
Pumping rate (l/min / GPM)		4		4	
Duration of pumping ____ hrs + ____ min		5		5	
Final water level end of pumping (mvt)		10		10	
If flowing give rate (l/min / GPM)		15		15	
Recommended pump depth (mvt)		20		20	
		25		25	
Recommended pump rate (l/min / GPM)		30		30	
		40		40	
Well production (l/min / GPM)		50		50	
Disinfected?		60		60	
☐ Yes	☐ No				

Construction Record - Casino

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Well Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Inactive, or Other
			From	To	
5.20	PVC	.390	0	3.05	

Status of Well

☐ Water Supply
☐ Replacement Well
☒ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify*

☐ Other, *specify*

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
6.03	PVC	10	7.05	8.14

☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify _____
☐ Other, specify _____

Water Details

Water found at Depth		Depth (m/ft)		Diameter
(m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	From	To	(cm/in)
Water found at Depth	Kind of Water: ☐ Fresh ☐ Untested	0	1.52	11.43
(m/ft) ☐ Gas ☐ Other, specify		1.52	9.14	7.62
Water found at Depth	Kind of Water: ☐ Fresh ☐ Untested			
(m/ft) ☐ Gas ☐ Other, specify				

Hole Diameter


Depth (m/ft)		Diameter (cm/in)
From	To	
0	1.52	11.43
1.52	9.14	7.62

Well Contractor and Well Technician Information

Business Name of Well Contractor		Well Contractor's Licence No.	
Strata Soil Sampling		7 2 4 1	
Business Address (Street Number/Name)		Municipality	
147-2 West Beaver Creek Road		Richmond Hill	
Province	Postal Code	Business E-mail Address	
Ontario	L4B1C6	wrecords@stratasoil.com	
Bus. Telephone No. (inc. area code)		Name of Well Technician (Last Name, First Name)	
9057649304		Beatty Brian	
Well Technician's Licence No.	Signature of Technician and/or Contractor		Date Submitted
3 6 1 6			20110509

Map of Well Location

Please provide a map below following instructions on the back.

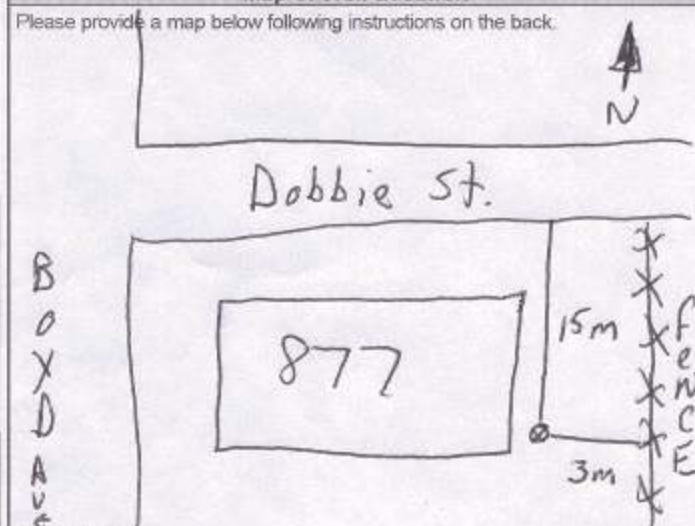

Comments:

Well owner's information: package delivered	Date Package Delivered	Ministry Use Only
	Y Y Y Y M M D D	
☐ Yes ☐ No	Date Work Completed 20110926	Received

UTM 18 2 4401914 d^E
9 R 50247910 N
Elev. 9 R 0260
Basin 25 1 1 1



15 No 7936

RECEIVED
OCT 25 1950
GEOLOGICAL BRANCH
DEPARTMENT OF MINES

The Well Drillers Act
Department of Mines, Province of Ontario

Water Well Record

CITY OF OTTAWA

County or District W. York Town Hwy Con. — Lot — Pt. Lot —
— Acres —
including pump) —

Pipe and Casing Record

Pumping Test

Casing diameter(s)	Date <u>Aug. 1950</u>
Length(s) of casing(s)	Developed Capacity
Length of screen	Duration of Test
Type of screen	Pumping Rate
Type of pump	Drawdown
Capacity of pump	Static level of completed well
Depth of pump setting	Is well a gravel-wall type? <u>No</u>

Water Record

Kind (fresh or mineral) <u>Fresh</u>	Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises
Quality (hard, soft, contains iron, sulphur etc.)	<u>50 ft</u>	<u>Fresh</u>	<u>38 ft</u>
Appearance (clear, cloudy, coloured)			
For what purpose(s) is the water to be used? <u>Household</u>			
How far is well from possible source of contamination? <u>40 ft</u>			
What is source of contamination? <u>Septic tank</u>			
Enclose a copy of any mineral analysis that has been made of water			

Well Log

Drift and Bedrock Record

From


To

0 ft.

.....ft.

Location of Well

In diagram below show distances of well from road and lot line

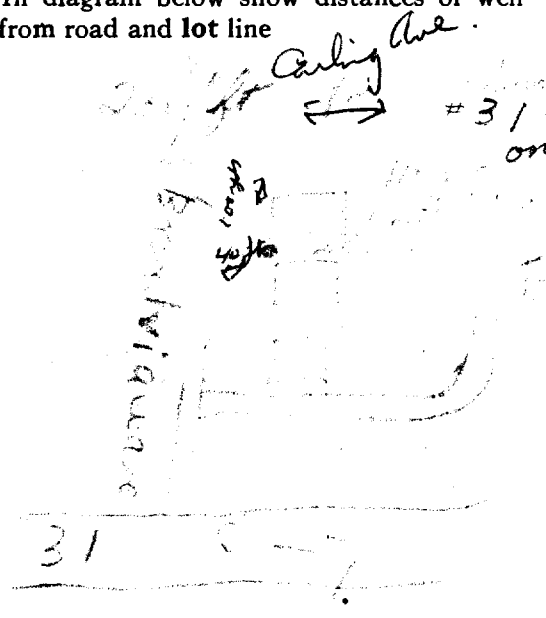

Situation: Is well on upland, in valley, or on hillside?

Drilling Firm Gordon S. McAllister

Address Wentworth RR #1

Recorded by Gordon S. McAllister Address Allymore East

Date Aug 30 Licence Number

Address of Well Location (Street Number/Name) 877 Boyd Ave		Township	Lot	Concession
County/District/Municipality		City/Town/Village Ottawa	Province Ontario	Postal Code
UTM Coordinates NAD 83	Zone 18	Easting 441276	Northing 5024979	Municipal Plan and Sublot Number
				Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BLK	gravel fill		loose	0	.31
BRN	sand	stones	soft	.31	1.52
GRY	limestone		hard	1.52	9.14

Annular Space		
Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)
0	.31	concrete/flush mount
.31	2.74	hole plug
2.74	9.14	filter sand

Method of Construction	Well Use
☐ Cable Tool ☐ Rotary (Conventional) ☐ Rotary (Reverse) ☐ Boring ☒ Air percussion ☐ Other, specify:	☐ Public ☐ Domestic ☐ Livestock ☐ Irrigation ☐ Industrial ☐ Other, specify:
☐ Diamond ☐ Jetting ☐ Driving ☐ Digging	☐ Commercial ☐ Municipal ☒ Test Hole ☐ Cooling & Air Conditioning
	☐ Not used ☐ Dewatering ☐ Monitoring

Construction Record - Casing			Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Well Thickness (cm/in)	Depth (m/ft) From	To
5.20	PVC	.790	0	3.05


Construction Record - Screen			Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	To
6.03	PVC	10	3.05	9.14

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From	Diameter (cm/in)
0		0	11.43
1.52		1.52	7.62

Business Name of Well Contractor Strata soil sampling		Well Contractor's Licence No. 7241
Business Address (Street Number/Name) 147-2 West Beaver Creek Rd		Municipality Richmond Hill
Province Ontario	Postal Code L4B1C6	Business E-mail Address cblwrecords@stratasoil.com
Bus. Telephone No. (inc. area code) 9057699304		Name of Well Technician (Last Name, First Name) Beatty Brian
Well Technician's Licence No. 3616	Signature of Technician and/or Contractor <i>[Signature]</i>	Date Submitted 20110509

Results of Well Yield Testing			
After test of well yield, water was:		Draw Down	
☐ Clear and sand free ☐ Other, specify:		Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Static Level	
Pump intake set at (m/ft)		1	1
Pumping rate (l/min / GPM)		2	2
Duration of pumping hrs + min		3	3
Final water level end of pumping (m/ft)		4	4
If flowing give rate (l/min / GPM)		5	5
Recommended pump depth (m/ft)		10	10
Recommended pump rate (l/min / GPM)		15	15
Well production (l/min / GPM)		20	20
Disinfected?		25	25
☐ Yes ☐ No		30	30
		40	40
		50	50
		60	60

Map of Well Location	
Please provide a map below following instructions on the back.	
Comments:	
Well owner's information package delivered	Date Package Delivered
☐ Yes ☐ No	20110426
Date Work Completed	
20110426	
Ministry Use Only	
Audit No. z123950	
JUN 02 2011	
Received	



A 094334

Regulation 903 Ontario Water Resources Act

Page 1 of 1

Measurements recorded in: ☐ Metric ☒ Imperial

Well Owner's Information

First Name Playtime Daycare Centre	Last Name / Organization [REDACTED]	E-mail Address [REDACTED]		☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name) 1160 Maitland Ave.	Municipality Ottawa	Province ON	Postal Code K2C 2C2	Telephone No. (inc. area code) 613 737 5858

Well Location

Address of Well Location (Street Number/Name) 836 Boyd St	Township	Lot	Concession
County/District/Municipality	City/Town/Village Ottawa	Province Ontario	Postal Code

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD	83	181440699	5034814N		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

[illegible]

Annular Space			
Depth Set at (m/ft) From To		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	9'	3/8" Bentonite chips	
9'	26'	#2 Silica Sand	

Method of Construction		Well Use		
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☒ Monitoring
☒ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☒ Air percussion		☐ Industrial		
☐ Other, specify _____		☐ Other, specify _____		

Construction Record - Casing			Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)	
			From	To
2"	Plastic	.25"	0	11'

Results of Well Yield Testing					
After test of well yield, water was:		Draw Down		Recovery	
☐ Clear and sand free ☐ Other, specify _____		Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Static Level			
1				1	
2				2	
3				3	
4				4	
5				5	
Final water level end of pumping (m/ft)		10		10	
If flowing give rate (l/min / GPM)		15		15	
20				20	
25				25	
Recommended pump rate (l/min / GPM)		30		30	
40				40	
Well production (l/min / GPM)		50		50	
Disinfected?		60		60	
☒ Yes ☐ No					

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
2.25"	Plastic	9 10	11'	26'

☐ Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify* _____
☐ Other, *specify* _____

Water Details		Hole Diameter		
Water found at Depth _____ (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft)	Diameter (cm/in)	
		From	To	
Water found at Depth _____ (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	0	7'	8"
Water found at Depth _____ (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested	7	26'	4"
Water found at Depth _____ (m/ft) ☐ Gas ☐ Other, specify _____	Kind of Water: ☐ Fresh ☐ Untested			

Well Contractor and Well Technician Information

Business Name of Well Contractor Can. Env. Drilling & Contractors Inc.		Well Contractor's Licence No. 71323	
Business Address (Street Number/Name) 4102 Penhryn Rd. Inverary		Municipality South Frontenac	
Province ON	Postal Code K0H1X0	Business E-mail Address Jonathan@canedc.com	
Bus. Telephone No. (inc. area code) 6133532231	Name of Well Technician (Last Name, First Name) FILLION JONATHAN		
Well Technician's Licence No. 38115	Signature of Technician and/or Contractor		Date Submitted 30/11/12 DF

Results of Well Yield Testing

After test of well yield, water was:		Draw Down		Recovery	
☐ Clear and sand free ☐ Other, <i>specify</i> _____		Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Static Level			
		1		1	
Pump intake set at (m/ft)		2		2	
Pumping rate (l/min / GPM)		3		3	
Duration of pumping _____ hrs + _____ min		4		4	
Final water level end of pumping (m/ft)		5		5	
If flowing give rate (l/min / GPM)		10		10	
Recommended pump depth (m/ft)		15		15	
		20		20	
Recommended pump rate (l/min / GPM)		25		25	
		30		30	
Well production (l/min / GPM)		40		40	
		50		50	
Disinfected?		60		60	
☒ Yes ☐ No					

Map of Well Location

Please provide a map below following instructions on the back.

Kerr ~~SL~~AVE

A hand-drawn sketch map of a property. At the top, the text 'Kerr ~~SL~~AVE' is written. On the right side, a vertical line represents a boundary with the text '836 Boyd St' written vertically. In the upper left, an arrow points upwards with the letter 'N' below it. In the upper middle, there is a square labeled 'garage' and another square labeled 'house'. Between them is the text 'xmu 2'. In the lower middle, there is another square labeled 'garage' and a third square labeled 'house'. A horizontal line is drawn between the upper and lower sets of buildings.

Comments:

Comments:

Well owner's information package delivered	Date Package Delivered	Ministry Use Only
	Y Y Y Y M M D D Date Work Completed 80111007	
☐ Yes ☐ No		

Measurements recorded in: ☒ Metric ☐ Imperial

Address of Well Location (Street Number/Name) 361 Boyd Ave		Township	Lot	Concession
County/District/Municipality		City/Town/Village Ottawa	Province Ontario	Postal Code
UTM Coordinates NAD 83	Zone 18	Easting 441260	Northing 5025005	Municipal Plan and Sublot Number
			Other	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
				From	To
Bm	Sand	Gravel	soft dry	0	.91
Gry	limestone		fractured	.91	7.62

Annular Space			
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	
From	To		
0	.31	Concrete / flushmount	
.31	4.27	Benseal	
4.27		Sand	

Method of Construction		Well Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Test Hole
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning
☒ Air percussion		☐ Industrial	☒ Monitoring
☐ Other, specify _____		☐ Other, specify _____	

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)	From	To
4.03	PVC	.368	0	4.57	

Construction Record - Screen				Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	From	To
4.57	PVC	10	4.57	7.62	

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify _____	Depth (m/ft)	Diameter (cm/in)
		From	To
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify _____	0	1.22
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify _____	1.22	7.62
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify _____		

Business Name of Well Contractor Strata Drilling Group		Well Contractor's Licence No. 7 2 4 1	
Business Address (Street Number/Name) 147-2 W Beaver creek		Municipality Richmond Hill	
Province ON	Postal Code L4B 1C6	Business E-mail Address wrecords@strataoil.com	
Bus. Telephone No. (inc. area code) 905 764 9304	Name of Well Technician (Last Name, First Name) Beath Brian		
Well Technician's Licence No. 3616	Signature of Technician and/or Contractor		Date Submitted 2013 01 15

Results of Well Yield Testing			
After test of well yield, water was:		Draw Down	
☐ Clear and sand free ☐ Other, specify _____		Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Static Level	
Pump intake set at (m/ft)		1	1
Pumping rate (l/min / GPM)		2	2
Duration of pumping hrs + min		3	3
Final water level end of pumping (m/ft)		4	4
If flowing give rate (l/min / GPM)		5	5
Recommended pump depth (m/ft)		10	10
Recommended pump rate (l/min / GPM)		15	15
Well production (l/min / GPM)		20	20
Disinfected?		25	25
☐ Yes ☐ No		30	30
		40	40
		50	50
		60	60

Map of Well Location

Please provide a map below following instructions on the back.

Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered Y Y Y Y M M D D 2013 01 14	Ministry Use Only Audit No. 2153005 FEB 14 2013



Ministry of
the Environment

A106764

Maker and/or Print Below

S-13574 Well Record
Regulation 903 Ontario Water Resources Act

Measurements recorded in: ☒ Metric ☐ Imperial

Page _____ of _____

Address of Well Location (Street Number/Name) 861 Boyd Ave		Township	Lot	Concession
County/District/Municipality		City/Town/Village Ottawa	Province Ontario	Postal Code
UTM Coordinates NAD 83	Zone 18	Easting 441253	Northings 5025001	Municipal Plan and Sublot Number
			Other	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
From	To			From	To
Bm	Sand	Gravel	soft, dry	0	1.5
Gr	Limestone		Fractured	1.5	10.06

Annular Space			
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	
From	To		
0	.31	Concrete / flushmount	
.31	7.32	Benseal	
7.32		Sand	

Method of Construction		Well Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole
☐ Boring	☐ Digging	☐ Irrigation	☒ Monitoring
☒ Air percussion		☐ Industrial	☐ Cooling & Air Conditioning
☐ Other, specify _____		☐ Other, specify _____	

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
From	To				
4.03	PVC	.368	0	7.01	

☐ Water Supply	☐ Replacement Well
☒ Test Hole	☐ Recharge Well
☐ Dewatering Well	☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)	☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality	☐ Abandoned, other, specify _____
☐ Other, specify _____	

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
From	To			
4.82	PVC	10	7.01	10.06

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify _____	Depth (m/ft)	Diameter (cm/in)
From	To		
		0	1.5
		1.5	10.06
			11.43
			8

Well Contractor and Well Technician Information			
Business Name of Well Contractor Strata Drilling Group	Well Contractor's Licence No. 7241	Business Address (Street Number/Name) 147-2 W. Beaver Creek	Municipality Richmond Hill
Province ON	Postal Code L4B1C6	Business E-mail Address wrecords@strataksol.com	
Bus. Telephone No. (inc. area code) 9057649304	Name of Well Technician (Last Name, First Name) Beatty Brian	Signature of Technician and/or Contractor 	Date Submitted 20130118
Well Technician's Licence No. 3616			

Results of Well Yield Testing			
After test of well yield, water was:		Draw Down	
☐ Clear and sand free		Time (min)	Water Level (m/ft)
☐ Other, specify _____		Static Level	
If pumping discontinued, give reason:		1	1
Pump intake set at (m/ft)		2	2
Pumping rate (l/min / GPM)		3	3
Duration of pumping hrs + min		4	4
Final water level end of pumping (m/ft)		5	5
If flowing give rate (l/min / GPM)		10	10
Recommended pump depth (m/ft)		15	15
Recommended pump rate (l/min / GPM)		20	20
Well production (l/min / GPM)		25	25
Disinfected?		30	30
☐ Yes ☐ No		40	40
		50	50
		60	60


Map of Well Location	
Please provide a map below following instructions on the back.	
Comments:	

Well owner's information		Ministry Use Only	
Well owner's information package delivered	Date Package Delivered	Audit No.	
☐ Yes	Y Y Y Y M M D D	2163355	
☐ No	Date Work Completed	Received	14 2013
	20130118		

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7204981

Well Audit Number: C21244

Well Tag Number: A096551

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441162.00 Northing: 5025068.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7328

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: C21244

Date Well Completed: May 10, 2012

Date Well Record Received by MOE: July 19, 2013

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7206030

Well Audit Number: C21239

Well Tag Number: A140382

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441253.00 Northing: 5025215.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7328

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: C21239

Date Well Completed: December 10, 2012

Date Well Record Received by MOE: August 07, 2013


Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014



A157752

Regulation 903 Ontario Water Resources Act

Measurements recorded in: ☒ Metric ☐ Imperial

5-15347 Page _____ of _____

Well Owner's Information

First Name <i>Sapieto Larry</i>	Last Name / Organization <i>Products CAN</i>	E-mail Address		☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name) <i>2365 chemin de la Côte de L'Église</i>		Municipality <i>St. Laurent</i>	Province <i>Que</i>	Postal Code <i>H4N 2M7</i>

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession	
861 Clyde Ave				
County/District/Municipality	City/Town/Village	Province	Postal Code	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	541355	5025177		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Color and Depth Material Measurement Reading Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
				From	To
BROWN	Fill			0	.91
BROWN	Sand	Gravel		.91	2.13
GRAY	Limestone			2.13	3.66

Annular Space

Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m ³ /ft ³)
From	To		
0	.31	Concrete / Flushmount	
.31	1.83	Bentonite	
1.83	3.64	Sand	

Method of Construction

☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☒ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☒ Air percussion		☐ Industrial		
☒ Other, specify <u>Hand-dug</u>		☐ Other, specify		

Well Use

- ☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☒ Test Hole ☒ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify*

Construction Record - Casing

Construction Record - Casing					Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,
			From	To	
5.20	PVC	.390	0	213	

Status of Well

- ☐ Water Supply
☐ Replacement Well
☒ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify*
☐ Other, *specify*

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
1.03	PVC	10	2.13	3.66

☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify _____
☐ Other, specify _____

Water Details

Water found at Depth		Hole Diameter		
(m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From	To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	0	2.74	11.43
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	2.74	3.66	7.62

Hole Diameter

Hole Diameter		
Depth (m/ft)		Diameter (cm/in)
From	To	
0	2.74	11.43
2.74	3.66	7.62

Well Contractor and Well Technician Information

Business Name of Well Contractor <i>Strata Drilling Group</i>		Well Contractor's Licence No. <i>7241</i>	
Business Address (Street Number/Name) <i>165 Shields Court</i>		Municipality <i>Markham</i>	
Province <i>ON</i>	Postal Code <i>L2R8V2</i>	Business E-mail Address <i>wrecords@stratasoil.com</i>	
Bus. Telephone No. (inc. area code) <i>9057649304</i>	Name of Well Technician (Last Name, First Name) <i>McCoy Jamie</i>		
Well Technician's Licence No. <i>3656</i>	Signature of Technician and/or Contractor <i>[Signature]</i>		Date Submitted <i>20140411</i>

Results of Well Yield Testing

Results of Well Field Testing				
After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
	4		4	
Duration of pumping _____ hrs + _____ min	5		5	
Final water level end of pumping (m/ft)	10		10	
If flowing give rate (l/min / GPM)	15		15	
	20		20	
Recommended pump depth (m/ft)	25		25	
	30		30	
Recommended pump rate (l/min / GPM)	40		40	
	50		50	
Well production (l/min / GPM)	60		60	
Disinfected? ☐ Yes ☐ No				

Map of Well Location

Please provide a map below following instructions on the back.

mu w 13

Comments:

Well owner's information package delivered	Date Package Delivered	Ministry Use Only
	Date Work Completed	Audit No. Z184499
☐ Yes ☐ No	20140908	MAY 15 2014



A157751

S-15347 Page of

Measurements recorded in: ☒ Metric ☐ Imperial

Well Owner's Information

First Name: Sapato Dairy Products Co. Last Name / Organization: [Redacted] E-mail Address: [Redacted] ☐ Well Constructed by Well Owner

Mailing Address (Street Number/Name): 2365 Chemin de la Cote de Liesse Municipality: St. Laurent Province: QC Postal Code: H4M 2H7 Telephone No. (inc. area code): [Redacted]

Well Location

Address of Well Location (Street Number/Name): 861 Clyde Ave Township: [Redacted] Lot: [Redacted] City/Town/Village: Ottawa

County/District/Municipality: [Redacted] Province: Ontario Postal Code: [Redacted]

UTM Coordinates: Zone: 18 Easting: 441357 Northing: 5025175 NAD: 83 Municipal Plan and Sublot Number: [Redacted] Other: [Redacted]

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)
BRN	Fill			0 .91
BRN	Sand	Gravel		.91 2.13
GRY	Limestone			2.13 3.66

Annular Space			
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	
0 .31	Concrete/Flashmount		
.31 1.83	Bentonite		
1.83 3.66	Sand		

Method of Construction		Well Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Not used
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Municipal
☐ Boring	☐ Digging	☐ Irrigation	☒ Test Hole
☒ Air percussion		☐ Cooling & Air Conditioning	☒ Monitoring
☒ Other, specify: direct push		☐ Industrial	
		☐ Other, specify:	

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
5.20	PVC	.390	0 2.13	☐ Water Supply	
				☐ Replacement Well	
				☒ Test Hole	
				☐ Recharge Well	
				☐ Dewatering Well	
				☒ Observation and/or Monitoring Hole	
				☐ Alteration (Construction)	
				☐ Abandoned, Insufficient Supply	
				☐ Abandoned, Poor Water Quality	
				☐ Abandoned, other, specify:	
				☐ Other, specify:	


Construction Record - Screen			
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)
6.03	PVC	10	2.13 3.66

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify:	Depth (m/ft)	Diameter (cm/in)
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify:	0 2.74	11.43
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify:	2.74 3.66	7.62

Well Contractor and Well Technician Information			
Business Name of Well Contractor: Strata Drilling Group		Well Contractor's Licence No.: 7241	
Business Address (Street Number/Name): 165 Shields Court		Municipality: Markham	
Province: ON	Postal Code: L2R 9V2	Business E-mail Address: wrecords@stratasoil.com	
Bus. Telephone No. (inc. area code): 905 764 9304		Name of Well Technician (Last Name, First Name): McLoe Vanie	
Well Technician's Licence No.: 3656		Signature of Technician and/or Contractor: [Signature] Date Submitted: 20140411	

Results of Well Yield Testing				
After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
Duration of pumping _____ hrs + _____ min	4		4	
	5		5	
Final water level end of pumping (m/ft)	10		10	
If flowing give rate (l/min / GPM)	15		15	
	20		20	
Recommended pump depth (m/ft)	25		25	
	30		30	
Recommended pump rate (l/min / GPM)	40		40	
	50		50	
Well production (l/min / GPM)	60		60	
Disinfected? ☐ Yes ☐ No				

Map of Well Location	
Please provide a map below following instructions on the back.	
[Handwritten map area]	
Comments:	
Well owner's information package delivered: ☐ Yes ☐ No	Date Package Delivered: YYY YYY MM DD Date Work Completed: 20140408
Ministry Use Only Audit No.: 184498 Received: MAY 15 2014	



Tag #

A16321)

Tag #: A16321

Regulation 903 Ontario Water Resources Act

Measurements recorded in: ☒ Metric ☐ Imperial

Page of

Well Owner's Information

First Name <i>Sandra</i>	Last Name / Organization <i>Dairy Products</i>	E-mail Address	☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name) <i>2365 chemin de la Côte de L'Église St Laurent</i>	Municipality	Province <i>Que</i>	Postal Code <i>H4N 2H7</i>

Well Location

Address of Well Location (Street Number/Name) 861 Clyde Ave	Township	Lot	Concession
County/District/Municipality	City/Town/Village	Province	Postal Code

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	446868	5625802		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

[illegible]

Annular Space				Results of Well Yield Testing					
Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m ³ /ft ³)	After test of well yield, water was:		Draw Down		Recovery	
From	To			☐ Clear and sand free ☐ Other, specify _____	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)	
0	31	concrete / Oleshmount		If pumping discontinued, give reason:	Static Level				
31	31	concrete			1		1		
					2		2		
Pump intake set at (m/ft)									

Method of Construction		Well Use		
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☒ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Test Hole	☐ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☒ Air percussion		☐ Industrial		
☐ Other, specify _____		☐ Other, specify _____		

Construction Record - Casing					Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
			From	To	
8.25	Steel	.390	0	3.1	☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To

☐ Insufficient Supply

☐ Abandoned, Poor Water Quality

☐ Abandoned, other, *specify* _____

☐ Other, *specify* _____

☐ Insufficient Supply

☐ Abandoned, Poor Water Quality

☐ Abandoned, other, *specify* _____

☐ Other, *specify* _____

Water Details		Hole Diameter		
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Depth (m/ft) From	To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	0	3.1	11.43
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	3.1	6.1	7.62
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____			

Well Contractor and Well Technician Information				
Business Name of Well Contractor		Well Contractor's Licence No.		
Stetka Drilling Group		7241		
Business Address (Street Number/Name)		Municipality		
163 Shields Court		Markham		
Province	Postal Code	Business E-mail Address		
ON	L2R8V2	wrecords@spintascil.com		
Bus. Telephone No. (inc. area code)		Name of Well Technician (Last Name, First Name)		
9057649304		MULLIGAN, JAMES		
Well Technician's Licence No.	Signature of Technician and/or Contractor		Date Submitted	
3656	[Signature]		2014 04 29	

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
	3		3	
Pumping rate (l/min / GPM)	4		4	
	5		5	
Duration of pumping _____ hrs + _____ min	10		10	
	15		15	
Final water level end of pumping (m/ft)	20		20	
	25		25	
If flowing give rate (l/min / GPM)	30		30	
	40		40	
Recommended pump depth (m/ft)	50		50	
	60		60	
Recommended pump rate (l/min / GPM)				
Well production (l/min / GPM)				
Disinfected? ☐ Yes ☐ No				

Map of Well Location

Please provide a map below following instructions on the back.

mw 16
see map

Comments:

Well owner's information package delivered	Date Package Delivered	Ministry Use Only Audit No. Z 179384 MAY 15 2014
	Y Y Y Y M M D D Date Work Completed 20140911	

UTM 18 4410181410E
19R 51012510510N
Elev. 91 012510
Basin 25



15 No 7929

RECEIVED
JUL 11 1950
GEOLOGICAL BRANCH
DEPARTMENT OF MINES

The Well Drillers Act
Department of Mines, Province of Ontario

Water Well Record

CARLETON. CITY OF OTTAWA
County or District
Town
Con. Lot. Pt. Lot.
Ottawa Acres
including pump)

Pipe and Casing Record

Pumping Test

Casing diameter(s) 4"	Date April 10/50
Length(s) of casing(s) 8'	Developed Capacity
Length of screen	Duration of Test 4.2
Type of screen	Pumping Rate 1.2
Type of pump	Drawdown
Capacity of pump	Static level of completed well 12 feet
Depth of pump setting	Is well a gravel-wall type? No

Water Record

Kind (fresh or mineral) fresh	Depth(s) to Water Horizon(s) 59	Kind of Water fresh	No. of Feet Water Rises 47 feet
Quality (hard, soft, contains iron, sulphur etc.) hard			
Appearance (clear, cloudy, coloured) clear			
For what purpose(s) is the water to be used? Domestic			
How far is well from possible source of contamination? 29'			
What is source of contamination? Septic			
Enclose a copy of any mineral analysis that has been made of water			


Well Log

Drift and Bedrock Record

From	To
0 ft.	7.7 ft.
7	61

Location of Well

In diagram below show distances of well from road and lot line

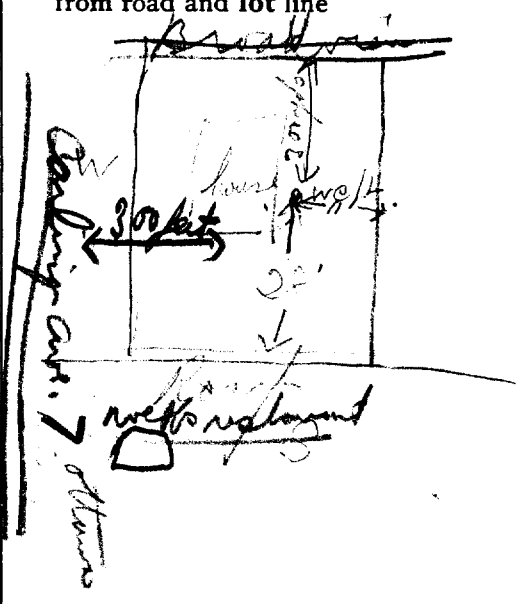

Situation: Is well on upland, in valley, or on hillside? Upland
Drilling Firm J. Gordon & Son
Address 412 Victoria Ave.
Recorded by Stanley Day
Date April 10/1950
Address 412 Victoria Ave.
Licence Number

Measurements recorded in: ☒ Metric ☐ Imperial

Tag#: A159149 *A159149*

5-15347 Page _____ of _____

Well Owner's Information

First Name <i>Sapate</i>	Last Name / Organization <i>Darry Product</i>	E-mail Address			☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name) <i>2365 Chemin de la Cote de Lièvre</i>		Municipality <i>St Laurent</i>	Province <i>Que</i>	Postal Code <i>H4H 2H7</i>	Telephone No. (inc. area code)

Well Location

Address of Well Location (Street Number/Name) 861 Clyde Ave			Township		Lot		Concession	
County/District/Municipality			City/Town/Village Ottawa				Province Ontario	
UTM Coordinates			Zone		Easting		Northing	
NAD 83			18		441370		5025205	
			Municipal Plan and Sublot Number				Other	

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*[illegible]

Annular Space

Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m ³ /ft ³)
From	To		
0	.31	Concrete Plasterment	
.31	1.5	Bentonite	
1.5	3.35	Sand	

Method of Construction

- ☐ Cable Tool
☐ Rotary (Conventional)
☐ Rotary (Reverse)
☐ Boring
☒ Air percussion
☐ Other, *specify* _____

Well Use

- ☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☒ Test Hole ☒ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		Status of Well
			From	To	
5.20	PVC	.390	0	1.83	☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)		☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify _____ ☐ Other, specify _____
			From	To	
6.03	PVC	10	1.83	3.35	

Water Details

Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Depth (m/ft) From	To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	0	2.44	11.43
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	2.44	3.35	76.2

Well Contractor and Well Technician Information

Business Name of Well Contractor <i>Strata Drilling Group</i>		Well Contractor's Licence No. <i>7 2 8 1</i>	
Business Address (Street Number/Name) <i>105 Shields East</i>		Municipality <i>Markham</i>	
Province <i>ON</i>	Postal Code <i>L2R8V2</i>	Business E-mail Address <i>Wrecords@StrataDrill.com</i>	
Bus. Telephone No. (inc. area code) <i>905 764 9304</i>	Name of Well Technician (Last Name, First Name) <i>McCoy, Jamie</i>		
Well Technician's Licence No. <i>3656</i>	Signature of Technician and/or Contractor 		Date Submitted <i>2014 04/21</i>

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
	3		3	
Pumping rate (l/min / GPM)	4		4	
	5		5	
Duration of pumping _____ hrs + _____ min	10		10	
	15		15	
Final water level end of pumping (m/ft)	20		20	
	25		25	
If flowing give rate (l/min / GPM)	30		30	
	40		40	
Recommended pump depth (m/ft)	50		50	
	60		60	
Recommended pump rate (l/min / GPM)				
Well production (l/min / GPM)				
Disinfected? ☐ Yes ☐ No				

Map of Well Location

Please provide a map below following instructions on the back.

See Map
m.w. 1

Comments:

Well owner's information package delivered	Date Package Delivered	Ministry Use Only
	Date Work Completed	

☐ Yes ☐ No	Y Y Y Y M M D D 20140410	Audit No. Z183177 MAY 15 2014 Received



Ministry of
the Environment

Well Tag No. (Place Sticker and/or Print Below)

Tag#: A157754 A157754

Well Record

Regulation 903 Ontario Water Resources Act

Measurements recorded in: ☒ Metric ☐ Im

5-15347 Page _____ of _____

Well Owner's Information

First Name <i>Steve Saputo Dairy Products Corp</i>	Last Name / Organization <i>[Redacted]</i>	E-mail Address <i>[Redacted]</i>	☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name) <i>2365 Chemin de la Cote de Fresse St. Laurent</i>		Province <i>Que</i>	Postal Code <i>H4N</i>

Well Location

Address of Well Location (Street Number/Name) <i>861 Clyde Ave</i>	Township <i>[Redacted]</i>	Lot <i>[Redacted]</i>	Concession <i>[Redacted]</i>
County/District/Municipality <i>[Redacted]</i>	City/Town/Village <i>[Redacted]</i>	Province Ontario	Postal Code <i>[Redacted]</i>

UTM Coordinates NAD <i>83</i>	Zone <i>18</i>	Easting <i>491368</i>	Northing <i>5025003</i>	Municipal Plan and Sublot Number <i>[Redacted]</i>	Other <i>[Redacted]</i>

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	To
<i>BRN</i>	<i>Sand</i>			<i>0</i>	<i>.91</i>
<i>BRN</i>	<i>Sand</i>	<i>Trace Clay</i>		<i>-91</i>	<i>2.13</i>
<i>GRY</i>	<i>Limestone</i>			<i>2.13</i>	<i>3.35</i>

Annular Space			
Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
<i>0</i>	<i>.31</i>	<i>Concrete / Freshment</i>	
<i>.31</i>		<i>Bentonite</i>	
		<i>Sand</i>	

Method of Construction		Well Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Test Hole
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning
☐ Air percussion		☐ Industrial	
☐ Other, specify		☐ Other, specify	

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	To	
<i>5.20</i>	<i>PVC</i>	<i>.390</i>	<i>0</i>	<i>1.83</i>	☒ Test Hole
					☐ Recharge Well
					☐ Dewatering Well
					☒ Observation and/or Monitoring Hole
					☐ Alteration (Construction)
					☐ Abandoned, Insufficient Supply
					☐ Abandoned, Poor Water Quality
					☐ Abandoned, other, specify
					☐ Other, specify

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	To
<i>6.03</i>	<i>PVC</i>	<i>10</i>	<i>1.83</i>	<i>3.35</i>

Water Details		Hole Diameter	
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft) From	To
		<i>0</i>	<i>2.44</i>
		<i>2.44</i>	<i>3.35</i>

Business Name of Well Contractor <i>Strata Drilling Group</i>		Well Contractor's Licence No. <i>7241</i>
Business Address (Street Number/Name) <i>165 Shields Court</i>		Municipality <i>Markham</i>
Province <i>ON</i>	Postal Code <i>L2R8Y2</i>	Business E-mail Address <i>Worcoards@StrataSol.com</i>
Bus. Telephone No. (inc. area code) <i>905-764-9304</i>		Name of Well Technician (Last Name, First Name) <i>McLoy, Vanie</i>
Well Technician's Licence No. <i>3456</i>	Signature of Technician and/or Contractor <i>[Signature]</i>	Date Submitted <i>20140411</i>


Results of Well Yield Testing				
After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
Duration of pumping _____ hrs + _____ min	4		4	
Final water level end of pumping (m/ft)	5		5	
	10		10	
If flowing give rate (l/min / GPM)	15		15	
	20		20	
Recommended pump depth (m/ft)	25		25	
Recommended pump rate (l/min / GPM)	30		30	
	40		40	
Well production (l/min / GPM)	50		50	
Disinfected? ☐ Yes ☐ No	60		60	

Map of Well Location	
Please provide a map below following instructions on the back.	
<i>See Map</i>	
<i>MW2</i>	
Comments:	
Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered <i>20140410</i>
Date Work Completed <i>20140410</i>	Ministry Use Only Audit No <i>183176</i> <i>MAY 15 2014</i> <i>MAY 15 2014</i>

C-7211 2183176

Pinetree

MAY 15 2014

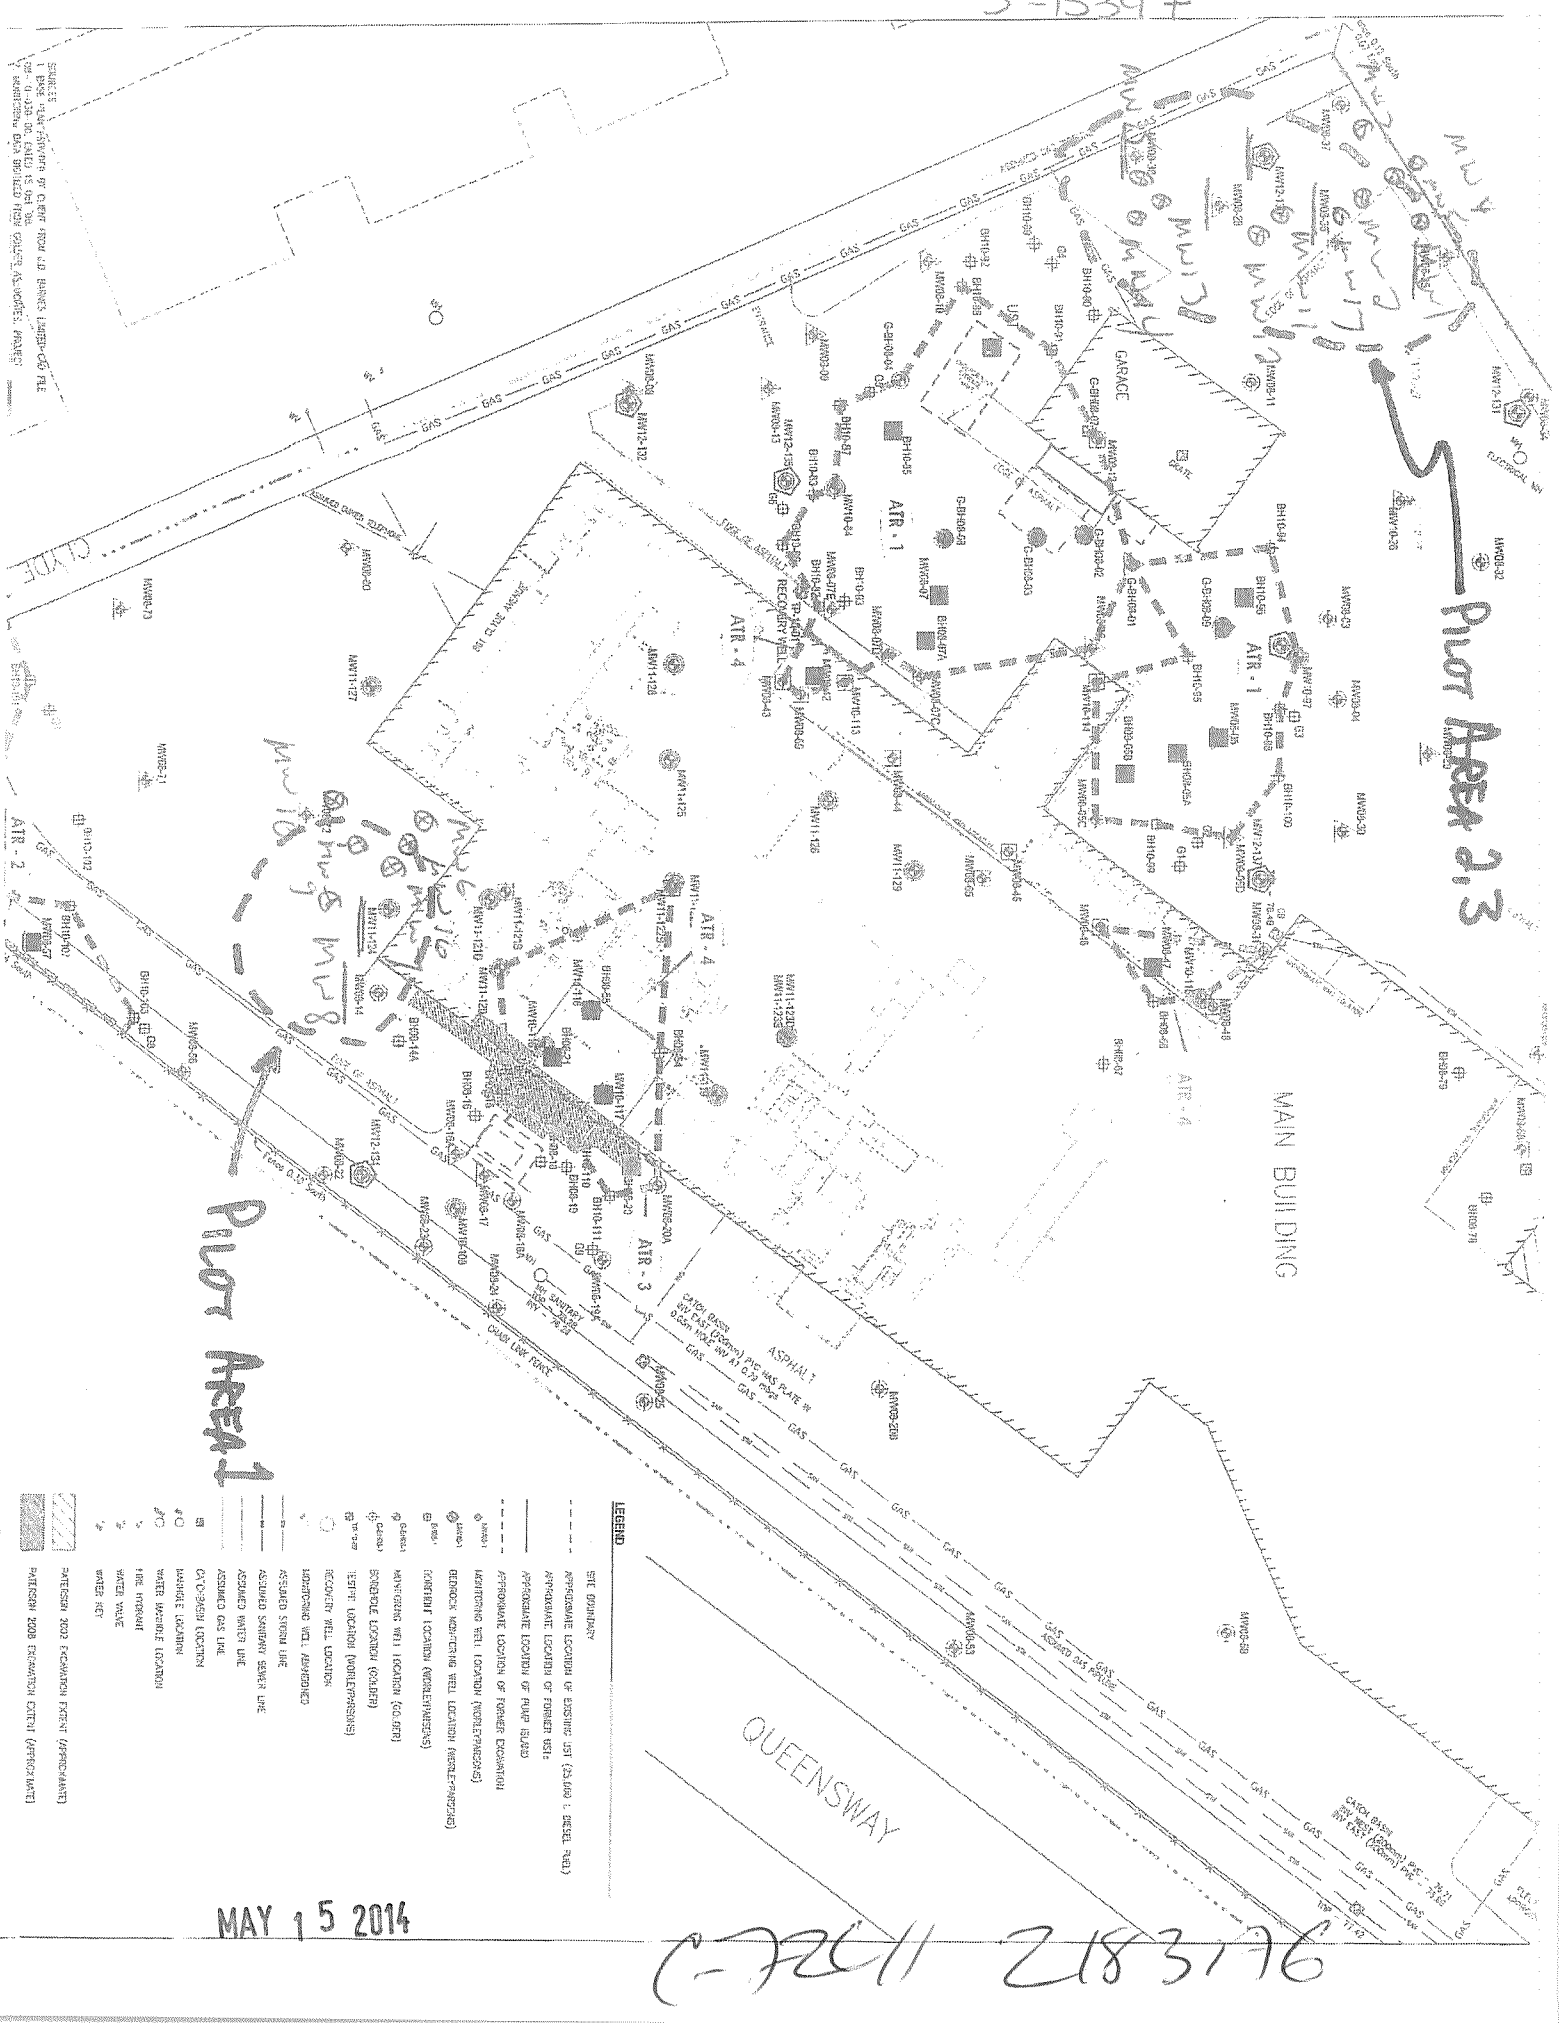

SEARCHED
1 PAGE RELEASED FROM FBI BUREAU INDEX CARD FILE
ON 11-15-60. CALLED 15 OCT 60
BY MEMPHIS. DATA OBTAINED FROM CALLED AS ABOVE. (PACED)

	SITE BOUNDARY
	APPROXIMATE LOCATION OF EXISTING JETTY (25,000 L. DEPTH) (RED)
	APPROXIMATE LOCATION OF FORMER SITE
	APPROXIMATE LOCATION OF FORMER EXTENSION
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)
	LOCATED WELL LOCATION (WELLHEADS)



Ministry of
the Environment

(Well Tag No. / Place Sticker and/or Print Below)

Tag#: A157932

A157932

Well Record

Regulation 903 Ontario Water Resources Act

Measurements recorded in: ☒ Metric ☐ Imperial

5-15347 Page of

Well Owner's Information

First Name: Sapato, Daisy Last Name / Organization: Products can E-mail Address: ☐ Well Constructed by Well Owner

Mailing Address (Street Number/Name): 2305 Chemin de la Cote de Liesse St Laurent Province: Que Postal Code: H4N 2M7

Well Location

Address of Well Location (Street Number/Name): 861 Clyde Ave Township: Ottawa Lot: Concession: Ontario Postal Code:

UTM Coordinates: Zone: 18 Easting: 441372 Northing: 5025205 Municipal Plan and Sublot Number: Other:

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)
BRN	Sand			0 .91
BRN	Sand	Trace clay		.91 2.13
GRY	Limestone			2.13 3.35

Annular Space			
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	
0 .31	Concrete/Flashmound		
.31 1.5	Bentonite		
1.5 3.35	Sand		

Method of Construction		Well Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning
☒ Air percussion		☐ Industrial	
☒ Other, specify direct push		☐ Other, specify	

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
5.20	PVC	.390	0 1.83	☐ Water Supply	
				☐ Replacement Well	
				☒ Test Hole	
				☐ Recharge Well	
				☐ Dewatering Well	
				☒ Observation and/or Monitoring Hole	
				☐ Alteration (Construction)	
				☐ Abandoned, Insufficient Supply	
				☐ Abandoned, Poor Water Quality	
				☐ Abandoned, other, specify	
				☐ Other, specify	

Construction Record - Screen			
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)
6.03	PVC	10	1.83 3.35

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft)	Diameter (cm/in)
0		0 2.44	11.43
2.44		2.44 3.35	7.62

Well Contractor and Well Technician Information			
Business Name of Well Contractor: Strata Drilling Group		Well Contractor's Licence No.: 7121411	
Business Address (Street Number/Name): 185 Shields Court		Municipality: Markham	
Province: ON	Postal Code: L2R 8V2	Business E-mail Address: wrecords@stratasol.com	
Bus. Telephone No. (inc. area code): 905 764 9304	Name of Well Technician (Last Name, First Name): McCoy, Vamir		
Well Technician's Licence No.: 3656	Signature of Technician and/or Contractor: [Signature]		Date Submitted: 2014/11/04


Results of Well Yield Testing					
After test of well yield, water was:		Draw Down		Recovery	
☐ Clear and sand free		Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
☐ Other, <i>specify</i> _____		Static Level			
If pumping discontinued, give reason: _____		1		1	
Pump intake set at (m/ft) _____		2		2	
Pumping rate (l/min / GPM) _____		3		3	
Duration of pumping _____ hrs + _____ min		4		4	
Final water level end of pumping (m/ft) _____		5		5	
If flowing give rate (l/min / GPM) _____		10		10	
Recommended pump depth (m/ft) _____		15		15	
Recommended pump rate (l/min / GPM) _____		20		20	
Well production (l/min / GPM) _____		25		25	
Disinfected?		30		30	
☐ Yes ☐ No		40		40	
		50		50	
		60		60	


Map of Well Location	
Please provide a map below following instructions on the back.	
MW3	
Comments:	
Well owner's information package delivered: ☐ Yes ☐ No	Date Package Delivered: 2014/04/10
Date Work Completed: 2014/04/10	
Ministry Use Only	
Audit No.: 2183199	
MAY 15 2014	

C-7241 203199

1557

MAY 15 2014

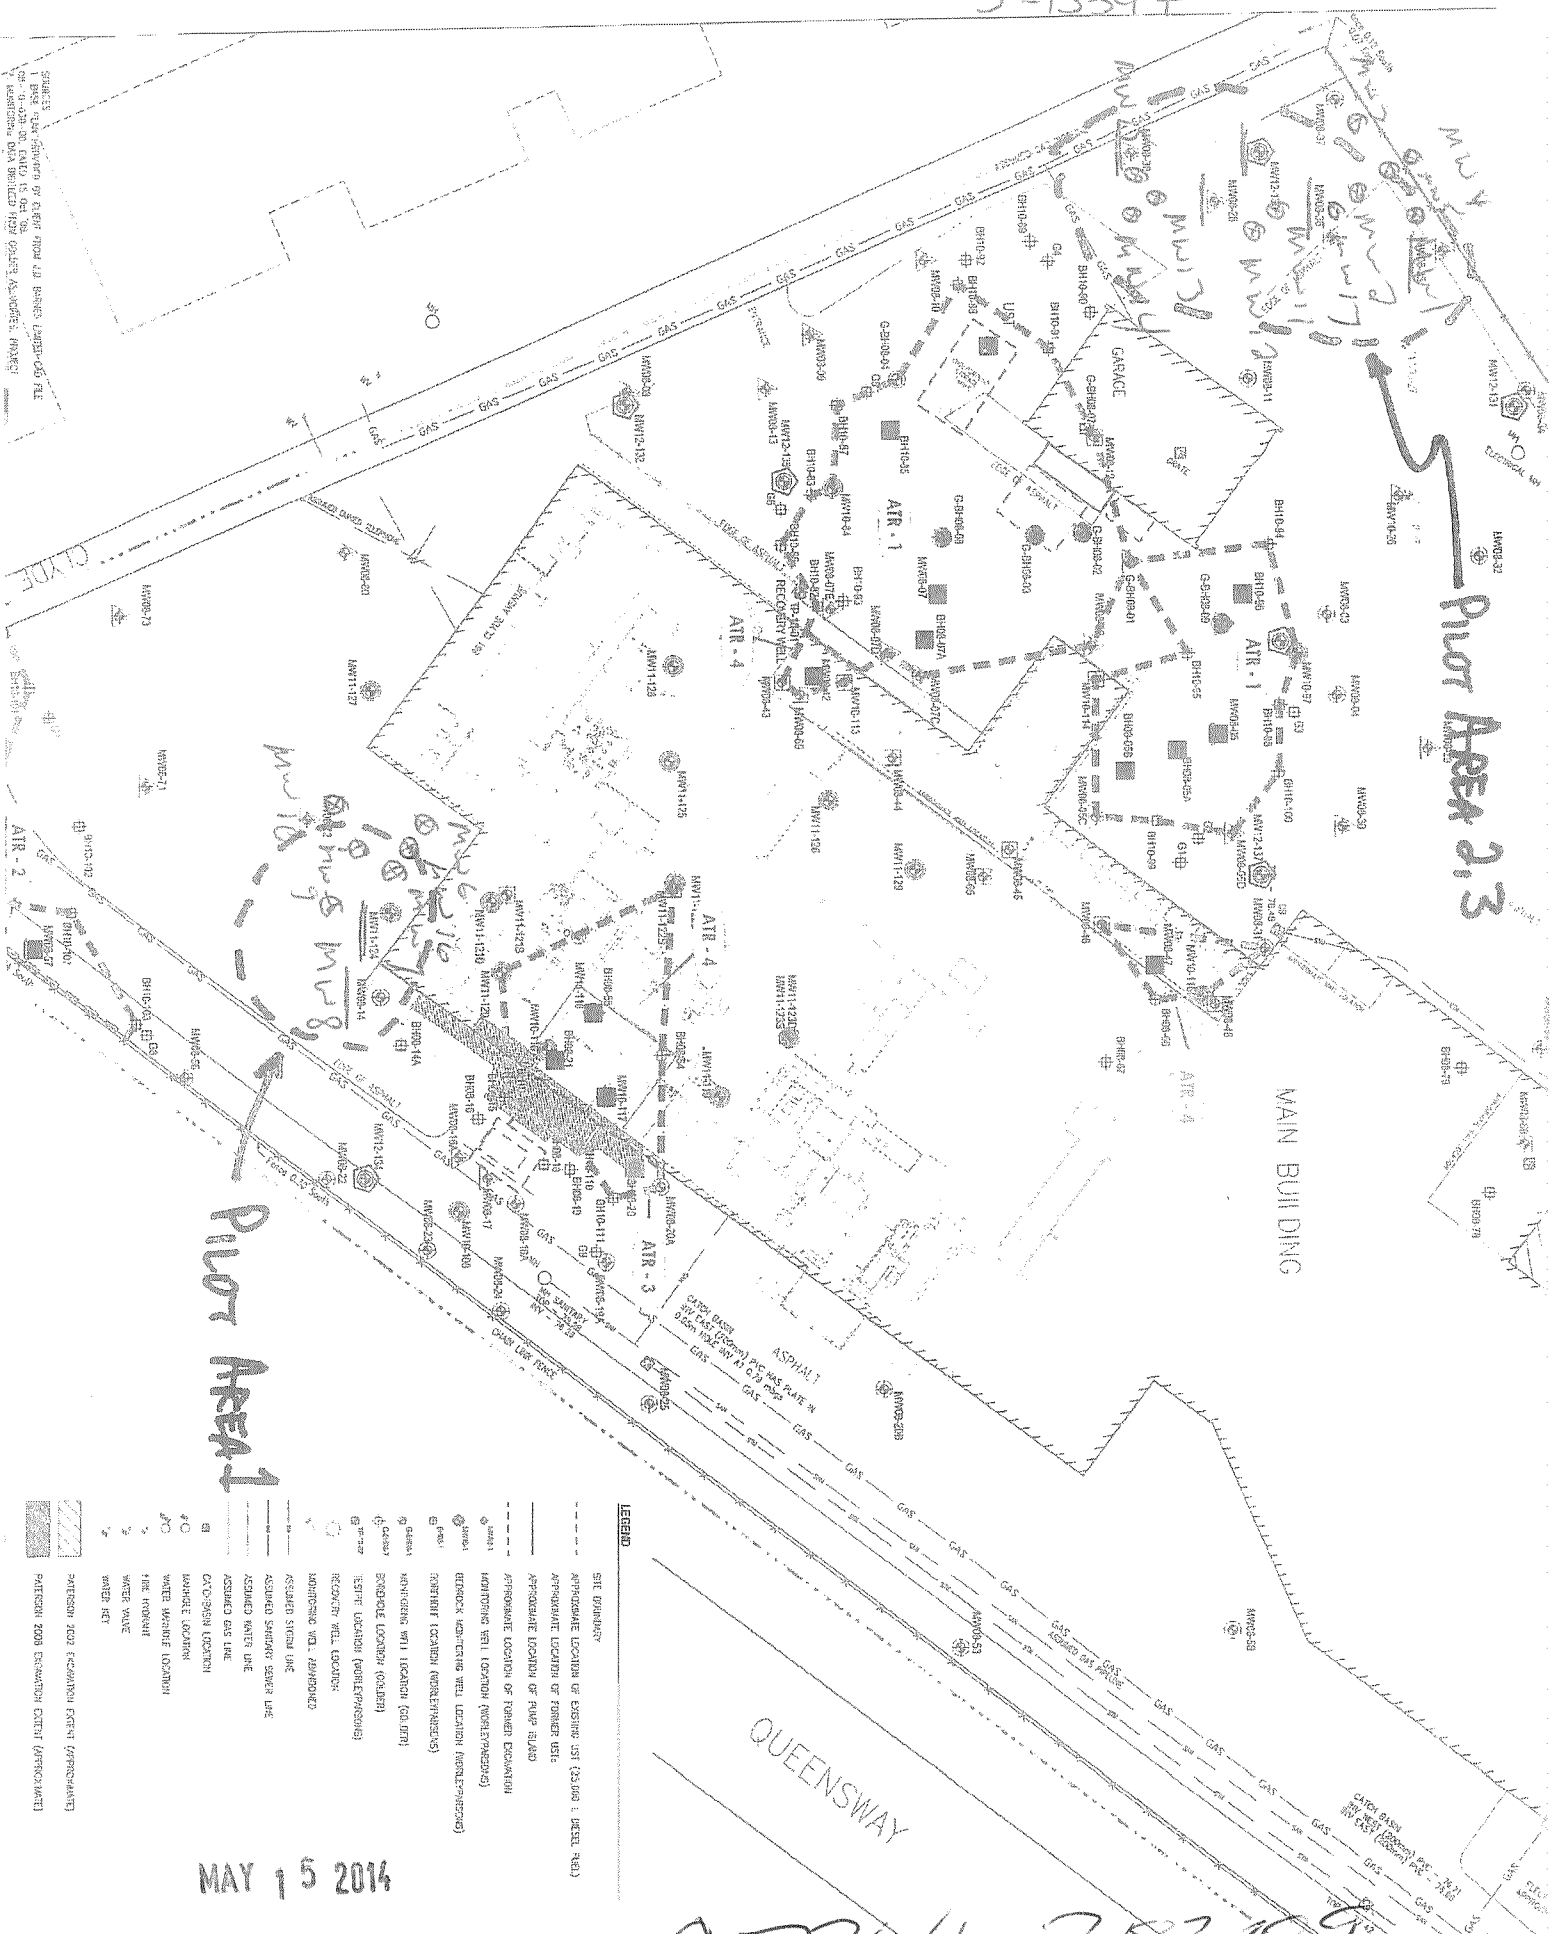[illegible]

Well Tag No. (If Blank, Enter "None") (Enter Name of Worker and/or Print Below)

A156412

Regulation 903 Ontario Water Resources Act

Measurements recorded in: ☒ Metric ☐ Imperial

5-5347 Page _____ of _____

Well Owner's Information

First Name <i>Sapate Dany</i>	Last Name / Organization <i>Products CAN</i>	E-mail Address	☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name) <i>2345 chemin de la Côte de la Pêche St-Laurent</i>		Province <i>Que</i>	Postal Code <i>H4R 2M7</i>

Well Location

Address of Well Location (Street Number/Name) <i>861 Clyde Ave</i>		Township	Lot	Concession	
County/District/Municipality		City/Town/Village <i>Ottawa</i>		Province Ontario	Postal Code
UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	
				Other	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

[illegible]

Annular Space

Depth Set at (m/ft)		Type of Sealant Used	Volume Placed (m³/ft³)
From	To	(Material and Type)	
0	.31	Concrete Flushmount	
.31	1.5	Bentonite	
1.5	3.35	Sand	

Method of Construction

- ☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☒ Air percussion
☐ Other, *specify*

Well Use

- ☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☒ Test Hole ☒ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify*

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)	
			From	To
5.20	PVC	.390	0	183

Status of Well

- ☐ Water Supply
☐ Replacement Well
☒ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify* _____
☐ Other, *specify* _____

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
1.03	PVC		183	335

Results of Well Yield Testing

After test of well yield, water was:		Draw Down		Recovery	
☐ Clear and sand free	If pumping discontinued, give reason:	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
☐ Other, <i>specify</i> _____		Static Level			
		1		1	
		2		2	
		3		3	
		4		4	
		5		5	
		10		10	
		15		15	
		20		20	
		25		25	
		30		30	
		40		40	
	50		50		
	60		60		
If pumping discontinued, give reason:					
Pump intake set at (m/ft)					
Pumping rate (l/min / GPM)					
Duration of pumping _____ hrs + _____ min					
Final water level end of pumping (m/ft)					
If flowing give rate (l/min / GPM)					
Recommended pump depth (m/ft)					
Recommended pump rate (l/min / GPM)					
Well production (l/min / GPM)					
Disinfected?					
☐ Yes ☐ No					

Map of Well Location

Please provide a map below following instructions on the back.

Water Details

Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, <i>specify</i>
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, <i>specify</i>
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, <i>specify</i>

Hole Diameter

Depth (m/ft)		Diameter (cm/in)
From	To	
0	2.44	11.43
2.44	3.35	7.62

Well Contractor and Well Technician Information

Business Name of Well Contractor		Well Contractor's Licence No.	
Strata Drilling Corp		7 2 4 1	
Business Address (Street Number/Name)		Municipality	
165 Shields Court		Markham	
Province	Postal Code	Business E-mail Address	
ON	L2R8V8	Wrecords@stratasoil.com	
Bus. Telephone No. (inc. area code)		Name of Well Technician (Last Name, First Name)	
905 764 9304		Mc Coy, Jamie	
Well Technician's Licence No.	Signature of Technician and/or Contractor		Date Submitted
3 6 5 6			20140411

Comments:

Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered Y Y Y Y M M D D 2 0 1 4 0 4 1 0	Ministry Use Only Audit No. Z 183175 MAY 15 2014 Received _____
	Date Work Completed 2 0 1 4 0 4 1 0	

[illegible][illegible]

MAY 15 2014

C-72511 Z183125

Measurements recorded in: ☒ Metric ☐ Imperial

Well Owner's Information

First Name <i>Sergio</i>	Last Name / Organization <i>Daicy Products can</i>	E-mail Address		☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name)		Province	Postal Code	

Mailing Address (Street Number/Name)	Municipality	Province	Postal Code
2365 Chemin de la Cote de Liesse	St Laurent	Que	H4N2H7

Well Location

Address of Well Location (Street Number/Name) 861 Clyde Ave	Township	Lot	Concession
County/District/Municipality	City/Town/Village	Province	Postal Code

County/District/Municipality		City/Town/Village	Province	Postal Code
		Ottawa	Ontario	
UTM Coordinates	Zone	Eastings	Northings	Municipal Plan and Sublot Number
				Other

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	441373	5025200		

Overburden and Bedrock Materials/Abandonment Sealing Record *(see instructions on the back of this form)*

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
				From	To
Brown	Sand			0	.91
Brown	Sand	Trace Clay		.91	2.13
Grey	Limestone			2.13	3.35

Annular Space

Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From	To		
0	.31	Concrete/Fluoromount	
.31	1.5	Bentonite	
1.5	3.35	Sand	

Method of Construction

☐ Cable Tool ☐ Diamond
☐ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☒ Air percussion
☐ Other, *specify* _____

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☒ Test Hole ☒ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned,
			From	To	
5.20	PVC	390	0	1.83	

Status of Well

☐ Water Supply
☐ Replacement Well
☒ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify*

☐ Other, *specify*

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
4.03	PVC	10	1.83	3.35


Water Details

Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, <i>specify</i> _____
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, <i>specify</i> _____
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, <i>specify</i> _____

Hole Diameter

Depth (m/ft)			Diameter (cm/in)
From	To		
0	2.44		11.43
2.44	3.35		7.62

Well Contractor and Well Technician Information

Business Name of Well Contractor <i>Strata Drilling Group</i>		Well Contractor's Licence No. <i>7 2 4 1</i>	
Business Address (Street Number/Name) <i>165 Shields Court</i>		Municipality <i>Markham</i>	
Province <i>ON</i>	Postal Code <i>L2A 8V2</i>	Business E-mail Address <i>Wrecords@StrataSol.com</i>	
Bus. Telephone No. (inc. area code) <i>905 764 9304</i>	Name of Well Technician (Last Name, First Name) <i>McCoy Jamie</i>		
Well Technician's Licence No. <i>3 6 5 6</i>	Signature of Technician and/or Contractor 		Date Submitted <i>20140411</i>

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
Duration of pumping _____ hrs + _____ min	4		4	
	5		5	
Final water level end of pumping (m/ft)	10		10	
If flowing give rate (l/min / GPM)	15		15	
	20		20	
Recommended pump depth (m/ft)	25		25	
	30		30	
Recommended pump rate (l/min / GPM)	40		40	
Well production (l/min / GPM)	50		50	
Disinfected? ☐ Yes ☐ No	60		60	

Map of Well Location

Please provide a map below following instructions on the back.

10-15

Comments:

Well owned information package delivered

☐ Yes

☐ No

Date Package Delivered


Date Work Completed 2/6/2022

Ministry Use Only

Audit No. **Z** 183174

MAY 15 2017

MAY 15 2014

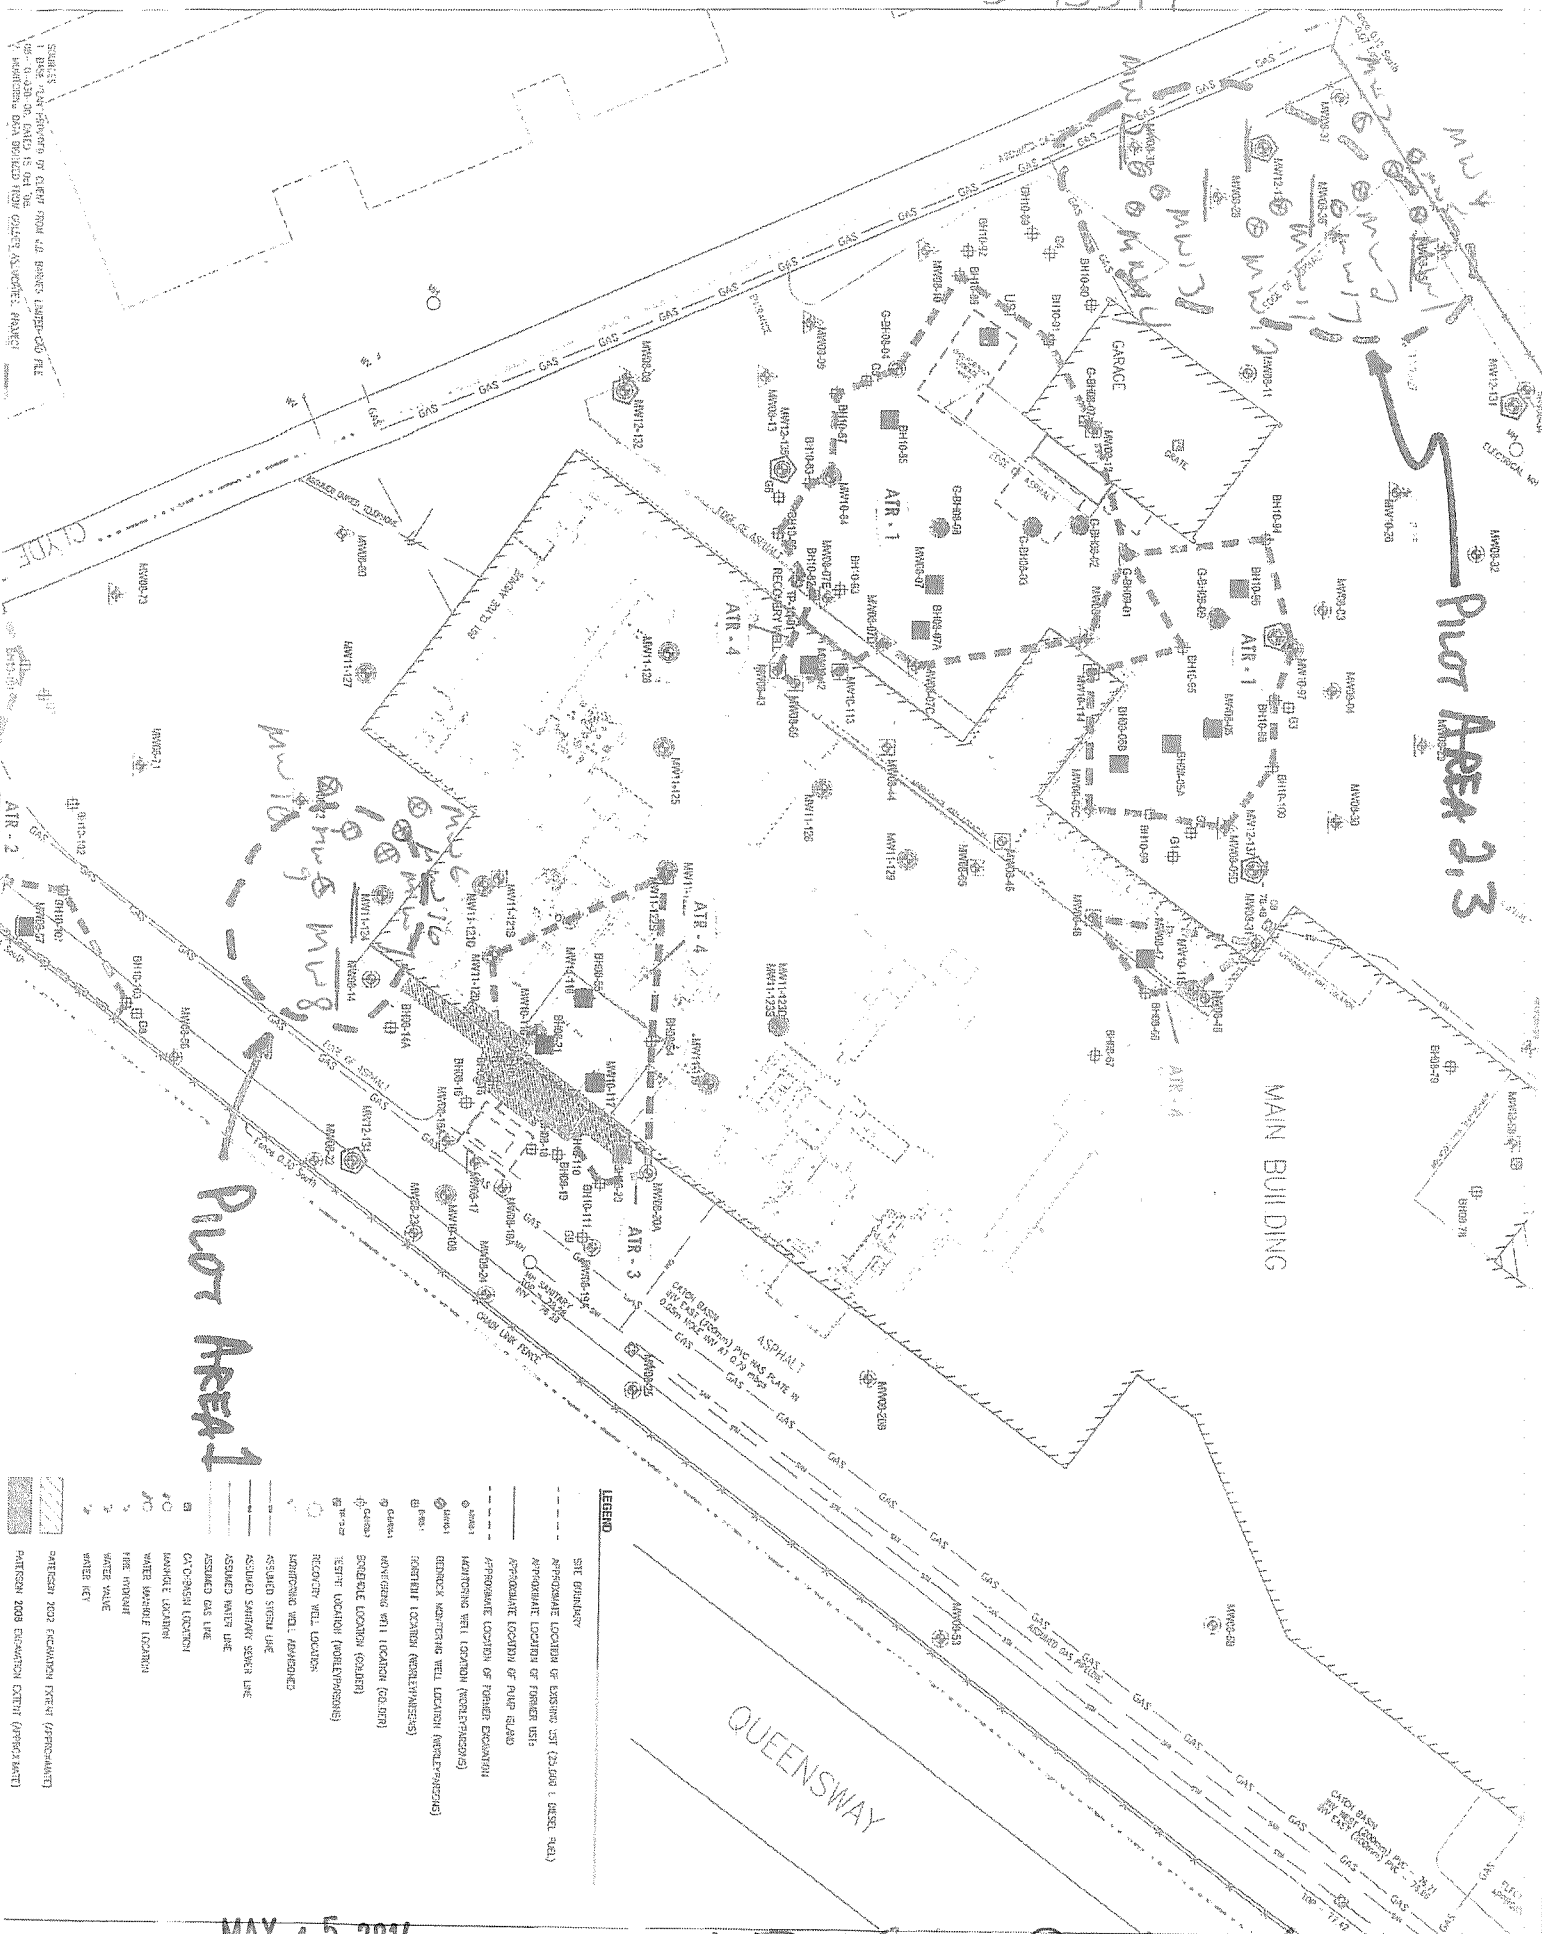



Ministry of
the Environment

Well Tag No. (Place Sticker and/or Print Below)

Tag#: A157860 A157860

Well Record

Regulation 903 Ontario Water Resources Act

Measurements recorded in: ☒ Metric ☐ Imperial

5-15347 Page of

Well Owner's Information

First Name *Saputo dairy Products* Last Name / Organization *[Redacted]* E-mail Address *[Redacted]* ☐ Well Constructed by Well Owner
Mailing Address (Street Number/Name) *2365 Chemin de la Cote de Liesse St Laurent* Municipality *Que* Province *Que* Postal Code *H4N2N7* Telephone No. (inc. area code) *[Redacted]*

Well Location

Address of Well Location (Street Number/Name) *861 Clyde Ave* Township *Ottawa* Lot *[Redacted]* Concession *[Redacted]*
County/District/Municipality *Ottawa* City/Town/Village *Ottawa* Province *Ontario* Postal Code *[Redacted]*

UTM Coordinates Zone Easting Northing *18 44 13 585925185* Municipal Plan and Sublot Number *[Redacted]* Other *[Redacted]*

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)
BRN	Fill			0 .90
BRN	Sand	Gravel		.91 2.13
GRY	Limstone			2.13 3.66

Annular Space			
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m ³ /ft ³)	
0 .31	Concrete/Flushmant		
.31 1.83	Bentonite		
1.83 3.66	Sand		

Method of Construction		Well Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Not used
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Municipal
☐ Boring	☐ Digging	☐ Irrigation	☒ Test Hole
☒ Air percussion		☐ Industrial	☒ Monitoring
☒ Other, specify <i>Hand dug</i>		☐ Other, specify	☐ Cooling & Air Conditioning

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
5.20	PVC	.390	0 2.13	☒ Test Hole	☐ Water Supply
				☐ Recharge Well	☐ Replacement Well
				☒ Observation and/or Monitoring Hole	☐ Dewatering Well
				☐ Alteration (Construction)	☐ Abandoned, Insufficient Supply
				☐ Abandoned, Poor Water Quality	☐ Abandoned, other, specify
				☐ Other, specify	

Construction Record - Screen			
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)
6.03	PVC	10	2.13 3.66

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft)	Diameter (cm/in)
0		2.74	11.43
2.74		3.66	7.62

Well Contractor and Well Technician Information
Business Name of Well Contractor *Strata Drilling Group* Well Contractor's Licence No. *7241*
Business Address (Street Number/Name) *165 Shields Court* Municipality *Markham*
Province *ON* Postal Code *K2R8V2* Business E-mail Address *wrecords@strataoil.com*
Bus. Telephone No. (inc. area code) *9052649304* Name of Well Technician (Last Name, First Name) *Mc Coy Jamie*
Well Technician's Licence No. *3650* Signature of Technician and/or Contractor *[Signature]* Date Submitted *20140411*

Results of Well Yield Testing				
After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason: 	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
Duration of pumping ____ hrs + ____ min	4		4	
Final water level end of pumping (m/ft)	5		5	
If flowing give rate (l/min / GPM)	10		10	
	15		15	
Recommended pump depth (m/ft)	20		20	
	25		25	
Recommended pump rate (l/min / GPM)	30		30	
	40		40	
Well production (l/min / GPM)	50		50	
Disinfected? ☐ Yes ☐ No	60		60	

Map of Well Location
Please provide a map below following instructions on the back.
MW10
Comments:
Well owner's information package delivered ☐ Yes ☐ No
Date Package Delivered *20140408*
Date Work Completed *20140408*
Ministry Use Only
Audit No. *184494*
Received *MAY 15 2014*

C-7211 2184494

[illegible]



Ministry of
the Environment

Well Tag#: A157755
er and/or Print Below
A157755

Well Record

Regulation 903 Ontario Water Resources Act

Measurements recorded in: ☒ Metric ☐ Imperial

5-15347 Page of

Well Owner's Information

First Name Last Name / Organization E-mail Address ☐ Well Constructed by Well Owner

Mailing Address (Street Number/Name) Municipality Province Postal Code Telephone No. (inc. area code)

Well Location

Address of Well Location (Street Number/Name) Township Lot Concession

County/District/Municipality City/Town/Village Province Ontario Postal Code

UTM Coordinates Zone Easting Northing Municipal Plan and Sublot Number Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)
BRN	Fill			0 .91
BRN	Sand	Gravel		.91 2.13
GRY	Limestone			2.13 3.66

Annular Space				Results of Well Yield Testing				
Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify _____	Draw Down		Recovery	
From	To				Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
0	.31	Concrete / Flushmount		If pumping discontinued, give reason:	Static Level			
.31	1.83	Bentonite			1		1	
1.83	3.66	Sand			2		2	
				Pump intake set at (m/ft)				

Method of Construction		Well Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning
☒ Air percussion		☐ Industrial	
☒ Other, specify		☐ Other, specify	

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)	From	To
5.20	PVC	.390	0	2.13	

☐ Water Supply	☐ Replacement Well	☒ Test Hole
☐ Recharge Well	☐ Dewatering Well	☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)	☐ Abandoned, Insufficient Supply	☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify		
☐ Other, specify		

Construction Record - Screen			
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)
6.03	PVC	19	2.13 3.66

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft)	Diameter (cm/in)
	☐ Gas ☐ Other, specify	From To	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested	0 2.74	11.43
	☐ Gas ☐ Other, specify	2.74 3.66	7.62
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested		
	☐ Gas ☐ Other, specify		

Well Contractor and Well Technician Information			
Business Name of Well Contractor		Well Contractor's Licence No.	
Stata Drilling Group		7241	
Business Address (Street Number/Name)		Municipality	
165 Shields Court		Markham	
Province	Postal Code	Business E-mail Address	
ON	L2R 8V2	wrecords@statasoil.com	
Bus. Telephone No. (inc. area code)		Name of Well Technician (Last Name, First Name)	
905 764 9304		Mc Coy JAMIE	
Well Technician's Licence No.		Signature of Technician and/or Contractor	
3656		Date Submitted	
		20140411	


Map of Well Location			
Please provide a map below following instructions on the back.			

Comments:	
m w 12	
Well owner's information package delivered	Date Package Delivered
☐ Yes ☐ No	Y Y Y Y M M D D
	Date Work Completed
	20130408
Ministry Use Only	
Audit No. Z184495	
MAY 15 2014	

~~C-7241 2184 URS~~

五五五

Post Post 2

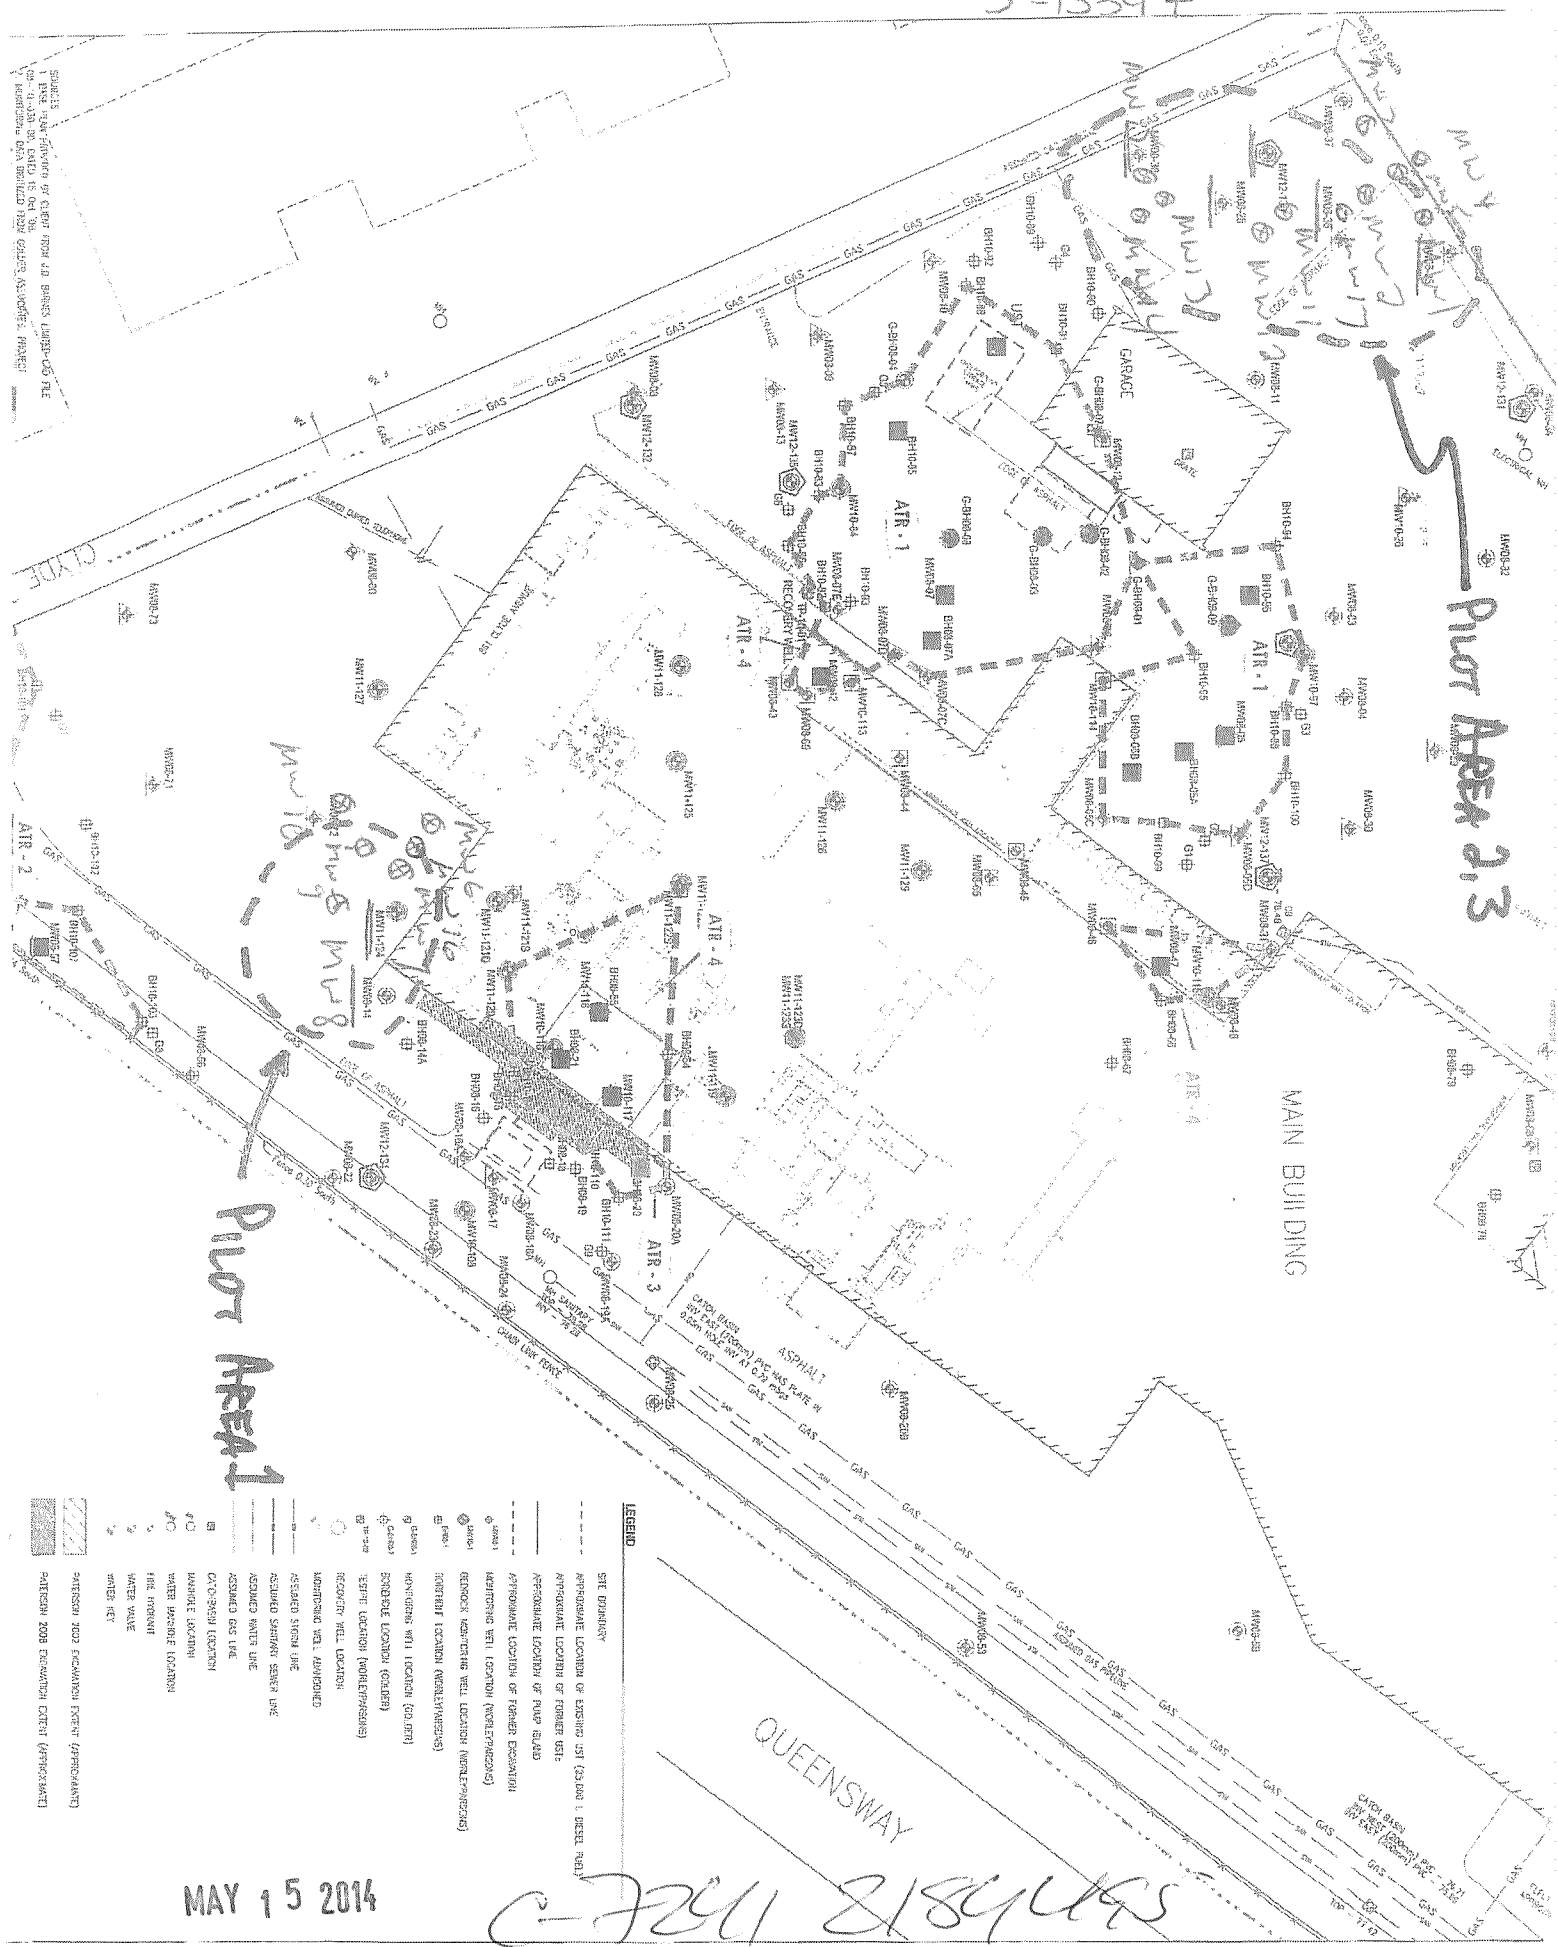

	SEWERAGE DISPOSAL
	SEWERAGE LOCATION OF EXISTING LIFT (2x DIA. L)
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED
	APPROXIMATE LOCATION OF FLOWERS USED

Measurements recorded in: ☒ Metric ☐ Imperial

165712

5-11669C

Page _____ of _____

Well Owner's Information

First Name	Last Name / Organization	E-mail Address		☐ Well Constructed by Well Owner	
	Carling Broadview Medical Holdings Ltd.				
Mailing Address (Street Number/Name)		Municipality	Province	Postal Code	Telephone No. (inc. area code)
1801 Woodward Drive		Ottawa	ON	K2C0R3	

Well Location

Address of Well Location (Street Number/Name) <i>770 Broadview</i>				Township		Lot		Concession	
County/District/Municipality				City/Town/Village <i>Ottawa</i>				Province Ontario	
								Postal Code 	
UTM Coordinates		Zone	Easting	Northing	Municipal Plan and Sublot Number				Other
NAD 83		18	440857	5025165					

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
				From	To
Bkn	Sand	Silt		0	3.1
Bkn	Silty clay			3.1	4.57
GRY	Silty clay			4.57	6.1

Annular Space

Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
From	To		
0	31	Concrete / Plasterment	
31	274	Bentonite	
274	61	Sand	

Method of Construction

☐ Cable Tool ☐ Diamond
☒ Rotary (Conventional) ☐ Jetting
☐ Rotary (Reverse) ☐ Driving
☐ Boring ☐ Digging
☐ Air percussion
☐ Other, *specify* _____

Well Use

☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☒ Test Hole ☒ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, (if in place)
			From	To	
5-20	PVC	.390	0	3.1	

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
1.03	PVC	10	3.1	6.1

☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify _____
☐ Other, specify _____

Water Details

Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____

Hole Diameter

Depth (m/ft)		Diameter (cm/in)
From	To	
0	6.1	15.32

Well Contractor and Well Technician Information


Business Name of Well Contractor <i>Strata Drilling Corp</i>		Well Contractor's Licence No. <i>7 2 4 1</i>	
Business Address (Street Number/Name) <i>165 Shreebbs Road</i>		Municipality <i>Markham</i>	
Province <i>ON</i>	Postal Code <i>L3R 5V2</i>	Business E-mail Address <i>Wrecords@StrataDrilling.com</i>	
Bus. Telephone No. (inc. area code) <i>905 764 9304</i>		Name of Well Technician (Last Name, First Name) <i>Hallackey Phil</i>	
Well Technician's Licence No. <i>3 8 3 2</i>	Signature of Technician and/or Contractor <i>PH Hallackey</i>		Date Submitted <i>2015 02 20</i>

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
Duration of pumping _____ hrs + _____ min	4		4	
Final water level end of pumping (m/ft)	5		5	
If flowing give rate (l/min / GPM)	10		10	
	15		15	
Recommended pump depth (m/ft)	20		20	
	25		25	
Recommended pump rate (l/min / GPM)	30		30	
	40		40	
Well production (l/min / GPM)	50		50	
	60		60	
Disinfected? ☐ Yes ☐ No				

Map of Well Location

Please provide a map below following instructions on the back.

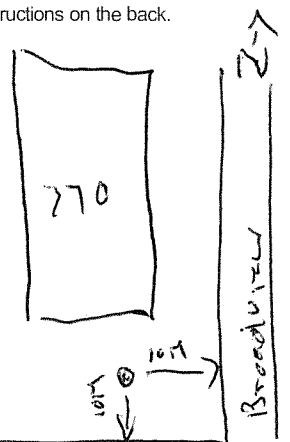

Carling Ave

Comments:

Well owner's information package delivered

Date Package Delivered

Date Work Completed

20150220

Ministry Use Only

Audit No. **Z 198114**

Received MAY 2 2015



Well Tag # _____ (Handwritten or Print Below)
 Tag #: A165711
 Serial _____ A165711

Regulation 903 Ontario Water Resources Act

Measurements recorded in: ☒ Metric ☐ Imperial

Page of

Well Owner's Information

First Name	Last Name / Organization		E-mail Address		☐ Well Constructed by Well Owner
	Carling Broadview Medical Holdings Ltd.				
Mailing Address (Street Number/Name)		Municipality	Province	Postal Code	Telephone No. (inc. area code)
1801 Woodhurst Drive		Ottawa	ON	K2C 0R3	

Well Location

Address of Well Location (Street Number/Name)	Township	Lot	Concession	
770 Broadway				
County/District/Municipality	City/Town/Village	Province	Postal Code	

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	440847	5035194		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

[illegible]

Annular Space

Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m ³ /ft ³)
From	To		
0	3.1	Concrete / Flushmount	
3.1	2.74	Bentonite	
2.74	6.1	Sand	

Method of Construction

☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☒ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☒ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☐ Air percussion		☐ Industrial		
☐ Other, <i>specify</i> _____		☐ Other, <i>specify</i> _____		

Well Use

- ☐ Public ☐ Commercial ☐ Not used
☐ Domestic ☐ Municipal ☐ Dewatering
☐ Livestock ☒ Test Hole ☒ Monitoring
☐ Irrigation ☐ Cooling & Air Conditioning
☐ Industrial
☐ Other, *specify* _____

Construction Record - Casing

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Inefficient, Small
			From	To	
520	PVC	.390	0	3.1	

Status of Well

- ☐ Water Supply
☐ Replacement Well
☒ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, *specify* _____
☐ Other, *specify* _____

Construction Record - Screen

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
1.03	PVC	10	3.1	6.1

Water Details

Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Depth (m/ft)		Diameter (cm/in)
		From	To	
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	0	6.1	15.32
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____			
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____			

Hole Diameter

Depth (m/ft)		Diameter (cm/in)
From	To	
0	6.1	15.32

Well Contractor and Well Technician Information


Business Name of Well Contractor <i>Strata Drilling Corp</i>		Well Contractor's Licence No. <i>7 2 4 1</i>	
Business Address (Street Number/Name) <i>165 Shields Court</i>		Municipality <i>Markham</i>	
Province <i>ON</i>	Postal Code <i>L3K 8V2</i>	Business E-mail Address <i>10 records@strata-soil.com</i>	
Bus. Telephone No. (inc. area code) <i>905-764-9304</i>	Name of Well Technician (Last Name, First Name) <i>Halladay Phil</i>		
Well Technician's Licence No. <i>3 8 3 2</i>	Signature of Technician and/or Contractor <i>[Signature]</i>		Date Submitted <i>2015-02-20</i>

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
	3		3	
Pumping rate (l/min / GPM)	4		4	
	5		5	
Duration of pumping _____ hrs + _____ min	10		10	
	15		15	
Final water level end of pumping (m/ft)	20		20	
	25		25	
If flowing give rate (l/min / GPM)	30		30	
	40		40	
Recommended pump depth (m/ft)	50		50	
	60		60	
Recommended pump rate (l/min / GPM)				
Well production (l/min / GPM)				
Disinfected? ☐ Yes ☐ No				

Map of Well Location

Please provide a map below following instructions on the back.

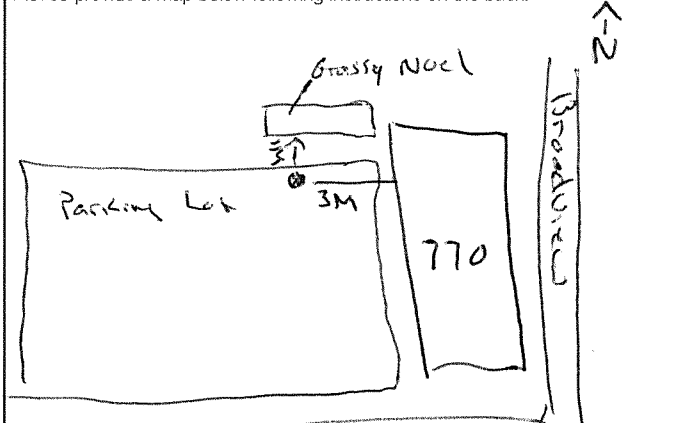

Carlberg Ave

Comments:

Well owner's information package delivered	Date Package Delivered	Ministry Use Only Audit No. Z198113 MAR 2 - 2013 Received _____
	Date Work Completed 2/21/13	

UTM 118Z 4409160E

19R 51012510110N

Elev. 19R 02510

Basin 254



ONTARIO

The Well Drillers Act

Department of Mines, Province of Ontario

15 No 7965

RECEIVED

JUL 11 1950

GEOLOGICAL BRANCH
DEPARTMENT OF MINES

Water Well Record

CARLETON CITY OF OTTAWA

County or District Con. Lot Pt. Lot

Owner Address Acres

Date Completed May 2/50 Cost of Well (not including pump)

Pipe and Casing Record

Pumping Test

Casing diameter(s)	Date May 2/50
Length(s) of casing(s)	Developed Capacity
Length of screen	Duration of Test
Type of screen	Pumping Rate 7.9 gal/min
Type of pump	Drawdown
Capacity of pump	Static level of completed well 12 feet
Depth of pump setting	Is well a gravel-wall type?

Water Record

Kind (fresh or mineral)	Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises
Quality (hard, soft, contains iron, sulphur etc.)	53	fresh	41 feet
Appearance (clear, cloudy, coloured)			
For what purpose(s) is the water to be used?			
How far is well from possible source of contamination?			
What is source of contamination?			
Enclose a copy of any mineral analysis that has been made of water			

Well Log

Drift and Bedrock Record

From

To

0 ft.


3 1/2 ft.

3 1/2

56

Location of Well

In diagram below show distances of well from road and lot line

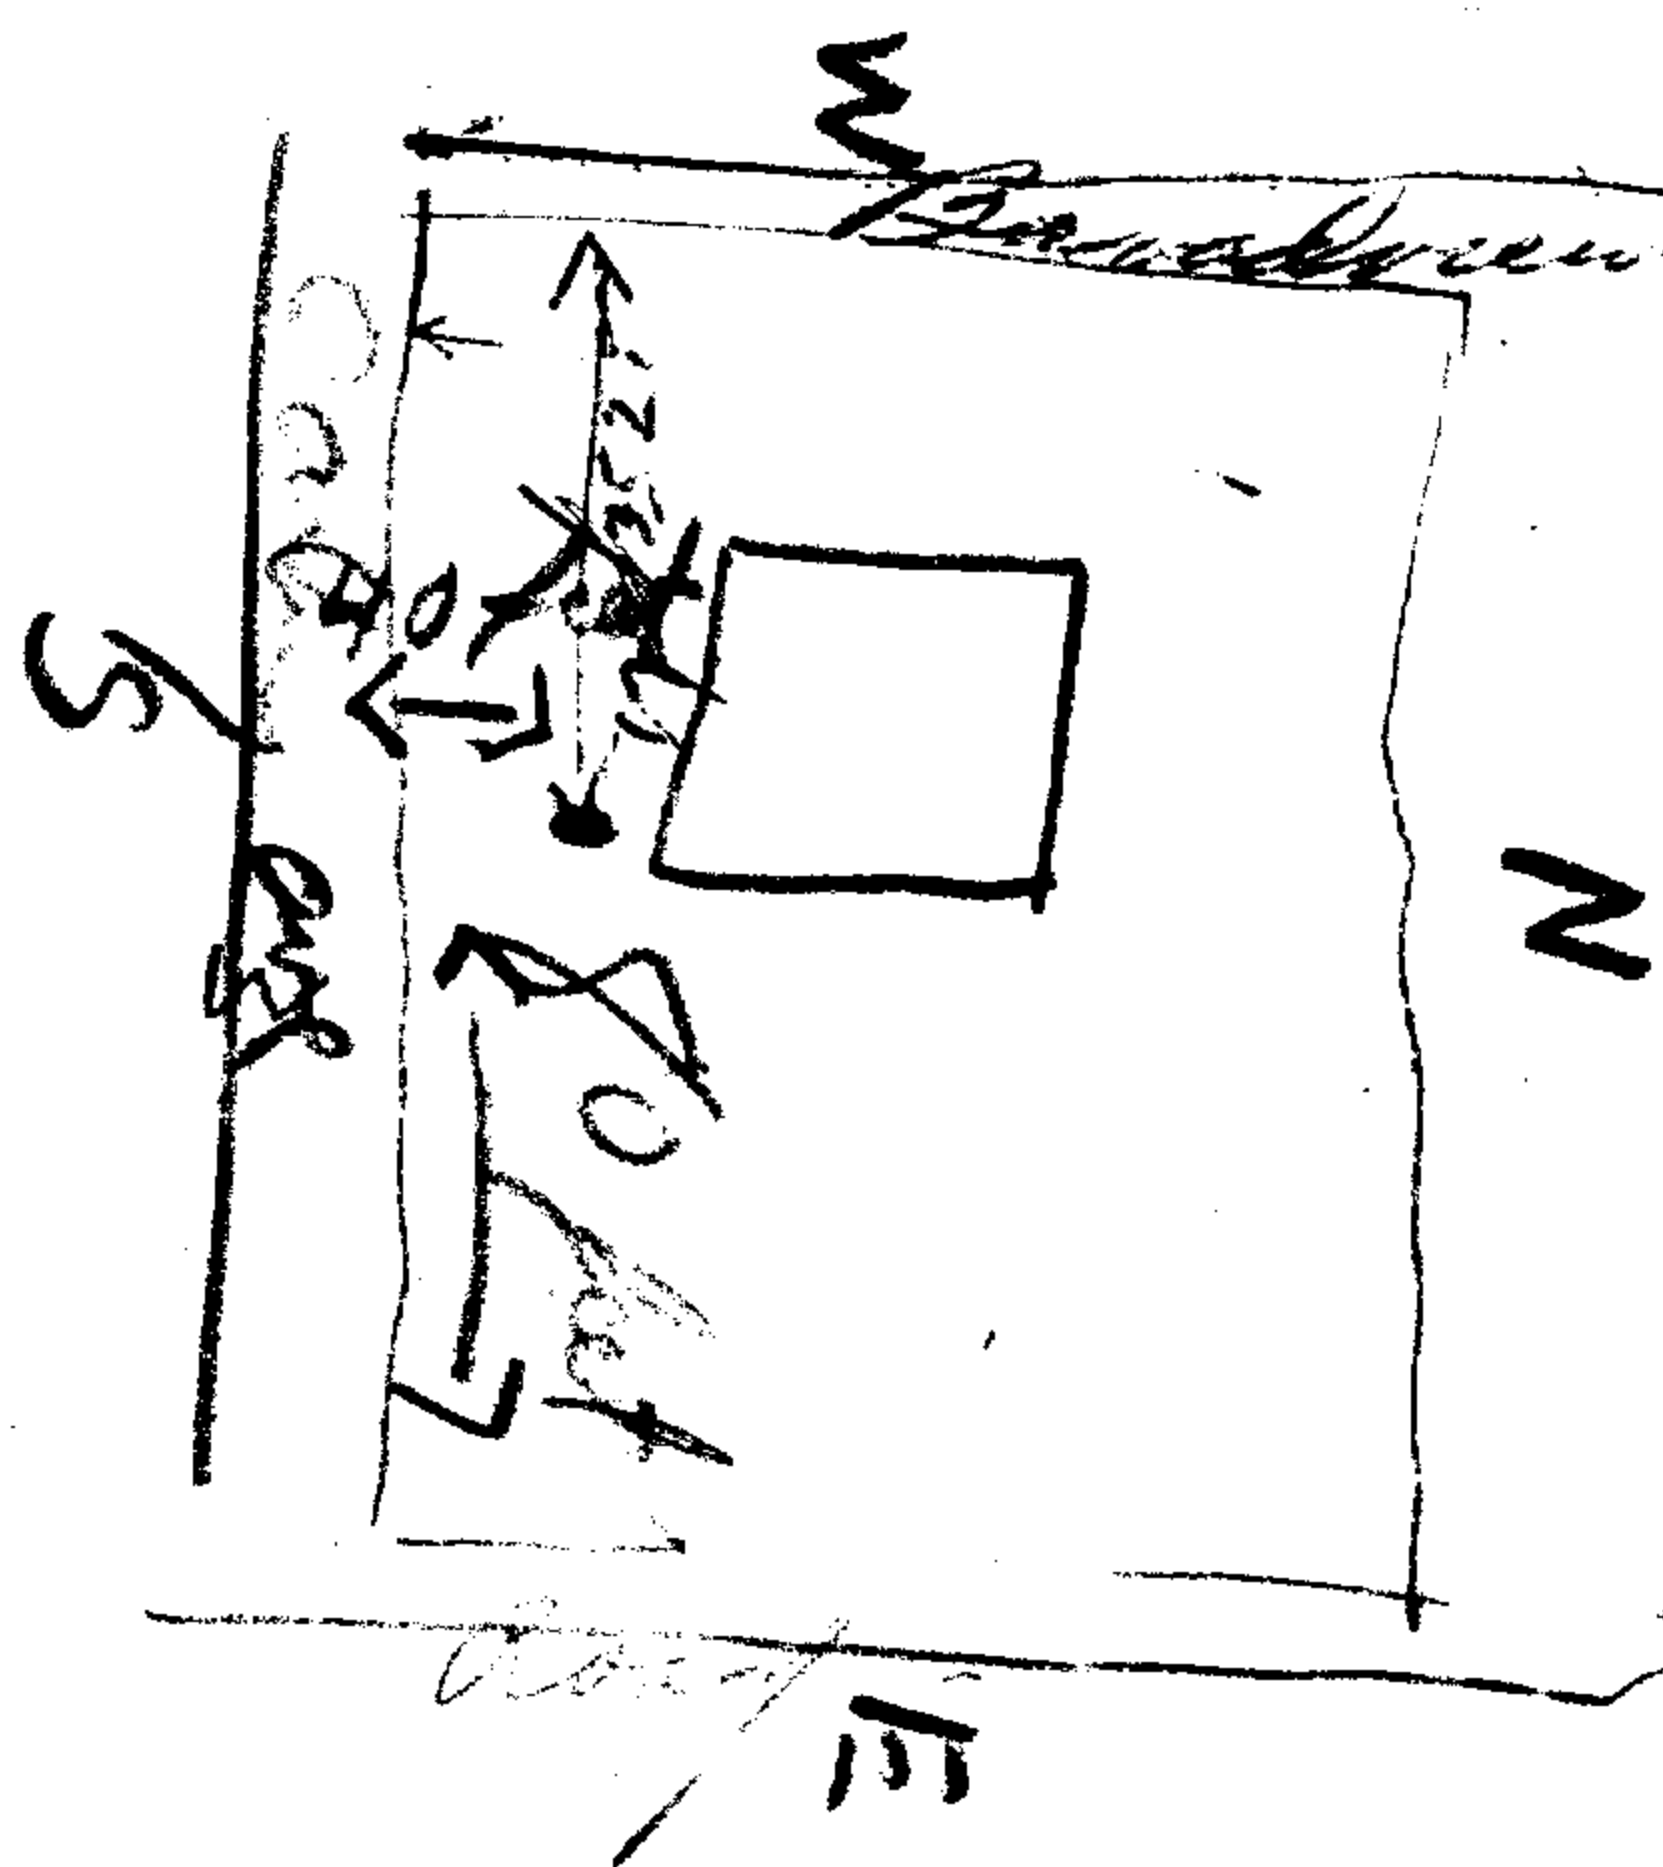

Situation: Is well on upland, in valley, or on hillside?

Drilling Firm

Address

Recorded by

Date May 2/50

Licence Number


CSS.SB

CARLING AVE.

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7240874

Well Audit Number: C16215

Well Tag Number: A175663

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441366.00 Northing: 5025144.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: C16215

Date Well Completed: March 12, 2015

Date Well Record Received by MOE: May 05, 2015


Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014



Well Record

Measurements recorded in: ☒ Metric ☐ Imperial

none Found

S-17165

Page of

First Name Saputo	Last Name / Organization	E-mail Address				☐ Well Constructed by Well Owner	
Mailing Address (Street Number/Name) 361 Clyde Ave	Municipality Ottawa	Province ON	Postal Code K1Z5A4	Telephone No. (inc. area code)			
Well Location							

Address of Well Location (Street Number/Name) 861 Clyde Ave	Township	Lot	Concession	
County/District/Municipality	City/Town/Village		Province	Postal Code

UTM Coordinates	Zone	Easting	Northing	Municipal Plan and Sublot Number	Other
NAD 83	18	441373	5025174		

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

[illegible]

Annular Space				Results of Well Yield Testing				
Depth Set at (m/ft)		Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify _____	Draw Down		Recovery	
From	To				Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
0	1.22	Benseal		If pumping discontinued, give reason:	Static Level			
1.22		Grout slurry			1		1	
					2		2	
				Pump intake set at (m/ft)	3		3	

Method of Construction		Well Use		
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☒ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole	☒ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☐ Air percussion		☐ Industrial		
☐ Other, <i>specify</i> _____		☐ Other, <i>specify</i> _____		

Construction Record - Casing					Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply
			From	To	
3.45	PK	.356	0		

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To
4.21				

Insufficient Supply


☐ Abandoned, Poor Water Quality

☒ Abandoned, other, specify

not needed

☐ Other, specify

Water Details		Hole Diameter		
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Depth (m/ft) From	To	Diameter (cm/in)
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	0		
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____			

Well Contractor and Well Technician Information			
Business Name of Well Contractor		Well Contractor's Licence No.	
Strata Drilling Group		7 2 4 1	
Business Address (Street Number/Name)		Municipality	
165 shields crt		Markham	
Province	Postal Code	Business E-mail Address	
ON	L4B1C6	wrecords@stratasoil.com	
Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)		
905 940 7919	Beatty Brian		
Well Technician's Licence No.	Signature of Technician and/or Contractor		Date Submitted
3616			20150608

After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
	3		3	
Pumping rate (l/min / GPM)	4		4	
	5		5	
Duration of pumping _____ hrs + _____ min	10		10	
	15		15	
Final water level end of pumping (m/ft)	20		20	
	25		25	
If flowing give rate (l/min / GPM)	30		30	
	40		40	
Recommended pump depth (m/ft)	50		50	
	60		60	
Recommended pump rate (l/min / GPM)				
Well production (l/min / GPM)				
Disinfected? ☐ Yes ☐ No				

Please provide a map below following instructions on the back.

A hand-drawn map on lined paper. On the left, a vertical line is labeled "Clyde Ave". To the right of this line is a small square building with a circle inside. A horizontal arrow points from the building to the left, labeled "28m". Below the building is a horizontal line segment labeled "75m". To the right of this segment is a larger rectangle labeled "861". At the bottom, a horizontal line is labeled "417". In the top right corner, there is a handwritten signature or initials.

Well owner's information package delivered	Date Package Delivered	Ministry Use Only
	Y Y Y Y M M D D	Audit No. Z 208931
☐ Yes	Date Work Completed	JUL 21 2015
☐ No	20150608	Received

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .

[Go Back to Map](#)

Well ID

Well ID Number: 7245028

Well Audit Number: Z208928

Well Tag Number:

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	861 CLYDE AVE
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441373.00 Northing: 5025174.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m		GROUT SLURY		

Method of Construction & Well Use

Method of Construction	Well Use	
	Monitoring and Test Hole	

Status of Well

Abandoned-Other

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
3.45 cm	PLASTIC			

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 6724

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z208928

Date Well Completed: June 08, 2015

Date Well Record Received by MOE: July 21, 2015

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7245028

Well Audit Number: Z208928

Well Tag Number:

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	861 CLYDE AVE
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441373.00 Northing: 5025174.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m		GROUT SLURY		

Method of Construction & Well Use

Method of Construction	Well Use	
	Monitoring and Test Hole	

Status of Well

Abandoned-Other

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
3.45 cm	PLASTIC			

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 6724

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z208928

Date Well Completed: June 08, 2015

Date Well Record Received by MOE: July 21, 2015

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014

Temperature recorded in: ☒ Metric ☐ Imperial

Well Location										Lot		Concession	
Address of Well Location (Street Number/Name)										Township			
842 Boyd Ave										Ottawa			
County/District/Municipality										City/Town/Village			
Ottawa Carleton										Ottawa			
UTM Coordinates										Municipal Plan and Sublot Number			
Zone										Other			
Easting													
Northing													
NAD 83 18 44 11 59 50 25 07 7													

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

[illegible]

Annular Space			Volume Placed (m³/ft³)
Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)	
36.57	0	Bentonite 3/4 Hole Plug (14 bags) 4 inch well	

Method of Construction		Well Use		
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Test Hole	☐ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☐ Air percussion		☐ Industrial		
☐ Other, <i>specify</i> _____		☐ Other, <i>specify</i> _____		

Construction Record - Casing					Status of Well
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
			From	To	
					☐ Water Supply
					☐ Replacement Well
					☐ Test Hole
					☐ Recharge Well
					☐ Dewatering Well
					☐ Observation and/or Monitoring Hole
					☐ Alteration (Construction)
					☐ Abandoned, Insufficient Supply

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
			From	To

☐ Abandoned, Poor Water Quality

☒ Abandoned, other, *specify* _____

☐ Other, *specify* _____

Indicate Supply

Water Details		Hole Diameter	
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____	Depth (m/ft) From	Diameter (cm/in) To
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____		
Water found at Depth (m/ft) ☐ Gas	Kind of Water: ☐ Fresh ☐ Untested ☐ Other, specify _____		

Well Contractor and Well Technician Information									
Business Name of Well Contractor						Well Contractor's Licence No.			
Capital Water Supply Ltd.						1 5 5 8			
Business Address (Street Number/Name)						Municipality			
P.O. Box 490						Stittsville			
Province		Postal Code		Business E-mail Address					
Ontario		K 2 S 1 A6		office@capitalwater.ca					
Bus. Telephone No. (inc. area code)				Name of Well Technician (Last Name, First Name)					
613 8 3 6 1 7 6 6				Miller Stephen					
Well Technician's Licence No.		Signature of Technician and/or Contractor				Date Submitted			
0 0 9 7						2 0 1 5 1 2 23			

Results of Well Yield Testing

After test of well yield, water was: ☐ Clear and sand free ☐ Other, <i>specify</i> _____	Draw Down		Recovery	
	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:	Static Level			
	1		1	
Pump intake set at (m/ft)	2		2	
Pumping rate (l/min / GPM)	3		3	
	4		4	
Duration of pumping _____ hrs + _____ min	5		5	
Final water level end of pumping (m/ft)	10		10	
	15		15	
If flowing give rate (l/min / GPM)	20		20	
	25		25	
Recommended pump depth (m/ft)	30		30	
	40		40	
Recommended pump rate (l/min / GPM)	50		50	
	60		60	
Well production (l/min / GPM)				
Disinfected? ☒ Yes ☐ No				

Map of Well Location

Please provide a map below following instructions on the back.

Boyd Ave

Kerr Ave

#842

← N

Comments:

Well owner's information package delivered ☐ Yes ☒ No	Date Package Delivered Y Y Y Y M M D D 2 0 1 5 1 2 2 3	Ministry Use Only Audit No. Z188421 AUG 29 2016 Received _____
	Date Work Completed Y Y Y Y M M D D 2 0 1 5 1 2 2 3	

HONEY CONSTRUCTION LTD.

Address of Well Location (Street Number/Name) 897 Boyd Ave		Township	Lot	Concession	
County/District/Municipality		City/Town/Village Oshawa	Province Ontario	Postal Code	
UTM Coordinates Zone Easting Northing NAD 83 18 49 12 78 50 24 94 13		Municipal Plan and Sublot Number		Other	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
BLK	asphalt	gravel	dense	0	3.1
BRN	sand	gravel	loose	3.1	8.13
GRY	limestone	shale	layered	2.13	13.72

Annular Space			Results of Well Yield Testing				
Depth Set at (m/ft) From To 0 3.1 3.1 10.06 10.06 13.72	Type of Sealant Used (Material and Type) concrete/flush mount butonite filter sand	Volume Placed (m³/ft³)	After test of well yield, water was: ☐ Clear and sand free ☐ Other, specify	Draw Down		Recovery	
			If pumping discontinued, give reason: Pump intake set at (m/ft) Pumping rate (l/min / GPM) Duration of pumping hrs + min Final water level end of pumping (m/ft) If flowing give rate (l/min / GPM) Recommended pump depth (m/ft) Recommended pump rate (l/min / GPM) Well production (l/min / GPM) Disinfected? ☐ Yes ☐ No	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
				Static Level			
				1		1	
				2		2	
				3		3	
				4		4	
				5		5	
				10		10	
				15		15	
				20		20	
				25		25	
				30		30	
				40		40	
				50		50	
				60		60	

Method of Construction				Well Use		
☐ Cable Tool ☐ Rotary (Conventional) ☐ Rotary (Reverse) ☐ Boring ☒ Air percussion ☐ Other, specify	☐ Diamond ☐ Jetting ☐ Driving ☐ Digging	☐ Public ☐ Domestic ☐ Livestock ☐ Irrigation ☐ Industrial ☐ Other, specify	☐ Commercial ☐ Municipal ☐ Test Hole ☐ Cooling & Air Conditioning	☐ Not used ☐ Dewatering ☒ Monitoring		
Construction Record - Casing				Status of Well		
Inside Diameter (cm/in) 4.03	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel) PVC	Wall Thickness (cm/in) .368	Depth (m/ft) From To 0 10.67	☐ Water Supply ☐ Replacement Well ☒ Test Hole ☐ Recharge Well ☐ Dewatering Well ☒ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☐ Abandoned, other, specify ☐ Other, specify		
Construction Record - Screen						
Outside Diameter (cm/in) 4.92	Material (Plastic, Galvanized, Steel) PVC	Slot No. 10	Depth (m/ft) From To 10.67 13.72			

Water Details		Hole Diameter	
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft) From To 0 2.47 2.47 13.72	Diameter (cm/in) 11.43 7.62
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested		
Water found at Depth (m/ft) ☐ Gas ☐ Other, specify	Kind of Water: ☐ Fresh ☐ Untested		

Well Contractor and Well Technician Information			
Business Name of Well Contractor Strata Drilling Group	Well Contractor's Licence No. 72411		
Business Address (Street Number/Name) 165 Shields Court	Municipality Markham		
Province ON	Postal Code L3R 9V2	Business E-mail Address wreco@strataoil.com	
Bus. Telephone No. (inc. area code) 905 940 7919	Name of Well Technician (Last Name, First Name) McLoughlin, JAMES		
Well Technician's Licence No. 3656	Signature of Technician and/or Contractor	Date Submitted 20171222	

Comments:

Well owner's information package delivered
☐ Yes
☐ No

Date Package Delivered
Y Y Y Y M M D D
20171218

Date Work Completed
20171218


Ministry Use Only

Audit No. 2268097

FFR 13 2018

Received

S-21259

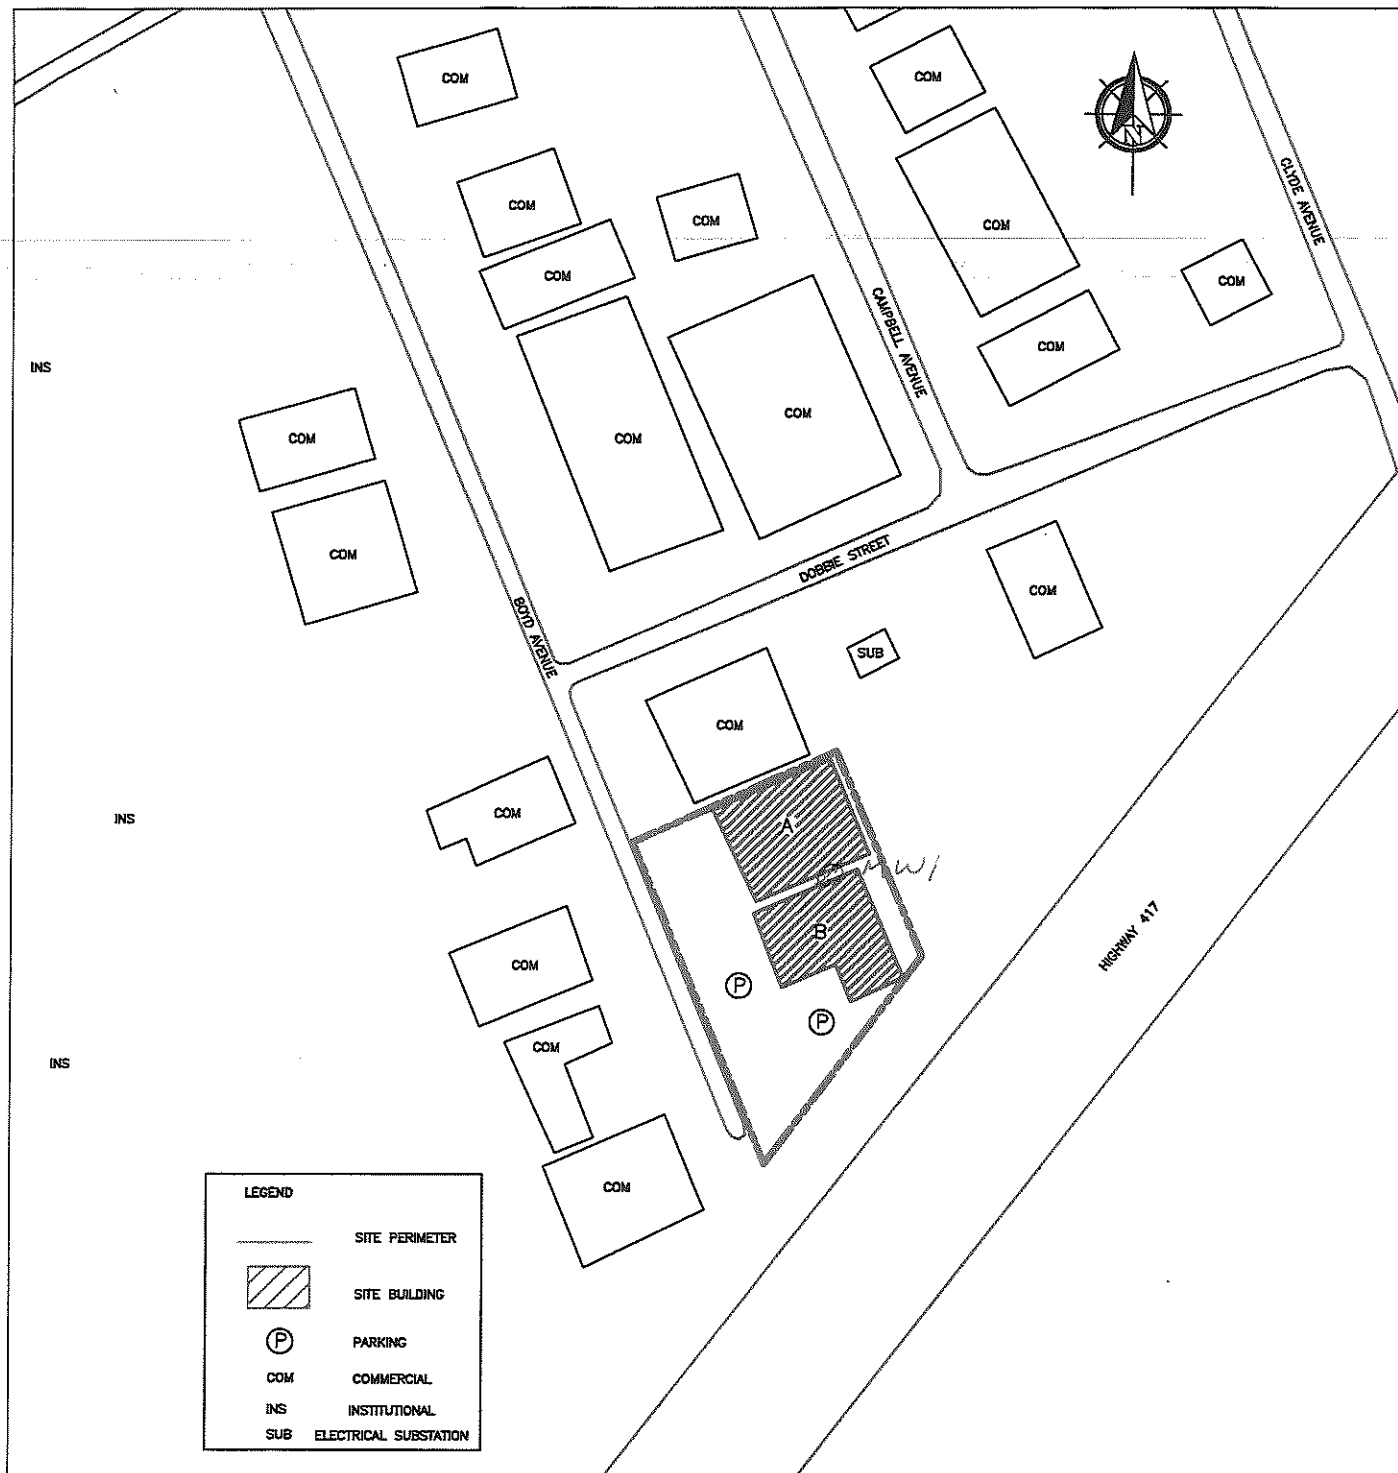

	PROJECT NAME		
	PHASE I ENVIRONMENTAL SITE ASSESSMENT		
	CLIENT NAME		
	HUNTINGTON CAPITAL CORPORATION		
	PROJECT LOCATION		
833 AND 891 BOYD AVENUE, OTTAWA, ONTARIO			
DRAWING NAME			
SITE AND SURROUNDING LAND USE PLAN			
DRAWING NO.			
FIG. 2			
SCALE	PROJECT NO.	DATE	
NTS	56721	JANUARY 2010	

FEB 13 2018


C-7241

2268097

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7306421

Well Audit Number: C34350

Well Tag Number: A149854

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 440969.00 Northing: 5025127.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 6964

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: C34350

Date Well Completed: July 27, 2017

Date Well Record Received by MOE: February 26, 2018


Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014



Page _____ of _____

All measurements recorded in: ☒ Metric ☐ Imperial

Follow instructions on the front and back of this form. Print or Type

Well Tag No. of Deepest Well: (Print Well Tag No.)

A183 838

Well # on Drawing of Deepest Well: B42

Well Cluster Location Information

Address of Well Location (Street Number(s)/Name(s), RR, if available)

863 CAMPBELL AVENUE

City, Town, Village or Hamlet

OTTAWA

Lot(s)	Area (sq. ft.)	Area (acres)	Use	Owner	Assessor's Parcel Number
1	10,000	0.23	Residential	John Doe	123456789
2	20,000	0.46	Commercial	Jane Smith	987654321
3	5,000	0.11	Industrial	ABC Corp	567890123
4	15,000	0.34	Residential	XYZ Inc	345678901
5	30,000	0.69	Commercial	DEF LLC	234567890
6	40,000	0.92	Industrial	GHI LLC	012345678
7	25,000	0.58	Residential	JKL LLC	890123456
8	18,000	0.41	Commercial	MNO LLC	789012345
9	12,000	0.28	Industrial	PQR LLC	678901234
10	8,000	0.18	Residential	STU LLC	567890123

Ontario

Concession(s)

GIR

Geographic Township

Model

Unit Mode of Operation

☐ Undifferentiated☐ Averaged☐ Differentiated, specify:

Well Details

[illegible]

Well Contractor and Well Technician Information

Business Name of Well Contractor		Business Address (Street Number/Name, RR)		Municipality	Province
EASTERN ONTARIO DIAMOND DRILLING		3180 County Road 17, P.O. Box 33		HANKESTOWN	ON
Postal Code	Bus. Telephone No.	Well Contractor's Licence No.	Business E-mail Address		
K1G 1A1	(613) 632-7769	7328	eadd@firedowningsdrilling.com		
Name of Well Technician (First Name, Last Name)		Well Technician's Licence No.	Signature of Well Technician	Date Submitted (yyyy/mm/dd)	
STEPHEN DOWNING		3326		2018/04/24	

Date First Well in Cluster Constructed
or Abandoned (yyyy/mm/dd)

2017/11/28

Date Last Well in Cluster Completed (yyyy/mm/dd)

2017/AL/28

Ministry Use Only

Date Received (yyyy/mm/dd)	Audit No.
MAY 25 2018	C 30132

Well Abandonment

Person Abandoning the Wells:


Name	Age	Gender	Occupation	Education	Marital Status	Income	Health Status	Smoking Status	Alcohol Consumption	Exercise Frequency	Dietary Habits	Stress Level	Sleep Pattern	Mental Health	Family Size	Work-Life Balance	Community Involvement	Life Satisfaction
John Doe	35	Male	Software Engineer	Bachelor's	Married	\$75,000	Good	Smoker	Occasional	Regular	Vegetarian	High	Regular	Stable	3	Good	Active	High
Jane Smith	28	Female	Marketing Manager	Master's	Single	\$60,000	Good	Non-Smoker	Occasional	Regular	Non-Vegetarian	Medium	Regular	Stable	1	Good	Active	High
Michael Johnson	42	Male	Teacher	Bachelor's	Married	\$50,000	Fair	Smoker	Occasional	Regular	Non-Vegetarian	High	Irregular	Stable	2	Fair	Active	Medium
Emily Davis	31	Female	Graphic Designer	Bachelor's	Single	\$45,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	1	Good	Active	High
David Wilson	55	Male	Retired	High School	Married	\$30,000	Fair	Smoker	Occasional	Regular	Non-Vegetarian	High	Irregular	Stable	3	Fair	Active	Medium
Sarah Brown	25	Female	Student	Bachelor's	Single	\$15,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	1	Good	Active	High
Robert Taylor	60	Male	Business Owner	Master's	Married	\$90,000	Good	Smoker	Occasional	Regular	Non-Vegetarian	High	Regular	Stable	2	Good	Active	High
Lisa Anderson	38	Female	Healthcare Worker	Bachelor's	Married	\$55,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	2	Good	Active	High
Christopher Lee	48	Male	Sales Representative	Bachelor's	Married	\$65,000	Fair	Smoker	Occasional	Regular	Non-Vegetarian	High	Regular	Stable	2	Fair	Active	Medium
Amanda White	22	Female	Freelance Writer	Bachelor's	Single	\$35,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	1	Good	Active	High
James Garcia	52	Male	Construction Worker	High School	Married	\$40,000	Fair	Smoker	Occasional	Regular	Non-Vegetarian	High	Irregular	Stable	3	Fair	Active	Medium
Michelle Martinez	33	Female	Event Planner	Master's	Single	\$50,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	1	Good	Active	High
Kevin Hall	45	Male	IT Support	Bachelor's	Married	\$55,000	Fair	Smoker	Occasional	Regular	Non-Vegetarian	High	Regular	Stable	2	Fair	Active	Medium
Nicole King	27	Female	Project Manager	Master's	Single	\$60,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	1	Good	Active	High
Brandon Scott	37	Male	Operations Manager	Bachelor's	Married	\$70,000	Fair	Smoker	Occasional	Regular	Non-Vegetarian	High	Regular	Stable	2	Fair	Active	Medium
Stephanie Adams	29	Female	Human Resources	Bachelor's	Single	\$50,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	1	Good	Active	High
Gregory Baker	58	Male	Financial Analyst	Master's	Married	\$80,000	Fair	Smoker	Occasional	Regular	Non-Vegetarian	High	Regular	Stable	2	Fair	Active	Medium
Heather Clark	32	Female	Product Designer	Bachelor's	Single	\$55,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	1	Good	Active	High
Timothy Evans	41	Male	Quality Assurance	Bachelor's	Married	\$60,000	Fair	Smoker	Occasional	Regular	Non-Vegetarian	High	Regular	Stable	2	Fair	Active	Medium
Christina Fisher	26	Female	UX Designer	Bachelor's	Single	\$50,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	1	Good	Active	High
Jonathan Green	50	Male	Systems Administrator	Bachelor's	Married	\$65,000	Fair	Smoker	Occasional	Regular	Non-Vegetarian	High	Regular	Stable	2	Fair	Active	Medium
Victoria Hill	30	Female	Business Development	Master's	Single	\$60,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	1	Good	Active	High
Benjamin King	44	Male	Operations Manager	Bachelor's	Married	\$70,000	Fair	Smoker	Occasional	Regular	Non-Vegetarian	High	Regular	Stable	2	Fair	Active	Medium
Rebecca King	24	Female	Marketing Assistant	Bachelor's	Single	\$30,000	Good	Non-Smoker	Occasional	Regular	Vegetarian	Medium	Regular	Stable	1	Good	Active	High
Christopher King	56	Male	Business Owner	Master's	Married	\$90,000	Good	Smoker	Occasional	Regular	Non-Vegetarian	High	Regular	Stable	2	Good	Active	High

(Print or Type) - See instruction 11 on the back of this form

Comments:

Note: This Well Record for Well Cluster Part 3 - Detailed Drawing of all Well Locations, must be attached to Parts 1 and 2. The drawing must include all property boundaries, an arrow indicating the North direction, all named roads and sufficient measurements to locate all wells in the cluster in relation to fixed points. The drawing must show the location of each well and each well must be numbered on the drawing to match number used for that well on the Well Record for Well Cluster Parts 1 and 2. The well with the well tag must be clearly identified on the Drawing.
UTM coordinates should appear beside each well, if space permits. Additional comments on wells can be included on the drawing


Well Tag Number: # A183838
"Well Record for Well Cluster" Form Audit Number: # C30132

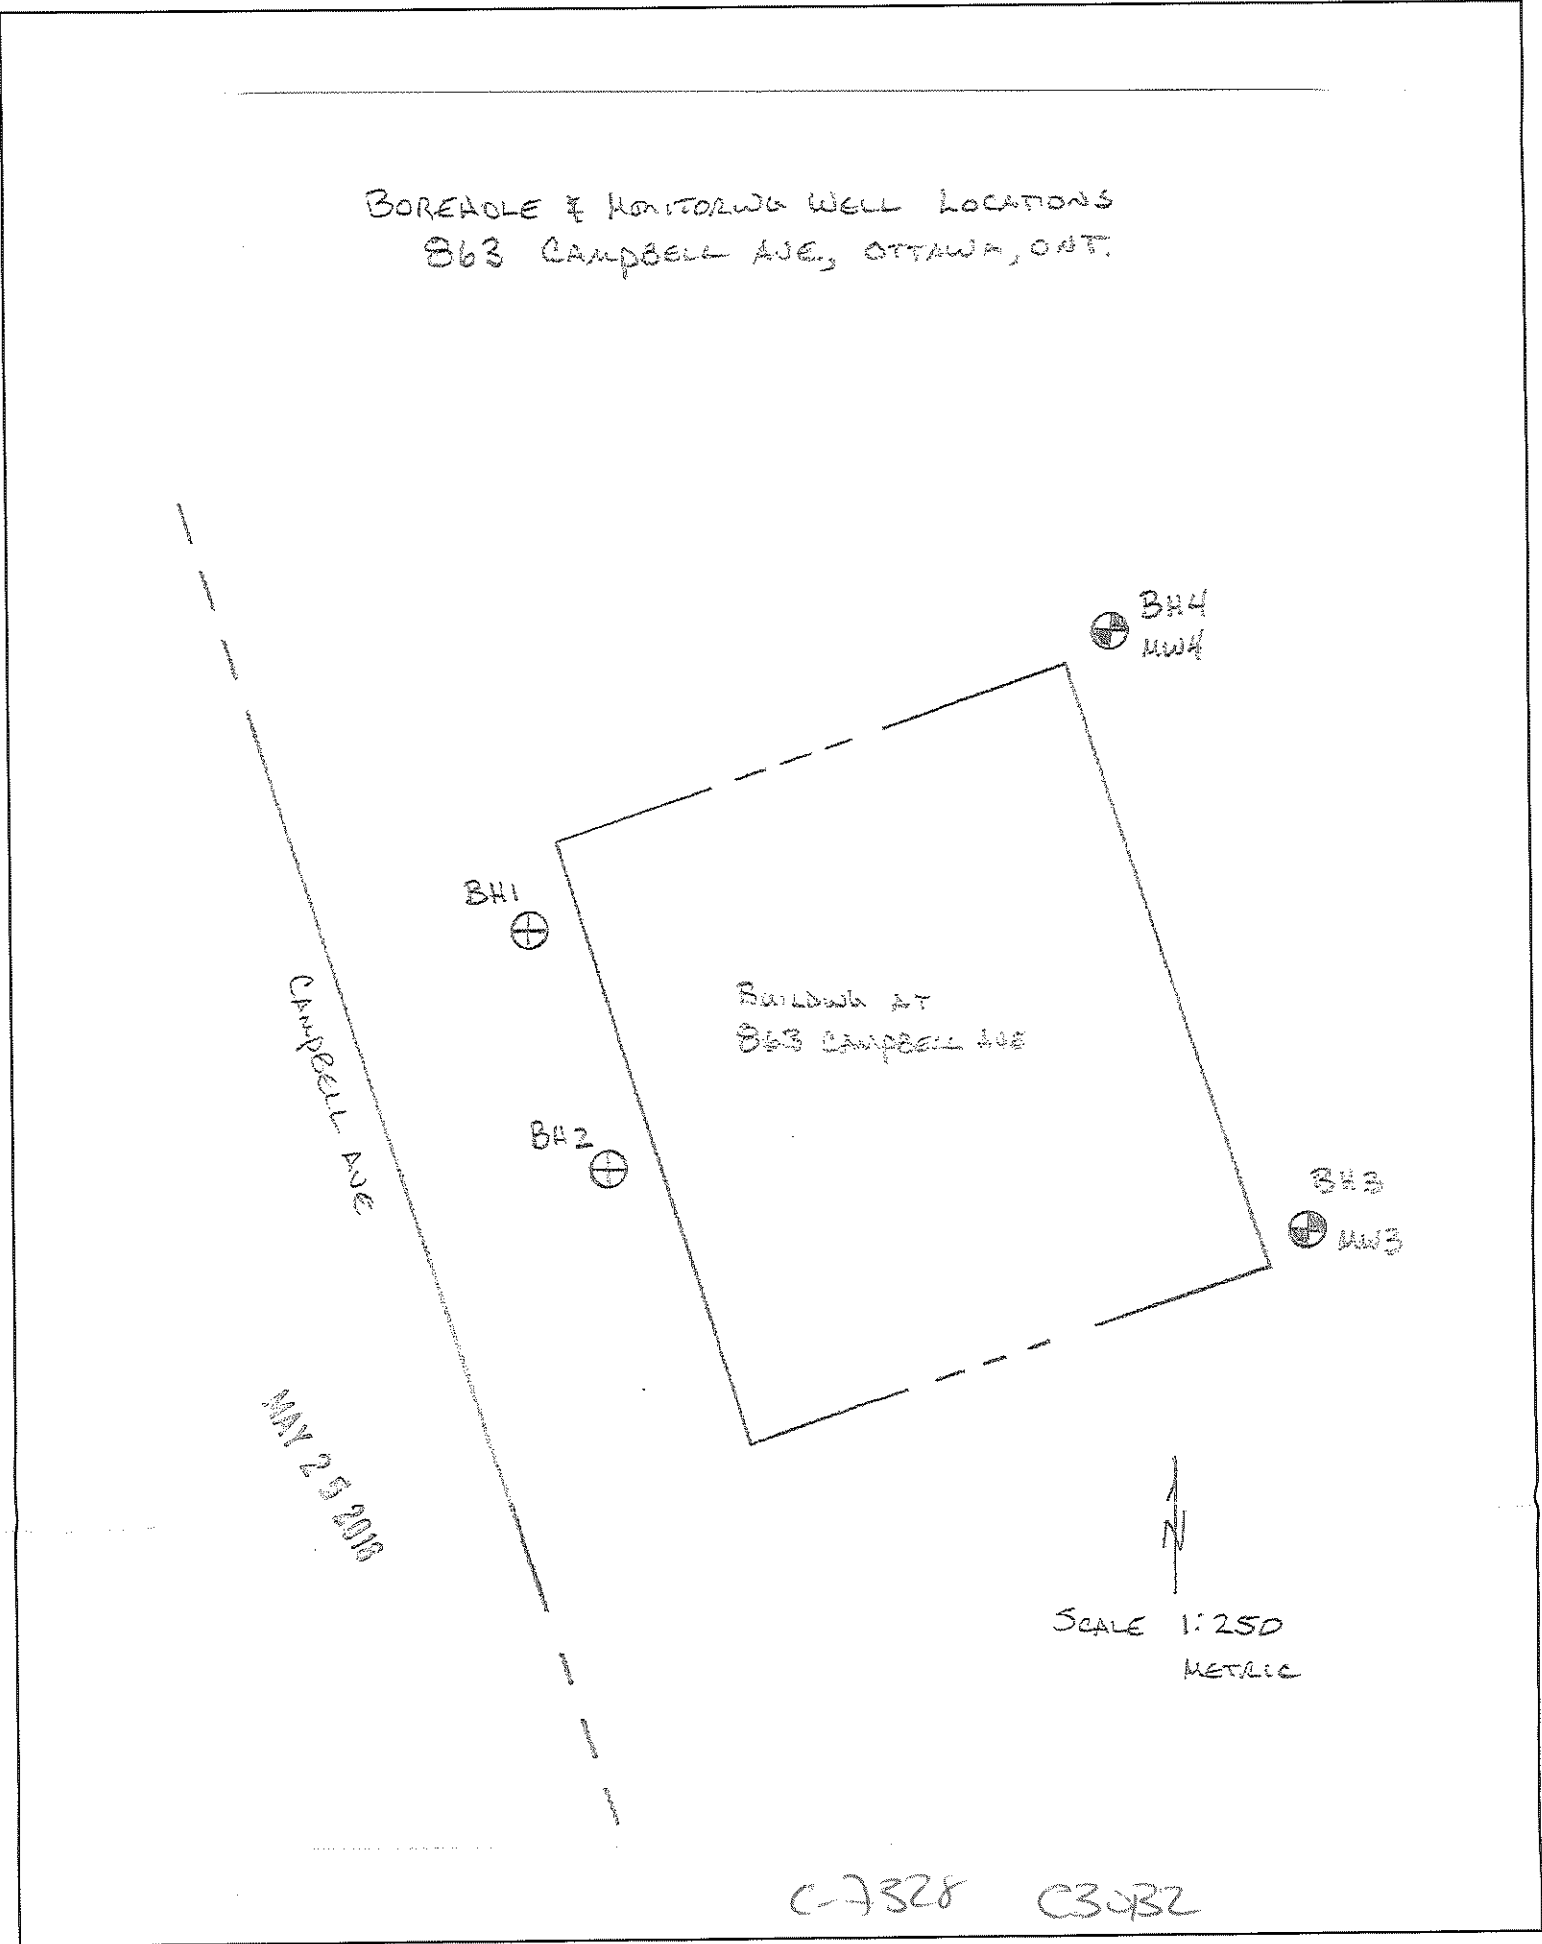

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



Go Back to Map

Well ID

Well ID Number: 7343574

Well Audit Number: Z317414

Well Tag Number: A274726

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	857 Boyd Ave
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441241.00 Northing: 5025023.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
GREY	----		HARD	0 ft	1 ft

BRWN	FSND		SOFT	1 ft	3 ft
BRWN	CLAY	SILT	SOFT	3 ft	6 ft
GREY	LMSN	SHLE	HARD	6 ft	14 ft

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed
0 ft	1 ft	CONCRETE FLUSHMOUNT	
1 ft	3 ft	BENSEAL	
3 ft	8 ft	BENTONITE PELLETS TIME RELEASE	
8 ft	14 ft	FILTER SAND	

Method of Construction & Well Use

Method of Construction	Well Use
Direct Push	
	Monitoring and Test Hole

Status of Well

Monitoring and Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
1.33 Inch	PLASTIC	0 ft	9 ft	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	
1.66 inch	PLASTIC	9 ft	14 ft	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		
Recommended pump depth		
Recommended pump rate		
Well Production		
Disinfected?		

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			

1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	
0 ft	6 ft	2.875 Inch	
6 ft	14 ft	2.375 Inch	

Audit Number: Z317414

Date Well Completed: August 13, 2019

Date Well Record Received by MOE: September 06, 2019

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7343575

Well Audit Number: Z317318

Well Tag Number: A268945

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	857 Boyd Ave
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441227.00 Northing: 5025011.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
BLCK	----	GRVL	DNSE	0 m	.31 m

BRWN	SILT	SAND	SOFT	.31 m	1.22 m
GREY	LMSN		LYRD	1.22 m	7.62 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	.31 m	CONCRETE FLUSHMOUNT		
.31 m	4.27 m	BENTONITE		
4.27 m	7.62 m	FILTER SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Boring		
	Monitoring and Test Hole	

Status of Well

Monitoring and Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
4.03 cm	PLASTIC	0 m	4.57 m	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	
4.82 cm	PLASTIC	4.57 m	7.62 m	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		

Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	

3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter
0 m	1.52 m	11.43 cm
1.52 m	7.62 m	7.62 cm

Audit Number: Z317318

Date Well Completed: August 13, 2019

Date Well Record Received by MOE: September 06, 2019

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

1182 440191210 E
9R 5101214181710 N
Elev. 9R 0121515
Basin 215



RECEIVED
15 No
SEP 18 1951
GEOLOGICAL BRANCH
DEPARTMENT OF MINES

The Well Drillers Act
Department of Mines, Province of Ontario


Water Well Record

Carleton.
County or Territorial District
Township, Village, Town or City
Date Completed July 15/51
Cost of well (excluding pump)

Pipe and Casing Record	Pumping Test
Casing diameter(s) 2	Date July 15/51
Length(s) of casing(s) 30	Static level
Type of screen	Pumping level 50 ft
Length of screen	Pumping rate 300
Distance from top of screen to ground level	Duration of test 2 hrs
Is well a gravel-wall type? Rock	Distance from cylinder or bowls to ground level

Water Record		Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises
Kind (fresh or mineral) Fresh	Quality (hard, soft, contains iron, sulphur, etc.) soft	45	fresh	37
Appearance (clear, cloudy, coloured) clear	For what purpose(s) is the water to be used? household			
How far is well from possible source of contamination? none	What is the source of contamination? none			
Enclose a copy of any mineral analysis that has been made of water				

Well Log		
Overburden and Bedrock Record	From	To
	0 ft.	...ft.
Clay & sand	0	30
Limestone	30	52

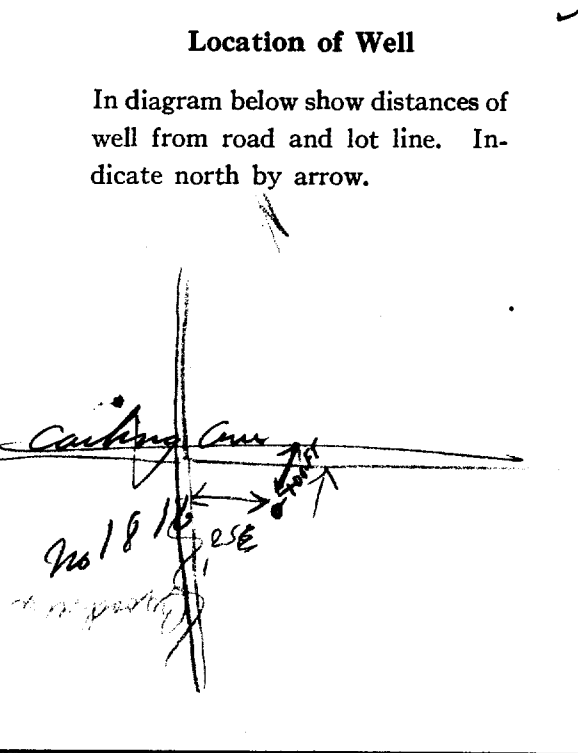


Situation: Is well on upland, in valley, or on hillside? valley
Drilling Firm J. B. Sullivan
Address 1870 Carling Ave
Name of Driller W. Ray
Date July 15/51
Licence Number
Signature of Licensee J. B. Sullivan

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7379158

Well Audit Number: C16072

Well Tag Number:

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441351.00 Northing: 5025192.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: C16072

Date Well Completed: November 19, 2020

Date Well Record Received by MOE: January 27, 2021

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



Go Back to Map

Well ID

Well ID Number: 7379159

Well Audit Number: C17610

Well Tag Number:

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441310.00 Northing: 5025152.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: C17610

Date Well Completed: November 19, 2020

Date Well Record Received by MOE: January 27, 2021

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7379161

Well Audit Number: C17616

Well Tag Number:

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441373.00 Northing: 5025179.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: C17616

Date Well Completed:

Date Well Record Received by MOE: January 27, 2021

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



Go Back to Map

Well ID

Well ID Number: 7379163

Well Audit Number: C17615

Well Tag Number:

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441367.00 Northing: 5025196.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: C17615

Date Well Completed: November 27, 2020

Date Well Record Received by MOE: January 27, 2021

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7379166

Well Audit Number: C16071

Well Tag Number:

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441354.00 Northing: 5025192.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: C16071

Date Well Completed: November 20, 2020

Date Well Record Received by MOE: January 27, 2021

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7379167

Well Audit Number: C17619

Well Tag Number:

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441372.00 Northing: 5025175.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: C17619

Date Well Completed: November 27, 2020

Date Well Record Received by MOE: January 27, 2021

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014

All measurements recorded in: ☒ Metric ☐ Imperial

Follow instructions on the front and back of this form. Print or Type

Well Tag No. of Deepest Well: (Print Well Tag No.)

A290210

Well No. on Drawing of Deepest Well: 346

☐ Dewatering wells

☒ Test holes

No. of wells reported 5

Page 1 of 1


Well Cluster Location Information

Address of Well Location (Street Number(s)/Name(s), RR, if available)		Lot(s)	Concession(s)	Geographic Township		County/District/Upper Tier Municipality
1688 CARLING AVENUE						
City, Town, Village or Hamlet		Province	GPS Unit Make	Model	Unit Mode of Operation	☐ Undifferentiated ☒ Averaged
OTTAWA		Ontario	GARMIN	ETREX	☐ Differentiated, specify: _____	

Well Details

[illegible]

Well Contractor and Well Technician Information

Business Name of Well Contractor		Business Address (Street Number/Name, RR)		Municipality	Province
EASTERN ONTARIO DIAMOND DRILLING LTD		3780 COUNTY ROAD 17, P.O. Box 46		HAWKESBURY	ON
Postal Code	Bus. Telephone No.	Well Contractor's Licence No.	Business E-mail Address		
K6A2R4	(613) 632-7769	73 28	eod@forage-downing-drilling.com		
Name of Well Technician (First Name, Last Name)		Well Technician's Licence No.	Signature of Well Technician		Date Submitted (yyyy/mm/dd)
STEPHEN DOWNING		33 26			2021/12/03

Date First Well in Cluster Constructed
or Abandoned (yyyy/mm/dd)

2021/03/16

	Date Last Well in Cluster Completed (yyyy/mm/dd)

2021/03/17

Ministry Use Only

Date Received (yyyy/mm/dd)

1)	Audit No.

C 54390

Well Abandonment

Person Abandoning the Wells:


Name N/A
(Print or Type) - See instruction 11 on the back of this form

Comments:

Note: This Well Record for Well Cluster Part 3 - Detailed Drawing of all Well Locations, must be attached to Parts 1 and 2. The drawing must include all property boundaries, an arrow indicating the North direction, all named roads and sufficient measurements to locate all wells in the cluster in relation to fixed points. The drawing must show the location of each well and each well must be numbered on the drawing to match number used for that well on the Well Record for Well Cluster Parts 1 and 2. The well with the well tag must be clearly identified on the Drawing. UTM coordinates should appear beside each well, if space permits. Additional comments on wells can be included on the drawing

Well Tag Number: # A290210

"Well Record for Well Cluster" Form Audit Number: # C54390

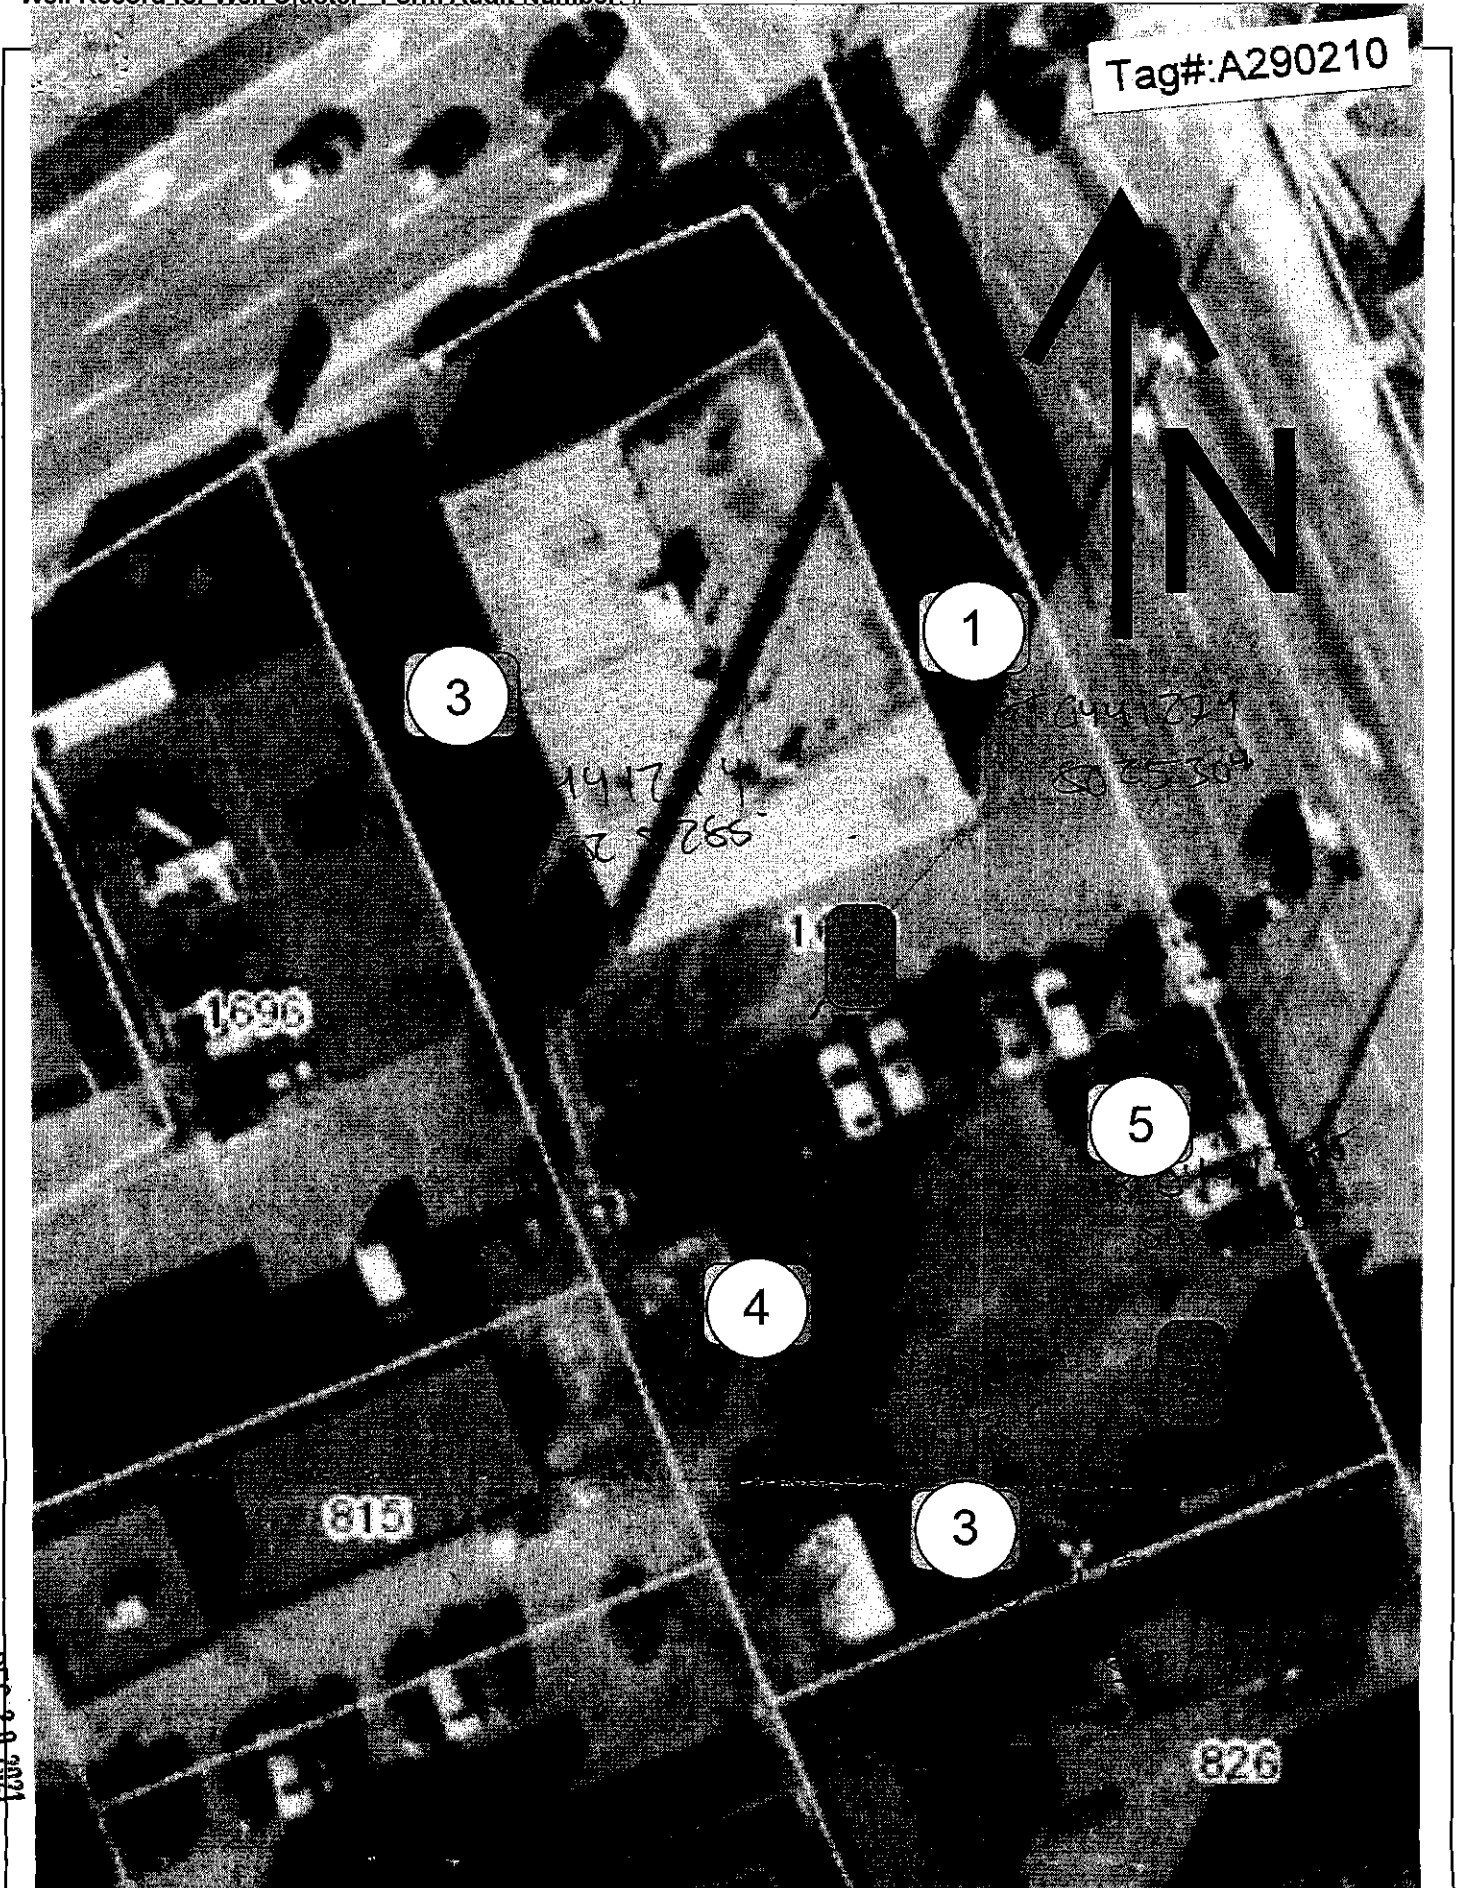


DEC 20 2021

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7419769

Well Audit Number: Z385975

Well Tag Number: A342599

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 440976.00 Northing: 5025096.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z385975

Date Well Completed: May 20, 2022

Date Well Record Received by MOE: June 09, 2022

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7343575

Well Audit Number: Z317318

Well Tag Number: A268945

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	857 Boyd Ave
Township	NEPEAN TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 441227.00 Northing: 5025011.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
BLCK	----	GRVL	DNSE	0 m	.31 m

BRWN	SILT	SAND	SOFT	.31 m	1.22 m
GREY	LMSN		LYRD	1.22 m	7.62 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	.31 m	CONCRETE FLUSHMOUNT		
.31 m	4.27 m	BENTONITE		
4.27 m	7.62 m	FILTER SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Boring		
	Monitoring and Test Hole	

Status of Well

Monitoring and Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
4.03 cm	PLASTIC	0 m	4.57 m	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	
4.82 cm	PLASTIC	4.57 m	7.62 m	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		

Pump intake set at	
Pumping Rate	
Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	

3		3	
4		4	
5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter
0 m	1.52 m	11.43 cm
1.52 m	7.62 m	7.62 cm

Audit Number: Z317318

Date Well Completed: August 13, 2019

Date Well Record Received by MOE: September 06, 2019

Related


How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7441170

Well Audit Number: Z380390

Well Tag Number: A366081

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 440967.00 Northing: 5025089.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z380390

Date Well Completed: December 02, 2022

Date Well Record Received by MOE: January 16, 2023

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024


Published: March 20, 2014

CLYDE AVE.

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7441171

Well Audit Number: Z384334

Well Tag Number: A366082

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 440969.00 Northing: 5025087.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z384334

Date Well Completed: December 02, 2022

Date Well Record Received by MOE: January 16, 2023

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024

Published: March 20, 2014

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7441172

Well Audit Number: Z380379

Well Tag Number: A357360

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 440975.00 Northing: 5025088.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z380379

Date Well Completed: December 01, 2022

Date Well Record Received by MOE: January 16, 2023

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014


UTM 18 414091010 E
5 R 50124171410 N

Elev. 41 0121610

Basin 25 111



The Water-well Drillers Act, 1954
Department of Mines

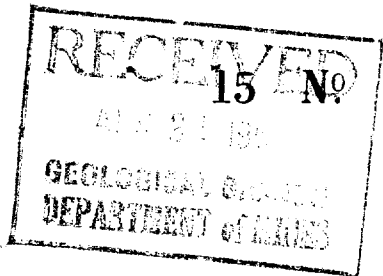

8094

Water-Well Record

County or Territorial District Carleton Township, Village, Town or City Ottawa
Village, Town or City Man Oue
Address 555 Redwood Ave
(day) (month) (year)

Pipe and Casing Record

Pumping Test

Casing diameter(s) 4" Static level 10'
Length(s) Pumping rate 250 G.P.M.
Type of screen Pumping level 10'
Length of screen Duration of test 1.2

Well Log

Water Record

Overburden and Bedrock Record	From ft.	To ft.	Depth (s) at which water (s) found	No. of feet water rises	Kind of water (fresh, salty, or sulphur)
<u>Clay</u>	<u>1-10'</u>				
<u>gravel</u>	<u>10-12'</u>				
<u>limestone</u>	<u>12-100'</u>				
			<u>95'</u>	<u>85'</u>	<u>fresh</u>


For what purpose(s) is the water to be used?
Residential
Is water clear or cloudy? clear
Is well on upland, in valley, or on hillside?
valley
Drilling firm M. M. Meagher
Address 639 Redwood Ave
Name of Driller M. M. Meagher
Address
Licence Number 191

I certify that the foregoing statements of fact are true.

Date Jan 30 M. M. Meagher
Signature of Licensee

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

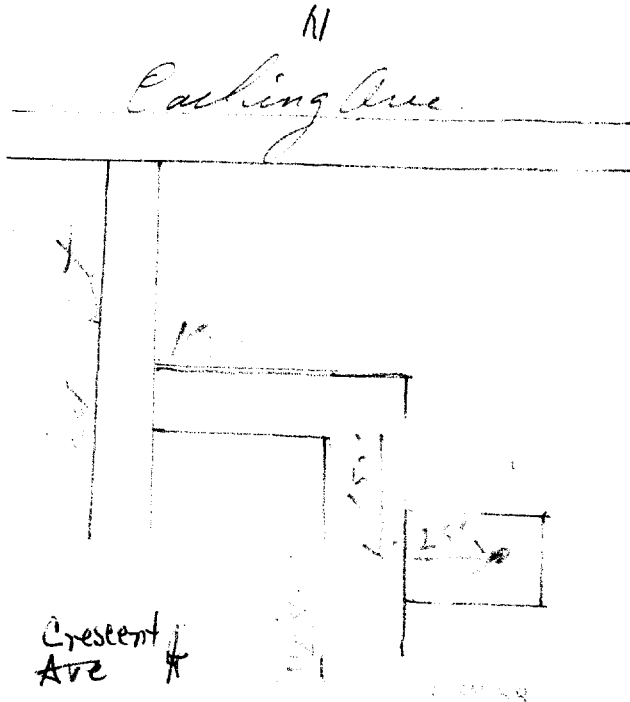



RE: Records Search for PE4425

From Public Information Services <publicinformationsservices@tssa.org>

Date Tue 11/19/2024 7:23 PM

To Mohammed Ramadan <MRamadan@patersongroup.ca>

External Email: Do not click on links or open attachments unless you trust the sender.

Hello ,

NO RECORDS FOUND IN CURRENT DATABASE:

- We confirm that there are NO **fuels records** in our database at the subject address(es).

This is not a confirmation that there are no records in the archives. For a further search in our archives, please go to the [TSSA Client Portal](#) to complete an Application for Release of Public Information.

Please refer to [How to Submit a Public Information Request \(tssa.org\)](#) for instructions.

The associated fee must be paid via credit card (Visa or MasterCard).

Once all steps have been successfully completed you will receive your payment receipt via email.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

If you have any questions or concerns, please do not hesitate to contact our Public Information Release team at publicinformationsservices@tssa.org.

Kind regards,
Sherees



Public Information Agent

Facilities and Business Services

345 Carlingview Drive

Toronto, Ontario M9W 6N9

Tel: +1-416-734-6222 | Fax: +1-416-734-3568 | E-Mail: publicinformationsservices@tssa.org

www.tssa.org



From: Mohammed Ramadan <MRamadan@patersongroup.ca>

Sent: Tuesday, November 19, 2024 2:38 PM

To: Public Information Services <publicinformationsservices@tssa.org>

Subject: Records Search for PE4425

Good Afternoon,

[CAUTION]: This email originated outside the organisation.

Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

Could you please complete a search of your records for underground/aboveground storage tanks, historical spills, or other incidents/infractions for the following address in Cornwall, Ontario:

Carling Avenue: 1723, 1740, 1743, 1746, 1754

Boyd Avenue: 811, 814, 818, 828

Kerr Avenue: 1755

Regards,



MOHAMMED RAMADAN, B.Sc.
Environmental Inspector

TEL: (613) 226-7381 ext. 345
DIRECT: (613) 909-8069

9 AURIGA DRIVE
OTTAWA ON K2E 7T9

patersongroup.ca

TEMPORARY SHORING DESIGN SERVICES ARE NOW AVAILABLE, PLEASE CONTACT US TO SEE HOW WE CAN HELP!

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

Office Use Only

Application Number: _____	Ward Number: _____	Application Received: (dd/mm/yyyy): _____
Client Service Centre Staff: _____	Fee Received: \$	



Historic Land Use Inventory

Application Form

Notice of Public Record

All information and materials required in support of your application shall be made available to the public, as indicated by Section 1.0.1 of *The Planning Act*, R.S.O. 1990, C.P.13.

Municipal Freedom of Information and Protection Act

Personal information on this form is collected under the authority the *Planning Act*, RSO 1990, c. P. 13 and will be used to process this application. Questions about this collection may be directed by mail to Manager, Business Support Services, Planning, Real Estate and Economic Development Department, 110 Laurier Avenue West, Ottawa, K1P 1J1, or by phone at (613) 580-2424, ext. 24075

Background Information

***Site Address or Location:**

1740, 1746, 1754 Carling Avenue - 1755 Kerr Avenue - 828 Boyd Avenue

** Mandatory Field*

Applicant/Agent Information:

Name:	Mohammed Ramadan		
Mailing Address:	9 Auriga Drive		
Telephone:	3439988982	Email Address:	mramadan@patersongroup.ca

Registered Property Owner Information:

☐ Same as above

Name:	Andrew Glass		
Mailing Address:	236 Metcalfe Street, Ottawa, ON, K2P 1R3		
Telephone:		Email Address:	

Site Details

Legal Description
and PIN:

What is the land
currently used for?

commercial

Lot frontage:

m

Lot depth:

m

Lot area:

m²

OR

Lot area: (irregular lot)

m²

Does the site have Full Municipal Services:

☒ Yes

☐ No

Required Fees

Please don't hesitate to visit the [Historic Land Use Inventory website](#) more information. Fees must be paid in full at the time of application submission.

Planning Fee

\$136.00

Submittal Requirements

The following are required to be submitted with this application:

- 1. Consent to Disclose Information:** Consultants and other third parties may make requests for information on behalf of an individual or corporation. However, if the requester is not the owner of the property, **the requester must provide the City of Ottawa with a 'consent to disclose information' letter, signed by the property owner.** This will authorize the City of Ottawa to release any relevant information about the property or its owner(s) to the requester. Consent for disclosure is required in the event that personal information or proprietary company information is found concerning the property and its owner. All consents must clearly indicate the name of the property owner as well as the name of the requester, and must be signed and dated.
- 2. Disclaimer:** Requesters must read and understand the conditions included in the attached disclaimer and submit a signed disclaimer to the City of Ottawa's Planning, Real Estate and Economic Development Department. This disclaimer is related to the Historic Land Use Inventory and must be received by the City of Ottawa, signed and dated by the requestor, before the process can begin.
- 3. A site plan or key plan of the property, its location and particular features.**
- 4. Any significant dates or time frames that you would like researched.**


Disclaimer

For use with HLUI Database

CITY OF OTTAWA ("the City") is the owner of the Historical Land Use Inventory ("HLUI"), a database of information on the type and location of land uses within the geographic area of Ottawa, which had or have the potential to cause contamination in soil, groundwater or surface water.

The City, in providing information from the HLUI, to Paterson Group ("the Requester") does so only under the following conditions and understanding:

1. The HLUI may contain erroneous information given that such records and sources of information may be flawed. Changes in municipal addresses over time may have introduced error in such records and sources of information. The City is not responsible for any errors or omissions in the HLUI and reserves the right to change and update the HLUI without further notice. The City does not, however, make any commitment to update the HLUI. Accordingly, all information from the HLUI is provided on an "as is" basis with no representation or warranty by the City with respect to the information's accuracy or exhaustiveness in responding to the request.
2. City staff will perform a search of the HLUI based on the information given by the Requester. City staff will make every effort to be accurate, however, the City does not provide an assurance, guarantee, warranty, representation (express or implied), as to the availability, accuracy, completeness or currency of information which will be provided to the Requester. The HLUI in no way confirms the presence or absence of contamination or pollution of any kind. The information provided by the City to the Requester is provided on the assumption that it will not be relied upon by any person whatsoever. The City denies all liability to any such persons attempting to rely on any information provided from the HLUI database.
3. The City, its employees, servants, agents, boards, officials or contractors take no responsibility for any actions, claims, losses, liability, judgments, demands, expenses, costs, damages or harm suffered by any person whatsoever including negligence in compiling or disseminating information in the HLUI.
4. Copyright is reserved to the City.
5. Any use of the information provided from the HLUI which a third party makes, or any reliance on or decisions to be based on it, are the responsibilities of such third parties. The City, its employees, servants, agents, boards, officials or contractors accept no responsibility for any damages, if any, suffered by a third party as a result of decisions made as a result of an information search of the HLUI.
6. Any use of this service by the Requestor indicates an acknowledgement, acceptance and limits of this disclaimer.
7. All information collected under this request and all records provided in response to this request are subject to the provisions of the Municipal Freedom of Information and Protection of Privacy Act, R.S.O. 1990, c. M.56, as amended.

Signed: 

Dated (dd/mm/yyyy): 01/04/2025

Per: Mohammed Ramadan

(Please print name)

Title: Environmental Scientist

Company: Paterson Group

Office Use Only

Application Number: _____	Ward Number: _____	Application Received: (dd/mm/yyyy): _____
Client Service Centre Staff: _____	Fee Received: \$	



Historic Land Use Inventory

Application Form

Notice of Public Record

All information and materials required in support of your application shall be made available to the public, as indicated by Section 1.0.1 of *The Planning Act*, R.S.O. 1990, C.P.13.

Municipal Freedom of Information and Protection Act

Personal information on this form is collected under the authority the *Planning Act*, RSO 1990, c. P. 13 and will be used to process this application. Questions about this collection may be directed by mail to Manager, Business Support Services, Planning, Real Estate and Economic Development Department, 110 Laurier Avenue West, Ottawa, K1P 1J1, or by phone at (613) 580-2424, ext. 24075

Background Information

***Site Address or Location:**

1740, 1746, 1754 Carling Avenue - 1755 Kerr Avenue - 828 Boyd Avenue

**Mandatory Field*

Applicant/Agent Information:

Name:	Mohammed Ramadan		
Mailing Address:	9 Auriga Drive		
Telephone:	3439988982	Email Address:	mramadan@patersongroup.ca

Registered Property Owner Information:

☐ Same as above

Name:	Andrew Glass		
Mailing Address:	236 Metcalfe Street, Ottawa, ON, K2P 1R3		
Telephone:		Email Address:	

Site Details

Legal Description
and PIN:

What is the land
currently used for?

commercial

Lot frontage:

m

Lot depth:

m

Lot area:

m²

OR

Lot area: (irregular lot)

m²

Does the site have Full Municipal Services:

☐

Yes

☐

No

Required Fees

Please don't hesitate to visit the [Historic Land Use Inventory website](#) more information. Fees must be paid in full at the time of application submission.

Planning Fee

\$136.00

Submittal Requirements

The following are required to be submitted with this application:

- 1. Consent to Disclose Information:** Consultants and other third parties may make requests for information on behalf of an individual or corporation. However, if the requester is not the owner of the property, **the requester must provide the City of Ottawa with a 'consent to disclose information' letter, signed by the property owner.** This will authorize the City of Ottawa to release any relevant information about the property or its owner(s) to the requester. Consent for disclosure is required in the event that personal information or proprietary company information is found concerning the property and its owner. All consents must clearly indicate the name of the property owner as well as the name of the requester, and must be signed and dated.
- 2. Disclaimer:** Requesters must read and understand the conditions included in the attached disclaimer and submit a signed disclaimer to the City of Ottawa's Planning, Real Estate and Economic Development Department. This disclaimer is related to the Historic Land Use Inventory and must be received by the City of Ottawa, signed and dated by the requestor, before the process can begin.
- 3. A site plan or key plan of the property, its location and particular features.**
- 4. Any significant dates or time frames that you would like researched.**

Disclaimer

For use with HLUI Database

CITY OF OTTAWA ("the City") is the owner of the Historical Land Use Inventory ("HLUI"), a database of information on the type and location of land uses within the geographic area of Ottawa, which had or have the potential to cause contamination in soil, groundwater or surface water.

The City, in providing information from the HLUI, to Paterson Group ("the Requester") does so only under the following conditions and understanding:

1. The HLUI may contain erroneous information given that such records and sources of information may be flawed. Changes in municipal addresses over time may have introduced error in such records and sources of information. The City is not responsible for any errors or omissions in the HLUI and reserves the right to change and update the HLUI without further notice. The City does not, however, make any commitment to update the HLUI. Accordingly, all information from the HLUI is provided on an "as is" basis with no representation or warranty by the City with respect to the information's accuracy or exhaustiveness in responding to the request.
2. City staff will perform a search of the HLUI based on the information given by the Requester. City staff will make every effort to be accurate, however, the City does not provide an assurance, guarantee, warranty, representation (express or implied), as to the availability, accuracy, completeness or currency of information which will be provided to the Requester. The HLUI in no way confirms the presence or absence of contamination or pollution of any kind. The information provided by the City to the Requester is provided on the assumption that it will not be relied upon by any person whatsoever. The City denies all liability to any such persons attempting to rely on any information provided from the HLUI database.
3. The City, its employees, servants, agents, boards, officials or contractors take no responsibility for any actions, claims, losses, liability, judgments, demands, expenses, costs, damages or harm suffered by any person whatsoever including negligence in compiling or disseminating information in the HLUI.
4. Copyright is reserved to the City.
5. Any use of the information provided from the HLUI which a third party makes, or any reliance on or decisions to be based on it, are the responsibilities of such third parties. The City, its employees, servants, agents, boards, officials or contractors accept no responsibility for any damages, if any, suffered by a third party as a result of decisions made as a result of an information search of the HLUI.
6. Any use of this service by the Requestor indicates an acknowledgement, acceptance and limits of this disclaimer.
7. All information collected under this request and all records provided in response to this request are subject to the provisions of the Municipal Freedom of Information and Protection of Privacy Act, R.S.O. 1990, c. M.56, as amended.

Signed: _____

Dated (dd/mm/yyyy): 01/04/2025

Per: Mohammed Ramadan
(Please print name)

Title: Environmental Scientist

Company: Paterson Group



DATABASE REPORT

Project Property:	<i>Phase I ESA Kerr/Broadview Project Ottawa ON K2A 2C7 P.O. 61561 - PE4425</i>
Project No:	<i>P.O. 61561 - PE4425</i>
Report Type:	<i>Quote - Custom-Build Your Own Report</i>
Order No:	<i>24101700600</i>
Requested by:	<i>Paterson Group Inc.</i>
Date Completed:	<i>November 1, 2024</i>

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	7
Executive Summary: Site Report Summary - Surrounding Properties.....	9
Executive Summary: Summary By Data Source.....	53
Map.....	107
Aerial.....	108
Topographic Map.....	109
Detail Report.....	110
Unplottable Summary.....	644
Unplottable Report.....	647
Appendix: Database Descriptions.....	669
Definitions.....	679

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: *Phase I ESA
Kerr/Broadview Project Ottawa ON K2A 2C7*

Project No: *P.O. 61561 - PE4425*

Order Information:

Order No: *24101700600*

Date Requested: *October 17, 2024*

Requested by: *Paterson Group Inc.*

Report Type: *Quote - Custom-Build Your Own Report*

Historical/Products:

ERIS Xplorer [*ERIS Xplorer*](#)

Executive Summary: Report Summary

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.25km</i>	<i>Total</i>
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	9	9
CA	Certificates of Approval	Y	0	12	12
CDRY	Dry Cleaning Facilities	Y	0	0	0
CFOT	Commercial Fuel Oil Tanks	Y	0	2	2
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	13	13
EASR	Environmental Activity and Sector Registry	Y	0	0	0
EBR	Environmental Registry	Y	0	1	1
ECA	Environmental Compliance Approval	Y	0	8	8
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	0	50	50
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	11	11
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	6	6
FSTH	Fuel Storage Tank - Historic	Y	0	8	8
GEN	Ontario Regulation 347 Waste Generators Summary	Y	6	213	219
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	3	3

Database	Name	Searched	Project Property	Boundary to 0.25km	Total
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0
INC	Fuel Oil Spills and Leaks	Y	0	2	2
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	2	2
NPR2	National Pollutant Release Inventory 1993-2020	Y	0	1	1
NPRI	National Pollutant Release Inventory - Historic	Y	0	0	0
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	6	6
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	6	6
PFAS	Ontario PFAS Spills	Y	0	0	0
PFCH	NPRI Reporters - PFAS Substances	Y	0	0	0
PFHA	Potential PFAS Handlers from NPRI	Y	0	0	0
PINC	Pipeline Incidents	Y	0	10	10
PPHA	Potential PFAS Handlers from EASR	Y	0	0	0
PRT	Private and Retail Fuel Storage Tanks	Y	0	8	8
PTTW	Permit to Take Water	Y	0	1	1
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	1	1
RST	Retail Fuel Storage Tanks	Y	0	3	3
SCT	Scott's Manufacturing Directory	Y	2	29	31
SPL	Ontario Spills	Y	0	34	34
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.25km</i>	<i>Total</i>
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	3	118	121
Total:			11	557	568

Executive Summary: Site Report Summary - Project Property

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>1</u>	GEN	AllGreen Demolition Inc.	1752 Carling Avenue Ottawa ON K2A 1E1	W/0.0	0.51	<u>110</u>
<u>2</u>	WWIS		ON <i>Well ID:</i> 1507908	E/0.0	0.72	<u>110</u>
<u>3</u>	SCT	VALIQUETTE ENTERPRISES INC.	1740 CARLING AVE OTTAWA ON K2A 1E1	NE/0.0	-0.29	<u>11</u>
<u>3</u>	SCT	Accolade Marketing Concept Inc.	1740 Carling Ave Ottawa ON K2A 1E1	NE/0.0	-0.29	<u>113</u>
<u>3</u>	GEN	OTTAWA BIKEWAY COMPANY LTD.	1740 CARLING AVE. OTTAWA ON K2A 1E1	NE/0.0	-0.29	<u>113</u>
<u>3</u>	GEN	OTTAWA BIKEWAY COMPANY LTD. 29-360	1740 CARLING AVE. OTTAWA ON K2A 1E1	NE/0.0	-0.29	<u>114</u>
<u>3</u>	GEN	OTTAWA BIKEWAY COMPANY LIMITED	1740 CARLING AVENUE OTTAWA ON K2A 1E1	NE/0.0	-0.29	<u>114</u>
<u>3</u>	GEN	VALIQUETTE SPORTS	1740 CARLING AVENUE OTTAWA ON K2A 1E1	NE/0.0	-0.29	<u>114</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>3</u>	GEN	VALIQUETTE ENTERPRISES INC.	1740 CARLING AVENUE OTTAWA ON	NE/0.0	-0.29	<u>115</u>
<u>4</u>	WWIS		ON <i>Well ID:</i> 7419769	WSW/0.0	0.78	<u>115</u>
<u>5</u>	WWIS		ON <i>Well ID:</i> 7419770	WSW/0.0	0.77	<u>116</u>

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
6	WWIS		ON Well ID: 1507981	WSW/5.0	0.77	117
7	EHS		818 Boyd Ave Ottawa ON K2A 2C7	E/11.4	0.66	119
7	EHS		818 Boyd Ave Ottawa ON K2A2C7	E/11.4	0.66	120
8	PRT	557249 ONTARIO INC	1784 CARLING AV OTTAWA ON K2A 1E1	WSW/11.6	0.78	120
8	PRT	557249 ONTARIO INC	1784 CARLING AV OTTAWA ON K2A1E1	WSW/11.6	0.78	120
8	PRT	557249 ONTARIO INC	1784 CARLING AV OTTAWA ON K2A1E1	WSW/11.6	0.78	120
8	PRT		1784 CARLING AV. OTTAWA ON	WSW/11.6	0.78	120
8	RST	SUNOCO GAS BAR	1784 CARLING AVE OTTAWA ON K2A 1E1	WSW/11.6	0.78	121
8	CA	SUNOCO INC.	SWM - 1784 CARLING AVENUE OTTAWA CITY ON K2A 1E1	WSW/11.6	0.78	121
8	FSTH	6434118 CANADA INC	1784 CARLING AV OTTAWA ON K2A 1E1	WSW/11.6	0.78	121
8	FSTH	2171273 ONTARIO INC	1784 CARLING AV OTTAWA ON K2A 1E1	WSW/11.6	0.78	121
8	SPL	Petro-Canada	1784 Carling Avenue Ottawa ON K2A 1E1	WSW/11.6	0.78	122

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>8</u>	DTNK	1496029 ONTARIO INC	1784 CARLING AV OTTAWA ON K2A 1E1	WSW/11.6	0.78	<u>123</u>
<u>8</u>	DTNK	1496029 ONTARIO INC	1784 CARLING AV OTTAWA ON	WSW/11.6	0.78	<u>123</u>
<u>8</u>	DTNK	557249 ONTARIO INC O/A BROADVIEW SERVICE CENTER	1784 CARLING AV OTTAWA ON	WSW/11.6	0.78	<u>124</u>
<u>8</u>	DTNK	1496029 ONTARIO INC	1784 CARLING AV OTTAWA ON	WSW/11.6	0.78	<u>124</u>
<u>8</u>	DTNK	2171273 ONTARIO INC	1784 CARLING AV OTTAWA ON	WSW/11.6	0.78	<u>125</u>
<u>8</u>	DTNK	2171273 ONTARIO INC	1784 CARLING AV OTTAWA ON	WSW/11.6	0.78	<u>126</u>
<u>8</u>	DTNK	2171273 ONTARIO INC	1784 CARLING AV OTTAWA ON	WSW/11.6	0.78	<u>126</u>
<u>8</u>	DTNK	1496029 ONTARIO INC	1784 CARLING AV OTTAWA ON	WSW/11.6	0.78	<u>127</u>
<u>8</u>	DTNK	557249 ONTARIO INC O/A BROADVIEW SERVICE CENTER	1784 CARLING AV OTTAWA ON	WSW/11.6	0.78	<u>127</u>
<u>8</u>	RST	SUNOCO GAS BAR	1784 CARLING AVE OTTAWA ON K2A1E1	WSW/11.6	0.78	<u>128</u>
<u>8</u>	CFOT	W.O. STINSON & SON LIMITED	1784 CARLING AVE OTTAWA ON	WSW/11.6	0.78	<u>128</u>
<u>8</u>	GEN	Suncor Energy Products Partnership	1784 Carling Avenue Ottawa ON K2A 1E1	WSW/11.6	0.78	<u>128</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>8</u>	EHS		1784 Carling Ave Ottawa ON K2A1E1	WSW/11.6	0.78	<u>129</u>
<u>8</u>	GEN	Suncor Energy Products Partnership	1784 Carling Avenue Ottawa ON K2A 1E1	WSW/11.6	0.78	<u>129</u>
<u>8</u>	INC	SUNCOR ENERGY PRODUCTS PARTNERSHIP	1784 CARLING AVE OTTAWA ON	WSW/11.6	0.78	<u>129</u>
<u>8</u>	GEN	Suncor Energy Products Partnership	1784 Carling Avenue Ottawa ON K2A 1E1	WSW/11.6	0.78	<u>130</u>
<u>8</u>	GEN	Suncor Energy Products Partnership	1784 Carling Avenue Ottawa ON K2A 1E1	WSW/11.6	0.78	<u>131</u>
<u>8</u>	EXP	SUNCOR ENERGY PRODUCTS PARTNERSHIP	1784 CARLING AVE OTTAWA ON	WSW/11.6	0.78	<u>131</u>
<u>8</u>	EXP	2171273 ONTARIO INC	1784 CARLING AVE OTTAWA ON	WSW/11.6	0.78	<u>131</u>
<u>8</u>	EXP	2171273 ONTARIO INC	1784 CARLING AVE OTTAWA ON	WSW/11.6	0.78	<u>132</u>
<u>8</u>	EXP	2171273 ONTARIO INC	1784 CARLING AVE OTTAWA ON	WSW/11.6	0.78	<u>132</u>
<u>8</u>	EXP	SUNCOR ENERGY PRODUCTS PARTNERSHIP	1784 CARLING AVE OTTAWA ON	WSW/11.6	0.78	<u>132</u>
<u>8</u>	EXP	2171273 ONTARIO INC	1784 CARLING AVE OTTAWA ON	WSW/11.6	0.78	<u>132</u>
<u>8</u>	EXP	1496029 ONTARIO INC	1784 CARLING AVE OTTAWA ON	WSW/11.6	0.78	<u>133</u>
<u>9</u>	EHS		814 Boyd Avenue Ottawa ON	ENE/14.6	0.65	<u>133</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
9	WWIS		ON Well ID: 7162302	ENE/14.6	0.65	133
10	EHS		818 Boyd Ave Ottawa ON Ottawa ON K2A 2C7	ENE/15.2	0.65	134
11	EHS		818 Boyd Avenue Ottawa ON K2A 2C7	ENE/17.2	0.65	134
12	EHS		1772 Carling Ave Ottawa ON K2A 1E1	W/17.4	0.79	134
12	GEN	Midas International	1772 Carling Avenue Ottawa ON K2A 1E1	W/17.4	0.79	135
12	GEN	MIDAS Auto Service	1772 Carling Ave Ottawa ON K2A 1E1	W/17.4	0.79	135
13	SCT	ZIPPY PRINT	1806 CARLING AVE OTTAWA ON K2A 1E2	WSW/23.2	0.77	136
13	SCT	ALLEGRA PRINT & IMAGING INC.	1806 Carling Ave Ottawa ON K2A 1E2	WSW/23.2	0.77	136
13	SCT	Allegra Print & Imaging	1806 Carling Ave Ottawa ON K2A 1E2	WSW/23.2	0.77	136
13	GEN	ZIPPY PRINT 43-535	1806 CARLING AVE. OTTAWA ON K2A 1E2	WSW/23.2	0.77	137
13	GEN	ZIPPY PRINT (SEE & USE ON2417500)3-535	1806 CARLING AVE. OTTAWA ON K2A 1E2	WSW/23.2	0.77	137
13	GEN	ALLEGRA PRINT & IMAGING	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	138
13	GEN	ZIPPY PRINT (SEE & USE ON2417500)	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	138

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>13</u>	SCT	Allegra Print & Imaging	1806 Carling Ave Ottawa ON K2A 1E2	WSW/23.2	0.77	<u>138</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>139</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>139</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>139</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>140</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>140</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON	WSW/23.2	0.77	<u>140</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>141</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>141</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>141</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>141</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>142</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>142</u>
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>143</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>13</u>	GEN	Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/23.2	0.77	<u>143</u>
<u>14</u>	WWIS		ON Well ID: 7306421	W/27.9	0.78	<u>143</u>
<u>15</u>	SCT	Advanced Prefabs Ltd.	1722 Carling Ave Ottawa ON K2A 1C7	NE/29.5	0.70	<u>144</u>
<u>16</u>	SCT	Jarry's Dental Laboratory Inc.	836 Boyd Ave Ottawa ON K2A 2E1	ESE/29.5	0.73	<u>145</u>
<u>16</u>	EHS		836 Boyd Avenue Ottawa ON K2A 2E1	ESE/29.5	0.73	<u>145</u>
<u>16</u>	WWIS		836 BOYD STREET Ottawa ON Well ID: 7175486	ESE/29.5	0.73	<u>145</u>
<u>17</u>	PINC	MTS ALLSTREAM INC	1793 KERR AVE.,OTTAWA,ON,K2A 1J2, CA ON	WSW/32.8	0.77	<u>148</u>
<u>17</u>	SPL	Enbridge Gas Distribution Inc.	1793 Kerr Avenue Ottawa ON	WSW/32.8	0.77	<u>148</u>
<u>18</u>	GEN	GLIDDEN PAINTS/ICI PAINTS (CANADA) INC.	819 BOYD AVENUE OTTAWA ON K2A 2C8	ENE/39.2	0.76	<u>149</u>
<u>18</u>	GEN	GLIDDEN PAINTS 17-533	ICI PAINTS (CANADA) INC. 819 BOYD AVENUE OTTAWA ON K2A 2C8	ENE/39.2	0.76	<u>150</u>
<u>18</u>	GEN	GLIDDEN PAINTS/ICI PAINTS (CANADA) INC	819 BOYD AVENUE OTTAWA ON K2A 2C8	ENE/39.2	0.76	<u>150</u>
<u>19</u>	SPL		East left turning lane @ Broadview Ave & Carlingview Ave. OTTAWA ON	W/43.5	0.75	<u>151</u>
<u>20</u>	SCT	International Kafia Coffee	842 Boyd Ave Ottawa ON K2A 2E1	ESE/44.8	0.73	<u>152</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
20	WWIS		842 BOYD AVENUE Ottawa ON Well ID: 7270130	ESE/44.8	0.73	152
21	SCT	Advanced Prefabs Ltd.	811 Boyd Ave Ottawa ON K2A 2C8	ENE/48.7	0.76	154
22	BORE		ON	W/51.5	0.75	154
23	EHS		1723 Carling Ave Ottawa ON K2A1C8	N/52.0	-0.16	155
24	WWIS		ON Well ID: 7204981	SE/54.1	0.73	156
25	GEN	CAPITAL FOOD SERVICES LTD.	830 CAMPBELL AVE. OTTAWA ON K2A 2C2	E/54.6	0.77	157
25	GEN	CAPITAL FOOD SERVICES LTD.	830 CAMPBELL AVE. OTTAWA ON K2A 2C2	E/54.6	0.77	157
25	GEN	CAPITAL FOOD SERVICES (OUT OF BUSINESS)	830 CAMPBELL AVE. OTTAWA ON K2A 2C2	E/54.6	0.77	157
25	GEN	CAPITAL FOOD SERVICES LTD. 08-359	830 CAMPBELL AVE. OTTAWA ON K2A 2C2	E/54.6	0.77	158
25	WWIS		830 CAMPBELL AVE OTTAWA ON Well ID: 7272146	E/54.6	0.77	158
25	WWIS		830 CAMPBELL AVE OTTAWA ON Well ID: 7272145	E/54.6	0.77	161
25	GEN	HTS Engineering Ltd	101-830 Campbell Drive Ottawa ON K2A2C4O	E/54.6	0.77	164
25	GEN	HTS Engineering Ltd	101-830 Campbell Drive Ottawa ON K2A2C4	E/54.6	0.77	164

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>25</u>	GEN	HTS Engineering Ltd	101-830 Campbell Drive Ottawa ON K2A2C4	E/54.6	0.77	<u>165</u>
<u>26</u>	SPL		Carling Ave and Broadview Ave, Ottawa OTTAWA ON	W/57.8	0.75	<u>165</u>
<u>27</u>	EHS		1767 and 1775 Carling Avenue Ottawa ON K2A 1C9	WNW/58.1	-0.22	<u>166</u>
<u>28</u>	EHS		830 Campbell Ottawa ON	E/61.3	0.77	<u>166</u>
<u>29</u>	SCT	Vision Circuit Technologies Inc.	1712 Carling Ave Ottawa ON K2A 1C7	NE/63.7	0.77	<u>166</u>
<u>30</u>	SPL	RESTAURANT	1775 CARLINGS, CHAOPHRAYA THAI CUISINE (N.O.S.) OTTAWA CITY ON	WNW/66.2	-0.23	<u>166</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	E/66.6	0.73	<u>167</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERV (OUT OF BUSINESS)	850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	E/66.6	0.73	<u>168</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC. 10-252	850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	E/66.6	0.73	<u>168</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON	E/66.6	0.73	<u>169</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON	E/66.6	0.73	<u>169</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON	E/66.6	0.73	<u>169</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	E/66.6	0.73	<u>170</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON	E/66.6	0.73	<u>170</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	E/66.6	0.73	<u>171</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	E/66.6	0.73	<u>171</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	E/66.6	0.73	<u>172</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC. INDEPENDENT LINEN SERVICE	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	E/66.6	0.73	<u>172</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC. INDEPENDENT LINEN SERVICE	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	E/66.6	0.73	<u>173</u>
<u>31</u>	GEN	CLEANWEAR UNIFORM SERVICE INC. INDEPENDENT LINEN SERVICE	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	E/66.6	0.73	<u>173</u>
<u>32</u>	WWIS		ON Well ID: 1507965	WNW/68.7	-0.18	<u>174</u>
<u>33</u>	CA	CLEANWEAR UNIFORM SERVICE INC.	847 BOYD AVENUE OTTAWA CITY ON K2A 2C9	E/69.7	0.73	<u>176</u>
<u>34</u>	WWIS		ON Well ID: 1508303	NNW/72.1	-0.27	<u>176</u>
<u>35</u>	BORE		ON	NNW/72.2	-0.27	<u>179</u>
<u>36</u>	EHS		843 Boyd Ave Ottawa ON Ottawa ON K2A 2C9	ESE/72.4	0.74	<u>180</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
37	WWIS		ON Well ID: 1507936	SW/76.1	0.76	180
38	CA	JEWISH COMMUNITY CAMPUS OF OTTAWA	831 BROADVIEW AVE. (SWM) OTTAWA CITY ON K2A 2M6	SW/78.3	0.78	183
39	EHS		850 Boyd Avenue Ottawa ON K2A 2E1	SE/81.1	0.77	184
40	SCT	LADY JANE DONUTS LIMITED	1779 CARLING AVE OTTAWA ON K2A 1C9	W/83.5	-0.26	184
40	EHS		1779 Carling Avenue Ottawa ON K2A 1C9	W/83.5	-0.26	184
41	SPL	OTTAWA HYDRO	490 WELLESLEY AVE TRANSFORMER OTTAWA CITY ON K2A 1B7	WNW/83.8	-0.21	184
42	WWIS		ON Well ID: 1508300	NW/83.9	-0.18	185
42	WWIS		ON Well ID: 1508301	NW/83.9	-0.18	188
43	PINC	DONALD OCONNOR	1807 KERR AVE.,OTTAWA,ON,K2A 1J2, CA ON	WSW/88.9	1.76	191
44	WWIS		ON Well ID: 1508379	WSW/94.4	1.76	192
45	GEN	OTTAWA ROMAN CATHOLIC S. S. BOARD	MAINTENCE FACILITY 1774 KERR AVENUE OTTAWA-CARLETON ON K2A 1R9	SSE/94.8	1.72	194
45	GEN	OTTAWA ROMAN CATHOLIC S. S. BOARD 29-612	MAINTENCE FACILITY 1774 KERR AVE. OTTAWA-CARLETON ON K2A 1R9	SSE/94.8	1.72	195
45	GEN	OTTAWA ROMAN CATHOLIC SEPARATE SCHOOL BD	MAINTENCE FACILITY 1774 KERR AVENUE OTTAWA-CARLETON ON K2A 1R9	SSE/94.8	1.72	195

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
46	WWIS		770 BROADVIEW OTTAWA ON <i>Well ID: 7238475</i>	W/98.5	-0.23	196
47	ECA	Claridge Homes (1717 Carling) Inc.	1707 Carling Ave 1717 Carling Avenue Ottawa ON K2P 0Y6	NNE/99.9	0.64	199
47	ECA	Claridge Homes (1717 Carling) Inc.	1707 Carling Ave 1717 Carling Avenue Ottawa ON K2P 0Y6	NNE/99.9	0.64	199
48	BORE		ON	W/101.3	-0.23	199
49	CA	CLEANWEAR UNIFORM SERVICE INC.	843 BOYD AVENUE OTTAWA CITY ON K2A 2C9	ESE/101.4	0.74	201
49	SPL	AUTOMOTIVE REPAIR SHOP	843 BOYD OTTAWA CITY ON K2A 2C9	ESE/101.4	0.74	202
49	SPL	DRY CLEANER	843 BOYD AVE. (N.O.S.) OTTAWA CITY ON K2A 2C9	ESE/101.4	0.74	202
49	CA	Cleanwear Uniform Service Inc.	843 Boyd Avenue Ottawa ON K2A 2C9	ESE/101.4	0.74	203
49	ECA	Cleanwear Uniform Service Inc.	843 Boyd Avenue Ottawa ON K2A 2C9	ESE/101.4	0.74	204
49	EHS		843 Boyd Ave Ottawa ON K2A2C9	ESE/101.4	0.74	204
50	SCT	Aarkade Design & Offset Printing Inc.	854 Boyd Ave Unit B Ottawa ON K2A 2E1	SE/103.1	1.79	204
50	EHS		854 Boyd, Ave, Ottawa ON K2A 2E1	SE/103.1	1.79	204
51	RSC	WEBB'S MOTEL LIMITED	1705 CARLING AVENUE ON Ottawa ON	NNE/106.7	0.64	205

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
51	PTTW	Claridge Homes (1717 Carling) Inc.	1705 Carling Avenue Ottawa, ON Canada ON	NNE/106.7	0.64	205
52	PINC	PIPELINE HIT - 2"	21 NADOLNY SACHS PVT,,OTTAWA,ON, K2A 1R9,CA ON	SSE/112.3	1.72	205
52	GEN	Capital elevator Ltd	21 Nadolny Satch Ottawa ON K2A 1R9	SSE/112.3	1.72	206
53	GEN	857-861 Boyd Inc.	857 Boyd Avenue Ottawa ON K2A 2C9	ESE/114.2	1.47	206
54	RST	MANNION PETROLEUM	1700B DOHENY ST OTTAWA ON K2A 1J4	E/114.3	0.64	207
55	WWIS		ON Well ID: 7206030	ENE/117.1	0.71	207
56	SCT	Mansfield & Rodney Printing	861 Boyd Ave Ottawa ON K2A 2C9	ESE/119.0	1.46	208
56	SCT	Wil-Mac Labels	861 Boyd Ave Ottawa ON K2A 2C9	ESE/119.0	1.46	208
56	EHS		861 Boyd Avenue Ottawa ON K2A 2C9	ESE/119.0	1.46	208
57	EHS		815 Campbell Avenue Ottawa ON K2A 2C4	ENE/119.7	0.76	209
57	ECA	Import Car Centre Sales Inc.	815 Campbell Rd Ottawa ON K1Z 5Z6	ENE/119.7	0.76	209
58	SCT	Al Parsons Electronics Ltd.	860 Boyd Ave Ottawa ON K2A 2E1	SE/121.5	1.79	209
58	EHS		860 Boyd Avenue Ottawa ON K2A 2E1	SE/121.5	1.79	210

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
59	BORE		ON	SSW/121.8	1.76	210
60	GEN	MEDICAL PHARMACY	770 BROADVIEW AVENUE OTTAWA ON K2A 3Z3	W/125.6	-0.23	211
60	EHS		770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	212
60	GEN	Britannia Medical Centre	770 Broadview Avenue Suite 203 Ottawa ON K2A 3Z3	W/125.6	-0.23	212
60	GEN	Britannia Medical Centre	770 Broadview Avenue Suite 203 Ottawa ON K2A 3Z3	W/125.6	-0.23	212
60	GEN	Fraser Scott-Thomas Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	213
60	GEN	Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	213
60	GEN	Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON	W/125.6	-0.23	213
60	EHS		770 Broadview Ave Ottawa ON K2A3Z3	W/125.6	-0.23	214
60	GEN	2520762 Ontario Inc.	210-770 Broadview Ave Ottawa ON K2A3Z3	W/125.6	-0.23	214
60	GEN	Rosenbloom,Morris, Goldman and Poitras	305-770 Broadview Ave Ottawa ON K2A 3Z3	W/125.6	-0.23	214
60	GEN	David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	W/125.6	-0.23	214
60	GEN	Dr. Timothy Capello/ Dr. Jodie Murray	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	W/125.6	-0.23	215

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
60	GEN	David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	W/125.6	-0.23	215
60	GEN	Rosenbloom,Morris and Goldman	305-770 Broadview Ave Ottawa ON K2A 3Z3	W/125.6	-0.23	216
60	GEN	Dr. Mark Smith	770 Broadview Avenue Suite 308 Ottawa ON K2A3Z3	W/125.6	-0.23	216
60	GEN	Drs. Levitan and Bartlett	205-770 Broadview Ave. Ottawa ON K2A3Z3	W/125.6	-0.23	216
60	GEN	Dr. Mark Smith	770 Broadview Avenue Suite 308 Ottawa ON K2A3Z3	W/125.6	-0.23	217
60	GEN	Drs. Levitan and Bartlett	205-770 Broadview Ave. Ottawa ON K2A3Z3	W/125.6	-0.23	217
60	GEN	Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	217
60	GEN	Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	218
60	GEN	Dr. Timothy Capello/ Dr. Jodie Murray	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	W/125.6	-0.23	218
60	GEN	Drs. Levitan and Bartlett	205-770 Broadview Ave. Ottawa ON K2A3Z3	W/125.6	-0.23	219
60	GEN	Dr. Timothy Capello/ Dr. Jodie Murray	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	W/125.6	-0.23	219
60	GEN	Rosenbloom,Morris and Goldman	305-770 Broadview Ave Ottawa ON K2A 3Z3	W/125.6	-0.23	219
60	GEN	David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	W/125.6	-0.23	220

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
60	GEN	Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	220
60	GEN	Postras, Giles, Lewin, & Kennedy	305-770 Broadview Ave Ottawa ON K2A 3Z3	W/125.6	-0.23	220
60	GEN	2520762 Ontario Inc.	210-770 Broadview Ave Ottawa ON K2A3Z3	W/125.6	-0.23	221
60	GEN	Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	221
60	GEN	Drs. Levitan and Bartlett	205-770 Broadview Ave. Ottawa ON K2A3Z3	W/125.6	-0.23	222
60	GEN	Dr. Timothy Capello/ Dr. Jodie Murray	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	W/125.6	-0.23	222
60	GEN	David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	W/125.6	-0.23	222
60	EHS		770 Broadview Ave Ottawa ON K2A3Z3	W/125.6	-0.23	223
60	GEN	2520762 Ontario Inc.	210-770 Broadview Ave Ottawa ON K2A3Z3	W/125.6	-0.23	223
60	GEN	Postras, Giles, Lewin, & Kennedy	305-770 Broadview Ave Ottawa ON K2A 3Z3	W/125.6	-0.23	223
60	GEN	Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	224
60	GEN	David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	W/125.6	-0.23	224
60	GEN	Dr. Timothy Capello/ Dr. Jodie Murray	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	W/125.6	-0.23	224

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
60	GEN	Dr. Riva Levitan	205-770 Broadview Ave. Ottawa ON K2A3Z3	W/125.6	-0.23	225
60	GEN	Dr. Timothy Capello/Dr. Iryna Yeuchyk	770 Broadview Ave Suite B4 Ottawa ON K2A3Z3	W/125.6	-0.23	225
60	GEN	Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	225
60	GEN	2520762 Ontario Inc.	210-770 Broadview Ave Ottawa ON K2A3Z3	W/125.6	-0.23	226
60	GEN	Dr. Riva Levitan	205-770 Broadview Ave. Ottawa ON K2A3Z3	W/125.6	-0.23	226
60	GEN	David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	W/125.6	-0.23	227
60	GEN	Poitras, Giles, Lewin, & Kennedy	305-770 Broadview Ave Ottawa ON K2A 3Z3	W/125.6	-0.23	227
60	GEN	Lovell Drugs Limited	770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	227
60	GEN	Lovell Drugs Limited	770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	228
60	GEN	Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	W/125.6	-0.23	228
60	GEN	Dr. Riva Levitan	205-770 Broadview Ave. Ottawa ON K2A3Z3	W/125.6	-0.23	228
60	GEN	Poitras, Giles, Lewin, & Kennedy	305-770 Broadview Ave Ottawa ON K2A 3Z3	W/125.6	-0.23	229
60	GEN	David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	W/125.6	-0.23	229

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
60	GEN	2520762 Ontario Inc.	210-770 Broadview Ave Ottawa ON K2A3Z3	W/125.6	-0.23	230
60	GEN	Dr. Timothy Capello/Dr. Iryna Yeuchyuk	770 Broadview Ave Suite B4 Ottawa ON K2A3Z3	W/125.6	-0.23	230
60	EHS		770 Broadview Ave Ottawa ON K2A 3Z3	W/125.6	-0.23	230
61	WWIS		ON Well ID: 1508094	SW/128.4	1.76	230
62	EHS		857 Boyd Avenue Ottawa ON K2A 2C9	ESE/128.7	1.75	233
63	SPL		851 Campbell Ave. Ottawa ON K2A 2C6	E/130.2	0.63	233
63	HINC		851 CAMPBELL AVENUE OTTAWA ON K2A 2C6	E/130.2	0.63	234
64	BORE		ON	W/130.3	0.74	235
65	WWIS		857 Boyd Ave Ottawa ON Well ID: 7343574	ESE/133.3	1.75	237
66	HINC		465 WELLESLEY AVENUE OTTAWA ON K2A 1B5	NNW/135.6	-0.29	241
67	WWIS		857 Boyd Ave Ottawa ON Well ID: 7343575	ESE/136.0	1.75	241
68	EHS		1696 Carling Avenue Ottawa ON K2A 1C6	ENE/137.0	0.69	245
69	SPL	LACOMBE WASTE OIL	J&L AUTOMOTIVE 849 CAMPBELL RD GLOUCESTER SITE 5573 POWER ROAD, RR # 6	E/138.5	0.61	245

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			OTTAWA CITY ON K2A 2C6			
70	WWIS		770 BROADVIEW Ottawa ON Well ID: 7238477	W/139.4	0.69	246
71	SCT	NU-TEK SIGNS	866 CAMPBELL AVE OTTAWA ON K2A 2C5	ESE/143.6	1.33	249
71	SCT	WYMAN & SON PUBLICATIONS LTD	866 CAMPBELL AVE OTTAWA ON K2A 2C5	ESE/143.6	1.33	249
71	SCT	Signs.ca/Nu-Tek Signs	866 Campbell Ave Ottawa ON K2A 2C5	ESE/143.6	1.33	250
71	GEN	NU-TEK SIGNS	866 CAMPBELL AVENUE OTTAWA ON K2A 2C5	ESE/143.6	1.33	250
71	GEN	12522890 Ontario Inc	866 Campbell Avenue Ottawa ON K2A 2C5	ESE/143.6	1.33	250
71	SCT	Signs.ca	866 Campbell Ave Ottawa ON K2A 2C5	ESE/143.6	1.33	251
71	GEN	1230372 Ontario Inc	866 Campbell Ave Ottawa ON K2A 2C5	ESE/143.6	1.33	251
71	GEN	1230372 Ontario Inc	866 Campbell Ave Ottawa ON K2A 2C5	ESE/143.6	1.33	251
72	WWIS		770 BROADVIEW OTTAWA ON Well ID: 7238476	W/147.4	0.05	252
73	SPL	Sealtest Enterprises Ltd. <UNOFFICIAL>	1845 Carling Avenue Ottawa ON	W/147.8	0.69	255
74	WWIS		ON Well ID: 7379159	E/148.8	0.62	256

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>75</u>	SPL	Enbridge Gas Distribution Inc.	744 Highland Avenue Ottawa ON	NW/150.8	-1.24	<u>256</u>
<u>75</u>	PINC	STONE TECH	744 HIGHLAND AVE.,OTTAWA,ON,K2A 2K7,CA ON	NW/150.8	-1.24	<u>257</u>
<u>76</u>	EHS		855 Campbell Avenue Ottawa ON K2A 2C6	E/153.9	0.55	<u>258</u>
<u>76</u>	GEN	BOEYENS' COMMUNICATION CONTRACTORS LIMITED	855 CAMPBELL AVENUE OTTAWA ON K2A 2C6	E/153.9	0.55	<u>258</u>
<u>77</u>	EHS		863 Campbell Avenue Ottawa ON K2A 2C6	ESE/155.9	0.43	<u>258</u>
<u>78</u>	EHS		1688 and 1690 Carling Ave Ottawa ON	ENE/156.5	1.02	<u>259</u>
<u>78</u>	EHS		1688 Carling Avenue Ottawa ON	ENE/156.5	1.02	<u>259</u>
<u>79</u>	WWIS		861 BOYD AVE. Ottawa ON Well ID: 7197303	ESE/158.2	1.71	<u>259</u>
<u>80</u>	WWIS		361 BOYD AVE. Ottawa ON Well ID: 7197302	ESE/159.1	1.65	<u>262</u>
<u>81</u>	EHS		848 Clyde Avenue North Ottawa ON K2A 1J4	E/159.2	0.63	<u>265</u>
<u>82</u>	PRT	SUPERIOR PROPANE INC	848 CLYDE AV OTTAWA ON K1Z5A2	E/159.2	0.63	<u>265</u>
<u>82</u>	GEN	POWERAIR OF CANADA LTD.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>265</u>
<u>82</u>	GEN	POWERAIR OF CANADA LTD.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>266</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>82</u>	GEN	MANNION'S PUMP HOUSE LTD.	848 CLYDE AVENUE OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>266</u>
<u>82</u>	GEN	POWERAIR OF CANADA LTD. 30-392	848 CLYDE AVE. OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>267</u>
<u>82</u>	GEN	MANNION'S PUMP HOUSE LIMITED	848 CLYDE AVENUE OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>267</u>
<u>82</u>	GEN	MANNION'S PUMP HOUSE LIMITED	848 CLYDE AVE. OTTAWA ON	E/159.2	0.63	<u>267</u>
<u>82</u>	GEN	MANNION'S PUMP HOUSE LTD.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>268</u>
<u>82</u>	DTNK	SUPERIOR PROPANE INC	848 CLYDE AVE OTTAWA ON	E/159.2	0.63	<u>268</u>
<u>82</u>	GEN	MANNION'S PUMP HOUSE LTD.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>269</u>
<u>82</u>	EHS		848 Clyde Avenue Ottawa ON	E/159.2	0.63	<u>269</u>
<u>82</u>	GEN	THE PUMP HOUSE INC.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>269</u>
<u>82</u>	GEN	THE PUMP HOUSE INC.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>270</u>
<u>82</u>	GEN	THE PUMP HOUSE INC.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>270</u>
<u>82</u>	GEN	THE PUMP HOUSE INC.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	E/159.2	0.63	<u>271</u>
<u>83</u>	WWIS		ON Well ID: 1508095	SW/161.2	1.76	<u>271</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>84</u>	SPL	OTTAWA HYDRO	DOBBIE AVE AND BOYD ST MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SE/162.4	1.76	<u>274</u>
<u>85</u>	GEN	COLOR YOUR WORLD	1840 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/163.4	1.75	<u>275</u>
<u>85</u>	GEN	ROBERT M. LEMIEUX PAINTS LTD.	1840 CARLING AVENUE OTTAWA ON K2A 1E2	WSW/163.4	1.75	<u>275</u>
<u>85</u>	EHS		1840 Carling Avenue Ottawa ON K2A 1E2	WSW/163.4	1.75	<u>276</u>
<u>85</u>	EHS		1840 Carling Ave Ottawa ON K2A1E2	WSW/163.4	1.75	<u>276</u>
<u>85</u>	EHS		1840 Carling Ave Ottawa ON K2A 1E2	WSW/163.4	1.75	<u>276</u>
<u>86</u>	GEN	Benson Auto Parts	863 Campbell Avenue Ottawa ON K2A 2C6	ESE/169.2	0.43	<u>276</u>
<u>87</u>	WWIS		ON Well ID: 7405897	ENE/170.2	1.34	<u>277</u>
<u>88</u>	WWIS		ON Well ID: 7311632	E/171.7	0.62	<u>277</u>
<u>89</u>	SPL	City of Ottawa	Carling Ave and Cole Ave Ottawa ON	NE/172.6	1.67	<u>278</u>
<u>90</u>	GEN	Hydro OTTAWA LIMITED	882 CAMPBELL AVE OTTAWA ON K2A 2C5	ESE/173.6	1.61	<u>279</u>
<u>91</u>	EHS		856 Clyde Avenue Ottawa ON K1Z 5A2	E/175.4	0.64	<u>279</u>
<u>92</u>	WWIS		ON Well ID: 1507939	WNW/176.0	-0.98	<u>280</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>93</u>	EHS		878 Boyd Avenue Ottawa ON K2A 2E3	SE/180.8	1.73	<u>282</u>
<u>94</u>	GEN	Jewish Community Campus of Ottawa Inc	31 Nadolny Sachs Pr Ottawa ON K2A 1R9	S/184.8	1.79	<u>282</u>
<u>95</u>	WWIS		877 BOYD AVENUE Ottawa ON Well ID: 7163796	ESE/187.5	1.65	<u>283</u>
<u>96</u>	WWIS		877 BOYD AVE Ottawa ON Well ID: 7159361	ESE/189.1	1.65	<u>286</u>
<u>97</u>	SPL	Enbridge Gas Distribution Inc.	840 Denison Crescent Ottawa ON	SW/189.4	2.76	<u>289</u>
<u>97</u>	PINC	PIPELINE HIT - 1/2"	840 DENISON CRESCENT,,OTTAWA,ON, K2A 2N5,CA ON	SW/189.4	2.76	<u>290</u>
<u>98</u>	WWIS		877 BOYD AVENUE Ottawa ON Well ID: 7163797	ESE/189.5	1.65	<u>290</u>
<u>99</u>	SCT	MASTRON MECHANICAL 1988 LTD	877 BOYD AVE OTTAWA ON K2A 2E2	SE/191.7	1.67	<u>294</u>
<u>99</u>	SCT	National Cabinet Design Supplies & Accessories Ltd.	877A Boyd Ave Ottawa ON K2A 2E2	SE/191.7	1.67	<u>294</u>
<u>99</u>	SCT	Breck-Mar Sales & Service Ltd.	877 Boyd Ave Ottawa ON K2A 2E2	SE/191.7	1.67	<u>294</u>
<u>99</u>	EHS		877 Boyd Avenue Ottawa ON	SE/191.7	1.67	<u>294</u>
<u>100</u>	PES	SWISH MAINTENANCE LIMITED	864 CLYDE AVENUE OTTAWA ON K1Z 5A2	E/191.9	0.66	<u>295</u>
<u>100</u>	SCT	Ottawa Solar Power Inc.	864 Clyde Ave Ottawa ON K1Z 5A2	E/191.9	0.66	<u>295</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>100</u>	GEN	Tomlinson Tomlinson	864 Clyde Ave N Ottawa ON K1Z 5A4	E/191.9	0.66	<u>295</u>
<u>101</u>	EBR	3240797 Canada Inc.	870 Clyde Avenue Ottawa CITY OF OTTAWA ON	E/195.5	0.65	<u>296</u>
<u>101</u>	CA	3240797 Canada Inc.	870 Clyde Ave Ottawa ON K1Z 5A2	E/195.5	0.65	<u>296</u>
<u>101</u>	SPL		870 Clyde Ave Ottawa ON	E/195.5	0.65	<u>296</u>
<u>101</u>	INC		870 CLYDE AVE, OTTAWA ON	E/195.5	0.65	<u>297</u>
<u>101</u>	ECA	3240797 Canada Inc.	870 Clyde Ave Ottawa ON K1Z 5A2	E/195.5	0.65	<u>298</u>
<u>102</u>	WWIS		877 BOYD AVE Ottawa ON Well ID: 7158273	SE/195.6	1.72	<u>298</u>
<u>103</u>	WWIS		877 BOYD AVENUE Ottawa ON Well ID: 7163795	SE/196.5	1.67	<u>305</u>
<u>104</u>	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7220446	E/196.5	0.67	<u>308</u>
<u>105</u>	WWIS		877 BOYD AVENUE Ottawa ON Well ID: 7163798	ESE/196.7	1.61	<u>311</u>
<u>106</u>	WWIS		877 BOYD AVENUE Ottawa ON Well ID: 7163794	SE/197.7	1.67	<u>315</u>
<u>107</u>	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7220405	E/197.7	0.67	<u>318</u>
<u>108</u>	WWIS		877 BOYD AVE Ottawa ON Well ID: 7159360	ESE/197.8	1.67	<u>321</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
109	WWIS		ON Well ID: 7379158	E/198.0	0.68	324
110	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7220406	E/199.2	0.67	325
111	WWIS		ON Well ID: 7379166	E/200.8	0.68	328
112	CA	Medaglia Auto Imports Inc.	10 Dobbie Street Ottawa ON K2A 4G1	ESE/201.4	0.58	329
112	SPL	Medaglia Auto Imports Inc.	10 Dobbie St Ottawa ON K2A 4G1	ESE/201.4	0.58	329
112	ECA	Medaglia Auto Imports Inc.	10 Dobbie Street Ottawa ON K2A 2C9	ESE/201.4	0.58	330
113	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7220444	E/202.6	0.67	330
114	WWIS		ON Well ID: 7240874	E/203.7	0.68	334
115	SPL	Enbridge Gas Distribution Inc.	Carling and Rex Ottawa ON	WSW/204.6	1.75	334
116	PINC	JOSIE MONTGOMERY O/A MAL'S GROCERY	844 DENISON CRES.,OTTAWA,ON,K2A 2N5,CA ON	SW/204.8	2.06	335
117	WWIS		ON Well ID: 1508088	SW/205.2	2.77	336
117	WWIS		ON Well ID: 1508090	SW/205.2	2.77	339
118	WWIS		ON Well ID: 1508086	SSW/205.2	2.74	342

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>119</u>	GEN	AECON UTILITIES INC.	874 CLYDE AVENUE OTTAWA ON K1Z 5A2	ESE/206.8	0.63	<u>345</u>
<u>120</u>	WWIS		ON Well ID: 1508093	WSW/207.9	2.75	<u>346</u>
<u>121</u>	WWIS		ON Well ID: 1508040	E/208.2	0.67	<u>348</u>
<u>122</u>	WWIS		ON Well ID: 1508380	WSW/209.2	2.75	<u>351</u>
<u>123</u>	WWIS		861 CLYDE AVE. Ottawa ON Well ID: 7114836	E/210.9	0.68	<u>354</u>
<u>124</u>	NPCB	OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>362</u>
<u>124</u>	SPL	SCHOOL	710 BROADVIEW HEATING OIL TANK OTTAWA CITY ON K2A 2M2	W/212.1	-0.25	<u>363</u>
<u>124</u>	OPCB	OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>364</u>
<u>124</u>	OPCB	OTTAWA-CARLETON CATHOLIC SCHOOL BOARD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>364</u>
<u>124</u>	OPCB	OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>364</u>
<u>124</u>	OPCB	OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>364</u>
<u>124</u>	OPCB	OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>365</u>
<u>124</u>	GEN	OTTAWA BOARD OF EDUCATION	HIGHLAND PARK HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>365</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>124</u>	GEN	OTTAWA BOARD OF EDUCATION 29-548	HIGHLAND PARK HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>366</u>
<u>124</u>	GEN	OTTAWA R.C. SEPARATE SCHOOL BOARD	NOTRE DAME HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>366</u>
<u>124</u>	GEN	OTTAWA-CARLETON CATHOLIC SCHOOL BOARD	NOTRE DAME HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>367</u>
<u>124</u>	GEN	Ottawa-Carleton Catholic School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>367</u>
<u>124</u>	OPCB	OTTAWA-CARLETON CATHOLIC SCHOOL BOARD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>368</u>
<u>124</u>	NPCB	OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	W/212.1	-0.25	<u>368</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>368</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>369</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>370</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>371</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>371</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON	W/212.1	-0.25	<u>372</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>373</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>374</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>375</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>376</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>377</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>379</u>
<u>124</u>	GEN	Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	W/212.1	-0.25	<u>380</u>
<u>125</u>	WWIS		861 CLYDE ST OTTAWA ON Well ID: 7155921	E/213.6	0.68	<u>382</u>
<u>126</u>	WWIS		ON Well ID: 7379167	E/213.9	0.69	<u>385</u>
<u>127</u>	WWIS		ON Well ID: 7379163	E/214.4	0.70	<u>386</u>
<u>128</u>	SCT	OTTAWA AWNING & CANVAS LTD	883 BOYD AVE OTTAWA ON K2A 2E2	SE/214.4	1.67	<u>386</u>
<u>128</u>	SCT	Ottawa Awning & Canvas Ltd.	883 Boyd Ave Ottawa ON K2A 2E2	SE/214.4	1.67	<u>387</u>
<u>129</u>	WWIS		861 CLYDE AVE Ottawa ON	E/214.7	0.69	<u>387</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7245027			
129	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7245028	E/214.7	0.69	389
130	WWIS		ON Well ID: 7379161	E/215.7	0.69	391
131	WWIS		861 Clyde Avenue lot I con A Ottawa ON Well ID: 7337587	E/216.3	0.68	392
132	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7220407	E/217.3	0.70	395
133	WWIS		861 CLYDE AVE ON Well ID: 7220435	E/217.6	0.70	398
134	EHS		1845-1855 Carling Ave Ottawa ON K2A 1E4	W/218.5	1.05	402
135	PINC	JOERNS HEALTHCARE INC	859 DENISON CRES.,OTTAWA,ON,K2A 2N4,CA ON	SSW/219.0	2.74	402
136	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7220408	E/220.1	0.70	402
136	WWIS		861 CKYDE AVE Ottawa ON Well ID: 7220437	E/220.1	0.70	406
137	WWIS		897 BOYD AVE OTTAWA ON Well ID: 7305656	SE/220.4	1.62	409
138	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7220438	E/221.4	0.70	412
139	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7220436	E/222.0	0.70	415
140	EHS		1846 Carling Avenue Ottawa ON K2A 1E2	WSW/223.2	1.71	418

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
141	WWIS		ON Well ID: 7379178	E/224.4	0.67	419
142	WWIS		ON Well ID: 7379172	E/224.8	0.69	419
143	WWIS		861 CLYDE AVE OTTAWA ON Well ID: 7246037	E/224.9	0.69	420
144	EHS		897 Boyd Ave Ottawa ON K2A2E2	SE/225.0	1.62	422
145	WWIS		ON Well ID: 7235388	E/225.2	0.69	422
146	WWIS		ON Well ID: 1508085	SSW/225.2	2.74	423
147	WWIS		861 CLYDE AV. Ottawa ON Well ID: 7326561	E/225.3	0.69	426
147	WWIS		ON Well ID: 7379175	E/225.3	0.69	430
148	WWIS		ON Well ID: 7379162	E/225.4	0.69	431
149	WWIS		861 CLYDE AVENUE Ottawa ON Well ID: 7271919	E/225.6	0.69	432
150	WWIS		ON Well ID: 7379171	E/227.0	0.69	435
151	WWIS		ON Well ID: 1508302	NW/227.2	-1.29	436
152	PINC	PIPELINE HIT	1848 CARLING AVENUE,,OTTAWA,ON, K2A 1E3,CA ON	WSW/227.8	1.71	438

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
153	EHS		883 & 891 Boyd Avenue Ottawa ON	SE/229.3	1.69	439
154	SCT	LUMI-LUX LTD	890 BOYD AVE OTTAWA ON K2A 2E3	SE/229.3	2.01	439
155	WWIS		861 CLYDE AVE Ottawa ON <i>Well ID:</i> 7245029	E/229.9	0.69	439
156	WWIS		lot 29 con 1 ON <i>Well ID:</i> 1503963	NE/229.9	1.69	441
157	BORE		ON	NE/230.0	1.69	444
158	WWIS		861 CLYDE RD OTTAWA ON <i>Well ID:</i> 7155923	E/231.1	0.69	446
159	WWIS		ON <i>Well ID:</i> 1507935	WNW/231.4	-1.26	449
160	BORE		ON	WNW/231.5	-1.26	452
161	BORE		ON	ESE/231.7	0.64	453
162	WWIS		ON <i>Well ID:</i> 1508091	SW/232.6	2.77	454
163	WWIS		861 CLYDE AVE Ottawa ON <i>Well ID:</i> 7183403	E/232.8	0.70	457
164	WWIS		861 CLYDE AVE Ottawa ON <i>Well ID:</i> 7172122	E/233.0	0.69	461
165	WWIS		ON	E/233.0	0.69	464

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7379177			
166	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7172118	E/233.1	0.69	465
167	WWIS		861 CLYDE AVE. OTTAWA ON Well ID: 7246035	E/233.3	0.70	468
168	WWIS		ON Well ID: 7267056	E/234.2	0.66	470
169	WWIS		861 CLYDE AVE. OTTAWA ON Well ID: 7246036	E/234.3	0.69	471
170	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7172119	E/234.4	0.70	473
171	GEN	The Growcer	891 Boyd Avenue Ottawa ON K2A 2E2	SE/234.9	1.62	476
171	EHS		891 Boyd Ave Ottawa ON K2A 2E2	SE/234.9	1.62	476
172	WWIS		ON Well ID: 7379164	E/235.0	0.70	477
173	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7172120	E/235.3	0.67	478
174	WWIS		861 CLYDE AV. Ottawa ON Well ID: 7326562	E/235.6	0.67	481
175	PINC	PIPELINE HIT - 1/2"	830 REX AVE,,OTTAWA,ON,K2A 2P5,CA ON	WSW/237.0	2.75	484
176	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7172199	E/237.2	0.70	485
177	EHS		890 Boyd Ave Ottawa ON Ottawa ON K2A 2E3	SE/237.5	2.01	488

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
178	WWIS		861 CLYDE AVE OTTAWA ON Well ID: 7155919	E/239.0	0.70	488
179	GEN	CARLING ANIMAL HOSPITAL 08-954	1850 CARLING AVENUE OTTAWA ON K2A 1E3	WSW/239.0	1.95	491
179	GEN	CARLING ANIMAL HOSPITAL	1850 CARLING AVENUE OTTAWA ON K2A 1E3	WSW/239.0	1.95	491
179	GEN	CARLING ANIMAL HOSPITAL	1850 Carling Ave Ottawa ON K2A 1E3	WSW/239.0	1.95	492
180	WWIS		861 CLYDE AVE OTTAWA ON Well ID: 7180632	E/239.3	0.70	492
181	WWIS		ON Well ID: 1508746	SW/239.4	2.75	495
181	WWIS		ON Well ID: 1508751	SW/239.4	2.75	499
182	SPL	WILLIAM NEILSON LTD.	861 CLYDE AVENUE OTTAWA PLANT 861 CLYDE AVENUE OTTAWA CITY ON K1Z 5A4	E/240.9	0.69	502
182	PRT	WILLIAM NEILSON LTEE	861 CLYDE AV OTTAWA ON K1Z 5A4	E/240.9	0.69	503
182	PRT	NEILSON DAIRY LTD	861 CLYDE AV OTTAWA ON K1Z5A4	E/240.9	0.69	503
182	CA	WILLIAM NEILSON LIMITED	861 CLYDE AVENUE OTTAWA CITY ON K1Z 5A4	E/240.9	0.69	503
182	SPL	WILLIAM NEILSON LTD.	861 CLYDE AVE. OTTAWA PLANT 861 CLYDE AVENUE OTTAWA CITY ON K1Z 5A4	E/240.9	0.69	504

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>182</u>	SCT	WILLIAM NEILSON LTD./LTÉE	861 Clyde Ave Ottawa ON K1Z 5A4	E/240.9	0.69	<u>504</u>
<u>182</u>	SPL	NEILSON DAIRY	NEILSON CANADA 861 CLYDE AVE OTTAWA TANK TRUCK (CARGO) OTTAWA CITY ON K1Z 5A4	E/240.9	0.69	<u>505</u>
<u>182</u>	SCT	William Neilson Ltd.	861 Clyde Ave Ottawa ON K1Z 5A4	E/240.9	0.69	<u>506</u>
<u>182</u>	CA		861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	<u>506</u>
<u>182</u>	GEN	WILLIAM NEILSON LTD.	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	E/240.9	0.69	<u>506</u>
<u>182</u>	GEN	WILLIAM NEILSON LTD.	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	E/240.9	0.69	<u>507</u>
<u>182</u>	GEN	WILLIAM NEILSON LTD. 42-059	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	E/240.9	0.69	<u>507</u>
<u>182</u>	GEN	WILLIAM NEILSON LTD. (OTTAWA)	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	E/240.9	0.69	<u>507</u>
<u>182</u>	GEN	WILLIAM NEILSON LIMITED (OTTAWA)	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	E/240.9	0.69	<u>508</u>
<u>182</u>	GEN	WILLIAM NEILSON LIMITED	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	E/240.9	0.69	<u>508</u>
<u>182</u>	DTNK	Wm. Neilson Ltd.	861 Clyde Ave. Ottawa ON K1Z 5A4	E/240.9	0.69	<u>509</u>
<u>182</u>	FSTH	WILLIAM NEILSON LTEE	861 CLYDE AVE OTTAWA ON K1Z 5A4	E/240.9	0.69	<u>510</u>
<u>182</u>	FSTH	NEILSON DAIRY LTD	861 CLYDE AVE OTTAWA ON K1Z 5A4	E/240.9	0.69	<u>510</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>182</u>	SPL	Camscott Trucking<UNOFFICIAL>	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	<u>510</u>
<u>182</u>	SPL	Neilson Dairy<UNOFFICIAL>	861 Clyde Ave Ottawa ON	E/240.9	0.69	<u>511</u>
<u>182</u>	SPL	William Neilson Co. Limited	861 Clyde Ave Ottawa ON K1Z 5A4	E/240.9	0.69	<u>512</u>
<u>182</u>	FSTH	WILLIAM NEILSON LTEE	861 CLYDE AVE OTTAWA ON K1Z 5A4	E/240.9	0.69	<u>513</u>
<u>182</u>	FSTH	NEILSON DAIRY LTD	861 CLYDE AVE OTTAWA ON K1Z 5A4	E/240.9	0.69	<u>513</u>
<u>182</u>	SCT	Saputo Dairy Products Canada	861 Clyde Ave Ottawa ON K1Z 5A4	E/240.9	0.69	<u>513</u>
<u>182</u>	GEN	Saputo Chesse GP	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	<u>514</u>
<u>182</u>	CA	William Neilson Co. Limited	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	<u>514</u>
<u>182</u>	SPL	Saputo Cheese G.P.	861 Clyde Ave Ottawa ON K1Z 5A4	E/240.9	0.69	<u>515</u>
<u>182</u>	SPL	Saputo Foods Limited acting as managing partner of	861 Clyde Ave. Ottawa ON K1Z 5A4	E/240.9	0.69	<u>515</u>
<u>182</u>	SPL	Saputo Cheese G.P.	861 Clyde Avenue<UNOFFICIAL> Ottawa ON K1Z 5A4	E/240.9	0.69	<u>516</u>
<u>182</u>	SPL	Saputo Foods Limited	861 Clyde Ave Ottawa ON K1Z 5A4	E/240.9	0.69	<u>517</u>
<u>182</u>	SPL	Saputo Foods Limited	861 Clyde Ave Ottawa ON K1Z 5A4	E/240.9	0.69	<u>518</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
182	HINC		861 CLYDE AVENUE OTTAWA ON K1Z 5A4	E/240.9	0.69	519
182	GEN	WILLIAM NEILSON LIMITED	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	E/240.9	0.69	519
182	GEN	Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	520
182	SPL	Saputo Dairy Products Canada	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	521
182	GEN	Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	522
182	GEN	Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	523
182	FST	SAPUTO DAIRY PRODUCTS CANADA G.P.	861 CLYDE AVE N OTTAWA ON	E/240.9	0.69	523
182	FST	WILLIAM NEILSON LTEE	861 CLYDE AVE N OTTAWA ON	E/240.9	0.69	524
182	GEN	Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	524
182	GEN	Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON	E/240.9	0.69	525
182	CFOT	W M NEILSON LTD	861 CLYDE AVE N OTTAWA ON	E/240.9	0.69	526
182	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7220445	E/240.9	0.69	526
182	SPL	Saputo Dairy Products Canda G. P.	861 Clyde Ave Ottawa ON NA	E/240.9	0.69	529

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>182</u>	EHS		861 Clyde Ave Ottawa ON K1Z5A4	E/240.9	0.69	<u>530</u>
<u>182</u>	EHS		861 Clyde Ave Ottawa ON K1Z5A4	E/240.9	0.69	<u>530</u>
<u>182</u>	ECA	Weston Inc.	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	<u>530</u>
<u>182</u>	ECA	William Neilson Co. Limited	861 Clyde Avenue Ottawa ON L7G 4B3	E/240.9	0.69	<u>531</u>
<u>182</u>	GEN	Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	<u>531</u>
<u>182</u>	GEN	Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	<u>532</u>
<u>182</u>	GEN	Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	<u>533</u>
<u>182</u>	GEN	Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	E/240.9	0.69	<u>534</u>
<u>182</u>	GEN	Vertex Environmental Inc. Vertex Environmental Inc.	861 Clyde Ave Ottawa ON K1Z 5A4	E/240.9	0.69	<u>535</u>
<u>182</u>	NPR2	OTTAWA	861 CLYDE AVENUE OTTAWA ON K1Z5A4	E/240.9	0.69	<u>535</u>
<u>183</u>	PES	VALIFF SALES INC	1660 CARLING AVE OTTAWA ON K2A 1C5	ENE/242.0	1.69	<u>548</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON K2A 1C5	ENE/242.0	1.69	<u>548</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON	ENE/242.0	1.69	<u>548</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>183</u>	PES	VALIFF SALES INC	1660 CARLING AVE OTTAWA ON K2A 1C5	ENE/242.0	1.69	<u>549</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON	ENE/242.0	1.69	<u>549</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON	ENE/242.0	1.69	<u>550</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON K2A 1C5	ENE/242.0	1.69	<u>550</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON	ENE/242.0	1.69	<u>551</u>
<u>183</u>	PES	VALIFF SALES INC	1660 CARLING AVE OTTAWA ON K2A1C5	ENE/242.0	1.69	<u>552</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	ENE/242.0	1.69	<u>552</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	ENE/242.0	1.69	<u>553</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	ENE/242.0	1.69	<u>554</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	ENE/242.0	1.69	<u>555</u>
<u>183</u>	PES	VALIFF SALES INC	1660 CARLING AVE OTTAWA ON K2A1C5	ENE/242.0	1.69	<u>556</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	ENE/242.0	1.69	<u>557</u>
<u>183</u>	PES	VALIFF SALES INC	1660 Carling AVE Ottawa ON K2A 1C5	ENE/242.0	1.69	<u>558</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	ENE/242.0	1.69	<u>558</u>
<u>183</u>	GEN	Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	ENE/242.0	1.69	<u>560</u>
<u>183</u>	GEN	Canadian Tire Real Estate Limited	1660 Carling Ave Ottawa ON K2A 1C5	ENE/242.0	1.69	<u>561</u>
<u>183</u>	EHS		1660 Carling Avenue Ottawa ON K2A 1C5	ENE/242.0	1.69	<u>562</u>
<u>184</u>	WWIS		861 CLYDE AV. Ottawa ON Well ID: 7326560	E/242.3	0.69	<u>562</u>
<u>185</u>	CA	OTTAWA CITY	BRIARWOOD AVE./TILLBURY AVE. OTTAWA CITY ON	NW/242.4	-1.25	<u>565</u>
<u>186</u>	WWIS		861 Clyde Avenue lot I con A Ottawa ON Well ID: 7337588	E/242.9	0.66	<u>565</u>
<u>187</u>	WWIS		ON Well ID: 1508736	WSW/242.9	2.75	<u>569</u>
<u>188</u>	BORE		ON	WSW/243.0	2.75	<u>571</u>
<u>189</u>	GEN	TRANSMISSIONS AUTOMOTIVE	757 COLE AVE. OTTAWA ON K2A 3W7	NE/243.6	1.68	<u>572</u>
<u>190</u>	WWIS		861 CLYDE AVENUE Ottawa ON Well ID: 7271920	E/243.6	0.70	<u>573</u>
<u>191</u>	WWIS		ON Well ID: 7267058	E/243.9	0.64	<u>576</u>
<u>192</u>	WWIS		ON Well ID: 7379169	E/244.1	0.70	<u>576</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>193</u>	WWIS		861 CLYDE RD OTTAWA ON Well ID: 7155920	E/244.9	0.70	<u>577</u>
<u>194</u>	SCT	D LYALL HANES LTD	894 BOYD AVE OTTAWA ON K2A 2E3	SE/245.1	2.01	<u>580</u>
<u>195</u>	WWIS		ON Well ID: 1508087	SSW/245.2	2.74	<u>581</u>
<u>196</u>	WWIS		581 CLYDE AV Ottawa ON Well ID: 7326721	E/245.3	0.69	<u>584</u>
<u>197</u>	WWIS		561 CLYDE AV Ottawa ON Well ID: 7326589	E/245.3	0.69	<u>589</u>
<u>197</u>	WWIS		561 CLYDE AV Ottawa ON Well ID: 7326590	E/245.3	0.69	<u>592</u>
<u>197</u>	WWIS		ON Well ID: 7379176	E/245.3	0.69	<u>595</u>
<u>198</u>	WWIS		861 CLYDE STREET Ottawa ON Well ID: 7119478	E/245.6	0.66	<u>596</u>
<u>199</u>	WWIS		861 CLYDE AV. Ottawa ON Well ID: 7326564	E/245.9	0.67	<u>600</u>
<u>200</u>	WWIS		ON Well ID: 7379179	E/246.2	0.66	<u>604</u>
<u>201</u>	WWIS		ON Well ID: 7379165	E/246.9	0.70	<u>605</u>
<u>202</u>	PRT	DALYS SERVICE CENTRE	1859 CARLING AV OTTAWA ON K2A 1E4	WSW/247.4	1.75	<u>605</u>
<u>202</u>	CA	IMPERIAL OIL LIMITED	1859 CARLING AVENUE (SWM) OTTAWA CITY ON K2A 1E4	WSW/247.4	1.75	<u>606</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
202	FSTH	CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AV OTTAWA ON K2A 1E4	WSW/247.4	1.75	606
202	SPL	Essroc Canada Inc.	1859 Carling Ave Ottawa ON K2A 1E4	WSW/247.4	1.75	606
202	SPL	Esso Imperial Oil<UNOFFICIAL>	1859 Carling Ave, at Carling and Maitland Ottawa ON	WSW/247.4	1.75	607
202	FSTH	CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AV OTTAWA ON K2A 1E4	WSW/247.4	1.75	608
202	DTNK	1048460 ONTARIO LTD O/A CARLING ESSO	1859 CARLING AV OTTAWA ON K2A 1E4	WSW/247.4	1.75	609
202	DTNK	CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AV OTTAWA ON	WSW/247.4	1.75	609
202	FST	MAC'S CONVENIENCE STORES INC.	1859 CARLING AVE OTTAWA ON	WSW/247.4	1.75	610
202	FST	MAC'S CONVENIENCE STORES INC.	1859 CARLING AVE OTTAWA ON	WSW/247.4	1.75	610
202	FST	MAC'S CONVENIENCE STORES INC.	1859 CARLING AVE OTTAWA ON	WSW/247.4	1.75	610
202	EHS		1859 CARLING AVE OTTAWA ON	WSW/247.4	1.75	611
202	GEN	Mac's Convenience Stores Inc.	1859 Carling Avenue Ottawa ON K2A1E4	WSW/247.4	1.75	611
202	GEN	Mac's Convenience Stores Inc.	1859 Carling Ave Ottawa ON K2A 1E4	WSW/247.4	1.75	611
202	GEN	Mac's Convenience Stores Inc.	1859 Carling Ave Ottawa ON K2A 1E4	WSW/247.4	1.75	612

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>202</u>	EXP	CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AVE OTTAWA ON	WSW/247.4	1.75	<u>612</u>
<u>202</u>	EXP	CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AVE OTTAWA ON	WSW/247.4	1.75	<u>612</u>
<u>202</u>	EXP	CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AVE OTTAWA ON	WSW/247.4	1.75	<u>613</u>
<u>202</u>	EXP	CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AVE OTTAWA ON	WSW/247.4	1.75	<u>613</u>
<u>202</u>	FST	MAC'S CONVENIENCE STORES INC.	1859 CARLING AVE OTTAWA ON	WSW/247.4	1.75	<u>613</u>
<u>203</u>	GEN	Tetra Pak Canada Inc.	846 Churchill Ave. N Ottawa ON K1Z 5G8	ESE/247.6	0.64	<u>613</u>
<u>203</u>	GEN	Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	ESE/247.6	0.64	<u>614</u>
<u>203</u>	GEN	Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON	ESE/247.6	0.64	<u>614</u>
<u>203</u>	GEN	Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON	ESE/247.6	0.64	<u>615</u>
<u>203</u>	GEN	Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON	ESE/247.6	0.64	<u>615</u>
<u>203</u>	GEN	Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	ESE/247.6	0.64	<u>615</u>
<u>203</u>	GEN	Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON	ESE/247.6	0.64	<u>616</u>
<u>203</u>	GEN	Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	ESE/247.6	0.64	<u>616</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>203</u>	GEN	Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	ESE/247.6	0.64	<u>617</u>
<u>203</u>	GEN	Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	ESE/247.6	0.64	<u>617</u>
<u>203</u>	GEN	Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	ESE/247.6	0.64	<u>617</u>
<u>203</u>	GEN	OTTAWA VALLEY HANDRAILING	846 Churchill Ave Ottawa ON K1Z 5G8	ESE/247.6	0.64	<u>618</u>
<u>203</u>	GEN	OTTAWA VALLEY HANDRAILING	846 Churchill Ave Ottawa ON K1Z 5G8	ESE/247.6	0.64	<u>618</u>
<u>204</u>	EHS		Carling Ave && Ridell Ave Ottawa ON	WSW/247.8	2.75	<u>619</u>
<u>205</u>	WWIS		861 CLYDE AV. Ottawa ON Well ID: 7326563	E/247.8	0.67	<u>619</u>
<u>206</u>	PINC	THOMAS CAVANAGH CONSTRUCTION LTD	864 DENISON CRES.,OTTAWA,ON,K2A 2N5,CA ON	SSW/248.0	2.76	<u>622</u>
<u>207</u>	WWIS		861 CLYDE AVE OTTAWA ON Well ID: 7300823	E/248.3	0.71	<u>623</u>
<u>208</u>	WWIS		ON Well ID: 7379174	E/248.6	0.67	<u>626</u>
<u>209</u>	GEN	OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	<u>627</u>
<u>209</u>	GEN	OTTAWA VETERINARY HOSPITAL	900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	<u>627</u>
<u>209</u>	GEN	OTTAWA VETERINARY HOSPITAL 01-149	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	<u>628</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
209	GEN	OTTAWA VETERINARY HOSPITAL	900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	628
209	EHS		900 Boyd Avenue Ottawa ON K2A 2E3	SE/248.9	2.01	628
209	GEN	OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	629
209	GEN	OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	629
209	GEN	OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	629
209	GEN	OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	630
209	GEN	OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON	SE/248.9	2.01	630
209	GEN	OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	631
209	GEN	OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	631
209	GEN	OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	632
209	GEN	OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	632
209	EHS		900 Boyd Avenue Ottawa ON Ottawa ON K2A 2E3	SE/248.9	2.01	633

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>209</u>	GEN	OTTAWA VETERINARY HOSPITAL	VCA CANADA OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	<u>633</u>
<u>209</u>	GEN	OTTAWA VETERINARY HOSPITAL	VCA CANADA OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	<u>633</u>
<u>209</u>	GEN	OTTAWA VETERINARY HOSPITAL	VCA CANADA OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	SE/248.9	2.01	<u>634</u>
<u>210</u>	WWIS		861 CLYDE AVE Ottawa ON Well ID: 7220439	E/249.2	0.67	<u>634</u>
<u>211</u>	WWIS		861 CLYDE AVE ON Well ID: 7220443	E/250.0	0.67	<u>637</u>
<u>212</u>	WWIS		861 CLYDE AV. Ottawa ON Well ID: 7326558	E/250.6	0.68	<u>640</u>

Executive Summary: Summary By Data Source

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 9 BORE site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	51.5	<u>22</u>
	ON	72.2	<u>35</u>
	ON	101.3	<u>48</u>
	ON	121.8	<u>59</u>
	ON	130.3	<u>64</u>
	ON	230.0	<u>157</u>
	ON	231.5	<u>160</u>
	ON	231.7	<u>161</u>
	ON	243.0	<u>188</u>

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 12 CA site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
SUNOCO INC.	SWM - 1784 CARLING AVENUE OTTAWA CITY ON K2A 1E1	11.6	<u>8</u>
CLEANWEAR UNIFORM SERVICE INC.	847 BOYD AVENUE OTTAWA CITY ON K2A 2C9	69.7	<u>33</u>
JEWISH COMMUNITY CAMPUS OF OTTAWA	831 BROADVIEW AVE. (SWM) OTTAWA CITY ON K2A 2M6	78.3	<u>38</u>
CLEANWEAR UNIFORM SERVICE INC.	843 BOYD AVENUE OTTAWA CITY ON K2A 2C9	101.4	<u>49</u>
Cleanwear Uniform Service Inc.	843 Boyd Avenue Ottawa ON K2A 2C9	101.4	<u>49</u>
3240797 Canada Inc.	870 Clyde Ave Ottawa ON K1Z 5A2	195.5	<u>101</u>
Medaglia Auto Imports Inc.	10 Dobbie Street Ottawa ON K2A 4G1	201.4	<u>112</u>
William Neilson Co. Limited	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LIMITED	861 CLYDE AVENUE OTTAWA CITY ON K1Z 5A4	240.9	<u>182</u>
OTTAWA CITY	BRIARWOOD AVE./TILLBURY AVE. OTTAWA CITY ON	242.4	<u>185</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
IMPERIAL OIL LIMITED	1859 CARLING AVENUE (SWM) OTTAWA CITY ON K2A 1E4	247.4	<u>202</u>

CFOT - Commercial Fuel Oil Tanks

A search of the CFOT database, dated Oct 2023 has found that there are 2 CFOT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
W.O. STINSON & SON LIMITED	1784 CARLING AVE OTTAWA ON	11.6	<u>8</u>
W M NEILSON LTD	861 CLYDE AVE N OTTAWA ON	240.9	<u>182</u>

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Oct 2023 has found that there are 13 DTNK site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
1496029 ONTARIO INC	1784 CARLING AV OTTAWA ON K2A 1E1	11.6	<u>8</u>
1496029 ONTARIO INC	1784 CARLING AV OTTAWA ON	11.6	<u>8</u>
557249 ONTARIO INC O/A BROADVIEW SERVICE CENTER	1784 CARLING AV OTTAWA ON	11.6	<u>8</u>
1496029 ONTARIO INC	1784 CARLING AV OTTAWA ON	11.6	<u>8</u>
2171273 ONTARIO INC	1784 CARLING AV OTTAWA ON	11.6	<u>8</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
2171273 ONTARIO INC	1784 CARLING AV OTTAWA ON	11.6	<u>8</u>
2171273 ONTARIO INC	1784 CARLING AV OTTAWA ON	11.6	<u>8</u>
1496029 ONTARIO INC	1784 CARLING AV OTTAWA ON	11.6	<u>8</u>
557249 ONTARIO INC O/A BROADVIEW SERVICE CENTER	1784 CARLING AV OTTAWA ON	11.6	<u>8</u>
SUPERIOR PROPANE INC	848 CLYDE AVE OTTAWA ON	159.2	<u>82</u>
Wm. Neilson Ltd.	861 Clyde Ave. Ottawa ON K1Z 5A4	240.9	<u>182</u>
1048460 ONTARIO LTD O/A CARLING ESSO	1859 CARLING AV OTTAWA ON K2A 1E4	247.4	<u>202</u>
CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AV OTTAWA ON	247.4	<u>202</u>

EBR - Environmental Registry

A search of the EBR database, dated 1994 - Aug 31, 2024 has found that there are 1 EBR site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
3240797 Canada Inc.	870 Clyde Avenue Ottawa CITY OF OTTAWA ON	195.5	<u>101</u>

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011-Aug 31, 2024 has found that there are 8 ECA site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Claridge Homes (1717 Carling) Inc.	1707 Carling Ave 1717 Carling Avenue Ottawa ON K2P 0Y6	99.9	<u>47</u>
Claridge Homes (1717 Carling) Inc.	1707 Carling Ave 1717 Carling Avenue Ottawa ON K2P 0Y6	99.9	<u>47</u>
Cleanwear Uniform Service Inc.	843 Boyd Avenue Ottawa ON K2A 2C9	101.4	<u>49</u>
Import Car Centre Sales Inc.	815 Campbell Rd Ottawa ON K1Z 5Z6	119.7	<u>57</u>
3240797 Canada Inc.	870 Clyde Ave Ottawa ON K1Z 5A2	195.5	<u>101</u>
Medaglia Auto Imports Inc.	10 Dobbie Street Ottawa ON K2A 2C9	201.4	<u>112</u>
William Neilson Co. Limited	861 Clyde Avenue Ottawa ON L7G 4B3	240.9	<u>182</u>
Weston Inc.	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Aug 31, 2024 has found that there are 50 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	818 Boyd Ave Ottawa ON K2A 2C7	11.4	<u>7</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	818 Boyd Ave Ottawa ON K2A2C7	11.4	<u>7</u>
	1784 Carling Ave Ottawa ON K2A1E1	11.6	<u>8</u>
	814 Boyd Avenue Ottawa ON	14.6	<u>9</u>
	818 Boyd Ave Ottawa ON Ottawa ON K2A 2C7	15.2	<u>10</u>
	818 Boyd Avenue Ottawa ON K2A 2C7	17.2	<u>11</u>
	1772 Carling Ave Ottawa ON K2A 1E1	17.4	<u>12</u>
	836 Boyd Avenue Ottawa ON K2A 2E1	29.5	<u>16</u>
	1723 Carling Ave Ottawa ON K2A1C8	52.0	<u>23</u>
	1767 and 1775 Carling Avenue Ottawa ON K2A 1C9	58.1	<u>27</u>
	830 Campbell Ottawa ON	61.3	<u>28</u>
	843 Boyd Ave Ottawa ON Ottawa ON K2A 2C9	72.4	<u>36</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	850 Boyd Avenue Ottawa ON K2A 2E1	81.1	<u>39</u>
	1779 Carling Avenue Ottawa ON K2A 1C9	83.5	<u>40</u>
	843 Boyd Ave Ottawa ON K2A2C9	101.4	<u>49</u>
	854 Boyd, Ave, Ottawa ON K2A 2E1	103.1	<u>50</u>
	861 Boyd Avenue Ottawa ON K2A 2C9	119.0	<u>56</u>
	815 Campbell Avenue Ottawa ON K2A 2C4	119.7	<u>57</u>
	860 Boyd Avenue Ottawa ON K2A 2E1	121.5	<u>58</u>
	770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>
	770 Broadview Ave Ottawa ON K2A3Z3	125.6	<u>60</u>
	770 Broadview Ave Ottawa ON K2A3Z3	125.6	<u>60</u>
	770 Broadview Ave Ottawa ON K2A 3Z3	125.6	<u>60</u>
	857 Boyd Avenue Ottawa ON K2A 2C9	128.7	<u>62</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1696 Carling Avenue Ottawa ON K2A 1C6	137.0	<u>68</u>
	855 Campbell Avenue Ottawa ON K2A 2C6	153.9	<u>76</u>
	863 Campbell Avenue Ottawa ON K2A 2C6	155.9	<u>77</u>
	1688 and 1690 Carling Ave Ottawa ON	156.5	<u>78</u>
	1688 Carling Avenue Ottawa ON	156.5	<u>78</u>
	848 Clyde Avenue North Ottawa ON K2A 1J4	159.2	<u>81</u>
	848 Clyde Avenue Ottawa ON	159.2	<u>82</u>
	1840 Carling Avenue Ottawa ON K2A 1E2	163.4	<u>85</u>
	1840 Carling Ave Ottawa ON K2A1E2	163.4	<u>85</u>
	1840 Carling Ave Ottawa ON K2A 1E2	163.4	<u>85</u>
	856 Clyde Avenue Ottawa ON K1Z 5A2	175.4	<u>91</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	878 Boyd Avenue Ottawa ON K2A 2E3	180.8	<u>93</u>
	877 Boyd Avenue Ottawa ON	191.7	<u>99</u>
	1845-1855 Carling Ave Ottawa ON K2A 1E4	218.5	<u>134</u>
	1846 Carling Avenue Ottawa ON K2A 1E2	223.2	<u>140</u>
	897 Boyd Ave Ottawa ON K2A2E2	225.0	<u>144</u>
	883 & 891 Boyd Avenue Ottawa ON	229.3	<u>153</u>
	891 Boyd Ave Ottawa ON K2A 2E2	234.9	<u>171</u>
	890 Boyd Ave Ottawa ON Ottawa ON K2A 2E3	237.5	<u>177</u>
	861 Clyde Ave Ottawa ON K1Z5A4	240.9	<u>182</u>
	861 Clyde Ave Ottawa ON K1Z5A4	240.9	<u>182</u>
	1660 Carling Avenue Ottawa ON K2A 1C5	242.0	<u>183</u>
	1859 CARLING AVE OTTAWA ON	247.4	<u>202</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Carling Ave & Ridell Ave Ottawa ON	247.8	204
	900 Boyd Avenue Ottawa ON Ottawa ON K2A 2E3	248.9	209
	900 Boyd Avenue Ottawa ON K2A 2E3	248.9	209

EXP - List of Expired Fuels Safety Facilities

A search of the EXP database, dated Oct 2023 has found that there are 11 EXP site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
SUNCOR ENERGY PRODUCTS PARTNERSHIP	1784 CARLING AVE OTTAWA ON	11.6	8
1496029 ONTARIO INC	1784 CARLING AVE OTTAWA ON	11.6	8
2171273 ONTARIO INC	1784 CARLING AVE OTTAWA ON	11.6	8
2171273 ONTARIO INC	1784 CARLING AVE OTTAWA ON	11.6	8
SUNCOR ENERGY PRODUCTS PARTNERSHIP	1784 CARLING AVE OTTAWA ON	11.6	8
2171273 ONTARIO INC	1784 CARLING AVE OTTAWA ON	11.6	8

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
2171273 ONTARIO INC	1784 CARLING AVE OTTAWA ON	11.6	<u>8</u>
CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AVE OTTAWA ON	247.4	<u>202</u>
CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AVE OTTAWA ON	247.4	<u>202</u>
CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AVE OTTAWA ON	247.4	<u>202</u>
CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AVE OTTAWA ON	247.4	<u>202</u>

FST - Fuel Storage Tank

A search of the FST database, dated Oct 2023 has found that there are 6 FST site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
SAPUTO DAIRY PRODUCTS CANADA G.P.	861 CLYDE AVE N OTTAWA ON	240.9	<u>182</u>
WILLIAM NEILSON LTEE	861 CLYDE AVE N OTTAWA ON	240.9	<u>182</u>
MAC'S CONVENIENCE STORES INC.	1859 CARLING AVE OTTAWA ON	247.4	<u>202</u>
MAC'S CONVENIENCE STORES INC.	1859 CARLING AVE OTTAWA ON	247.4	<u>202</u>
MAC'S CONVENIENCE STORES INC.	1859 CARLING AVE OTTAWA ON	247.4	<u>202</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
MAC'S CONVENIENCE STORES INC.	1859 CARLING AVE OTTAWA ON	247.4	<u>202</u>

FSTH - Fuel Storage Tank - Historic

A search of the FSTH database, dated Pre-Jan 2010* has found that there are 8 FSTH site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
2171273 ONTARIO INC	1784 CARLING AV OTTAWA ON K2A 1E1	11.6	<u>8</u>
6434118 CANADA INC	1784 CARLING AV OTTAWA ON K2A 1E1	11.6	<u>8</u>
NEILSON DAIRY LTD	861 CLYDE AVE OTTAWA ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LTEE	861 CLYDE AVE OTTAWA ON K1Z 5A4	240.9	<u>182</u>
NEILSON DAIRY LTD	861 CLYDE AVE OTTAWA ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LTEE	861 CLYDE AVE OTTAWA ON K1Z 5A4	240.9	<u>182</u>
CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AV OTTAWA ON K2A 1E4	247.4	<u>202</u>
CARLING TIGER EXPRESS ATTN NISAR ABBASI	1859 CARLING AV OTTAWA ON K2A 1E4	247.4	<u>202</u>

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Oct 31, 2022 has found that there are 219 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
AllGreen Demolition Inc.	1752 Carling Avenue Ottawa ON K2A 1E1	0.0	<u>1</u>
OTTAWA BIKEWAY COMPANY LTD.	1740 CARLING AVE. OTTAWA ON K2A 1E1	0.0	<u>3</u>
OTTAWA BIKEWAY COMPANY LTD. 29-360	1740 CARLING AVE. OTTAWA ON K2A 1E1	0.0	<u>3</u>
OTTAWA BIKEWAY COMPANY LIMITED	1740 CARLING AVENUE OTTAWA ON K2A 1E1	0.0	<u>3</u>
VALIQUETTE SPORTS	1740 CARLING AVENUE OTTAWA ON K2A 1E1	0.0	<u>3</u>
VALIQUETTE ENTERPRISES INC.	1740 CARLING AVENUE OTTAWA ON	0.0	<u>3</u>
Suncor Energy Products Partnership	1784 Carling Avenue Ottawa ON K2A 1E1	11.6	<u>8</u>
Suncor Energy Products Partnership	1784 Carling Avenue Ottawa ON K2A 1E1	11.6	<u>8</u>
Suncor Energy Products Partnership	1784 Carling Avenue Ottawa ON K2A 1E1	11.6	<u>8</u>
Suncor Energy Products Partnership	1784 Carling Avenue Ottawa ON K2A 1E1	11.6	<u>8</u>
Midas International	1772 Carling Avenue Ottawa ON K2A 1E1	17.4	<u>12</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
MIDAS Auto Service	1772 Carling Ave Ottawa ON K2A 1E1	17.4	<u>12</u>
ZIPPY PRINT 43-535	1806 CARLING AVE. OTTAWA ON K2A 1E2	23.2	<u>13</u>
ZIPPY PRINT (SEE & USE ON2417500)3-535	1806 CARLING AVE. OTTAWA ON K2A 1E2	23.2	<u>13</u>
ALLEGRA PRINT & IMAGING	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
ZIPPY PRINT (SEE & USE ON2417500)	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON	23.2	<u>13</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
Kealey Printing Inc.	1806 CARLING AVENUE OTTAWA ON K2A 1E2	23.2	<u>13</u>
GLIDDEN PAINTS/ICI PAINTS (CANADA) INC.	819 BOYD AVENUE OTTAWA ON K2A 2C8	39.2	<u>18</u>
GLIDDEN PAINTS 17-533	ICI PAINTS (CANADA) INC. 819 BOYD AVENUE OTTAWA ON K2A 2C8	39.2	<u>18</u>
GLIDDEN PAINTS/ICI PAINTS (CANADA) INC	819 BOYD AVENUE OTTAWA ON K2A 2C8	39.2	<u>18</u>
CAPITAL FOOD SERVICES LTD.	830 CAMPBELL AVE. OTTAWA ON K2A 2C2	54.6	<u>25</u>
CAPITAL FOOD SERVICES LTD.	830 CAMPBELL AVE. OTTAWA ON K2A 2C2	54.6	<u>25</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CAPITAL FOOD SERVICES (OUT OF BUSINESS)	830 CAMPBELL AVE. OTTAWA ON K2A 2C2	54.6	<u>25</u>
CAPITAL FOOD SERVICES LTD. 08-359	830 CAMPBELL AVE. OTTAWA ON K2A 2C2	54.6	<u>25</u>
HTS Engineering Ltd	101-830 Campbell Drive Ottawa ON K2A2C4O	54.6	<u>25</u>
HTS Engineering Ltd	101-830 Campbell Drive Ottawa ON K2A2C4	54.6	<u>25</u>
HTS Engineering Ltd	101-830 Campbell Drive Ottawa ON K2A2C4	54.6	<u>25</u>
CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	66.6	<u>31</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CLEANWEAR UNIFORM SERVICE INC. INDEPENDENT LINEN SERVICE	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC. INDEPENDENT LINEN SERVICE	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC. INDEPENDENT LINEN SERVICE	850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	66.6	<u>31</u>
CLEANWEAR UNIFORM SERV (OUT OF BUSINESS)	850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC. 10-252	850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON	66.6	<u>31</u>
CLEANWEAR UNIFORM SERVICE INC.	850 CAMPBELL AVENUE OTTAWA ON	66.6	<u>31</u>
OTTAWA ROMAN CATHOLIC S.S. BOARD	MAINTENCE FACILITY 1774 KERR AVENUE OTTAWA-CARLETON ON K2A 1R9	94.8	<u>45</u>
OTTAWA ROMAN CATHOLIC S.S. BOARD 29-612	MAINTENCE FACILITY 1774 KERR AVE. OTTAWA-CARLETON ON K2A 1R9	94.8	<u>45</u>
OTTAWA ROMAN CATHOLIC SEPARATE SCHOOL BD	MAINTENCE FACILITY 1774 KERR AVENUE OTTAWA-CARLETON ON K2A 1R9	94.8	<u>45</u>
Capital elevator Ltd	21 Nadolny Satch Ottawa ON K2A 1R9	112.3	<u>52</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
857-861 Boyd Inc.	857 Boyd Avenue Ottawa ON K2A 2C9	114.2	<u>53</u>
MEDICAL PHARMACY	770 BROADVIEW AVENUE OTTAWA ON K2A 3Z3	125.6	<u>60</u>
Britannia Medical Centre	770 Broadview Avenue Suite 203 Ottawa ON K2A 3Z3	125.6	<u>60</u>
Britannia Medical Centre	770 Broadview Avenue Suite 203 Ottawa ON K2A 3Z3	125.6	<u>60</u>
Fraser Scott-Thomas Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>
Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>
Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON	125.6	<u>60</u>
2520762 Ontario Inc.	210-770 Broadview Ave Ottawa ON K2A3Z3	125.6	<u>60</u>
Rosenbloom,Morris, Goldman and Poitras	305-770 Broadview Ave Ottawa ON K2A 3Z3	125.6	<u>60</u>
David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	125.6	<u>60</u>
Dr. Timothy Capello/ Dr. Jodie Murray	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	125.6	<u>60</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	125.6	<u>60</u>
Rosenbloom,Morris and Goldman	305-770 Broadview Ave Ottawa ON K2A 3Z3	125.6	<u>60</u>
Dr. Mark Smith	770 Broadview Avenue Suite 308 Ottawa ON K2A3Z3	125.6	<u>60</u>
Drs. Levitan and Bartlett	205-770 Broadview Ave. Ottawa ON K2A3Z3	125.6	<u>60</u>
Dr. Mark Smith	770 Broadview Avenue Suite 308 Ottawa ON K2A3Z3	125.6	<u>60</u>
Drs. Levitan and Bartlett	205-770 Broadview Ave. Ottawa ON K2A3Z3	125.6	<u>60</u>
Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>
Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>
Dr. Timothy Capello/ Dr. Jodie Murray	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	125.6	<u>60</u>
Drs. Levitan and Bartlett	205-770 Broadview Ave. Ottawa ON K2A3Z3	125.6	<u>60</u>
Dr. Timothy Capello/ Dr. Jodie Murray	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	125.6	<u>60</u>
Rosenbloom,Morris and Goldman	305-770 Broadview Ave Ottawa ON K2A 3Z3	125.6	<u>60</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	125.6	<u>60</u>
Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>
Poitras, Giles, Lewin, & Kennedy	305-770 Broadview Ave Ottawa ON K2A 3Z3	125.6	<u>60</u>
2520762 Ontario Inc.	210-770 Broadview Ave Ottawa ON K2A3Z3	125.6	<u>60</u>
Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>
Drs. Levitan and Bartlett	205-770 Broadview Ave. Ottawa ON K2A3Z3	125.6	<u>60</u>
Dr. Timothy Capello/ Dr. Jodie Murray	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	125.6	<u>60</u>
David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	125.6	<u>60</u>
2520762 Ontario Inc.	210-770 Broadview Ave Ottawa ON K2A3Z3	125.6	<u>60</u>
Poitras, Giles, Lewin, & Kennedy	305-770 Broadview Ave Ottawa ON K2A 3Z3	125.6	<u>60</u>
Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	125.6	<u>60</u>
Dr. Timothy Capello/ Dr. Jodie Murray	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	125.6	<u>60</u>
Dr. Riva Levitan	205-770 Broadview Ave. Ottawa ON K2A3Z3	125.6	<u>60</u>
Dr. Timothy Capello/Dr. Iryna Yeuchyk	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	125.6	<u>60</u>
Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>
2520762 Ontario Inc.	210-770 Broadview Ave Ottawa ON K2A3Z3	125.6	<u>60</u>
Dr. Riva Levitan	205-770 Broadview Ave. Ottawa ON K2A3Z3	125.6	<u>60</u>
David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	125.6	<u>60</u>
Poitras, Giles, Lewin, & Kennedy	305-770 Broadview Ave Ottawa ON K2A 3Z3	125.6	<u>60</u>
Lovell Drugs Limited	770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>
Lovell Drugs Limited	770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>
Arbour Family Medicine	201-770 Broadview Avenue Ottawa ON K2A 3Z3	125.6	<u>60</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Dr. Riva Levitan	205-770 Broadview Ave. Ottawa ON K2A3Z3	125.6	<u>60</u>
Poitras, Giles, Lewin, & Kennedy	305-770 Broadview Ave Ottawa ON K2A 3Z3	125.6	<u>60</u>
David Greenberg Podiatry Professional Corporation	770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	125.6	<u>60</u>
2520762 Ontario Inc.	210-770 Broadview Ave Ottawa ON K2A3Z3	125.6	<u>60</u>
Dr. Timothy Capello/Dr. Iryna Yeuchyuk	770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	125.6	<u>60</u>
NU-TEK SIGNS	866 CAMPBELL AVENUE OTTAWA ON K2A 2C5	143.6	<u>71</u>
12522890 Ontario Inc	866 Campbell Avenue Ottawa ON K2A 2C5	143.6	<u>71</u>
1230372 Ontario Inc	866 Campbell Ave Ottawa ON K2A 2C5	143.6	<u>71</u>
1230372 Ontario Inc	866 Campbell Ave Ottawa ON K2A 2C5	143.6	<u>71</u>
BOEYENS' COMMUNICATION CONTRACTORS LIMITED	855 CAMPBELL AVENUE OTTAWA ON K2A 2C6	153.9	<u>76</u>
POWERAIR OF CANADA LTD.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	159.2	<u>82</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
POWERAIR OF CANADA LTD.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	159.2	<u>82</u>
MANNION'S PUMP HOUSE LTD.	848 CLYDE AVENUE OTTAWA ON K1Z 5A2	159.2	<u>82</u>
POWERAIR OF CANADA LTD. 30-392	848 CLYDE AVE. OTTAWA ON K1Z 5A2	159.2	<u>82</u>
MANNION'S PUMP HOUSE LIMITED	848 CLYDE AVENUE OTTAWA ON K1Z 5A2	159.2	<u>82</u>
MANNION'S PUMP HOUSE LIMITED	848 CLYDE AVE. OTTAWA ON	159.2	<u>82</u>
MANNION'S PUMP HOUSE LTD.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	159.2	<u>82</u>
MANNION'S PUMP HOUSE LTD.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	159.2	<u>82</u>
THE PUMP HOUSE INC.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	159.2	<u>82</u>
THE PUMP HOUSE INC.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	159.2	<u>82</u>
THE PUMP HOUSE INC.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	159.2	<u>82</u>
THE PUMP HOUSE INC.	848 CLYDE AVE. OTTAWA ON K1Z 5A2	159.2	<u>82</u>
COLOR YOUR WORLD	1840 CARLING AVENUE OTTAWA ON K2A 1E2	163.4	<u>85</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
ROBERT M. LEMIEUX PAINTS LTD.	1840 CARLING AVENUE OTTAWA ON K2A 1E2	163.4	<u>85</u>
Benson Auto Parts	863 Campbell Avenue Ottawa ON K2A 2C6	169.2	<u>86</u>
Hydro OTTAWA LIMITED	882 CAMPBELL AVE OTTAWA ON K2A 2C5	173.6	<u>90</u>
Jewish Community Campus of Ottawa Inc	31 Nadolny Sachs Pr Ottawa ON K2A 1R9	184.8	<u>94</u>
Tomlinson Tomlinson	864 Clyde Ave N Ottawa ON K1Z 5A4	191.9	<u>100</u>
AECON UTILITIES INC.	874 CLYDE AVENUE OTTAWA ON K1Z 5A2	206.8	<u>119</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
OTTAWA BOARD OF EDUCATION	HIGHLAND PARK HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	<u>124</u>
OTTAWA BOARD OF EDUCATION 29-548	HIGHLAND PARK HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	<u>124</u>
OTTAWA R.C. SEPARATE SCHOOL BOARD	NOTRE DAME HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	<u>124</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA-CARLETON CATHOLIC SCHOOL BOARD	NOTRE DAME HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	<u>124</u>
Ottawa-Carleton Catholic School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Ottawa Catholic District School Board	Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	212.1	<u>124</u>
The Growcer	891 Boyd Avenue Ottawa ON K2A 2E2	234.9	<u>171</u>
CARLING ANIMAL HOSPITAL 08-954	1850 CARLING AVENUE OTTAWA ON K2A 1E3	239.0	<u>179</u>
CARLING ANIMAL HOSPITAL	1850 CARLING AVENUE OTTAWA ON K2A 1E3	239.0	<u>179</u>
CARLING ANIMAL HOSPITAL	1850 Carling Ave Ottawa ON K2A 1E3	239.0	<u>179</u>
WILLIAM NEILSON LTD.	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LTD.	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LTD. 42-059	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LTD. (OTTAWA)	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LIMITED (OTTAWA)	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LIMITED	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	240.9	<u>182</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Saputo Chesse GP	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LIMITED	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	240.9	<u>182</u>
Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON	240.9	<u>182</u>
Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Dairy Products Canada GP	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
Vertex Environmental Inc. Vertex Environmental Inc.	861 Clyde Ave Ottawa ON K1Z 5A4	240.9	<u>182</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Valiff Sales	1660 Carling Ave Ottawa ON	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON K2A1C5	242.0	<u>183</u>
Canadian Tire Real Estate Limited	1660 Carling Ave Ottawa ON K2A 1C5	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON K2A 1C5	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON	242.0	<u>183</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Valiff Sales	1660 Carling Ave Ottawa ON	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON	242.0	<u>183</u>
Valiff Sales	1660 Carling Ave Ottawa ON K2A 1C5	242.0	<u>183</u>
TRANSMISSIONS AUTOMOTIVE	757 COLE AVE. OTTAWA ON K2A 3W7	243.6	<u>189</u>
Mac's Convenience Stores Inc.	1859 Carling Avenue Ottawa ON K2A1E4	247.4	<u>202</u>
Mac's Convenience Stores Inc.	1859 Carling Ave Ottawa ON K2A 1E4	247.4	<u>202</u>
Mac's Convenience Stores Inc.	1859 Carling Ave Ottawa ON K2A 1E4	247.4	<u>202</u>
Tetra Pak Canada Inc.	846 Churchill Ave. N Ottawa ON K1Z 5G8	247.6	<u>203</u>
Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	247.6	<u>203</u>
Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON	247.6	<u>203</u>
Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON	247.6	<u>203</u>
Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON	247.6	<u>203</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	247.6	<u>203</u>
Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON	247.6	<u>203</u>
Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	247.6	<u>203</u>
Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	247.6	<u>203</u>
Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	247.6	<u>203</u>
Logoplaste Canada Inc	846 Churchill Ave North Ottawa ON K1Z 5G8	247.6	<u>203</u>
OTTAWA VALLEY HANDRAILING	846 Churchill Ave Ottawa ON K1Z 5G8	247.6	<u>203</u>
OTTAWA VALLEY HANDRAILING	846 Churchill Ave Ottawa ON K1Z 5G8	247.6	<u>203</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA VETERINARY HOSPITAL	VCA CANADA OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	VCA CANADA OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	VCA CANADA OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL 01-149	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	<u>209</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON	248.9	<u>209</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA VETERINARY HOSPITAL	AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	248.9	209

HINC - TSSA Historic Incidents

A search of the HINC database, dated 2006-June 2009* has found that there are 3 HINC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	851 CAMPBELL AVENUE OTTAWA ON K2A 2C6	130.2	63
	465 WELLESLEY AVENUE OTTAWA ON K2A 1B5	135.6	66
	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	240.9	182

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated 31 Oct, 2023 has found that there are 2 INC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
SUNCOR ENERGY PRODUCTS PARTNERSHIP	1784 CARLING AVE OTTAWA ON	11.6	8
	870 CLYDE AVE, OTTAWA ON	195.5	101

NPCB - National PCB Inventory

A search of the NPCB database, dated 1988-2008* has found that there are 2 NPCB site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	124
OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	124

NPR2 - National Pollutant Release Inventory 1993-2020

A search of the NPR2 database, dated Sep 2020 has found that there are 1 NPR2 site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA	861 CLYDE AVENUE OTTAWA ON K1Z5A4	240.9	182

OPCB - Inventory of PCB Storage Sites

A search of the OPCB database, dated 1987-Oct 2004; 2012-Dec 2013 has found that there are 6 OPCB site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	124
OTTAWA-CARLETON CATHOLIC SCHOOL BOARD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	124
OTTAWA-CARLETON CATHOLIC SCHOOL BOARD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	124
OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	124
OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	124

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD	710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	212.1	124

PES - Pesticide Register

A search of the PES database, dated Oct 2011-Aug 31, 2024 has found that there are 6 PES site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
SWISH MAINTENANCE LIMITED	864 CLYDE AVENUE OTTAWA ON K1Z 5A2	191.9	100
VALIFF SALES INC	1660 CARLING AVE OTTAWA ON K2A1C5	242.0	183
VALIFF SALES INC	1660 Carling AVE Ottawa ON K2A 1C5	242.0	183
VALIFF SALES INC	1660 CARLING AVE OTTAWA ON K2A 1C5	242.0	183
VALIFF SALES INC	1660 CARLING AVE OTTAWA ON K2A1C5	242.0	183
VALIFF SALES INC	1660 CARLING AVE OTTAWA ON K2A 1C5	242.0	183

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 10 PINC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
MTS ALLSTREAM INC	1793 KERR AVE,,OTTAWA,ON,K2A 1J2,CA ON	32.8	17

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
DONALD OCONNOR	1807 KERR AVE,,OTTAWA,ON,K2A 1J2,CA ON	88.9	<u>43</u>
PIPELINE HIT - 2"	21 NADOLNY SACHS PVT,,OTTAWA,ON, K2A 1R9,CA ON	112.3	<u>52</u>
STONE TECH	744 HIGHLAND AVE,,OTTAWA,ON,K2A 2K7, CA ON	150.8	<u>75</u>
PIPELINE HIT - 1/2"	840 DENISON CRESCENT,,OTTAWA,ON, K2A 2N5,CA ON	189.4	<u>97</u>
JOSIE MONTGOMERY O/A MAL'S GROCERY	844 DENISON CRES,,OTTAWA,ON,K2A 2N5,CA ON	204.8	<u>116</u>
JOERNS HEALTHCARE INC	859 DENISON CRES,,OTTAWA,ON,K2A 2N4,CA ON	219.0	<u>135</u>
PIPELINE HIT	1848 CARLING AVENUE,,OTTAWA,ON,K2A 1E3,CA ON	227.8	<u>152</u>
PIPELINE HIT - 1/2"	830 REX AVE,,OTTAWA,ON,K2A 2P5,CA ON	237.0	<u>175</u>
THOMAS CAVANAGH CONSTRUCTION LTD	864 DENISON CRES,,OTTAWA,ON,K2A 2N5,CA ON	248.0	<u>206</u>

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 8 PRT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
557249 ONTARIO INC	1784 CARLING AV OTTAWA ON K2A 1E1	11.6	<u>8</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
557249 ONTARIO INC	1784 CARLING AV OTTAWA ON K2A1E1	11.6	<u>8</u>
557249 ONTARIO INC	1784 CARLING AV OTTAWA ON K2A1E1	11.6	<u>8</u>
	1784 CARLING AV. OTTAWA ON	11.6	<u>8</u>
SUPERIOR PROPANE INC	848 CLYDE AV OTTAWA ON K1Z5A2	159.2	<u>82</u>
WILLIAM NEILSON LTEE	861 CLYDE AV OTTAWA ON K1Z 5A4	240.9	<u>182</u>
NEILSON DAIRY LTD	861 CLYDE AV OTTAWA ON K1Z5A4	240.9	<u>182</u>
DALYS SERVICE CENTRE	1859 CARLING AV OTTAWA ON K2A 1E4	247.4	<u>202</u>

PTTW - Permit to Take Water

A search of the PTTW database, dated 1994 - Aug 31, 2024 has found that there are 1 PTTW site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Claridge Homes (1717 Carling) Inc.	1705 Carling Avenue Ottawa, ON Canada ON	106.7	<u>51</u>

RSC - Record of Site Condition

A search of the RSC database, dated 1997-Sept 2001, Oct 2004-Aug 2024 has found that there are 1 RSC site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
WEBB'S MOTEL LIMITED	1705 CARLING AVENUE ON Ottawa ON	106.7	<u>51</u>

RST - Retail Fuel Storage Tanks

A search of the RST database, dated 1999-Apr 30, 2024 has found that there are 3 RST site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
SUNOCO GAS BAR	1784 CARLING AVE OTTAWA ON K2A 1E1	11.6	<u>8</u>
SUNOCO GAS BAR	1784 CARLING AVE OTTAWA ON K2A1E1	11.6	<u>8</u>
MANNION PETROLEUM	1700B DOHENY ST OTTAWA ON K2A 1J4	114.3	<u>54</u>

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 31 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
VALIQUETTE ENTERPRISES INC.	1740 CARLING AVE OTTAWA ON K2A 1E1	0.0	<u>3</u>
Accolade Marketing Concept Inc.	1740 Carling Ave Ottawa ON K2A 1E1	0.0	<u>3</u>
ZIPPY PRINT	1806 CARLING AVE OTTAWA ON K2A 1E2	23.2	<u>13</u>
ALLEGRA PRINT & IMAGING INC.	1806 Carling Ave Ottawa ON K2A 1E2	23.2	<u>13</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Allegra Print & Imaging	1806 Carling Ave Ottawa ON K2A 1E2	23.2	<u>13</u>
Allegra Print & Imaging	1806 Carling Ave Ottawa ON K2A 1E2	23.2	<u>13</u>
Advanced Prefabs Ltd.	1722 Carling Ave Ottawa ON K2A 1C7	29.5	<u>15</u>
Jarry's Dental Laboratory Inc.	836 Boyd Ave Ottawa ON K2A 2E1	29.5	<u>16</u>
International Kafia Coffee	842 Boyd Ave Ottawa ON K2A 2E1	44.8	<u>20</u>
Advanced Prefabs Ltd.	811 Boyd Ave Ottawa ON K2A 2C8	48.7	<u>21</u>
Vision Circuit Technologies Inc.	1712 Carling Ave Ottawa ON K2A 1C7	63.7	<u>29</u>
LADY JANE DONUTS LIMITED	1779 CARLING AVE OTTAWA ON K2A 1C9	83.5	<u>40</u>
Aarkade Design & Offset Printing Inc.	854 Boyd Ave Unit B Ottawa ON K2A 2E1	103.1	<u>50</u>
Mansfield & Rodney Printing	861 Boyd Ave Ottawa ON K2A 2C9	119.0	<u>56</u>
Wil-Mac Labels	861 Boyd Ave Ottawa ON K2A 2C9	119.0	<u>56</u>
Al Parsons Electronics Ltd.	860 Boyd Ave Ottawa ON K2A 2E1	121.5	<u>58</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
NU-TEK SIGNS	866 CAMPBELL AVE OTTAWA ON K2A 2C5	143.6	<u>71</u>
WYMAN & SON PUBLICATIONS LTD	866 CAMPBELL AVE OTTAWA ON K2A 2C5	143.6	<u>71</u>
Signs.ca/Nu-Tek Signs	866 Campbell Ave Ottawa ON K2A 2C5	143.6	<u>71</u>
Signs.ca	866 Campbell Ave Ottawa ON K2A 2C5	143.6	<u>71</u>
MASTRON MECHANICAL 1988 LTD	877 BOYD AVE OTTAWA ON K2A 2E2	191.7	<u>99</u>
National Cabinet Design Supplies & Accessories Ltd.	877A Boyd Ave Ottawa ON K2A 2E2	191.7	<u>99</u>
Breck-Mar Sales & Service Ltd.	877 Boyd Ave Ottawa ON K2A 2E2	191.7	<u>99</u>
Ottawa Solar Power Inc.	864 Clyde Ave Ottawa ON K1Z 5A2	191.9	<u>100</u>
OTTAWA AWNING & CANVAS LTD	883 BOYD AVE OTTAWA ON K2A 2E2	214.4	<u>128</u>
Ottawa Awning & Canvas Ltd.	883 Boyd Ave Ottawa ON K2A 2E2	214.4	<u>128</u>
LUMI-LUX LTD	890 BOYD AVE OTTAWA ON K2A 2E3	229.3	<u>154</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Saputo Dairy Products Canada	861 Clyde Ave Ottawa ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LTD./LTÉE	861 Clyde Ave Ottawa ON K1Z 5A4	240.9	<u>182</u>
William Neilson Ltd.	861 Clyde Ave Ottawa ON K1Z 5A4	240.9	<u>182</u>
D LYALL HANES LTD	894 BOYD AVE OTTAWA ON K2A 2E3	245.1	<u>194</u>

SPL - Ontario Spills

A search of the SPL database, dated 1988-Jun 2024 has found that there are 34 SPL site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Petro-Canada	1784 Carling Avenue Ottawa ON K2A 1E1	11.6	<u>8</u>
Enbridge Gas Distribution Inc.	1793 Kerr Avenue Ottawa ON	32.8	<u>17</u>
	East left turning lane @ Broadview Ave & Carlingview Ave. OTTAWA ON	43.5	<u>19</u>
	Carling Ave and Broadview Ave, Ottawa OTTAWA ON	57.8	<u>26</u>
RESTAURANT	1775 CARLINGS, CHAOPHRAYA THAI CUISINE (N.O.S.) OTTAWA CITY ON	66.2	<u>30</u>
OTTAWA HYDRO	490 WELLESLEY AVE TRANSFORMER OTTAWA CITY ON K2A 1B7	83.8	<u>41</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
AUTOMOTIVE REPAIR SHOP	843 BOYD OTTAWA CITY ON K2A 2C9	101.4	<u>49</u>
DRY CLEANER	843 BOYD AVE. (N.O.S.) OTTAWA CITY ON K2A 2C9	101.4	<u>49</u>
	851 Campbell Ave. Ottawa ON K2A 2C6	130.2	<u>63</u>
LACOMBE WASTE OIL	J&L AUTOMOTIVE 849 CAMPBELL RD GLOUCESTER SITE 5573 POWER ROAD, RR # 6 OTTAWA CITY ON K2A 2C6	138.5	<u>69</u>
Sealtest Enterprises Ltd. <UNOFFICIAL>	1845 Carling Avenue Ottawa ON	147.8	<u>73</u>
Enbridge Gas Distribution Inc.	744 Highland Avenue Ottawa ON	150.8	<u>75</u>
OTTAWA HYDRO	DOBBIE AVE AND BOYD ST MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	162.4	<u>84</u>
City of Ottawa	Carling Ave and Cole Ave Ottawa ON	172.6	<u>89</u>
Enbridge Gas Distribution Inc.	840 Denison Crescent Ottawa ON	189.4	<u>97</u>
	870 Clyde Ave Ottawa ON	195.5	<u>101</u>
Medaglia Auto Imports Inc.	10 Dobbie St Ottawa ON K2A 4G1	201.4	<u>112</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Enbridge Gas Distribution Inc.	Carling and Rex Ottawa ON	204.6	<u>115</u>
SCHOOL	710 BROADVIEW HEATING OIL TANK OTTAWA CITY ON K2A 2M2	212.1	<u>124</u>
Saputo Dairy Products Canada	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Dairy Products Canda G.P.	861 Clyde Ave Ottawa ON NA	240.9	<u>182</u>
Camscott Trucking<UNOFFICIAL>	861 Clyde Avenue Ottawa ON K1Z 5A4	240.9	<u>182</u>
Neilson Dairy<UNOFFICIAL>	861 Clyde Ave Ottawa ON	240.9	<u>182</u>
William Neilson Co. Limited	861 Clyde Ave Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Cheese G.P.	861 Clyde Ave Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Foods Limited acting as managing partner of	861 Clyde Ave. Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Cheese G.P.	861 Clyde Avenue<UNOFFICIAL> Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Foods Limited	861 Clyde Ave Ottawa ON K1Z 5A4	240.9	<u>182</u>
Saputo Foods Limited	861 Clyde Ave Ottawa ON K1Z 5A4	240.9	<u>182</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
WILLIAM NEILSON LTD.	861 CLYDE AVENUE OTTAWA PLANT 861 CLYDE AVENUE OTTAWA CITY ON K1Z 5A4	240.9	<u>182</u>
WILLIAM NEILSON LTD.	861 CLYDE AVE. OTTAWA PLANT 861 CLYDE AVENUE OTTAWA CITY ON K1Z 5A4	240.9	<u>182</u>
NEILSON DAIRY	NEILSON CANADA 861 CLYDE AVE OTTAWA TANK TRUCK (CARGO) OTTAWA CITY ON K1Z 5A4	240.9	<u>182</u>
Essroc Canada Inc.	1859 Carling Ave Ottawa ON K2A 1E4	247.4	<u>202</u>
Esso Imperial Oil<UNOFFICIAL>	1859 Carling Ave, at Carling and Maitland Ottawa ON	247.4	<u>202</u>

WWIS - Water Well Information System

A search of the WWIS database, dated Dec 31 2023 has found that there are 122 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON Well ID: 1507908	0.0	<u>2</u>
	ON Well ID: 7419769	0.0	<u>4</u>
	ON Well ID: 7419770	0.0	<u>5</u>
	ON Well ID: 1507981	5.0	<u>6</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON <i>Well ID:</i> 7162302	14.6	<u>9</u>
	ON <i>Well ID:</i> 7306421	27.9	<u>14</u>
	836 BOYD STREET Ottawa ON <i>Well ID:</i> 7175486	29.5	<u>16</u>
	842 BOYD AVENUE Ottawa ON <i>Well ID:</i> 7270130	44.8	<u>20</u>
	ON <i>Well ID:</i> 7204981	54.1	<u>24</u>
	830 CAMPBELL AVE OTTAWA ON <i>Well ID:</i> 7272146	54.6	<u>25</u>
	830 CAMPBELL AVE OTTAWA ON <i>Well ID:</i> 7272145	54.6	<u>25</u>
	ON <i>Well ID:</i> 1507965	68.7	<u>32</u>
	ON <i>Well ID:</i> 1508303	72.1	<u>34</u>
	ON <i>Well ID:</i> 1507936	76.1	<u>37</u>
	ON <i>Well ID:</i> 1508300	83.9	<u>42</u>
	ON	83.9	<u>42</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 1508301		
	ON	94.4	<u>44</u>
	Well ID: 1508379		
	770 BROADVIEW OTTAWA ON	98.5	<u>46</u>
	Well ID: 7238475		
	ON	117.1	<u>55</u>
	Well ID: 7206030		
	ON	128.4	<u>61</u>
	Well ID: 1508094		
	857 Boyd Ave Ottawa ON	133.3	<u>65</u>
	Well ID: 7343574		
	857 Boyd Ave Ottawa ON	136.0	<u>67</u>
	Well ID: 7343575		
	770 BROADVIEW Ottawa ON	139.4	<u>70</u>
	Well ID: 7238477		
	770 BROADVIEW OTTAWA ON	147.4	<u>72</u>
	Well ID: 7238476		
	ON	148.8	<u>74</u>
	Well ID: 7379159		
	861 BOYD AVE. Ottawa ON	158.2	<u>79</u>
	Well ID: 7197303		
	361 BOYD AVE. Ottawa ON	159.1	<u>80</u>
	Well ID: 7197302		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON <i>Well ID:</i> 1508095	161.2	<u>83</u>
	ON <i>Well ID:</i> 7405897	170.2	<u>87</u>
	ON <i>Well ID:</i> 7311632	171.7	<u>88</u>
	ON <i>Well ID:</i> 1507939	176.0	<u>92</u>
	877 BOYD AVENUE Ottawa ON <i>Well ID:</i> 7163796	187.5	<u>95</u>
	877 BOYD AVE Ottawa ON <i>Well ID:</i> 7159361	189.1	<u>96</u>
	877 BOYD AVENUE Ottawa ON <i>Well ID:</i> 7163797	189.5	<u>98</u>
	877 BOYD AVE Ottawa ON <i>Well ID:</i> 7158273	195.6	<u>102</u>
	877 BOYD AVENUE Ottawa ON <i>Well ID:</i> 7163795	196.5	<u>103</u>
	861 CLYDE AVE Ottawa ON <i>Well ID:</i> 7220446	196.5	<u>104</u>
	877 BOYD AVENUE Ottawa ON <i>Well ID:</i> 7163798	196.7	<u>105</u>
	877 BOYD AVENUE Ottawa ON	197.7	<u>106</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7163794		
	861 CLYDE AVE Ottawa ON	197.7	107
	Well ID: 7220405		
	877 BOYD AVE Ottawa ON	197.8	108
	Well ID: 7159360		
	ON	198.0	109
	Well ID: 7379158		
	861 CLYDE AVE Ottawa ON	199.2	110
	Well ID: 7220406		
	ON	200.8	111
	Well ID: 7379166		
	861 CLYDE AVE Ottawa ON	202.6	113
	Well ID: 7220444		
	ON	203.7	114
	Well ID: 7240874		
	ON	205.2	117
	Well ID: 1508088		
	ON	205.2	117
	Well ID: 1508090		
	ON	205.2	118
	Well ID: 1508086		
	ON	207.9	120
	Well ID: 1508093		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON <i>Well ID:</i> 1508040	208.2	<u>121</u>
	ON <i>Well ID:</i> 1508380	209.2	<u>122</u>
	861 CLYDE AVE. Ottawa ON <i>Well ID:</i> 7114836	210.9	<u>123</u>
	861 CLYDE ST OTTAWA ON <i>Well ID:</i> 7155921	213.6	<u>125</u>
	ON <i>Well ID:</i> 7379167	213.9	<u>126</u>
	ON <i>Well ID:</i> 7379163	214.4	<u>127</u>
	861 CLYDE AVE Ottawa ON <i>Well ID:</i> 7245027	214.7	<u>129</u>
	861 CLYDE AVE Ottawa ON <i>Well ID:</i> 7245028	214.7	<u>129</u>
	ON <i>Well ID:</i> 7379161	215.7	<u>130</u>
	861 Clyde Avenue lot I con A Ottawa ON <i>Well ID:</i> 7337587	216.3	<u>131</u>
	861 CLYDE AVE Ottawa ON <i>Well ID:</i> 7220407	217.3	<u>132</u>
	861 CLYDE AVE ON	217.6	<u>133</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7220435		
	861 CLYDE AVE Ottawa ON	220.1	<u>136</u>
	Well ID: 7220408		
	861 CKYDE AVE Ottawa ON	220.1	<u>136</u>
	Well ID: 7220437		
	897 BOYD AVE OTTAWA ON	220.4	<u>137</u>
	Well ID: 7305656		
	861 CLYDE AVE Ottawa ON	221.4	<u>138</u>
	Well ID: 7220438		
	861 CLYDE AVE Ottawa ON	222.0	<u>139</u>
	Well ID: 7220436		
	ON	224.4	<u>141</u>
	Well ID: 7379178		
	ON	224.8	<u>142</u>
	Well ID: 7379172		
	861 CLYDE AVE OTTAWA ON	224.9	<u>143</u>
	Well ID: 7246037		
	ON	225.2	<u>145</u>
	Well ID: 7235388		
	ON	225.2	<u>146</u>
	Well ID: 1508085		
	861 CLYDE AV. Ottawa ON	225.3	<u>147</u>
	Well ID: 7326561		


<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
		225.3	<u>147</u>
	ON		
	Well ID: 7379175		
		225.4	<u>148</u>
	ON		
	Well ID: 7379162		
	861 CLYDE AVENUE Ottawa ON	225.6	<u>149</u>
	Well ID: 7271919		
		227.0	<u>150</u>
	ON		
	Well ID: 7379171		
		227.2	<u>151</u>
	ON		
	Well ID: 1508302		
	861 CLYDE AVE Ottawa ON	229.9	<u>155</u>
	Well ID: 7245029		
	lot 29 con 1 ON	229.9	<u>156</u>
	Well ID: 1503963		
	861 CLYDE RD OTTAWA ON	231.1	<u>158</u>
	Well ID: 7155923		
		231.4	<u>159</u>
	ON		
	Well ID: 1507935		
		232.6	<u>162</u>
	ON		
	Well ID: 1508091		
	861 CLYDE AVE Ottawa ON	232.8	<u>163</u>
	Well ID: 7183403		
	861 CLYDE AVE Ottawa ON	233.0	<u>164</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7172122		
	ON	233.0	165
	Well ID: 7379177		
	861 CLYDE AVE Ottawa ON	233.1	166
	Well ID: 7172118		
	861 CLYDE AVE. OTTAWA ON	233.3	167
	Well ID: 7246035		
	ON	234.2	168
	Well ID: 7267056		
	861 CLYDE AVE. OTTAWA ON	234.3	169
	Well ID: 7246036		
	861 CLYDE AVE Ottawa ON	234.4	170
	Well ID: 7172119		
	ON	235.0	172
	Well ID: 7379164		
	861 CLYDE AVE Ottawa ON	235.3	173
	Well ID: 7172120		
	861 CLYDE AV. Ottawa ON	235.6	174
	Well ID: 7326562		
	861 CLYDE AVE Ottawa ON	237.2	176
	Well ID: 7172199		
	861 CLYDE AVE OTTAWA ON	239.0	178
	Well ID: 7155919		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	861 CLYDE AVE OTTAWA ON <i>Well ID:</i> 7180632	239.3	<u>180</u>
	ON <i>Well ID:</i> 1508746	239.4	<u>181</u>
	ON <i>Well ID:</i> 1508751	239.4	<u>181</u>
	861 CLYDE AVE Ottawa ON <i>Well ID:</i> 7220445	240.9	<u>182</u>
	861 CLYDE AV. Ottawa ON <i>Well ID:</i> 7326560	242.3	<u>184</u>
	861 Clyde Avenue lot I con A Ottawa ON <i>Well ID:</i> 7337588	242.9	<u>186</u>
	ON <i>Well ID:</i> 1508736	242.9	<u>187</u>
	861 CLYDE AVENUE Ottawa ON <i>Well ID:</i> 7271920	243.6	<u>190</u>
	ON <i>Well ID:</i> 7267058	243.9	<u>191</u>
	ON <i>Well ID:</i> 7379169	244.1	<u>192</u>
	861 CLYDE RD OTTAWA ON <i>Well ID:</i> 7155920	244.9	<u>193</u>
	ON	245.2	<u>195</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 1508087		
	581 CLYDE AV Ottawa ON	245.3	<u>196</u>
	Well ID: 7326721		
	561 CLYDE AV Ottawa ON	245.3	<u>197</u>
	Well ID: 7326589		
	561 CLYDE AV Ottawa ON	245.3	<u>197</u>
	Well ID: 7326590		
	ON	245.3	<u>197</u>
	Well ID: 7379176		
	861 CLYDE STREET Ottawa ON	245.6	<u>198</u>
	Well ID: 7119478		
	861 CLYDE AV. Ottawa ON	245.9	<u>199</u>
	Well ID: 7326564		
	ON	246.2	<u>200</u>
	Well ID: 7379179		
	ON	246.9	<u>201</u>
	Well ID: 7379165		
	861 CLYDE AV. Ottawa ON	247.8	<u>205</u>
	Well ID: 7326563		
	861 CLYDE AVE OTTAWA ON	248.3	<u>207</u>
	Well ID: 7300823		
	ON	248.6	<u>208</u>
	Well ID: 7379174		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	861 CLYDE AVE Ottawa ON <i>Well ID: 7220439</i>	249.2	<u>210</u>
	861 CLYDE AVE ON <i>Well ID: 7220443</i>	250.0	<u>211</u>
	861 CLYDE AV. Ottawa ON <i>Well ID: 7326558</i>	250.6	<u>212</u>

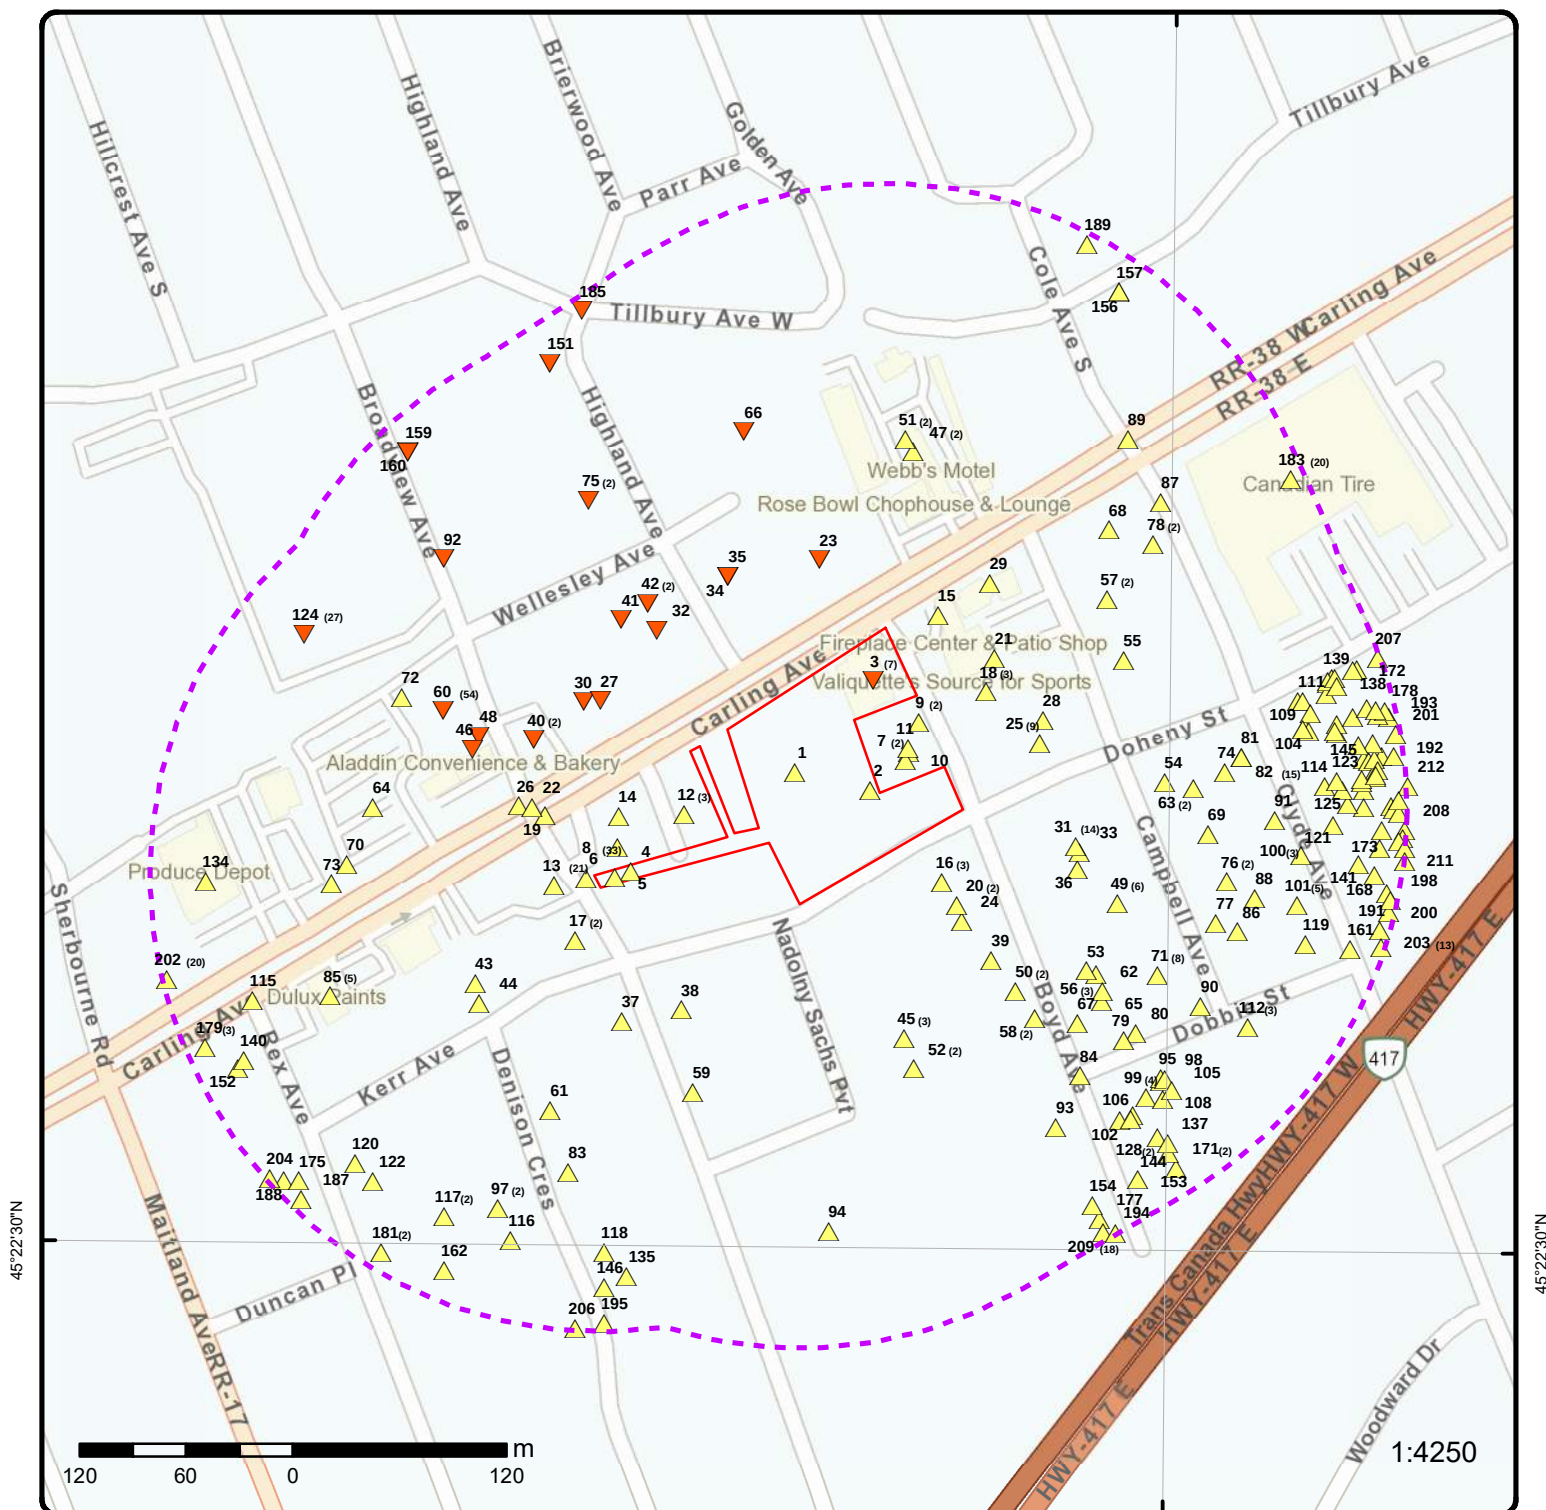

Map: 0.25 Kilometer Radius

Order Number: 24101700600

Address: Kerr/Broadview Project, Ottawa, ON




 Project Property	 Freeways; Highways	 Beach	 Shopping & Sports Area
 Buffer Outline	 Traffic Circle; Ramp	 Airport	 University/College
▲ Eris Sites with Higher Elevation	 Major Arterial; Minor Arterial	 Industrial Area	 Cemetery; Golf Course
▲ Eris Sites with Same Elevation	 Local Road	 Military Base	 Parkt (National)
▲ Eris Sites with Lower Elevation	 Service Road; Traffic Circle; Ramp	 Aircraft Roads	 Park (City/County)
○ Eris Sites with Unknown Elevation	 Rail	 Native Reservation	
		 Hospital	

75°45'W

45°22'30"N

45°22'30"N

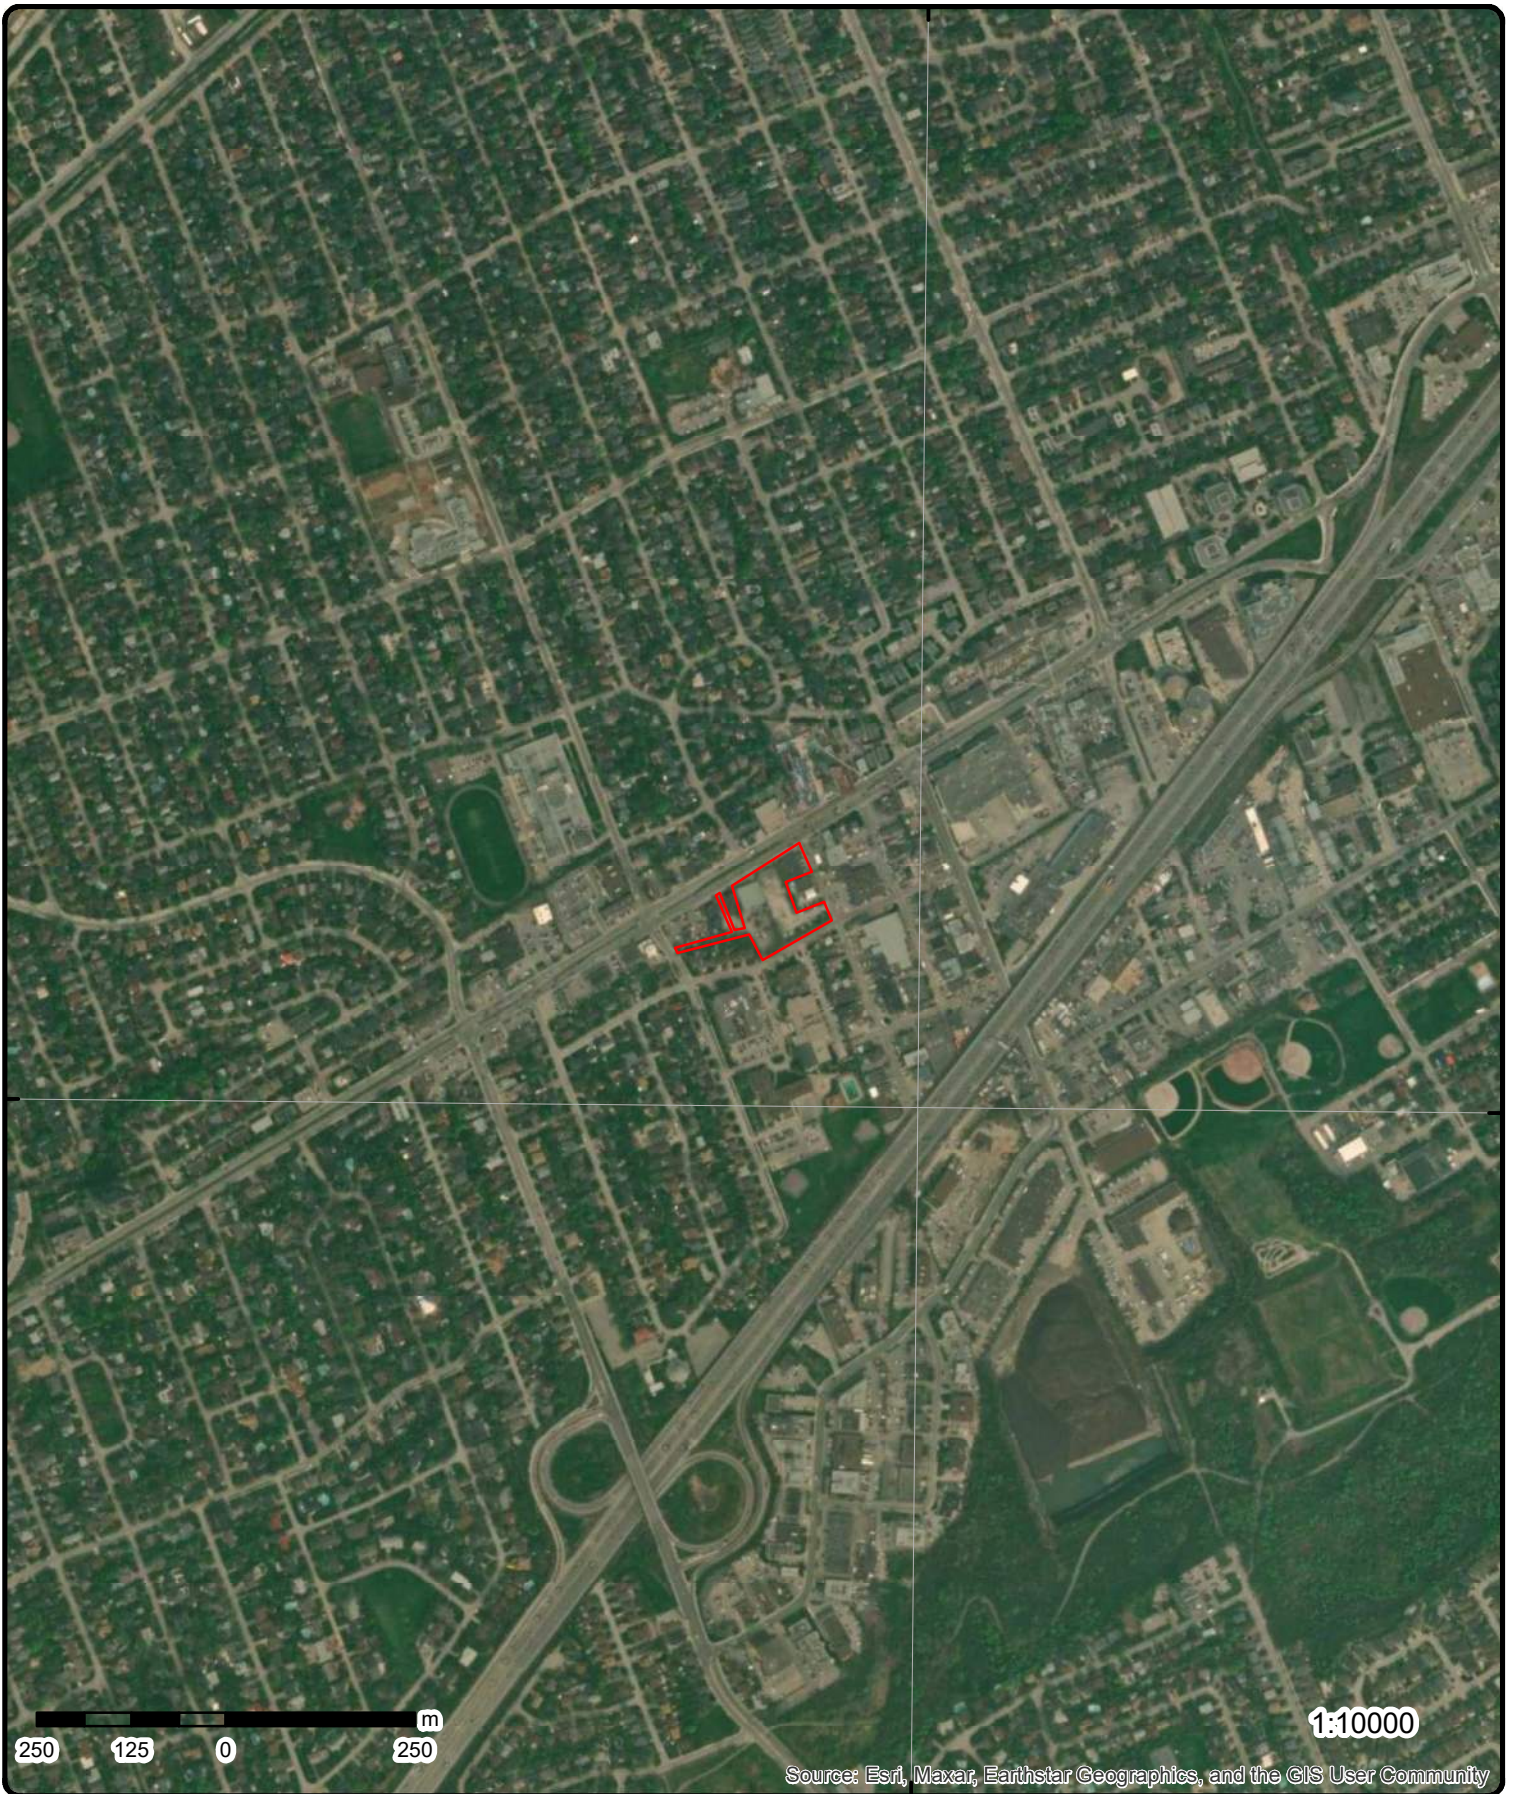

Aerial

Year: 2023

Order Number: 24101700600

Address: Kerr/Broadview Project, Ottawa, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

75°46'30"W

75°45'W


75°43'30"W

45°24'N

45°24'N

45°22'30"N

45°22'30"N

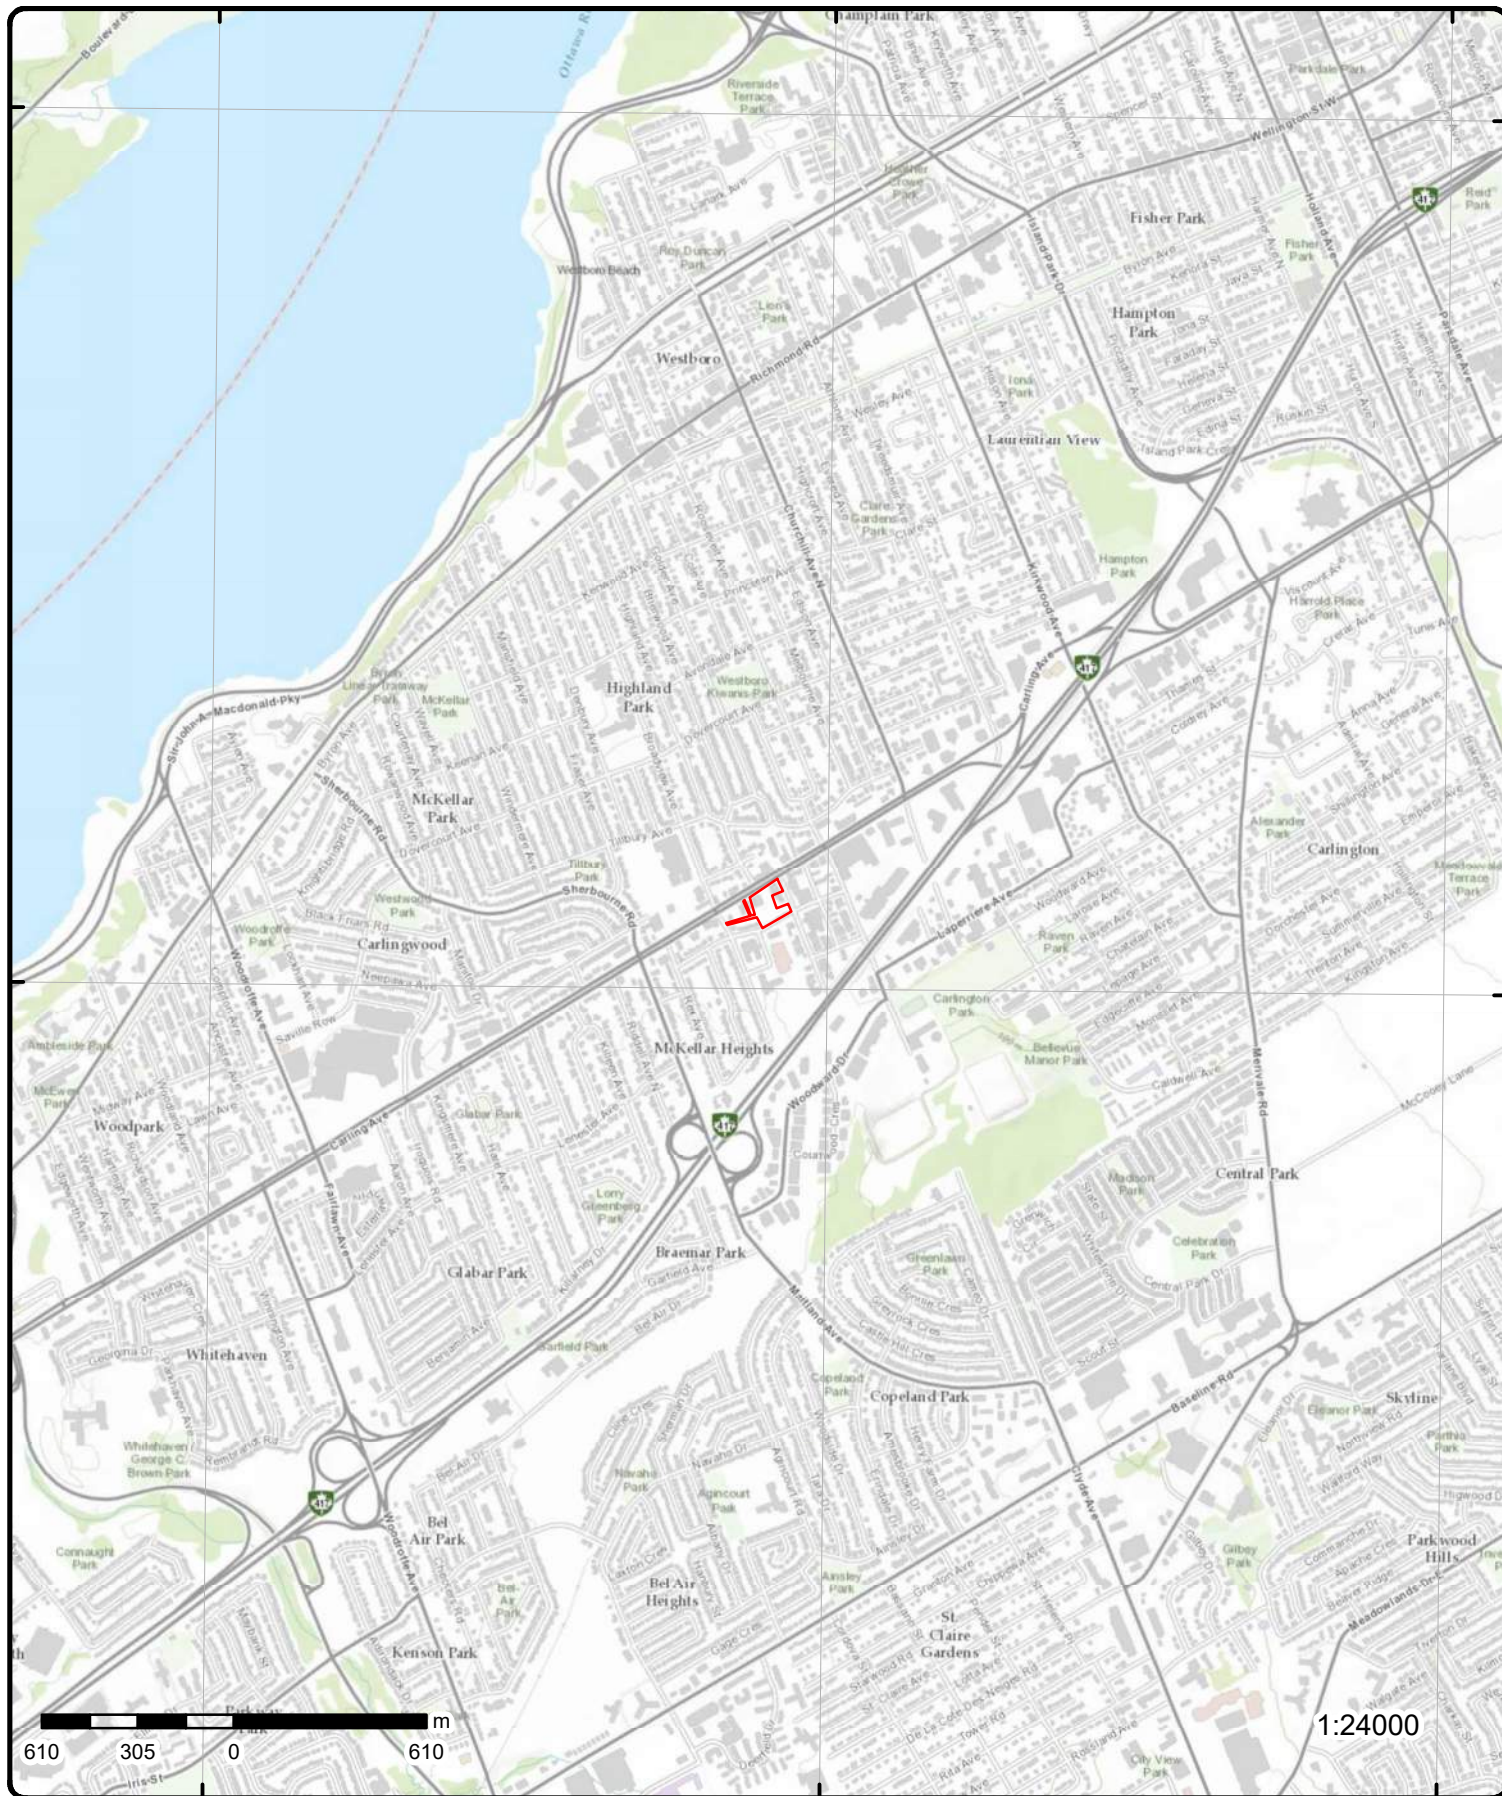

Topographic Map

Order Number: 24101700600

Address: Kerr/Broadview Project, ON

Source: ESRI World Topographic Map



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 1	W/0.0	76.6 / 0.51	AllGreen Demolition Inc. 1752 Carling Avenue Ottawa ON K2A 1E1	GEN
Generator No: ON2644362 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: 251 L Waste Class Name: Waste oils/sludges (petroleum based)					
2	1 of 1	E/0.0	76.9 / 0.72	ON	WWIS
Well ID: 1507908 Construction Date: Use 1st: Domestic Use 2nd: 0 Final Well Status: Water Supply Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: 1 Date Received: 11/12/1951 Selected Flag: TRUE Abandonment Rec: Contractor: 1802 Form Version: 1 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1507908.pdf					
Additional Detail(s) (Map)					
Well Completed Date: 11/04/1951 Year Completed: 1951 Depth (m): 18.8976					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:		45.377316602723			
Longitude:		-75.7521342160514			
X:		-75.75213405416538			
Y:		45.37731659621584			
Path:		150\1507908.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	10029943			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441110.70
Code OB Desc:				North83:	5025142.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	9
Date Completed:	11/04/1951			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	931008343				
Layer:	2				
Color:					
General Color:					
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:	17				
Material 2 Desc:	SHALE				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	3.0				
Formation End Depth:	62.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	931008342				
Layer:	1				
Color:					
General Color:					
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	3.0				
Formation End Depth UOM:	ft				
<u>Method of Construction & Well</u>					
<u>Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID:		961507908			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578513			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052539			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		62.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052538			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		20.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991507908			
Pump Set At:					
Static Level:		3.0			
Final Level After Pumping:		20.0			
Recommended Pump Depth:					
Pumping Rate:		4.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		2			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462201			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth: Water Found Depth UOM:		58.0 ft			
3	1 of 7	NE/0.0	75.8 / -0.29	VALIQUETTE ENTERPRISES INC. 1740 CARLING AVE OTTAWA ON K2A 1E1	SCT
Established:		1965			
Plant Size (ft²):		10000			
Employment:		35			
--Details--					
Description:		Textile and Fabric Finishing			
SIC/NAICS Code:		313310			
Description:		Textile Bag and Canvas Mills			
SIC/NAICS Code:		314910			
Description:		All Other Textile Product Mills			
SIC/NAICS Code:		314990			
Description:		Other Men's and Boys' Cut and Sew Clothing Manufacturing			
SIC/NAICS Code:		315229			
Description:		Other Women's and Girls' Cut and Sew Clothing Manufacturing			
SIC/NAICS Code:		315239			
Description:		All Other Miscellaneous Manufacturing			
SIC/NAICS Code:		339990			
Description:		Clothing and Clothing Accessories Wholesaler-Distributors			
SIC/NAICS Code:		414110			
Description:		Amusement and Sporting Goods Wholesaler-Distributors			
SIC/NAICS Code:		414470			
Description:		All Other Wholesaler-Distributors			
SIC/NAICS Code:		418990			
3	2 of 7	NE/0.0	75.8 / -0.29	Accolade Marketing Concept Inc. 1740 Carling Ave Ottawa ON K2A 1E1	SCT
Established:		1965			
Plant Size (ft²):		10000			
Employment:		35			
3	3 of 7	NE/0.0	75.8 / -0.29	OTTAWA BIKEWAY COMPANY LTD. 1740 CARLING AVE. OTTAWA ON K2A 1E1	GEN
Generator No:		ON1115300			
SIC Code:		6542			
SIC Description:		BICYCLE SHOPS			
Approval Years:		88,89			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
3	4 of 7	NE/0.0	75.8 / -0.29	OTTAWA BIKEWAY COMPANY LTD. 29-360 1740 CARLING AVE. OTTAWA ON K2A 1E1	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON1115300 6542 BICYCLE SHOPS 92,93,94,95,96,97,98			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
3	5 of 7	NE/0.0	75.8 / -0.29	OTTAWA BIKEWAY COMPANY LIMITED 1740 CARLING AVENUE OTTAWA ON K2A 1E1	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON1115300 6542 BICYCLE SHOPS 99,00,01			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
3	6 of 7	NE/0.0	75.8 / -0.29	VALIQUETTE SPORTS 1740 CARLING AVENUE OTTAWA ON K2A 1E1	GEN
Generator No: SIC Code: SIC Description: Approval Years:		ON2505900 5942 SPORTING GOODS, WH. 99,00,01			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			

3	7 of 7	NE/0.0	75.8 / -0.29	VALIQUETTE ENTERPRISES INC. 1740 CARLING AVENUE OTTAWA ON	GEN
Generator No:		ON2505900			
SIC Code:		451110			
SIC Description:		Sporting Goods Stores			
Approval Years:		03,04,05,06			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			

4	1 of 1	WSW/0.0	76.9 / 0.78	ON	WWIS
Well ID:		7419769		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	06/09/2022
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z385975			Contractor:	7241
Tag:	A342599			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1009059568			Tag No:	A342599
Depth M:				Contractor:	7241
Year Completed:	2022			Latitude:	45.3768912362805
Well Completed Dt:	05/20/2022			Longitude:	-75.7538489534528
Audit No:	Z385975			Y:	45.37689122918316
Path:				X:	-75.75384879108536
<u>Bore Hole Information</u>					
Bore Hole ID:	1009059568			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440976.00
Code OB Desc:				North83:	5025096.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05/20/2022			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
5	1 of 1	WSW/0.0	76.9 / 0.77	ON	WWIS
Well ID:	7419770			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	06/09/2022
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z385974			Contractor:	7241
Tag:	A349356			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1009059571			Tag No:	A349356
Depth M:				Contractor:	7241
Year Completed:	2022			Latitude:	45.3768634759577
Well Completed Dt:	05/19/2022			Longitude:	-75.753963531745
Audit No:	Z385974			Y:	45.37686346904676
Path:				X:	-75.75396337026594

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1009059571			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440967.00
Code OB Desc:				North83:	5025093.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05/19/2022			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

<u>6</u>	1 of 1	WSW/5.0	76.9 / 0.77	ON	WWIS
Well ID:	1507981			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Public			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	09/18/1951
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	1802
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1507981.pdf				

Additional Detail(s) (Map)

Well Completed Date: 07/15/1951
 Year Completed: 1951
 Depth (m): 15.8496
 Latitude: 45.3768531010739
 Longitude: -75.7541715759227
 X: -75.75417141462778
 Y: 45.376853094572404
 Path: 150\1507981.pdf

Bore Hole Information

Bore Hole ID: 10030016
 DP2BR:
 Spatial Status:
 Code OB:
 Elevation:
 Elevrc:
 Zone: 18
 East83: 440950.70

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	5025092.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	9
Date Completed:	07/15/1951			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008524			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		30.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008525			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		30.0			
Formation End Depth:		52.0			
Formation End Depth UOM:		ft			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961507981			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		10578586			
Casing No:		1			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		930052688			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		30.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052689			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		52.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991507981			
Pump Set At:					
Static Level:		8.0			
Final Level After Pumping:		20.0			
Recommended Pump Depth:					
Pumping Rate:		5.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		2			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462299			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		45.0			
Water Found Depth UOM:		ft			
<u>7</u>	1 of 2	E/11.4	76.8 / 0.66	818 Boyd Ave Ottawa ON K2A 2C7	EHS
Order No:	20040329009			Nearest Intersection:	Boyd Avenue and Carling Avenue
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	4/7/04			Search Radius (km):	0.25
Date Received:	3/29/04			X:	-75.75173
Previous Site Name:				Y:	45.377572

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Lot/Building Size: Additional Info Ordered:					
<u>7</u>	2 of 2	E/11.4	76.8 / 0.66	818 Boyd Ave Ottawa ON K2A2C7	EHS
Order No: 20141117019 Status: C Report Type: Custom Report Report Date: 20-NOV-14 Date Received: 17-NOV-14 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.751887 Y: 45.377468			
<u>8</u>	1 of 33	WSW/11.6	76.9 / 0.78	557249 ONTARIO INC 1784 CARLING AV OTTAWA ON K2A 1E1	PRT
Location ID: 10898 Type: private Expiry Date: 1994-09-30 Capacity (L): 0.00 Licence #: 0039813001					
<u>8</u>	2 of 33	WSW/11.6	76.9 / 0.78	557249 ONTARIO INC 1784 CARLING AV OTTAWA ON K2A1E1	PRT
Location ID: 10898 Type: retail Expiry Date: 1994-11-30 Capacity (L): 5000 Licence #: 0034008001					
<u>8</u>	3 of 33	WSW/11.6	76.9 / 0.78	557249 ONTARIO INC 1784 CARLING AV OTTAWA ON K2A1E1	PRT
Location ID: 10898 Type: retail Expiry Date: 1995-11-30 Capacity (L): 20737 Licence #: 0053894001					
<u>8</u>	4 of 33	WSW/11.6	76.9 / 0.78	1784 CARLING AV. OTTAWA ON	PRT
Location ID: 10899 Type: retail Expiry Date: Capacity (L): Licence #:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>8</u>	5 of 33	WSW/11.6	76.9 / 0.78	SUNOCO GAS BAR 1784 CARLING AVE OTTAWA ON K2A 1E1	RST
Headcode: Headcode Desc: Phone: List Name: Description:		01186800 SERVICE STATIONS-GASOLINE, OIL & NATURAL GAS			
<u>8</u>	6 of 33	WSW/11.6	76.9 / 0.78	SUNOCO INC. SWM - 1784 CARLING AVENUE OTTAWA CITY ON K2A 1E1	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		3-1731-95-966 95 5/2/96 Municipal sewage Received in 1995, Issued in 1996			
<u>8</u>	7 of 33	WSW/11.6	76.9 / 0.78	6434118 CANADA INC 1784 CARLING AV OTTAWA ON K2A 1E1	FSTH
License Issue Date: Tank Status: Tank Status As Of: Operation Type: Facility Type:		12/14/2005 Pending Renewal August 2007 Retail Fuel Outlet Gasoline Station - Self Serve			
--Details--					
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:		Active 1992 50000 Liquid Fuel Double Wall UST - Gasoline			
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:		Active 1992 50000 Liquid Fuel Double Wall UST - Gasoline			
<u>8</u>	8 of 33	WSW/11.6	76.9 / 0.78	2171273 ONTARIO INC 1784 CARLING AV OTTAWA ON K2A 1E1	FSTH
License Issue Date: Tank Status: Tank Status As Of: Operation Type: Facility Type:		7/21/2008 1:19:00 PM Licensed December 2008 Retail Fuel Outlet Gasoline Station - Self Serve			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details--					
Status:		Active			
Year of Installation:		1992			
Corrosion Protection:					
Capacity:		50000			
Tank Fuel Type:		Liquid Fuel Double Wall UST - Gasoline			
<u>8</u>	9 of 33	WSW/11.6	76.9 / 0.78	Petro-Canada 1784 Carling Avenue Ottawa ON K2A 1E1	SPL
Ref No:	0683-8LJSUE			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	9/9/2011			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	9/9/2011			Impact to Health:	
Dt Document Closed:	11/22/2011			Agency Involved:	
Site No:					
MOE Response:	Referral to others				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:	Petro Canada Service Station #03919<UNOFFICIAL>				
Site Address:	1784 Carling Avenue				
Site Region:					
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:	Other Discharges				
Incident Preceding Spill:					
Environment Impact:	Not Anticipated				
Health Env Consequence:					
Nature of Impact:	Other Impact(s)				
Contaminant Qty:	70 L				
Contaminant Qty 1:	70				
Contaminant Unit:	L				
Client Type:					
Source Type:					
Contaminant Code:	12				
Contaminant Name:	GASOLINE				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:					
Incident Reason:	Other - Reason not otherwise defined				
Incident Summary:	TSSA: Petro Can Serv Stn, 70L gasoline cement/asphalt, clnd				
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:	Service Station				
SAC Action Class:	Land Spills				
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					
Client Name:	Petro-Canada				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
8	10 of 33	WSW/11.6	76.9 / 0.78	1496029 ONTARIO INC 1784 CARLING AV OTTAWA ON K2A 1E1	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	9929540	Expired Date:	12/3/2001
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:		Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:			
Original Source:	EXP		
Record Date:	Up to May 2013		

8	11 of 33	WSW/11.6	76.9 / 0.78	1496029 ONTARIO INC 1784 CARLING AV OTTAWA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	9929491	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	399026	Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Propane Refill Cntr - Cylr Fill Original Source: EXP Record Date: Up to Mar 2012					

8	12 of 33	WSW/11.6	76.9 / 0.78	557249 ONTARIO INC O/A BROADVIEW SERVICE CENTER 1784 CARLING AV OTTAWA ON	DTNK

**Delisted Expired Fuel Safety
Facilities**

Instance No: 9672046 Status: EXPIRED Instance ID: 392546 Instance Type: FS Facility Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Propane Vehicle Conv Centre Original Source: EXP Record Date: Up to Mar 2012	Expired Date: Max Hazard Rank: Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:

8	13 of 33	WSW/11.6	76.9 / 0.78	1496029 ONTARIO INC 1784 CARLING AV OTTAWA ON	DTNK

**Delisted Expired Fuel Safety
Facilities**

Instance No: 11465477 Status: EXPIRED	Expired Date: Max Hazard Rank:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Instance ID: 85543 Instance Type: FS Piping Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Piping Original Source: EXP Record Date: Up to Mar 2012 Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:					

<u>8</u>	14 of 33	WSW/11.6	76.9 / 0.78	2171273 ONTARIO INC 1784 CARLING AV OTTAWA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No: 63209173 Status: EXPIRED Instance ID: 346598 Instance Type: FS Piping Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Piping Original Source: EXP Expired Date: Max Hazard Rank: Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Record Date:		Up to Mar 2012			
8	15 of 33	WSW/11.6	76.9 / 0.78	2171273 ONTARIO INC 1784 CARLING AV OTTAWA ON	DTNK
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:		63209175	Expired Date:		
Status:		EXPIRED	Max Hazard Rank:		
Instance ID:		346699	Facility Location:		
Instance Type:		FS Piping	Facility Type:		
Instance Creation Dt:			Fuel Type 2:		
Instance Install Dt:			Fuel Type 3:		
Item Description:			Panam Related:		
Manufacturer:			Panam Venue Nm:		
Model:			External Identifier:		
Serial No:			Item:		
ULC Standard:			Piping Steel:		
Quantity:			Piping Galvanized:		
Unit of Measure:			Tank Single Wall St:		
Overfill Prot Type:			Piping Underground:		
Creation Date:			Tank Underground:		
Next Periodic Str DT:			Source:		
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:		FS Piping			
Original Source:		EXP			
Record Date:		Up to Mar 2012			
8	16 of 33	WSW/11.6	76.9 / 0.78	2171273 ONTARIO INC 1784 CARLING AV OTTAWA ON	DTNK
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:		63209174	Expired Date:		
Status:		EXPIRED	Max Hazard Rank:		
Instance ID:		347469	Facility Location:		
Instance Type:		FS Piping	Facility Type:		
Instance Creation Dt:			Fuel Type 2:		
Instance Install Dt:			Fuel Type 3:		
Item Description:			Panam Related:		
Manufacturer:			Panam Venue Nm:		
Model:			External Identifier:		
Serial No:			Item:		
ULC Standard:			Piping Steel:		
Quantity:			Piping Galvanized:		
Unit of Measure:			Tank Single Wall St:		
Overfill Prot Type:			Piping Underground:		
Creation Date:			Tank Underground:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: Original Source: Record Date:				Source:	
		FS Piping EXP Up to Mar 2012			

<u>8</u>	17 of 33	WSW/11.6	76.9 / 0.78	1496029 ONTARIO INC 1784 CARLING AV OTTAWA ON	DTNK

**Delisted Expired Fuel Safety
Facilities**

Instance No:	10901844	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	50994	Facility Location:	
Instance Type:	FS Propane Tank	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS Propane Tank		
Original Source:	EXP		
Record Date:	Up to Mar 2012		

<u>8</u>	18 of 33	WSW/11.6	76.9 / 0.78	557249 ONTARIO INC O/A BROADVIEW SERVICE CENTER 1784 CARLING AV OTTAWA ON	DTNK

**Delisted Expired Fuel Safety
Facilities**

Instance No:	11136696	Expired Date:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 221 L Waste Class Name: Light fuels Waste Class: 251 L Waste Class Name: Waste oils/sludges (petroleum based)					
<u>8</u>	22 of 33	WSW/11.6	76.9 / 0.78	1784 Carling Ave Ottawa ON K2A1E1	EHS
Order No: 20170616036 Status: C Report Type: Standard Report Report Date: 22-JUN-17 Date Received: 16-JUN-17 Previous Site Name: Lot/Building Size: Additional Info Ordered: City Directory					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.754028 Y: 45.377088					
<u>8</u>	23 of 33	WSW/11.6	76.9 / 0.78	Suncor Energy Products Partnership 1784 Carling Avenue Ottawa ON K2A 1E1	GEN
Generator No: ON6711796 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 221 L Waste Class Name: Light fuels Waste Class: 251 L Waste Class Name: Waste oils/sludges (petroleum based)					
Waste Class: 221 I Waste Class Name: Light fuels					
<u>8</u>	24 of 33	WSW/11.6	76.9 / 0.78	SUNCOR ENERGY PRODUCTS PARTNERSHIP 1784 CARLING AVE OTTAWA ON	INC

8	25 of 33	WSW/11.6	76.9 / 0.78	Suncor Energy Products Partnership 1784 Carling Avenue Ottawa ON K2A 1E1	GEN
Generator No:		ON6711796			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
Waste Class:		221 L			
Waste Class Name:		Light fuels			
Waste Class:		221 I			
Waste Class Name:		Light fuels			
<u>8</u>	26 of 33	WSW/11.6	76.9 / 0.78	Suncor Energy Products Partnership 1784 Carling Avenue Ottawa ON K2A 1E1	GEN
Generator No:		ON6711796			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		221 L			
Waste Class Name:		LIGHT FUELS			
Waste Class:		221 I			
Waste Class Name:		LIGHT FUELS			
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>8</u>	27 of 33	WSW/11.6	76.9 / 0.78	SUNCOR ENERGY PRODUCTS PARTNERSHIP 1784 CARLING AVE OTTAWA ON	EXP
Inventory No:	25905259			Tank Material:	Fiberglass (FRP)
Inventory Status:	EXPIRED			Corrosion Protect:	Fiberglass
Installation Year:	1996			Overfill Protection:	
Capacity:	50000			Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		2009VBS			
Previous Fuel Type:		Gasoline			
<u>8</u>	28 of 33	WSW/11.6	76.9 / 0.78	2171273 ONTARIO INC 1784 CARLING AVE OTTAWA ON	EXP
Inventory No:	63209178			Tank Material:	Steel
Inventory Status:	EXPIRED			Corrosion Protect:	Sacrificial anode
Installation Year:	1974			Overfill Protection:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type:	23000			Inventory Context: Inventory Item:	FS Liquid Fuel Tank FS LIQUID FUEL TANK
<u>8</u>	29 of 33	WSW/11.6	76.9 / 0.78	2171273 ONTARIO INC 1784 CARLING AVE OTTAWA ON	EXP
Inventory No: Inventory Status: Installation Year: Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type:	63209177 EXPIRED 1974 23000			Tank Material: Corrosion Protect: Overfill Protection: Inventory Context: Inventory Item:	Steel Sacrificial anode FS Liquid Fuel Tank FS LIQUID FUEL TANK
	2009VBS Diesel				
<u>8</u>	30 of 33	WSW/11.6	76.9 / 0.78	2171273 ONTARIO INC 1784 CARLING AVE OTTAWA ON	EXP
Inventory No: Inventory Status: Installation Year: Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type:	63209176 EXPIRED 1974 23000			Tank Material: Corrosion Protect: Overfill Protection: Inventory Context: Inventory Item:	Steel Sacrificial anode FS Liquid Fuel Tank FS LIQUID FUEL TANK
	2009VBS Gasoline				
<u>8</u>	31 of 33	WSW/11.6	76.9 / 0.78	SUNCOR ENERGY PRODUCTS PARTNERSHIP 1784 CARLING AVE OTTAWA ON	EXP
Inventory No: Inventory Status: Installation Year: Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type:	10901850 EXPIRED 1996 50000			Tank Material: Corrosion Protect: Overfill Protection: Inventory Context: Inventory Item:	Fiberglass (FRP) Fiberglass FS Liquid Fuel Tank FS LIQUID FUEL TANK
	2009VBS Gasoline				
<u>8</u>	32 of 33	WSW/11.6	76.9 / 0.78	2171273 ONTARIO INC 1784 CARLING AVE OTTAWA ON	EXP
Inventory No: Inventory Status:	63209179 EXPIRED			Tank Material: Corrosion Protect:	Steel Sacrificial anode

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Installation Year: 1974 Capacity: 23000 Capacity Unit: Tank Type: Manufacturer: Model: Description: 2009VBS Previous Fuel Type: Gasoline					
Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
<u>8</u>	33 of 33	WSW/11.6	76.9 / 0.78	1496029 ONTARIO INC 1784 CARLING AVE OTTAWA ON	EXP
Inventory No: 11465464 Inventory Status: EXPIRED Installation Year: 1996 Capacity: 50000 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
<u>9</u>	1 of 2	ENE/14.6	76.8 / 0.65	814 Boyd Avenue Ottawa ON	EHS
Order No: 20101029030 Status: C Report Type: Standard Report Report Date: 11/9/2010 Date Received: 10/29/2010 3:08:10 PM Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Carling and Clyde Municipality: formerly Nepean Client Prov/State: ON Search Radius (km): 0.25 X: -75.751952 Y: 45.377639					
<u>9</u>	2 of 2	ENE/14.6	76.8 / 0.65	ON	WWIS
Well ID: 7162302 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: M06272 Tag: A109123 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 04/28/2011 Selected Flag: TRUE Abandonment Rec: Contractor: 7085 Form Version: 5 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7162302.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		01/06/2011			
Year Completed:		2011			
Depth (m):					
Latitude:		45.377660919138			
Longitude:		-75.7517901030368			
X:		-75.75178994110586			
Y:		45.37766091212475			
Path:		716\7162302.pdf			
Bore Hole Information					
Bore Hole ID:		1003503410		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				441138.00	
Cluster Kind:				North83:	
Date Completed:		01/06/2011		5025180.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				3	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 10 - 30 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
10	1 of 1	ENE/15.2	76.8 / 0.65	818 Boyd Ave Ottawa ON Ottawa ON K2A 2C7	EHS
Order No:		21112400580		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	
Report Date:		29-NOV-21		ON	
Date Received:		24-NOV-21		Search Radius (km):	
Previous Site Name:				.25	
Lot/Building Size:				X:	
Additional Info Ordered:				-75.7518646	
				Y:	
				45.3775109	
11	1 of 1	ENE/17.2	76.8 / 0.65	818 Boyd Avenue Ottawa ON K2A 2C7	EHS
Order No:		20190812046		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	
Report Date:		15-AUG-19		ON	
Date Received:		12-AUG-19		Search Radius (km):	
Previous Site Name:				.25	
Lot/Building Size:				X:	
Additional Info Ordered:				-75.751868	
				Y:	
				45.37753	
12	1 of 3	W/17.4	76.9 / 0.79	1772 Carling Ave Ottawa ON K2A 1E1	EHS
Order No:		20171130129		Nearest Intersection:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: Site Report Report Date: 01-DEC-17 Date Received: 30-NOV-17 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Municipality: Client Prov/State: ON Search Radius (km): .001 X: -75.75346 Y: 45.377283					
12	2 of 3	W/17.4	76.9 / 0.79	Midas International 1772 Carling Avenue Ottawa ON K2A 1E1	GEN
Generator No: ON3753474 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 L Waste Class Name: Waste crankcase oils and lubricants					
12	3 of 3	W/17.4	76.9 / 0.79	MIDAS Auto Service 1772 Carling Ave Ottawa ON K2A 1E1	GEN
Generator No: ON6993280 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 251 L Waste Class Name: Waste oils/sludges (petroleum based)					
Waste Class: 221 I Waste Class Name: Light fuels					
Waste Class: 252 L Waste Class Name: Waste crankcase oils and lubricants					
Waste Class: 331 A Waste Class Name: Waste compressed gases including cylinders					
Waste Class: 213 I					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Petroleum distillates			
Waste Class:		331 R			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		331 B			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		263 C			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
13	1 of 21	WSW/23.2	76.9 / 0.77	ZIPPY PRINT 1806 CARLING AVE OTTAWA ON K2A 1E2	SCT
Established:		1991			
Plant Size (ft²):		880			
Employment:		6			
--Details--					
Description:		COMMERCIAL PRINTING, LITHOGRAPHIC			
SIC/NAICS Code:		2752			
Description:		COMMERCIAL PRINTING, NOT ELSEWHERE CLASSIFIED			
SIC/NAICS Code:		2759			
13	2 of 21	WSW/23.2	76.9 / 0.77	ALLEGRA PRINT & IMAGING INC. 1806 Carling Ave Ottawa ON K2A 1E2	SCT
Established:		1991			
Plant Size (ft²):		880			
Employment:		6			
--Details--					
Description:		Quick Printing			
SIC/NAICS Code:		323114			
Description:		Digital Printing			
SIC/NAICS Code:		323115			
Description:		Other Printing			
SIC/NAICS Code:		323119			
13	3 of 21	WSW/23.2	76.9 / 0.77	Allegra Print & Imaging 1806 Carling Ave Ottawa ON K2A 1E2	SCT
Established:		01-JUN-87			
Plant Size (ft²):		1946			
Employment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details--					
Description:		Other Printing			
SIC/NAICS Code:		323119			
Description:		Quick Printing			
SIC/NAICS Code:		323114			
Description:		Other Printing			
SIC/NAICS Code:		323119			
Description:		Digital Printing			
SIC/NAICS Code:		323115			
Description:		Data Processing, Hosting, and Related Services			
SIC/NAICS Code:		518210			
13	4 of 21	WSW/23.2	76.9 / 0.77	ZIPPY PRINT 43-535 1806 CARLING AVE. OTTAWA ON K2A 1E2	GEN
Generator No:		ON1491609			
SIC Code:		2821			
SIC Description:		PLATEMAKING, ETC.			
Approval Years:		92,93,94,95,96,97			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
13	5 of 21	WSW/23.2	76.9 / 0.77	ZIPPY PRINT (SEE & USE ON2417500)3-535 1806 CARLING AVE. OTTAWA ON K2A 1E2	GEN
Generator No:		ON1491609			
SIC Code:		2821			
SIC Description:		PLATEMAKING, ETC.			
Approval Years:		98			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
13	6 of 21	WSW/23.2	76.9 / 0.77	ALLEGRA PRINT & IMAGING 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON2417500 2821 PLATEMAKING, ETC. 98,99,00,01,02,03,04,05,06			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		264 PHOTOPROCESSING WASTES			
13	7 of 21	WSW/23.2	76.9 / 0.77	ZIPPY PRINT (SEE & USE ON2417500) 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON1491609 2821 PLATEMAKING, ETC. 99			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		264 PHOTOPROCESSING WASTES			
13	8 of 21	WSW/23.2	76.9 / 0.77	Allegra Print & Imaging 1806 Carling Ave Ottawa ON K2A 1E2	SCT
Established: Plant Size (ft²): Employment:		1987 1946			
<u>--Details--</u>					
Description: SIC/NAICS Code:		Quick Printing 323114			
Description: SIC/NAICS Code:		Digital Printing 323115			
Description: SIC/NAICS Code:		Other Printing 323119			

139 erisinfo.com | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
13	12 of 21	WSW/23.2	76.9 / 0.77	Kealey Printing Inc. 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No:		ON2417500			
SIC Code:		414430			
SIC Description:		Photographic Equipment and Supplies Wholesaler-Distributors			
Approval Years:		2011			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
13	13 of 21	WSW/23.2	76.9 / 0.77	Kealey Printing Inc. 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No:		ON2417500			
SIC Code:		414430			
SIC Description:		Photographic Equipment and Supplies Wholesaler-Distributors			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
13	14 of 21	WSW/23.2	76.9 / 0.77	Kealey Printing Inc. 1806 CARLING AVENUE OTTAWA ON	GEN
Generator No:		ON2417500			
SIC Code:		414430			
SIC Description:		PHOTOGRAPHIC EQUIPMENT AND SUPPLIES WHOLESALER-DISTRIBUTORS			
Approval Years:		2013			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
13	15 of 21	WSW/23.2	76.9 / 0.77	Kealey Printing Inc. 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No:		ON2417500			
SIC Code:		414430			
SIC Description:		PHOTOGRAPHIC EQUIPMENT AND SUPPLIES WHOLESALER-DISTRIBUTORS			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
Detail(s)					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
13	16 of 21	WSW/23.2	76.9 / 0.77	Kealey Printing Inc. 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No:		ON2417500			
SIC Code:		414430			
SIC Description:		PHOTOGRAPHIC EQUIPMENT AND SUPPLIES WHOLESALER-DISTRIBUTORS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
Detail(s)					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
13	17 of 21	WSW/23.2	76.9 / 0.77	Kealey Printing Inc. 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON2417500 SIC Code: 414430 SIC Description: PHOTOGRAPHIC EQUIPMENT AND SUPPLIES WHOLESALER-DISTRIBUTORS Approval Years: 2014 PO Box No: Country: Canada Status: Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
13	18 of 21	WSW/23.2	76.9 / 0.77	Kealey Printing Inc. 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No: ON2417500 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 264 L Waste Class Name: Photoprocessing wastes Waste Class: 264 T Waste Class Name: Photoprocessing wastes					
13	19 of 21	WSW/23.2	76.9 / 0.77	Kealey Printing Inc. 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No: ON2417500 SIC Code: SIC Description: Approval Years: As of Jul 2020 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: 264 T Waste Class Name: Photoprocessing wastes Waste Class: 264 L Waste Class Name: Photoprocessing wastes					
13	20 of 21	WSW/23.2	76.9 / 0.77	Kealey Printing Inc. 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No: ON2417500 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 264 T Waste Class Name: Photoprocessing wastes Waste Class: 264 L Waste Class Name: Photoprocessing wastes					
13	21 of 21	WSW/23.2	76.9 / 0.77	Kealey Printing Inc. 1806 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No: ON2417500 SIC Code: SIC Description: Approval Years: As of Oct 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 264 T Waste Class Name: PHOTOPROCESSING WASTES Waste Class: 264 L Waste Class Name: PHOTOPROCESSING WASTES					
14	1 of 1	W/27.9	76.9 / 0.78	ON	WWIS
Well ID: 7306421 Construction Date: Flowing (Y/N): Flow Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C34350 Tag: A149854 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:				Data Entry Status: Yes Data Src: Date Received: 02/26/2018 Selected Flag: TRUE Abandonment Rec: Contractor: 6964 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1006991993 Depth M: Year Completed: 2017 Well Completed Dt: 07/27/2017 Audit No: C34350 Path:				Tag No: A149854 Contractor: 6964 Latitude: 45.3771696632535 Longitude: -75.753942057048 Y: 45.3771696564726 X: -75.75394189512184	
<u>Bore Hole Information</u>					
Bore Hole ID: 1006991993 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 07/27/2017 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:				Elevation: Elevrc: Zone: 18 East83: 440969.00 North83: 5025127.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr	
15	1 of 1	NE/29.5	76.8 / 0.70	Advanced Prefabs Ltd. 1722 Carling Ave Ottawa ON K2A 1C7	SCT
Established: Plant Size (ft²): Employment:		01-SEP-52			
<u>--Details--</u>					
Description: SIC/NAICS Code:		Household Appliance Wholesaler-Distributors 414220			
Description: SIC/NAICS Code:		Other Home Furnishings Wholesaler-Distributors 414390			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		Plumbing, Heating and Air-Conditioning Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		416120			
Description:		All Other Home Furnishings Stores			
SIC/NAICS Code:		442298			
Description:		Amusement and Sporting Goods Wholesaler-Distributors			
SIC/NAICS Code:		414470			
Description:		Plumbing, Heating and Air-Conditioning Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		416120			
16	1 of 3	ESE/29.5	76.9 / 0.73	Jarry's Dental Laboratory Inc. 836 Boyd Ave Ottawa ON K2A 2E1	SCT
Established:					
Plant Size (ft²):					
Employment:					
--Details--					
Description:		Medical Equipment and Supplies Manufacturing			
SIC/NAICS Code:		339110			
16	2 of 3	ESE/29.5	76.9 / 0.73	836 Boyd Avenue Ottawa ON K2A 2E1	EHS
Order No:		20110824020		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State: ON	
Report Date:		8/30/2011		Search Radius (km): 0.25	
Date Received:		8/24/2011 10:57:11 AM		X: -75.751417	
Previous Site Name:				Y: 45.377047	
Lot/Building Size:					
Additional Info Ordered:					
16	3 of 3	ESE/29.5	76.9 / 0.73	836 BOYD STREET Ottawa ON	WWIS
Well ID:		7175486		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received: 01/24/2012	
Water Type:				Selected Flag: TRUE	
Casing Material:		Abandonment Rec:			
Audit No:		Z132501		Contractor: 7323	
Tag:		A094334		Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:		Lot:			
Depth to Bedrock:		Concession:			
Well Depth:		Concession Name:			
Overburden/Bedrock:		Easting NAD83:			
Pump Rate:		Northing NAD83:			
Static Water Level:		Zone:			
Clear/Cloudy:		UTM Reliability:			
Municipality:		OTTAWA CITY			
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/717\7175486.pdf			
Additional Detail(s) (Map)					
Well Completed Date:	10/07/2011				
Year Completed:	2011				
Depth (m):	7.9248				
Latitude:	45.3768519619402				
Longitude:	-75.751613348167				
X:	-75.75161318602288				
Y:	45.37685195548608				
Path:	717\7175486.pdf				
Bore Hole Information					
Bore Hole ID:	1003636054		Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		
Code OB:			East83:		
Code OB Desc:			North83:		
Open Hole:			Org CS:		
Cluster Kind:			UTMRC:		
Date Completed:	10/07/2011		UTMRC Desc:		
Remarks:			Location Method:		
Location Method Desc:	from gis		gis		
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:	1004142037				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:					
Material 2 Desc:					
Material 3:	77				
Material 3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	7.0				
Formation End Depth UOM:	ft				
Overburden and Bedrock					
Materials Interval					
Formation ID:	1004142038				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	74				
Material 3 Desc:	LAYERED				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		7.0			
Formation End Depth:		26.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004142047			
Layer:		1			
Plug From:		0.0			
Plug To:		9.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004142048			
Layer:		2			
Plug From:		9.0			
Plug To:		26.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004142046			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:		BORING			
 <u>Pipe Information</u>					
Pipe ID:		1004142036			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004142042			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		11.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1004142043			
Layer:		1			
Slot:		.10			
Screen Top Depth:		11.0			
Screen End Depth:		26.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		1004142041			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1004142040			
Diameter:		4.0			
Depth From:		7.0			
Depth To:		26.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1004142039			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		7.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
17	1 of 2	WSW/32.8	76.9 / 0.77	MTS ALLSTREAM INC 1793 KERR AVE,,OTTAWA,ON,K2A 1J2,CA ON	PINC
Incident Id:				Pipe Material:	
Incident No:	1481046			Fuel Category:	
Incident Reported Dt:	9/17/2014			Health Impact:	
Type:	FS-Pipeline Incident			Environment Impact:	
Status Code:				Property Damage:	
Tank Status:	Pipeline Damage Reason Est			Service Interrupt:	
Task No:				Enforce Policy:	
Spills Action Centre:				Public Relation:	
Fuel Type:				Pipeline System:	
Fuel Occurrence Tp:				PSIG:	
Date of Occurrence:				Attribute Category:	
Occurrence Start Dt:				Regulator Location:	
Depth:				Method Details:	
Customer Acct Name:	MTS ALLSTREAM INC				
Incident Address:	1793 KERR AVE,,OTTAWA,ON,K2A 1J2,CA				
Operation Type:					
Pipeline Type:					
Regulator Type:					
Summary:					
Reported By:					
Affiliation:					
Occurrence Desc:					
Damage Reason:					
Notes:					
17	2 of 2	WSW/32.8	76.9 / 0.77	Enbridge Gas Distribution Inc. 1793 Kerr Avenue Ottawa ON	SPL
Ref No:	0246-9P2PV9			Municipality No:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year: Incident Dt: 2014/09/17 Dt MOE Arvl on Scn: MOE Reported Dt: 2014/09/17 Dt Document Closed: Site No: NA MOE Response: Not Moe mandate Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: resi property<UNOFFICIAL> Site Address: 1793 Kerr Avenue Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: Leak/Break Incident Preceding Spill: Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Air Pollution Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description Client Type: Source Type: Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Operator/Human Error Incident Summary: TSSA FSB: gas srvc dmrgd Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Pipeline/Components SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Enbridge Gas Distribution Inc. Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					
18	1 of 3	ENE/39.2	76.9 / 0.76	GLIDDEN PAINTS/ICI PAINTS(CANADA) INC. 819 BOYD AVENUE OTTAWA ON K2A 2C8	GEN
Generator No: ON0003942 SIC Code: 3751 SIC Description: PAINT & VARNISH IND. Approval Years: 92,93,97 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>18</u>	2 of 3	ENE/39.2	76.9 / 0.76	GLIDDEN PAINTS 17-533 ICI PAINTS (CANADA) INC. 819 BOYD AVENUE OTTAWA ON K2A 2C8	GEN
Generator No:		ON0003942			
SIC Code:		3751			
SIC Description:		PAINT & VARNISH IND.			
Approval Years:		94,95,96			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>18</u>	3 of 3	ENE/39.2	76.9 / 0.76	GLIDDEN PAINTS/ICI PAINTS(CANADA) INC 819 BOYD AVENUE OTTAWA ON K2A 2C8	GEN
Generator No:		ON0003942			
SIC Code:		3751			
SIC Description:		PAINT & VARNISH IND.			
Approval Years:		98,99,00,01			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
19	1 of 1	W/43.5	76.9 / 0.75	East left turning lane @ Broadview Ave & Carlingview Ave. OTTAWA ON	SPL
Ref No:		1-ZD6BT		Municipality No:	
Year:				Nature of Damage:	
Incident Dt:		7/19/2021 3:00:00 PM		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		7/19/2021 5:39:00 PM		Impact to Health:	0 No Impact
Dt Document Closed:		7/20/2021 3:02:32 PM		Agency Involved:	
Site No:					
MOE Response:		Desktop Response			
Site County/District:					
Site Geo Ref Meth:					
Site District Office:		Ottawa District Office			
Nearest Watercourse:					
Site Name:					
Site Address:		East left turning lane @ Broadview Ave & Carlingview Ave.			
Site Region:					
Site Municipality:		OTTAWA			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:					
Incident Preceding Spill:		Accident/Collision			
Environment Impact:		1 Minor Impact			
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:		1 other - see notes			
Contaminant Qty 1:					
Contaminant Unit:					
Client Type:					
Source Type:		Motor Vehicle			
Contaminant Code:					
Contaminant Name:		OIL (PETROLEUM BASED, NOT SPECIFIED)			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		Land			
Incident Reason:		Unknown			
Incident Summary:		Norris Construction Management - spill to CB found. Cleaned			
Activity Preceding Spill:		Unknown			
Property 2nd Watershed:		Central Ottawa			
Property Tertiary Watershed:		02KF-Central Ottawa - Mississippi			
Sector Type:					
SAC Action Class:					
Call Report Locatn Geodata:		{ "integration_ids": ["PR00004324337"], "wkts": ["POINT (-75.7544697576 45.3771720089)"], "creation_date": "2021-07-19" }			
Time Reported:					
System Facility Address:					
Client Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
20	1 of 2	ESE/44.8	76.9 / 0.73	International Kafia Coffee 842 Boyd Ave Ottawa ON K2A 2E1	SCT
Established:		01-JAN-81			
Plant Size (ft²):		4500			
Employment:					
--Details--					
Description:		Other Specialty-Line Food Wholesaler-Distributors			
SIC/NAICS Code:		413190			
Description:		Coffee and Tea Manufacturing			
SIC/NAICS Code:		311920			
Description:		All Other Specialty Food Stores			
SIC/NAICS Code:		445299			
20	2 of 2	ESE/44.8	76.9 / 0.73	842 BOYD AVENUE Ottawa ON	WWIS
Well ID:		7270130		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	
Water Type:				08/29/2016	
Casing Material:				Selected Flag:	
Audit No:		Z188421		TRUE	
Tag:				Abandonment Rec:	
Constructn Method:				Yes	
Elevation (m):				Contractor:	
Elevatn Reliability:				1558	
Depth to Bedrock:				Form Version:	
Well Depth:				7	
Overburden/Bedrock:				Owner:	
Pump Rate:				County:	
Static Water Level:				OTTAWA-CARLETON	
Clear/Cloudy:				Lot:	
Municipality:		NEPEAN TOWNSHIP		Concession:	
Site Info:				Concession Name:	
				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/727\7270130.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		12/23/2015			
Year Completed:		2015			
Depth (m):					
Latitude:		45.3767356270022			
Longitude:		-75.7515096318712			
X:		-75.75150947017768			
Y:		45.376735620548246			
Path:		727\7270130.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006227528		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
				441159.00	
				North83:	
				5025077.00	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	12/23/2015			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006256075			
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006256081			
Layer:		1			
Plug From:		36.75			
Plug To:		0.0			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006256080			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006256074			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006256078			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006256079			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006256077			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006256076			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>21</u>	1 of 1	ENE/48.7	76.9 / 0.76	Advanced Prefabs Ltd. 811 Boyd Ave Ottawa ON K2A 2C8	SCT
Established:		1952			
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:		All Other Non-Metallic Mineral Product Manufacturing			
SIC/NAICS Code:		327990			
Description:		Other Ornamental and Architectural Metal Products Manufacturing			
SIC/NAICS Code:		332329			
Description:		Heating Equipment and Commercial Refrigeration Equipment Manufacturing			
SIC/NAICS Code:		333416			
<u>22</u>	1 of 1	W/51.5	76.9 / 0.75	ON	BORE
Borehole ID:		612814		Inclin FLG:	No
OGF ID:		215514120		SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:		Borehole		Piezometer:	No
Use:				Primary Name:	
Completion Date:				Municipality:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method: Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	7.3 -999 Ground Surface 76.5 77			Lot: Township: Latitude DD: 45.377212 Longitude DD: -75.75456 UTM Zone: 18 Easting: 440921 Northing: 5025132 Location Accuracy: Accuracy: Not Applicable	
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218392599 4.3 Brown Bedrock 			Mat Consistency: Compact Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
BEDROCK. BROWN,GREY,FISSURED. M, WATER STABLE AT 226.9 FEET.SAND. COMPACT. SAND. VERY HA **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218392598 0 4.3 Clay Sand 			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
CLAY.					
<u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 053220 NTS_Sheet: 31G05F			Source Appl: Spatial/Tabular Source Iden: 1 Scale or Res: Varies Horizontal: NAD27 Verticalda: Mean Average Sea Level	
<u>Source List</u>					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: NAD27 Vertical Datum: Mean Average Sea Level Projection Name: Universal Transverse Mercator	
23	1 of 1	N/52.0	76.0 / -0.16	1723 Carling Ave Ottawa ON K2A1C8	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 20160201020 Status: C Report Type: Custom Report Report Date: 04-FEB-16 Date Received: 01-FEB-16 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.752516 Y: 45.378478					
24	1 of 1	SE/54.1	76.9 / 0.73	ON	WWIS
Well ID: 7204981 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C21244 Tag: A096551 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 07/19/2013 Selected Flag: TRUE Abandonment Rec: Contractor: 7328 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1004440457 Depth M: Year Completed: 2012 Well Completed Dt: 05/10/2012 Audit No: C21244 Path:					
Tag No: A096551 Contractor: 7328 Latitude: 45.3766548740838 Longitude: -75.7514702465844 Y: 45.37665486706858 X: -75.7514700853606					
<u>Bore Hole Information</u>					
Bore Hole ID: 1004440457 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 05/10/2012 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 441162.00 North83: 5025068.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

157 erisinfo.com | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
25	4 of 9	E/54.6	76.9 / 0.77	CAPITAL FOOD SERVICES LTD. 08-359 830 CAMPBELL AVE. OTTAWA ON K2A 2C2	GEN
Generator No:		ON0938900			
SIC Code:		9214			
SIC Description:		CATERERS			
Approval Years:		94			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
25	5 of 9	E/54.6	76.9 / 0.77	830 CAMPBELL AVE OTTAWA ON	WWIS
Well ID:	7272146			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	09/22/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z233040			Contractor:	7241

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag:	A190862			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	FRONTENAC
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		KINGSTON TOWNSHIP			
Site Info:					

Bore Hole Information

Bore Hole ID:	1006253090	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	374786.00
Code OB Desc:		North83:	4901359.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	9
Date Completed:	08/19/2016	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	www
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID:	1006472421
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	28
Material 1 Desc:	SAND
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	77
Material 3 Desc:	LOOSE
Formation Top Depth:	0.0
Formation End Depth:	1.5199999809265137
Formation End Depth UOM:	m

Overburden and Bedrock Materials Interval

Formation ID:	1006472422
Layer:	2
Color:	2
General Color:	GREY
Material 1:	15
Material 1 Desc:	LIMESTONE
Material 2:	73
Material 2 Desc:	HARD
Material 3:	71
Material 3 Desc:	FRACTURED
Formation Top Depth:	1.5199999809265137

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		4.869999885559082			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006472431			
Layer:		3			
Plug From:		1.83000000429153442			
Plug To:		4.869999885559082			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006472430			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.83000000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006472429			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006472428			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006472420			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006472426			
Layer:		1			
Material:		7			
Open Hole or Material:		OTHER			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006472427			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Slot:		10			
Screen Top Depth:		2.130000114440918			
Screen End Depth:		4.8699998855559082			
Screen Material:		7			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
 <u>Water Details</u>					
Water ID:		1006472425			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1006472424			
Diameter:		7.599999904632568			
Depth From:		1.5199999809265137			
Depth To:		4.8699998855559082			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1006472423			
Diameter:		11.399999618530273			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
25	6 of 9	E/54.6	76.9 / 0.77	830 CAMPBELL AVE OTTAWA ON	WWIS
Well ID:	7272145			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	09/22/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z233041			Contractor:	7241
Tag:	A190853			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	FRONTENAC
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	KINGSTON TOWNSHIP				
Site Info:					

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1006253087			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	374786.00
Code OB Desc:				North83:	4901358.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	9
Date Completed:	08/19/2016			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006472381				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:	71				
Material 3 Desc:	FRACTURED				
Formation Top Depth:	1.8200000524520874				
Formation End Depth:	6.090000152587891				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006472380				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	77				
Material 3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	1.8200000524520874				
Formation End Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006472390				
Layer:	1				
Plug From:	0.0				
Plug To:	0.3100000023841858				
Plug Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1006472392			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.090000152587891			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006472391			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006472389			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006472379			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006472385			
Layer:		1			
Material:		7			
Open Hole or Material:		OTHER			
Depth From:		0.0			
Depth To:		3.049999952316284			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006472386			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.049999952316284			
Screen End Depth:		6.090000152587891			
Screen Material:		7			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1006472384			
Layer:					
Kind Code:					
Kind:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006472383			
Diameter:		7.599999904632568			
Depth From:		1.8200000524520874			
Depth To:		6.090000152587891			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1006472382			
Diameter:		11.399999618530273			
Depth From:		0.0			
Depth To:		1.8200000524520874			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>25</u>	7 of 9	E/54.6	76.9 / 0.77	HTS Engineering Ltd 101-830 Campbell Drive Ottawa ON K2A2C4O	GEN
Generator No:		ON7994838			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>25</u>	8 of 9	E/54.6	76.9 / 0.77	HTS Engineering Ltd 101-830 Campbell Drive Ottawa ON K2A2C4	GEN
Generator No:		ON7994838			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		252 L Waste crankcase oils and lubricants			
25	9 of 9	E/54.6	76.9 / 0.77	HTS Engineering Ltd 101-830 Campbell Drive Ottawa ON K2A2C4	GEN
Generator No:		ON7994838			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		252 L			
Waste Class Name:		WASTE OILS & LUBRICANTS			
26	1 of 1	W/57.8	76.9 / 0.75	Carling Ave and Broadview Ave, Ottawa OTTAWA ON	SPL
Ref No:		1-WPTDM		Municipality No:	
Year:				Nature of Damage:	
Incident Dt:		7/14/2021 5:13:00 AM		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		7/14/2021 5:39:16 AM		Impact to Health:	0 No Impact
Dt Document Closed:		7/15/2021 8:37:22 AM		Agency Involved:	
Site No:					
MOE Response:		Desktop Response			
Site County/District:					
Site Geo Ref Meth:					
Site District Office:		Ottawa District Office			
Nearest Watercourse:					
Site Name:					
Site Address:		Carling Ave and Broadview Ave, Ottawa			
Site Region:					
Site Municipality:		OTTAWA			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:					
Incident Preceding Spill:		Accident/Collision			
Environment Impact:		1 Minor Impact			
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:		0 other - see notes			
Contaminant Qty 1:					
Contaminant Unit:					
Client Type:					
Source Type:		Motor Vehicle			
Contaminant Code:					
Contaminant Name:		FUEL OIL			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Incident Reason: Unknown Incident Summary: CofOttawa: MVA operating fluids to road Activity Preceding Spill: Normal operations Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004324337"],"wkts":["POINT (-75.7544848000 45.3771360000)"],"creation_date":"2021-07-14"} Time Reported: System Facility Address: Client Name:					
27	1 of 1	WNW/58.1	75.9 / -0.22	1767 and 1775 Carling Avenue Ottawa ON K2A 1C9	EHS
Order No: 20060131001 Status: C Report Type: Custom Report Report Date: 2/8/2006 Date Received: 1/31/2006 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.754078 Y: 45.377758					
28	1 of 1	E/61.3	76.9 / 0.77	830 Campbell Ottawa ON	EHS
Order No: 20160615079 Status: C Report Type: Standard Report Report Date: 22-JUN-16 Date Received: 15-JUN-16 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Ottawa Client Prov/State: ON Search Radius (km): .25 X: -75.7509 Y: 45.377679					
29	1 of 1	NE/63.7	76.9 / 0.77	Vision Circuit Technologies Inc. 1712 Carling Ave Ottawa ON K2A 1C7	SCT
Established: 1996 Plant Size (ft²): Employment: 12					
30	1 of 1	WNW/66.2	75.9 / -0.23	RESTAURANT 1775 CARLINGS, CHAOPHRAYA THAI CUISINE (N.O.S.) OTTAWA CITY ON	SPL
Ref No: 160041 Year: Incident Dt: 9/11/1998 Dt MOE Arvl on Scn: MOE Reported Dt: 9/13/1998					
Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Dt Document Closed:		Agency Involved:			
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:		OTHER CONTAINER LEAK			
Incident Preceding Spill:					
Environment Impact:		POSSIBLE			
Health Env Consequence:					
Nature of Impact:		Soil contamination			
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Client Type:					
Source Type:					
Contaminant Code:					
Contaminant Name:					
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		LAND			
Incident Reason:		DAMAGE BY MOVING EQUIPMENT			
Incident Summary:		CHAOPHRAYA THAI CUISINE - VEGETABLE OIL TO LAWN. CLEANING.			
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:					
SAC Action Class:					
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					
Client Name:					

31	1 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	GEN
Generator No:		ON0840500			
SIC Code:		9725			
SIC Description:		LINEN SUPPLY			
Approval Years:		86,87,88,89,90,97,98,99,00,01,02,03,04,06,07,08			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					

Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name: 221 LIGHT FUELS Waste Class: Waste Class Name: 252 WASTE OILS & LUBRICANTS Waste Class: Waste Class Name: 262 DETERGENTS/SOAPS					
31	2 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERV (OUT OF BUSINESS) 850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: ON0840500 9725 LINEN SUPPLY 92,93,95,96					
<u>Detail(s)</u>					
Waste Class: Waste Class Name: 221 LIGHT FUELS Waste Class: Waste Class Name: 262 DETERGENTS/SOAPS					
31	3 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 10-252 850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility: ON0840500 9725 LINEN SUPPLY 94					
<u>Detail(s)</u>					
Waste Class: Waste Class Name: 221 LIGHT FUELS Waste Class: Waste Class Name: 262 DETERGENTS/SOAPS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
31	4 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 850 CAMPBELL AVENUE OTTAWA ON	GEN
Generator No:		ON0840500			
SIC Code:		812330			
SIC Description:		Linen and Uniform Supply			
Approval Years:		2009			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
31	5 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 850 CAMPBELL AVENUE OTTAWA ON	GEN
Generator No:		ON0840500			
SIC Code:		812330			
SIC Description:		Linen and Uniform Supply			
Approval Years:		2010			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
31	6 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 850 CAMPBELL AVENUE OTTAWA ON	GEN
Generator No:		ON0840500			
SIC Code:		812330			
SIC Description:		Linen and Uniform Supply			
Approval Years:		2011			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
31	7 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 850 CAMPBELL AVENUE OTTAWA ON K2A 2C5	GEN
Generator No:		ON0840500			
SIC Code:		812330			
SIC Description:		Linen and Uniform Supply			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
31	8 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 850 CAMPBELL AVENUE OTTAWA ON	GEN
Generator No:		ON0840500			
SIC Code:		812330			
SIC Description:		LINEN AND UNIFORM SUPPLY			
Approval Years:		2013			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
31	9 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	GEN
Generator No:		ON0840500			
SIC Code:		812330			
SIC Description:		LINEN AND UNIFORM SUPPLY			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
31	10 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	GEN
Generator No:		ON0840500			
SIC Code:		812330			
SIC Description:		LINEN AND UNIFORM SUPPLY			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		252			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
31	11 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	GEN
Generator No:		ON0840500			
SIC Code:		812330			
SIC Description:		LINEN AND UNIFORM SUPPLY			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
31	12 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. INDEPENDENT LINEN SERVICE 850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	GEN
Generator No:		ON0840500			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		262 L			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Detergents and soaps			
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
31	13 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. INDEPENDENT LINEN SERVICE 850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	GEN
Generator No:		ON0840500			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		262 L			
Waste Class Name:		Detergents and soaps			
31	14 of 14	E/66.6	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. INDEPENDENT LINEN SERVICE 850 CAMPBELL AVENUE OTTAWA ON K2A 2C9	GEN
Generator No:		ON0840500			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		262 L			
Waste Class Name:		Detergents and soaps			

32	1 of 1	WNW/68.7	76.0 / -0.18	ON	WWIS
Well ID:	1507965			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	07/11/1950
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	3725
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1507965.pdf				

Additional Detail(s) (Map)

Well Completed Date: 05/02/1950
 Year Completed: 1950
 Depth (m): 17.0688
 Latitude: 45.3781165499368
 Longitude: -75.753677484723
 X: -75.7536773233116
 Y: 45.378116543173995
 Path: 150\1507965.pdf

Bore Hole Information

Bore Hole ID:	10030000	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440990.70
Code OB Desc:		North83:	5025232.00
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	05/02/1950	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	p9
Location Method Desc:	Original Pre1985 UTM Rel Code 9: unknown UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008487			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008488			
Layer:		2			
Color:		8			
General Color:		BLACK			
Material 1:		26			
Material 1 Desc:		ROCK			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		56.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961507965			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578570			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052654			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		4.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 930052655 Layer: 2 Material: 4 Open Hole or Material: OPEN HOLE Depth From: Depth To: 56.0 Casing Diameter: 4.0 Casing Diameter UOM: inch Casing Depth UOM: ft					
Results of Well Yield Testing					
Pumping Test Method Desc: PUMP Pump Test ID: 991507965 Pump Set At: Static Level: 12.0 Final Level After Pumping: Recommended Pump Depth: Pumping Rate: 1.0 Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: 1 Water State After Test: CLEAR Pumping Test Method: 1 Pumping Duration HR: 0 Pumping Duration MIN: 30 Flowing: No					
Water Details					
Water ID: 933462278 Layer: 1 Kind Code: 1 Kind: FRESH Water Found Depth: 53.0 Water Found Depth UOM: ft					
33	1 of 1	E/69.7	76.9 / 0.73	CLEANWEAR UNIFORM SERVICE INC. 847 BOYD AVENUE OTTAWA CITY ON K2A 2C9	CA
Certificate #: 3-0927-96- Application Year: 96 Issue Date: 9/25/1996 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
34	1 of 1	NNW/72.1	75.9 / -0.27	ON	WWIS
Well ID: 1508303 Flowing (Y/N):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	10/15/1951
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	5448
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508303.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	05/30/1951				
Year Completed:	1951				
Depth (m):	16.764				
Latitude:	45.3783899362032				
Longitude:	-75.7531702267679				
X:	-75.75317006547678				
Y:	45.378389929058365				
Path:	150\1508303.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	10030338			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441030.70
Code OB Desc:				North83:	5025262.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	9
Date Completed:	05/30/1951			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:	Original Pre1985 UTM Rel Code 9: unknown UTM				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	931009319				
Layer:	1				
Color:					
General Color:					
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:					
Material 2 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931009320			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0			
Formation End Depth:		55.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508303			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578908			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930053330			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		12.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930053331			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		55.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:	PUMP				
Pump Test ID:	991508303				
Pump Set At:					
Static Level:	6.0				
Final Level After Pumping:	10.0				
Recommended Pump Depth:					
Pumping Rate:	7.0				
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:	1				
Water State After Test:	CLEAR				
Pumping Test Method:	1				
Pumping Duration HR:	0				
Pumping Duration MIN:	30				
Flowing:	No				
<u>Water Details</u>					
Water ID:	933462745				
Layer:	1				
Kind Code:	1				
Kind:	FRESH				
Water Found Depth:	55.0				
Water Found Depth UOM:	ft				
35	1 of 1	NNW/72.2	75.9 / -0.27	ON	BORE
Borehole ID:	612834			Inclin FLG:	No
OGF ID:	215514140			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	MAY-1951			Municipality:	
Static Water Level:	10.7			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.378391
Total Depth m:	16.8			Longitude DD:	-75.75317
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	441031
Drill Method:				Northing:	5025262
Orig Ground Elev m:	77.7			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	76.2				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218392664			Mat Consistency:	Soft
Top Depth:	.9			Material Moisture:	
Bottom Depth:	16.8			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Limestone			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gsc Material Description: Stratum Description:				Depositional Gen: LIMESTONE. K. 00120 00175. CLAY. GREY,SOFT. CLAY. LAYERED, WATER STABLE AT 220.0 FE **Note: Many records provided by the department have a truncated [Stratum Description] field.	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218392663 0 .9 Clay CLAY.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 05342 NTS_Sheet:			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
<u>36</u>	1 of 1	ESE/72.4	76.9 / 0.74	843 Boyd Ave Ottawa ON Ottawa ON K2A 2C9	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	21110800153 C Standard Report 11-NOV-21 08-NOV-21 			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON .25 -75.7506421 45.3769281
<u>37</u>	1 of 1	SW/76.1	76.9 / 0.76	ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m):	1507936 Domestic 0 Water Supply Constructn Method: Elevation (m):			Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County:	 1 10/25/1950 TRUE 3725 1 OTTAWA-CARLETON

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			OTTAWA CITY	Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1507936.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/20/1950			
Year Completed:		1950			
Depth (m):		20.7264			
Latitude:		45.3761347432683			
Longitude:		-75.7539065916344			
X:		-75.7539064306324			
Y:		45.376134736009924			
Path:		150\1507936.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10029971		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440970.70
Code OB Desc:				North83:	5025012.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	9
Date Completed:		08/20/1950		UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008395			
Layer:		1			
Color:					
General Color:					
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		931008397			
Layer:		3			
Color:					
General Color:					
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		20.0			
Formation End Depth:		29.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008396			
Layer:		2			
Color:		3			
General Color:		BLUE			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		8.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008398			
Layer:		4			
Color:		3			
General Color:		BLUE			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		29.0			
Formation End Depth:		68.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961507936			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578541			
Casing No:		1			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		930052594			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		68.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052593			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		30.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991507936			
Pump Set At:					
Static Level:		12.0			
Final Level After Pumping:		20.0			
Recommended Pump Depth:					
Pumping Rate:		40.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		0			
Pumping Duration MIN:		20			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462235			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		50.0			
Water Found Depth UOM:		ft			
<u>38</u>	1 of 1	SW/78.3	76.9 / 0.78	JEWISH COMMUNITY CAMPUS OF OTTAWA 831 BROADVIEW AVE. (SWM) OTTAWA CITY ON K2A 2M6	CA
Certificate #:		3-1187-97-			
Application Year:		97			
Issue Date:		9/18/1997			
Approval Type:		Municipal sewage			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		Approved			
39	1 of 1	SE/81.1	76.9 / 0.77	850 Boyd Avenue Ottawa ON K2A 2E1	EHS
Order No: 20200327156 Status: C Report Type: Standard Report Report Date: 01-APR-20 Date Received: 27-MAR-20 Previous Site Name: Lot/Building Size: Additional Info Ordered:				Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.751254 Y: 45.3764627	
40	1 of 2	W/83.5	75.9 / -0.26	LADY JANE DONUTS LIMITED 1779 CARLING AVE OTTAWA ON K2A 1C9	SCT
Established: 1979 Plant Size (ft²): 0 Employment: 11 --Details-- Description: BREAD AND OTHER BAKERY PRODUCTS, EXCEPT COOKIES AND CRACKERS SIC/NAICS Code: 2051					
40	2 of 2	W/83.5	75.9 / -0.26	1779 Carling Avenue Ottawa ON K2A 1C9	EHS
Order No: 20050705010 Status: C Report Type: Complete Report Report Date: 7/14/2005 Date Received: 7/5/2005 Previous Site Name: Lot/Building Size: Additional Info Ordered:				Nearest Intersection: north side of Carling Avenue Municipality: Ottawa-Carleton Client Prov/State: ON Search Radius (km): 0.25 X: -75.754217 Y: 45.377522	
41	1 of 1	WNW/83.8	75.9 / -0.21	OTTAWA HYDRO 490 WELLESLEY AVE TRANSFORMER OTTAWA CITY ON K2A 1B7	SPL
Ref No: 124149 Year: Incident Dt: 3/12/1996 Dt MOE Arvl on Scn: MOE Reported Dt: 3/11/1996 Dt Document Closed: Site No: MOE Response:				Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: OTHER CONTAINER LEAK Incident Preceding Spill: Environment Impact: NOT ANTICIPATED Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Client Type: Source Type: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Incident Reason: EQUIPMENT FAILURE Incident Summary: OTTAWA HYDRO:35L MINERAL OIL TO GROUND DUE TO FAULTY TRANSFORMER. Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:					
42	1 of 2	NW/83.9	76.0 / -0.18	ON	WWIS
Well ID: 1508300 Construction Date: Use 1st: Domestic Use 2nd: 0 Final Well Status: Water Supply Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: 1 Date Received: 11/26/1951 Selected Flag: TRUE Abandonment Rec: Contractor: 4832 Form Version: 1 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508300.pdf				
Additional Detail(s) (Map)					
Well Completed Date:	02/10/1950				
Year Completed:	1950				
Depth (m):	21.336				
Latitude:	45.3782511367781				
Longitude:	-75.7537431338873				
X:	-75.75374297215939				
Y:	45.37825113002573				
Path:	150\1508300.pdf				
Bore Hole Information					
Bore Hole ID:	10030335			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440985.70
Code OB Desc:				North83:	5025247.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	9
Date Completed:	02/10/1950			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:	Original Pre1985 UTM Rel Code 9: unknown UTM				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:	931009313				
Layer:	2				
Color:					
General Color:					
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	5.0				
Formation End Depth:	70.0				
Formation End Depth UOM:	ft				
Overburden and Bedrock					
Materials Interval					
Formation ID:	931009312				
Layer:	1				
Color:					
General Color:					
Material 1:	02				
Material 1 Desc:	TOPSOIL				
Material 2:					
Material 2 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961508300			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578905			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930053324			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		10.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930053325			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		70.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		991508300			
Pump Set At:					
Static Level:		14.0			
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Duration MIN: Flowing:		No			
<u>Water Details</u>					
Water ID:		933462738			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		44.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		933462739			
Layer:		2			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		50.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		933462740			
Layer:		3			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		70.0			
Water Found Depth UOM:		ft			
42	2 of 2	NW/83.9	76.0 / -0.18	ON	WWIS
Well ID:		1508301		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Domestic		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Water Supply		Date Received:	
Water Type:				Selected Flag:	
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	
Tag:				Form Version:	
Constructn Method:				Owner:	
Elevation (m):				County:	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508301.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/07/1950			
Year Completed:		1950			
Depth (m):		28.0416			
Latitude:		45.3782511367781			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Longitude:		-75.7537431338873			
X:		-75.75374297215939			
Y:		45.37825113002573			
Path:		150\1508301.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	10030336			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440985.70
Code OB Desc:				North83:	5025247.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	9
Date Completed:	10/07/1950			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	931009315				
Layer:	2				
Color:					
General Color:					
Material 1:	17				
Material 1 Desc:	SHALE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	2.0				
Formation End Depth:	6.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	931009314				
Layer:	1				
Color:					
General Color:					
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	2.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	931009316				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		3			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		6.0			
Formation End Depth:		92.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961508301			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578906			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930053327			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		92.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930053326			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		15.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508301			
Pump Set At:					
Static Level:		9.0			
Final Level After Pumping:		12.0			
Recommended Pump Depth:					
Pumping Rate:		8.0			
Flowing Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Recommended Pump Rate: 11.0 Levels UOM: ft Rate UOM: GPM Water State After Test Code: 1 Water State After Test: CLEAR Pumping Test Method: 1 Pumping Duration HR: 1 Pumping Duration MIN: 0 Flowing: No					
<u>Water Details</u>					
Water ID: 933462742 Layer: 2 Kind Code: 1 Kind: FRESH Water Found Depth: 70.0 Water Found Depth UOM: ft					
<u>Water Details</u>					
Water ID: 933462741 Layer: 1 Kind Code: 1 Kind: FRESH Water Found Depth: 50.0 Water Found Depth UOM: ft					
<u>Water Details</u>					
Water ID: 933462743 Layer: 3 Kind Code: 1 Kind: FRESH Water Found Depth: 92.0 Water Found Depth UOM: ft					
43	1 of 1	WSW/88.9	77.9 / 1.76	DONALD OCONNOR 1807 KERR AVE,,OTTAWA,ON,K2A 1J2,CA ON	PINC
Incident Id: Incident No: 1494554 Incident Reported Dt: 10/8/2014 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: DONALD OCONNOR Incident Address: 1807 KERR AVE,,OTTAWA,ON,K2A 1J2,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation:					
Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Occurrence Desc: Damage Reason: Notes:					
44	1 of 1	WSW/94.4	77.9 / 1.76	ON	WWIS
Well ID:		1508379		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Domestic		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Water Supply		Date Received:	
Water Type:				Selected Flag:	
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	
Tag:				Form Version:	
Constructn Method:				Owner:	
Elevation (m):				County:	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508379.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		09/29/1954			
Year Completed:		1954			
Depth (m):		32.004			
Latitude:		45.3762180005154			
Longitude:		-75.754929439014			
X:		-75.75492927722176			
Y:		45.37621799416146			
Path:		150\1508379.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10030414		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		09/29/1954		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		Original Pre1985 UTM Rel Code 5: margin of error : 100 m - 300 m			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		931009534			
Layer:		3			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		22.0			
Formation End Depth:		105.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931009532			
Layer:		1			
Color:					
General Color:					
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		18.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931009533			
Layer:		2			
Color:					
General Color:					
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		18.0			
Formation End Depth:		22.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508379			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578984			
Casing No:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930053476			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		105.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930053475			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		26.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508379			
Pump Set At:					
Static Level:		15.0			
Final Level After Pumping:		20.0			
Recommended Pump Depth:					
Pumping Rate:		3.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462862			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		100.0			
Water Found Depth UOM:		ft			
45	1 of 3	SSE/94.8	77.8 / 1.72	OTTAWA ROMAN CATHOLIC S.S. BOARD MAINTENCE FACILITY 1774 KERR AVENUE OTTAWA-CARLETON ON K2A 1R9	GEN
Generator No:		ON0426410			
SIC Code:		8511			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ELEMT./SECON. EDUC. 92,93,97,98			
Detail(s)					
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
45	2 of 3	SSE/94.8	77.8 / 1.72	OTTAWA ROMAN CATHOLIC S.S. BOARD 29-612 MAINTENCE FACILITY 1774 KERR AVE. OTTAWA-CARLETON ON K2A 1R9	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON0426410 8511 ELEMT./SECON. EDUC. 94,95,96			
Detail(s)					
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
45	3 of 3	SSE/94.8	77.8 / 1.72	OTTAWA ROMAN CATHOLIC SEPARATE SCHOOL BD MAINTENCE FACILITY 1774 KERR AVENUE OTTAWA-CARLETON ON K2A 1R9	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON0426410 8511 ELEMT./SECON. EDUC. 99,00,01			
Detail(s)					
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
46	1 of 1	W/98.5	75.9 / -0.23	770 BROADVIEW OTTAWA ON	WWIS
Well ID:		7238475	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring and Test Hole	Data Entry Status:		
Use 2nd:		0	Data Src:		
Final Well Status:		Monitoring and Test Hole	Date Received: 03/23/2015		
Water Type:			Selected Flag: TRUE		
Casing Material:			Abandonment Rec:		
Audit No:		Z198114	Contractor: 7241		
Tag:		A165712	Form Version: 7		
Constructn Method:			Owner:		
Elevation (m):			County: OTTAWA-CARLETON		
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7238475.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		02/20/2015			
Year Completed:		2015			
Depth (m):		6.1			
Latitude:		45.3775047665289			
Longitude:		-75.7549938188086			
X:		-75.75499365755093			
Y:		45.37750476002185			
Path:		723\7238475.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1005314035	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone: 18		
Code OB:			East83: 440887.00		
Code OB Desc:			North83: 5025165.00		
Open Hole:			Org CS: UTM83		
Cluster Kind:			UTMRC: 4		
Date Completed:		02/20/2015	UTMRC Desc: margin of error : 30 m - 100 m		
Remarks:			Location Method: wwr		
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005563541			
Layer:		2			
Color:		6			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		84			
Material 2 Desc:		SILTY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005563540			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005563542			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		84			
Material 2 Desc:		SILTY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.570000171661377			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005563552			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005563550			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005563551			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005563549			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005563539			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005563545			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005563546			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005563544			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: Diameter: Depth From: Depth To: Hole Depth UOM: Hole Diameter UOM:		1005563543 15.319999694824219 0.0 6.099999904632568 m cm			
47	1 of 2	NNE/99.9	76.8 / 0.64	Claridge Homes (1717 Carling) Inc. 1707 Carling Ave 1717 Carling Avenue Ottawa ON K2P 0Y6	ECA
Approval No: Approval Date: Status: Record Type: Link Source: SWP Area Name: Approval Type: Project Type: Business Name: Address: Full Address: Full PDF Link: PDF Site Location:		3250-CES2GC July 3, 2022 Approved ECA IDS Rideau Valley ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS MUNICIPAL AND PRIVATE SEWAGE WORKS Claridge Homes (1717 Carling) Inc. 1707 Carling Ave 1717 Carling Avenue https://www.accessenvironment.ene.gov.on.ca/instruments/5937-CDWGPJ-14.pdf High Rise Residential and Retirement Home Facility 1707 and 1717 Carling Avenue City of Ottawa, Ontario	MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:	Ottawa Ottawa -75.75106 45.378838 -8432569.4263000004 5681360.2572999969	
47	2 of 2	NNE/99.9	76.8 / 0.64	Claridge Homes (1717 Carling) Inc. 1707 Carling Ave 1717 Carling Avenue Ottawa ON K2P 0Y6	ECA
Approval No: Approval Date: Status: Record Type: Link Source: SWP Area Name: Approval Type: Project Type: Business Name: Address: Full Address: Full PDF Link: PDF Site Location:		5371-CESQEP July 25, 2022 Approved ECA IDS Rideau Valley ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS MUNICIPAL AND PRIVATE SEWAGE WORKS Claridge Homes (1717 Carling) Inc. 1707 Carling Ave 1717 Carling Avenue https://www.accessenvironment.ene.gov.on.ca/instruments/4377-CE4MRX-14.pdf 1707 and 1717 Carling Avenue City of Ottawa, Ontario	MOE District: City: Longitude: Latitude: Geometry X: Geometry Y:	Ottawa Ottawa -75.75106 45.378838 -8432569.4263000004 5681360.2572999969	
48	1 of 1	W/101.3	75.9 / -0.23	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev: Drill Method:		612820 215514126 Borehole NOV-1972 8.8 Ground Surface	Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: Northing:	No Initial Entry No No No 45.377569 -75.754948 18 440891 5025172	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Orig Ground Elev m: Elev Reliabil Note: DEM Ground Elev m: Concession: Location D: Survey D: Comments:	74.6 75.9			Location Accuracy: Accuracy:	Not Applicable
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218392620 1.8 3 Brown Clay Sand			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Soft
		CLAY. BROWN,VERY SOFT.			
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218392619 1.5 1.8 Sand Silt			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
		SAND. DENSE.			
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218392621 3 3.4 Clay Silt Sand			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Stiff
		CLAY. STIFF.			
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218392623 3.8 7.3 Till Silt Boulders			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Dense
		TILL. DENSE TO VERY DENSE.			
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218392622 3.4 3.8 Sand Silt Till			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	Stiff
		SAND. STIFF.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218392624 7.3 8.8 Bedrock Limestone BEDROCK. 00000 012 00050 015 00060 038 00100 067 00110 012 00125 010 0000			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: Top Depth: Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	218392618 0 1.5 Sand Silt Bedrock ARTIFICIAL.			Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Source					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 H Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 053280 NTS_Sheet: 31G05F Logged by professional. Exact and complete description of material and properties.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
Source List					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
49	1 of 6	ESE/101.4	76.9 / 0.74	CLEANWEAR UNIFORM SERVICE INC. 843 BOYD AVENUE OTTAWA CITY ON K2A 2C9	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:	8-4108-91-91 2/4/1992 Industrial air Approved in 1992 INSTALL (1) BOILER, (6) UNIT HEATERS Nitrogen Oxides No Controls				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
49	2 of 6	ESE/101.4	76.9 / 0.74	AUTOMOTIVE REPAIR SHOP 843 BOYD OTTAWA CITY ON K2A 2C9	SPL
Ref No: 32025 Year: Incident Dt: 3/14/1990 Dt MOE Arvl on Scn: MOE Reported Dt: 3/14/1990 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: OTHER CONTAINER LEAK Incident Preceding Spill: Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Water course or lake Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Client Type: Source Type: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND / WATER Incident Reason: ERROR Incident Summary: FUEL OIL INTERCEPTERS 100 L FUEL OIL TO GROUND AND SEWER. Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved: CITY OF OTTAWA					
49	3 of 6	ESE/101.4	76.9 / 0.74	DRY CLEANER 843 BOYD AVE. (N.O.S.) OTTAWA CITY ON K2A 2C9	SPL
Ref No: 153743 Year: Incident Dt: 3/26/1998 Dt MOE Arvl on Scn: MOE Reported Dt: 3/26/1998 Dt Document Closed: Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved: OTTAWA-CARLETON REG.					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: OTHER CAUSE (N.O.S.) Incident Preceding Spill: Environment Impact: NOT ANTICIPATED Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Client Type: Source Type: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Incident Reason: OTHER Incident Summary: INDEPENDENT LINNEN: LINT ON GROUND OUTSIDE STORE, WORKS. Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:					
49	4 of 6	ESE/101.4	76.9 / 0.74	Cleanwear Uniform Service Inc. 843 Boyd Avenue Ottawa ON K2A 2C9	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		9675-5K4LA2 2003 3/7/2003 Industrial Sewage Works Approved			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
49	5 of 6	ESE/101.4	76.9 / 0.74	Cleanwear Uniform Service Inc. 843 Boyd Avenue Ottawa ON K2A 2C9	ECA
Approval No: 9675-5K4LA2 Approval Date: 2003-03-07 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-INDUSTRIAL SEWAGE WORKS Project Type: INDUSTRIAL SEWAGE WORKS Business Name: Cleanwear Uniform Service Inc. Address: 843 Boyd Avenue Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/7249-5J8LW2-14.pdf PDF Site Location: MOE District: Ottawa City: Longitude: -75.75083 Latitude: 45.376617 Geometry X: Geometry Y:					
49	6 of 6	ESE/101.4	76.9 / 0.74	843 Boyd Ave Ottawa ON K2A2C9	EHS
Order No: 20170605055 Status: C Report Type: Standard Report Report Date: 08-JUN-17 Date Received: 05-JUN-17 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.750676 Y: 45.376799					
50	1 of 2	SE/103.1	77.9 / 1.79	Aarkade Design & Offset Printing Inc. 854 Boyd Ave Unit B Ottawa ON K2A 2E1	SCT
Established: 1989 Plant Size (ft²): Employment: 4 --Details-- Description: Quick Printing SIC/NAICS Code: 323114 Description: Digital Printing SIC/NAICS Code: 323115 Description: Other Printing SIC/NAICS Code: 323119					
50	2 of 2	SE/103.1	77.9 / 1.79	854 Boyd, Ave, Ottawa ON K2A 2E1	EHS
Order No: 20120524016 Status: C Report Type: Standard Report Report Date: 04-JUN-12 Date Received: 24-MAY-12 Previous Site Name: Lot/Building Size: 5624 square feet Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.751035 Y: 45.37641					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
51	1 of 2	NNE/106.7	76.8 / 0.64	WEBB'S MOTEL LIMITED 1705 CARLING AVENUE ON Ottawa ON	RSC
RSC No: 225386 RA No: Status: FILED Filing Date: Date Ack: Date Returned: Approval Date: February 13, 2019 Cert Date: Cert Prop Use No: Curr Property Use: Intended Prop Use: Restoration Type: Soil Type: Criteria: Stratified (Y/N): Audit (Y/N): Entire Leg Prop. (Y/N): CPU Issu Sect 1686: Business Name: WEBB'S MOTEL LIMITED Address: 1705 CARLING AVENUE ON Legal Desc: Site Pin: 04006-0002 (LT) Asmt Roll No: Project Type: POST2011 Approval Type: RSC based on Phase One and Two ESAs Applicable Standards: PDF Link: https://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=225386 X: -75.7519369007888 Y: 45.37910016600528 Latitude: 45.37910017 Longitude: -75.7519369 UTM Coordinates: Latitude Longitude: Accuracy Estimate: Measurement Method: Mailing Address: Telephone: Fax: Email: Postal Code: K2A 1C8 Ministry District: MOE District: Ottawa SWP Area Name: Rideau Valley Qual Person Name: MICHAEL BEAUDOIN Consultant:					
51	2 of 2	NNE/106.7	76.8 / 0.64	Claridge Homes (1717 Carling) Inc. 1705 Carling Avenue Ottawa, ON Canada ON	PTTW
EBR Registry No: 019-2911 Ministry Ref No: 4400-BWLS4B Notice Type: Instrument Notice Stage: Decision Notice Date: Proposal Date: December 29, 2020 Year: 2020 Instrument Type: Permit to take water Off Instrument Name: Permit to Take Water (OWRA s. 34) Posted By: Ministry of the Environment, Conservation and Parks Company Name: Site Address: 1705 Carling Avenue Ottawa, ON Canada Location Other: Proponent Name: Claridge Homes (1717 Carling) Inc. Proponent Address: Claridge Homes (1717 Carling) Inc. Suite 2001 - 210 Gladstone Avenue Ottawa, ON K2P 0Y6 Canada Comment Period: December 29, 2020 - January 28, 2021 (30 days) Closed URL: https://ero.ontario.ca/notice/019-2911 Summary: Site Location Details: Decision Posted: March 30, 2021 Exception Posted: Section: Section 34 Act 1: Ontario Water Resources Act, R.S.O. 1990 Act 2: Ontario Water Resources Act Site Location Map: 45.378898,-75.751695					
52	1 of 2	SSE/112.3	77.8 / 1.72	PIPELINE HIT - 2" 21 NADOLNY SACHS PVT,,OTTAWA,ON,K2A	PINC

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				1R9,CA ON	
Incident Id: Incident No: 1721564 Incident Reported Dt: 9/16/2015 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: PIPELINE HIT - 2" Incident Address: 21 NADOLNY SACHS PVT.,OTTAWA,ON,K2A 1R9,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes: Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					

52	2 of 2	SSE/112.3	77.8 / 1.72	Capital elevator Ltd 21 Nadolny Satch Ottawa ON K2A 1R9	GEN
Generator No: ON4251897 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 L Waste Class Name: Waste crankcase oils and lubricants					

53	1 of 1	ESE/114.2	77.6 / 1.47	857-861 Boyd Inc. 857 Boyd Avenue Ottawa ON K2A 2C9	GEN
Generator No: ON5393963 SIC Code: SIC Description: Approval Years: As of Oct 2019 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class:		221 L			
Waste Class Name:		Light fuels			
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
54	1 of 1	E/114.3	76.8 / 0.64	MANNION PETROLEUM 1700B DOHENY ST OTTAWA ON K2A 1J4	RST
Headcode:		924800			
Headcode Desc:		Oils-Fuel			
Phone:		6137224034			
List Name:					
Description:					
55	1 of 1	ENE/117.1	76.8 / 0.71	ON	WWIS
Well ID:		7206030		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status: Yes	
Use 2nd:				Data Src:	
Final Well Status:				Date Received: 08/07/2013	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		C21239		Contractor: 7328	
Tag:		A140382		Form Version: 8	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
Additional Detail(s) (Map)					
Bore Hole ID:		1004496298		Tag No: A140382	
Depth M:				Contractor: 7328	
Year Completed:		2012		Latitude: 45.3779855962258	
Well Completed Dt:		12/10/2012		Longitude: -75.7503256072614	
Audit No:		C21239		Y: 45.377985589163195	
Path:				X: -75.75032544510529	
Bore Hole Information					
Bore Hole ID:		1004496298		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 18	
Code OB:				East83: 441253.00	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc: Open Hole: Cluster Kind: Date Completed: 12/10/2012 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
				North83: 5025215.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr	
56	1 of 3	ESE/119.0	77.6 / 1.46	Mansfield & Rodney Printing 861 Boyd Ave Ottawa ON K2A 2C9	SCT
Established: 01-AUG-63 Plant Size (ft²): 6000 Employment:					
--Details-- Description: Paper Bag and Coated and Treated Paper Manufacturing SIC/NAICS Code: 322220					
Description: Quick Printing SIC/NAICS Code: 323114					
Description: Other Printing SIC/NAICS Code: 323119					
Description: Digital Printing SIC/NAICS Code: 323115					
Description: Other Printing SIC/NAICS Code: 323119					
56	2 of 3	ESE/119.0	77.6 / 1.46	Wil-Mac Labels 861 Boyd Ave Ottawa ON K2A 2C9	SCT
Established: 01-AUG-83 Plant Size (ft²): Employment:					
--Details-- Description: Other Printing SIC/NAICS Code: 323119					
Description: Digital Printing SIC/NAICS Code: 323115					
Description: Paper Bag and Coated and Treated Paper Manufacturing SIC/NAICS Code: 322220					
Description: Other Printing SIC/NAICS Code: 323119					
56	3 of 3	ESE/119.0	77.6 / 1.46	861 Boyd Avenue Ottawa ON K2A 2C9	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 20120514004 Status: C Report Type: Custom Report Report Date: 5/23/2012 Date Received: 5/14/2012 9:10:31 AM Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans;					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.750418 Y: 45.376159					
57	1 of 2	ENE/119.7	76.9 / 0.76	815 Campbell Avenue Ottawa ON K2A 2C4	EHS
Order No: 20060417020 Status: C Report Type: Basic Report Report Date: 4/26/2006 Date Received: 4/17/2006 Previous Site Name: Lot/Building Size: 400 square metres Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Carling Avenue Municipality: City of Ottawa Client Prov/State: ON Search Radius (km): 0.25 X: -75.750645 Y: 45.378363					
57	2 of 2	ENE/119.7	76.9 / 0.76	Import Car Centre Sales Inc. 815 Campbell Rd Ottawa ON K1Z 5Z6	ECA
Approval No: 0542-6GML7B Approval Date: 2005-10-07 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-INDUSTRIAL SEWAGE WORKS Project Type: INDUSTRIAL SEWAGE WORKS Business Name: Import Car Centre Sales Inc. Address: 815 Campbell Rd Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/9382-6F5KGL-14.pdf PDF Site Location:					
MOE District: Ottawa City: Longitude: -75.75045 Latitude: 45.378292 Geometry X: Geometry Y:					
58	1 of 2	SE/121.5	77.9 / 1.79	AI Parsons Electronics Ltd. 860 Boyd Ave Ottawa ON K2A 2E1	SCT
Established: 01-SEP-48 Plant Size (ft²): 6500 Employment:					
--Details-- Description: General-Line Building Supplies Wholesaler-Distributors SIC/NAICS Code: 416310					
Description: Electronic Components, Navigational and Communications Equipment and Supplies Wholesaler-Distributors SIC/NAICS Code: 417320					
Description: Other Building Finishing Contractors SIC/NAICS Code: 238390					
Description: Industrial Machinery, Equipment and Supplies Wholesaler-Distributors SIC/NAICS Code: 417230					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		Electronic Components, Navigational and Communications Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		417320			
Description:		Other Specialty-Line Building Supplies Wholesaler-Distributors			
SIC/NAICS Code:		416390			
Description:		All Other Building Equipment Contractors			
SIC/NAICS Code:		238299			
Description:		Hardware Wholesaler-Distributors			
SIC/NAICS Code:		416330			
58	2 of 2	SE/121.5	77.9 / 1.79	860 Boyd Avenue Ottawa ON K2A 2E1	EHS
Order No:		20180724017		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		27-JUL-18		Search Radius (km): .25	
Date Received:		24-JUL-18		X: -75.7511	
Previous Site Name:				Y: 45.376125	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
59	1 of 1	SSW/121.8	77.9 / 1.76	ON	BORE
Borehole ID:		612792		Inclin FLG: No	
OGF ID:		215514098		SP Status: Initial Entry	
Status:				Surv Elev: No	
Type:		Borehole		Piezometer: No	
Use:					
Completion Date:					
Static Water Level:		10.0			
Primary Water Use:					
Sec. Water Use:					
Total Depth m:		-999		Latitude DD: 45.375779	
Depth Ref:		Ground Surface		Longitude DD: -75.753391	
Depth Elev:				UTM Zone: 18	
Drill Method:				Easting: 441011	
Orig Ground Elev m:		79.1		Northing: 5024972	
Elev Reliabil Note:				Location Accuracy:	
DEM Ground Elev m:		79.2		Accuracy: Not Applicable	
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:		218392513		Mat Consistency:	
Top Depth:		.3		Material Moisture:	
Bottom Depth:		1.7		Material Texture:	
Material Color:		Non Geo Mat Type:			
Material 1:		Clay		Geologic Formation:	
Material 2:		Sand		Geologic Group:	
Material 3:		Geologic Period:			
Material 4:		Depositional Gen:			
Gsc Material Description:					
Stratum Description:		CLAY.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Geology Stratum ID:	218392512			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:	Black			Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL. BLACK.				
Geology Stratum ID:	218392514			Mat Consistency:	Firm
Top Depth:	1.7			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. SOFT. CLAY. BROWN,GREY,STIFF. AND. FIRM. BOULDERS. SILT. BEDROCK. 0001 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	H			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: OTTAWA2.txt RecordID: 053000 NTS_Sheet: 31G05F				
Confiden 1:	Logged by professional. Exact and complete description of material and properties.				
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

60	1 of 54	W/125.6	75.9 / -0.23	MEDICAL PHARMACY 770 BROADVIEW AVENUE OTTAWA ON K2A 3Z3	GEN
Generator No:	ON1538107				
SIC Code:	6031				
SIC Description:	PHARMACIES				
Approval Years:	99,00,01				
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					

Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: 261 Waste Class Name: PHARMACEUTICALS Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	2 of 54	W/125.6	75.9 / -0.23	770 Broadview Avenue Ottawa ON K2A 3Z3	EHS
Order No: 20080118020 Status: C Report Type: Complete Report Report Date: 1/24/2008 Date Received: 1/18/2008 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Broadview Ave and Carling Ave Municipality: Client Prov/State: BC Search Radius (km): 0.25 X: -75.755559 Y: 45.377657					
60	3 of 54	W/125.6	75.9 / -0.23	Britannia Medical Centre 770 Broadview Avenue Suite 203 Ottawa ON K2A 3Z3	GEN
Generator No: ON4511913 SIC Code: 621110 SIC Description: Offices of Physicians Approval Years: 2010 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 261 Waste Class Name: PHARMACEUTICALS Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	4 of 54	W/125.6	75.9 / -0.23	Britannia Medical Centre 770 Broadview Avenue Suite 203 Ottawa ON K2A 3Z3	GEN
Generator No: ON4511913 SIC Code: 621110 SIC Description: Offices of Physicians Approval Years: 2011 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
60	5 of 54	W/125.6	75.9 / -0.23	Fraser Scott-Thomas Family Medicine 201-770 Broadview Avenue Ottawa ON K2A 3Z3	GEN
Generator No:		ON7532107			
SIC Code:		621110			
SIC Description:					
Approval Years:		2011			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
60	6 of 54	W/125.6	75.9 / -0.23	Arbour Family Medicine 201-770 Broadview Avenue Ottawa ON K2A 3Z3	GEN
Generator No:		ON7532107			
SIC Code:		621110			
SIC Description:		Offices of Physicians			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
60	7 of 54	W/125.6	75.9 / -0.23	Arbour Family Medicine 201-770 Broadview Avenue Ottawa ON	GEN
Generator No:		ON7532107			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2013			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
60	8 of 54	W/125.6	75.9 / -0.23	770 Broadview Ave Ottawa ON K2A3Z3	EHS
Order No: 20150126057 Status: C Report Type: Standard Report Report Date: 02-FEB-15 Date Received: 26-JAN-15 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Ottawa Client Prov/State: ON Search Radius (km): .25 X: -75.755611 Y: 45.377486			
60	9 of 54	W/125.6	75.9 / -0.23	2520762 Ontario Inc. 210-770 Broadview Ave Ottawa ON K2A3Z3	GEN
Generator No: ON7847210 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	10 of 54	W/125.6	75.9 / -0.23	Rosenbloom,Morris, Goldman and Poitras 305-770 Broadview Ave Ottawa ON K2A 3Z3	GEN
Generator No: ON3300702 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Jacqueline G Lam Choice of Contact: CO_ADMIN Phone No Admin: 613-728-7700 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	11 of 54	W/125.6	75.9 / -0.23	David Greenberg Podiatry Professional Corporation 770 Broadview Avenue Suite 102	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ottawa ON K2A 3Z3					
Generator No:		ON8509053			
SIC Code:		621390			
SIC Description:		OFFICES OF ALL OTHER HEALTH PRACTITIONERS			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
60	12 of 54	W/125.6	75.9 / -0.23	Dr. Timothy Capello/ Dr. Jodie Murray 770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	GEN
Generator No:		ON7767075			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
60	13 of 54	W/125.6	75.9 / -0.23	David Greenberg Podiatry Professional Corporation 770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	GEN
Generator No:		ON8509053			
SIC Code:		621390			
SIC Description:		OFFICES OF ALL OTHER HEALTH PRACTITIONERS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
60	14 of 54	W/125.6	75.9 / -0.23	Rosenbloom, Morris and Goldman 305-770 Broadview Ave Ottawa ON K2A 3Z3	GEN
Generator No:		ON3300702			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
60	15 of 54	W/125.6	75.9 / -0.23	Dr. Mark Smith 770 Broadview Avenue Suite 308 Ottawa ON K2A3Z3	GEN
Generator No:		ON4956874			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Mark Smith			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		6137259374 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
60	16 of 54	W/125.6	75.9 / -0.23	Drs. Levitan and Bartlett 205-770 Broadview Ave. Ottawa ON K2A3Z3	GEN
Generator No:		ON9656439			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	17 of 54	W/125.6	75.9 / -0.23	Dr. Mark Smith 770 Broadview Avenue Suite 308 Ottawa ON K2A3Z3	GEN
Generator No: ON4956874 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Mark Smith Choice of Contact: CO_OFFICIAL Phone No Admin: 6137259374 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 261 Waste Class Name: PHARMACEUTICALS					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	18 of 54	W/125.6	75.9 / -0.23	Drs. Levitan and Bartlett 205-770 Broadview Ave. Ottawa ON K2A3Z3	GEN
Generator No: ON9656439 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	19 of 54	W/125.6	75.9 / -0.23	Arbour Family Medicine 201-770 Broadview Avenue Ottawa ON K2A 3Z3	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON7532107 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Tina LaBrecque Choice of Contact: CO_ADMIN Phone No Admin: 613-680-1065 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
Waste Class: 261 Waste Class Name: PHARMACEUTICALS					
60	20 of 54	W/125.6	75.9 / -0.23	Arbour Family Medicine 201-770 Broadview Avenue Ottawa ON K2A 3Z3	GEN
Generator No: ON7532107 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2015 PO Box No: Country: Canada Status: Co Admin: Tina LaBrecque Choice of Contact: CO_ADMIN Phone No Admin: 613-680-1065 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 261 Waste Class Name: PHARMACEUTICALS					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	21 of 54	W/125.6	75.9 / -0.23	Dr. Timothy Capello/ Dr. Jodie Murray 770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	GEN
Generator No: ON7767075 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2015 PO Box No: Country: Canada Status: Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
60	22 of 54	W/125.6	75.9 / -0.23	Drs. Levitan and Bartlett 205-770 Broadview Ave. Ottawa ON K2A3Z3	GEN
Generator No:		ON9656439			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
60	23 of 54	W/125.6	75.9 / -0.23	Dr. Timothy Capello/ Dr. Jodie Murray 770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	GEN
Generator No:		ON7767075			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
60	24 of 54	W/125.6	75.9 / -0.23	Rosenbloom,Morris and Goldman 305-770 Broadview Ave Ottawa ON K2A 3Z3	GEN
Generator No:		ON3300702			
SIC Code:		621110			
SIC Description:		OFFICES OF PHYSICIANS			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	25 of 54	W/125.6	75.9 / -0.23	David Greenberg Podiatry Professional Corporation 770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	GEN
Generator No: ON8509053 SIC Code: 621390 SIC Description: OFFICES OF ALL OTHER HEALTH PRACTITIONERS Approval Years: 2014 PO Box No: Country: Canada Status: Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	26 of 54	W/125.6	75.9 / -0.23	Arbour Family Medicine 201-770 Broadview Avenue Ottawa ON K2A 3Z3	GEN
Generator No: ON7532107 SIC Code: 621110 SIC Description: OFFICES OF PHYSICIANS Approval Years: 2014 PO Box No: Country: Canada Status: Co Admin: Elizabeth Burch Choice of Contact: CO_ADMIN Phone No Admin: 613-680-1065 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
60	27 of 54	W/125.6	75.9 / -0.23	Poitras, Giles, Lewin, & Kennedy 305-770 Broadview Ave Ottawa ON K2A 3Z3	GEN
Generator No: ON3300702					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	28 of 54	W/125.6	75.9 / -0.23	2520762 Ontario Inc. 210-770 Broadview Ave Ottawa ON K2A3Z3	GEN
Generator No: ON7847210 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	29 of 54	W/125.6	75.9 / -0.23	Arbour Family Medicine 201-770 Broadview Avenue Ottawa ON K2A 3Z3	GEN
Generator No: ON7532107 SIC Code: SIC Description: Approval Years: As of Dec 2018 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
Waste Class:		312 P			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Pathological wastes			
60	30 of 54	W/125.6	75.9 / -0.23	Drs. Levitan and Bartlett 205-770 Broadview Ave. Ottawa ON K2A3Z3	GEN
Generator No:		ON9656439			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	31 of 54	W/125.6	75.9 / -0.23	Dr. Timothy Capello/ Dr. Jodie Murray 770 Broadview Ave Suite B4 Ottawa ON K2A3Z3	GEN
Generator No:		ON7767075			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	32 of 54	W/125.6	75.9 / -0.23	David Greenberg Podiatry Professional Corporation 770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	GEN
Generator No:		ON8509053			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	33 of 54	W/125.6	75.9 / -0.23	770 Broadview Ave Ottawa ON K2A3Z3	EHS
Order No:	20180206134			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	MD
Report Date:	12-FEB-18			Search Radius (km):	.25
Date Received:	06-FEB-18			X:	-75.755605
Previous Site Name:				Y:	45.37745
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; Topographic Maps; City Directory; Aerial Photos				
60	34 of 54	W/125.6	75.9 / -0.23	2520762 Ontario Inc. 210-770 Broadview Ave Ottawa ON K2A3Z3	GEN
Generator No:	ON7847210				
SIC Code:					
SIC Description:					
Approval Years:	As of Jul 2020				
PO Box No:					
Country:	Canada				
Status:	Registered				
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	35 of 54	W/125.6	75.9 / -0.23	Poitras, Giles, Lewin, & Kennedy 305-770 Broadview Ave Ottawa ON K2A 3Z3	GEN
Generator No:	ON3300702				
SIC Code:					
SIC Description:					
Approval Years:	As of Jul 2020				
PO Box No:					
Country:	Canada				
Status:	Registered				
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		312 P Pathological wastes			
60	36 of 54	W/125.6	75.9 / -0.23	Arbour Family Medicine 201-770 Broadview Avenue Ottawa ON K2A 3Z3	GEN
Generator No:		ON7532107			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	37 of 54	W/125.6	75.9 / -0.23	David Greenberg Podiatry Professional Corporation 770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	GEN
Generator No:		ON8509053			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	38 of 54	W/125.6	75.9 / -0.23	Dr. Timothy Capello/ Dr. Jodie Murray 770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	GEN
Generator No:		ON7767075			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	39 of 54	W/125.6	75.9 / -0.23	Dr. Riva Levitan 205-770 Broadview Ave. Ottawa ON K2A3Z3	GEN
Generator No:		ON9656439			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	40 of 54	W/125.6	75.9 / -0.23	Dr. Timothy Capello/Dr. Iryna Yeuchy 770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	GEN
Generator No:		ON7767075			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	41 of 54	W/125.6	75.9 / -0.23	Arbour Family Medicine 201-770 Broadview Avenue Ottawa ON K2A 3Z3	GEN
Generator No:		ON7532107			
SIC Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	42 of 54	W/125.6	75.9 / -0.23	2520762 Ontario Inc. 210-770 Broadview Ave Ottawa ON K2A3Z3	GEN
Generator No: ON7847210 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	43 of 54	W/125.6	75.9 / -0.23	Dr. Riva Levitan 205-770 Broadview Ave. Ottawa ON K2A3Z3	GEN
Generator No: ON9656439 SIC Code: SIC Description: Approval Years: As of Nov 2021 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
60	44 of 54	W/125.6	75.9 / -0.23	David Greenberg Podiatry Professional Corporation 770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON8509053	As of Nov 2021	Canada Registered	
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		312 P Pathological wastes			
60	45 of 54	W/125.6	75.9 / -0.23	Poitras, Giles, Lewin, & Kennedy 305-770 Broadview Ave Ottawa ON K2A 3Z3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON3300702	As of Nov 2021	Canada Registered	
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		312 P Pathological wastes			
60	46 of 54	W/125.6	75.9 / -0.23	Lovell Drugs Limited 770 Broadview Avenue Ottawa ON K2A 3Z3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON8203663	As of Nov 2021	Canada Registered	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
60	47 of 54	W/125.6	75.9 / -0.23	Lovell Drugs Limited 770 Broadview Avenue Ottawa ON K2A 3Z3	GEN
Generator No:		ON8203663			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
60	48 of 54	W/125.6	75.9 / -0.23	Arbour Family Medicine 201-770 Broadview Avenue Ottawa ON K2A 3Z3	GEN
Generator No:		ON7532107			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
60	49 of 54	W/125.6	75.9 / -0.23	Dr. Riva Levitan 205-770 Broadview Ave. Ottawa ON K2A3Z3	GEN
Generator No:		ON9656439			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Code: SIC Description: Approval Years: As of Oct 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
60	50 of 54	W/125.6	75.9 / -0.23	Poitras, Giles, Lewin, & Kennedy 305-770 Broadview Ave Ottawa ON K2A 3Z3	GEN
Generator No: ON3300702 SIC Code: SIC Description: Approval Years: As of Oct 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
60	51 of 54	W/125.6	75.9 / -0.23	David Greenberg Podiatry Professional Corporation 770 Broadview Avenue Suite 102 Ottawa ON K2A 3Z3	GEN
Generator No: ON8509053 SIC Code: SIC Description: Approval Years: As of Oct 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
60	52 of 54	W/125.6	75.9 / -0.23	2520762 Ontario Inc. 210-770 Broadview Ave Ottawa ON K2A3Z3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON7847210 As of Oct 2022 Canada Registered			
<u>Detail(s)</u>		312 P PATHOLOGICAL WASTES			
60	53 of 54	W/125.6	75.9 / -0.23	Dr. Timothy Capello/Dr. Iryna Yeuchy 770 Broadview Ave Suite B4 Ottaw ON K2A3Z3	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON7767075 As of Oct 2022 Canada Registered			
<u>Detail(s)</u>		312 P PATHOLOGICAL WASTES			
60	54 of 54	W/125.6	75.9 / -0.23	770 Broadview Ave Ottawa ON K2A 3Z3	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		22021100362 C Standard Report 16-FEB-22 11-FEB-22	Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:		
			ON .25 -75.7552096 45.3776967		
61	1 of 1	SW/128.4	77.9 / 1.76	ON	WWIS
Well ID:		1508094	Flowing (Y/N):		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:			Flow Rate:		
Use 1st:	Municipal			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	04/21/1955
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	3601
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508094.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		01/20/1955			
Year Completed:		1955			
Depth (m):		30.48			
Latitude:		45.3756813427618			
Longitude:		-75.754411432298			
X:		-75.75441127021858			
Y:		45.375681336176456			
Path:		150\1508094.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	10030129			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440930.70
Code OB Desc:				North83:	5024962.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	5
Date Completed:	01/20/1955			UTMRC Desc:	margin of error : 100 m - 300 m
Remarks:				Location Method:	p5
Location Method Desc:		Original Pre1985 UTM Rel Code 5: margin of error : 100 m - 300 m			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008793			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008795			
Layer:		3			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		12.0			
Formation End Depth:		100.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008794			
Layer:		2			
Color:					
General Color:					
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		10.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508094			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578699			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052917			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To: 100.0 Casing Diameter: 4.0 Casing Diameter UOM: inch Casing Depth UOM: ft					
<u>Construction Record - Casing</u>					
Casing ID: 930052916 Layer: 1 Material: Open Hole or Material: Depth From: Depth To: 12.0 Casing Diameter: 4.0 Casing Diameter UOM: inch Casing Depth UOM: ft					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc: PUMP Pump Test ID: 991508094 Pump Set At: Static Level: 10.0 Final Level After Pumping: 10.0 Recommended Pump Depth: Pumping Rate: 4.0 Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: 1 Water State After Test: CLEAR Pumping Test Method: 1 Pumping Duration HR: 1 Pumping Duration MIN: 0 Flowing: No					
<u>Water Details</u>					
Water ID: 933462461 Layer: 1 Kind Code: 1 Kind: FRESH Water Found Depth: 95.0 Water Found Depth UOM: ft					
62	1 of 1	ESE/128.7	77.9 / 1.75	857 Boyd Avenue Ottawa ON K2A 2C9	EHS
Order No: 20190603115 Status: C Report Type: Standard Report Report Date: 07-JUN-19 Date Received: 03-JUN-19 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.750454 Y: 45.376309					
63	1 of 2	E/130.2	76.8 / 0.63	851 Campbell Ave. Ottawa ON K2A 2C6	SPL

63	2 of 2	E/130.2	76.8 / 0.63	851 CAMPBELL AVENUE OTTAWA ON K2A 2C6	HINC
External File Num:		FS INC 0906-03460			
Fuel Occurrence Type:		Leak			
Date of Occurrence:		6/22/2009			
Fuel Type Involved:		Fuel Oil			
Status Desc:		Completed - Causal Analysis(End)			
Job Type Desc:		Incident/Near-Miss Occurrence (FS)			
Oper. Type Involved:		Commercial (e.g. restaurant, business unit, etc)			
Service Interruptions:		No			
Property Damage:		No			
Fuel Life Cycle Stage:		Utilization			
Root Cause:		Root Cause: Equipment/Material/Component:Yes Procedures:Yes Maintenance:No Design:No Training:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Reported Details: Fuel Category: Occurrence Type: Affiliation: County Name: Approx. Quant. Rel: Nearby body of water: Enter Drainage Syst.: Approx. Quant. Unit: Environmental Impact:		No Management:No Human Factors:No Import Motors Liquid Fuel Incident Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.) Ottawa 250 No No Liters			

64	1 of 1	W/130.3	76.9 / 0.74	ON	BORE
Borehole ID:	612816	Inclin FLG:	No		
OGF ID:	215514122	SP Status:	Initial Entry		
Status:		Surv Elev:	No		
Type:	Borehole	Piezometer:	No		
Use:		Primary Name:			
Completion Date:	NOV-1972	Municipality:			
Static Water Level:		Lot:			
Primary Water Use:		Township:			
Sec. Water Use:		Latitude DD:	45.377204		
Total Depth m:	10.2	Longitude DD:	-75.755709		
Depth Ref:	Ground Surface	UTM Zone:	18		
Depth Elev:		Easting:	440831		
Drill Method:		Northing:	5025132		
Orig Ground Elev m:	75.3	Location Accuracy:			
Elev Reliabil Note:		Accuracy:	Not Applicable		
DEM Ground Elev m:	75.8				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218392603	Mat Consistency:	Soft		
Top Depth:	2.6	Material Moisture:			
Bottom Depth:	3	Material Texture:			
Material Color:	Brown	Non Geo Mat Type:			
Material 1:	Clay	Geologic Formation:			
Material 2:	Sand	Geologic Group:			
Material 3:		Geologic Period:			
Material 4:		Depositional Gen:			
Gsc Material Description:					
Stratum Description:	CLAY. BROWN,GREY,VERY SOFT.				
Geology Stratum ID:	218392604	Mat Consistency:	Soft		
Top Depth:	3	Material Moisture:			
Bottom Depth:	3.8	Material Texture:			
Material Color:	Brown	Non Geo Mat Type:			
Material 1:	Clay	Geologic Formation:			
Material 2:	Silt	Geologic Group:			
Material 3:		Geologic Period:			
Material 4:		Depositional Gen:			
Gsc Material Description:					
Stratum Description:	CLAY. BROWN,GREY,VERY SOFT,FISSURED.				
Geology Stratum ID:	218392605	Mat Consistency:	Dense		
Top Depth:	3.8	Material Moisture:			
Bottom Depth:	4.4	Material Texture:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color:				Non Geo Mat Type:	
Material 1:	Unknown			Geologic Formation:	
Material 2:	Till			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		UNSPECIFIED. DENSE.			
Geology Stratum ID:	218392606			Mat Consistency:	Dense
Top Depth:	4.4			Material Moisture:	
Bottom Depth:	6.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Unknown			Geologic Formation:	
Material 2:	Till			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		UNSPECIFIED. DENSE TO VERY DENSE.			
Geology Stratum ID:	218392608			Mat Consistency:	Dense
Top Depth:	6.6			Material Moisture:	
Bottom Depth:	8.7			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Unknown			Geologic Formation:	
Material 2:	Till			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		UNSPECIFIED. DENSE.			
Geology Stratum ID:	218392607			Mat Consistency:	Dense
Top Depth:	6.1			Material Moisture:	
Bottom Depth:	6.6			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Boulders			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		TILL. DENSE.			
Geology Stratum ID:	218392609			Mat Consistency:	
Top Depth:	8.7			Material Moisture:	
Bottom Depth:	10.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Dolomite			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		BEDROCK. 00000 020 00075 015 00085 026 00100 045 00125 010 00145 011 00200 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	218392601			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	2.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:				Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Sand			Geologic Period:	
Material 4:	Bedrock			Depositional Gen:	
Gsc Material Description:					
Stratum Description:		ARTIFICIAL.			
Geology Stratum ID:	218392602			Mat Consistency:	Dense
Top Depth:	2.3			Material Moisture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bottom Depth: Material Color: Material 1: Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description:	2.6 Sand Gravel Clay SAND. DENSE.			Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
<u>Source</u>					
Source Type: Source Orig: Source Date: Confidence: Observatio: Source Name: Source Details: Confiden 1:	Data Survey Geological Survey of Canada 1956-1972 H Urban Geology Automated Information System (UGAIS) File: OTTAWA2.txt RecordID: 053240 NTS_Sheet: 31G05F Logged by professional. Exact and complete description of material and properties.			Source Appl: Source Iden: Scale or Res: Horizontal: Verticalda:	Spatial/Tabular 1 Varies NAD27 Mean Average Sea Level
<u>Source List</u>					
Source Identifier: Source Type: Source Date: Scale or Resolution: Source Name: Source Originators:	1 Data Survey 1956-1972 Varies Urban Geology Automated Information System (UGAIS) Geological Survey of Canada			Horizontal Datum: Vertical Datum: Projection Name:	NAD27 Mean Average Sea Level Universal Transverse Mercator
65	1 of 1	ESE/133.3	77.9 / 1.75	857 Boyd Ave Ottawa ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:	7343574 Monitoring and Test Hole Monitoring and Test Hole Z317414 A274726 NEPEAN TOWNSHIP			Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	09/06/2019 TRUE 7241 7 OTTAWA-CARLETON
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: Depth M: Year Completed: Well Completed Dt: Audit No: Path:	1007664083 4.2672 2019 08/13/2019 Z317414			Tag No: Contractor: Latitude: Longitude: Y: X:	A274726 7241 45.376256482444 -75.750455999657 45.376256475455236 -75.75045583836737

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1007664083			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441241.00
Code OB Desc:				North83:	5025023.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/13/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007872558				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	08				
Material 1 Desc:	FINE SAND				
Material 2:					
Material 2 Desc:					
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	1.0				
Formation End Depth:	3.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007872557				
Layer:	1				
Color:	2				
General Color:	GREY				
Material 1:	27				
Material 1 Desc:	OTHER				
Material 2:					
Material 2 Desc:					
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007872559				
Layer:	3				
Color:	6				
General Color:	BROWN				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		3.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007872560			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		6.0			
Formation End Depth:		14.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007873727			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007873728			
Layer:		2			
Plug From:		1.0			
Plug To:		3.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007873730			
Layer:		4			
Plug From:		8.0			
Plug To:		14.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007873729			
Layer:		3			
Plug From:		3.0			
Plug To:		8.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Use</u>					
Method Construction ID:		1007875235			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007871552			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007875857			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		9.0			
Casing Diameter:		1.3300000429153442			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007876321			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.0			
Screen End Depth:		14.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007876940			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007874695			
Diameter:		2.875			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		6.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007874696			
Diameter:		2.375			
Depth From:		6.0			
Depth To:		14.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>66</u>	1 of 1	NNW/135.6	75.8 / -0.29	465 WELLESLEY AVENUE OTTAWA ON K2A 1B5	HINC
External File Num:		FS INC 0806-02619			
Fuel Occurrence Type:		Pipeline Strike			
Date of Occurrence:		5/27/2008			
Fuel Type Involved:		Natural Gas			
Status Desc:		Completed - Causal Analysis(End)			
Job Type Desc:		Incident/Near-Miss Occurrence (FS)			
Oper. Type Involved:		Construction Site (pipeline strike)			
Service Interruptions:		Yes			
Property Damage:		Yes			
Fuel Life Cycle Stage:		Transmission, Distribution and Transportation			
Root Cause:		Root Cause: Equipment/Material/Component:No Procedures:No Maintenance:No Design:No Training:No Management:Yes Human Factors:Yes			
Reported Details:					
Fuel Category:		Gaseous Fuel			
Occurrence Type:		Incident			
Affiliation:		Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.)			
County Name:		Ottawa			
Approx. Quant. Rel:					
Nearby body of water:					
Enter Drainage Syst.:					
Approx. Quant. Unit:					
Environmental Impact:					
<u>67</u>	1 of 1	ESE/136.0	77.9 / 1.75	857 Boyd Ave Ottawa ON	WWIS
Well ID:	7343575			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	09/06/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z317318			Contractor:	7241
Tag:	A268945			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1007664086			Tag No:	A268945
Depth M:	7.62			Contractor:	7241
Year Completed:	2019			Latitude:	45.3761473008651
Well Completed Dt:	08/13/2019			Longitude:	-75.7506333598724
Audit No:	Z317318			Y:	45.376147294449915
Path:				X:	-75.7506331980943
<u>Bore Hole Information</u>					
Bore Hole ID:	1007664086			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441227.00
Code OB Desc:				North83:	5025011.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/13/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007872563				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:	74				
Material 3 Desc:	LAYERED				
Formation Top Depth:	1.2200000286102295				
Formation End Depth:	7.619999885559082				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007872561				
Layer:	1				
Color:	8				
General Color:	BLACK				
Material 1:	27				
Material 1 Desc:	OTHER				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	0.0				
Formation End Depth:	0.3100000023841858				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007872562			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007873733			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		7.619999885559082			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007873732			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007873731			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007875236			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007871553			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1007875858			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.570000171661377			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007876322			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.570000171661377			
Screen End Depth:		7.619999885559082			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007876941			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007874698			
Diameter:		7.619999885559082			
Depth From:		1.5199999809265137			
Depth To:		7.619999885559082			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007874697			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
68	1 of 1	ENE/137.0	76.8 / 0.69	1696 Carling Avenue Ottawa ON K2A 1C6	EHS
Order No: 20100629011				Nearest Intersection:	
Status: C				Municipality:	
Report Type: Custom Report				Client Prov/State:	ON
Report Date: 7/8/2010				Search Radius (km):	0.25
Date Received: 6/29/2010				X:	-75.75044
Previous Site Name:				Y:	45.378645
Lot/Building Size:					
Additional Info Ordered:					
69	1 of 1	E/138.5	76.7 / 0.61	LACOMBE WASTE OIL J&L AUTOMOTIVE 849 CAMPBELL RD GLOUCESTER SITE 5573 POWER ROAD, RR # 6 OTTAWA CITY ON K2A 2C6	SPL
Ref No: 210703				Municipality No:	20107
Year:				Nature of Damage:	
Incident Dt: 9/4/2001				Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt: 9/4/2001				Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:		VALVE/FITTING LEAK OR FAILURE			
Incident Preceding Spill:					
Environment Impact:		Possible			
Health Env Consequence:					
Nature of Impact:		Soil contamination			
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Client Type:					
Source Type:					
Contaminant Code:					
Contaminant Name:					
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		Land			
Incident Reason:		ERROR			
Incident Summary:		LACOMB: 9L OF WASTE OIL TO PAVEMENT APRON, CONTAINED AND CLEANING			
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:					
SAC Action Class:					
Call Report Locatn Geodata:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Time Reported: System Facility Address: Client Name:					
70	1 of 1	W/139.4	76.8 / 0.69	770 BROADVIEW Ottawa ON	WWIS
Well ID:		7238477	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring and Test Hole	Data Entry Status:		
Use 2nd:		0	Data Src:		
Final Well Status:		Monitoring and Test Hole	Date Received:		
Water Type:			03/23/2015		
Casing Material:			Selected Flag:		
Audit No:		Z198112	TRUE		
Tag:		A165710	Abandonment Rec:		
Constructn Method:			Contractor:		
Elevation (m):			7241		
Elevatn Reliabilty:			Form Version:		
Depth to Bedrock:			7		
Well Depth:			Owner:		
Overburden/Bedrock:			County:		
Pump Rate:			OTTAWA-CARLETON		
Static Water Level:			Lot:		
Clear/Cloudy:			Concession:		
Municipality:		NEPEAN TOWNSHIP	Concession Name:		
Site Info:			Easting NAD83:		
			Northing NAD83:		
			Zone:		
			UTM Reliability:		
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7238477.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		02/20/2015			
Year Completed:		2015			
Depth (m):		8.71			
Latitude:		45.3769137336968			
Longitude:		-75.7558927594669			
X:		-75.7558925969165			
Y:		45.376913727385876			
Path:		723\7238477.pdf			
Bore Hole Information					
Bore Hole ID:		1005314041	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		
Code OB:			18		
Code OB Desc:			East83:		
Open Hole:			440816.00		
Cluster Kind:			North83:		
Date Completed:		02/20/2015	5025100.00		
Remarks:			Org CS:		
Location Method Desc:		on Water Well Record	UTM83		
Elevrc Desc:			UTMRC:		
Location Source Date:			4		
Improvement Location Source:			UTMRC Desc:		
Improvement Location Method:			margin of error : 30 m - 100 m		
Source Revision Comment:			Location Method:		
Supplier Comment:			wwr		
Overburden and Bedrock					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:			1005563589		
Layer:			3		
Color:			6		
General Color:			BROWN		
Material 1:			05		
Material 1 Desc:			CLAY		
Material 2:			84		
Material 2 Desc:			SILTY		
Material 3:			85		
Material 3 Desc:			SOFT		
Formation Top Depth:			3.0999999046325684		
Formation End Depth:			4.880000114440918		
Formation End Depth UOM:			m		
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			1005563587		
Layer:			1		
Color:			6		
General Color:			BROWN		
Material 1:			01		
Material 1 Desc:			FILL		
Material 2:					
Material 2 Desc:					
Material 3:			85		
Material 3 Desc:			SOFT		
Formation Top Depth:			0.0		
Formation End Depth:			1.8300000429153442		
Formation End Depth UOM:			m		
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			1005563590		
Layer:			4		
Color:			2		
General Color:			GREY		
Material 1:			05		
Material 1 Desc:			CLAY		
Material 2:			84		
Material 2 Desc:			SILTY		
Material 3:			85		
Material 3 Desc:			SOFT		
Formation Top Depth:			4.880000114440918		
Formation End Depth:			8.710000038146973		
Formation End Depth UOM:			m		
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:			1005563591		
Layer:			5		
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		8.710000038146973			
Formation End Depth:					
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005563588			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.8300000429153442			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005563600			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.3499999046325684			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005563601			
Layer:		3			
Plug From:		3.3499999046325684			
Plug To:		8.710000038146973			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005563599			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005563598			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005563586			
Casing No:		0			
Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005563594			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.6600000858306885			
Casing Diameter:		5.19999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005563595			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.6600000858306885			
Screen End Depth:		8.710000038146973			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005563593			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005563592			
Diameter:		15.34000015258789			
Depth From:		0.0			
Depth To:		8.710000038146973			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
71	1 of 8	ESE/143.6	77.5 / 1.33	NU-TEK SIGNS 866 CAMPBELL AVE OTTAWA ON K2A 2C5	SCT
Established:		1989			
Plant Size (ft²):		0			
Employment:		0			
--Details--					
Description:		Sign Manufacturing			
SIC/NAICS Code:		339950			
71	2 of 8	ESE/143.6	77.5 / 1.33	WYMAN & SON PUBLICATIONS LTD 866 CAMPBELL AVE OTTAWA ON K2A 2C5	SCT

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Established: 1973 Plant Size (ft²): 1400 Employment: 3					
--Details-- Description: COMMERCIAL PRINTING, LITHOGRAPHIC SIC/NAICS Code: 2752 Description: COMMERCIAL PRINTING, NOT ELSEWHERE CLASSIFIED SIC/NAICS Code: 2759					
71	3 of 8	ESE/143.6	77.5 / 1.33	Signs.ca/Nu-Tek Signs 866 Campbell Ave Ottawa ON K2A 2C5	SCT
Established: 1997 Plant Size (ft²): Employment: 25					
--Details-- Description: Sign Manufacturing SIC/NAICS Code: 339950					
71	4 of 8	ESE/143.6	77.5 / 1.33	NU-TEK SIGNS 866 CAMPBELL AVENUE OTTAWA ON K2A 2C5	GEN
Generator No: ON2137001 SIC Code: 3971 SIC Description: SIGN & DISPLAY IND. Approval Years: 00,01 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u> Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES					
71	5 of 8	ESE/143.6	77.5 / 1.33	12522890 Ontario Inc 866 Campbell Avenue Ottawa ON K2A 2C5	GEN
Generator No: ON2137001 SIC Code: SIC Description: Approval Years: 02,03,04,05 PO Box No: Country: Status: Co Admin: Choice of Contact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
71	6 of 8	ESE/143.6	77.5 / 1.33	Signs.ca 866 Campbell Ave Ottawa ON K2A 2C5	SCT
Established:		1997			
Plant Size (ft²):		10000			
Employment:					
--Details--					
Description:		Sign Manufacturing			
SIC/NAICS Code:		339950			
71	7 of 8	ESE/143.6	77.5 / 1.33	1230372 Ontario Inc 866 Campbell Ave Ottawa ON K2A 2C5	GEN
Generator No:		ON5867386			
SIC Code:		339950			
SIC Description:		Sign Manufacturing			
Approval Years:		07,08			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
71	8 of 8	ESE/143.6	77.5 / 1.33	1230372 Ontario Inc 866 Campbell Ave Ottawa ON K2A 2C5	GEN
Generator No:		ON5867386			
SIC Code:		339950			
SIC Description:		Sign Manufacturing			
Approval Years:		2009			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:	145				
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES				
72	1 of 1	W/147.4	76.2 / 0.05	770 BROADVIEW OTTAWA ON	WWIS
Well ID:	7238476			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	03/23/2015
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z198113			Contractor:	7241
Tag:	A165711			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7238476.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	02/20/2015				
Year Completed:	2015				
Depth (m):	6.1				
Latitude:	45.3777624044289				
Longitude:	-75.7555081320026				
X:	-75.75550797070655				
Y:	45.37776239718618				
Path:	723\7238476.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1005314038			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440847.00
Code OB Desc:				North83:	5025194.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	02/20/2015			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005563556			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		84			
Material 2 Desc:		SILTY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		3.6600000858306885			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005563555			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		84			
Material 2 Desc:		SILTY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.8300000429153442			
Formation End Depth:		3.6600000858306885			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005563554			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.8300000429153442			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005563565			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005563564			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005563566			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005563563			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005563553			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005563559			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005563560			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005563558			
Layer:					

255 erisinfo.com | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Time Reported: System Facility Address: Client Name: Sealtest Enterprises Ltd.<UNOFFICIAL>					
74	1 of 1	E/148.8	76.8 / 0.62	ON	WWIS
Well ID: 7379159 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C17610 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 01/27/2021 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008615655 Depth M: Year Completed: 2020 Well Completed Dt: 11/19/2020 Audit No: C17610 Path: Tag No: Contractor: 7241 Latitude: 45.3774233409725 Longitude: -75.7495901648517 Y: 45.377423334130214 X: -75.74959000365678					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008615655 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 11/19/2020 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 441310.00 North83: 5025152.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
75	1 of 2	NW/150.8	74.9 / -1.24	Enbridge Gas Distribution Inc. 744 Highland Avenue Ottawa ON	SPL
Ref No: 2185-APEJYG Year: Municipality No: Nature of Damage:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Dt: 7/19/2017 Dt MOE Arvl on Scn: MOE Reported Dt: 7/19/2017 Dt Document Closed: 7/22/2017 Site No: NA MOE Response: No Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: Residential Property<UNOFFICIAL> Site Address: 744 Highland Avenue Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northings: Easting: Incident Cause: Incident Preceding Spill: Leak/Break Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description Client Type: Corporation Source Type: Valve/Fitting/Piping Contaminant Code: 35 Contaminant Name: NATURAL GAS (METHANE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1075 Receiving Medium: Air Incident Reason: Operator/Human Error Incident Summary: TSSA - 1/2" plastic IP line strike, made safe - Ottawa Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Industrial SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Enbridge Gas Distribution Inc. Discharger Report: Material Group: Impact to Health: 2 - Minor Environment Agency Involved:					

75	2 of 2	NW/150.8	74.9 / -1.24	STONE TECH 744 HIGHLAND AVE,,OTTAWA,ON,K2A 2K7,CA ON	PINC
Incident Id: Incident No: 2121400 Incident Reported Dt: 7/19/2017 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location:					

258 erisinfo.com | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
78	1 of 2	ENE/156.5	77.1 / 1.02	1688 and 1690 Carling Ave Ottawa ON	EHS
Order No: 20070523023				Nearest Intersection: Carling Ave and Clyde Ave	
Status: C				Municipality:	
Report Type: CAN - Complete Report				Client Prov/State:	
Report Date: 5/29/2007				Search Radius (km): 0.25	
Date Received: 5/23/2007				X: -75.750213	
Previous Site Name:				Y: 45.378696	
Lot/Building Size:					
Additional Info Ordered:					
78	2 of 2	ENE/156.5	77.1 / 1.02	1688 Carling Avenue Ottawa ON	EHS
Order No: 21030800190				Nearest Intersection:	
Status: C				Municipality:	
Report Type: Standard Report				Client Prov/State: ON	
Report Date: 11-MAR-21				Search Radius (km): .25	
Date Received: 08-MAR-21				X: -75.7501193	
Previous Site Name:				Y: 45.3785751	
Lot/Building Size:					
Additional Info Ordered:					
79	1 of 1	ESE/158.2	77.8 / 1.71	861 BOYD AVE. Ottawa ON	WWIS
Well ID: 7197303				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st: Monitoring and Test Hole				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status: Monitoring and Test Hole				Date Received: 02/14/2013	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: Z163355				Contractor: 7241	
Tag: A106764				Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/719\7197303.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 01/14/2013					
Year Completed: 2013					
Depth (m): 10.06					
Latitude: 45.3760594769749					
Longitude: -75.7503001329881					
X: -75.75029997085248					
Y: 45.37605947014967					
Path: 719\7197303.pdf					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1004254409			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441253.00
Code OB Desc:				North83:	5025001.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/14/2013			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004804505				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:	71				
Material 3 Desc:	FRACTURED				
Formation Top Depth:	1.5				
Formation End Depth:	10.0600004196167				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004804504				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	1.5				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1004804516				
Layer:	3				
Plug From:	7.320000171661377				
Plug To:					
Plug Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004804515			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		7.320000171661377			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004804514			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004804513			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004804503			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004804509			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		7.010000228881836			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004804510			
Layer:		1			
Slot:		10			
Screen Top Depth:		7.010000228881836			
Screen End Depth:		10.0600004196167			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1004804508			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
 <u>Hole Diameter</u>					
Hole ID:		1004804507			
Diameter:		8.0			
Depth From:		1.5			
Depth To:		10.0600004196167			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
 <u>Hole Diameter</u>					
Hole ID:		1004804506			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
80	1 of 1	ESE/159.1	77.8 / 1.65	361 BOYD AVE. Ottawa ON	WWIS
Well ID:	7197302			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	02/14/2013
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z153005			Contractor:	7241
Tag:	A141796			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/719\7197302.pdf				
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:	01/14/2013				
Year Completed:	2013				
Depth (m):	7.62				
Latitude:	45.376096066424				
Longitude:	-75.7502112147405				
X:	-75.75021105293708				
Y:	45.37609605930309				
Path:	719\7197302.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1004254406			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441260.00
Code OB Desc:				North83:	5025005.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/14/2013			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004804483				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	0.9100000262260437				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004804484				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:	71				
Material 3 Desc:	FRACTURED				
Formation Top Depth:	0.9100000262260437				
Formation End Depth:	7.619999885559082				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1004804493				
Layer:	1				
Plug From:	0.0				
Plug To:	0.3100000023841858				
Plug Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004804494			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004804495			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004804492			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004804482			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004804488			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.570000171661377			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004804489			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.570000171661377			
Screen End Depth:		7.619999885559082			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.570000171661377			
<u>Water Details</u>					
Water ID:		1004804487			
Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind Code: Kind: Water Found Depth: Water Found Depth UOM:					
		m			
Hole Diameter					
Hole ID: Diameter: Depth From: Depth To: Hole Depth UOM: Hole Diameter UOM:					
			1004804485 11.430000305175781 0.0 1.2200000286102295 m cm		
Hole Diameter					
Hole ID: Diameter: Depth From: Depth To: Hole Depth UOM: Hole Diameter UOM:					
			1004804486 8.0 1.2200000286102295 7.6199998855559082 m cm		
<u>81</u>	1 of 1	E/159.2	76.8 / 0.63	848 Clyde Avenue North Ottawa ON K2A 1J4	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:					
			20191101180 C Standard Report 08-NOV-19 01-NOV-19	Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON .25 -75.749474 45.3775
		City Directory			
<u>82</u>	1 of 15	E/159.2	76.8 / 0.63	SUPERIOR PROPANE INC 848 CLYDE AV OTTAWA ON K1Z5A2	PRT
Location ID: Type: Expiry Date: Capacity (L): Licence #:					
			10913 retail 1995-01-31 1000 0076354158		
<u>82</u>	2 of 15	E/159.2	76.8 / 0.63	POWERAIR OF CANADA LTD. 848 CLYDE AVE. OTTAWA ON K1Z 5A2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility:					
			ON1060600 5622 PLUMBING, ETC., WH. 88,89		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>82</u>	3 of 15	E/159.2	76.8 / 0.63	POWERAIR OF CANADA LTD. 848 CLYDE AVE. OTTAWA ON K1Z 5A2	GEN
Generator No:		ON1060600			
SIC Code:		5622			
SIC Description:		PLUMBING, ETC., WH.			
Approval Years:		90			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>82</u>	4 of 15	E/159.2	76.8 / 0.63	MANNION'S PUMP HOUSE LTD. 848 CLYDE AVENUE OTTAWA ON K1Z 5A2	GEN
Generator No:		ON1060600			
SIC Code:		5622			
SIC Description:		PLUMBING, ETC., WH.			
Approval Years:		92,93,97,98			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
82	5 of 15	E/159.2	76.8 / 0.63	POWERAIR OF CANADA LTD. 30-392 848 CLYDE AVE. OTTAWA ON K1Z 5A2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON1060600 5622 PLUMBING, ETC., WH. 94,95,96			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			
82	6 of 15	E/159.2	76.8 / 0.63	MANNION'S PUMP HOUSE LIMITED 848 CLYDE AVENUE OTTAWA ON K1Z 5A2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON1060600 5622 PLUMBING, ETC., WH. 99,00,01,02			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			
82	7 of 15	E/159.2	76.8 / 0.63	MANNION'S PUMP HOUSE LIMITED 848 CLYDE AVE. OTTAWA ON	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact:		ON1060600 03 			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
82	8 of 15	E/159.2	76.8 / 0.63	MANNION'S PUMP HOUSE LTD. 848 CLYDE AVE. OTTAWA ON K1Z 5A2	GEN
Generator No:		ON1060600			
SIC Code:		221310			
SIC Description:		Water Supply and Irrigation Systems			
Approval Years:		04,05,06			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
82	9 of 15	E/159.2	76.8 / 0.63	SUPERIOR PROPANE INC 848 CLYDE AVE OTTAWA ON	DTNK
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:		9624721		Expired Date:	
Status:		EXPIRED		Max Hazard Rank:	
Instance ID:		391591		Facility Location:	
Instance Type:		FS Facility		Facility Type:	
Instance Creation Dt:				Fuel Type 2:	
Instance Install Dt:				Fuel Type 3:	
Item Description:				Panam Related:	
Manufacturer:				Panam Venue Nm:	
Model:				External Identifier:	
Serial No:				Item:	
ULC Standard:				Piping Steel:	
Quantity:				Piping Galvanized:	
Unit of Measure:				Tank Single Wall St:	
Overfill Prot Type:				Piping Underground:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: Original Source: Record Date:				Tank Underground: Source:	
82	10 of 15	E/159.2	76.8 / 0.63	MANNION'S PUMP HOUSE LTD. 848 CLYDE AVE. OTTAWA ON K1Z 5A2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON1060600 221310 Water Supply and Irrigation Systems 2010			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			
Waste Class: Waste Class Name:		251 OIL SKIMMINGS & SLUDGES			
82	11 of 15	E/159.2	76.8 / 0.63	848 Clyde Avenue Ottawa ON	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20130808023 C Standard Report 19-AUG-13 08-AUG-13 Fire Insur. Maps and/or Site Plans		Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	ON .25 -75.749311 45.377519
82	12 of 15	E/159.2	76.8 / 0.63	THE PUMP HOUSE INC. 848 CLYDE AVE. OTTAWA ON K1Z 5A2	GEN
Generator No: SIC Code:		ON1060600 221310			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		WATER SUPPLY AND IRRIGATION SYSTEMS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
82	13 of 15	E/159.2	76.8 / 0.63	THE PUMP HOUSE INC. 848 CLYDE AVE. OTTAWA ON K1Z 5A2	GEN
Generator No:		ON1060600			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
82	14 of 15	E/159.2	76.8 / 0.63	THE PUMP HOUSE INC. 848 CLYDE AVE. OTTAWA ON K1Z 5A2	GEN
Generator No:		ON1060600			
SIC Code:		221310			
SIC Description:		WATER SUPPLY AND IRRIGATION SYSTEMS			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO OFFICIAL			

271 erisinfo.com | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:		OTTAWA CITY			UTM Reliability:
Municipality:					
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508095.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		02/01/1955			
Year Completed:		1955			
Depth (m):		36.576			
Latitude:		45.3753671669081			
Longitude:		-75.7542795389238			
X:		-75.75427937694401			
Y:		45.37536716005532			
Path:		150\1508095.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10030130		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		02/01/1955		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		Original Pre1985 UTM Rel Code 5: margin of error : 100 m - 300 m			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008797			
Layer:		2			
Color:					
General Color:					
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		10.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008796			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008798			
Layer:		3			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		12.0			
Formation End Depth:		120.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508095			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578700			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052918			
Layer:		1			
Material:					
Open Hole or Material:					
Depth From:					
Depth To:		12.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052919			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		120.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508095			
Pump Set At:					
Static Level:		10.0			
Final Level After Pumping:		10.0			
Recommended Pump Depth:					
Pumping Rate:		4.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462462			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		95.0			
Water Found Depth UOM:		ft			
<u>84</u>	1 of 1	SE/162.4	77.9 / 1.76	OTTAWA HYDRO DOBBIE AVE AND BOYD ST MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON	SPL
Ref No:	46003			Municipality No:	20101
Year:				Nature of Damage:	
Incident Dt:	1/24/1991			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	1/24/1991			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:		PIPE/HOSE LEAK			
Incident Preceding Spill:					
Environment Impact:		NOT ANTICIPATED			
Health Env Consequence:					
Nature of Impact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Client Type: Source Type: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Incident Summary: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:					
85	1 of 5	WSW/163.4	77.9 / 1.75	COLOR YOUR WORLD 1840 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class: Waste Class Name:					
85	2 of 5	WSW/163.4	77.9 / 1.75	ROBERT M. LEMIEUX PAINTS LTD. 1840 CARLING AVENUE OTTAWA ON K2A 1E2	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
85	3 of 5	WSW/163.4	77.9 / 1.75	1840 Carling Avenue Ottawa ON K2A 1E2	EHS
Order No:	20050718038			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	7/27/2005			Search Radius (km):	0.25
Date Received:	7/18/2005			X:	-75.756113
Previous Site Name:				Y:	45.376346
Lot/Building Size:					
Additional Info Ordered:					
85	4 of 5	WSW/163.4	77.9 / 1.75	1840 Carling Ave Ottawa ON K2A1E2	EHS
Order No:	20140203001			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	07-FEB-14			Search Radius (km):	.25
Date Received:	03-FEB-14			X:	-75.756043
Previous Site Name:				Y:	45.376181
Lot/Building Size:					
Additional Info Ordered:					
85	5 of 5	WSW/163.4	77.9 / 1.75	1840 Carling Ave Ottawa ON K2A 1E2	EHS
Order No:	20321100044			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	16-DEC-20			Search Radius (km):	.25
Date Received:	11-DEC-20			X:	-75.7560038
Previous Site Name:				Y:	45.3762501
Lot/Building Size:					
Additional Info Ordered:					
86	1 of 1	ESE/169.2	76.6 / 0.43	Benson Auto Parts 863 Campbell Avenue Ottawa ON K2A 2C6	GEN
Generator No:	ON5912570				
SIC Code:					
SIC Description:					
Approval Years:	As of Oct 2022				
PO Box No:					
Country:	Canada				
Status:	Registered				
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
87	1 of 1	ENE/170.2	77.5 / 1.34	ON	WWIS
Well ID: 7405897		Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:		Data Entry Status:		Yes	
Use 2nd:		Data Src:			
Final Well Status:		Date Received:		12/20/2021	
Water Type:		Selected Flag:		TRUE	
Casing Material:		Abandonment Rec:			
Audit No: C54390		Contractor:		7328	
Tag: A290210		Form Version:		8	
Constructn Method:		Owner:			
Elevation (m):		County:		OTTAWA-CARLETON	
Elevatn Reliabilty:		Lot:			
Depth to Bedrock:		Concession:			
Well Depth:		Concession Name:			
Overburden/Bedrock:		Easting NAD83:			
Pump Rate:		Northing NAD83:			
Static Water Level:		Zone:			
Clear/Cloudy:		UTM Reliability:			
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008884788		Tag No: A290210			
Depth M:		Contractor:		7328	
Year Completed: 2021		Latitude:		45.3787884072219	
Well Completed Dt: 03/17/2021		Longitude:		-75.750068006597	
Audit No: C54390		Y:		45.37878840011588	
Path:		X:		-75.75006784512992	
<u>Bore Hole Information</u>					
Bore Hole ID: 1008884788		Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone:		18	
Code OB:		East83:		441274.00	
Code OB Desc:		North83:		5025304.00	
Open Hole:		Org CS:		UTM83	
Cluster Kind:		UTMRC:		4	
Date Completed: 03/17/2021		UTMRC Desc:		margin of error : 30 m - 100 m	
Remarks:		Location Method:		wwr	
Location Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
88	1 of 1	E/171.7	76.7 / 0.62	ON	WWIS
Well ID: 7311632		Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:		Data Entry Status:		Yes	
Use 2nd:		Data Src:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:				Date Received:	05/25/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C30132			Contractor:	7328
Tag:	A183838			Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					

Additional Detail(s) (Map)

Bore Hole ID:	1007060076	Tag No:	A183838
Depth M:		Contractor:	7328
Year Completed:	2017	Latitude:	45.3767857259308
Well Completed Dt:	11/28/2017	Longitude:	-75.7493646179608
Audit No:	C30132	Y:	45.37678571918266
Path:		X:	-75.74936445658075

Bore Hole Information

Bore Hole ID:	1007060076	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	441327.00
Code OB Desc:		North83:	5025081.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	11/28/2017	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

89	1 of 1	NE/172.6	77.8 / 1.67	City of Ottawa Carling Ave and Cole Ave Ottawa ON	SPL
Ref No:	6065-BNVN2D	Municipality No:			
Year:		Nature of Damage:			
Incident Dt:	2020/04/21	Discharger Report:			
Dt MOE Arvl on Scn:		Material Group:			
MOE Reported Dt:	2020/04/21	Impact to Health:	0 - No Impact		
Dt Document Closed:		Agency Involved:			
Site No:	NA				
MOE Response:	No				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa				
Nearest Watercourse:					
Site Name:	accident site<UNOFFICIAL>				
Site Address:	Carling Ave and Cole Ave				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: Incident Preceding Spill: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Client Type: Source Type: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Incident Summary: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:		Eastern Ottawa 5025343 441262 Collision/Accident 0 other - see incident description 0 other - see incident description Municipal Government Motor Vehicle 13 DIESEL FUEL 1202 Land Operator/Human Error C of O: MVA, diesel spill to cb Miscellaneous Communal Highway Spills (usually highway accidents) City of Ottawa			
90	1 of 1	ESE/173.6	77.7 / 1.61	Hydro OTTAWA LIMITED 882 CAMPBELL AVE OTTAWA ON K2A 2C5	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON7110563 221122 Electric Power Distribution 05 			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			
91	1 of 1	E/175.4	76.8 / 0.64	856 Clyde Avenue Ottawa ON K1Z 5A2	EHS
Order No:		24052700171	Nearest Intersection:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	30-MAY-24			Search Radius (km):	.25
Date Received:	27-MAY-24			X:	-75.7492297
Previous Site Name:				Y:	45.3771818
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				

92	1 of 1	WNW/176.0	75.1 / -0.98	ON	WWIS

Well ID:	1507939	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Domestic	Data Entry Status:	
Use 2nd:	0	Data Src:	1
Final Well Status:	Water Supply	Date Received:	07/11/1950
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:		Contractor:	3725
Tag:		Form Version:	1
Constructn Method:		Owner:	
Elevation (m):		County:	OTTAWA-CARLETON
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	OTTAWA CITY		
Site Info:			
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1507939.pdf		

Additional Detail(s) (Map)

Well Completed Date:	04/10/1950
Year Completed:	1950
Depth (m):	18.5928
Latitude:	45.3784664486815
Longitude:	-75.7552148056072
X:	-75.7552146438542
Y:	45.378466442382866
Path:	150\1507939.pdf

Bore Hole Information

Bore Hole ID:	10029974	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440870.70
Code OB Desc:		North83:	5025272.00
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	04/10/1950	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	p9
Location Method Desc:	Original Pre1985 UTM Rel Code 9: unknown UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008407			
Layer:		2			
Color:		8			
General Color:		BLACK			
Material 1:		26			
Material 1 Desc:		ROCK			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		7.0			
Formation End Depth:		61.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008406			
Layer:		1			
Color:		3			
General Color:		BLUE			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961507939			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578544			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052599			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		8.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		930052600			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		61.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991507939			
Pump Set At:					
Static Level:		12.0			
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:		72.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		0			
Pumping Duration MIN:		40			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462239			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		59.0			
Water Found Depth UOM:		ft			
<u>93</u>	1 of 1	SE/180.8	77.9 / 1.73	878 Boyd Avenue Ottawa ON K2A 2E3	EHS
Order No:	23042400600			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	27-APR-23			Search Radius (km):	.25
Date Received:	24-APR-23			X:	-75.7507803
Previous Site Name:				Y:	45.3756174
Lot/Building Size:					
Additional Info Ordered:	City Directory				
<u>94</u>	1 of 1	S/184.8	77.9 / 1.79	Jewish Community Campus of Ottawa Inc 31 Nadolny Sachs Pr Ottawa ON K2A 1R9	GEN
Generator No:	ON3069957				
SIC Code:	611690				
SIC Description:	ALL OTHER SCHOOLS AND INSTRUCTION				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Choice of Contact: CO_OFFICIAL Phone No Admin: Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 331 Waste Class Name: WASTE COMPRESSED GASES					
Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS					
95	1 of 1	ESE/187.5	77.8 / 1.65	877 BOYD AVENUE Ottawa ON	WWIS
Well ID: 7163796 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z123949 Tag: A113553 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06/02/2011 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7163796.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 04/26/2011 Year Completed: 2011 Depth (m): 9.14 Latitude: 45.3758722266553 Longitude: -75.7500294512344 X: -75.75002928969833 Y: 45.37587222041436 Path: 716\7163796.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1003516628 DP2BR:					
Elevation: Elevrc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	441274.00
Code OB Desc:				North83:	5024980.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		04/26/2011	UTMRC Desc:		margin of error : 10 - 30 m
Remarks:		Location Method:		wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003801329			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		9.140000343322754			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003801328			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		12			
Material 2 Desc:		STONES			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003801327			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		01			
Material 2 Desc:		FILL			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003801340			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003801339			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003801341			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		9.140000343322754			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003801337			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003801326			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003801333			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.049999952316284			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003801334			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer: Slot: Screen Top Depth: Screen End Depth: Screen Material: Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter:					
<u>Water Details</u>					
Water ID: 1003801332 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1003801331 Diameter: 7.619999885559082 Depth From: 1.5199999809265137 Depth To: 9.140000343322754 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1003801330 Diameter: 11.430000305175781 Depth From: 0.0 Depth To: 1.5199999809265137 Hole Depth UOM: m Hole Diameter UOM: cm					
96	1 of 1	ESE/189.1	77.8 / 1.65	877 BOYD AVE Ottawa ON	WWIS
Well ID: 7159361 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z127943 Tag: A097271 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: WKQ-003456 PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159361.pdf					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 02/17/2011 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		01/20/2011			
Year Completed:		2011			
Depth (m):		7.62			
Latitude:		45.375854225536			
Longitude:		-75.7500292132567			
X:		-75.75002905164641			
Y:		45.375854219192526			
Path:		715\7159361.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003477040			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441274.00
Code OB Desc:				North83:	5024978.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	01/20/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003779270				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	12				
Material 3 Desc:	STONES				
Formation Top Depth:	0.0				
Formation End Depth:	1.5199999809265137				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003779271				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:	73				
Material 2 Desc:	HARD				
Material 3:	68				
Material 3 Desc:	DRY				
Formation Top Depth:	1.5199999809265137				
Formation End Depth:	7.619999885559082				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003779281			
Layer:		1			
Plug From:		0.0			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003779282			
Layer:		2			
Plug From:		2.740000009536743			
Plug To:		7.619999885559082			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003779279			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003779269			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003779275			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.049999952316284			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003779276			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.049999952316284			
Screen End Depth:		7.619999885559082			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1003779274			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1003779272			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1003779273			
Diameter:		5.710000038146973			
Depth From:		1.5199999809265137			
Depth To:		7.619999885559082			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
97	1 of 2	SW/189.4	78.9 / 2.76	Enbridge Gas Distribution Inc. 840 Denison Crescent Ottawa ON	SPL
Ref No:	6856-9ZJR3Y			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	8/19/2015			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	8/19/2015			Impact to Health:	
Dt Document Closed:	8/26/2015			Agency Involved:	
Site No:	NA				
MOE Response:	No				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:	Residential<UNOFFICIAL>				
Site Address:	840 Denison Crescent				
Site Region:					
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:					
Incident Preceding Spill:					
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	0 other - see incident description				
Contaminant Qty 1:	0				
Contaminant Unit:	other - see incident description				
Client Type:					
Source Type:					
Contaminant Code:	35				
Contaminant Name:	NATURAL GAS (METHANE)				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Operator/Human Error Incident Summary: TSSA FSB: 1/2" plastic IP line strike to atm. Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Communal SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Enbridge Gas Distribution Inc.					
97	2 of 2	SW/189.4	78.9 / 2.76	PIPELINE HIT - 1/2" 840 DENISON CRESCENT,,OTTAWA,ON,K2A 2N5,CA ON	PINC
Incident Id: Incident No: 1705350 Incident Reported Dt: 8/19/2015 Type: FS-Pipeline Incident Status Code: Tank Status: Non Mandated Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: PIPELINE HIT - 1/2" Incident Address: 840 DENISON CRESCENT,,OTTAWA,ON,K2A 2N5,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					
98	1 of 1	ESE/189.5	77.8 / 1.65	877 BOYD AVENUE Ottawa ON	WWIS
Well ID: 7163797 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z123950 Tag: A113554 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06/02/2011 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			OTTAWA CITY	Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7163797.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/26/2011			
Year Completed:		2011			
Depth (m):		9.14			
Latitude:		45.3758633938169			
Longitude:		-75.7500037910978			
X:		-75.75000362933149			
Y:		45.375863387339976			
Path:		716\7163797.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003516630		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441276.00
Code OB Desc:				North83:	5024979.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		04/26/2011		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003801387			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		9.140000343322754			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003801386			
Laver:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		12			
Material 2 Desc:		STONES			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003801385			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		01			
Material 2 Desc:		FILL			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003801397			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003801398			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003801399			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		9.140000343322754			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1003801395			
Method Construction Code:		5			
Method Construction:		Air Percussion			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003801384			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003801391			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.049999952316284			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003801392			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.049999952316284			
Screen End Depth:		9.140000343322754			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1003801390			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003801389			
Diameter:		7.619999885559082			
Depth From:		1.5199999809265137			
Depth To:		9.140000343322754			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1003801388			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
99	1 of 4	SE/191.7	77.8 / 1.67	MASTRON MECHANICAL 1988 LTD 877 BOYD AVE OTTAWA ON K2A 2E2	SCT
Established:		1976			
Plant Size (ft²):		2400			
Employment:		11			
--Details--					
Description:		SHEET METAL WORK			
SIC/NAICS Code:		3444			
99	2 of 4	SE/191.7	77.8 / 1.67	National Cabinet Design Supplies & Accessories Ltd. 877A Boyd Ave Ottawa ON K2A 2E2	SCT
Established:		1994			
Plant Size (ft²):					
Employment:		1			
--Details--					
Description:		Wood Kitchen Cabinet and Counter Top Manufacturing			
SIC/NAICS Code:		337110			
Description:		Other Wood Household Furniture Manufacturing			
SIC/NAICS Code:		337123			
Description:		Showcase, Partition, Shelving and Locker Manufacturing			
SIC/NAICS Code:		337215			
99	3 of 4	SE/191.7	77.8 / 1.67	Breck-Mar Sales & Service Ltd. 877 Boyd Ave Ottawa ON K2A 2E2	SCT
Established:		01-SEP-86			
Plant Size (ft²):		4000			
Employment:					
--Details--					
Description:		Plumbing, Heating and Air-Conditioning Contractors			
SIC/NAICS Code:		238220			
Description:		Wholesale Trade Agents and Brokers			
SIC/NAICS Code:		419120			
Description:		Wholesale Trade Agents and Brokers			
SIC/NAICS Code:		419120			
99	4 of 4	SE/191.7	77.8 / 1.67	877 Boyd Avenue Ottawa ON	EHS
Order No:		20101124010		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		11/30/2010		Search Radius (km):	0.25
Date Received:		11/24/2010 10:37:55 AM		X:	-75.75039
Previous Site Name:				Y:	45.375732

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Lot/Building Size: Additional Info Ordered:					
100	1 of 3	E/191.9	76.8 / 0.66	SWISH MAINTENANCE LIMITED 864 CLYDE AVENUE OTTAWA ON K1Z 5A2	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Vendor Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
100	2 of 3	E/191.9	76.8 / 0.66	Ottawa Solar Power Inc. 864 Clyde Ave Ottawa ON K1Z 5A2	SCT
Established: Plant Size (ft²): Employment:		01-SEP-97			
--Details-- Description: SIC/NAICS Code:		Other Electric Power Generation 221119			
Description: SIC/NAICS Code:		Electrical Wiring and Construction Supplies Wholesaler-Distributors 416110			
Description: SIC/NAICS Code:		Industrial Design Services 541420			
100	3 of 3	E/191.9	76.8 / 0.66	Tomlinson Tomlinson 864 Clyde Ave N Ottawa ON K1Z 5A4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON8231024 As of Oct 2022 Canada Registered			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Detail(s)					
Waste Class:		148 C			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
101	1 of 5	E/195.5	76.8 / 0.65	3240797 Canada Inc. 870 Clyde Avenue Ottawa CITY OF OTTAWA ON	EBR
EBR Registry No:		010-1574		Decision Posted:	
Ministry Ref No:		7901-76ALQ7		Exception Posted:	
Notice Type:		Instrument Decision		Section:	
Notice Stage:				Act 1:	
Notice Date:		October 16, 2009		Act 2:	
Proposal Date:		September 04, 2007		Site Location Map:	
Year:		2007			
Instrument Type:		(EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)			
Off Instrument Name:					
Posted By:					
Company Name:		3240797 Canada Inc.			
Site Address:					
Location Other:					
Proponent Name:					
Proponent Address:		870 Clyde avenue, Ottawa Ontario, Canada K1Z 5A2			
Comment Period:					
URL:					
Summary:					
Site Location Details:					
870 Clyde Avenue Ottawa CITY OF OTTAWA					
101	2 of 5	E/195.5	76.8 / 0.65	3240797 Canada Inc. 870 Clyde Ave Ottawa ON K1Z 5A2	CA
Certificate #:		0285-7WKLMK			
Application Year:		2009			
Issue Date:		10/8/2009			
Approval Type:		Air			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
101	3 of 5	E/195.5	76.8 / 0.65	870 Clyde Ave Ottawa ON	SPL
Ref No:		0524-9E4M3R		Municipality No:	
Year:				Nature of Damage:	
Incident Dt:		2013/12/05		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		2013/12/05		Impact to Health:	
Dt Document Closed:				Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site No: MOE Response: Referral to others Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Chales Auto Care<UNOFFICIAL> Site Address: 870 Clyde Ave Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northings: Easting: Incident Cause: Leak/Break Incident Preceding Spill: Environment Impact: Confirmed Health Env Consequence: Nature of Impact: Soil Contamination Contaminant Qty: 0 L Contaminant Qty 1: 0 Contaminant Unit: L Client Type: Source Type: Contaminant Code: 13 Contaminant Name: FURNACE OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Equipment Failure Incident Summary: TSSA Bruce Fuels- located UST Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Tank - Underground SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:					

101	4 of 5	E/195.5	76.8 / 0.65	870 CLYDE AVE, OTTAWA ON	INC
Incident No: 1296404 Incident ID: Instance No: Status Code: Incident Status: Incident Severity: Task No: 4736215 Attribute Category: FS-Perform L1 Incident Insp Context: Date of Occurrence: 2013/12/05 00:00:00 Time of Occurrence: NULL Occr Insp Start Dt: 2013/12/06 00:00:00 Incident Creat On: Instance Creat Dt: Instance Install Dt: Approx Quant Rel: Tank Capacity:					
Any Health Impact: No Any Enviro Impact: Yes Service Intrap: No Was Prop Damaged: No Reside App. Type: Commer App. Type: Indus App. Type: Institut App. Type: Depth Ground Cover: Operation Pressure: Equipment Type: Equipment Model: Serial No: Cylinder Capacity: Cylinder Cap Units: Cylinder Mat Type: Pump Flow Rate Cap:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Fuels Occur Type: Leak Occur Type Rpt: Occur Category: Fuel Type Involved: Fuel Oil Fuel Type Reported: Enforcement Policy: NULL Prc Escalation Req: NULL Item: Item Description: Device Installed Location: Venting Type: Vent Conn Mater: Vent Chimney Mater: Pipeline Type: Pipeline Involved: Pipe Material: Regulator Location: Regulator Type: Liquid Prop Make: Liquid Prop Model: Liquid Prop Serial No: Liquid Prop Notes: Inventory Address: 870 CLYDE AVE, OTTAWA - LEAK Invent Postal Code: Notes: Contact Natural Env: Aff Prop Use Water: Occurrence Narrative: underground fuel oil tank discovery, subsequent leak Operation Type Involved: Commercial (e.g. restaurant, business unit, etc)					
101	5 of 5	E/195.5	76.8 / 0.65	3240797 Canada Inc. 870 Clyde Ave Ottawa ON K1Z 5A2	ECA
Approval No: 0285-7WKLMK Approval Date: 2009-10-08 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-AIR Project Type: AIR Business Name: 3240797 Canada Inc. Address: 870 Clyde Ave Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/7901-76ALQ7-14.pdf PDF Site Location:					
102	1 of 1	SE/195.6	77.9 / 1.72	877 BOYD AVE Ottawa ON	WWIS
Well ID: 7158273 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Test Hole Water Type: Casing Material: Audit No: M03224 Tag: A097285 Constructn Method: Elevation (m):					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 01/24/2011 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 5 Owner: County: OTTAWA-CARLETON					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			OTTAWA CITY	Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7158273.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		12/22/2010			
Year Completed:		2010			
Depth (m):		7.62			
Latitude:		45.3756542840287			
Longitude:		-75.750320317628			
X:		-75.75032015602463			
Y:		45.37565427696998			
Path:		715\7158273.pdf			
Bore Hole Information					
Bore Hole ID:		1003461056		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441251.00
Code OB Desc:				North83:	5024956.00
Open Hole:		No		Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		12/22/2010		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1004585290			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
Overburden and Bedrock					
Materials Interval					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1004585293			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		5.179999828338623			
Formation End Depth:		7.619999885559082			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1004585291			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.83000000429153442			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1004585292			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.83000000429153442			
Formation End Depth:		5.179999828338623			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1004585296			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1004585297			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004585298			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		7.619999885559082			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004585304			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1004585289			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004585299			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.049999952316284			
Casing Diameter:		4.210000038146973			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Casing</u>					
Casing ID:		1004585300			
Layer:		2			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		3.049999952316284			
Depth To:		7.619999885559082			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1004585301			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
 <u>Hole Diameter</u>					
Hole ID:		1004585295			
Diameter:		5.710000038146973			
Depth From:		1.8300000429153442			
Depth To:		7.619999885559082			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1004585294			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1004585280			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441276.00
Code OB Desc:				North83:	5024976.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	4
Date Completed:	12/22/2010			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	WWR
Location Method Desc:					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004585284			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1004585283			
Method Construction Code:					
Method Construction:					
Other Method Construction:		AIR PERCUSSION			
 <u>Pipe Information</u>					
Pipe ID:		1004585285			
Casing No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004585287			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.049999952316284			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004585286			
Layer:		1			
Slot:					
Screen Top Depth:		3.049999952316284			
Screen End Depth:		7.619999885559082			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1004585288			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1004585282			
Diameter:		5.710000038146973			
Depth From:					
Depth To:		7.619999885559082			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1004585271			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441259.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	5024978.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	4
Date Completed:	12/22/2010			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	WWR
Location Method Desc:					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004585275			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1004585274			
Method Construction Code:					
Method Construction:					
Other Method Construction:		AIR PERCUSSION			
<u>Pipe Information</u>					
Pipe ID:		1004585276			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004585278			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.049999952316284			
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004585277			
Layer:		1			
Slot:					
Screen Top Depth:		3.049999952316284			
Screen End Depth:		7.619999885559082			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1004585279			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:					
Diameter:		1004585273			
5.710000038146973					
Depth From:					
Depth To:		7.619999885559082			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
103	1 of 1	SE/196.5	77.8 / 1.67	877 BOYD AVENUE Ottawa ON	WWIS
Well ID: 7163795					
Construction Date:					
Use 1st:		Monitoring and Test Hole		Flowing (Y/N):	
Use 2nd:		0		Flow Rate:	
Final Well Status:		Monitoring and Test Hole		Data Entry Status:	
Water Type:				Data Src:	
Casing Material:				Date Received:	06/02/2011
Audit No:	Z123947			Selected Flag:	TRUE
Tag:	A113552			Abandonment Rec:	
Constructn Method:				Contractor:	7241
Elevation (m):				Form Version:	7
Elevatn Reliabilty:				Owner:	
Depth to Bedrock:				County:	OTTAWA-CARLETON
Well Depth:				Lot:	
Overburden/Bedrock:				Concession:	
Pump Rate:				Concession Name:	
Static Water Level:				Easting NAD83:	
Clear/Cloudy:				Northing NAD83:	
Municipality:		OTTAWA CITY		Zone:	
Site Info:				UTM Reliability:	
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7163795.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 04/26/2011					
Year Completed: 2011					
Depth (m): 9.14					
Latitude: 45.3756818729324					
Longitude: -75.7502312810052					
X: -75.75023111953242					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Y:		45.37568186606202			
Path:		716\7163795.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003516626			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441258.00
Code OB Desc:				North83:	5024959.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	04/26/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003801311				
Layer:	1				
Color:	8				
General Color:	BLACK				
Material 1:	11				
Material 1 Desc:	GRAVEL				
Material 2:	01				
Material 2 Desc:	FILL				
Material 3:	77				
Material 3 Desc:	LOOSE				
Formation Top Depth:	0.0				
Formation End Depth:	0.3100000023841858				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003801312				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	12				
Material 2 Desc:	STONES				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	1.5199999809265137				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003801313				
Layer:	3				
Color:	2				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		9.140000343322754			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003801323			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003801325			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		9.140000343322754			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003801324			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003801321			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003801310			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003801317			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.049999952316284			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003801318			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
 <u>Water Details</u>					
Water ID:		1003801316			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1003801314			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1003801315			
Diameter:		7.619999885559082			
Depth From:		1.5199999809265137			
Depth To:		9.140000343322754			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
104	1 of 1	E/196.5	76.8 / 0.67	861 CLYDE AVE Ottawa ON	WWIS
Well ID:	7220446			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z184495			Contractor:	7241
Tag:	A157755			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level: Clear/Cloudy: Municipality: Site Info:				Zone: UTM Reliability:	
		NEPEAN TOWNSHIP			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220446.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/08/2013			
Year Completed:		2013			
Depth (m):		3.66			
Latitude:		45.3776430408759			
Longitude:		-75.749031096134			
X:		-75.74903093461135			
Y:		45.37764303440175			
Path:		722\7220446.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1004765909		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441354.00
Code OB Desc:				North83:	5025176.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		04/08/2013		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005154630			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005154631			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.130000114440918			
Formation End Depth:		3.6600000858306885			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005154629			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005154640			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005154642			
Layer:		3			
Plug From:		1.8300000429153442			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005154641			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1005154639			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1005154628			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005154635			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005154636			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.130000114440918			
Screen End Depth:		3.6600000858306885			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005154634			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005154633			
Diameter:		7.619999885559082			
Depth From:		2.740000009536743			
Depth To:		3.6600000858306885			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005154632			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.740000009536743			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
105	1 of 1	ESE/196.7	77.7 / 1.61	877 BOYD AVENUE Ottawa ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7163798			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06/02/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z123946			Contractor:	7241
Tag:	A113555			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7163798.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	04/26/2011				
Year Completed:	2011				
Depth (m):	9.14				
Latitude:	45.375809725883				
Longitude:	-75.7499519949423				
X:	-75.74995183339225				
Y:	45.37580971935174				
Path:	716\7163798.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003516632			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441280.00
Code OB Desc:				North83:	5024973.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	04/26/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003801439				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		9.140000343322754			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003801437			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		01			
Material 2 Desc:		FILL			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003801438			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		12			
Material 2 Desc:		STONES			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003801450			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003801451			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		9.140000343322754			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1003801449			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003801447			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003801436			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003801443			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.049999952316284			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003801444			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.049999952316284			
Screen End Depth:		9.140000343322754			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1003801442			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003801441			
Diameter:		7.619999885559082			
Depth From:		1.5199999809265137			
Depth To:		7.139999866485596			
Hole Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1003801440			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

106	1 of 1	SE/197.7	77.8 / 1.67	877 BOYD AVENUE Ottawa ON	WWIS
Well ID:		7163794		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	06/02/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z123948		Contractor:	7241
Tag:		A113551		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7163794.pdf			

Additional Detail(s) (Map)

Well Completed Date: 04/26/2011
Year Completed: 2011
Depth (m): 9.14
Latitude: 45.3756637879282
Longitude: -75.7502438134933
X: -75.75024365102799
Y: 45.37566378148467
Path: 716\7163794.pdf

Bore Hole Information

Bore Hole ID:	1003516624	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	441257.00
Code OB Desc:		North83:	5024957.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	04/26/2011	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003801295			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		01			
Material 2 Desc:		FILL			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003801297			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		9.140000343322754			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003801296			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		12			
Material 2 Desc:		STONES			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1003801309			
Layer:		3			
Plug From:		2.740000009536743			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		9.140000343322754			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003801307			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003801308			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003801305			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003801294			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003801301			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.049999952316284			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003801302			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.049999952316284			
Screen End Depth:		9.140000343322754			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		1003801300			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003801299			
Diameter:		7.619999885559082			
Depth From:		1.5199999809265137			
Depth To:		9.140000343322754			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1003801298			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
107	1 of 1	E/197.7	76.8 / 0.67	861 CLYDE AVE Ottawa ON	WWIS
Well ID:	7220405			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z184499			Contractor:	7241
Tag:	A157752			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220405.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	04/08/2014				
Year Completed:	2014				
Depth (m):	3.66				
Latitude:	45.3776521251871				
Longitude:	-75.7490184439926				
X:	-75.749018281844				
Y:	45.3776521183362				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:		722\7220405.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1004764960			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441355.00
Code OB Desc:				North83:	5025177.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/08/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005152868				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	01				
Material 1 Desc:	FILL				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	0.9100000262260437				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005152870				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	2.130000114440918				
Formation End Depth:	3.66000000858306885				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005152869				
Layer:	2				
Color:	6				
General Color:	BROWN				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005152880			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005152879			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005152881			
Layer:		3			
Plug From:		1.8300000429153442			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005152878			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005152867			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005152874			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		5.199999809265137			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005152875			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.130000114440918			
Screen End Depth:		3.6600000858306885			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005152873			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005152872			
Diameter:		7.619999885559082			
Depth From:		2.740000009536743			
Depth To:		3.6600000858306885			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005152871			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.740000009536743			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
108	1 of 1	ESE/197.8	77.8 / 1.67	877 BOYD AVE Ottawa ON	WWIS
Well ID:		7159360		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Test Hole		Date Received:	02/17/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z127944		Contractor:	7241
Tag:		A097304		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:		UTM Reliability:			
Municipality:		OTTAWA CITY			
Site Info:		WKQ-003456			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159360.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		01/20/2011			
Year Completed:		2011			
Depth (m):		7.62			
Latitude:		45.3757643037995			
Longitude:		-75.7500152528198			
X:		-75.75001509094082			
Y:		45.37576429755419			
Path:		715\7159360.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003477038		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				441275.00	
Cluster Kind:				North83:	
Date Completed:		01/20/2011		5024968.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				3	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 10 - 30 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				www	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003779213			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		7.619999885559082			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003779212			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		12			
Material 3 Desc:		STONES			
Formation Top Depth:		0.0			
Formation End Depth:		1.519999809265137			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003779223			
Layer:		1			
Plug From:		0.0			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003779224			
Layer:		2			
Plug From:		2.740000009536743			
Plug To:		7.619999885559082			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003779221			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003779211			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003779217			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.049999952316284			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003779218			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.049999952316284			
Screen End Depth:		7.619999885559082			
Screen Material:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1003779216			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003779215			
Diameter:		5.710000038146973			
Depth From:		1.5199999809265137			
Depth To:		7.619999885559082			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1003779214			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
109	1 of 1	E/198.0	76.8 / 0.68	ON	WWIS
Well ID:		7379158		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	01/27/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:		C16072		Contractor:	7241
Tag:				Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:		1008615652		Tag No:	
Depth M:				Contractor:	7241
Year Completed:		2020		Latitude:	45.3777867985499
Well Completed Dt:		11/19/2020		Longitude:	-75.7490713105765
Audit No:		C16072		Y:	45.37778679210916

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:				X: -75.74907114946613	
<u>Bore Hole Information</u>					
Bore Hole ID:	1008615652			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441351.00
Code OB Desc:				North83:	5025192.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/19/2020			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

110	1 of 1	E/199.2	76.8 / 0.67	861 CLYDE AVE Ottawa ON	WWIS
Well ID:	7220406			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z184498			Contractor:	7241
Tag:	A157751			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220406.pdf				

Additional Detail(s) (Map)

Well Completed Date: 04/08/2014
 Year Completed: 2014
 Depth (m): 3.66
 Latitude: 45.3776342915694
 Longitude: -75.7489926643699
 X: -75.74899250200203
 Y: 45.37763428552697
 Path: 722\7220406.pdf

Bore Hole Information

Bore Hole ID: 1004764963
 DP2BR:
 Elevation:
 Elevrc:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	441357.00
Code OB Desc:				North83:	5025175.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/08/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005152900			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005152902			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.130000114440918			
Formation End Depth:		3.66000000858306885			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005152901			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.9100000262260437			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005152913			
Layer:		3			
Plug From:		1.83000000429153442			
Plug To:		3.66000000858306885			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005152911			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005152912			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.83000000429153442			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005152910			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005152899			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005152906			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005152907			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Slot:		10			
Screen Top Depth:		2.130000114440918			
Screen End Depth:		3.6600000858306885			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Water Details</u>					
Water ID:		1005152905			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1005152903			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.740000009536743			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1005152904			
Diameter:		7.619999885559082			
Depth From:		2.740000009536743			
Depth To:		3.6600000858306885			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
111	1 of 1	E/200.8	76.8 / 0.68	ON	WWIS
Well ID:	7379166			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	01/27/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	C16071			Contractor:	7241
Tag:				Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
 <u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID: 1008615676 Depth M: Year Completed: 2020 Well Completed Dt: 11/20/2020 Audit No: C16071 Path:					
Tag No: Contractor: 7241 Latitude: 45.3777870498165 Longitude: -75.7490329975474 Y: 45.37778704324654 X: -75.74903283633193					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008615676 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 11/20/2020 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 441354.00 North83: 5025192.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
112	1 of 3	ESE/201.4	76.7 / 0.58	Medaglia Auto Imports Inc. 10 Dobbie Street Ottawa ON K2A 4G1	CA
Certificate #: 1459-6FMNHY Application Year: 2005 Issue Date: 9/6/2005 Approval Type: Municipal and Private Sewage Works Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
112	2 of 3	ESE/201.4	76.7 / 0.58	Medaglia Auto Imports Inc. 10 Dobbie St Ottawa ON K2A 4G1	SPL
Ref No: 7734-8QML3S Year: Incident Dt: 16-JAN-12 Dt MOE Arvl on Scn: MOE Reported Dt: 18-JAN-12 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Medaglia Auto Imports<UNOFFICIAL> Site Address: 10 Dobbie St					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: Other Discharges Incident Preceding Spill: Environment Impact: Possible Health Env Consequence: Nature of Impact: Soil Contamination Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Client Type: Source Type: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Sewage - Municipal/Private and Commercial Incident Reason: Other - Reason not otherwise defined Incident Summary: TIPS: Medaglia Auto- Oil like substance dumped to grnd. Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Other SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Medaglia Auto Imports Inc.					
112	3 of 3	ESE/201.4	76.7 / 0.58	Medaglia Auto Imports Inc. 10 Dobbie Street Ottawa ON K2A 2C9	ECA
Approval No: 1459-6FMNHY Approval Date: 2005-09-06 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS Business Name: Medaglia Auto Imports Inc. Address: 10 Dobbie Street Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/8000-6E8LWQ-14.pdf PDF Site Location:					
113	1 of 1	E/202.6	76.8 / 0.67	861 CLYDE AVE Ottawa ON	WWIS
Well ID: 7220444 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Test Hole Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 05/15/2014					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:	Z184494		Contractor:		7241
Tag:	A157860		Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220444.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/08/2014			
Year Completed:		2014			
Depth (m):		3.66			
Latitude:		45.3777243809069			
Longitude:		-75.7489810816945			
X:		-75.74898092001924			
Y:		45.377724374561545			
Path:		722\7220444.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1004765885			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441358.00
Code OB Desc:				North83:	5025185.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/08/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005154601				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	2.130000114440918				
Formation End Depth:	3.6600000858306885				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005154599			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005154600			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154612			
Layer:		3			
Plug From:		1.8300000429153442			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154610			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154611			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005154609			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005154598			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005154605			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005154606			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.130000114440918			
Screen End Depth:		3.6600000858306885			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005154604			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005154603			
Diameter:		7.619999885559082			
Depth From:		2.740000009536743			
Depth To:		3.6600000858306885			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: 1005154602 Diameter: 11.430000305175781 Depth From: 0.0 Depth To: 2.740000009536743 Hole Depth UOM: m Hole Diameter UOM: cm					
114	1 of 1	E/203.7	76.8 / 0.68	ON	WWIS
Well ID: 7240874 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C16215 Tag: A175663 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 05/05/2015 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1005337534 Depth M: Year Completed: 2015 Well Completed Dt: 03/12/2015 Audit No: C16215 Path:					
Tag No: A175663 Contractor: 7241 Latitude: 45.3773560279064 Longitude: -75.7488740423959 Y: 45.37735602143116 X: -75.74887388043001					
<u>Bore Hole Information</u>					
Bore Hole ID: 1005337534 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 03/12/2015 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 441366.00 North83: 5025144.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
115	1 of 1	WSW/204.6	77.9 / 1.75	Enbridge Gas Distribution Inc. Carling and Rex Ottawa ON	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ref No: Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: Incident Preceding Spill: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Client Type: Source Type: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Incident Summary: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:	3376-9N5VNG 2014/08/19 2014/08/19 2014/09/03 NA Referral to others 1848 Carling Ave<UNOFFICIAL> Carling and Rex Ottawa Leak/Break Not Anticipated Air Pollution 0 other - see incident description 0 other - see incident description 35 NATURAL GAS (METHANE) Operator/Human Error TSSA: line damage, ongoing Pipeline/Components TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill Enbridge Gas Distribution Inc.	Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:			
116	1 of 1	SW/204.8	78.2 / 2.06	JOSIE MONTGOMERY O/A MAL'S GROCERY 844 DENISON CRES,,OTTAWA,ON,K2A 2N5,CA ON	PINC
Incident Id: Incident No: Incident Reported Dt: Type: Status Code: Tank Status: Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp:	1679232 7/10/2015 FS-Pipeline Incident Pipeline Damage Reason Est 	Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks:		Location Method:			p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008771			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		9.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008774			
Layer:		4			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		98.0			
Formation End Depth:		105.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008775			
Layer:		5			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		105.0			
Formation End Depth:		145.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		931008772			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		9.0			
Formation End Depth:		43.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008773			
Layer:		3			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		43.0			
Formation End Depth:		98.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508088			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578693			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052903			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		18.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052904			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		145.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508088			
Pump Set At:					
Static Level:		9.0			
Final Level After Pumping:		13.0			
Recommended Pump Depth:					
Pumping Rate:		4.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
 <u>Water Details</u>					
Water ID:		933462455			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		43.0			
Water Found Depth UOM:		ft			
117	2 of 2	SW/205.2	78.9 / 2.77	ON	WWIS
Well ID:	1508090			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	03/24/1955
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	3718
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508090.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		09/15/1954			
Year Completed:		1954			
Depth (m):		42.672			
Latitude:		45.3751362461032			
Longitude:		-75.7551704752124			
X:		-75.75517031319082			
Y:		45.37513623940877			
Path:		150\1508090.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	10030125			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440870.70
Code OB Desc:				North83:	5024902.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	9
Date Completed:	09/15/1954			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	931008783				
Layer:	2				
Color:					
General Color:					
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	8.0				
Formation End Depth:	60.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	931008782				
Layer:	1				
Color:					
General Color:					
Material 1:	02				
Material 1 Desc:	TOPSOIL				
Material 2:	17				
Material 2 Desc:	SHALE				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008784			
Layer:		3			
Color:					
General Color:					
Material 1:		18			
Material 1 Desc:		SANDSTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		60.0			
Formation End Depth:		140.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961508090			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578695			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052907			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		20.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052908			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		140.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508090			
Pump Set At:					
Static Level:		10.0			
Final Level After Pumping:		10.0			
Recommended Pump Depth:					
Pumping Rate:		100.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462457			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		60.0			
Water Found Depth UOM:		ft			

118	1 of 1	SSW/205.2	78.9 / 2.74	ON	WWIS
Well ID:					
1508086		Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:		Data Entry Status:			
Domestic		Data Src:			
Use 2nd:		1			
0		Date Received:			
Final Well Status:		09/07/1954			
Water Supply		Selected Flag:			
Water Type:		TRUE			
Casing Material:		Abandonment Rec:			
Audit No:		3725			
Tag:		Form Version:			
		1			
Constructn Method:		Owner:			
Elevation (m):		County:			
Elevatn Reliabilty:		OTTAWA-CARLETON			
Depth to Bedrock:		Lot:			
Well Depth:		Concession:			
Overburden/Bedrock:		Concession Name:			
Pump Rate:		Easting NAD83:			
Static Water Level:		Northing NAD83:			
Clear/Cloudy:		Zone:			
Municipality:		UTM Reliability:			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508086.pdf			

Additional Detail(s) (Map)					
Well Completed Date:		08/10/1954			
Year Completed:		1954			
Depth (m):		42.672			
Latitude:		45.3749638284895			
Longitude:		-75.7540187470514			
X:		-75.7540185853579			
Y:		45.37496382156047			
Path:		150\1508086.pdf			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	10030121			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440960.70
Code OB Desc:				North83:	5024882.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	9
Date Completed:	08/10/1954			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:	Original Pre1985 UTM Rel Code 9: unknown UTM				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	931008759				
Layer:	1				
Color:					
General Color:					
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	3.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	931008761				
Layer:	3				
Color:					
General Color:					
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:	17				
Material 2 Desc:	SHALE				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	68.0				
Formation End Depth:	88.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	931008762				
Layer:	4				
Color:					
General Color:					
Material 1:	18				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		SANDSTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		88.0			
Formation End Depth:		109.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		931008763			
Layer:		5			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		109.0			
Formation End Depth:		140.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		931008760			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0			
Formation End Depth:		68.0			
Formation End Depth UOM:		ft			
 <u>Method of Construction & Well</u> <u>Use</u>					
Method Construction ID:		961508086			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		10578691			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930052900			
Layer:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		140.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052899			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		18.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508086			
Pump Set At:					
Static Level:		11.0			
Final Level After Pumping:		15.0			
Recommended Pump Depth:					
Pumping Rate:		5.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		2			
Water State After Test:		CLOUDY			
Pumping Test Method:		1			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462453			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		140.0			
Water Found Depth UOM:		ft			
119	1 of 1	ESE/206.8	76.8 / 0.63	AECON UTILITIES INC. 874 CLYDE AVENUE OTTAWA ON K1Z 5A2	GEN
Generator No:		ON6769680			
SIC Code:		238190			
SIC Description:		OTHER FOUNDATION, STRUCTURE AND BUILDING EXTERIOR CONTRACTORS			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility: No No					
Detail(s)					
Waste Class: Waste Class Name: 221 LIGHT FUELS					
120	1 of 1	WSW/207.9	78.9 / 2.75	ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info: 1508093 Domestic 0 Water Supply OTTAWA CITY Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version: Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability: 1 03/24/1955 TRUE 3718 1 OTTAWA-CARLETON					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508093.pdf					
Additional Detail(s) (Map)					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: X: Y: Path: 12/15/1954 1954 18.288 45.3754020389879 -75.7558125920036 -75.75581243051718 45.37540203206378 150\1508093.pdf					
Bore Hole Information					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: 10030128 12/15/1954 Original Pre1985 UTM Rel Code 9: unknown UTM Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method: 18 440820.70 5024932.00 9 unknown UTM p9					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008791			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		20.0			
Formation End Depth:		50.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008790			
Layer:		1			
Color:					
General Color:					
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		20.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008792			
Layer:		3			
Color:					
General Color:					
Material 1:		18			
Material 1 Desc:		SANDSTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		50.0			
Formation End Depth:		60.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508093			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		10578698			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052914			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		20.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052915			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		60.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508093			
Pump Set At:					
Static Level:		20.0			
Final Level After Pumping:		40.0			
Recommended Pump Depth:					
Pumping Rate:		50.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462460			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		50.0			
Water Found Depth UOM:		ft			
<u>121</u>	1 of 1	E/208.2	76.8 / 0.67		WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ON					
Well ID:	1508040			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Commerical			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	11/01/1954
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	4833
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508040.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	10/26/1954				
Year Completed:	1954				
Depth (m):	76.5048				
Latitude:	45.377158409126				
Longitude:	-75.748811405467				
X:	-75.74881124363772				
Y:	45.377158402201886				
Path:	150\1508040.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	10030075			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441370.70
Code OB Desc:				North83:	5025122.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	9
Date Completed:	10/26/1954			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:	Original Pre1985 UTM Rel Code 9: unknown UTM				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	931008655				
Layer:	2				
Color:					
General Color:					
Material 1:	15				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		6.0			
Formation End Depth:		251.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008654			
Layer:		1			
Color:					
General Color:					
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		961508040			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		10578645			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930052806			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		20.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Casing</u>					
Casing ID:		930052807			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		251.0			
Casing Diameter:		5.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508040			
Pump Set At:					
Static Level:		6.0			
Final Level After Pumping:		125.0			
Recommended Pump Depth:					
Pumping Rate:		7.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		0			
Pumping Duration MIN:		40			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462378			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		248.0			
Water Found Depth UOM:		ft			
122	1 of 1	WSW/209.2	78.9 / 2.75	ON	WWIS
Well ID:		1508380		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Domestic		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Water Supply		Date Received:	
Water Type:				Selected Flag:	
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	
Tag:				Form Version:	
Constructn Method:				Owner:	
Elevation (m):				County:	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508380.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		11/16/1954			
Year Completed:		1954			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth (m):		32.004			
Latitude:		45.3753128785086			
Longitude:		-75.7556836886318			
X:		-75.7556835277141			
Y:		45.37531287198596			
Path:		150\1508380.pdf			

Bore Hole Information

Bore Hole ID:	10030415	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440830.70
Code OB Desc:		North83:	5024922.00
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	5
Date Completed:	11/16/1954	UTMRC Desc:	margin of error : 100 m - 300 m
Remarks:		Location Method:	p5
Location Method Desc:	Original Pre1985 UTM Rel Code 5: margin of error : 100 m - 300 m		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	931009536
Layer:	2
Color:	
General Color:	
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	8.0
Formation End Depth:	23.0
Formation End Depth UOM:	ft

Overburden and Bedrock

Materials Interval

Formation ID:	931009538
Layer:	4
Color:	
General Color:	
Material 1:	15
Material 1 Desc:	LIMESTONE
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	25.0
Formation End Depth:	105.0
Formation End Depth UOM:	ft

Overburden and Bedrock

Materials Interval

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		931009535			
Layer:		1			
Color:					
General Color:					
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931009537			
Layer:		3			
Color:					
General Color:					
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		23.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508380			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578985			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930053478			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		105.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930053477			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		30.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508380			
Pump Set At:					
Static Level:		12.0			
Final Level After Pumping:		12.0			
Recommended Pump Depth:					
Pumping Rate:		10.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
 <u>Water Details</u>					
Water ID:		933462863			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		60.0			
Water Found Depth UOM:		ft			
123	1 of 1	E/210.9	76.8 / 0.68	861 CLYDE AVE. Ottawa ON	WWIS
Well ID:	7114836			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	11/12/2008
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	M00443			Contractor:	7241
Tag:	A079081			Form Version:	5
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7114836.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	10/09/2008				
Year Completed:	2008				
Depth (m):					
Latitude:	45.3775915494643				
Longitude:	-75.7486472541261				
X:	-75.74864709270685				
Y:	45.37759154253083				
Path:	711\7114836.pdf				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7114836.pdf				
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:					
Year Completed:					
Depth (m):					
Latitude:	45.3776823083958				
Longitude:	-75.74853350301				
X:	-75.74853334086902				
Y:	45.37768230112411				
Path:	711\7114836.pdf				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7114836.pdf				
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:					
Year Completed:					
Depth (m):					
Latitude:	45.3773836156961				
Longitude:	-75.748785002395				
X:	-75.74878484034453				
Y:	45.37738360906196				
Path:	711\7114836.pdf				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7114836.pdf				
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:	10/09/2008				
Year Completed:	2008				
Depth (m):					
Latitude:	45.377555296089				
Longitude:	-75.7486850918956				
X:	-75.74868493063545				
Y:	45.37755528940667				
Path:	711\7114836.pdf				
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7114836.pdf				
 <u>Additional Detail(s) (Map)</u>					
Well Completed Date:	12/05/2007				
Year Completed:	2007				
Depth (m):	5.4864				
Latitude:	45.3776278028272				
Longitude:	-75.7486094163084				
X:	-75.74860925387989				
Y:	45.37762779626282				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:		711\7114836.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002707991			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441393.00
Code OB Desc:				North83:	5025180.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:				UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1002707994				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Hole Diameter</u>					
Hole ID:	1002707993				
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
<u>Bore Hole Information</u>					
Bore Hole ID:	1002707973			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441384.00
Code OB Desc:				North83:	5025170.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	10/09/2008			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1002707977				
Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From: Plug To: Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1002707976				
Method Construction Code:					
Method Construction:					
Other Method Construction:	DIAMOND CORE				
<u>Pipe Information</u>					
Pipe ID:	1002707978				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1002707980				
Layer:					
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:	4.0				
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:	ft				
<u>Construction Record - Screen</u>					
Screen ID:	1002707979				
Layer:					
Slot:					
Screen Top Depth:	4.0				
Screen End Depth:	14.0				
Screen Material:					
Screen Depth UOM:	ft				
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1002707981				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1002707975			
Diameter:		3.0			
Depth From:					
Depth To:		14.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002707982			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441381.00
Code OB Desc:				North83:	5025166.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	10/09/2008			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002707986			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002707985			
Method Construction Code:					
Method Construction:					
Other Method Construction:		DIAMOND CORE			
<u>Pipe Information</u>					
Pipe ID:		1002707987			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002707989			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		4.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:					
		ft			
<u>Construction Record - Screen</u>					
Screen ID:					
		1002707988			
Layer:					
Slot:					
Screen Top Depth:					
		4.0			
Screen End Depth:					
		14.0			
Screen Material:					
Screen Depth UOM:					
		ft			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:					
		1002707990			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:					
		1002707984			
Diameter:					
		3.0			
Depth From:					
Depth To:					
		14.0			
Hole Depth UOM:					
		ft			
Hole Diameter UOM:					
		inch			
<u>Bore Hole Information</u>					
Bore Hole ID:					
		1001880503			
DP2BR:					
Spatial Status:					
Code OB:					
Code OB Desc:					
Open Hole:					
Cluster Kind:					
Date Completed:					
		12/05/2007			
Remarks:					
Location Method Desc:					
		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Elevation:					
Elevrc:					
Zone:					
		18			
East83:					
		441387.00			
North83:					
		5025174.00			
Org CS:					
		UTM83			
UTMRC:					
		3			
UTMRC Desc:					
		margin of error : 10 - 30 m			
Location Method:					
		wwr			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002708001			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		5.5			
Formation End Depth:		18.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002708000			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		5.5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002708006			
Layer:		3			
Plug From:		7.0			
Plug To:		18.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002708004			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002708005			
Layer:		2			
Plug From:		1.0			
Plug To:		7.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002708010			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1002707999			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002708007			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		8.0			
Casing Diameter:		1.25			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1002708008			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.25			
<u>Hole Diameter</u>					
Hole ID:		1002708003			
Diameter:		3.5			
Depth From:		5.5			
Depth To:		18.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1002708002			
Diameter:		4.0			
Depth From:		0.0			
Depth To:		5.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Bore Hole Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1002707995			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441373.00
Code OB Desc:				North83:	5025147.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:				UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Method of Construction & Well Use</u>					
Method Construction ID:	1002707998				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
 <u>Hole Diameter</u>					
Hole ID:	1002707997				
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
124	1 of 27	W/212.1	75.9 / -0.25	OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	NPCB
Company Code:	F1530				
Industry:					
Site Status:					
Transaction Date:	1/29/1996				
Inspection Date:					
 <u>--Details--</u>					
Label:					
Serial No.:					
PCB Type/Code:	Askarel				
Location:					
Item/State:					
No. of Items:					
Manufacturer:					
Status:	Stored for Disposal				
Contents:	295.00 KG				
Label:					
Serial No.:					
PCB Type/Code:	Askarel				
Location:					
Item/State:					
No. of Items:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Manufacturer: Status: Stored for Disposal Contents: 400.00 KG Label: Serial No.: PCB Type/Code: Low 50 - 10,000 ppm Location: Item/State: No. of Items: Manufacturer: Status: Stored for Disposal Contents: 6150.00 KG Label: Serial No.: PCB Type/Code: Askarel Location: Item/State: No. of Items: Manufacturer: Status: Stored for Disposal Contents: 10400.00 KG					
124	2 of 27	W/212.1	75.9 / -0.25	SCHOOL 710 BROADVIEW HEATING OIL TANK OTTAWA CITY ON K2A 2M2	SPL
Ref No: 89167 Year: Incident Dt: 7/30/1993 Dt MOE Arvl on Scn: MOE Reported Dt: 7/30/1993 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: UNDERGROUND TANK LEAK Incident Preceding Spill: Environment Impact: CONFIRMED Health Env Consequence: Nature of Impact: Soil contamination Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Client Type: Source Type: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1:					
Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant UN No 1: Receiving Medium: LAND Incident Reason: OVERSTRESS/OVERPRESSURE Incident Summary: SCHOOL - UNDERGROUND TANK REMOVED AND LEAKING OIL Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:					
124	3 of 27	W/212.1	75.9 / -0.25	OTTAWA ROMAN CATHOLIC SEPARATE SCHOOL BD 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	OPCB
Year: 1995 Site Number: 40294A019 Name Owner: Additional Site Information:					
124	4 of 27	W/212.1	75.9 / -0.25	OTTAWA-CARLETON CATHOLIC SCHOOL BOARD 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	OPCB
Year: 2003 Site Number: 40294A019 Name Owner: Additional Site Information:					
124	5 of 27	W/212.1	75.9 / -0.25	OTTAWA ROMAN CATHOLIC SEPARATE SCHOOL BD 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	OPCB
Year: 1998 Site Number: 40294A019 Name Owner: Additional Site Information:					
--Details--					
Quantity: 34.00					
Address Site:					
Description: Number of Drums of Ballasts with High Level PCBs (>1000 ppm)					
Quantity: 6800.00					
Address Site:					
Description: Calculated Weight (Kg) of Drums of Ballasts with High Level PCBs (>1000 ppm)					
124	6 of 27	W/212.1	75.9 / -0.25	OTTAWA ROMAN CATHOLIC SEPARATE SCHOOL BD 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	OPCB

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year:		1999			
Site Number:		40294A019			
Name Owner:					
Additional Site Information:					
--Details--					
Quantity:		42.00			
Address Site:					
Description:		Number of Drums of Ballasts with High Level PCBs (>1000 ppm)			
Quantity:		8400.00			
Address Site:					
Description:		Calculated Weight (Kg) of Drums of Ballasts with High Level PCBs (>1000 ppm)			
124	7 of 27	W/212.1	75.9 / -0.25	OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	OPCB
Year:		2000			
Site Number:		40294A019			
Name Owner:					
Additional Site Information:					
--Details--					
Quantity:		8400.00			
Address Site:					
Description:		Calculated Weight (Kg) of Drums of Ballasts with High Level PCBs (>1000 ppm)			
Quantity:		42.00			
Address Site:					
Description:		Number of Drums of Ballasts with High Level PCBs (>1000 ppm)			
124	8 of 27	W/212.1	75.9 / -0.25	OTTAWA BOARD OF EDUCATION HIGHLAND PARK HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	GEN
Generator No:		ON0375205			
SIC Code:		8511			
SIC Description:		ELEMT./SECON. EDUC.			
Approval Years:		86,87,88,89,90,92,93,97,98,99,00,01			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		212			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
124	9 of 27	W/212.1	75.9 / -0.25	OTTAWA BOARD OF EDUCATION 29-548 HIGHLAND PARK HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	GEN
Generator No:		ON0375205			
SIC Code:		8511			
SIC Description:		ELEMT./SECON. EDUC.			
Approval Years:		94,95,96			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
124	10 of 27	W/212.1	75.9 / -0.25	OTTAWA R.C. SEPARATE SCHOOL BOARD NOTRE DAME HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	GEN
Generator No:		ON0426415			
SIC Code:		8511			
SIC Description:		ELEMT./SECON. EDUC.			
Approval Years:		93,94,95,96			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		243			
Waste Class Name:		PCB'S			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
124	11 of 27	W/212.1	75.9 / -0.25	OTTAWA-CARLETON CATHOLIC SCHOOL BOARD NOTRE DAME HIGH SCHOOL 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	GEN
Generator No: ON0426415 SIC Code: 8511 SIC Description: ELEM.T./SECON. EDUC. Approval Years: 97,98,99,00,01 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES Waste Class: 243 Waste Class Name: PCB'S Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
124	12 of 27	W/212.1	75.9 / -0.25	Ottawa-Carleton Catholic School Board Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	GEN
Generator No: ON5468196 SIC Code: SIC Description: Approval Years: 02,03,04,05,06 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		243			
Waste Class Name:		PCB'S			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
124	13 of 27	W/212.1	75.9 / -0.25	OTTAWA-CARLETON CATHOLIC SCHOOL BOARD 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	OPCB
Year:		2004			
Site Number:		40294A019			
Name Owner:					
Additional Site Information:					
124	14 of 27	W/212.1	75.9 / -0.25	OTTAWA ROMAN CAHTOLIC SEPARATE SCHOOL BD 710 BROADVIEW AVENUE OTTAWA ON K2A 2M2	NPCB
Company Code:		F1367			
Industry:		UNDEFINED			
Site Status:					
Transaction Date:					
Inspection Date:					
124	15 of 27	W/212.1	75.9 / -0.25	Ottawa Catholic District School Board Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	GEN
Generator No:		ON5468196			
SIC Code:		611690			
SIC Description:		All Other Schools and Instruction			
Approval Years:		07,08			
PO Box No:					
Country:					
Status:					
Co Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		243			
Waste Class Name:		PCB'S			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			

<u>124</u>	16 of 27	W/212.1	75.9 / -0.25	Ottawa Catholic District School Board Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	GEN
Generator No: ON5468196 SIC Code: 611690 SIC Description: All Other Schools and Instruction Approval Years: 2009 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					

<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		243			
Waste Class Name:		PCBS			

[124](#)

17 of 27

W/212.1

75.9 / -0.25

Ottawa Catholic District School Board
Notre Dame High School 710 Broadview Avenue
Ottawa ON K2A 2M2

GEN

Generator No: ON5468196
SIC Code: 611690
SIC Description: All Other Schools and Instruction
Approval Years: 2010
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Class: 243
Waste Class Name: PCBS

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

Waste Class: 146

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
124	18 of 27	W/212.1	75.9 / -0.25	Ottawa Catholic District School Board Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	GEN
Generator No:		ON5468196			
SIC Code:		611690			
SIC Description:		All Other Schools and Instruction			
Approval Years:		2011			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		243			
Waste Class Name:		PCBS			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
124	19 of 27	W/212.1	75.9 / -0.25	Ottawa Catholic District School Board Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	GEN
Generator No:		ON5468196			
SIC Code:		611690			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		All Other Schools and Instruction			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		243			
Waste Class Name:		PCBS			
124	20 of 27	W/212.1	75.9 / -0.25	Ottawa Catholic District School Board Notre Dame High School 710 Broadview Avenue Ottawa ON	GEN
Generator No:		ON5468196			
SIC Code:		611690			
SIC Description:		ALL OTHER SCHOOLS AND INSTRUCTION			
Approval Years:		2013			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		146			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		243			
Waste Class Name:		PCBS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
124	21 of 27	W/212.1	75.9 / -0.25	Ottawa Catholic District School Board Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	GEN
Generator No:		ON5468196			
SIC Code:		611690			
SIC Description:		ALL OTHER SCHOOLS AND INSTRUCTION			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		264			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		243			
Waste Class Name:		PCBS			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
124	22 of 27	W/212.1	75.9 / -0.25	Ottawa Catholic District School Board Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	GEN
Generator No:		ON5468196			
SIC Code:		611690			
SIC Description:		ALL OTHER SCHOOLS AND INSTRUCTION			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:					
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:					
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		263			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		243			
Waste Class Name:		PCBS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			

[124](#)

23 of 27

W/212.1

75.9 / -0.25

Ottawa Catholic District School Board
 Notre Dame High School 710 Broadview Avenue
 Ottawa ON K2A 2M2

GEN

Generator No: ON5468196
SIC Code: 611690
SIC Description: ALL OTHER SCHOOLS AND INSTRUCTION
Approval Years: 2014
PO Box No:
Country: Canada
Status:
Co Admin:
Choice of Contact: CO_OFFICIAL
Phone No Admin:
Contaminated Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 243
Waste Class Name: PCBS

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Class: 112

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
124	24 of 27	W/212.1	75.9 / -0.25	Ottawa Catholic District School Board Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	GEN
Generator No:		ON5468196			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		146 L			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
Waste Class:		148 L			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		212 B			
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
Waste Class:		213 L			
Waste Class Name:		Petroleum distillates			
Waste Class:		213 T			
Waste Class Name:		Petroleum distillates			
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
Waste Class:		146 T			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		148 B			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		148 I			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		251 T			
Waste Class Name:		Waste oils/sludges (petroleum based)			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 B			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		264 L			
Waste Class Name:		Photoprocessing wastes			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		331 L			
Waste Class Name:		Waste compressed gases including cylinders			
124	25 of 27	W/212.1	75.9 / -0.25	Ottawa Catholic District School Board Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	GEN
Generator No:		ON5468196			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
Waste Class:		148 C			

<i>Map Key</i>	<i>Number of Records</i>	<i>Direction/ Distance (m)</i>	<i>Elev/Diff (m)</i>	<i>Site</i>	<i>DB</i>
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
Waste Class:		263 B			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		148 I			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
Waste Class:		148 B			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		213 L			
Waste Class Name:		Petroleum distillates			
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		264 L			
Waste Class Name:		Photoprocessing wastes			
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		213 T			
Waste Class Name:		Petroleum distillates			
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		148 L			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
Waste Class:		146 L			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		331 L			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		212 B			
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		251 T			
Waste Class Name:		Waste oils/sludges (petroleum based)			
124	26 of 27	W/212.1	75.9 / -0.25	Ottawa Catholic District School Board Notre Dame High School 710 Broadview Avenue Ottawa ON K2A 2M2	GEN
Generator No:		ON5468196			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
Waste Class:		331 L			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
Waste Class:		212 B			
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		213 T			
Waste Class Name:		Petroleum distillates			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		264 L			
Waste Class Name:		Photoprocessing wastes			
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		148 I			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
Waste Class:		146 L			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
Waste Class:		148 C			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		148 L			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		263 B			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
Waste Class:		148 B			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		251 T			
Waste Class Name:		Waste oils/sludges (petroleum based)			
Waste Class:		213 L			
Waste Class Name:		Petroleum distillates			
Waste Class:		263 C			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			

[124](#)

27 of 27

W/212.1

75.9 / -0.25

Ottawa Catholic District School Board
Notre Dame High School 710 Broadview Avenue
Ottawa ON K2A 2M2

GEN

Generator No: ON5468196
SIC Code:
SIC Description:
Approval Years: As of Oct 2022
PO Box No:
Country: Canada
Status: Registered
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 122 C

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		331 L			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		263 C			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		121 C			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Class:		148 B			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		146 L			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		331 I			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		148 L			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		145 L			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		148 A			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		251 T			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		264 L			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		263 I			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		263 A			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		146 T			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		213 L			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		213 T			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		263 B			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		252 L			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		212 B			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		148 I			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		263 L			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		148 C			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		213 I			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		112 C			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		145 I			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			

125	1 of 1	E/213.6	76.8 / 0.68	861 CLYDE ST OTTAWA ON	WWIS
Well ID:	7155921			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	12/08/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z116189			Contractor:	7241
Tag:	A097278			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7155921.pdf				

Additional Detail(s) (Map)

Well Completed Date: 10/28/2010
Year Completed: 2010
Depth (m): 3.96
Latitude: 45.3773388640652
Longitude: -75.7487460956779
X: -75.74874593432627
Y: 45.37733885739227
Path: 715\7155921.pdf

Bore Hole Information

Bore Hole ID:	1003433950	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	441376.00
Code OB Desc:		North83:	5025142.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	10/28/2010	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003724094			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		1.8300000429153442			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003724095			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.8300000429153442			
Formation End Depth:		3.9600000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003724093			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003724106			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Plug From:		0.9100000262260437			
Plug To:		3.9600000381469727			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003724105			
Layer:		1			
Plug From:		0.0			
Plug To:		0.9100000262260437			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003724103			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003724092			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003724099			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.2200000286102295			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003724100			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.2200000286102295			
Screen End Depth:		3.9600000381469727			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
 <u>Water Details</u>					
Water ID:		1003724098			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1003724096			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1003724097			
Diameter:		5.710000038146973			
Depth From:		1.8200000524520874			
Depth To:		3.9600000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
126	1 of 1	E/213.9	76.8 / 0.69	ON	WWIS
Well ID:	7379167			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	01/27/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	C17619			Contractor:	7241
Tag:				Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008615679			Tag No:	
Depth M:				Contractor:	7241
Year Completed:	2020			Latitude:	45.3776355476388
Well Completed Dt:	11/27/2020			Longitude:	-75.748801099731
Audit No:	C17619			Y:	45.37763554121732
Path:				X:	-75.74880093812769
<u>Bore Hole Information</u>					
Bore Hole ID:	1008615679			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441372.00
Code OB Desc:				North83:	5025175.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/27/2020			UTMRC Desc:	margin of error : 30 m - 100 m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Location Method: WWR					
127	1 of 1	E/214.4	76.8 / 0.70	ON	WWIS
Well ID: 7379163 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C17615 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 01/27/2021 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map)					
Bore Hole ID: 1008615667 Depth M: Year Completed: 2020 Well Completed Dt: 11/27/2020 Audit No: C17615 Path:					
Tag No: Contractor: 7241 Latitude: 45.3778241407259 Longitude: -75.7488674496658 Y: 45.3778241341876 X: -75.74886728855488					
Bore Hole Information					
Bore Hole ID: 1008615667 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 11/27/2020 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 441367.00 North83: 5025196.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
128	1 of 2	SE/214.4	77.8 / 1.67	OTTAWA AWNING & CANVAS LTD	SCT

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				883 BOYD AVE OTTAWA ON K2A 2E2	
Established:		1960			
Plant Size (ft²):		10000			
Employment:		20			
--Details--					
Description:		CANVAS AND RELATED PRODUCTS			
SIC/NAICS Code:		2394			
Description:		SIGNS AND ADVERTISING SPECIALTIES			
SIC/NAICS Code:		3993			
128	2 of 2	SE/214.4	77.8 / 1.67	Ottawa Awning & Canvas Ltd. 883 Boyd Ave Ottawa ON K2A 2E2	SCT
Established:		01-AUG-60			
Plant Size (ft²):		10000			
Employment:					
--Details--					
Description:		Textile Bag and Canvas Mills			
SIC/NAICS Code:		314910			
Description:		Textile Bag and Canvas Mills			
SIC/NAICS Code:		314910			
129	1 of 2	E/214.7	76.8 / 0.69	861 CLYDE AVE Ottawa ON	WWIS
Well ID:	7245027			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	07/21/2015
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z208931			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/724\7245027.pdf				
Additional Detail(s) (Map)					
Well Completed Date:	06/08/2015				
Year Completed:	2015				
Depth (m):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:		45.3776266308059			
Longitude:		-75.7487882099553			
X:		-75.74878804820669			
Y:		45.377626624495335			
Path:		724\7245027.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1005496661			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441373.00
Code OB Desc:				North83:	5025174.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/08/2015			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1005649593				
Layer:	2				
Plug From:	1.2200000286102295				
Plug To:					
Plug Depth UOM:	m				
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1005649592				
Layer:	1				
Plug From:	0.0				
Plug To:	1.2200000286102295				
Plug Depth UOM:	m				
 <u>Method of Construction & Well Use</u>					
Method Construction ID:	1005649591				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:	1005649583				
Casing No:	0				
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:	1005649587				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:					
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1005649588			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
 <u>Water Details</u>					
Water ID:		1005649586			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1005649585			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
129	2 of 2	E/214.7	76.8 / 0.69	861 CLYDE AVE Ottawa ON	WWIS
Well ID:	7245028			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	07/21/2015
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z208928			Contractor:	6724
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1005496706			Tag No:	
Depth M:				Contractor:	6724
Year Completed:	2015			Latitude:	45.3776266308059
Well Completed Dt:	06/08/2015			Longitude:	-75.7487882099553
Audit No:	Z208928			Y:	45.377626624495335
Path:				X:	-75.74878804820669
<u>Bore Hole Information</u>					
Bore Hole ID:	1005496706			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441373.00
Code OB Desc:				North83:	5025174.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/08/2015			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1005649603				
Layer:	1				
Plug From:	0.0				
Plug To:					
Plug Depth UOM:	m				
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:	1005649602				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1005649594				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1005649598				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter: 3.450000047683716 Casing Diameter UOM: cm Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1005649599 Layer: Slot: Screen Top Depth: Screen End Depth: Screen Material: Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter:					
<u>Water Details</u>					
Water ID: 1005649597 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1005649596 Diameter: Depth From: Depth To: Hole Depth UOM: m Hole Diameter UOM: cm					
130	1 of 1	E/215.7	76.8 / 0.69	ON	WWIS
Well ID: 7379161 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C17616 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 01/27/2021 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008615661 Depth M:					
Tag No: Contractor: 7241					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:			Latitude:	45.3776716336029	
Well Completed Dt:			Longitude:	-75.7487888039524	
Audit No:	C17616		Y:	45.37767162707516	
Path:			X:	-75.74878864198908	
<u>Bore Hole Information</u>					
Bore Hole ID:	1008615661		Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:	18	
Code OB:			East83:	441373.00	
Code OB Desc:			North83:	5025179.00	
Open Hole:			Org CS:	UTM83	
Cluster Kind:			UTMRC:	4	
Date Completed:			UTMRC Desc:	margin of error : 30 m - 100 m	
Remarks:			Location Method:	wwr	
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
131	1 of 1	E/216.3	76.8 / 0.68	861 Clyde Avenue lot I con A Ottawa ON	WWIS
Well ID:	7337587		Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:	Monitoring and Test Hole		Data Entry Status:		
Use 2nd:			Data Src:		
Final Well Status:	Monitoring and Test Hole		Date Received:	05/28/2019	
Water Type:			Selected Flag:	TRUE	
Casing Material:			Abandonment Rec:		
Audit No:	Z311109		Contractor:	7241	
Tag:	A265339		Form Version:	7	
Constructn Method:			Owner:		
Elevation (m):			County:	OTTAWA-CARLETON	
Elevatn Reliabilty:			Lot:	I	
Depth to Bedrock:			Concession:	A	
Well Depth:			Concession Name:	OF	
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/733\7337587.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	04/01/2019				
Year Completed:	2019				
Depth (m):	4.95				
Latitude:	45.37726711074				
Longitude:	-75.7487068326676				
X:	-75.74870667167923				
Y:	45.37726710421576				
Path:	733\7337587.pdf				
<u>Bore Hole Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1007526921			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441379.00
Code OB Desc:				North83:	5025134.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/01/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007858740				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	73				
Material 2 Desc:	HARD				
Material 3:	68				
Material 3 Desc:	DRY				
Formation Top Depth:	0.9100000262260437				
Formation End Depth:	2.740000009536743				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007858741				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	26				
Material 1 Desc:	ROCK				
Material 2:	15				
Material 2 Desc:	LIMESTONE				
Material 3:	71				
Material 3 Desc:	FRACTURED				
Formation Top Depth:	2.740000009536743				
Formation End Depth:	4.949999809265137				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007858739				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	11				
Material 1 Desc:	GRAVEL				
Material 2:	28				
Material 2 Desc:	SAND				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007860155			
Layer:		3			
Plug From:		5.5			
Plug To:		14.800000190734863			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007860154			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		5.5			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007860153			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007861462			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007856971			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007861861			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.899999976158142			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1007862424			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.899999976158142			
Screen End Depth:		4.800000190734863			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007863136			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007861072			
Diameter:		8.5			
Depth From:		1.5			
Depth To:		4.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007861073			
Diameter:		20.799999237060547			
Depth From:		0.0			
Depth To:		1.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
132	1 of 1	E/217.3	76.8 / 0.70	861 CLYDE AVE Ottawa ON	WWIS
Well ID:	7220407			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Dewatering			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	0			Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z179384			Contractor:	7241
Tag:	A163211			Form Version:	7

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			NEPEAN TOWNSHIP	Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220407.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/11/2014			
Year Completed:		2014			
Depth (m):		6.1			
Latitude:		45.3778782278138			
Longitude:		-75.748855391512			
X:		-75.74885523046822			
Y:		45.37787822113935			
Path:		722\7220407.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1004764978		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				441368.00	
Open Hole:				East83:	
Cluster Kind:				5025202.00	
Date Completed:		04/11/2014		North83:	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005152927			
Layer:		2			
Color:		8			
General Color:		BLACK			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1005152928			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		74			
Material 3 Desc:		LAYERED			
Formation Top Depth:		2.130000114440918			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005152926			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005152936			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1005152937			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.0999999046325684			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1005152935			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005152925			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1005152932			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		8.25			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1005152933			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
 <u>Water Details</u>					
Water ID:		1005152931			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1005152929			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1005152930			
Diameter:		7.619999885559082			
Depth From:		3.0999999046325684			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
133	1 of 1	E/217.6	76.8 / 0.70	861 CLYDE AVE ON	WWIS
Well ID:	7220435			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z183176			Contractor:	7241
Tag:	A157754			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220435.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	04/10/2014				
Year Completed:	2014				
Depth (m):	3.35				
Latitude:	45.3778872283727				
Longitude:	-75.7488555103231				
X:	-75.74885534814673				
Y:	45.37788722111332				
Path:	722\7220435.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1004765787			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441368.00
Code OB Desc:				North83:	5025203.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/10/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005154458				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		2.130000114440918			
Formation End Depth:		3.3499999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005154457			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005154456			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154465			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154467			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154466			
Layer:		2			
Plug From:		0.3100000023841858			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005154464			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005154455			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005154462			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005154463			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		3.3499999046325684			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005154461			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005154459			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1005154460			
Diameter:		7.619999885559082			
Depth From:		2.440000057220459			
Depth To:		3.3499999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>134</u>	1 of 1	W/218.5	77.2 / 1.05	1845-1855 Carling Ave Ottawa ON K2A 1E4	EHS
Order No:	20051107006			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	11/15/2005			Search Radius (km):	0.25
Date Received:	11/7/2005			X:	-75.756711
Previous Site Name:				Y:	45.376511
Lot/Building Size:					
Additional Info Ordered:					
<u>135</u>	1 of 1	SSW/219.0	78.9 / 2.74	JOERNS HEALTHCARE INC 859 DENISON CRES,,OTTAWA,ON,K2A 2N4,CA ON	PINC
Incident Id:				Pipe Material:	
Incident No:	1746656			Fuel Category:	
Incident Reported Dt:	10/29/2015			Health Impact:	
Type:	FS-Pipeline Incident			Environment Impact:	
Status Code:				Property Damage:	
Tank Status:	Pipeline Damage Reason Est			Service Interrupt:	
Task No:				Enforce Policy:	
Spills Action Centre:				Public Relation:	
Fuel Type:				Pipeline System:	
Fuel Occurrence Tp:				PSIG:	
Date of Occurrence:				Attribute Category:	
Occurrence Start Dt:				Regulator Location:	
Depth:				Method Details:	
Customer Acct Name:	JOERNS HEALTHCARE INC				
Incident Address:	859 DENISON CRES,,OTTAWA,ON,K2A 2N4,CA				
Operation Type:					
Pipeline Type:					
Regulator Type:					
Summary:					
Reported By:					
Affiliation:					
Occurrence Desc:					
Damage Reason:					
Notes:					
<u>136</u>	1 of 2	E/220.1	76.8 / 0.70	861 CLYDE AVE Ottawa ON	WWIS
Well ID:	7220408			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z183177			Contractor:	7241

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag:	A159149			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220408.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/10/2014			
Year Completed:		2014			
Depth (m):		3.35			
Latitude:		45.377905396955			
Longitude:		-75.7488302058713			
X:		-75.74883004440863			
Y:		45.37790539016424			
Path:		722\7220408.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1004764981		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441370.00
Code OB Desc:				North83:	5025205.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		04/10/2014		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005153185			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005153186			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.130000114440918			
Formation End Depth:		3.3499999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005153184			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005153195			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005153197			
Layer:		3			
Plug From:		0.3100000023841858			
Plug To:		3.3499999046325684			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005153196			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Use</u>					
Method Construction ID:		1005153194			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005153183			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005153190			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005153191			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		3.3499999046325684			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005153189			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005153188			
Diameter:		7.619999885559082			
Depth From:		2.440000057220459			
Depth To:		3.3499999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005153187			
Diameter:		11.430000305175781			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
136	2 of 2	E/220.1	76.8 / 0.70	861 CKYDE AVE Ottawa ON	WWIS
Well ID:		7220437		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Test Hole		Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z183175		Contractor:	7241
Tag:		A156412		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220437.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/10/2014			
Year Completed:		2014			
Depth (m):		3.35			
Latitude:		45.377905396955			
Longitude:		-75.7488302058713			
X:		-75.74883004440863			
Y:		45.37790539016424			
Path:		722\7220437.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1004765793		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441370.00
Code OB Desc:				North83:	5025205.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		04/10/2014		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1005154485			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1005154486			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.130000114440918			
Formation End Depth:		3.3499999046325684			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1005154484			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1005154497			
Layer:		3			
Plug From:		1.5			
Plug To:		3.3499999046325684			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1005154495			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154496			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1005154494			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1005154483			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1005154490			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.83000000429153442			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1005154491			
Layer:		1			
Slot:					
Screen Top Depth:		1.83000000429153442			
Screen End Depth:		3.3499999046325684			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Water Details</u>					
Water ID:		1005154489			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1005154488			
Diameter:		7.619999885559082			
Depth From:		2.440000057220459			
Depth To:		3.3499999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005154487			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
137	1 of 1	SE/220.4	77.7 / 1.62	897 BOYD AVE OTTAWA ON	WWIS
Well ID:	7305656			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Observation Wells			Date Received:	02/13/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z268097			Contractor:	7241
Tag:	A182799			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7305656.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	12/18/2017				
Year Completed:	2017				
Depth (m):	13.72				
Latitude:	45.3755395413713				
Longitude:	-75.7499739666785				
X:	-75.74997380530144				
Y:	45.37553953416479				
Path:	730\7305656.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1006985505			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441278.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	5024943.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		12/18/2017		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007147666			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007147667			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:		74			
Material 3 Desc:		LAYERED			
Formation Top Depth:		2.130000114440918			
Formation End Depth:		13.720000267028809			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007147678			
Layer:		3			
Plug From:		10.0600004196167			
Plug To:		13.720000267028809			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007147676			
Layer:		1			
Plug From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007147677			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		10.0600004196167			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007147675			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007147665			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007147671			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.670000076293945			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007147672			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.670000076293945			
Screen End Depth:		13.720000267028809			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
 <u>Water Details</u>					
Water ID:		1007147670			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1007147668			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007147669			
Diameter:		7.619999885559082			
Depth From:		2.440000057220459			
Depth To:		13.720000267028809			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
138	1 of 1	E/221.4	76.8 / 0.70	861 CLYDE AVE Ottawa ON	WWIS
Well ID:	7220438			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z183174			Contractor:	7241
Tag:	A159148			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220438.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	04/10/2014				
Year Completed:	2014				
Depth (m):	3.35				
Latitude:	45.3778606453462				
Longitude:	-75.7487912987556				
X:	-75.74879113749205				
Y:	45.3778606382765				
Path:	722\7220438.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1004765825			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441373.00
Code OB Desc:				North83:	5025200.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/10/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005154501			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.130000114440918			
Formation End Depth:		3.3499999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005154499			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005154500			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154512			
Layer:		3			
Plug From:		1.5			
Plug To:		3.3499999046325684			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154510			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154511			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005154509			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005154498			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005154505			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005154506			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen End Depth:		3.3499999046325684			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005154504			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005154502			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1005154503			
Diameter:		7.619999885559082			
Depth From:		2.440000057220459			
Depth To:		3.3499999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

139	1 of 1	E/222.0	76.8 / 0.70	861 CLYDE AVE Ottawa ON	WWIS
Well ID:	7220436			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z183199			Contractor:	7241
Tag:	A157932			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220436.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	04/10/2014				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:		2014			
Depth (m):		3.35			
Latitude:		45.377905564414			
Longitude:		-75.7488046637972			
X:		-75.74880450261863			
Y:		45.377905557378504			
Path:		722\7220436.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1004765790			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441372.00
Code OB Desc:				North83:	5025205.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/10/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005154471				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	2.130000114440918				
Formation End Depth:	3.3499999046325684				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005154470				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.9100000262260437				
Formation End Depth:	2.130000114440918				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1005154469			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.91000000262260437			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154480			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154482			
Layer:		3			
Plug From:		1.5			
Plug To:		3.3499999046325684			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154481			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005154479			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005154468			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005154475			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1005154476			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		3.3499999046325684			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Water Details</u>					
Water ID:		1005154474			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1005154473			
Diameter:		7.619999885559082			
Depth From:		2.440000057220459			
Depth To:		3.3499999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1005154472			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>140</u>	1 of 1	WSW/223.2	77.8 / 1.71	1846 Carling Avenue Ottawa ON K2A 1E2	EHS
Order No:	24051100005			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	15-MAY-24			Search Radius (km):	.25
Date Received:	11-MAY-24			X:	-75.7566206
Previous Site Name:				Y:	45.3759167
Lot/Building Size:					
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
141	1 of 1	E/224.4	76.8 / 0.67	ON	WWIS
Well ID: 7379178 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C17621 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 01/28/2021 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008615712 Depth M: Year Completed: Well Completed Dt: Audit No: C17621 Path: Tag No: Contractor: 7241 Latitude: 45.376961593952 Longitude: -75.748626169064 Y: 45.376961587447745 X: -75.74862600751095					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008615712 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 441385.00 North83: 5025100.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

142	1 of 1	E/224.8	76.8 / 0.69	ON	WWIS
Well ID: 7379172 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C16077 Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 01/27/2021 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info: NEPEAN TOWNSHIP Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map)					
Bore Hole ID: 1008615694 Depth M: Year Completed: Well Completed Dt: Audit No: C16077 Path: Tag No: Contractor: 7241 Latitude: 45.3773757871472 Longitude: -75.7486060907445 Y: 45.37737578014953 X: -75.74860592923754					
Bore Hole Information					
Bore Hole ID: 1008615694 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 441387.00 North83: 5025146.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
143	1 of 1	E/224.9	76.8 / 0.69	861 CLYDE AVE OTTAWA ON	WWIS
Well ID: 7246037 Construction Date: Use 1st: Use 2nd: Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: Z208989 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 08/05/2015 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB		
Site Info:							
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/724\7246037.pdf						
Additional Detail(s) (Map)							
Well Completed Date:	06/26/2015						
Year Completed:	2015						
Depth (m):							
Latitude:	45.3773937882676						
Longitude:	-75.7486063282833						
X:	-75.74860616639116						
Y:	45.377393781517995						
Path:	724\7246037.pdf						
Bore Hole Information							
Bore Hole ID:	1005541362			Elevation:			
DP2BR:				Elevrc:			
Spatial Status:				Zone:	18		
Code OB:				East83:	441387.00		
Code OB Desc:				North83:	5025148.00		
Open Hole:				Org CS:	UTM83		
Cluster Kind:				UTMRC:	4		
Date Completed:	06/26/2015			UTMRC Desc:	margin of error : 30 m - 100 m		
Remarks:				Location Method:	wwr		
Location Method Desc:	on Water Well Record						
Elevrc Desc:							
Location Source Date:							
Improvement Location Source:							
Improvement Location Method:							
Source Revision Comment:							
Supplier Comment:							
Annular Space/Abandonment							
Sealing Record							
Plug ID:	1005692039						
Layer:	1						
Plug From:	0.0						
Plug To:	3.0						
Plug Depth UOM:	ft						
Method of Construction & Well							
Use							
Method Construction ID:	1005692038						
Method Construction Code:							
Method Construction:							
Other Method Construction:							
Pipe Information							
Pipe ID:	1005692032						
Casing No:	0						
Comment:							
Alt Name:							
Construction Record - Casing							
Casing ID:	1005692036						

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer: Material: Open Hole or Material: Depth From: Depth To: Casing Diameter: Casing Diameter UOM: inch Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1005692037 Layer: 1 Slot: 10 Screen Top Depth: 0.0 Screen End Depth: 3.0 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter: 1.659999966621399					
<u>Water Details</u>					
Water ID: 1005692035 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1005692034 Diameter: Depth From: Depth To: Hole Depth UOM: ft Hole Diameter UOM: inch					
144	1 of 1	SE/225.0	77.7 / 1.62	897 Boyd Ave Ottawa ON K2A2E2	EHS
Order No: 20171208021 Status: C Report Type: Standard Report Report Date: 13-DEC-17 Date Received: 08-DEC-17 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.749971 Y: 45.375492					
145	1 of 1	E/225.2	76.8 / 0.69	ON	WWIS
Well ID: 7235388 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 01/12/2015 Selected Flag: TRUE Abandonment Rec: Yes					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:	C16210			Contractor:	7241
Tag:				Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
 <u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1005279737			Tag No:	
Depth M:				Contractor:	7241
Year Completed:	2014			Latitude:	45.3775646314942
Well Completed Dt:	11/25/2014			Longitude:	-75.7486341268352
Audit No:	C16210			Y:	45.37756462449355
Path:				X:	-75.74863396563222
 <u>Bore Hole Information</u>					
Bore Hole ID:	1005279737			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441385.00
Code OB Desc:				North83:	5025167.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/25/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
146	1 of 1	SSW/225.2	78.9 / 2.74	ON	WWIS
Well ID:	1508085			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	08/05/1954
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	3725
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508085.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/28/1954			
Year Completed:		1954			
Depth (m):		38.1			
Latitude:		45.3747838174296			
Longitude:		-75.7540163547029			
X:		-75.75401619316037			
Y:		45.3747838099787			
Path:		150\1508085.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10030120	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		18
Code OB:			East83:		440960.70
Code OB Desc:			North83:		5024862.00
Open Hole:			Org CS:		
Cluster Kind:			UTMRC:		9
Date Completed:		07/28/1954	UTMRC Desc:		unknown UTM
Remarks:			Location Method:		p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008758			
Layer:		4			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		72.0			
Formation End Depth:		125.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008755			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008756			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0			
Formation End Depth:		31.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008757			
Layer:		3			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		31.0			
Formation End Depth:		72.0			
Formation End Depth UOM:		ft			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508085			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		10578690			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930052898			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:					
Depth To:		125.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052897			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		20.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508085			
Pump Set At:					
Static Level:		10.0			
Final Level After Pumping:		14.0			
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462452			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		39.0			
Water Found Depth UOM:		ft			
147	1 of 2	E/225.3	76.8 / 0.69	861 CLYDE AV. Ottawa ON	WWIS
Well ID:		7326561		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Other		Data Src:	
Final Well Status:		Test Hole		Date Received:	12/11/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z229537		Contractor:	7241
Tag:		A257538		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			NEPEAN TOWNSHIP	Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7326561.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/12/2018			
Year Completed:		2018			
Depth (m):		5.0292			
Latitude:		45.377249863007			
Longitude:		-75.7485916570889			
X:		-75.74859149512302			
Y:		45.377249856226285			
Path:		732\7326561.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007343910		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441388.00
Code OB Desc:				North83:	5025132.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		10/12/2018		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007713640			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		10.0			
Formation End Depth:		16.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007713637			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007713639			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		9.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007713638			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.0			
Formation End Depth:		9.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007713906			
Layer:		4			
Plug From:		11.0			
Plug To:		12.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007713904			
Layer:		2			
Plug From:		1.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		2.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713903			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713907			
Layer:		5			
Plug From:		12.0			
Plug To:		16.5			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713905			
Layer:		3			
Plug From:		2.0			
Plug To:		11.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007714270			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007713361			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007714361			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		12.5			
Casing Diameter:		1.2799999713897705			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007714460			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Slot:		10			
Screen Top Depth:		12.5			
Screen End Depth:		16.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
 <u>Hole Diameter</u>					
Hole ID:		1007714153			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		10.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
 <u>Hole Diameter</u>					
Hole ID:		1007714154			
Diameter:		2.375			
Depth From:		10.0			
Depth To:		16.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
147	2 of 2	E/225.3	76.8 / 0.69	ON	WWIS
Well ID:	7379175			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	01/27/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	C17639			Contractor:	7241
Tag:				Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
 <u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008615703			Tag No:	
Depth M:				Contractor:	7241
Year Completed:				Latitude:	45.377249863007
Well Completed Dt:				Longitude:	-75.7485916570889
Audit No:	C17639			Y:	45.377249856226285
Path:				X:	-75.74859149512302
 <u>Bore Hole Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1008615703			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441388.00
Code OB Desc:				North83:	5025132.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:				UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Additional Detail(s) (Map)

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
149	1 of 1	E/225.6	76.8 / 0.69	861 CLYDE AVENUE Ottawa ON	WWIS
Well ID: 7271919 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z233046 Tag: A191192 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/727\7271919.pdf					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 09/22/2016 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map) Well Completed Date: 08/10/2016 Year Completed: 2016 Depth (m): 2.59 Latitude: 45.3773398686106 Longitude: -75.7485928447571 X: -75.74859268358611 Y: 45.37733986194986 Path: 727\7271919.pdf					
Bore Hole Information Bore Hole ID: 1006251939 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 08/10/2016 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 441388.00 North83: 5025142.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006338494			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		2.5899999141693115			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006338493			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006338492			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006338503			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.9800000190734863			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1006338502			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006338504			
Layer:		3			
Plug From:		1.9800000190734863			
Plug To:		2.5899999141693115			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006338501			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006338491			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006338497			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.2799999713897705			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006338498			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.2799999713897705			
Screen End Depth:		2.5899999141693115			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1006338496			
Layer:					
Kind Code:					
Kind:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006338495			
Diameter:		8.5			
Depth From:		0.0			
Depth To:		2.5899999141693115			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

150	1 of 1	E/227.0	76.8 / 0.69	ON	WWIS
Well ID: 7379171					
Construction Date:					
Use 1st:					
Use 2nd:					
Final Well Status:					
Water Type:					
Casing Material:					
Audit No: C17606		Flowing (Y/N):			
Tag:		Flow Rate:			
Constructn Method:		Data Entry Status: Yes			
Elevation (m):		Data Src:			
Elevatn Reliabilty:		Date Received: 01/27/2021			
Depth to Bedrock:		Selected Flag: TRUE			
Well Depth:		Abandonment Rec: Yes			
Overburden/Bedrock:		Contractor: 7241			
Pump Rate:		Form Version: 8			
Static Water Level:		Owner:			
Clear/Cloudy:		County: OTTAWA-CARLETON			
Municipality: NEPEAN TOWNSHIP		Lot:			
Site Info:		Concession:			
		Concession Name:			
		Easting NAD83:			
		Northing NAD83:			
		Zone:			
		UTM Reliability:			

Additional Detail(s) (Map)

Bore Hole ID: 1008615691		Tag No:	
Depth M:		Contractor: 7241	
Year Completed:		Latitude: 45.3774928781333	
Well Completed Dt:		Longitude: -75.748594863806	
Audit No: C17606		Y: 45.377492870972446	
Path:		X: -75.74859470208689	

Bore Hole Information

Bore Hole ID: 1008615691		Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone: 18	
Code OB:		East83: 441388.00	
Code OB Desc:		North83: 5025159.00	
Open Hole:		Org CS: UTM83	
Cluster Kind:		UTMRC: 4	
Date Completed:		UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:		Location Method: wwr	
Location Method Desc: on Water Well Record			
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
151	1 of 1	NW/227.2	74.8 / -1.29	ON	WWIS
Well ID:		1508302	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Domestic	Data Entry Status:		
Use 2nd:		0	Data Src:		1
Final Well Status:		Water Supply	Date Received:		01/15/1951
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:			Contractor:		5448
Tag:			Form Version:		1
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508302.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		12/27/1950			
Year Completed:		1950			
Depth (m):		23.7744			
Latitude:		45.379461572862			
Longitude:		-75.7544617042593			
X:		-75.7544615422991			
Y:		45.379461566275644			
Path:		150\1508302.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10030337	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		18
Code OB:			East83:		440930.70
Code OB Desc:			North83:		5025382.00
Open Hole:			Org CS:		
Cluster Kind:			UTMRC:		9
Date Completed:		12/27/1950	UTMRC Desc:		unknown UTM
Remarks:			Location Method:		p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931009317			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		13.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931009318			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		13.0			
Formation End Depth:		78.0			
Formation End Depth UOM:		ft			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508302			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		10578907			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930053329			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		78.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Casing</u>					
Casing ID:		930053328			
Layer:		1			
Material:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		14.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508302			
Pump Set At:					
Static Level:		15.0			
Final Level After Pumping:		25.0			
Recommended Pump Depth:					
Pumping Rate:		5.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		0			
Pumping Duration MIN:		30			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462744			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		78.0			
Water Found Depth UOM:		ft			

152	1 of 1	WSW/227.8	77.8 / 1.71	PIPELINE HIT 1848 CARLING AVENUE,,OTTAWA,ON,K2A 1E3, CA ON	PINC
Incident Id:					
Incident No:		1462020			Pipe Material:
Incident Reported Dt:		8/20/2014			Fuel Category:
Type:		FS-Pipeline Incident			Health Impact:
Status Code:					Environment Impact:
Tank Status:		Non Mandated			Property Damage:
Task No:					Service Interrupt:
Spills Action Centre:					Enforce Policy:
Fuel Type:					Public Relation:
Fuel Occurrence Tp:					Pipeline System:
Date of Occurrence:					PSIG:
Occurrence Start Dt:					Attribute Category:
Depth:					Regulator Location:
Customer Acct Name:		PIPELINE HIT			Method Details:
Incident Address:		1848 CARLING AVENUE,,OTTAWA,ON,K2A 1E3,CA			
Operation Type:					
Pipeline Type:					
Regulator Type:					
Summary:					
Reported By:					
Affiliation:					
Occurrence Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Damage Reason: Notes:					
153	1 of 1	SE/229.3	77.8 / 1.69	883 & 891 Boyd Avenue Ottawa ON	EHS
Order No: 20100108038 Status: C Report Type: Custom Report Report Date: 1/15/2010 Date Received: 1/8/2010 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.74998 Y: 45.375432			
154	1 of 1	SE/229.3	78.1 / 2.01	LUMI-LUX LTD 890 BOYD AVE OTTAWA ON K2A 2E3	SCT
Established: 1988 Plant Size (ft²): 0 Employment: 6					
<u>--Details--</u>					
Description:		ELECTRICAL APPARATUS & CONSTRUCTION MATERIALS			
SIC/NAICS Code:		5063			
155	1 of 1	E/229.9	76.8 / 0.69	861 CLYDE AVE Ottawa ON	WWIS
Well ID: 7245029 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: Z208929 Tag: A172177 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:		Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 07/21/2015 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/724\7245029.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 06/08/2015 Year Completed: 2015 Depth (m): Latitude: 45.3774841286787					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Longitude:		-75.7485564322093			
X:		-75.74855627037587			
Y:		45.37748412207444			
Path:		724\7245029.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1005496709			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441391.00
Code OB Desc:				North83:	5025158.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/08/2015			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1005649625				
Layer:	1				
Plug From:	0.0				
Plug To:	1.8300000429153442				
Plug Depth UOM:	m				
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1005649626				
Layer:	2				
Plug From:	1.8300000429153442				
Plug To:					
Plug Depth UOM:	m				
 <u>Method of Construction & Well Use</u>					
Method Construction ID:	1005649624				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:	1005649616				
Casing No:	0				
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:	1005649620				
Layer:	1				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		4.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005649621			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1005649619			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005649618			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

156	1 of 1	NE/229.9	77.8 / 1.69	lot 29 con 1 ON	WWIS
Well ID:	1503963			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	08/08/1951
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	3725
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	029
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	OF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY (NEPEAN)				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1503963.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	01/15/1949				
Year Completed:	1949				
Depth (m):	88.392				
Latitude:	45.3798485179625				
Longitude:	-75.7503796250951				
X:	-75.75037946332215				
Y:	45.379848511209595				
Path:	150\1503963.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	10026006	Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone:		18	
Code OB:		East83:		441250.70	
Code OB Desc:		North83:		5025422.00	
Open Hole:		Org CS:			
Cluster Kind:		UTMRC:		9	
Date Completed:	01/15/1949	UTMRC Desc:		unknown UTM	
Remarks:		Location Method:		p9	
Location Method Desc:	Original Pre1985 UTM Rel Code 9: unknown UTM				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	930998042				
Layer:	4				
Color:					
General Color:					
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	200.0				
Formation End Depth:	290.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	930998040				
Layer:	2				
Color:	3				
General Color:	BLUE				
Material 1:	17				
Material 1 Desc:	SHALE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		5.0			
Formation End Depth:		95.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		930998039			
Layer:		1			
Color:					
General Color:					
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		930998041			
Layer:		3			
Color:		1			
General Color:		WHITE			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		95.0			
Formation End Depth:		200.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961503963			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10574576			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930044746			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		290.0			
Casing Diameter:		6.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930044745			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		14.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991503963			
Pump Set At:					
Static Level:		28.0			
Final Level After Pumping:		90.0			
Recommended Pump Depth:					
Pumping Rate:		2.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		2			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933456997			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		90.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		933456998			
Layer:		2			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		150.0			
Water Found Depth UOM:		ft			
<u>157</u>	1 of 1	NE/230.0	77.8 / 1.69	ON	BORE
Borehole ID:		612853		Inclin FLG:	No
OGF ID:		215514159		SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:		Borehole		Piezometer:	No
Use:				Primary Name:	
Completion Date:		JAN-1949		Municipality:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: 88.4 Depth Ref: Ground Surface Depth Elev: Drill Method: Orig Ground Elev m: 76.2 Elev Reliabil Note: DEM Ground Elev m: 77.5 Concession: Location D: Survey D: Comments:				Lot: Township: Latitude DD: 45.37985 Longitude DD: -75.75038 UTM Zone: 18 Easting: 441251 Northing: 5025422 Location Accuracy: Accuracy: Not Applicable	
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218392724 Top Depth: 0 Bottom Depth: 1.5 Material Color: Material 1: Sand Material 2: Gravel Material 3: Material 4: Gsc Material Description: Stratum Description: SAND.				Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: 218392726 Top Depth: 29 Bottom Depth: 61 Material Color: White Material 1: Limestone Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: LIMESTONE. WHITE.				Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: 218392725 Top Depth: 1.5 Bottom Depth: 29 Material Color: Blue Material 1: Shale Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: SHALE. BLUE.				Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	
Geology Stratum ID: 218392727 Top Depth: 61 Bottom Depth: 88.4 Material Color: Material 1: Limestone Material 2: Material 3: Material 4: Gsc Material Description: Stratum Description: LIMESTONE. 00150TILL. DENSE. TILL. VERY DENSE. IFIED. DENSE. TILL. VERY DENSE. BEDR **Note: Many records provided by the department have a truncated [Stratum Description] field.				Mat Consistency: Dense Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:	

Source

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Type:		Data Survey		Source Appl:	Spatial/Tabular
Source Orig:		Geological Survey of Canada		Source Iden:	1
Source Date:		1956-1972		Scale or Res:	Varies
Confidence:				Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: OTTAWA2.txt RecordID: 05361 NTS_Sheet:			
Confiden 1:					
Source List					
Source Identifier:		1		Horizontal Datum:	NAD27
Source Type:		Data Survey		Vertical Datum:	Mean Average Sea Level
Source Date:		1956-1972		Projection Name:	Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
158	1 of 1	E/231.1	76.8 / 0.69	861 CLYDE RD OTTAWA ON	WWIS
Well ID:		7155923		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	12/08/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z120965		Contractor:	7241
Tag:		A104566		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7155923.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		10/26/2010			
Year Completed:		2010			
Depth (m):		2.44			
Latitude:		45.3774122915933			
Longitude:		-75.748529940262			
X:		-75.74852977817471			
Y:		45.3774122851589			
Path:		715\7155923.pdf			
Bore Hole Information					
Bore Hole ID:		1003433954		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441393.00
Code OB Desc:				North83:	5025150.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	10/26/2010			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003724122			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003724123			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		1.5			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003724133			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003724134			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		0.9100000262260437			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003724132			
Layer:		1			
Plug From:					
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003724135			
Layer:		3			
Plug From:		0.9100000262260437			
Plug To:		2.440000057220459			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003724130			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003724121			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003724126			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		0.9100000262260437			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003724127			
Layer:		1			
Slot:		10			
Screen Top Depth:		0.9100000262260437			
Screen End Depth:		2.440000057220459			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1003724125			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
<u>Hole Diameter</u>					
Hole ID:		1003724124			
Diameter:		5.710000038146973			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
159	1 of 1	WNW/231.4	74.9 / -1.26	ON	WWIS
Well ID:	1507935			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	08/08/1951
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	3725
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1507935.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/28/1950				
Year Completed:	1950				
Depth (m):	24.384				
Latitude:	45.3790047921168				
Longitude:	-75.7554774203617				
X:	-75.75547725810995				
Y:	45.37900478516747				
Path:	150\1507935.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	10029970			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440850.70
Code OB Desc:				North83:	5025332.00
Open Hole:				Org CS:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:				UTMRC:	9
Date Completed:	08/28/1950			UTMRC Desc:	unknown UTM
Remarks:				Location Method:	p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008392			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008393			
Layer:		2			
Color:					
General Color:					
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		10.0			
Formation End Depth:		19.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008394			
Layer:		3			
Color:		3			
General Color:		BLUE			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		19.0			
Formation End Depth:		80.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:	961507935				
Method Construction Code:	1				
Method Construction:	Cable Tool				
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	10578540				
Casing No:	1				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	930052591				
Layer:	1				
Material:	1				
Open Hole or Material:	STEEL				
Depth From:					
Depth To:	23.0				
Casing Diameter:	6.0				
Casing Diameter UOM:	inch				
Casing Depth UOM:	ft				
<u>Construction Record - Casing</u>					
Casing ID:	930052592				
Layer:	2				
Material:	4				
Open Hole or Material:	OPEN HOLE				
Depth From:					
Depth To:	80.0				
Casing Diameter:	6.0				
Casing Diameter UOM:	inch				
Casing Depth UOM:	ft				
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	991507935				
Pump Set At:					
Static Level:	7.0				
Final Level After Pumping:	11.0				
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:	No				
<u>Water Details</u>					
Water ID:	933462234				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:	1				
Kind Code:	1				
Kind:	FRESH				
Water Found Depth:	60.0				
Water Found Depth UOM:	ft				
160	1 of 1	WNW/231.5	74.9 / -1.26	ON	BORE
Borehole ID:	612844			Inclin FLG:	No
OGF ID:	215514150			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	AUG-1950			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.379006
Total Depth m:	24.4			Longitude DD:	-75.755478
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	440851
Drill Method:				Northing:	5025332
Orig Ground Elev m:	76.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	74.6				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218392687			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	CLAY.				
Geology Stratum ID:	218392688			Mat Consistency:	
Top Depth:	3			Material Moisture:	
Bottom Depth:	5.8			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Gravel			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	GRAVEL.				
Geology Stratum ID:	218392689			Mat Consistency:	Compact
Top Depth:	5.8			Material Moisture:	
Bottom Depth:	24.4			Material Texture:	
Material Color:	Blue			Non Geo Mat Type:	
Material 1:	Shale			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SHALE. BLUE. 00060FEET.LL. COMPACT. BEDROCK. ERED, WATER STABLE AT 220.0 FEET.TILL.				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:				Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: OTTAWA2.txt RecordID: 05352 NTS_Sheet:				
Confiden 1:					
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
161	1 of 1	ESE/231.7	76.8 / 0.64	ON	BORE
Borehole ID:	612805			Inclin FLG:	No
OGF ID:	215514111			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:				Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.37653
Total Depth m:	-999			Longitude DD:	-75.748676
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	441381
Drill Method:				Northing:	5025052
Orig Ground Elev m:	77.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.3				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218392575			Mat Consistency:	Hard
Top Depth:	2.1			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. AY. BROWN,GREY,HARD,FISSURED. CLAY. BROWN,GREY,VERY SOFT. CLAY. GREY,SOFT. UNSPE **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218392574			Mat Consistency:	Firm
Top Depth:	1.8			Material Moisture:	
Bottom Depth:	2.1			Material Texture:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		TILL. FIRM.			
Geology Stratum ID:	218392572			Mat Consistency:	Soft
Top Depth:	0			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		CLAY. BROWN,SOFT.			
Geology Stratum ID:	218392573			Mat Consistency:	Firm
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	1.8			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		CLAY. FIRM.			
 Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	H			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: OTTAWA2.txt RecordID: 053130 NTS_Sheet: 31G05G				
Confiden 1:	Logged by professional. Exact and complete description of material and properties.				
 Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
162	1 of 1	SW/232.6	78.9 / 2.77	ON	WWIS
Well ID:	1508091			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	03/24/1955
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	3718
Tag:				Form Version:	1
Constructn Method:				Owner:	

455 erisinfo.com | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		931008787			
Layer:		3			
Color:					
General Color:					
Material 1:		18			
Material 1 Desc:		SANDSTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		60.0			
Formation End Depth:		140.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008786			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		8.0			
Formation End Depth:		60.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508091			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578696			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052909			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		20.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052910			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		140.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508091			
Pump Set At:					
Static Level:		10.0			
Final Level After Pumping:		10.0			
Recommended Pump Depth:					
Pumping Rate:		100.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
 <u>Water Details</u>					
Water ID:		933462458			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		60.0			
Water Found Depth UOM:		ft			
163	1 of 1	E/232.8	76.8 / 0.70	861 CLYDE AVE Ottawa ON	WWIS
Well ID:	7183403			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	05/10/2012
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z145306			Contractor:	7241
Tag:	A126550			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7183403.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Additional Detail(s) (Map)

Well Completed Date: 02/07/2012
Year Completed: 2012
Depth (m): 11.89
Latitude: 45.3779424038597
Longitude: -75.7486774285548
X: -75.74867726707743
Y: 45.3779423971051
Path: 718\7183403.pdf

Bore Hole Information

Bore Hole ID:	1004194876	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	441382.00
Code OB Desc:		North83:	5025209.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	02/07/2012	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID: 1004397523
Layer: 4
Color: 8
General Color: BLACK
Material 1: 17
Material 1 Desc: SHALE
Material 2:
Material 2 Desc:
Material 3: 74
Material 3 Desc: LAYERED
Formation Top Depth: 3.9600000381469727
Formation End Depth: 4.880000114440918
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1004397520
Layer: 1
Color: 8
General Color: BLACK
Material 1:
Material 1 Desc:
Material 2: 11
Material 2 Desc: GRAVEL
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004397524			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		74			
Material 3 Desc:		LAYERED			
Formation Top Depth:		4.880000114440918			
Formation End Depth:		7.920000076293945			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004397522			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		71			
Material 3 Desc:		FRACTURED			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		3.9600000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004397521			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		12			
Material 2 Desc:		STONES			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004397526			
Layer:		7			
Color:		2			
General Color:		GREY			
Material 1:		15			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		LIMESTONE			
Material 2:		71			
Material 2 Desc:		FRACTURED			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		10.970000267028809			
Formation End Depth:		11.890000343322754			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004397525			
Layer:		6			
Color:		8			
General Color:		BLACK			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:		74			
Material 2 Desc:		LAYERED			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		7.920000076293945			
Formation End Depth:		10.970000267028809			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004397535			
Layer:		1			
Plug From:		9.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004397537			
Layer:		3			
Plug From:		10.0600004196167			
Plug To:		11.890000343322754			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1004397536			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.059999942779541			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1004397534			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1004397519			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004397530			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.359999656677246			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004397531			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.359999656677246			
Screen End Depth:		11.890000343322754			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1004397529			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004397528			
Diameter:		6.349999904632568			
Depth From:		2.440000057220459			
Depth To:		11.890000343322754			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1004397527			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
164	1 of 1	E/233.0	76.8 / 0.69	861 CLYDE AVE Ottawa ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7172122			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/22/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z140234			Contractor:	7241
Tag:	A106786			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/717/7172122.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	10/23/2011				
Year Completed:	2011				
Depth (m):	4.88				
Latitude:	45.3774933803316				
Longitude:	-75.748518238136				
X:	-75.74851807671682				
Y:	45.377493373249855				
Path:	717/7172122.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003610415			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441394.00
Code OB Desc:				North83:	5025159.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	10/23/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004091132				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:	73				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:		HARD			
Material 3:		71			
Material 3 Desc:		FRACTURED			
Formation Top Depth:		2.740000009536743			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004091131			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		2.740000009536743			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004091143			
Layer:		3			
Plug From:		0.9100000262260437			
Plug To:		3.0999999046325684			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004091142			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		0.9100000262260437			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004091141			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004091140			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID:		1004091130			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004091136			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.3499999046325684			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1004091137			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.3499999046325684			
Screen End Depth:		4.880000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
 <u>Water Details</u>					
Water ID:		1004091135			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1004091133			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		2.740000009536743			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1004091134			
Diameter:		5.710000038146973			
Depth From:		2.740000009536743			
Depth To:		4.880000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
165	1 of 1	E/233.0	76.8 / 0.69	ON	WWIS
Well ID:	7379177			Flowing (Y/N):	
Construction Date:				Flow Rate:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C16076 Tag: Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:				Data Entry Status: Yes Data Src: Date Received: 01/27/2021 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008615709 Depth M: Year Completed: Well Completed Dt: Audit No: C16076 Path:				Tag No: Contractor: 7241 Latitude: 45.3774034584233 Longitude: -75.7485042796548 Y: 45.377403451063046 X: -75.74850411870618	
<u>Bore Hole Information</u>					
Bore Hole ID: 1008615709 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:				Elevation: Elevrc: Zone: 18 East83: 441395.00 North83: 5025149.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr	
166	1 of 1	E/233.1	76.8 / 0.69	861 CLYDE AVE Ottawa ON	WWIS
Well ID: 7172118 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z140237 Tag: A094089 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock:				Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 11/22/2011 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			OTTAWA CITY	Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/717\7172118.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		10/15/2011			
Year Completed:		2011			
Depth (m):		4.27			
Latitude:		45.3774124589837			
Longitude:		-75.7485043984081			
X:		-75.74850423638469			
Y:		45.37741245237461			
Path:		717\7172118.pdf			
Bore Hole Information					
Bore Hole ID:		1003610407		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441395.00
Code OB Desc:				North83:	5025150.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		10/15/2011		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1004090800			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		71			
Material 3 Desc:		FRACTURED			
Formation Top Depth:		2.440000057220459			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
Overburden and Bedrock					
Materials Interval					
Formation ID:		1004090799			
Laver:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004090810			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004090811			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004090809			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004090808			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004090798			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004090804			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		3.0999999046325684			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004090805			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		4.269999980926514			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1004090803			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004090801			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1004090802			
Diameter:		5.710000038146973			
Depth From:		2.440000057220459			
Depth To:		4.269999980926514			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
167	1 of 1	E/233.3	76.8 / 0.70	861 CLYDE AVE. OTTAWA ON	WWIS
Well ID:	7246035			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	08/05/2015
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z208988			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):				https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/724\7246035.pdf	
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		06/26/2015			
Year Completed:		2015			
Depth (m):					
Latitude:		45.3775743016764			
Longitude:		-75.7485320779048			
X:		-75.74853191615063			
Y:		45.37757429527138			
Path:		724\7246035.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1005541345		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441393.00
Code OB Desc:				North83:	5025168.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		06/26/2015		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005691527			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005691521			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005691525			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005691526			
Layer:		1			
Slot:		10			
Screen Top Depth:		0.0			
Screen End Depth:		5.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
<u>Water Details</u>					
Water ID:		1005691524			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1005691523			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

1681 of 1E/234.276.8 / 0.66ONWWIS

Well ID:7267056

Construction Date:

Use 1st:

Use 2nd:

Final Well Status:

Water Type:

Casing Material:

Audit No:C12370

Tag:A165687

Constructn Method:

Elevation (m):

Elevatn Reliabilty:

Depth to Bedrock:

Well Depth:

Overburden/Bedrock:

Pump Rate:

Static Water Level:

Clear/Cloudy:

Municipality:OTTAWA CITY

Site Info:

Flowing (Y/N):

Flow Rate:

Data Entry Status:Yes

Data Src:

Date Received:10/16/2015

Selected Flag:TRUE

Abandonment Rec:

Contractor:7241

Form Version:6

Owner:

County:OTTAWA-CARLETON

Lot:

Concession:

Concession Name:

Easting NAD83:

Northing NAD83:

Zone:

UTM Reliability:

Additional Detail(s) (Map)

Bore Hole ID:1006176696

Depth M:

Year Completed:2015

Tag No:A165687

Contractor:7241

Latitude:45.3769083438882

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Dt:	08/20/2015			Longitude:	-75.7485105191208
Audit No:	C12370			Y:	45.376908336967226
Path:				X:	-75.74851035754581
<u>Bore Hole Information</u>					
Bore Hole ID:	1006176696			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441394.00
Code OB Desc:				North83:	5025094.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/20/2015			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

169	1 of 1	E/234.3	76.8 / 0.69	861 CLYDE AVE. OTTAWA ON	WWIS
Well ID:	7246036			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	08/05/2015
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z208987			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/724\7246036.pdf				

Additional Detail(s) (Map)

Well Completed Date: 06/26/2015
Year Completed: 2015
Depth (m):
Latitude: 45.3774395443578
Longitude: -75.7484919837354
X: -75.74849182256759
Y: 45.37743953706899
Path: 724\7246036.pdf

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1005541348			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441396.00
Code OB Desc:				North83:	5025153.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	06/26/2015			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1005691573				
Layer:	1				
Plug From:	0.0				
Plug To:	5.0				
Plug Depth UOM:	ft				
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:	1005691572				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:	1005691566				
Casing No:	0				
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:	1005691570				
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:	inch				
Casing Depth UOM:	ft				
 <u>Construction Record - Screen</u>					
Screen ID:	1005691571				
Layer:	1				
Slot:	10				
Screen Top Depth:	0.0				
Screen End Depth:	5.0				
Screen Material:	5				
Screen Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
<u>Water Details</u>					
Water ID:		1005691569			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1005691568			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
170	1 of 1	E/234.4	76.8 / 0.70	861 CLYDE AVE Ottawa ON	WWIS
Well ID:		7172119		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Test Hole		Date Received: 11/22/2011	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z140235		Contractor: 7241	
Tag:		A106788		Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/717/7172119.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/16/2011			
Year Completed:		2011			
Depth (m):		4.27			
Latitude:		45.377754061775			
Longitude:		-75.748572766096			
X:		-75.74857260441436			
Y:		45.3777540550358			
Path:		717/7172119.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003610409		Elevation:	
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	441390.00
Code OB Desc:				North83:	5025188.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		10/16/2011	UTMRC Desc:		margin of error : 10 - 30 m
Remarks:		Location Method:		wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004090911			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:		60			
Material 3 Desc:		CEMENTED			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004090912			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004090913			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		2.130000114440918			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004090922			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004090924			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004090923			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004090921			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004090910			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004090917			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.740000009536743			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004090918			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer: 1 Slot: 10 Screen Top Depth: 2.740000009536743 Screen End Depth: 4.269999980926514 Screen Material: 5 Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter: 4.210000038146973					
<u>Water Details</u>					
Water ID: 1004090916 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1004090914 Diameter: 8.25 Depth From: 0.0 Depth To: 2.130000114440918 Hole Depth UOM: m Hole Diameter UOM: cm					
<u>Hole Diameter</u>					
Hole ID: 1004090915 Diameter: 5.710000038146973 Depth From: 2.130000114440918 Depth To: 4.269999980926514 Hole Depth UOM: m Hole Diameter UOM: cm					
171	1 of 2	SE/234.9	77.7 / 1.62	The Growcer 891 Boyd Avenue Ottawa ON K2A 2E2	GEN
Generator No: ON9982410 SIC Code: SIC Description: Approval Years: As of Oct 2022 PO Box No: Country: Canada Status: Registered Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 263 L Waste Class Name: ORGANIC LABORATORY CHEMICALS					
171	2 of 2	SE/234.9	77.7 / 1.62	891 Boyd Ave Ottawa ON K2A 2E2	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 23100600470 Status: C Report Type: Standard Report Report Date: 12-OCT-23 Date Received: 06-OCT-23 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7500604 Y: 45.3756054					
172	1 of 1	E/235.0	76.8 / 0.70	ON	WWIS
Well ID: 7379164 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C17614 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 01/27/2021 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008615670 Depth M: Year Completed: 2020 Well Completed Dt: 11/27/2020 Audit No: C17614 Path:					
Tag No: Contractor: 7241 Latitude: 45.3779515718438 Longitude: -75.7486520052421 Y: 45.377951565544976 X: -75.74865184296591					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008615670 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 11/27/2020 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 441384.00 North83: 5025210.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
173	1 of 1	E/235.3	76.8 / 0.67	861 CLYDE AVE Ottawa ON	WWIS
Well ID:7172120 Construction Date: Use 1st:Monitoring and Test Hole Use 2nd:0 Final Well Status:Test Hole Water Type: Casing Material: Audit No:Z134361 Tag:A094090 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality:OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received:11/22/2011 Selected Flag:TRUE Abandonment Rec: Contractor:7241 Form Version:7 Owner: County:OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/717\7172120.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/19/2011			
Year Completed:		2011			
Depth (m):		4.88			
Latitude:		45.3770436033796			
Longitude:		-75.748473987879			
X:		-75.74847382665708			
Y:		45.37704359619291			
Path:		717\7172120.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003610411		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				441397.00	
Cluster Kind:				North83:	
Date Completed:		10/19/2011		5025109.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				3	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 10 - 30 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1004090976			
Layer:		2			
Color:		2			
General Color:		GREY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		1.8300000429153442			
Formation End Depth:		2.890000104904175			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004090975			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		12			
Material 2 Desc:		STONES			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.8300000429153442			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1004090977			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.890000104904175			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004090986			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004090987			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.25			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004090988			
Layer:		3			
Plug From:		3.25			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004090985			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004090974			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004090981			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.3499999046325684			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004090982			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.3499999046325684			
Screen End Depth:		4.880000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1004090980			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004090979			
Diameter:		5.710000038146973			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		2.890000104904175			
Depth To:		4.880000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1004090978			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		2.890000104904175			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
174	1 of 1	E/235.6	76.8 / 0.67	861 CLYDE AV. Ottawa ON	WWIS
Well ID:		7326562		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Other		Data Src:	
Final Well Status:		Test Hole		Date Received:	
Water Type:				12/11/2018	
Casing Material:				Selected Flag:	
Audit No:		Z298101		TRUE	
Tag:		A257539		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				7241	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				7	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				OTTAWA-CARLETON	
Static Water Level:				Lot:	
Clear/Cloudy:				Concession:	
Municipality:		NEPEAN TOWNSHIP		Concession Name:	
Site Info:				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7326562.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/12/2018			
Year Completed:		2018			
Depth (m):		5.0292			
Latitude:		45.3771336926782			
Longitude:		-75.7484624044877			
X:		-75.74846224197937			
Y:		45.37713368616855			
Path:		732\7326562.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007343913		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				441398.00	
Cluster Kind:				North83:	
Date Completed:		10/12/2018		5025119.00	
Remarks:				Org CS:	
				UTM83	
				UTMRC:	
				4	
				UTMRC Desc:	
				margin of error : 30 m - 100 m	
				Location Method:	
				wwr	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007713641			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007713642			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007713643			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		8.0			
Formation End Depth:		8.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007713644			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		8.5			
Formation End Depth:		16.5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713909			
Layer:		2			
Plug From:		1.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713908			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713912			
Layer:		5			
Plug From:		10.5			
Plug To:		16.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713910			
Layer:		3			
Plug From:		2.0			
Plug To:		9.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713911			
Layer:		4			
Plug From:		9.5			
Plug To:		10.5			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID: 1007714271 Method Construction Code: D Method Construction: Direct Push Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1007713362 Casing No: 0 Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1007714362 Layer: 1 Material: 5 Open Hole or Material: PLASTIC Depth From: 0.0 Depth To: 11.0 Casing Diameter: 1.3799999952316284 Casing Diameter UOM: inch Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1007714461 Layer: 1 Slot: 10 Screen Top Depth: 11.0 Screen End Depth: 16.5 Screen Material: 5 Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter: 1.6599999966621399					
<u>Hole Diameter</u>					
Hole ID: 1007714156 Diameter: 2.375 Depth From: 8.5 Depth To: 16.5 Hole Depth UOM: ft Hole Diameter UOM: inch					
<u>Hole Diameter</u>					
Hole ID: 1007714155 Diameter: 2.875 Depth From: 0.0 Depth To: 8.5 Hole Depth UOM: ft Hole Diameter UOM: inch					
175	1 of 1	WSW/237.0	78.9 / 2.75	PIPELINE HIT - 1/2" 830 REX AVE,,OTTAWA,ON,K2A 2P5,CA ON	PINC
Incident Id: Incident No: 1468312		Pipe Material: Fuel Category:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Reported Dt: 8/28/2014 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: PIPELINE HIT - 1/2" Incident Address: 830 REX AVE,,OTTAWA,ON,K2A 2P5,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					

176	1 of 1	E/237.2	76.8 / 0.70	861 CLYDE AVE Ottawa ON	WWIS
Well ID: 7172199 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z140236 Tag: A106781 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 11/22/2011 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/717/7172199.pdf			

Additional Detail(s) (Map)

Well Completed Date: 10/15/2011
Year Completed: 2011
Depth (m): 4.57
Latitude: 45.3775117162224
Longitude: -75.7484673918505
X: -75.74846723029039
Y: 45.37751170901173
Path: 717/7172199.pdf

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID:	1003610569			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441398.00
Code OB Desc:				North83:	5025161.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	10/15/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004096656				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:	71				
Material 3 Desc:	FRACTURED				
Formation Top Depth:	2.5				
Formation End Depth:	4.570000171661377				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1004096655				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	85				
Material 2 Desc:	SOFT				
Material 3:	68				
Material 3 Desc:	DRY				
Formation Top Depth:	0.0				
Formation End Depth:	2.5				
Formation End Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1004096665				
Layer:	1				
Plug From:	0.0				
Plug To:	0.3100000023841858				
Plug Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1004096666			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004096667			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1004096664			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1004096654			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1004096660			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1004096661			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1004096659			
Layer:					
Kind Code:					
Kind:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004096657			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		2.5			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1004096658			
Diameter:		5.710000038146973			
Depth From:		2.5			
Depth To:		4.570000171661377			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
177	1 of 1	SE/237.5	78.1 / 2.01	890 Boyd Ave Ottawa ON Ottawa ON K2A 2E3	EHS
Order No:		23070400339	Nearest Intersection:		
Status:		C	Municipality:		
Report Type:		Standard Report	Client Prov/State:		ON
Report Date:		07-JUL-23	Search Radius (km):		.25
Date Received:		04-JUL-23	X:		-75.7504633
Previous Site Name:			Y:		45.3751567
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			
178	1 of 1	E/239.0	76.8 / 0.70	861 CLYDE AVE OTTAWA ON	WWIS
Well ID:		7155919	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring and Test Hole	Data Entry Status:		
Use 2nd:		0	Data Src:		
Final Well Status:		Monitoring and Test Hole	Date Received:		12/08/2010
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z116187	Contractor:		7241
Tag:		A097276	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7155919.pdf			
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		10/28/2010			
Year Completed:		2010			
Depth (m):		7.01			
Latitude:		45.3777454797068			
Longitude:		-75.7485087923213			
X:		-75.74850863001501			
Y:		45.37774547339294			
Path:		715\7155919.pdf			

Bore Hole Information

Bore Hole ID:	1003433946	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	441395.00
Code OB Desc:		North83:	5025187.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	10/28/2010	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	www
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	1003723925
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	
Material 2 Desc:	
Material 3:	91
Material 3 Desc:	WATER-BEARING
Formation Top Depth:	0.6100000143051147
Formation End Depth:	1.8200000524520874
Formation End Depth UOM:	m

Overburden and Bedrock

Materials Interval

Formation ID:	1003723926
Layer:	3
Color:	2
General Color:	GREY
Material 1:	15
Material 1 Desc:	LIMESTONE
Material 2:	
Material 2 Desc:	
Material 3:	73
Material 3 Desc:	HARD
Formation Top Depth:	1.8200000524520874
Formation End Depth:	7.010000228881836
Formation End Depth UOM:	m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003723924			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.6100000143051147			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003723936			
Layer:		1			
Plug From:		0.0			
Plug To:		2.130000114440918			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003723934			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003723923			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003723930			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		10.15999984741211			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003723931			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		4			
Screen Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM: Screen Diameter:		cm			
<u>Water Details</u>					
Water ID:		1003723929			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003723928			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1003723927			
Diameter:		7.6199998855559082			
Depth From:		2.130000114440918			
Depth To:		7.010000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
179	1 of 3	WSW/239.0	78.1 / 1.95	CARLING ANIMAL HOSPITAL 08-954 1850 CARLING AVENUE OTTAWA ON K2A 1E3	GEN
Generator No:		ON1175301			
SIC Code:		0211			
SIC Description:		VETERINARY SERVICE			
Approval Years:		92,93,94,95,96,97,98			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
179	2 of 3	WSW/239.0	78.1 / 1.95	CARLING ANIMAL HOSPITAL 1850 CARLING AVENUE OTTAWA ON K2A 1E3	GEN
Generator No:		ON1175301			
SIC Code:		0211			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		VETERINARY SERVICE			
Approval Years:		99,00,01			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
179	3 of 3	WSW/239.0	78.1 / 1.95	CARLING ANIMAL HOSPITAL 1850 Carling Ave Ottawa ON K2A 1E3	GEN
Generator No:		ON1175301			
SIC Code:					
SIC Description:					
Approval Years:		02,03,04			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
180	1 of 1	E/239.3	76.8 / 0.70	861 CLYDE AVE OTTAWA ON	WWIS
Well ID:		7180632		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Test Hole		Date Received:	
Water Type:				05/10/2012	
Casing Material:				Selected Flag:	
Audit No:		Z129465		TRUE	
Tag:		A106779		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				7241	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				7	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				OTTAWA-CARLETON	
Static Water Level:				Lot:	
Clear/Cloudy:				Concession:	
Municipality:		OTTAWA CITY		Concession Name:	
				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/718\7180632.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		02/11/2012			
Year Completed:		2012			
Depth (m):		12.15			
Latitude:		45.3777185617212			
Longitude:		-75.7484956650593			
X:		-75.7484955029404			
Y:		45.377718555428885			
Path:		718\7180632.pdf			
Bore Hole Information					
Bore Hole ID:		1003759372		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				441396.00	
Cluster Kind:				North83:	
Date Completed:		02/11/2012		5025184.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
Overburden and Bedrock					
Materials Interval					
Formation ID:		1004302663			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		71			
Material 3 Desc:		FRACTURED			
Formation Top Depth:		1.5			
Formation End Depth:		12.149999618530273			
Formation End Depth UOM:		m			
Overburden and Bedrock					
Materials Interval					
Formation ID:		1004302662			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:		11			
Material 2 Desc:		GRAVEL			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:		28			
Material 3 Desc:		SAND			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004302673			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		10.0600004196167			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004302672			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1004302674			
Layer:		3			
Plug From:		10.0600004196167			
Plug To:		12.149999618530273			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1004302671			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1004302661			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1004302667			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		10.359999656677246			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1004302668			
Layer:		1			
Slot:		10			
Screen Top Depth:		10.359999656677246			
Screen End Depth:		12.149999618530273			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1004302666			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1004302665			
Diameter:		12.149999618530273			
Depth From:		2.130000114440918			
Depth To:		12.149999618530273			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1004302664			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>181</u>	1 of 2	SW/239.4	78.9 / 2.75	ON	WWIS
Well ID:	1508746			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Domestic			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	06/14/1954
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	3725
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508746.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		06/01/1954			
Year Completed:		1954			
Depth (m):		57.912			
Latitude:		45.3749532789873			
Longitude:		-75.7556150415723			
X:		-75.75561488031			
Y:		45.37495327199969			
Path:		150\1508746.pdf			
Bore Hole Information					
Bore Hole ID:		10030780		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				440835.70	
Cluster Kind:				North83:	
Date Completed:		06/01/1954		5024882.00	
Remarks:				Org CS:	
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM		UTMRC:	
Elevrc Desc:				9	
Location Source Date:				UTMRC Desc:	
Improvement Location Source:				unknown UTM	
Improvement Location Method:				p9	
Source Revision Comment:				Location Method:	
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		931010479			
Layer:		4			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		79.0			
Formation End Depth:		89.0			
Formation End Depth UOM:		ft			
Overburden and Bedrock					
Materials Interval					
Formation ID:		931010477			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:					
Formation Top Depth:		8.0			
Formation End Depth:		52.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931010476			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931010478			
Layer:		3			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		52.0			
Formation End Depth:		79.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931010480			
Layer:		5			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		89.0			
Formation End Depth:		190.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961508746			
Method Construction Code:		1			
Method Construction:		Cable Tool			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10579350			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930054194			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		18.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930054195			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		190.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508746			
Pump Set At:					
Static Level:		9.0			
Final Level After Pumping:		12.0			
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
<u>Water Details</u>					
Water ID:		933463397			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		52.0			
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
181	2 of 2	SW/239.4	78.9 / 2.75	ON	WWIS
Well ID:1508751 Construction Date: Use 1st:Domestic Use 2nd:0 Final Well Status:Water Supply Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality:OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src:1 Date Received:11/26/1954 Selected Flag:TRUE Abandonment Rec: Contractor:3718 Form Version:1 Owner: County:OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508751.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/07/1954			
Year Completed:		1954			
Depth (m):		58.2168			
Latitude:		45.3749532789873			
Longitude:		-75.7556150415723			
X:		-75.75561488031			
Y:		45.37495327199969			
Path:		150\1508751.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10030785		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		10/07/1954		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931010499			
Layer:		2			
Color:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		43.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931010498			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931010501			
Layer:		4			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		67.0			
Formation End Depth:		93.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931010502			
Layer:		5			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		26			
Material 2 Desc:		ROCK			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		93.0			
Formation End Depth:		191.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931010500			
Layer:		3			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		43.0			
Formation End Depth:		67.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961508751			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10579355			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930054205			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		191.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930054204			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		12.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508751			
Pump Set At:					
Static Level:		9.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Level After Pumping:		14.0			
Recommended Pump Depth:					
Pumping Rate:		3.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
 <u>Water Details</u>					
Water ID:		933463405			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		43.0			
Water Found Depth UOM:		ft			
 <u>Water Details</u>					
Water ID:		933463406			
Layer:		2			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		141.0			
Water Found Depth UOM:		ft			
182	1 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LTD. 861 CLYDE AVENUE OTTAWA PLANT 861 CLYDE AVENUE OTTAWA CITY ON K1Z 5A4	SPL
Ref No:	43218			Municipality No:	20101
Year:				Nature of Damage:	
Incident Dt:	11/9/1990			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	11/9/1990			Impact to Health:	
Dt Document Closed:				Agency Involved:	WORKS DEPT
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:		CONTAINER OVERFLOW			
Incident Preceding Spill:					
Environment Impact:		CONFIRMED			
Health Env Consequence:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Nature of Impact: Soil contamination Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Client Type: Source Type: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Incident Reason: ERROR Incident Summary: WILLIAM NEILSON LTD - 100 L FURNACE OIL TO BASEMENT. Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:					
182	2 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LTEE 861 CLYDE AV OTTAWA ON K1Z 5A4	PRT
Location ID: 25794 Type: private Expiry Date: Capacity (L): 25000.00 Licence #: 0001019272					
182	3 of 54	E/240.9	76.8 / 0.69	NEILSON DAIRY LTD 861 CLYDE AV OTTAWA ON K1Z5A4	PRT
Location ID: 25794 Type: retail Expiry Date: Capacity (L): 25000 Licence #: 0001039082					
182	4 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LIMITED 861 CLYDE AVENUE OTTAWA CITY ON K1Z 5A4	CA
Certificate #: 8-4026-97- Application Year: 97 Issue Date: 3/5/1997 Approval Type: Industrial air Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: 2 PROPANE TUBE HEATERS FOR SPACE HEATING Contaminants: Nitrogen Oxides					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Emission Control:		No Controls			
182	5 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LTD. 861 CLYDE AVE. OTTAWA PLANT 861 CLYDE AVENUE OTTAWA CITY ON K1Z 5A4	SPL
Ref No: 144980 Year: Incident Dt: 8/12/1997 Dt MOE Arvl on Scn: MOE Reported Dt: 8/12/1997 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: VALVE/FITTING LEAK OR FAILURE Incident Preceding Spill: Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Multi Media Pollution Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Client Type: Source Type: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND / WATER Incident Reason: MATERIAL FAILURE Incident Summary: WILLIAM NEILSON LTD.: 20000 L MILK TO PLANT FLOOR & SEWERS, WORKS. Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:		Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved: WORKS			
182	6 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LTD./LTÉE 861 Clyde Ave Ottawa ON K1Z 5A4	SCT
Established:		1893			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plant Size (ft²):		35000			
Employment:		100			
--Details--					
Description:		Fruit and Vegetable Canning, Pickling and Drying			
SIC/NAICS Code:		311420			
Description:		Fluid Milk Manufacturing			
SIC/NAICS Code:		311511			
182	7 of 54	E/240.9	76.8 / 0.69	NEILSON DAIRY NEILSON CANADA 861 CLYDE AVE OTTAWA TANK TRUCK (CARGO) OTTAWA CITY ON K1Z 5A4	SPL
Ref No:		203187		Municipality No:	20107
Year:					
Incident Dt:		6/12/2001		Nature of Damage:	
Dt MOE Arvl on Scn:		Discharger Report:			
MOE Reported Dt:		6/12/2001		Material Group:	
Dt Document Closed:		Impact to Health:			
Site No:		Agency Involved:			
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:		VALVE/FITTING LEAK OR FAILURE			
Incident Preceding Spill:					
Environment Impact:		Not Anticipated			
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Client Type:					
Source Type:					
Contaminant Code:					
Contaminant Name:					
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		Land			
Incident Reason:		UNKNOWN			
Incident Summary:		SPILL:NEILSON:16 L OF MO-TOR OIL TO ASPHALT.NO SEW-ERS,CONTAINED, CLEANED.			
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:					
SAC Action Class:					
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Client Name:					
182	8 of 54	E/240.9	76.8 / 0.69	William Neilson Ltd. 861 Clyde Ave Ottawa ON K1Z 5A4	SCT
Established:		1893			
Plant Size (ft²):		35000			
Employment:					
--Details--					
Description:		Fruit and Vegetable Canning, Pickling and Drying			
SIC/NAICS Code:		311420			
Description:		Fluid Milk Manufacturing			
SIC/NAICS Code:		311511			
182	9 of 54	E/240.9	76.8 / 0.69	861 Clyde Avenue Ottawa ON K1Z 5A4	CA
Certificate #:		4051-5EQMFF			
Application Year:		02			
Issue Date:		10/11/02			
Approval Type:		Industrial sewage			
Status:		Approved			
Application Type:		New Certificate of Approval			
Client Name:		Weston Inc.			
Client Address:		861 Clyde Avenue			
Client City:		Ottawa			
Client Postal Code:		K1Z 5A4			
Project Description:		This application is for approval to install a stormwater management facility for an enlarged parking lot involved in the extension of the milk processing plant.			
Contaminants:					
Emission Control:					
182	10 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LTD. 861 CLYDE AVENUE OTTAWA ON K1Z 5A4	GEN
Generator No:		ON0392200			
SIC Code:		1041			
SIC Description:		FLUID MILK IND.			
Approval Years:		86,87,88,89			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
Detail(s)					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			

507 [esisinfo.com](https://www.esisinfo.com) | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
182	14 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LIMITED (OTTAWA) 861 CLYDE AVENUE OTTAWA ON K1Z 5A4	GEN
Generator No:		ON0392200			
SIC Code:		1041			
SIC Description:		FLUID MILK IND.			
Approval Years:		99,00,01			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
182	15 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LIMITED 861 CLYDE AVENUE OTTAWA ON K1Z 5A4	GEN
Generator No:		ON0392200			
SIC Code:					
SIC Description:					
Approval Years:		02,03,04,05,06,07,08			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		267			
Waste Class Name:		ORGANIC ACIDS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		135			
Waste Class Name:		REACTIVE ANION WASTES			
Waste Class:		135			
Waste Class Name:		REACTIVE ANION WASTES			
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		222			
Waste Class Name:		HEAVY FUELS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			

[182](#)

16 of 54

E/240.9

76.8 / 0.69

Wm. Neilson Ltd.
861 Clyde Ave.
Ottawa ON K1Z 5A4

DTNK

**Delisted Commercial Fuel Oil
Tanks**

Licence No:		Facility Type:	
Registration No:	200204-2400	Fuel Type:	
Posse File No:		Corrosion Protection:	
Posse Reg No:		NBR:	
Instance No:		Contact Name:	c/o Dwayne Robillard
Status Name:		Contact Address:	861 Clyde Ave.
Tank Type:		Contact Address2:	
Tank Size:	25000 L	Contact Suite:	
Tank Material:	Steel	Contact City:	Ottawa
Tk Age(as of 05/1992):	12 yrs	Contact Prov:	ON
Tank Address:	same as above	Contact Postal:	K1Z 5A4
Instance Type:		Province:	
Instance Creation Dt:		Letter Sent:	
Instance Install Dt:		Context:	
Item:		Distributor:	Esso or Shell
Item Desc:		Comments:	
Device Instld Loc:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description: Original Source: CFOT Record Date: Up to Apr 2013					
182	17 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LTEE 861 CLYDE AVE OTTAWA ON K1Z 5A4	FSTH
License Issue Date: 6/17/1996 Tank Status: Licensed Tank Status As Of: August 2007 Operation Type: Private Fuel Outlet Facility Type: Gasoline Station - Self Serve					
--Details-- Status: Active Year of Installation: 1990 Corrosion Protection: Capacity: 25000 Tank Fuel Type: Liquid Fuel Single Wall UST - Diesel					
182	18 of 54	E/240.9	76.8 / 0.69	NEILSON DAIRY LTD 861 CLYDE AVE OTTAWA ON K1Z 5A4	FSTH
License Issue Date: 6/17/1996 Tank Status: Licensed Tank Status As Of: August 2007 Operation Type: Private Fuel Outlet Facility Type: Gasoline Station - Self Serve					
--Details-- Status: Active Year of Installation: 1990 Corrosion Protection: Capacity: 25000 Tank Fuel Type: Liquid Fuel Single Wall UST - Diesel					
182	19 of 54	E/240.9	76.8 / 0.69	Camscott Trucking<UNOFFICIAL> 861 Clyde Avenue Ottawa ON K1Z 5A4	SPL
Ref No: 5602-6D8JYT Year: Incident Dt: 6/10/2005 Dt MOE Arvl on Scn: MOE Reported Dt: 6/10/2005 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: Pavement<UNOFFICIAL> Site Address: Site Region: Site Municipality: Ottawa Site Lot: Site Conc:					
Municipality No: Nature of Damage: Discharger Report: 0 Material Group: Oil Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: Pipe Or Hose Leak Incident Preceding Spill: Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Other Impact(s) Contaminant Qty: Contaminant Qty 1: Contaminant Unit: L Client Type: Source Type: Contaminant Code: Contaminant Name: DIESEL FUEL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Incident Reason: Equipment Failure Incident Summary: Neilson Dairy - 50 L diesel to grd. Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Other Motor Vehicle SAC Action Class: Spills to Land Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Camscott Trucking<UNOFFICIAL>					

182	20 of 54	E/240.9	76.8 / 0.69	Neilson Dairy<UNOFFICIAL> 861 Clyde Ave Ottawa ON	SPL
Ref No: 0653-6U3PRY Year: Incident Dt: 9/7/2006 Dt MOE Arvl on Scn: MOE Reported Dt: 9/28/2006 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: Neilson Dairy<UNOFFICIAL> Site Address: 861 Clyde Ave Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: Incident Preceding Spill: Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Contaminant Qty: 5 L					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Qty 1:	5				
Contaminant Unit:	L				
Client Type:					
Source Type:	Transformer				
Contaminant Code:	15				
Contaminant Name:	TRANSFORMER OIL (N.O.S.)				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:					
Incident Reason:	Corrosion - All forms of internal/external corrosion				
Incident Summary:	Neilson Dairy - 20 L transformer oil to grass				
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:					
SAC Action Class:					
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					
Client Name:	Neilson Dairy<UNOFFICIAL>				
182	21 of 54	E/240.9	76.8 / 0.69	William Neilson Co. Limited 861 Clyde Ave Ottawa ON K1Z 5A4	SPL
Ref No:	1084-7MFRXA			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:				Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	12/18/2008			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:	Planned Field Response				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa				
Nearest Watercourse:					
Site Name:	861 Clyde Avenue				
Site Address:					
Site Region:					
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:	NA				
Easting:	NA				
Incident Cause:	Tank (Underground) Leak				
Incident Preceding Spill:					
Environment Impact:	Possible				
Health Env Consequence:					
Nature of Impact:	Groundwater Pollution; Soil Contamination				
Contaminant Qty:	0 L				
Contaminant Qty 1:	0				
Contaminant Unit:	L				
Client Type:					
Source Type:					
Contaminant Code:	13				
Contaminant Name:	DIESEL FUEL				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Reason: Incident Summary: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:		Spill TSSA-FSB: Neilson: u/k amt of diesel to grnd and grnd water. Land Spills William Neilson Co. Limited			
182	22 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LTEE 861 CLYDE AVE OTTAWA ON K1Z 5A4	FSTH
License Issue Date: Tank Status: Tank Status As Of: Operation Type: Facility Type:		6/17/1996 Licensed December 2008 Private Fuel Outlet Gasoline Station - Self Serve			
--Details--					
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:		Active 1990 25000 Liquid Fuel Single Wall UST - Diesel			
182	23 of 54	E/240.9	76.8 / 0.69	NEILSON DAIRY LTD 861 CLYDE AVE OTTAWA ON K1Z 5A4	FSTH
License Issue Date: Tank Status: Tank Status As Of: Operation Type: Facility Type:		6/17/1996 Licensed December 2008 Private Fuel Outlet Gasoline Station - Self Serve			
--Details--					
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:		Active 1990 25000 Liquid Fuel Single Wall UST - Diesel			
182	24 of 54	E/240.9	76.8 / 0.69	Saputo Dairy Products Canada 861 Clyde Ave Ottawa ON K1Z 5A4	SCT
Established: Plant Size (ft²): Employment:		90000			
--Details--					
Description: SIC/NAICS Code:		Fruit and Vegetable Canning, Pickling and Drying 311420			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description:		Fluid Milk Manufacturing			
SIC/NAICS Code:		311511			
182	25 of 54	E/240.9	76.8 / 0.69	Saputo Chesse GP 861 Clyde Avenue Ottawa ON K1Z 5A4	GEN
Generator No:		ON9639114			
SIC Code:		311511			
SIC Description:		Fluid Milk Manufacturing			
Approval Years:		07,08			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		135			
Waste Class Name:		REACTIVE ANION WASTES			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		267			
Waste Class Name:		ORGANIC ACIDS			
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
182	26 of 54	E/240.9	76.8 / 0.69	William Neilson Co. Limited 861 Clyde Avenue Ottawa ON K1Z 5A4	CA
Certificate #:		1822-5GQTJS			
Application Year:		2002			
Issue Date:		12/16/2002			
Approval Type:		Air			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Client Postal Code: Project Description: Contaminants: Emission Control:					
182	27 of 54	E/240.9	76.8 / 0.69	Saputo Cheese G.P. 861 Clyde Ave Ottawa ON K1Z 5A4	SPL
Ref No: 5677-89QNHY Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: 9/28/2010 Dt Document Closed: 11/23/2010 Site No: MOE Response: No Field Response Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Saputo Dairy<UNOFFICIAL> Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northings: Easting: Incident Cause: Incident Preceding Spill: Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Air Pollution Contaminant Qty: 40 lb Contaminant Qty 1: 40 Contaminant Unit: lb Client Type: Source Type: Contaminant Code: 38 Contaminant Name: FREON R-22 (CFC) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Incident Summary: Saputo Dairy: 40 lbs of R22 to atm. Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Other SAC Action Class: Air Spills - Gases and Vapours Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name:					
182	28 of 54	E/240.9	76.8 / 0.69	Saputo Foods Limited acting as managing partner of 861 Clyde Ave.	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ottawa ON K1Z 5A4					
Ref No:	7028-8KCRWD			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	8/2/2011			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	8/2/2011			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:	No Field Response				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:	Saputo Dairy Products Canada GP<UNOFFICIAL>				
Site Address:	861 Clyde Ave.				
Site Region:					
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:					
Incident Preceding Spill:					
Environment Impact:	Not Anticipated				
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	8700 L				
Contaminant Qty 1:	8700				
Contaminant Unit:	L				
Client Type:					
Source Type:					
Contaminant Code:	96				
Contaminant Name:	MILK PRODUCT				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:	Sewage - Municipal/Private and Commercial				
Incident Reason:					
Incident Summary:	Saputo Dairy: 8,700 L milk spill to secondary containment				
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:	Other				
SAC Action Class:	Primary Assessment of Spills				
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					
Client Name:	Saputo Foods Limited acting as managing partner of				
182	29 of 54	E/240.9	76.8 / 0.69	Saputo Cheese G.P. 861 Clyde Avenue<UNOFFICIAL> Ottawa ON K1Z 5A4	SPL

Ref No:	8468-8KMJMQ	Municipality No:
Year:		Nature of Damage:
Incident Dt:	8/10/2011	Discharger Report:
Dt MOE Arvl on Scn:		Material Group:
MOE Reported Dt:	8/11/2011	Impact to Health:
Dt Document Closed:		Agency Involved:
Site No:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: 861 Clyde Avenue<UNOFFICIAL> Site Address: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: Pipe Or Hose Leak Incident Preceding Spill: Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Other Impact(s) Contaminant Qty: 1500 L Contaminant Qty 1: 1500 Contaminant Unit: L Client Type: Source Type: Contaminant Code: 96 Contaminant Name: MILK PRODUCT Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Spill Incident Summary: Saputo Cheese: 1500 L milk to trmt tank Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Pipeline SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Saputo Cheese G.P.					
182	30 of 54	E/240.9	76.8 / 0.69	Saputo Foods Limited 861 Clyde Ave Ottawa ON K1Z 5A4	SPL
Ref No: 2211-8LAQR5 Year: Incident Dt: 9/1/2011 Dt MOE Arvl on Scn: MOE Reported Dt: 9/1/2011 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Saputo Dairy Products<UNOFFICIAL> Site Address: 861 Clyde Ave Site Region: Site Municipality: Ottawa Site Lot:					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: Incident Preceding Spill: Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Other Impact(s) Contaminant Qty: 200 L Contaminant Qty 1: 200 Contaminant Unit: L Client Type: Source Type: Contaminant Code: n/a Contaminant Name: SANITIZER 160 Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Incident Summary: Saputo Dairy: sanitizer to floor, cleaned Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Other SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Saputo Foods Limited					

182	31 of 54	E/240.9	76.8 / 0.69	Saputo Foods Limited 861 Clyde Ave Ottawa ON K1Z 5A4	SPL
Ref No: 5386-8NDLDP Year: Incident Dt: 11/7/2011 Dt MOE Arvl on Scn: MOE Reported Dt: 11/7/2011 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: 861 Clyde Avenue Site Address: 861 Clyde Ave Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: NA Easting: NA Incident Cause: Other Discharges Incident Preceding Spill: Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Other Impact(s)					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Qty: 1200 L Contaminant Qty 1: 1200 Contaminant Unit: L Client Type: Source Type: Contaminant Code: 96 Contaminant Name: MILK PRODUCT Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Error- Operator error Incident Summary: Saputo: 1200 L milk spill, to effluent tank. Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Other SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Saputo Foods Limited					
182	32 of 54	E/240.9	76.8 / 0.69	861 CLYDE AVENUE OTTAWA ON K1Z 5A4	HINC
External File Num: FS INC 0812-07915 Fuel Occurrence Type: Leak Date of Occurrence: 12/18/2008 Fuel Type Involved: Diesel Status Desc: Pending Root Cause Attribution Validation Job Type Desc: Incident/Near-Miss Occurrence (FS) Oper. Type Involved: Private Fuel Outlet (including agricultural farms) Service Interruptions: No Property Damage: No Fuel Life Cycle Stage: Storage and Dispensing Root Cause: Root Cause: Equipment/Material/Component:Yes Procedures:No Maintenance:No Design:No Training:No Management:No Human Factors:No Reported Details: Fuel Category: Liquid Fuel Occurrence Type: Incident Affiliation: Industry Stakeholder (Licensee/Registration/Certificate Holder, Facility Owner, etc.) County Name: Ottawa Approx. Quant. Rel: 1 Nearby body of water: No Enter Drainage Syst.: No Approx. Quant. Unit: Liters Environmental Impact: TEST RESULTS NOT READY AT THIS DATE					
182	33 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON LIMITED 861 CLYDE AVENUE OTTAWA ON K1Z 5A4	GEN
Generator No: ON0392200 SIC Code: 311511 SIC Description: Fluid Milk Manufacturing Approval Years: 2009 PO Box No: Country: Status: Co Admin: Choice of Contact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		135			
Waste Class Name:		REACTIVE ANION WASTES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		267			
Waste Class Name:		ORGANIC ACIDS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		222			
Waste Class Name:		HEAVY FUELS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			

[182](#)

34 of 54

E/240.9

76.8 / 0.69

Saputo Dairy Products Canada GP
861 Clyde Avenue
Ottawa ON K1Z 5A4

GEN

Generator No: ON9639114
SIC Code: 311511
SIC Description: Fluid Milk Manufacturing
Approval Years: 2009
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		135			
Waste Class Name:		REACTIVE ANION WASTES			
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		267			
Waste Class Name:		ORGANIC ACIDS			

182	35 of 54	E/240.9	76.8 / 0.69	Saputo Dairy Products Canada 861 Clyde Avenue Ottawa ON K1Z 5A4	SPL
Ref No:	7064-8XEKQT			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	22-AUG-12			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	22-AUG-12			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:	No Field Response				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:	Saputo Facility<UNOFFICIAL>				
Site Address:	861 Clyde Avenue				
Site Region:					
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:	Valve / Fitting Leak Or Failure				
Incident Preceding Spill:					
Environment Impact:	Not Anticipated				
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	15 L				
Contaminant Qty 1:	15				
Contaminant Unit:	L				
Client Type:					
Source Type:					
Contaminant Code:	46				

522 erisinfo.com | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
182	37 of 54	E/240.9	76.8 / 0.69	Saputo Dairy Products Canada GP 861 Clyde Avenue Ottawa ON K1Z 5A4	GEN
Generator No:		ON9639114			
SIC Code:		311511			
SIC Description:		Fluid Milk Manufacturing			
Approval Years:		2011			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		135			
Waste Class Name:		REACTIVE ANION WASTES			
Waste Class:		267			
Waste Class Name:		ORGANIC ACIDS			
Waste Class:		150			
Waste Class Name:		INERT INORGANIC WASTES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
182	38 of 54	E/240.9	76.8 / 0.69	SAPUTO DAIRY PRODUCTS CANADA G.P. 861 CLYDE AVE N OTTAWA ON	FST
Inventory No:		11205187		Tank Material:	Steel

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Inventory Status: Active Installation Year: Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description: UNDERGROUND TANK					
Corrosion Protect: Impressed Current Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
182	39 of 54	E/240.9	76.8 / 0.69	WILLIAM NEILSON L TEE 861 CLYDE AVE N OTTAWA ON	FST
Inventory No: 11205150 Inventory Status: Active Installation Year: Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description: UNDERGROUND TANK					
Tank Material: Steel Corrosion Protect: Sacrificial anode Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
182	40 of 54	E/240.9	76.8 / 0.69	Saputo Dairy Products Canada GP 861 Clyde Avenue Ottawa ON K1Z 5A4	GEN
Generator No: ON9639114 SIC Code: 311511 SIC Description: Fluid Milk Manufacturing Approval Years: 2012 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
Waste Class: 135 Waste Class Name: REACTIVE ANION WASTES					
Waste Class: 267 Waste Class Name: ORGANIC ACIDS					
Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
Waste Class: 150 Waste Class Name: INERT INORGANIC WASTES					
Waste Class: 221					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		LIGHT FUELS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			

[182](#)

41 of 54

E/240.9

76.8 / 0.69

Saputo Dairy Products Canada GP
861 Clyde Avenue
Ottawa ON

GEN

Generator No: ON9639114
SIC Code: 311511
SIC Description: FLUID MILK MANUFACTURING
Approval Years: 2013
PO Box No:
Country:
Status:
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Class: 251
Waste Class Name: OIL SKIMMINGS & SLUDGES

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Class: 267
Waste Class Name: ORGANIC ACIDS

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Class: 135
Waste Class Name: REACTIVE ANION WASTES

Waste Class: 150
Waste Class Name: INERT INORGANIC WASTES

Waste Class: 146

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
182	42 of 54	E/240.9	76.8 / 0.69	W M NEILSON LTD 861 CLYDE AVE N OTTAWA ON	CFOT
Inventory No:		61126473		Tank Material:	Steel
Inventory Status:		Active		Corrosion Protect:	
Installation Year:		1990		Overfill Protection:	
Capacity:		25000		Inventory Context:	FS Fuel Oil Tank
Capacity Unit:				Inventory Item:	FS FUEL OIL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:					
182	43 of 54	E/240.9	76.8 / 0.69	861 CLYDE AVE Ottawa ON	WWIS
Well ID:		7220445		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Test Hole		Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z173618		Contractor:	7241
Tag:		A159166		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	RUSSELL
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		CAMBRIDGE TOWNSHIP			
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:		1004765899		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	491360.00
Code OB Desc:				North83:	5025183.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	9
Date Completed:		04/08/2014		UTMRC Desc:	unknown UTM
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005154614			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005154615			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005154616			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.130000114440918			
Formation End Depth:		3.6600000858306885			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154627			
Layer:		3			
Plug From:		1.8300000429153442			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154625			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154626			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005154624			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005154613			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005154620			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005154621			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.130000114440918			
Screen End Depth:		3.6600000858306885			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1005154619			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1005154618			
Diameter:		7.619999885559082			
Depth From:		2.740000009536743			
Depth To:		3.6600000858306885			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1005154617			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.740000009536743			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
182	44 of 54	E/240.9	76.8 / 0.69	Saputo Dairy Products Canda G.P. 861 Clyde Ave Ottawa ON NA	SPL
Ref No:	4066-A4GM2S			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	11/21/2015			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	11/21/2015			Impact to Health:	
Dt Document Closed:	11/23/2015			Agency Involved:	
Site No:	4603-5BQU6Z				
MOE Response:	No				
Site County/District:					
Site Geo Ref Meth:	NA				
Site District Office:					
Nearest Watercourse:					
Site Name:	861 Clyde Avenue				
Site Address:	861 Clyde Ave				
Site Region:					
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:	NA				
Site Map Datum:	NA				
Northing:	NA				
Easting:	NA				
Incident Cause:					
Incident Preceding Spill:					
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	1000 L				
Contaminant Qty 1:	1000				
Contaminant Unit:	L				
Client Type:					
Source Type:					
Contaminant Code:	96				
Contaminant Name:	CREAM (MILK BY-PRODUCT)				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Incident Reason: Equipment Failure Incident Summary: Saputo Dairy - 1000L cream to sanitary drain Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Industrial SAC Action Class: Notifications Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Saputo Dairy Products Canda G.P.					
182	45 of 54	E/240.9	76.8 / 0.69	861 Clyde Ave Ottawa ON K1Z5A4	EHS
Order No: 20151005024 Status: C Report Type: Standard Express Report Report Date: 05-OCT-15 Date Received: 05-OCT-15 Previous Site Name: Lot/Building Size: Additional Info Ordered: City Directory; Aerial Photos Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.748493 Y: 45.376345					
182	46 of 54	E/240.9	76.8 / 0.69	861 Clyde Ave Ottawa ON K1Z5A4	EHS
Order No: 20150709048 Status: C Report Type: Site Report Report Date: 10-JUL-15 Date Received: 09-JUL-15 Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .02 X: -75.747777 Y: 45.377732					
182	47 of 54	E/240.9	76.8 / 0.69	Weston Inc. 861 Clyde Avenue Ottawa ON K1Z 5A4	ECA
Approval No: 4051-5EQMFF Approval Date: 2002-10-11 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-INDUSTRIAL SEWAGE WORKS Project Type: INDUSTRIAL SEWAGE WORKS Business Name: Weston Inc. Address: 861 Clyde Avenue Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/6929-5BQU29-14.pdf PDF Site Location:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
182	48 of 54	E/240.9	76.8 / 0.69	William Neilson Co. Limited 861 Clyde Avenue Ottawa ON L7G 4B3	ECA
Approval No: 1822-5GQTJS Approval Date: 2002-12-16 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-AIR Project Type: AIR Business Name: William Neilson Co. Limited Address: 861 Clyde Avenue Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/4901-5F9RA6-14.pdf PDF Site Location: MOE District: Ottawa City: Longitude: -75.74765 Latitude: 45.37783 Geometry X: Geometry Y:					
182	49 of 54	E/240.9	76.8 / 0.69	Saputo Dairy Products Canada GP 861 Clyde Avenue Ottawa ON K1Z 5A4	GEN
Generator No: ON9639114 SIC Code: 311511 SIC Description: FLUID MILK MANUFACTURING Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Sylvester Antonipillai Choice of Contact: CO_ADMIN Phone No Admin: 613-761-7262 Ext. Contaminated Facility: No MHSW Facility: No					
<u>Detail(s)</u>					
Waste Class: 221 Waste Class Name: LIGHT FUELS					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES					
Waste Class: 112 Waste Class Name: ACID WASTE - HEAVY METALS					
Waste Class: 122 Waste Class Name: ALKALINE WASTES - OTHER METALS					
Waste Class: 150 Waste Class Name: INERT INORGANIC WASTES					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		251 OIL SKIMMINGS & SLUDGES			
Waste Class: Waste Class Name:		148 INORGANIC LABORATORY CHEMICALS			
Waste Class: Waste Class Name:		135 REACTIVE ANION WASTES			
Waste Class: Waste Class Name:		331 WASTE COMPRESSED GASES			
Waste Class: Waste Class Name:		267 ORGANIC ACIDS			

182	50 of 54	E/240.9	76.8 / 0.69	Saputo Dairy Products Canada GP 861 Clyde Avenue Ottawa ON K1Z 5A4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON9639114 311511 FLUID MILK MANUFACTURING 2015 Canada Sylvester Antonipillai CO_ADMIN 613-761-7262 Ext. No No			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		221 LIGHT FUELS			
Waste Class: Waste Class Name:		122 ALKALINE WASTES - OTHER METALS			
Waste Class: Waste Class Name:		112 ACID WASTE - HEAVY METALS			
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			
Waste Class: Waste Class Name:		150 INERT INORGANIC WASTES			
Waste Class: Waste Class Name:		135 REACTIVE ANION WASTES			
Waste Class: Waste Class Name:		267 ORGANIC ACIDS			
Waste Class: Waste Class Name:		145 PAINT/PIGMENT/COATING RESIDUES			
Waste Class: Waste Class Name:		146 OTHER SPECIFIED INORGANICS			
Waste Class: Waste Class Name:		263 ORGANIC LABORATORY CHEMICALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
182	51 of 54	E/240.9	76.8 / 0.69	Saputo Dairy Products Canada GP 861 Clyde Avenue Ottawa ON K1Z 5A4	GEN
Generator No:		ON9639114			
SIC Code:		311511			
SIC Description:		FLUID MILK MANUFACTURING			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Sylvester Antonipillai			
Choice of Contact:		CO_ADMIN			
Phone No Admin:		613-761-7262 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
 <u>Detail(s)</u>					
Waste Class:		135			
Waste Class Name:		REACTIVE ANION WASTES			
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		267			
Waste Class Name:		ORGANIC ACIDS			
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		150 INERT INORGANIC WASTES			
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			
Waste Class: Waste Class Name:		331 WASTE COMPRESSED GASES			
182	52 of 54	E/240.9	76.8 / 0.69	Saputo Dairy Products Canada GP 861 Clyde Avenue Ottawa ON K1Z 5A4	GEN
Generator No:		ON9639114			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
Waste Class:		112 L			
Waste Class Name:		Acid solutions - containing heavy metals			
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		135 C			
Waste Class Name:		Wastes containing other reactive anions			
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		150 L			
Waste Class Name:		Inert organic wastes			
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
Waste Class:		213 L			
Waste Class Name:		Petroleum distillates			
Waste Class:		221 I			
Waste Class Name:		Light fuels			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		221 L Light fuels			
Waste Class: Waste Class Name:		251 L Waste oils/sludges (petroleum based)			
Waste Class: Waste Class Name:		252 L Waste crankcase oils and lubricants			
Waste Class: Waste Class Name:		263 I Misc. waste organic chemicals			
Waste Class: Waste Class Name:		263 L Misc. waste organic chemicals			
Waste Class: Waste Class Name:		267 L Organic acids			
Waste Class: Waste Class Name:		331 I Waste compressed gases including cylinders			

182	53 of 54	E/240.9	76.8 / 0.69	Vertex Environmental Inc. Vertex Environmental Inc. 861 Clyde Ave Ottawa ON K1Z 5A4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON3658880 As of Jul 2020 Canada Registered			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		221 L Light fuels			

182	54 of 54	E/240.9	76.8 / 0.69	OTTAWA 861 CLYDE AVENUE OTTAWA ON K1Z5A4	NPR2
NPRI ID: Facility ID: Note:	10913 344852, 374876, 241561		Latitude: Longitude:	45.3776 -75.7479	
Substances included on NPRI reports for this NPRI ID are summarized below in the NPRI ID Substances Summary section. Substances listed in the Substances Summary are included on the basis of NPRI ID only. For entities (NPRI ID) with mobile plants and/or more than one facility location, substances listed above may or may not have been reported for specific facilities/mobile locations. The list of substances additionally includes those which have been included on the NPRI report with an unknown quantity or a quantity of 0. For specific details about substance quantities, years, release/transfer/disposal methods, the reader is referred the facility report: https://pollution-waste.canada.ca/national-release-inventory/?fromYear=1993&toYear=2022&name=10913					

NPRI ID Substances Summary

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
CAS No:	7697-37-2			Is PAH?:	FALSE
Is VOC?:	FALSE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	Nitric acid				
Name French:	Acide nitrique				
Sort English:	Nitric acid				
Sort French:	Acide nitrique				
CAS No:	7664-93-9			Is PAH?:	FALSE
Is VOC?:	FALSE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	Sulphuric acid				
Name French:	Acide sulfurique				
Sort English:	Sulphuric acid				
Sort French:	Acide sulfurique				
CAS No:	NA - 17			Is PAH?:	FALSE
Is VOC?:	FALSE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	Nitrate ion in solution at pH >= 6.0				
Name French:	Nitrate (ion en sol. à un pH de >= 6.0)				
Sort English:	Nitrate ion in solution at pH >= 6.0				
Sort French:	Nitrate (ion en sol. à un pH de >= 6.0)				
CAS No:	NA - M09			Is PAH?:	FALSE
Is VOC?:	FALSE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	PM10 - Particulate Matter <= 10 Micrometers				
Name French:	PM10 - Matière particulaire <= 10 micromètres				
Sort English:	PM10 - Particulate Matter <= 10 Micrometers				
Sort French:	PM10 - Matière particulaire <= 10 micromètres				
<u>Geographic Location</u>					
DLS Description:				Datum:	1983.0
NTS Description:	B-060-G/031-G-5			Forward Sort Area:	K2A
Latitude:	45.3776			SOMA:	TRUE
Longitude:	-75.7479			ON PEMA:	TRUE
Census Subdiv ID:	3506008			QC PEMA:	FALSE
Ecozone ID:	8			Quebec Windsor Corr:	TRUE
Water Survey ID:	2			Province Code:	ON
<u>NPRI ID Facility ID</u>					
NPRI ID:	10913				
Facility ID:	344852				
<u>Facility</u>					
Facility ID:	344852			IDM ID:	0
Portable:	FALSE			AB Approval ID:	0
NAICS Primary:	311511			GHGRP ID:	0
NAICS Secondary:	0			ON GHGRP ID:	0
NAICS Tertiary:	0				
Facility Name:	OTTAWA				
Website:	www.neilsondairy.com				
<u>Address</u>					
Address1:	861 Clyde Avenue				
Address2:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
City: Postal Zip: Prov:		OTTAWA K1Z5A4			
<u>Address Geographic</u>					
Latitude:	45.3776			Datum:	1983
Longitude:	-75.7479			Land Survey:	
UTM Easting:	0.000000			Topograph:	
UTM Northing:	0.000000			Additional Info:	
UTM Zone:	0				
<u>Primary NAICS Details</u>					
NAICS Code:	311511			Start Date:	1993
Record Year:	1997			End Date:	2001
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid Milk Manufacturing			
NAICS Title Fr:		Fabrication du lait de consommation			
NAICS Description En:					
NAICS Description Fr:					
NAICS Code:	311511			Start Date:	1993
Record Year:	2002			End Date:	2006
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid Milk Manufacturing			
NAICS Title Fr:		Fabrication du lait de consommation			
NAICS Description En:					
NAICS Description Fr:					
NAICS Code:	311511			Start Date:	1993
Record Year:	2007			End Date:	2011
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid Milk Manufacturing			
NAICS Title Fr:		Fabrication du lait de consommation			
NAICS Description En:					
NAICS Description Fr:					
NAICS Code:	311511			Start Date:	2017
Record Year:	2017			End Date:	2021
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid milk manufacturing			
NAICS Title Fr:		Fabrication de lait de consommation			
NAICS Description En:					

This Canadian industry comprises establishments primarily engaged in manufacturing milk and processed milk products.

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

NAICS Description Fr:

Cette classe canadienne comprend les établissements dont l'activité principale est la fabrication de lait et de produits de lait transformé.

NAICS Code:	311511	Start Date:	2012
Record Year:	2012	End Date:	2016
Key Indus Sector En:	Other Manufacturing		
Key Indus Sector Fr:	Autres fabrication		
NAICS Title En:	Fluid milk manufacturing		
NAICS Title Fr:	Fabrication de lait de consommation		

NAICS Description En:

This Canadian industry comprises establishments primarily engaged in manufacturing milk and processed milk products. Establishments primarily engaged in manufacturing substitute products are included.

NAICS Description Fr:

Cette classe canadienne comprend les établissements dont l'activité principale est la fabrication de lait et de produits de lait transformé. Sont inclus les établissements dont l'activité principale est la fabrication de succédanés.

NPRI Report

Report ID:	143795	Repor Type ID:	1
Report Year:	2006	New Reporter:	FALSE
NPRI ID:	10913	No of Employees:	120
Company ID:	134232	Is Compressor:	FALSE
Facility ID:	344852	Is NPRI Part 4:	FALSE
SWR Report ID:	20060000010913	Is Battery:	FALSE

Company

Company Name:	NEILSON DAIRY
Trade Name En:	
Trade Name Fr:	
DUNS No:	0
Website:	www.neilsondairy.com

NPRI Report Contact

Contact Type:	NPRI	Phone:	6137617270
First Name:	Mario	Extension:	
Last Name:	Allison	Fax:	
Email:	mario.allison@neilsondairy.com		
Description En:	Public Contact		
Description Fr:	Responsable des renseignements au public		
Position:	Site Manager		
Language:			
Company Name:			

NPRI Report

Report ID:	141045	Repor Type ID:	1
Report Year:	2007	New Reporter:	FALSE
NPRI ID:	10913	No of Employees:	113
Company ID:	134232	Is Compressor:	FALSE
Facility ID:	344852	Is NPRI Part 4:	FALSE
SWR Report ID:	20070000010913	Is Battery:	FALSE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Company</u>					
Company Name:		NEILSON DAIRY			
Trade Name En:					
Trade Name Fr:					
DUNS No:		0			
Website:		www.neilsondairy.com			
<u>NPRI Report Contact</u>					
Contact Type:	NPRI			Phone:	6137617270
First Name:	Mario			Extension:	
Last Name:	Allison			Fax:	
Email:	mario.allison@neilsondairy.com				
Description En:	Public Contact				
Description Fr:	Responsable des renseignements au public				
Position:	Site Manager				
Language:					
Company Name:					
<u>NPRI Report</u>					
Report ID:	139728			Repor Type ID:	1
Report Year:	2009			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	103
Company ID:	134232			Is Compressor:	FALSE
Facility ID:	344852			Is NPRI Part 4:	FALSE
SWR Report ID:	20090000010913			Is Battery:	FALSE
<u>Company</u>					
Company Name:		NEILSON DAIRY			
Trade Name En:					
Trade Name Fr:					
DUNS No:		0			
Website:		www.neilsondairy.com			
<u>NPRI Report Contact</u>					
Contact Type:	NPRI			Phone:	6137617270
First Name:	Mario			Extension:	
Last Name:	Allison			Fax:	
Email:	mario.allison@neilsondairy.com				
Description En:	Public Contact				
Description Fr:	Responsable des renseignements au public				
Position:	Site Manager				
Language:					
Company Name:					
<u>NPRI Report</u>					
Report ID:	263950			Repor Type ID:	1
Report Year:	2004			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	120
Company ID:	146967			Is Compressor:	FALSE
Facility ID:	344852			Is NPRI Part 4:	FALSE
SWR Report ID:	20040000010913			Is Battery:	FALSE
<u>Company</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Company Name:		NEILSON DAIRY			
Trade Name En:					
Trade Name Fr:					
DUNS No:		0			
Website:		www.neilsondairy.com			
<u>NPRI Report Comment</u>					
Description En:		NPRI - Report Submission			
Description Fr:		INRP - Soumission de rapport			
Comment:		Updated due to misunderstanding about MOE CAC reporting requirements No change to NPRI submission			
Note:		Many NPRI Report Comments are truncated in the NPRI data.			
<u>NPRI Report Contact</u>					
Contact Type:	NPRI			Phone:	6137617270
First Name:	Mario			Extension:	0
Last Name:	Allison			Fax:	0
Email:	mario.allison@neilsondairy.com				
Description En:	Public Contact				
Description Fr:	Responsable des renseignements au public				
Position:	Site Manager				
Language:					
Company Name:					
<u>NPRI Report</u>					
Report ID:	247820			Repor Type ID:	1
Report Year:	2005			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	120
Company ID:	146967			Is Compressor:	FALSE
Facility ID:	344852			Is NPRI Part 4:	FALSE
SWR Report ID:	20050000010913			Is Battery:	FALSE
<u>Company</u>					
Company Name:		NEILSON DAIRY			
Trade Name En:					
Trade Name Fr:					
DUNS No:		0			
Website:		www.neilsondairy.com			
<u>NPRI Report Contact</u>					
Contact Type:	NPRI			Phone:	6137617270
First Name:	Mario			Extension:	0
Last Name:	Allison			Fax:	0
Email:	mario.allison@neilsondairy.com				
Description En:	Public Contact				
Description Fr:	Responsable des renseignements au public				
Position:	Site Manager				
Language:					
Company Name:					
<u>NPRI Report</u>					
Report ID:	129738			Repor Type ID:	1
Report Year:	2008			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	103
Company ID:	134232			Is Compressor:	FALSE
Facility ID:	344852			Is NPRI Part 4:	FALSE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SWR Report ID:	20080000010913			Is Battery:	FALSE
<u>Company</u>					
Company Name:	NEILSON DAIRY				
Trade Name En:					
Trade Name Fr:					
DUNS No:	0				
Website:	www.neilsondairy.com				
<u>NPRI Report Contact</u>					
Contact Type:	NPRI			Phone:	6137617270
First Name:	Mario			Extension:	
Last Name:	Allison			Fax:	
Email:	mario.allison@neilsondairy.com				
Description En:	Public Contact				
Description Fr:	Responsable des renseignements au public				
Position:	Site Manager				
Language:					
Company Name:					
<u>NPRI ID Facility ID</u>					
NPRI ID:	10913				
Facility ID:	241561				
<u>Facility</u>					
Facility ID:	241561			IDM ID:	10398
Portable:	FALSE			AB Approval ID:	0
NAICS Primary:	311511			GHGRP ID:	0
NAICS Secondary:	0			ON GHGRP ID:	0
NAICS Tertiary:	0				
Facility Name:	Ottawa				
Website:					
<u>Address</u>					
Address1:	861 Clyde Avenue				
Address2:					
City:	OTTAWA				
Postal Zip:	K1Z5A4				
Prov:					
<u>Address Geographic</u>					
Latitude:	45.3776			Datum:	1983
Longitude:	-75.7479			Land Survey:	
UTM Easting:	0.000000			Topograph:	
UTM Northing:	0.000000			Additional Info:	
UTM Zone:	0				
<u>Primary NAICS Details</u>					
NAICS Code:	311511			Start Date:	1993
Record Year:	1997			End Date:	2001
Key Indus Sector En:	Other Manufacturing				
Key Indus Sector Fr:	Autres fabrication				
NAICS Title En:	Fluid Milk Manufacturing				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Title Fr:		Fabrication du lait de consommation			
NAICS Description En:					
NAICS Description Fr:					
NAICS Code:	311511			Start Date:	1993
Record Year:	2002			End Date:	2006
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid Milk Manufacturing			
NAICS Title Fr:		Fabrication du lait de consommation			
NAICS Description En:					
NAICS Description Fr:					
NAICS Code:	311511			Start Date:	1993
Record Year:	2007			End Date:	2011
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid Milk Manufacturing			
NAICS Title Fr:		Fabrication du lait de consommation			
NAICS Description En:					
NAICS Description Fr:					
NAICS Code:	311511			Start Date:	2017
Record Year:	2017			End Date:	2021
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid milk manufacturing			
NAICS Title Fr:		Fabrication de lait de consommation			
NAICS Description En:					
This Canadian industry comprises establishments primarily engaged in manufacturing milk and processed milk products.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements dont l'activité principale est la fabrication de lait et de produits de lait transformé.					
NAICS Code:	311511			Start Date:	2012
Record Year:	2012			End Date:	2016
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid milk manufacturing			
NAICS Title Fr:		Fabrication de lait de consommation			
NAICS Description En:					
This Canadian industry comprises establishments primarily engaged in manufacturing milk and processed milk products. Establishments primarily engaged in manufacturing substitute products are included.					
NAICS Description Fr:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cette classe canadienne comprend les établissements dont l'activité principale est la fabrication de lait et de produits de lait transformé. Sont inclus les établissements dont l'activité principale est la fabrication de succédanés.					
<u>NPRI Report</u>					
Report ID:	17674			Repor Type ID:	1
Report Year:	2015			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	140
Company ID:	112167			Is Compressor:	FALSE
Facility ID:	241561			Is NPRI Part 4:	FALSE
SWR Report ID:	71828			Is Battery:	FALSE
<u>Company</u>					
Company Name:		Saputo Foods Ltd.			
Trade Name En:					
Trade Name Fr:					
DUNS No:		249462144			
Website:					
<u>NPRI Report</u>					
Report ID:	47913			Repor Type ID:	1
Report Year:	2012			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	137
Company ID:	112167			Is Compressor:	FALSE
Facility ID:	241561			Is NPRI Part 4:	FALSE
SWR Report ID:	30608			Is Battery:	FALSE
<u>Company</u>					
Company Name:		Saputo Foods Ltd.			
Trade Name En:					
Trade Name Fr:					
DUNS No:		249462144			
Website:					
<u>NPRI Report</u>					
Report ID:	34327			Repor Type ID:	1
Report Year:	2013			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	138
Company ID:	112167			Is Compressor:	FALSE
Facility ID:	241561			Is NPRI Part 4:	FALSE
SWR Report ID:	28097			Is Battery:	FALSE
<u>Company</u>					
Company Name:		Saputo Foods Ltd.			
Trade Name En:					
Trade Name Fr:					
DUNS No:		249462144			
Website:					
<u>NPRI Report</u>					
Report ID:	26977			Repor Type ID:	1
Report Year:	2014			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	140

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Company ID:	112167			Is Compressor:	FALSE
Facility ID:	241561			Is NPRI Part 4:	FALSE
SWR Report ID:	52620			Is Battery:	FALSE
<u>Company</u>					
Company Name:		Saputo Foods Ltd.			
Trade Name En:					
Trade Name Fr:					
DUNS No:		249462144			
Website:					
<u>NPRI Report</u>					
Report ID:	114473			Repor Type ID:	1
Report Year:	2010			New Reporter:	TRUE
NPRI ID:	10913			No of Employees:	110
Company ID:	128369			Is Compressor:	FALSE
Facility ID:	241561			Is NPRI Part 4:	FALSE
SWR Report ID:	20100000010913			Is Battery:	FALSE
<u>Company</u>					
Company Name:		SAPUTO FODDS LTD.			
Trade Name En:					
Trade Name Fr:					
DUNS No:		249462144			
Website:					
<u>NPRI ID Facility ID</u>					
NPRI ID:		10913			
Facility ID:		374876			
<u>Facility</u>					
Facility ID:	374876			IDM ID:	0
Portable:	FALSE			AB Approval ID:	0
NAICS Primary:	311511			GHGRP ID:	0
NAICS Secondary:	0			ON GHGRP ID:	0
NAICS Tertiary:	0				
Facility Name:		OTTAWA			
Website:					
<u>Address</u>					
Address1:		861 Clyde Avenue			
Address2:					
City:		OTTAWA			
Postal Zip:		K1Z5A4			
Prov:					
<u>Address Geographic</u>					
Latitude:	45.3776			Datum:	1983
Longitude:	-75.7479			Land Survey:	
UTM Easting:	0.000000			Topograph:	
UTM Northing:	0.000000			Additional Info:	
UTM Zone:	0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Primary NAICS Details</u>					
NAICS Code:	311511			Start Date:	1993
Record Year:	1997			End Date:	2001
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid Milk Manufacturing			
NAICS Title Fr:		Fabrication du lait de consommation			
NAICS Description En:					
NAICS Description Fr:					
NAICS Code:	311511			Start Date:	1993
Record Year:	2002			End Date:	2006
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid Milk Manufacturing			
NAICS Title Fr:		Fabrication du lait de consommation			
NAICS Description En:					
NAICS Description Fr:					
NAICS Code:	311511			Start Date:	1993
Record Year:	2007			End Date:	2011
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid Milk Manufacturing			
NAICS Title Fr:		Fabrication du lait de consommation			
NAICS Description En:					
NAICS Description Fr:					
NAICS Code:	311511			Start Date:	2017
Record Year:	2017			End Date:	2021
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid milk manufacturing			
NAICS Title Fr:		Fabrication de lait de consommation			
NAICS Description En:					
This Canadian industry comprises establishments primarily engaged in manufacturing milk and processed milk products.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements dont l'activité principale est la fabrication de lait et de produits de lait transformé.					
NAICS Code:	311511			Start Date:	2012
Record Year:	2012			End Date:	2016
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Fluid milk manufacturing			
NAICS Title Fr:		Fabrication de lait de consommation			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

NAICS Description En:

This Canadian industry comprises establishments primarily engaged in manufacturing milk and processed milk products. Establishments primarily engaged in manufacturing substitute products are included.

NAICS Description Fr:

Cette classe canadienne comprend les établissements dont l'activité principale est la fabrication de lait et de produits de lait transformé. Sont inclus les établissements dont l'activité principale est la fabrication de succédanés.

NPRI Report

Report ID:	273043	Repor Type ID:	1
Report Year:	2003	New Reporter:	FALSE
NPRI ID:	10913	No of Employees:	120
Company ID:	138607	Is Compressor:	FALSE
Facility ID:	374876	Is NPRI Part 4:	FALSE
SWR Report ID:	20030000010913	Is Battery:	FALSE

Company

Company Name:	NEILSON DAIRY
Trade Name En:	
Trade Name Fr:	
DUNS No:	0
Website:	

NPRI Report Contact

Contact Type:	NPRI	Phone:	9057027215
First Name:	Denis	Extension:	0
Last Name:	Borys	Fax:	9058731907
Email:	denis.borys@neilsondairy.com		
Description En:	Public Contact		
Description Fr:	Responsable des renseignements au public		
Position:	Director, Technical Services		
Language:			
Company Name:			

NPRI ID Facility ID

NPRI ID:	10913
Facility ID:	275925

NPRI Report

Report ID:	56422	Repor Type ID:	1
Report Year:	2011	New Reporter:	FALSE
NPRI ID:	10913	No of Employees:	122
Company ID:	112213	Is Compressor:	FALSE
Facility ID:	275925	Is NPRI Part 4:	FALSE
SWR Report ID:	7747	Is Battery:	FALSE

Company

Company Name:	Saputo Foods Ltd.
Trade Name En:	
Trade Name Fr:	
DUNS No:	249462144

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Website:					
<u>NPRI Report</u>					
Report ID:	83555			Repor Type ID:	1
Report Year:	2017			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	117
Company ID:	112166			Is Compressor:	FALSE
Facility ID:	275925			Is NPRI Part 4:	FALSE
SWR Report ID:	97477			Is Battery:	FALSE
<u>Company</u>					
Company Name:		Saputo Foods Ltd.			
Trade Name En:					
Trade Name Fr:					
DUNS No:		249462144			
Website:					
<u>NPRI Report</u>					
Report ID:	83556			Repor Type ID:	1
Report Year:	2016			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	119
Company ID:	112166			Is Compressor:	FALSE
Facility ID:	275925			Is NPRI Part 4:	FALSE
SWR Report ID:	89710			Is Battery:	FALSE
<u>Company</u>					
Company Name:		Saputo Foods Ltd.			
Trade Name En:					
Trade Name Fr:					
DUNS No:		249462144			
Website:					
<u>NPRI Report</u>					
Report ID:	83561			Repor Type ID:	3
Report Year:	2018			New Reporter:	FALSE
NPRI ID:	10913			No of Employees:	0
Company ID:	112166			Is Compressor:	FALSE
Facility ID:	275925			Is NPRI Part 4:	FALSE
SWR Report ID:	154893			Is Battery:	FALSE
<u>Company</u>					
Company Name:		Saputo Foods Ltd.			
Trade Name En:					
Trade Name Fr:					
DUNS No:		249462144			
Website:					
<u>NPRI Report Comment</u>					
Description En:		Reason the facility does not meet the criteria for NPRI			
Description Fr:		La raison pour laquelle cette installation ne rencontre pas les critères de déclaration de l'INRP			
Comment:		Plant closed in December 2017.			
Note:		Many NPRI Report Comments are truncated in the NPRI data.			

548 erisinfo.com | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years: 2009 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 122 Waste Class Name: ALKALINE WASTES - OTHER METALS					
Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
Waste Class: 331 Waste Class Name: WASTE COMPRESSED GASES					
183	4 of 20	ENE/242.0	77.8 / 1.69	VALIFF SALES INC 1660 CARLING AVE OTTAWA ON K2A 1C5	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Vendor Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
183	5 of 20	ENE/242.0	77.8 / 1.69	Valiff Sales 1660 Carling Ave Ottawa ON	GEN
Generator No: ON6532572 SIC Code: 452991, 452999 SIC Description: Home and Auto Supplies Stores, All Other Miscellaneous General Merchandise Stores Approval Years: 2010 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
183	6 of 20	ENE/242.0	77.8 / 1.69	Valiff Sales 1660 Carling Ave Ottawa ON	GEN
Generator No:		ON6532572			
SIC Code:		452991, 452999			
SIC Description:		Home and Auto Supplies Stores, All Other Miscellaneous General Merchandise Stores			
Approval Years:		2011			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
183	7 of 20	ENE/242.0	77.8 / 1.69	Valiff Sales 1660 Carling Ave Ottawa ON K2A 1C5	GEN
Generator No:		ON6532572			
SIC Code:		452991, 452999			
SIC Description:		Home and Auto Supplies Stores, All Other Miscellaneous General Merchandise Stores			
Approval Years:		2012			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
183	8 of 20	ENE/242.0	77.8 / 1.69	Valiff Sales 1660 Carling Ave Ottawa ON	GEN
Generator No:		ON6532572			
SIC Code:		452991, 452999			
SIC Description:		HOME AND AUTO SUPPLIES STORES, ALL OTHER MISCELLANEOUS GENERAL MERCHANDISE STORES			
Approval Years:		2013			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		231			
Waste Class Name:		LATEX WASTES			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		114			
Waste Class Name:		OTHER INORGANIC ACID WASTES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		268			
Waste Class Name:		AMINES			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: 122 Waste Class Name: ALKALINE WASTES - OTHER METALS Waste Class: 222 Waste Class Name: HEAVY FUELS Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES					
183	9 of 20	ENE/242.0	77.8 / 1.69	VALIFF SALES INC 1660 CARLING AVE OTTAWA ON K2A1C5	PES
Detail Licence No: Licence No: 17227 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL: Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 613 Oper Phone No: 7253111 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
183	10 of 20	ENE/242.0	77.8 / 1.69	Valiff Sales 1660 Carling Ave Ottawa ON K2A1C5	GEN
Generator No: ON6532572 SIC Code: 452991, 452999 SIC Description: HOME AND AUTO SUPPLIES STORES, ALL OTHER MISCELLANEOUS GENERAL MERCHANDISE STORES Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Matt Gunness Choice of Contact: CO_OFFICIAL Phone No Admin: 905-795-3339 Ext. Contaminated Facility: No MHSW Facility: No <u>Detail(s)</u> Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS Waste Class: 263					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
Waste Class:		114			
Waste Class Name:		OTHER INORGANIC ACID WASTES			
Waste Class:		268			
Waste Class Name:		AMINES			
Waste Class:		135			
Waste Class Name:		REACTIVE ANION WASTES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		231			
Waste Class Name:		LATEX WASTES			
Waste Class:		222			
Waste Class Name:		HEAVY FUELS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			

[183](#)

11 of 20

ENE/242.0

77.8 / 1.69

Valiff Sales
1660 Carling Ave
Ottawa ON K2A1C5

GEN

Generator No: ON6532572
SIC Code: 452991, 452999
SIC Description: HOME AND AUTO SUPPLIES STORES, ALL OTHER MISCELLANEOUS GENERAL MERCHANDISE STORES
Approval Years: 2015
PO Box No:
Country: Canada
Status:
Co Admin: Matt Gunness
Choice of Contact: CO_OFFICIAL
Phone No Admin: 905-795-3339 Ext.
Contaminated Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Class: 268
Waste Class Name: AMINES

Waste Class: 222
Waste Class Name: HEAVY FUELS

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Class: 231

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		LATEX WASTES			
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
Waste Class:		114			
Waste Class Name:		OTHER INORGANIC ACID WASTES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		135			
Waste Class Name:		REACTIVE ANION WASTES			
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			

[183](#)

12 of 20

ENE/242.0

77.8 / 1.69

Valiff Sales
1660 Carling Ave
Ottawa ON K2A1C5

GEN

Generator No: ON6532572
SIC Code: 452991, 452999
SIC Description: HOME AND AUTO SUPPLIES STORES, ALL OTHER MISCELLANEOUS GENERAL MERCHANDISE STORES
Approval Years: 2014
PO Box No:
Country: Canada
Status:
Co Admin: Matt Gunness
Choice of Contact: CO_OFFICIAL
Phone No Admin: 905-795-3339 Ext.
Contaminated Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Class: 122
Waste Class Name: ALKALINE WASTES - OTHER METALS

Waste Class: 331
Waste Class Name: WASTE COMPRESSED GASES

Waste Class: 222
Waste Class Name: HEAVY FUELS

Waste Class: 148

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		114			
Waste Class Name:		OTHER INORGANIC ACID WASTES			
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		231			
Waste Class Name:		LATEX WASTES			
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
Waste Class:		268			
Waste Class Name:		AMINES			

[183](#)

13 of 20

ENE/242.0

77.8 / 1.69

Valiff Sales
1660 Carling Ave
Ottawa ON K2A1C5

GEN

Generator No: ON6532572
SIC Code:
SIC Description:
Approval Years: As of Dec 2018
PO Box No:
Country: Canada
Status: Registered
Co Admin:
Choice of Contact:
Phone No Admin:
Contaminated Facility:
MHSW Facility:

Detail(s)

Waste Class: 114 C
Waste Class Name: Other inorganic acid wastes

Waste Class: 122 C
Waste Class Name: Alkaline slutions - containing other metals and non-metals (not cyanide)

Waste Class: 135 R
Waste Class Name: Wastes containing other reactive anions

Waste Class: 145 I
Waste Class Name: Wastes from the use of pigments, coatings and paints

Waste Class: 145 L
Waste Class Name: Wastes from the use of pigments, coatings and paints

Waste Class: 148 C
Waste Class Name: Misc. wastes and inorganic chemicals

Waste Class: 148 I
Waste Class Name: Misc. wastes and inorganic chemicals

Waste Class: 212 L

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
Waste Class:		221 I			
Waste Class Name:		Light fuels			
Waste Class:		221 L			
Waste Class Name:		Light fuels			
Waste Class:		222 I			
Waste Class Name:		Heavy fuels			
Waste Class:		222 L			
Waste Class Name:		Heavy fuels			
Waste Class:		231 L			
Waste Class Name:		Latex wastes			
Waste Class:		242 T			
Waste Class Name:		Halogenated pesticides and herbicides			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		265 I			
Waste Class Name:		Graphic arts wastes			
Waste Class:		267 C			
Waste Class Name:		Organic acids			
Waste Class:		268 L			
Waste Class Name:		Amines			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			

[183](#)

14 of 20

ENE/242.0

77.8 / 1.69

VALIFF SALES INC
1660 CARLING AVE
OTTAWA ON K2A1C5

PES

Detail Licence No: 23-01-11848-0
Licence No: 11848
Status:
Approval Date:
Report Source: Legacy Licenses (Excluding TS)
Licence Type: Limited Vendor
Licence Type Code: 23
Licence Class: 01
Licence Control: 0
Latitude:
Longitude:
Lot:
Concession:
Region:
District:
County:
Trade Name:

Operator Box:
Operator Class:
Operator No:
Operator Type:
Oper Area Code: 613
Oper Phone No: 7253111
Operator Ext:
Operator Lot:
Oper Concession:
Operator Region: 4
Operator District: 2
Operator County: 15
Op Municipality:
Post Office Box:
MOE District:
SWP Area Name:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL:					
183	15 of 20	ENE/242.0	77.8 / 1.69	Valiff Sales 1660 Carling Ave Ottawa ON K2A1C5	GEN
Generator No:		ON6532572			
SIC Code:					
SIC Description:					
Approval Years:		As of Jul 2020			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		222 I			
Waste Class Name:		Heavy fuels			
Waste Class:		268 L			
Waste Class Name:		Amines			
Waste Class:		114 C			
Waste Class Name:		Other inorganic acid wastes			
Waste Class:		242 T			
Waste Class Name:		Halogenated pesticides and herbicides			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		231 L			
Waste Class Name:		Latex wastes			
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		148 I			
Waste Class Name:		Misc. wastes and inorganic chemicals			
Waste Class:		265 I			
Waste Class Name:		Graphic arts wastes			

558 erisinfo.com | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		222 L			
Waste Class Name:		Heavy fuels			
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		221 I			
Waste Class Name:		Light fuels			
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
Waste Class:		242 T			
Waste Class Name:		Halogenated pesticides and herbicides			
Waste Class:		222 I			
Waste Class Name:		Heavy fuels			
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		135 R			
Waste Class Name:		Wastes containing other reactive anions			
Waste Class:		114 C			
Waste Class Name:		Other inorganic acid wastes			
Waste Class:		231 L			
Waste Class Name:		Latex wastes			
Waste Class:		221 L			
Waste Class Name:		Light fuels			
Waste Class:		267 C			
Waste Class Name:		Organic acids			
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
Waste Class:		253 L			
Waste Class Name:		Emulsified oils			
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		263 C			
Waste Class Name:		Misc. waste organic chemicals			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
Waste Class:		148 I			
Waste Class Name:		Misc. wastes and inorganic chemicals			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
Waste Class:		265 I			
Waste Class Name:		Graphic arts wastes			
Waste Class:		268 L			
Waste Class Name:		Amines			
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
183	18 of 20	ENE/242.0	77.8 / 1.69	Valiff Sales 1660 Carling Ave Ottawa ON K2A1C5	GEN
Generator No:		ON6532572			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		222 I			
Waste Class Name:		HEAVY FUELS			
Waste Class:		268 L			
Waste Class Name:		AMINES			
Waste Class:		213 I			
Waste Class Name:		PETROLEUM DISTILLATES			
Waste Class:		252 L			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		263 L			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		222 L			
Waste Class Name:		HEAVY FUELS			
Waste Class:		145 I			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Class:		263 C			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
Waste Class:		148 C			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Class:		221 I			
Waste Class Name:		LIGHT FUELS			
Waste Class:		148 I			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		221 L LIGHT FUELS			
Waste Class: Waste Class Name:		114 C OTHER INORGANIC ACID WASTES			
Waste Class: Waste Class Name:		263 I ORGANIC LABORATORY CHEMICALS			
Waste Class: Waste Class Name:		212 L ALIPHATIC SOLVENTS			
Waste Class: Waste Class Name:		265 I GRAPHIC ART WASTES			
Waste Class: Waste Class Name:		331 I WASTE COMPRESSED GASES			
Waste Class: Waste Class Name:		269 T NON-HALOGENATED PESTICIDES			
Waste Class: Waste Class Name:		145 L PAINT/PIGMENT/COATING RESIDUES			
Waste Class: Waste Class Name:		242 T HALOGENATED PESTICIDES			
Waste Class: Waste Class Name:		253 L EMULSIFIED OILS			
Waste Class: Waste Class Name:		135 R REACTIVE ANION WASTES			
Waste Class: Waste Class Name:		267 C ORGANIC ACIDS			
Waste Class: Waste Class Name:		231 L LATEX WASTES			
Waste Class: Waste Class Name:		122 C ALKALINE WASTES - OTHER METALS			
183	19 of 20	ENE/242.0	77.8 / 1.69	Canadian Tire Real Estate Limited 1660 Carling Ave Ottawa ON K2A 1C5	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:		ON9805215 As of Oct 2022 Canada Registered			
<u>Detail(s)</u>					
Waste Class: Waste Class Name:		221 L LIGHT FUELS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
183	20 of 20	ENE/242.0	77.8 / 1.69	1660 Carling Avenue Ottawa ON K2A 1C5	EHS
Order No:		22071400544		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State: ON	
Report Date:		19-JUL-22		Search Radius (km): .25	
Date Received:		14-JUL-22		X: -75.7491351	
Previous Site Name:				Y: 45.378909	
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; City Directory			
184	1 of 1	E/242.3	76.8 / 0.69	861 CLYDE AV. Ottawa ON	WWIS
Well ID:		7326560		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Other		Data Src:	
Final Well Status:		Test Hole		Date Received: 12/11/2018	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z298102		Contractor: 7241	
Tag:		A257537		Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:		1007343907		Tag No: A257537	
Depth M:		5.6388		Contractor: 7241	
Year Completed:		2018		Latitude: 45.3772422851956	
Well Completed Dt:		10/12/2018		Longitude: -75.7483744332163	
Audit No:		Z298102		Y: 45.377242278435105	
Path:				X: -75.74837427088184	
<u>Bore Hole Information</u>					
Bore Hole ID:		1007343907		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 18	
Code OB:				East83: 441405.00	
Code OB Desc:				North83: 5025131.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed:		10/12/2018		UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007713635			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007713634			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007713636			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		7.0			
Formation End Depth:		18.5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713898			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713902			
Layer:		5			
Plug From:		3.5			
Plug To:		8.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713901			
Layer:		4			
Plug From:		3.0			
Plug To:		3.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713900			
Layer:		3			
Plug From:		1.5			
Plug To:		3.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713899			
Layer:		2			
Plug From:		1.0			
Plug To:		1.5			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007714269			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007713360			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007714360			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter:		1.6799999475479126			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007714459			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.0			
Screen End Depth:		8.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.899999976158142			
<u>Hole Diameter</u>					
Hole ID:		1007714152			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		8.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
185	1 of 1	NW/242.4	74.9 / -1.25	OTTAWA CITY BRIARWOOD AVE./TILLBURY AVE. OTTAWA CITY ON	CA
Certificate #:		3-1073-90-			
Application Year:		90			
Issue Date:		6/18/1990			
Approval Type:		Municipal sewage			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
186	1 of 1	E/242.9	76.8 / 0.66	861 Clyde Avenue lot I con A Ottawa ON	WWIS
Well ID:		7337588		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	
Water Type:				05/28/2019	
Casing Material:				Selected Flag:	
Audit No:		Z311188		TRUE	
Tag:		A265338		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				7241	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				7	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				OTTAWA-CARLETON	
				Lot:	
				I	
				Concession:	
				A	
				Concession Name:	
				OF	
				Easting NAD83:	
				Northina NAD83:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Static Water Level: Clear/Cloudy: Municipality: Site Info:				Zone: UTM Reliability:	
		NEPEAN TOWNSHIP			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/733\7337588.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/01/2019			
Year Completed:		2019			
Depth (m):		12.19			
Latitude:		45.3768189240954			
Longitude:		-75.7484199360469			
X:		-75.74841977416513			
Y:		45.3768189173955			
Path:		733\7337588.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007526933		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441401.00
Code OB Desc:				North83:	5025084.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		04/01/2019		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007858744			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		26			
Material 1 Desc:		ROCK			
Material 2:		15			
Material 2 Desc:		LIMESTONE			
Material 3:		71			
Material 3 Desc:		FRACTURED			
Formation Top Depth:		2.740000009536743			
Formation End Depth:		12.1899995803833			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007858743			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		06			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		SILT			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.740000009536743			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007858742			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007860157			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		8.829999923706055			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007860156			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007860158			
Layer:		3			
Plug From:		8.829999923706055			
Plug To:		12.1899995803833			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u> <u>Use</u>					
Method Construction ID:		1007861464			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1007856972			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007861862			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		9.140000343322754			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007862425			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.140000343322754			
Screen End Depth:		12.1899995803833			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007863137			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007861075			
Diameter:		8.5			
Depth From:		1.309999942779541			
Depth To:		12.1899995803833			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID:		1007861074			
Diameter:		20.799999237060547			
Depth From:		0.0			
Depth To:		1.309999942779541			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

[187](#) 1 of 1 WSW/242.9 78.9 / 2.75 ON [WWIS](#)

Well ID:	1508736	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Domestic	Data Entry Status:	
Use 2nd:	0	Data Src:	1
Final Well Status:	Water Supply	Date Received:	12/08/1952
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:		Contractor:	4833
Tag:		Form Version:	1
Constructn Method:		Owner:	
Elevation (m):		County:	OTTAWA-CARLETON
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508736.pdf

Additional Detail(s) (Map)

Well Completed Date:	05/27/1952
Year Completed:	1952
Depth (m):	39.9288
Latitude:	45.3752194921503
Longitude:	-75.7561933062782
X:	-75.75619314450881
Y:	45.3752194851477
Path:	150\1508736.pdf

Bore Hole Information

Bore Hole ID:	10030770	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440790.70
Code OB Desc:		North83:	5024912.00
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	05/27/1952	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	p9
Location Method Desc:	Original Pre1985 UTM Rel Code 9: unknown UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931010455			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		5.0			
Formation End Depth:		131.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931010454			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		02			
Material 2 Desc:		TOPSOIL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961508736			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10579340			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930054174			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		131.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		930054173			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		25.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508736			
Pump Set At:					
Static Level:		12.0			
Final Level After Pumping:		35.0			
Recommended Pump Depth:					
Pumping Rate:		4.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		12			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933463386			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		120.0			
Water Found Depth UOM:		ft			
<u>188</u>	1 of 1	WSW/243.0	78.9 / 2.75	ON	BORE
Borehole ID:	612784			Inclin FLG:	No
OGF ID:	215514090			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:				Municipality:	
Static Water Level:	10.1			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.37531
Total Depth m:	-999			Longitude DD:	-75.756322
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	440781
Drill Method:				Northing:	5024922
Orig Ground Elev m:	79.2			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	78.4				
Concession:					
Location D:					
Survey D:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comments:					
Borehole Geology Stratum					
Geology Stratum ID:	218392488			Mat Consistency:	Firm
Top Depth:	4.6			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:	Blue			Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Limestone			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. 00100ONE. BLUE. SHALE. BROWN. 0006600195 SAND. FIRM. BOULDERS. SILT. B **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218392487			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	4.6			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	CLAY.				
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	H			Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: OTTAWA2.txt RecordID: 052920 NTS_Sheet: 31G05F				
Confiden 1:	Logged by professional. Exact and complete description of material and properties.				
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
189	1 of 1	NE/243.6	77.8 / 1.68	TRANSMISSIONS AUTOMOTIVE 757 COLE AVE. OTTAWA ON K2A 3W7	GEN
Generator No:	ON0175000				
SIC Code:	0000				
SIC Description:	*** NOT DEFINED ***				
Approval Years:	86,87,88,89,90,92,93,94				
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:					
190	1 of 1	E/243.6	76.8 / 0.70	861 CLYDE AVENUE Ottawa ON	WWIS
Well ID:		7271920	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring and Test Hole	Data Entry Status:		
Use 2nd:		0	Data Src:		
Final Well Status:		Observation Wells	Date Received:		09/22/2016
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z233047	Contractor:		7241
Tag:		A191193	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
Additional Detail(s) (Map)					
Bore Hole ID:		1006252127	Tag No:		A191193
Depth M:		2.13	Contractor:		7241
Year Completed:		2016	Latitude:		45.3777368976026
Well Completed Dt:		08/10/2016	Longitude:		-75.7484448185656
Audit No:		Z233047	Y:		45.37773689111773
Path:			X:		-75.74844465741229
Bore Hole Information					
Bore Hole ID:		1006252127	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		18
Code OB:			East83:		441400.00
Code OB Desc:			North83:		5025186.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		4
Date Completed:		08/10/2016	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:			Location Method:		wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:		1006338507			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.3700000047683716			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006338506			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1006338508			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.3700000047683716			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1006338518			
Layer:		3			
Plug From:		1.5199999809265137			
Plug To:		2.130000114440918			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1006338516			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1006338517			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006338515			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006338505			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006338511			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8200000524520874			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006338512			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8200000524520874			
Screen End Depth:		2.130000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1006338510			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006338509			
Diameter:		8.5			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		2.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

[191](#) 1 of 1 E/243.9 76.8 / 0.64 ON WWIS

Well ID:	7267058	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	
Final Well Status:		Date Received:	01/21/2016
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	C12372	Contractor:	7241
Tag:	A173816	Form Version:	6
Constructn Method:		Owner:	
Elevation (m):		County:	OTTAWA-CARLETON
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	OTTAWA CITY		
Site Info:			

Additional Detail(s) (Map)

Bore Hole ID:	1006176744	Tag No:	A173816
Depth M:		Contractor:	7241
Year Completed:	2015	Latitude:	45.3766295775583
Well Completed Dt:	10/27/2015	Longitude:	-75.7484685255753
Audit No:	C12372	Y:	45.37662957143109
Path:		X:	-75.74846836403881

Bore Hole Information

Bore Hole ID:	1006176744	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	441397.00
Code OB Desc:		North83:	5025063.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	10/27/2015	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

[192](#) 1 of 1 E/244.1 76.8 / 0.70 ON WWIS

Well ID:	7379169	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:		Data Entry Status:	Yes
Use 2nd:		Data Src:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status: Water Type: Casing Material: Audit No: C17637 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info: Date Received: 01/27/2021 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map)					
Bore Hole ID: 1008615685 Depth M: Year Completed: Well Completed Dt: Audit No: C17637 Path: Tag No: Contractor: 7241 Latitude: 45.3775123020158 Longitude: -75.748377995203 Y: 45.37751229521217 X: -75.74837783357614					
Bore Hole Information					
Bore Hole ID: 1008615685 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 441405.00 North83: 5025161.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
193	1 of 1	E/244.9	76.8 / 0.70	861 CLYDE RD OTTAWA ON	WWIS
Well ID: 7155920 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z116188 Tag: A097277 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 12/08/2010 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7155920.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/28/2010			
Year Completed:		2010			
Depth (m):		7.32			
Latitude:		45.3777100632948			
Longitude:		-75.7484189203417			
X:		-75.74841875809521			
Y:		45.377710056441515			
Path:		715\7155920.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003433948		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441402.00
Code OB Desc:				North83:	5025183.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		10/28/2010		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003723976			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		2.130000114440918			
Formation End Depth:		7.320000171661377			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003723974			
Layer:		1			
Color:		6			
General Color:		BROWN			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003723975			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003723986			
Layer:		1			
Plug From:		0.0			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003723984			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003723973			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003723980			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:		0.0			
Depth To:		2.740000009536743			
Casing Diameter:		10.15999984741211			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:			1003723981		
Layer:			1		
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:			4		
Screen Depth UOM:			m		
Screen Diameter UOM:			cm		
Screen Diameter:					
<u>Water Details</u>					
Water ID:			1003723979		
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:			m		
<u>Hole Diameter</u>					
Hole ID:			1003723977		
Diameter:			11.430000305175781		
Depth From:			0.0		
Depth To:			2.740000009536743		
Hole Depth UOM:			m		
Hole Diameter UOM:			cm		
<u>Hole Diameter</u>					
Hole ID:			1003723978		
Diameter:			7.619999885559082		
Depth From:			2.740000009536743		
Depth To:			7.320000171661377		
Hole Depth UOM:			m		
Hole Diameter UOM:			cm		
<u>194</u>	1 of 1	SE/245.1	78.1 / 2.01	D LYALL HANES LTD 894 BOYD AVE OTTAWA ON K2A 2E3	SCT
Established:			1945		
Plant Size (ft²):			4500		
Employment:			2		
<u>--Details--</u>					
Description:			WOOD HOUSEHOLD FURNITURE, EXCEPT UPHOLSTERED		
SIC/NAICS Code:			2511		
Description:			WOOD HOUSEHOLD FURNITURE, UPHOLSTERED		
SIC/NAICS Code:			2512		
Description:			Upholstered Household Furniture Manufacturing		
SIC/NAICS Code:			337121		
Description:			Other Wood Household Furniture Manufacturing		
SIC/NAICS Code:			337123		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
195	1 of 1	SSW/245.2	78.9 / 2.74	ON	WWIS
Well ID: 1508087 Construction Date: Use 1st: Not Used Use 2nd: 0 Final Well Status: Abandoned-Supply Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: 1 Date Received: 09/07/1954 Selected Flag: TRUE Abandonment Rec: Contractor: 3725 Form Version: 1 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1508087.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 08/18/1954 Year Completed: 1954 Depth (m): 44.196 Latitude: 45.3746038063639 Longitude: -75.7540139623771 X: -75.75401380006453 Y: 45.37460379908597 Path: 150\1508087.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 10030122 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 08/18/1954 Remarks: Location Method Desc: Original Pre1985 UTM Rel Code 9: unknown UTM Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 440960.70 North83: 5024842.00 Org CS: UTMRC: 9 UTMRC Desc: unknown UTM Location Method: p9					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 931008767 Layer: 4					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		58.0			
Formation End Depth:		83.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008768			
Layer:		5			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		83.0			
Formation End Depth:		108.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008764			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008769			
Layer:		6			
Color:					
General Color:					
Material 1:		18			
Material 1 Desc:		SANDSTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		108.0			
Formation End Depth:		113.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008766			
Layer:		3			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		43.0			
Formation End Depth:		58.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008770			
Layer:		7			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		113.0			
Formation End Depth:		145.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008765			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		43.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961508087			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578692			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930052902			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		145.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Casing</u>					
Casing ID:		930052901			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		13.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991508087			
Pump Set At:					
Static Level:		142.0			
Final Level After Pumping:		145.0			
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
 <u>Water Details</u>					
Water ID:		933462454			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		145.0			
Water Found Depth UOM:		ft			
196	1 of 1	E/245.3	76.8 / 0.69	581 CLYDE AV Ottawa ON	WWIS
Well ID:	7326721			Flowing (Y/N):	
Construction Date:				Flow Rate:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	12/11/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z298106			Contractor:	7241
Tag:	A257533			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7326721.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/10/2018			
Year Completed:		2018			
Depth (m):		4.572			
Latitude:		45.3772245351042			
Longitude:		-75.748335883097			
X:		-75.74833572149234			
Y:		45.37722452815828			
Path:		732\7326721.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007349903		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441408.00
Code OB Desc:				North83:	5025129.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		10/10/2018		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007723699			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		HARD			
Formation Top Depth:		8.5			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007723697			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		5.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007723696			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.0			
Formation End Depth:		5.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007723698			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		6.0			
Formation End Depth:		8.5			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007723695			
Layer:		1			
Color:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		GREY			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007723821			
Layer:		4			
Plug From:		9.5			
Plug To:		10.5			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007723822			
Layer:		5			
Plug From:		10.5			
Plug To:		15.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007723818			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007723820			
Layer:		3			
Plug From:		2.0			
Plug To:		9.5			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007723819			
Layer:		2			
Plug From:		1.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007723915			
Method Construction Code:		D			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Direct Push			
Other Method Construction:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007723916			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007723541			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007723956			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		11.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007723992			
Layer:		1			
Slot:		10			
Screen Top Depth:		11.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
<u>Hole Diameter</u>					
Hole ID:		1007723872			
Diameter:		2.34999999046325684			
Depth From:		9.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007723871			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		9.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
197	1 of 3	E/245.3	76.8 / 0.69	561 CLYDE AV Ottawa ON	WWIS
Well ID: 7326589				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st: Test Hole				Data Entry Status:	
Use 2nd: Other				Data Src:	
Final Well Status: Test Hole				Date Received: 12/11/2018	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: Z298104				Contractor: 7241	
Tag: A257534				Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: NEPEAN TOWNSHIP					
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1007344543				Tag No: A257534	
Depth M: 5.0292				Contractor: 7241	
Year Completed: 2018				Latitude: 45.3772875390308	
Well Completed Dt: 10/10/2018				Longitude: -75.7483367141794	
Audit No: Z298104				Y: 45.377287532460464	
Path:				X: -75.74833655242836	
<u>Bore Hole Information</u>					
Bore Hole ID: 1007344543				Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 18	
Code OB:				East83: 441408.00	
Code OB Desc:				North83: 5025136.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed: 10/10/2018				UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Location Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1007713707					
Layer: 1					
Color: 2					
General Color: GREY					
Material 1: 27					
Material 1 Desc: OTHER					
Material 2: 11					
Material 2 Desc: GRAVEL					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007713708			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		1.0			
Formation End Depth:		9.5			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007713709			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		9.5			
Formation End Depth:		16.5			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007713982			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007713985			
Layer:		4			
Plug From:		10.5			
Plug To:		11.5			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007713984			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		3			
Plug From:		1.5			
Plug To:		10.5			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713983			
Layer:		2			
Plug From:		1.0			
Plug To:		1.5			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713986			
Layer:		5			
Plug From:		11.5			
Plug To:		16.5			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007714291			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:		DIAMOND			
 <u>Pipe Information</u>					
Pipe ID:		1007713388			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007714385			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		12.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007714484			
Layer:		1			
Slot:		10			
Screen Top Depth:		12.0			
Screen End Depth:		16.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007714529			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007714186			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		9.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>Hole Diameter</u>					
Hole ID:		1007714187			
Diameter:		2.375			
Depth From:		9.5			
Depth To:		16.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
197	2 of 3	E/245.3	76.8 / 0.69	561 CLYDE AV Ottawa ON	WWIS
Well ID:	7326590			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	12/11/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z229538			Contractor:	7241
Tag:	A257532			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7326590.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	10/10/2018				
Year Completed:	2018				
Depth (m):	2.5908				
Latitude:	45.3772875390308				
Longitude:	-75.7483367141794				
X:	-75.74833655242836				
Y:	45.377287532460464				
Path:	732\7326590.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1007344546	Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone:		18	
Code OB:		East83:		441408.00	
Code OB Desc:		North83:		5025136.00	
Open Hole:		Org CS:		UTM83	
Cluster Kind:		UTMRC:		4	
Date Completed:	10/10/2018	UTMRC Desc:		margin of error : 30 m - 100 m	
Remarks:		Location Method:		wwr	
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1007713710				
Layer:	1				
Color:	2				
General Color:	GREY				
Material 1:	27				
Material 1 Desc:	OTHER				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1007713711				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	09				
Material 1 Desc:	MEDIUM SAND				
Material 2:	85				
Material 2 Desc:	SOFT				
Material 3:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:					
Formation Top Depth:		1.0			
Formation End Depth:		8.5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713990			
Layer:		4			
Plug From:		3.0			
Plug To:		3.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713987			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713988			
Layer:		2			
Plug From:		1.0			
Plug To:		1.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713991			
Layer:		5			
Plug From:		3.5			
Plug To:		8.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713989			
Layer:		3			
Plug From:		1.5			
Plug To:		3.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007714292			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID:		1007713389			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007714386			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.0			
Casing Diameter:		1.6799999475479126			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007714485			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.0			
Screen End Depth:		8.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.899999976158142			
 <u>Hole Diameter</u>					
Hole ID:		1007714188			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		8.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
197	3 of 3	E/245.3	76.8 / 0.69	ON	WWIS
Well ID:	7379176			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	01/27/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	C17638			Contractor:	7241
Tag:				Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008615706			Tag No:	
Depth M:				Contractor:	7241
Year Completed:				Latitude:	45.3772875390308
Well Completed Dt:				Longitude:	-75.7483367141794
Audit No:	C17638			Y:	45.377287532460464
Path:				X:	-75.74833655242836
<u>Bore Hole Information</u>					
Bore Hole ID:	1008615706			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441408.00
Code OB Desc:				North83:	5025136.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:				UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

198	1 of 1	E/245.6	76.8 / 0.66	861 CLYDE STREET Ottawa ON	WWIS
Well ID:	7119478			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	0			Date Received:	02/23/2009
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	M04402			Contractor:	7241
Tag:	A080354			Form Version:	5
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/7117119478.pdf				

Additional Detail(s) (Map)

Well Completed Date: 01/30/2009
Year Completed: 2009
Depth (m): 4.57
Latitude: 45.3774914051475
Longitude: -75.7474453599577
X: -75.7474451984674
Y: 45.37749139815636

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:		711\7119478.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/711\7119478.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		01/30/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.3767830892133			
Longitude:		-75.748393919526			
X:		-75.74839375806785			
Y:		45.376783082135326			
Path:		711\7119478.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1002743530	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		18
Code OB:			East83:		441403.00
Code OB Desc:			North83:		5025080.00
Open Hole:			Org CS:		UTM83
Cluster Kind:		This is a record from cluster log sheet	UTMRC:		3
Date Completed:		01/30/2009	UTMRC Desc:		margin of error : 10 - 30 m
Remarks:			Location Method:		wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002743534			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1002743533			
Method Construction Code:					
Method Construction:					
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1002743535			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1002743537			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		0.9100000262260437			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1002743536			
Layer:					
Slot:					
Screen Top Depth:		0.9100000262260437			
Screen End Depth:		4.519999980926514			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1002743538			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1002743532			
Diameter:		5.079999923706055			
Depth From:					
Depth To:		4.570000171661377			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:		1002018945		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441478.00
Code OB Desc:				North83:	5025158.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		01/30/2009		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002743541			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.740000009536743			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1002743540			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		2.740000009536743			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002743543			
Layer:		2			
Plug From:		0.9100000262260437			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1002743542			
Layer:		1			
Plug From:		0.0			
Plug To:		0.9100000262260437			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID: 1002743548 Method Construction Code: D Method Construction: Direct Push Other Method Construction:					
Pipe Information					
Pipe ID: 1002743539 Casing No: 0 Comment: Alt Name:					
Construction Record - Casing					
Casing ID: 1002743544 Layer: 1 Material: 5 Open Hole or Material: PLASTIC Depth From: 0.0 Depth To: 0.9100000262260437 Casing Diameter: 3.450000047683716 Casing Diameter UOM: cm Casing Depth UOM: m					
Construction Record - Screen					
Screen ID: 1002743545 Layer: 1 Slot: Screen Top Depth: 0.9100000262260437 Screen End Depth: 4.570000171661377 Screen Material: 5 Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter: 3.450000047683716					
199	1 of 1	E/245.9	76.8 / 0.67	861 CLYDE AV. Ottawa ON	WWIS
Well ID: 7326564 Construction Date: Use 1st: Test Hole Use 2nd: Other Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z229540 Tag: A257541 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 12/11/2018 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7326564.pdf					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/13/2018			
Year Completed:		2018			
Depth (m):		5.4864			
Latitude:		45.3770805261264			
Longitude:		-75.7483339834904			
X:		-75.74833382156838			
Y:		45.37708051914293			
Path:		732\7326564.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1007343919			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441408.00
Code OB Desc:				North83:	5025113.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	10/13/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007713652				
Layer:	4				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	8.5				
Formation End Depth:	18.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007713650				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	09				
Material 1 Desc:	MEDIUM SAND				
Material 2:					
Material 2 Desc:					
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	1.0				
Formation End Depth:	7.5				
Formation End Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007713651			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		7.5			
Formation End Depth:		8.5			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007713649			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713921			
Layer:		4			
Plug From:		9.5			
Plug To:		10.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713919			
Layer:		2			
Plug From:		1.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713922			
Layer:		5			
Plug From:		10.5			
Plug To:		18.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713920			
Layer:		3			
Plug From:		2.0			
Plug To:		9.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713918			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007714273			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007713364			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007714364			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		11.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007714463			
Layer:		1			
Slot:		10			
Screen Top Depth:		11.0			
Screen End Depth:		18.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
<u>Hole Diameter</u>					
Hole ID:		1007714159			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Diameter:		2.875			
Depth From:		0.0			
Depth To:		8.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1007714160			
Diameter:		2.375			
Depth From:		8.5			
Depth To:		18.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

200	1 of 1	E/246.2	76.8 / 0.66	ON	WWIS
Well ID:	7379179			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	01/28/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	C17627			Contractor:	7241
Tag:				Form Version:	8
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					

Additional Detail(s) (Map)

Bore Hole ID:	1008615715	Tag No:	
Depth M:		Contractor:	7241
Year Completed:		Latitude:	45.3767200016009
Well Completed Dt:		Longitude:	-75.7484058591662
Audit No:	C17627	Y:	45.376719995239796
Path:		X:	-75.74840569757767

Bore Hole Information

Bore Hole ID:	1008615715	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	441402.00
Code OB Desc:		North83:	5025073.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
201	1 of 1	E/246.9	76.8 / 0.70	ON	WWIS
Well ID: 7379165 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: C17611 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 01/27/2021 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 8 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map)					
Bore Hole ID: 1008615673 Depth M: Year Completed: 2020 Well Completed Dt: 11/20/2020 Audit No: C17611 Path: Tag No: Contractor: 7241 Latitude: 45.3776203924195 Longitude: -75.7483666490377 Y: 45.37762038510638 X: -75.74836648695039					
Bore Hole Information					
Bore Hole ID: 1008615673 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 11/20/2020 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 441406.00 North83: 5025173.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
202	1 of 20	WSW/247.4	77.9 / 1.75	DALYS SERVICE CENTRE 1859 CARLING AV OTTAWA ON K2A 1E4	PRT
Location ID: 10820 Type: retail					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Expiry Date: Capacity (L): Licence #:		1991-07-31 0 0050990001			
202	2 of 20	WSW/247.4	77.9 / 1.75	IMPERIAL OIL LIMITED 1859 CARLING AVENUE (SWM) OTTAWA CITY ON K2A 1E4	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		3-1514-97- 97 11/7/1997 Municipal sewage Approved 			
202	3 of 20	WSW/247.4	77.9 / 1.75	CARLING TIGER EXPRESS ATTN NISAR ABBASI 1859 CARLING AV OTTAWA ON K2A 1E4	FSTH
License Issue Date: Tank Status: Tank Status As Of: Operation Type: Facility Type:		10/31/2003 Licensed August 2007 Retail Fuel Outlet Gasoline Station - Self Serve			
--Details--					
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:		Active 1998 46000 Liquid Fuel Double Wall UST - Gasoline			
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:		Active 1998 46000 Liquid Fuel Double Wall UST - Gasoline			
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:		Active 1998 46000 Liquid Fuel Double Wall UST - Gasoline			
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:		Active 1998 138000 Liquid Fuel Double Wall UST - Gasoline			
202	4 of 20	WSW/247.4	77.9 / 1.75	Essroc Canada Inc.	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				1859 Carling Ave Ottawa ON K2A 1E4	
Ref No:	0717-5QDSCP			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	8/13/2003			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	Oil
MOE Reported Dt:	8/13/2003			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa				
Nearest Watercourse:					
Site Name:	ESSO SERVICE STATION<UNOFFICIAL>				
Site Address:					
Site Region:	Eastern				
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:	Pipe Or Hose Leak				
Incident Preceding Spill:					
Environment Impact:	Not Anticipated				
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Client Type:					
Source Type:					
Contaminant Code:	12				
Contaminant Name:	GASOLINE				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:	Land				
Incident Reason:	Equipment Failure				
Incident Summary:	ESSO Str: Carling Ave; Gas Spill				
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:					
SAC Action Class:	Spills				
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					
Client Name:	Essroc Canada Inc.				

202	5 of 20	WSW/247.4	77.9 / 1.75	Esso Imperial Oil<UNOFFICIAL> 1859 Carling Ave, at Carling and Maitland Ottawa ON	SPL
Ref No:	3575-5QDSDA			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	8/13/2003			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	Oil
MOE Reported Dt:	8/13/2003			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: ESSO IMPERIAL OIL<UNOFFICIAL> Site Address: Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Incident Cause: Pipe Or Hose Leak Incident Preceding Spill: Environment Impact: Possible Health Env Consequence: Nature of Impact: Soil Contamination Contaminant Qty: 13.65 L Contaminant Qty 1: 13.65 Contaminant Unit: L Client Type: Source Type: Contaminant Code: 12 Contaminant Name: GASOLINE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Incident Reason: Equipment Failure Incident Summary: TSSA/MOE - Campbell Landing Marina - gas pump Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Service Station SAC Action Class: Spills Call Report Locatn Geodata: Time Reported: System Facility Address: Client Name: Esso Imperial Oil<UNOFFICIAL>					
202	6 of 20	WSW/247.4	77.9 / 1.75	CARLING TIGER EXPRESS ATTN NISAR ABBASI 1859 CARLING AV OTTAWA ON K2A 1E4	FSTH
License Issue Date: 10/31/2003 4:07:00 PM Tank Status: Licensed Tank Status As Of: December 2008 Operation Type: Retail Fuel Outlet Facility Type: Gasoline Station - Self Serve					
--Details--					
Status: Active Year of Installation: 1998 Corrosion Protection: Capacity: 46000 Tank Fuel Type: Liquid Fuel Double Wall UST - Gasoline					
Status: Active Year of Installation: 1998					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Corrosion Protection:					
Capacity:		46000			
Tank Fuel Type:		Liquid Fuel Double Wall UST - Gasoline			
Status:		Active			
Year of Installation:		1998			
Corrosion Protection:					
Capacity:		46000			
Tank Fuel Type:		Liquid Fuel Double Wall UST - Gasoline			
Status:		Active			
Year of Installation:		1998			
Corrosion Protection:					
Capacity:		138000			
Tank Fuel Type:		Liquid Fuel Double Wall UST - Gasoline			
202	7 of 20	WSW/247.4	77.9 / 1.75	1048460 ONTARIO LTD O/A CARLING ESSO 1859 CARLING AV OTTAWA ON K2A 1E4	DTNK
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:	9707149			Expired Date:	5/20/2009
Status:	EXPIRED			Max Hazard Rank:	
Instance ID:				Facility Location:	
Instance Type:	FS Facility			Facility Type:	
Instance Creation Dt:				Fuel Type 2:	
Instance Install Dt:				Fuel Type 3:	
Item Description:				Panam Related:	
Manufacturer:				Panam Venue Nm:	
Model:				External Identifier:	
Serial No:				Item:	
ULC Standard:				Piping Steel:	
Quantity:				Piping Galvanized:	
Unit of Measure:				Tank Single Wall St:	
Overfill Prot Type:				Piping Underground:	
Creation Date:				Tank Underground:	
Next Periodic Str DT:				Source:	
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:					
Original Source:	EXP				
Record Date:	Up to May 2013				
202	8 of 20	WSW/247.4	77.9 / 1.75	CARLING TIGER EXPRESS ATTN NISAR ABBASI 1859 CARLING AV OTTAWA ON	DTNK

Delisted Expired Fuel Safety Facilities

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Instance No: 11388351 Status: EXPIRED Instance ID: 81917 Instance Type: FS Piping Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Piping Original Source: EXP Record Date: Up to Mar 2012 Expired Date: Max Hazard Rank: Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:					
202	9 of 20	WSW/247.4	77.9 / 1.75	MAC'S CONVENIENCE STORES INC. 1859 CARLING AVE OTTAWA ON	FST
Inventory No: 11527654 Inventory Status: active Installation Year: 1998 Capacity: 46000 Capacity Unit: L Tank Type: Double Wall UST Manufacturer: Model: Description: 2009VBS; VeederRoot protection; 2010VB FDF [attached to SR# 009707159-013] Tank Material: Fiberglass (FRP) Corrosion Protect: Overfill Protection: Inventory Context: FS Liquid Fuel Inventory Item: FS Liquid Fuel Tank					
202	10 of 20	WSW/247.4	77.9 / 1.75	MAC'S CONVENIENCE STORES INC. 1859 CARLING AVE OTTAWA ON	FST
Inventory No: 11527631 Inventory Status: active Installation Year: 1998 Capacity: 46000 Capacity Unit: L Tank Type: Double Wall UST Manufacturer: Model: Description: 2009VBS; VeederRoot protection; 2010VB FDF [attached to SR# 009707159-013] Tank Material: Fiberglass (FRP) Corrosion Protect: Overfill Protection: Inventory Context: FS Liquid Fuel Inventory Item: FS Liquid Fuel Tank					
202	11 of 20	WSW/247.4	77.9 / 1.75	MAC'S CONVENIENCE STORES INC. 1859 CARLING AVE	FST

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OTTAWA ON					
Inventory No: Inventory Status: Installation Year: Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description:	11502751 active 1998 46000 L Double Wall Horizontal AST 2009VBS; VeederRoot protection; 2010VB FDF [attached to SR# 009707159-013]			Tank Material: Corrosion Protect: Overfill Protection: Inventory Context: Inventory Item:	Fiberglass (FRP) FS Liquid Fuel FS Liquid Fuel Tank
202	12 of 20	WSW/247.4	77.9 / 1.75	1859 CARLING AVE OTTAWA ON	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20150427154 C Standard Report 01-MAY-15 27-APR-15 			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	 ON .25 -75.757341 45.376346
202	13 of 20	WSW/247.4	77.9 / 1.75	Mac's Convenience Stores Inc. 1859 Carling Avenue Ottawa ON K2A1E4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:	ON9071691 447110 447110 2016 Canada Kathryn Maton CO_ADMIN 613-617-9237 Ext. No No				
<u>Detail(s)</u>					
Waste Class: Waste Class Name:	221 LIGHT FUELS				
202	14 of 20	WSW/247.4	77.9 / 1.75	Mac's Convenience Stores Inc. 1859 Carling Ave Ottawa ON K2A 1E4	GEN
Generator No: SIC Code: SIC Description: Approval Years: PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin:	ON6624313 As of Nov 2021 Canada Registered 				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		221 I			
Waste Class Name:		Light fuels			
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
202	15 of 20	WSW/247.4	77.9 / 1.75	Mac's Convenience Stores Inc. 1859 Carling Ave Ottawa ON K2A 1E4	GEN
Generator No:		ON6624313			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		221 I			
Waste Class Name:		LIGHT FUELS			
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
202	16 of 20	WSW/247.4	77.9 / 1.75	CARLING TIGER EXPRESS ATTN NISAR ABBASI 1859 CARLING AVE OTTAWA ON	EXP
Inventory No:	11388302			Tank Material:	Steel
Inventory Status:	EXPIRED			Corrosion Protect:	Sacrificial anode
Installation Year:	1986			Overfill Protection:	
Capacity:	22700			Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		2009VBS Removed 1998			
Previous Fuel Type:		Gasoline			
202	17 of 20	WSW/247.4	77.9 / 1.75	CARLING TIGER EXPRESS ATTN NISAR ABBASI 1859 CARLING AVE OTTAWA ON	EXP
Inventory No:	10899161			Tank Material:	Steel
Inventory Status:	EXPIRED			Corrosion Protect:	Sacrificial anode
Installation Year:	1986			Overfill Protection:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type:	22700			Inventory Context: Inventory Item: FS Liquid Fuel Tank FS LIQUID FUEL TANK	
		2009VBS Removed 1998 Gasoline			
202	18 of 20	WSW/247.4	77.9 / 1.75	CARLING TIGER EXPRESS ATTN NISAR ABBASI 1859 CARLING AVE OTTAWA ON	EXP
Inventory No: Inventory Status: Installation Year: Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type:	11388322 EXPIRED 1986 22700			Tank Material: Corrosion Protect: Overfill Protection: Inventory Context: Inventory Item: Steel Sacrificial anode FS Liquid Fuel Tank FS LIQUID FUEL TANK	
		2009VBS Removed 1998 Gasoline			
202	19 of 20	WSW/247.4	77.9 / 1.75	CARLING TIGER EXPRESS ATTN NISAR ABBASI 1859 CARLING AVE OTTAWA ON	EXP
Inventory No: Inventory Status: Installation Year: Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type:	11388338 EXPIRED 1986 22700			Tank Material: Corrosion Protect: Overfill Protection: Inventory Context: Inventory Item: Steel Sacrificial anode FS Liquid Fuel Tank FS LIQUID FUEL TANK	
		2009VBS Removed 1998 Gasoline			
202	20 of 20	WSW/247.4	77.9 / 1.75	MAC'S CONVENIENCE STORES INC. 1859 CARLING AVE OTTAWA ON	FST
Inventory No: Inventory Status: Installation Year: Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description:	10194930 Active 138000 L			Tank Material: Corrosion Protect: Overfill Protection: Inventory Context: Inventory Item: Liquid Fuels FS Gasoline Station - Self Serve	
203	1 of 13	ESE/247.6	76.8 / 0.64	Tetra Pak Canada Inc. 846 Churchill Ave. N	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ottawa ON K1Z 5G8					
Generator No:		ON1972530			
SIC Code:		326160			
SIC Description:		Plastic Bottle Manufacturing			
Approval Years:		05			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
203	2 of 13	ESE/247.6	76.8 / 0.64	Logoplaste Canada Inc 846 Churchill Ave North Ottawa ON K1Z 5G8	GEN
Generator No:		ON7998136			
SIC Code:		326160			
SIC Description:		Plastic Bottle Manufacturing			
Approval Years:		07,08			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
203	3 of 13	ESE/247.6	76.8 / 0.64	Logoplaste Canada Inc 846 Churchill Ave North Ottawa ON	GEN
Generator No:		ON7998136			
SIC Code:		326160			
SIC Description:		Plastic Bottle Manufacturing			
Approval Years:		2009			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
203	4 of 13	ESE/247.6	76.8 / 0.64	Logoplaste Canada Inc 846 Churchill Ave North Ottawa ON	GEN
Generator No:		ON7998136			
SIC Code:		326160			
SIC Description:		Plastic Bottle Manufacturing			
Approval Years:		2010			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
203	5 of 13	ESE/247.6	76.8 / 0.64	Logoplaste Canada Inc 846 Churchill Ave North Ottawa ON	GEN
Generator No:		ON7998136			
SIC Code:		326160			
SIC Description:		Plastic Bottle Manufacturing			
Approval Years:		2011			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
203	6 of 13	ESE/247.6	76.8 / 0.64	Logoplaste Canada Inc 846 Churchill Ave North Ottawa ON K1Z 5G8	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON7998136 SIC Code: 326160 SIC Description: Plastic Bottle Manufacturing Approval Years: 2012 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 212 Waste Class Name: ALIPHATIC SOLVENTS Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
203	7 of 13	ESE/247.6	76.8 / 0.64	Logoplaste Canada Inc 846 Churchill Ave North Ottawa ON	GEN
Generator No: ON7998136 SIC Code: 326160 SIC Description: PLASTIC BOTTLE MANUFACTURING Approval Years: 2013 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS Waste Class: 212 Waste Class Name: ALIPHATIC SOLVENTS					
203	8 of 13	ESE/247.6	76.8 / 0.64	Logoplaste Canada Inc 846 Churchill Ave North Ottawa ON K1Z 5G8	GEN
Generator No: ON7998136 SIC Code: 326160 SIC Description: PLASTIC BOTTLE MANUFACTURING Approval Years: 2016 PO Box No: Country: Canada Status: Co Admin: Mayra Petit Choice of Contact: CO_OFFICIAL Phone No Admin: 613 837 8282 Ext. Contaminated Facility: No MHSW Facility: No					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
203	9 of 13	ESE/247.6	76.8 / 0.64	Logoplaste Canada Inc 846 Churchill Ave North Ottawa ON K1Z 5G8	GEN
Generator No:		ON7998136			
SIC Code:		326160			
SIC Description:		PLASTIC BOTTLE MANUFACTURING			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Mayra Petit			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		613 837 8282 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
203	10 of 13	ESE/247.6	76.8 / 0.64	Logoplaste Canada Inc 846 Churchill Ave North Ottawa ON K1Z 5G8	GEN
Generator No:		ON7998136			
SIC Code:		326160			
SIC Description:		PLASTIC BOTTLE MANUFACTURING			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Mayra Petit			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		613 837 8282 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
203	11 of 13	ESE/247.6	76.8 / 0.64	Logoplaste Canada Inc 846 Churchill Ave North	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ottawa ON K1Z 5G8					
Generator No:		ON7998136			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
Waste Class:		232 N			
Waste Class Name:		Polymeric resins			
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
203	12 of 13	ESE/247.6	76.8 / 0.64	OTTAWA VALLEY HANDRAILING 846 Churchill Ave Ottawa ON K1Z 5G8	GEN
Generator No:		ON3022592			
SIC Code:					
SIC Description:					
Approval Years:		As of Nov 2021			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
203	13 of 13	ESE/247.6	76.8 / 0.64	OTTAWA VALLEY HANDRAILING 846 Churchill Ave Ottawa ON K1Z 5G8	GEN
Generator No:		ON3022592			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminated Facility: MHSW Facility:					
Detail(s)					
Waste Class:		145 I			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
204	1 of 1	WSW/247.8	78.9 / 2.75	Carling Ave && Ridell Ave Ottawa ON	EHS
Order No:		20070206017		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		CAN - Custom Report		Client Prov/State:	
Report Date:		2/14/2007		Search Radius (km):	
Date Received:		2/5/2007		X:	
Previous Site Name:				Y:	
Lot/Building Size:				0.25	
Additional Info Ordered:				-75.756424	
				45.375324	
205	1 of 1	E/247.8	76.8 / 0.67	861 CLYDE AV. Ottawa ON	WWIS
Well ID:		7326563		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Other		Data Src:	
Final Well Status:		Test Hole		Date Received:	
Water Type:				12/11/2018	
Casing Material:				Selected Flag:	
Audit No:		Z229539		TRUE	
Tag:		A257540		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				7241	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				7	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				OTTAWA-CARLETON	
Static Water Level:				Lot:	
Clear/Cloudy:				Concession:	
Municipality:		NEPEAN TOWNSHIP		Concession Name:	
Site Info:				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
Additional Detail(s) (Map)					
Bore Hole ID:		1007343916		Tag No:	
Depth M:		5.4864		A257540	
Year Completed:		2018		Contractor:	
Well Completed Dt:		10/13/2018		7241	
Audit No:		Z229539		Latitude:	
Path:				45.3770986945946	
				Longitude:	
				-75.7483086792266	
				Y:	
				45.37709868845308	
				X:	
				-75.74830851693197	
Bore Hole Information					
Bore Hole ID:		1007343916		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				441410.00	
				North83:	
				5025115.00	
				Org CS:	
				UTM83	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:				UTMRC:	4
Date Completed:	10/13/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007713648				
Layer:	4				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	8.5				
Formation End Depth:	18.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007713646				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	09				
Material 1 Desc:	MEDIUM SAND				
Material 2:					
Material 2 Desc:					
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	1.0				
Formation End Depth:	7.5				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007713645				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	27				
Material 1 Desc:	OTHER				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007713647			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		7.5			
Formation End Depth:		8.5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713914			
Layer:		3			
Plug From:		2.0			
Plug To:		9.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713913			
Layer:		2			
Plug From:		1.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713915			
Layer:		4			
Plug From:		9.5			
Plug To:		10.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713917			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713916			
Layer:		5			
Plug From:		10.5			
Plug To:		18.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007714272			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:		DIAMOND			
<u>Pipe Information</u>					
Pipe ID:		1007713363			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007714363			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		11.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007714462			
Layer:		1			
Slot:		10			
Screen Top Depth:		11.0			
Screen End Depth:		18.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
<u>Hole Diameter</u>					
Hole ID:		1007714157			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		8.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1007714158			
Diameter:		2.375			
Depth From:		8.5			
Depth To:		18.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>206</u>	1 of 1	SSW/248.0	78.9 / 2.76	THOMAS CAVANAGH CONSTRUCTION LTD 864 DENISON CRES., OTTAWA, ON, K2A 2N5, CA ON	PINC

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1006856589			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441396.00
Code OB Desc:				North83:	5025216.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/22/2017			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007049915				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	1.8200000524520874				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007049916				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	1.8200000524520874				
Formation End Depth:	4.260000228881836				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1007049925				
Layer:	1				
Plug From:	0.0				
Plug To:	0.3100000023841858				
Plug Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007049927			
Layer:		3			
Plug From:		2.430000066757202			
Plug To:		4.260000228881836			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007049926			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.430000066757202			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007049924			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007049914			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007049920			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.740000009536743			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007049921			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.740000009536743			
Screen End Depth:		4.260000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1007049919			
Layer:					

626 erisinfo.com | Environmental Risk Information Services Order No: 24101700600

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	5025119.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:				UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
209	1 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:		0211			
SIC Description:		VETERINARY SERVICE			
Approval Years:		86,87,88,89,90,02,03,04,05,06,07,08			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
209	2 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:		0211			
SIC Description:		VETERINARY SERVICE			
Approval Years:		92,93,97,98,99,00,01			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		264 PHOTOPROCESSING WASTES			
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
209	3 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL 01-149 AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:		0211			
SIC Description:		VETERINARY SERVICE			
Approval Years:		94,95,96			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
209	4 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0747100			
SIC Code:		0000			
SIC Description:		*** NOT DEFINED ***			
Approval Years:		86,87,88,89,90,92,93,94			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
209	5 of 18	SE/248.9	78.1 / 2.01	900 Boyd Avenue Ottawa ON K2A 2E3	EHS
Order No:		20110301003		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		3/7/2011		Search Radius (km):	0.25
Date Received:		3/1/2011 9:09:09 AM		X:	-75.750269
Previous Site Name:				Y:	45.374992
Lot/Building Size:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:					
209	6 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:		541940			
SIC Description:		Veterinary Services			
Approval Years:		2009			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
209	7 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:		541940			
SIC Description:		Veterinary Services			
Approval Years:		2010			
PO Box No:					
Country:					
Status:					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
209	8 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:		541940			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description: Veterinary Services Approval Years: 2011 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
209	9 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No: ON0706300 SIC Code: 541940 SIC Description: Veterinary Services Approval Years: 2012 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
209	10 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON	GEN
Generator No: ON0706300 SIC Code: 541940 SIC Description: VETERINARY SERVICES Approval Years: 2013 PO Box No: Country: Status: Co Admin: Choice of Contact: Phone No Admin: Contaminated Facility: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
209	11 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:		541940			
SIC Description:		VETERINARY SERVICES			
Approval Years:		2016			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Mark Wallar			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		725-1182 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
209	12 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:		541940			
SIC Description:		VETERINARY SERVICES			
Approval Years:		2015			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Mark Wallar			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		725-1182 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
Waste Class: Waste Class Name:		261 PHARMACEUTICALS			
209	13 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:		541940			
SIC Description:		VETERINARY SERVICES			
Approval Years:		2014			
PO Box No:					
Country:		Canada			
Status:					
Co Admin:		Mark Wallar			
Choice of Contact:		CO_OFFICIAL			
Phone No Admin:		725-1182 Ext.			
Contaminated Facility:		No			
MHSW Facility:		No			
<u>Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
209	14 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL AFFILIATED ANIMAL SERVICES 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:					
SIC Description:					
Approval Years:		As of Dec 2018			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
209	15 of 18	SE/248.9	78.1 / 2.01	900 Boyd Avenue Ottawa ON Ottawa ON K2A 2E3	EHS
Order No: 20190311212		Nearest Intersection:			
Status: C		Municipality:			
Report Type: Standard Report		Client Prov/State: ON			
Report Date: 15-MAR-19		Search Radius (km): .25			
Date Received: 11-MAR-19		X: -75.750431			
Previous Site Name:		Y: 45.374937			
Lot/Building Size:					
Additional Info Ordered:					
209	16 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL VCA CANADA OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No: ON0706300					
SIC Code:					
SIC Description:					
Approval Years: As of Jul 2020					
PO Box No:					
Country: Canada					
Status: Registered					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 261 A					
Waste Class Name: Pharmaceuticals					
Waste Class: 312 P					
Waste Class Name: Pathological wastes					
209	17 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL VCA CANADA OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No: ON0706300					
SIC Code:					
SIC Description:					
Approval Years: As of Nov 2021					
PO Box No:					
Country: Canada					
Status: Registered					
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class: 312 P					
Waste Class Name: Pathological wastes					
Waste Class: 261 A					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Pharmaceuticals			
209	18 of 18	SE/248.9	78.1 / 2.01	OTTAWA VETERINARY HOSPITAL VCA CANADA OTTAWA VETERINARY HOSPITAL 900 BOYD AVENUE OTTAWA ON K2A 2E3	GEN
Generator No:		ON0706300			
SIC Code:					
SIC Description:					
Approval Years:		As of Oct 2022			
PO Box No:					
Country:		Canada			
Status:		Registered			
Co Admin:					
Choice of Contact:					
Phone No Admin:					
Contaminated Facility:					
MHSW Facility:					
<u>Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		PHARMACEUTICALS			
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
210	1 of 1	E/249.2	76.8 / 0.67	861 CLYDE AVE Ottawa ON	WWIS
Well ID:		7220439		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Test Hole		Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z184497		Contractor:	7241
Tag:		A159175		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220439.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/09/2014			
Year Completed:		2014			
Depth (m):		3.66			
Latitude:		45.3770447748973			
Longitude:		-75.7482951960567			
X:		-75.74829503412691			
Y:		45.37704476797252			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:		722\7220439.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1004765828			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441411.00
Code OB Desc:				North83:	5025109.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/09/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005154514				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	2.130000114440918				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005154515				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	2.130000114440918				
Formation End Depth:	3.6600000858306885				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1005154526				
Layer:	3				
Plug From:	1.8300000429153442				
Plug To:	3.6600000858306885				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154525			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154524			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005154523			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005154513			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005154519			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005154520			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.130000114440918			
Screen End Depth:		3.6600000858306885			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1005154518			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
 <u>Hole Diameter</u>					
Hole ID:		1005154516			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.740000009536743			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
 <u>Hole Diameter</u>					
Hole ID:		1005154517			
Diameter:		7.619999885559082			
Depth From:		2.740000009536743			
Depth To:		3.6600000858306885			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				

211	1 of 1	E/250.0	76.8 / 0.67	861 CLYDE AVE ON	WWIS
Well ID:	7220443			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	05/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z183200			Contractor:	7241
Tag:	A157753			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7220443.pdf				

Additional Detail(s) (Map)

Well Completed Date: 04/09/2014
 Year Completed: 2014
 Depth (m): 3.66
 Latitude: 45.3769817709674
 Longitude: -75.7482943650274
 X: -75.7482942031909
 Y: 45.37698176403088
 Path: 722\7220443.pdf

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1004765882			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	441411.00
Code OB Desc:				North83:	5025102.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/09/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005154570				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	2.130000114440918				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005154571				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	2.130000114440918				
Formation End Depth:	3.6600000858306885				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1005154580				
Layer:	1				
Plug From:	0.0				
Plug To:	0.3100000023841858				
Plug Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154581			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.83000000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005154582			
Layer:		3			
Plug From:		1.83000000429153442			
Plug To:		3.66000000858306885			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005154579			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005154569			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005154575			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.130000114440918			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005154576			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.130000114440918			
Screen End Depth:		3.66000000858306885			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID:		1005154574			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
 <u>Hole Diameter</u>					
Hole ID:		1005154572			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		2.740000009536743			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
 <u>Hole Diameter</u>					
Hole ID:		1005154573			
Diameter:		7.619999885559082			
Depth From:		2.740000009536743			
Depth To:		3.6600000858306885			
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
212	1 of 1	E/250.6	76.8 / 0.68	861 CLYDE AV. Ottawa ON	WWIS
Well ID:	7326558			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Other			Data Src:	
Final Well Status:	Test Hole			Date Received:	12/11/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z298105			Contractor:	7241
Tag:	A257535			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
 <u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1007343901			Tag No:	A257535
Depth M:	5.6388			Contractor:	7241
Year Completed:	2018			Latitude:	45.3773599618749
Well Completed Dt:	10/11/2018			Longitude:	-75.7482738094126
Audit No:	Z298105			Y:	45.37735995510553
Path:				X:	-75.74827364701696
 <u>Bore Hole Information</u>					
Bore Hole ID:	1007343901			Elevation:	
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	441413.00
Code OB Desc:				North83:	5025144.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		10/11/2018	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:		Location Method:		wwr	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007713628			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007713629			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007713630			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		7.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		18.5			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713892			
Layer:		5			
Plug From:		9.0			
Plug To:		18.5			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713890			
Layer:		3			
Plug From:		2.0			
Plug To:		8.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713891			
Layer:		4			
Plug From:		8.0			
Plug To:		9.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713889			
Layer:		2			
Plug From:		1.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007713888			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007714267			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007713358			
Casing No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007714358			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		9.5			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007714457			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.5			
Screen End Depth:		18.5			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.659999966621399			
<u>Hole Diameter</u>					
Hole ID:		1007714148			
Diameter:		2.875			
Depth From:		0.0			
Depth To:		7.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>Hole Diameter</u>					
Hole ID:		1007714149			
Diameter:		2.375			
Depth From:		7.0			
Depth To:		18.5			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Unplottable Summary

Total: 45 Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
AAGR		Lot 30 Con 2	City of Ottawa ON	
CA	Thomas Cavanagh Construction Limited		Ottawa ON	
CA	REG.MUN.OF OTTAWA-CARLETON	QUEENSWAY N.	OTTAWA ON	
CA	PETER PEREL INVESTMENTS LTD.-LOTS 1-4	TILLBURY AVE., CONC. 1	OTTAWA CITY ON	
CA	Thomas Cavanagh Construction Limited		Ottawa ON	
CA	Hydro Ottawa Limited		Ottawa ON	
CA	Thomas Cavanagh Construction Limited		Ottawa ON	
CA	Canadian Tire Real Estate Limited		Ottawa ON	
CA	City of Ottawa	Carling Avenue (Road allownce)	Ottawa ON	
CA	Thomas Cavanagh Construction Limited		Ottawa ON	
CA	Thomas Cavanagh Construction Limited		Ottawa ON	
CA	Canadian Tire Real Estate Limited		Ottawa ON	
CA	City of Ottawa	Carling Ave	Ottawa ON	
CA	L.SIPOLINS	SOUTH OF CARLING AVE.	OTTAWA CITY ON	
CA	Thomas Cavanagh Construction Limited		Ottawa ON	
CA	Canadian Tire Real Estate Limited		Ottawa ON	

CA	Petro-Canada		Ottawa ON	
CONV	IMPERIAL OIL LIMITED		DON MILLS ON	
CONV	SUPERIOR PROPANE INCORPORATED		UNIONVILLE ON	
CONV	ESSROC CANADA INC.		ON	
CONV	IMPERIAL OIL LIMITED		NORTH YORK ON	
ECA	Thomas Cavanagh Construction Limited		Ottawa ON	K0A 1B0
ECA	Thomas Cavanagh Construction Limited		Ottawa ON	K0A 1B0
ECA	City of Ottawa	Rex Avenue, Kerr Avenue, Ernest Avenue, Denison Crescent and Broadview Avenue	Ottawa ON	K2G 6J8
ECA	City of Ottawa	Carling Ave	Ottawa ON	K2G 6J8
ECA	Canadian Tire Real Estate Limited		Ottawa ON	M4P 2V8
ECA	Petro-Canada Inc.		Ottawa ON	L6L 6N5
ECA	City of Ottawa	Carling Ave	Ottawa ON	K2G 6J8
ECA	City of Ottawa	Broadview Ave	Ottawa ON	K2G 6J8
EHS		Hwy 417	Ottawa ON	
GEN	R.W Tomlinson	LRT Central Site Hwy 417 Widening	ottawa ON	K1G 3N4
GEN	R.W Tomlinson	LRT Central Site Hwy 417 Widening	ottawa ON	K1G 3N4
PTTW	Thomas Cavanagh Construction Limited		ON	
PTTW	Corporation of the City of Ottawa	Lot 30, Concession 2RF, City of Ottawa (formerly City of Nepean) CITY OF OTTAWA	ON	
SPL	Kiewit Eurovia Vinci	Spill site north of Carling Avenue	Ottawa ON	
SPL	Kiewit Eurovia Vinci	Carling Ave	Ottawa ON	
SPL	TRANSPORT TRUCK	HWY. 417 MOTOR VEHICLE (OPERATING FLUID)	OTTAWA ON	
SPL	OTTAWA TRANSIT	CARLING AVENUE BUS	OTTAWA ON	
SPL	TRANSPORT TRUCK	QUEENSWAY MOTOR VEHICLE (OPERATING FLUID)	OTTAWA CITY ON	

SPL	City of Ottawa	Highway 417	Ottawa ON
SPL	HOTEL/MOTEL	CARLING AVENUE (N.O.S.)	OTTAWA CITY ON
SPL	Thomas Cavanagh Construction Limited		Ottawa ON
SPL	Enbridge Gas Distribution Inc.	Denison Cres	Ottawa ON
SPL	Thomas Cavanagh Construction Limited		Ottawa ON
WWIS		HWY 417 WEST	Ottawa ON

Unplottable Report

Site: Lot 30 Con 2 City of Ottawa ON

Database:
AAGR

Type: Quarry
Region/County: Ottawa-Carleton
Township: City of Ottawa
Concession: 2
Lot: 30
Size (ha): 3.7
Landuse:
Comments:

Site: Thomas Cavanagh Construction Limited
Ottawa ON

Database:
CA

Certificate #: 1332-67RGUN
Application Year: 2005
Issue Date: 1/6/2005
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: REG.MUN.OF OTTAWA-CARLETON
QUEENSWAY N. OTTAWA ON

Database:
CA

Certificate #: 3-0468-85-006
Application Year: 85
Issue Date: 6/4/85
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: PETER PEREL INVESTMENTS LTD.-LOTS 1-4
TILLBURY AVE., CONC. 1 OTTAWA CITY ON

Database:
CA

Certificate #: 3-0068-92-
Application Year: 92
Issue Date: 2/5/1992
Approval Type: Municipal sewage
Status: Approved
Application Type:

Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Thomas Cavanagh Construction Limited
Ottawa ON

Database:
CA

Certificate #: 0598-5FTQFY
Application Year: 2002
Issue Date: 11/20/2002
Approval Type: Industrial Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Hydro Ottawa Limited
Ottawa ON

Database:
CA

Certificate #: 9824-89HKHQ
Application Year: 2010
Issue Date: 10/14/2010
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Thomas Cavanagh Construction Limited
Ottawa ON

Database:
CA

Certificate #: 9927-6G8LNP
Application Year: 2005
Issue Date: 9/19/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Canadian Tire Real Estate Limited
Ottawa ON

Database:
CA

Certificate #: 2877-73WH5F
Application Year: 2007
Issue Date: 6/7/2007
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *City of Ottawa*
Carling Avenue (Road allowance) Ottawa ON

Database:
[CA](#)

Certificate #: 3615-6QHRAR
Application Year: 2006
Issue Date: 6/13/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Thomas Cavanagh Construction Limited*
Ottawa ON

Database:
[CA](#)

Certificate #: 4624-6CPJGJ
Application Year: 2005
Issue Date: 6/13/2005
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Thomas Cavanagh Construction Limited*
Ottawa ON

Database:
[CA](#)

Certificate #: 7389-5HYQMW
Application Year: 2004
Issue Date: 2/24/2004
Approval Type: Industrial Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Canadian Tire Real Estate Limited
Ottawa ON

Database:
CA

Certificate #: 8928-6XKJW9
Application Year: 2007
Issue Date: 2/12/2007
Approval Type: Industrial Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: City of Ottawa
Carling Ave Ottawa ON

Database:
CA

Certificate #: 2472-8GRQTN
Application Year: 2011
Issue Date: 5/20/2011
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: L.SIPOLINS
SOUTH OF CARLING AVE. OTTAWA CITY ON

Database:
CA

Certificate #: 7-1008-85-006
Application Year: 85
Issue Date: 11/15/85
Approval Type: Municipal water
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Thomas Cavanagh Construction Limited
Ottawa ON

Database:
CA

Certificate #: 5915-7K9JUV
Application Year: 2008
Issue Date: 10/17/2008
Approval Type: Air
Status: Approved
Application Type:
Client Name:

Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Canadian Tire Real Estate Limited
Ottawa ON

Database:
CA

Certificate #: 6332-769QGX
Application Year: 2007
Issue Date: 8/21/2007
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Petro-Canada
Ottawa ON

Database:
CA

Certificate #: 5607-79YMZ8
Application Year: 2008
Issue Date: 2/12/2008
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: IMPERIAL OIL LIMITED
DON MILLS ON

Database:
CONV

File No:
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: FAILED TO COMPLY WITH CONDITIONS OF C. OF A.
Background:
URL:

Location:
Region: EASTERN REGION
Ministry District:

Additional Details

Publication Date:

Count: 1
Act: OWRA
Regulation:
Section: 66(3)
Act/Regulation/Section: OWRA- -66(3)
Date of Offence:
Date of Conviction:
Date Charged: 6/4/93
Charge Disposition:
Fine: \$6,000
Synopsis:

Site: SUPERIOR PROPANE INCORPORATED
UNIONVILLE ON

Database:
CONV

File No:
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: DISCHARGE OF PROPANE VAPOURS INTO NATURAL ENVIRON
Background:
URL:

Location:
Region: EASTERN REGION
Ministry District:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation:
Section: 14(1)
Act/Regulation/Section: EPA- -14(1)
Date of Offence:
Date of Conviction:
Date Charged: 12/13/93
Charge Disposition:
Fine: \$3,500
Synopsis:

Site: ESSROC CANADA INC.
ON

Database:
CONV

File No:
Crown Brief No: 99-0179-0118
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: DISCHARGE AIRBORNE PARTICULATE INTO THE NATURAL ENVIRONMENT THAT IS LIKELY TO CAUSE AN ADVERSE EFFECT.
Background:
URL:

Location:
Region: EASTERN REGION
Ministry District: BELLEVILLE

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation:
Section: 14 (1)
Act/Regulation/Section: EPA 14 (1)
Date of Offence:
Date of Conviction:
Date Charged: 4/23/2003
Charge Disposition: FINED
Fine: \$15,000.00
Synopsis:

Site: **IMPERIAL OIL LIMITED**
NORTH YORK ON

Database:
CONV

File No:
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: FAILED TO INSPECT OIL/WATER SEPARATOR WEEKLY & MAINTAIN LOG BOOK AT SITE
Background:
URL:

Location:
Region: EASTERN REGION
Ministry District:

Additional Details

Publication Date:
Count: 1
Act: OWRA
Regulation:
Section: 66(3)
Act/Regulation/Section: OWRA- -66(3)
Date of Offence:
Date of Conviction:
Date Charged: 6/4/93
Charge Disposition:
Fine: \$4,000
Synopsis:

Additional Details

Publication Date:
Count: 1
Act: OWRA
Regulation:
Section: 66(3)
Act/Regulation/Section: OWRA- -66(3)
Date of Offence:
Date of Conviction:
Date Charged: 6/4/93
Charge Disposition:
Fine: \$1,000
Synopsis:

Site: **Thomas Cavanagh Construction Limited**
Ottawa ON K0A 1B0

Database:
ECA

Approval No: 7749-8ZJSTU
Approval Date: 2012-11-09
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Thomas Cavanagh Construction Limited
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/8951-8Z5PSL-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **Thomas Cavanagh Construction Limited**
Ottawa ON K0A 1B0

Database:
ECA

Approval No: 3467-9AYP63
Approval Date: 2013-08-30
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Thomas Cavanagh Construction Limited
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/0772-98NN9V-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **City of Ottawa**
Rex Avenue, Kerr Avenue, Ernest Avenue, Denison Crescent and Broadview Avenue Ottawa ON K2G 6J8

Database:
ECA

Approval No: 3449-9J6NNF
Approval Date: 2014-04-23
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Rex Avenue, Kerr Avenue, Ernest Avenue, Denison Crescent and Broadview Avenue
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/7560-9H5QHM-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: **City of Ottawa**
Carling Ave Ottawa ON K2G 6J8

Database:
ECA

Approval No: 3723-9ATJC6
Approval Date: 2013-08-30
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Carling Ave
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/9325-9AMR2C-14.pdf>

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: Canadian Tire Real Estate Limited
Ottawa ON M4P 2V8

Database:
ECA

Approval No: 2877-73WH5F
Approval Date: 2007-06-07
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Business Name: Canadian Tire Real Estate Limited
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/1011-73VQQQ-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: Petro-Canada Inc.
Ottawa ON L6L 6N5

Database:
ECA

Approval No: 4810-4UMJP8
Approval Date: 2001-03-12
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-INDUSTRIAL SEWAGE WORKS
Project Type: INDUSTRIAL SEWAGE WORKS
Business Name: Petro-Canada Inc.
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/7825-4UCP9D-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: City of Ottawa
Carling Ave Ottawa ON K2G 6J8

Database:
ECA

Approval No: 2472-8GRQTN
Approval Date: 2011-05-20
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Carling Ave
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/5823-8GCKK6-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: City of Ottawa
Broadview Ave Ottawa ON K2G 6J8

Database:
ECA

Approval No: 0261-CCBMMX
Approval Date: March 22, 2022
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name: Rideau Valley

MOE District: Ottawa
City:
Longitude:
Latitude:
Geometry X: -8434101.1823999994
Geometry Y: 5676579.6894000024

Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Broadview Ave
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/5069-CBJU3C-14.pdf>
PDF Site Location: Broadview Avenue
City of Ottawa, Ontario

Site: **Hwy 417 Ottawa ON** **Database:** **EHS**

Order No: 20120509053
Status: C
Report Type: Custom Report
Report Date: 5/16/2012
Date Received: 5/9/2012
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): 0.25
X: -75.670099
Y: 1

Site: **R.W Tomlinson** **Database:** **GEN**
LRT Central Site Hwy 417 Widening ottawa ON K1G 3N4

Generator No: ON9834153
SIC Code: 237310
SIC Description: HIGHWAY, STREET AND BRIDGE CONSTRUCTION
Approval Years: 2015
PO Box No:
Country: Canada
Status:
Co Admin: mark peralta
Choice of Contact: CO_OFFICIAL
Phone No Admin: 6138221867 Ext.
Contaminated Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Site: **R.W Tomlinson** **Database:** **GEN**
LRT Central Site Hwy 417 Widening ottawa ON K1G 3N4

Generator No: ON9834153
SIC Code: 237310
SIC Description: HIGHWAY, STREET AND BRIDGE CONSTRUCTION
Approval Years: 2014
PO Box No:
Country: Canada
Status:
Co Admin: mark peralta
Choice of Contact: CO_OFFICIAL
Phone No Admin: 6138221867 Ext.
Contaminated Facility: No
MHSW Facility: No

Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Site: **Thomas Cavanagh Construction Limited**
ON

Database:
[PTTW](#)

EBR Registry No: 010-5806
Ministry Ref No: 7423-7NPJQN
Notice Type: Instrument Final Decision
Notice Stage:
Notice Date: August 25, 2009
Proposal Date: January 30, 2009
Year: 2009
Instrument Type: (OWRA s. 34) - Permit to Take Water
Off Instrument Name:
Posted By:
Company Name: Thomas Cavanagh Construction Limited
Site Address:
Location Other:
Proponent Name:
Proponent Address:
Comment Period:
URL:
Summary:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Henderson Quarry Address: Lot: 13, Concession: 11, Geographic Town of Goulbourn, Ottawa, City District Office: Ottawa GeoReference: Map Datum: Unknown, Zone: 18, Accuracy Estimate: 10 -100 metres eg. Topographic Map, Method: Map, UTM Easting: 422063, UTM Northing: 5008627 CITY OF OTTAWA GOULBOURN

Site: **Corporation of the City of Ottawa**
Lot 30, Concession 2RF, City of Ottawa (formerly City of Nepean) CITY OF OTTAWA ON

Database:
[PTTW](#)

EBR Registry No: IA03E1588
Ministry Ref No: ER-0743-5SBP7D
Notice Type: Instrument Decision
Notice Stage:
Notice Date: February 19, 2004
Proposal Date: November 10, 2003
Year: 2003
Instrument Type: (OWRA s. 34) - Permit to Take Water
Off Instrument Name:
Posted By:
Company Name: Corporation of the City of Ottawa
Site Address:
Location Other:
Proponent Name:
Proponent Address: 1595 Telesat Court, Ottawa Ontario, K1G 3V5
Comment Period:
URL:
Summary:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Lot 30, Concession 2RF, City of Ottawa (formerly City of Nepean) CITY OF OTTAWA

Site: Kiewit Eurovia Vinci
Spill site north of Carling Avenue Ottawa ON

Database:
SPL

Ref No: 7466-BWBNCD
Year:
Incident Dt: 12/15/2020
Dt MOE Arvl on Scn:
MOE Reported Dt: 12/15/2020
Dt Document Closed: 2/1/2021
Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: Lincoln Fields Bus Station<UNOFFICIAL>
Site Address: Spill site north of Carling Avenue
Site Region: Eastern
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing: 5023964
Easting: 438776
Incident Cause:
Incident Preceding Spill: Leak/Break
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 0.5 L
Contaminant Qty 1: 0.5
Contaminant Unit: L
Client Type: Corporation
Source Type: Valve/Fitting/Piping
Contaminant Code: 15
Contaminant Name: HYDRAULIC OIL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1: n/a
Receiving Medium: Land
Incident Reason: Equipment Failure
Incident Summary: KEV: 0.5L hydraulic oil to grnd, cnted, clned
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Miscellaneous Communal
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:
Client Name: Kiewit Eurovia Vinci

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health: 2 - Minor Environment
Agency Involved:

Site: Kiewit Eurovia Vinci
Carling Ave Ottawa ON

Database:
SPL

Ref No: 4771-BW6QNN
Year:
Incident Dt: 12/10/2020
Dt MOE Arvl on Scn:
MOE Reported Dt: 12/10/2020
Dt Document Closed: 2/1/2021
Site No: NA
MOE Response: No
Site County/District:

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health: 2 - Minor Environment
Agency Involved:

Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: Lincoln Fields Bus Station<UNOFFICIAL>
Site Address: Carling Ave
Site Region: Eastern
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing: 5023820
Easting: 438710
Incident Cause:
Incident Preceding Spill: Leak/Break
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 3 L
Contaminant Qty 1: 3
Contaminant Unit: L
Client Type: Corporation
Source Type: Motor Vehicle
Contaminant Code: 15
Contaminant Name: HYDRAULIC OIL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1: n/a
Receiving Medium: Land
Incident Reason: Operator/Human Error
Incident Summary: Spill: 3L hydraulic oil to ground, clnd
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Miscellaneous Communal
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:
Client Name: Kiewit Eurovia Vinci

Site: TRANSPORT TRUCK
 HWY. 417 MOTOR VEHICLE (OPERATING FLUID) OTTAWA ON

Database:
 SPL

Ref No:	191523	Municipality No:	20107
Year:		Nature of Damage:	
Incident Dt:	12/4/2000	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	12/4/2000	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Incident Cause:	TRUCK/TRAILER OVERTURN		

Incident Preceding Spill:
Environment Impact: POSSIBLE
Health Env Consequence:
Nature of Impact: Soil contamination
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Client Type:
Source Type:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Incident Reason: OTHER
Incident Summary: RSR ENVIRONMENTAL:SPILL OF 50-100 L DIESEL DUE TO ROLLOVER. CONTAINED.
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:
Client Name:

Site: OTTAWA TRANSIT
 CARLING AVENUE BUS OTTAWA ON

Database:
 SPL

Ref No:	187680	Municipality No:	20107
Year:		Nature of Damage:	
Incident Dt:	9/29/2000	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	9/29/2000	Impact to Health:	
Dt Document Closed:		Agency Involved:	PUBLIC WORKS, FIRE DEPARTMENT
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Incident Cause:	PIPE/HOSE LEAK		
Incident Preceding Spill:			
Environment Impact:	POSSIBLE		
Health Env Consequence:			
Nature of Impact:	Water course or lake		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Client Type:			
Source Type:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			

Receiving Medium: WATER
Incident Reason: UNKNOWN
Incident Summary: OC TRANSPD:DIESEL FUEL LEAK FROM FUEL PUMP/LINE INTO SEWER-WORKS NOTIFIED
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:
Client Name:

Site: TRANSPORT TRUCK
QUEENSWAY MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON
Database: [SPL](#)

Ref No: 224201
Year:
Incident Dt: 4/19/2002
Dt MOE Arvl on Scn:
MOE Reported Dt: 4/19/2002
Dt Document Closed:
Municipality No: 20107
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved: OPP-KANATA; MTO

Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northings:
Easting:
Incident Cause: OTHER TRANSPORTATION ACCIDENT
Incident Preceding Spill:
Environment Impact: CONFIRMED
Health Env Consequence:
Nature of Impact: Soil contamination
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Client Type:
Source Type:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Incident Reason: ERROR
Incident Summary: LOBLAWS: 450L DIESEL FROMTRUCK TO ROAD ONLY; OPP; MTO.
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:
Client Name:

Site: City of Ottawa
Highway 417 Ottawa ON

Database:
[SPL](#)

Ref No: 3043-7QMTYH

Year:

Incident Dt:

Dt MOE Arvl on Scn:

MOE Reported Dt: 3/30/2009

Dt Document Closed:

Site No:

MOE Response:

Site County/District:

Site Geo Ref Meth:

Site District Office:

Nearest Watercourse:

Site Name: EB Merge Lane Hwy 417 & Eagleson Road

Site Address:

Site Region:

Site Municipality: Ottawa

Site Lot:

Site Conc:

Site Geo Ref Accu:

Site Map Datum:

Northings: NA

Easting: NA

Incident Cause: Pipe Or Hose Leak

Incident Preceding Spill:

Environment Impact: Not Anticipated

Health Env Consequence:

Nature of Impact: Other Impact(s)

Contaminant Qty: 10 L

Contaminant Qty 1: 10

Contaminant Unit: L

Client Type:

Source Type:

Contaminant Code:

Contaminant Name: ENGINE OIL

Contaminant Limit 1:

Contam Limit Freq 1:

Contaminant UN No 1:

Receiving Medium:

Incident Reason: Unknown - Reason not determined

Incident Summary: OC Transpo: 10L engine oil to grnd on Hwy 417

Activity Preceding Spill:

Property 2nd Watershed:

Property Tertiary Watershed:

Sector Type: Other

SAC Action Class: Primary Assessment of Incident

Call Report Locatn Geodata:

Time Reported:

System Facility Address:

Client Name: City of Ottawa

Municipality No:

Nature of Damage:

Discharger Report:

Material Group:

Impact to Health:

Agency Involved:

Site: HOTEL/MOTEL
CARLING AVENUE (N.O.S.) OTTAWA CITY ON

Database:
[SPL](#)

Ref No: 84065

Year:

Incident Dt: 4/14/1993

Dt MOE Arvl on Scn:

MOE Reported Dt: 4/14/1993

Dt Document Closed:

Site No:

MOE Response:

Site County/District:

Site Geo Ref Meth:

Municipality No: 20101

Nature of Damage:

Discharger Report:

Material Group:

Impact to Health:

Agency Involved: MCCR

Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Incident Cause: UNDERGROUND TANK LEAK
Incident Preceding Spill:
Environment Impact: CONFIRMED
Health Env Consequence:
Nature of Impact: Soil contamination
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Client Type:
Source Type:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Incident Reason: CORROSION
Incident Summary: EMBASSY WEST HOTEL: FUEL-CONTAMINATED SOIL FOUND BY UNDERGROUND TANK
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:
Client Name:

Site: Thomas Cavanagh Construction Limited
 Ottawa ON

Database:
 SPL

Ref No:	5552-8XKTLB	Municipality No:
Year:		Nature of Damage:
Incident Dt:	27-AUG-12	Discharger Report:
Dt MOE Arvl on Scn:		Material Group:
MOE Reported Dt:	27-AUG-12	Impact to Health:
Dt Document Closed:		Agency Involved:
Site No:		
MOE Response:	No Field Response	
Site County/District:		
Site Geo Ref Meth:		
Site District Office:		
Nearest Watercourse:		
Site Name:	The Queensway between Hwy 7 and Eagleson Rd<UNOFFICIAL>	
Site Address:		
Site Region:		
Site Municipality:	Ottawa	
Site Lot:		
Site Conc:		
Site Geo Ref Accu:		
Site Map Datum:		
Northing:		
Easting:		
Incident Cause:		
Incident Preceding Spill:		

Environment Impact: Not Anticipated
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 50 L
Contaminant Qty 1: 50
Contaminant Unit: L
Client Type:
Source Type:
Contaminant Code: 15
Contaminant Name: HYDRAULIC OIL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Incident Reason:
Incident Summary: Cabanah Const'n, 50 L hydraulic oil to The Queensway, cont'd
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Motor Vehicle
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:
Client Name: Thomas Cavanagh Construction Limited

Site: Enbridge Gas Distribution Inc.
 Denison Cres Ottawa ON

Database:
 SPL

Ref No: 2728-A3RHW
Year:
Incident Dt: 10/29/2015
Dt MOE Arvl on Scn:
MOE Reported Dt: 10/29/2015
Dt Document Closed:
Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name: 859 Denison Cres<UNOFFICIAL>
Site Address: Denison Cres
Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Incident Cause:
Incident Preceding Spill:
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 1 other - see incident description
Contaminant Qty 1: 1
Contaminant Unit: other - see incident description
Client Type:
Source Type:
Contaminant Code: 35
Contaminant Name: NATURAL GAS (METHANE)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Incident Reason: Operator/Human Error
Incident Summary: TSSA FSB: 1/2 in pl IP dmgd, made safe
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Miscellaneous Industrial
SAC Action Class: TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill
Call Report Locatn Geodata:
Time Reported:
System Facility Address:
Client Name: Enbridge Gas Distribution Inc.

Site: **Thomas Cavanagh Construction Limited**
Ottawa ON

Database:
SPL

Ref No: 8581-ALQMUR
Year:
Incident Dt: 4/24/2017
Dt MOE Arvl on Scn:
MOE Reported Dt: 4/24/2017
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: Light Rail Project, Merton Street Entrance<UNOFFICIAL>
Site Address:
Site Region: Eastern
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Incident Cause:
Incident Preceding Spill: Other
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 2 L
Contaminant Qty 1: 2
Contaminant Unit: L
Client Type: Corporation
Source Type: Other
Contaminant Code: 15
Contaminant Name: HYDRAULIC OIL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1: n/a
Receiving Medium: Land
Incident Reason: Equipment Failure
Incident Summary: Thomas Cavanagh Cnst: 2L hydraulic oil to grnd, no CBs, contained
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Miscellaneous Industrial
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:
Client Name: Thomas Cavanagh Construction Limited

Site:

HWY 417 WEST Ottawa ON

Database:

WWIS

Well ID: 7290688
Construction Date:
Use 1st: Test Hole
Use 2nd:
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: Z261473
Tag: A228339
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality:
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 07/19/2017
Selected Flag: TRUE
Abandonment Rec:
Contractor: 7579
Form Version: 7
Owner:
County:
Lot:
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 1006636095
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 07/04/2017
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone:
East83:
North83:
Org CS: UTM83
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: wwr

Overburden and Bedrock**Materials Interval**

Formation ID: 1006753724
Layer: 3
Color: 8
General Color: BLACK
Material 1: 17
Material 1 Desc: SHALE
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 42.0
Formation End Depth: 72.5
Formation End Depth UOM: ft

Overburden and Bedrock**Materials Interval**

Formation ID: 1006753722
Layer: 1
Color: 2

General Color: GREY
Material 1: 11
Material 1 Desc: GRAVEL
Material 2: 28
Material 2 Desc: SAND
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 20.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 1006753723
Layer: 2
Color: 6
General Color: BROWN
Material 1: 28
Material 1 Desc: SAND
Material 2: 06
Material 2 Desc: SILT
Material 3:
Material 3 Desc:
Formation Top Depth: 20.0
Formation End Depth: 42.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 1006753731
Layer: 1
Plug From: 0.0
Plug To: 72.5
Plug Depth UOM: ft

Method of Construction & Well
Use

Method Construction ID: 1006753730
Method Construction Code:
Method Construction:
Other Method Construction:

Pipe Information

Pipe ID: 1006753721
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1006753727
Layer: 1
Material:
Open Hole or Material:
Depth From: 0.0
Depth To: 72.5
Casing Diameter: 2.5
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 1006753728
Layer:
Slot:
Screen Top Depth:
Screen End Depth:
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter:

Water Details

Water ID: 1006753726
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole Diameter

Hole ID: 1006753725
Diameter: 3.630000114440918
Depth From: 0.0
Depth To: 72.5
Hole Depth UOM: ft
Hole Diameter UOM: inch

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial [AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial [AGR](#)

This database of licensed and permitted pits and quarries is maintained by the Ontario Ministry of Natural Resources and Forestry (MNRF), as regulated under the Aggregate Resources Act, R.S.O. 1990. Aggregate site data has been divided into active and inactive sites. Active sites may be further subdivided into partial surrenders. In partial surrenders, defined areas of a site are inactive while the rest of the site remains active.

Government Publication Date: Up to Nov 2023

Abandoned Mine Information System:

Provincial [AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Apr 2024

Anderson's Waste Disposal Sites:

Private [ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial [AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private [AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Apr 30, 2024

Borehole:

Provincial [BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2022

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-Apr 30, 2024

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -May 2024

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Jun 2024

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Aug 31, 2024

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database (ODHD) is offered by the Province of Ontario's Ministry of Mines. The dataset contains information for over 164,000 percussion, overburden, sonic and diamond-drill holes. The presence of assay results with cutoff values for gold, silver, copper, zinc, lead, nickel and platinum group elements is noted. Drill hole data are compiled from assessment files that have been submitted to the ministry in accordance with the Ontario Mining Act (OMA). Source assessment file numbers are captured for cross reference with the Ontario Assessment File Database (OAFD). Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Aug 2024**Delisted Fuel Tanks:**

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Oct 2023**Environmental Activity and Sector Registry:**

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011-Aug 31, 2024**Environmental Registry:**

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Aug 31, 2024**Environmental Compliance Approval:**

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011-Aug 31, 2024**Environmental Effects Monitoring:**

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007***ERIS Historical Searches:**

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Aug 31, 2024**Environmental Issues Inventory System:**

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment and Climate Change. These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2023

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Jun 2024

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: Oct 31, 2021

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Oct 31, 2022

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Dec 2022

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing is a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: 31 Oct, 2023

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 31, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2024

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act.

Government Publication Date: Dec 31, 2022

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Nov 2023

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Jun 30, 2021

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

[NEES](#)

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

[NPCB](#)

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory 1993-2020:**

Federal

[NPR2](#)

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of pollutant releases (to air, water and land), disposals, and transfers for recycling. The inventory, managed by Environment and Climate Change Canada, tracks over 300 substances. Under the authority of the Canadian Environmental Protection Act (CEPA), owners or operators of facilities that meet published reporting requirements are required to report to the NPRI.

Government Publication Date: Sep 2020**National Pollutant Release Inventory - Historic:**

Federal

[NPRI](#)

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances. This data holds historic records; current records are found in NPR2.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

[OGWE](#)

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-May 31, 2024**Ontario Oil and Gas Wells:**

Provincial

[OOGW](#)

In 1998, the Ministry of Natural Resources (MNR) handed over to the Ontario Oil, Gas and Salt Resources (OGSR) Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database includes well owner/operator, location, permit issue date, and well cap date, license number, status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provided for each well record.

Government Publication Date: 1800-Aug 2024**Inventory of PCB Storage Sites:**

Provincial

[OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

[ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Aug 31, 2024

Canadian Pulp and Paper:

Private

PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014

Parks Canada Fuel Storage Tanks:

Federal

PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial

PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011-Aug 31, 2024

Ontario PFAS Spills:

Provincial

PFAS

This specific list of spills includes those incidents where one or more of the listed contaminants are identified in the PFAS Structure List and/or PFAS Chemicals Without Explicit Structure List made available by the United States Environmental Protection Agency (US EPA), is originally sourced from the Ministry of the Environment, Conservation and Parks spills related data. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Mar 2024; May 2024

NPRI Reporters - PFAS Substances:

Federal

PFCH

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This listing of PFAS substance reporters includes those NPRI facilities that reported substances that are found in either: a) the Comprehensive Global Database of PFASs compiled by the Organisation for Economic Co-operation and Development (OECD), b) the US Environmental Protection Agency (US EPA) Master List of PFAS Substances, c) the US EPA list of PFAS chemicals without explicit structures, or d) the US EPA list of PFAS structures (encompassing the largest set of structures having sufficient levels of fluorination to potentially impart PFAS-type properties).

Government Publication Date: Sep 2020

Potential PFAS Handlers from NPRI:

Federal

PFHA

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This list of potential PFAS handlers includes those NPRI facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used, or released by the facility - these are facilities that potentially handle PFAS based on their industrial profile.

Government Publication Date: Sep 2020

Pipeline Incidents:

Provincial

PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Potential PFAS Handlers from EASR:

Provincial

PPHA

The Ontario Environmental Activity and Sector Registry (EASR), described in Ontario Regulation 245/11, allows businesses with less complex operations - and hence not requiring an Environmental Compliance Approval - to register their activities with the Ontario Ministry of the Environment, Conservation and Parks (MECP). This list of potential PFAS handlers includes those EASR facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used.

Government Publication Date: Jun 30, 2024

Private and Retail Fuel Storage Tanks:

Provincial

PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial

PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Aug 31, 2024

Ontario Regulation 347 Waste Receivers Summary:

Provincial

REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2021

Record of Site Condition:

Provincial

RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up. RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09). The Government of Ontario states that it is not responsible for the accuracy of the information in this Registry.

Government Publication Date: 1997-Sept 2001, Oct 2004-Aug 2024

Retail Fuel Storage Tanks:

Private

RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-Apr 30, 2024

Scott's Manufacturing Directory:

Private

SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial

SPL

List of spills and incidents made available by the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024

Wastewater Discharger Registration Database:

Provincial

SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2021

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2024

Variances for Abandonment of Underground Storage Tanks:

Provincial

[VAR](#)

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

[WDS](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011 Aug 31, 2024

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

[WDSH](#)

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

[WWIS](#)

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Dec 31 2023

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX 3

QUALIFICATIONS OF ASSESSORS

MOHAMMED RAMADAN

B.Sc

ENVIRONMENTAL SCIENTIST

MOHAMMED JOINED PATERSON GROUP IN 2021 AS PART OF THE ENVIRONMENTAL DEPARTMENT. MOHAMMED RECEIVED HIS BACHELOR OF SCIENCE IN ENVIRONMENTAL SCIENCE FROM CARLETON UNIVERSITY IN 2017. SINCE JOINING PATERSON GROUP IN 2021, MOHAMMED HAS WORKED ON NUMEROUS RESIDENTIAL AND COMMERCIAL DEVELOPMENT PROJECTS, PREDOMINANTLY WITHIN THE NATIONAL CAPITAL REGION AS WELL AS VARIOUS LOCATIONS WITHIN SOUTHEASTERN ONTARIO. HIS SCOPE OF WORK CONSISTS OF CONDUCTING PHASE I & II ENVIRONMENTAL SITE ASSESSMENTS, FIELD INSPECTIONS, CONTAMINATED SOIL AND GROUNDWATER FIELD SAMPLING, SUPERVISING THE REMEDIATION OF CONTAMINATED SITES, AS WELL AS PERFORMING DESIGNATED SUBSTANCE SURVEYS.

YEARS OF EXPERIENCE

- WITH PATERSON: 6

EDUCATION

- BACHELOR OF SCIENCE IN ENVIRONMENTAL SCIENCE, 2017
CARLETON UNIVERSITY, OTTAWA, ON

OFFICE LOCATION

9 AURIGA DRIVE, OTTAWA, ONTARIO, K2E 7T9

SELECT LIST OF PROJECTS

- RESIDENTIAL DEVELOPMENT: 200 BARIBEAU STREET, OTTAWA, ON (SITE REMEDIATION COORDINATOR & SUPERVISOR).
- RESIDENTIAL DEVELOPMENT: 93-105 NORMAN STREET, OTTAWA, ON (SITE REMEDIATION COORDINATOR & SUPERVISOR)
- COMMERCIAL DEVELOPMENT: TOLLGATE ROAD W, CORNWALL, ON (PHASE I & II ENVIRONMENTAL SITE ASSESSMENT)
- COMMERCIAL DEVELOPMENT: 930 WELLINGTON STREET W, OTTAWA, ON (PHASE I & II ENVIRONMENTAL SITE ASSESSMENT)
- COMMERCIAL DEVELOPMENT: 1405 WELLINGTON STREET W, OTTAWA, ON (PHASE I & II ENVIRONMENTAL SITE ASSESSMENT)
- RESIDENTIAL DEVELOPMENT: 1124 – 1130 BANK STREET, OTTAWA, ON (PHASE I & II ENVIRONMENTAL SITE ASSESSMENT)
- COMMERCIAL DEVELOPMENT: 1802 – 1804 ST. LAURENT BLVD, OTTAWA, ON (PHASE I ENVIRONMENTAL SITE ASSESSMENT)

PROFESSIONAL EXPERIENCE

2021 TO PRESENT, ENVIRONMENTAL SCIENTIST, PATERSON GROUP, OTTAWA, ONTARIO

CONDUCTING PHASE I AND PHASE II ENVIRONMENTAL SITE ASSESSMENTS IN ACCORDANCE WITH CSA STANDARDS AND O.REG. 153/04.

RESPONSIBLE FOR THE APPLICATION OF ENVIRONMENTAL, HYDROGEOLOGICAL, AND/OR GEOTECHNICAL PRINCIPLES AND PRACTICES IN THE IDENTIFICATION AND DELINEATION OF SOIL AND GROUNDWATER CONTAMINATION PLUMES WHILE ENSURING COMPLIANCE WITH FEDERAL, PROVINCIAL, AND/OR MUNICIPAL LEGAL AND REGULATORY REQUIREMENTS.

PRESENTING ANALYTICAL TEST RESULTS, INTERPRETATIONS, ASSESSMENTS, RECOMMENDATIONS AND/OR CONCLUSIONS IN A FINAL TECHNICAL REPORT.

FIELD EXPERIENCE IN THE SUPERVISION OF DRILLING AND EXCAVATION CONTRACTORS, INSPECTION OF ABOVEGROUND AND UNDERGROUND FUEL STORAGE TANKS, SOIL AND ROCK CLASSIFICATION, SOIL AND GROUNDWATER FIELD SAMPLING, AS WELL AS THE COLLECTION OF HAZARDOUS BUILDING MATERIALS AND DESIGNATED SUBSTANCES.

COORDINATION AND ON-SITE SUPERVISION OF SOIL AND GROUNDWATER REMEDIATION ACTIVITIES FOR CONTAMINATED SITES.

LIAISING WITH CLIENTS, CONTRACTORS, CONSULTANTS, AND GOVERNMENT OFFICIALS.

COORDINATION OF CONTRACTORS AND FIELD STAFF WHILE DIRECTLY REPORTING TO SENIOR MANAGEMENT AND CLIENT TO ENSURE COMPLETION OF PROJECT ON SCHEDULE AND WITHIN BUDGET.



PATERSON GROUP

solution oriented engineering



Mark S. D'Arcy, P.Eng., QP_{ESA} **Director – Environmental Division**

After receiving his Bachelors of Applied Science from Queen's University in 1991 in Geological Engineering, Mark joined Paterson Group Inc. During the first 10 years of Mark's career, he was heavily involved in all aspects of field work, including drilling boreholes, excavating test pits, conducting phase I site inspections, environmental sampling and analysis and inspection of environmental remediations. During Mark's field experience, he gained invaluable field and office experience, which would prepare Mark to become the Environmental Division Manager. Mark's field experience ranges from Phase I Environmental Site Assessments (ESAs) to on-site soil and groundwater remediations, as well as, environmental/geotechnical borehole investigations. Mark's field experience has provided extensive knowledge of subsurface conditions, contractor relations and project management. These skills would provide Mark with the ability to understand a variety of situations, which has lead Paterson to an extremely successful Environmental Department. Mark became the Environmental Manager in 2006, which consisted of two engineers and two field technicians. Mark has been an integral part in growing the Environmental Division, which now consists of nine engineers and three field technicians. Mark is the Senior Project Manager for a wide variety of environmental projects within the Eastern Ontario area including Phase I ESAs, Phase II ESAs, remediations for filing Records of Site Condition in the Ontario Ministry of the Environment and Climate Change (MOECC) Environmental Site Registry, Brownfield Applications and Landfill Monitoring Programs. As the Senior Project Manager, Mark is responsible for directing project personnel, final report review and overall project success. Mark has proven leadership and ability to manage small to large scale projects within the allotted time and budget.

EDUCATION

B.A.Sc. 1991, Geological Engineering, Queen's University, Kingston, ON

LICENCE/PROFESSIONAL AFFILIATIONS

Professional Engineers of Ontario

ESA Qualified Person with MECP

Ontario Society of Professional Engineers

Consulting Engineers of Ontario

YEARS OF EXPERIENCE

With Paterson: 33

OFFICE LOCATION

9 Auriga Drive, Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS

- 222 Beechwood Avenue, Ottawa, Ontario (Senior Project Manager for Phase I ESA, Phase II ESA, Phase III ESA, Environmental Remediation)
- 409 MacKay Street, Ottawa, Ontario (Senior Project Manager for Phase I ESA, Phase II ESA, Phase III ESA, Environmental Remediation)
- Art's Court Redevelopment, Ottawa, Ontario (Senior Project Manager for Phase I ESA, Phase II ESA, Phase III ESA, Environmental Remediation)
- Visitor Welcome Centre, Phase II and Phase III, Parliament Hill, Ottawa, Ontario (Senior Project Manager for Environmental Remediation)
- Mattawa Landfill, Mattawa, Ontario (Senior Project Manager, Annual Water Quality Monitoring report)
- Multi-Phase Redevelopment of the Ottawa Train Yards, Ottawa, Ontario (Senior Project Manager)
- Rideau Centre Expansion, Ottawa, Ontario (Senior Project Manager for Phase I ESA, Phase II ESA, Phase III ESA, Environmental Remediation)
- 26 Stanley Avenue, Ottawa, Ontario, Phase I ESA, Phase II ESA (Senior Project Manager)
- Monitoring Landfills for River Valley, Kipling and Lavigne (Senior Project Manager)
- Block D Lands – Brownfields Project - Kingston

PROFESSIONAL EXPERIENCE

2001 to present, Manager of Environmental Division, Paterson Group Inc., Ottawa, Ontario

- Manage all aspects of the environmental division (management of personnel, budgeting, invoicing, scheduling, business development, reporting, marketing, and fieldwork).
- Review day to day operations within the environmental division.
- Design, perform, and lead Phase I, II and Phase III ESAs, Remediation's, Brownfield Applications and Record of Site conditions, fieldwork surveys, excavation, monitoring, laboratory analysis, and interpretation.
- Write, present, and publish reports with methodology and laboratory analysis results, along with recommendations for environmental findings.
- Responsible for ensuring projects meet Ministry of Environment and Climate Change Standards and Guidelines.
- Building and fostering relationships with clients, stakeholders, and Ministry officials.
- Supervise and continuous training of staff in environmental methods (environmental sampling techniques, technical expertise and guidance).
- Applied due diligence in ensuring the health and safety of staff and the public in field locations.

1991 to 2001, Geotechnical and Environmental Engineer, Paterson Group Inc., Ottawa, Ontario

- Provide on-site geotechnical and environmental expertise to various clients.
- Oversee geotechnical and environmental investigations for drilling and test pitting on numerous proposed utility installations, residential and commercial developments.
- Problem solving to help advance or maintain project schedules.
- Complete environmental reports with recommendations to meet environmental standards set by MOE and CCME standards.
- Conduct site inspections, bearing medium evaluations, bearing surface inspections, concrete testing and field density testing.
- Liaising with contractors, consultants and government officials.
- Provide cost estimates for geotechnical and environmental field programs and construction costs.
- Review RFI's, submittals, monthly progress reports and other various construction related work.