

Phase I Environmental Site Assessment

1984 Baseline Road
Ottawa, Ontario

Prepared for Chick-fil-A Canada ULC

Report: PE7169-2R
Date: November 20, 2025

TABLE OF CONTENTS

EXECUTIVE SUMMARY	ii
1.0 INTRODUCTION	1
2.0 PHASE I PROPERTY INFORMATION	2
3.0 SCOPE OF INVESTIGATION	3
4.0 RECORDS REVIEW	4
4.1 General	4
4.2 Environmental Source Information	7
4.3 Physical Setting Sources	12
5.0 INTERVIEWS	15
6.0 SITE RECONNAISSANCE	15
6.1 General Requirements	15
6.2 Specific Observations at the Phase I Property	16
7.0 REVIEW AND EVALUATION OF INFORMATION	20
7.1 Current and Past Uses	20
7.2 Conceptual Site Model	22
8.0 CONCLUSIONS	27
8.1 Assessment	27
9.0 STATEMENT OF LIMITATIONS	28
10.0 REFERENCES	29

List of Figures

Figure 1 - Key Plan
Figure 2 - Topographic Map
Drawing PE7169-2 - Site Plan
Drawing PE7169-3 - Surrounding Land Use Plan

List of Appendices

Appendix 1 Plan of Survey
Aerial Photographs
Site Photographs

Appendix 2 MECP Freedom of Information
MECP Well Records
TSSA Correspondence
City of Ottawa HLUI
ERIS Report

Appendix 3 Qualifications of Assessors

EXECUTIVE SUMMARY

Assessment

Paterson Group was retained by Chick-fil-A Canada ULC, to carry out a Phase I-Environmental Site Assessment (ESA) for 1984 Baseline Road, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and 250m Phase I Study Area, and to identify any environmental concerns with the potential to have impacted the Phase I Property.

Based on the available historical information, the Phase I Property was initially developed with a public roadway on the eastern portion of the subject site prior to 1945, with the remainder of the property consisting of agricultural use land. The Phase I Property was developed with the existing commercial building in approximately 2002. The building has operated as retail store since that time to the present day. Two potentially contaminating activities related to on-site activities were identified including the potential presence of fill material of unknown quality (APEC 1) and the use of de-icing agents for road and pedestrian safety (APEC 2).

Based on the available historical information, adjacent and surrounding properties within the Phase I Study Area have been developed primarily for commercial purposes. Off-site PCAs, including former retail fuel outlets and automotive service garages located to the north and east, and a former dry cleaner and PCB waste storage site located to the southeast, were identified and are considered to represent APECs on the Phase I Property. The remaining PCAs identified in the Phase I Study Area are not considered to represent APECs on the Phase I Property due to their separation distance and/or the down/cross-gradient orientation with respect to the Phase I Property.

Following the historical research, a site visit was conducted. The Phase I Property is occupied by a commercial building used for commercial retail purposes (The Beer Store). No environmental concerns were identified with the current use of the Phase I Property.

Land use within the Phase I Study Area is primarily commercial, with some properties used for industrial and agricultural or other purposes. No previously unidentified PCAs were observed during the review of the current use of surrounding properties.

Based on the findings of the Phase I ESA, it is **our opinion that a Phase II-Environmental Site Assessment is required for the Phase I Property.**

1.0 INTRODUCTION

At the request of Chick-fil-A Canada ULC, Paterson Group (Paterson) carried out a Phase I-Environmental Site Assessment (Phase I-ESA) for 1984 Baseline Road, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and properties within the Phase I Study Area to identify any potentially contaminating activities (PCAs) that would result in areas of potential environmental concern (APECs) on the subject land.

Paterson was engaged to conduct this Phase I-ESA by Mr. Roland Garro with Chick-fil-A Canada ULC. Mr. Roland Garro can be reached by mail at 5200 Buffington Road, Atlanta, GA, USA, 30349.

This report has been prepared specifically and solely for the above noted project which is described herein. It contains all our findings and results of the environmental conditions at this site.

This Phase I-ESA report has been prepared in general accordance with Ontario Regulation (O.Reg.) 153/04, as amended, under the Environmental Protection Act, and CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I-ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

2.0 PHASE I PROPERTY INFORMATION

Address:	1984 Baseline Road, Ottawa, Ontario.
Legal Description:	Part of Lot 35, Concession 2 (Rideau Front) and Part of Road Allowance between Concessions 1 and 2 (Rideau Front), City of Ottawa.
Property Identification Number (PIN):	04691-0235 (LT).
Location:	The Phase I Property is located on the southeast corner of the intersection between Baseline Road and Woodroffe Avenue, in the City of Ottawa, Ontario. Refer to Figure 1 - Key Plan in the Figures section following the text.
Latitude and Longitude:	45° 21' 5.0" N, 75° 45' 43.0" W
Site Description:	
Configuration:	Irregular
Area:	0.24 ha (approximate)
Zoning:	MC F (1.5) H (34) – Mixed-Use Centre Zone
Current Use:	The Phase I Property is currently occupied by a single storey commercial retail building and associated parking and landscaped areas.
Services:	The Phase I Property is located in a municipally serviced area.

3.0 SCOPE OF INVESTIGATION

The scope of work for this Phase I – Environmental Site Assessment was as follows:

- ☐ Determine the historical activities on the Phase I property and Study Area by conducting a review of readily available records, reports, photographs, plans, mapping, databases, and regulatory agencies;
- ☐ Investigate the existing conditions present at the Phase I property and Study Area by conducting site reconnaissance;
- ☐ Conduct interviews with persons knowledgeable of current and historic operations on the subject properties, and if warranted, neighbouring properties;
- ☐ Present the results of our findings in a comprehensive report in general accordance with the requirements of O.Reg. 153/04, as amended, under the Environmental Protection Act, and CSA Z768-01 (reaffirmed 2022);
- ☐ Provide a preliminary environmental site evaluation based on our findings;
- ☐ Provide preliminary remediation recommendations and further investigative work if contamination is suspected or encountered.

4.0 RECORDS REVIEW

4.1 General

Phase I-ESA Study Area Determination

A radius of approximately 250 m was determined to be appropriate as a Phase I Study Area for this assignment. Properties outside the 250 m radius are not considered to have impacted the subject land, based on their significant distance from the site.

First Developed Use Determination

Based on a review of available historical records, the Phase I Property was first developed with a roadway prior to 1945. The first developed use is considered to be Community Use.

Fire Insurance Plans (FIPs)

Fire Insurance Plans (FIPs) from 1965 were reviewed for the Phase I Property and surrounding properties. The Phase I Property is depicted as a vacant parcel of land, with the former Woodroffe Avenue running through the eastern portion of the site. The 1965 Fire Insurance Plans (FIPs) included coverage of the surrounding properties located immediately north of Baseline Road, and to the south and east of the Phase I Property.

Potentially contaminating activities (PCAs) identified within the Phase I Study Area from a review of the 1965 FIPs are summarized in Table 1.

Table 1 – Potentially Contaminating Activities Fire Insurance Plans (1965) Review Summary			
Address	Potentially Contaminating Activity	Distance / Orientation from Site	Area of Potential Environmental Concern (Y/ N)
1980 Baseline Road (now part of 1900 Baseline Road)	Former Retail Fuel Outlet (with one associated UST)	Adjacent East	Y
1983 Baseline Road	Former Automotive Service Garage (with two associated USTs)	40 m North	Y
1945 Baseline Road	Former Automotive Service Garage (with one associated UST)	100 m Northeast	Y

The former retail fuel outlet with 1 UST addressed 1980 Baseline Road (now part of 1900 Baseline Road), adjacent to the west of the Phase I Property, and the former automotive service garage with 2 USTs addressed 1983 Baseline Road,

approximately 40 m to the north of the Phase I Property are off-site PCAs considered to result in APECs on the Phase I Property.

Additionally, the former automotive service garage (with 1 UST) at 1945 Baseline Road is considered to result in an APEC on the Phase I Property.

It should be noted that civic addresses have changed over the years and those listed above may not currently exist. The respective distances of the above noted activities from the Phase I Property were determined using FIPs and the City of Ottawa electronic mapping website.

The PCAs identified during a review of the FIPs are illustrated on Drawing PE7169-2 – Surrounding Land Use Plan, provided in the Figures section following the text.

City of Ottawa Street Directories

City directories for the Phase I Property and neighbouring properties in the Phase I Study Area were reviewed in approximate ten-year intervals, between 1956 to 2011 (last published year). The Phase I Property was first listed in the city directories in the early 2000s as The Beer Store and remains the same up to 2011. The Phase I Property remained undeveloped until its current development in 2002, at which time it was assigned the municipal address 1984 Baseline Road.

Prior to the early 2000s, the address 1984 Baseline Road was associated with a Brewer's Retail Store established in 1969, located to the east of the Phase I Property.

No environmental concerns were identified in relation to the former use of the Phase I Property based on the review of the city directories.

Surrounding properties in the Phase I Study Area were historically listed for commercial use. Potentially contaminating activities identified from a review of the City Directories are summarized in Table 2.

Table 2 - Potentially Contaminating Activities City Directories Review Summary					
Listing	Address	Approx. Distance from Phase I Property	Years Listed	Potentially Contaminating Activity	Represents an Area of Potential Environmental Concern (Y/N)
Top Valu Gas Mart Service Station	1980 Baseline Road (now part of 1900 Baseline Road)	Adjacent East	1970- 2000s	Former Retail Fuel Outlet	Y

Table 2 - Potentially Contaminating Activities City Directories Review Summary					
Listing	Address	Approx. Distance from Phase I Property	Years Listed	Potentially Contaminating Activity	Represents an Area of Potential Environmental Concern (Y/N)
Shaw Bill Esso Service Station	1983 Baseline Road	40 m North	1960s-1980s	Former Retail Fuel Outlet	Y
Dry Cleaners (under multiple names)	1363 and 1371 Woodroffe Avenue	95 m Southeast	1960s-1990s	Former Dry Cleaners	Y
Small Car Centre Auto Dealers	1945 Baseline Road	100 m Northeast	1970s-1980s	Former Automotive Service Garage	Y
Graham Tony Toyota Centre Gas and Serv. Centre (Later Tony Graham Lexus Toyota)	1945 and 1971 Baseline Road	40 m Northeast	1980s-2000s	Former Retail Fuel Outlet and Car Dealership	Y

As discussed in the FIP section, the former retail fuel outlet at 1980 Baseline Road (now part of 1900 Baseline Road), adjacent to the west of the Phase I Property, the former automotive service garage/ retail fuel outlet at 1983 Baseline Road, and the former operations of 1945, 1971 Baseline Road are considered to result in APECs on the Phase I Property.

Additionally, former dry-cleaning facilities identified at 1363 and 1371 Woodroffe Avenue, located within a large shopping centre that was demolished in the early 2000s, are considered to represent an APEC on the Phase I Property.

Based on the respective separation distance and cross-gradient orientation relative to the Phase I Property, the remaining off-site PCAs identified during the review of the City of Ottawa street directories are not considered to represent an environmental concern on the Phase I Property.

The PCAs identified during a review of the City of Ottawa street directories are illustrated on Drawing PE7169-2 – Surrounding Land Use Plan, provided in the Figures section following the text.

Chain of Title

Given the available information, it was determined that the results of a chain of title search would not contribute to the environmental assessment for the Phase I Property. Therefore, a chain of title search was not completed as part of this assessment.

Plan of Survey

A topographic plan of survey for the Phase I Property, prepared by J.D. Barnes Ltd. was reviewed as part of the Phase I ESA. The plan shows the Phase I Property in its current configuration. A copy of the topographic plan of survey is provided in Appendix 1.

Previous Environmental Reports

The following environmental reports were reviewed as part of this Phase I-ESA:

- ❑ “Designated Substance Survey, 1984 Baseline Road, Ottawa, Ontario,” prepared for Chick-fil-A Canada ULC., by Paterson Group Inc., and dated August 13, 2025.

A designated substance survey was completed by Paterson Group in conjunction with the current assessment. A total of 28 bulk samples of potentially asbestos-containing materials were submitted for laboratory analysis, along with two paint samples for lead content testing. The results did not identify any asbestos-containing materials (ACMs) or lead-based paints present within the building.

4.2 Environmental Source Information

Environment Canada

A search of the National Pollutant Release Inventory (NPRI) was conducted electronically on September 17, 2025. No records were found in the NPRI database for properties within the Phase I Study Area.

PCB Inventory

A search of provincial PCB waste storage sites was conducted. A PCB waste storage site was identified at 1980 Baseline Road, presumed to have been associated with the former shopping centre demolished in the early 2000s, located approximately 95m southeast of the Phase I Property. This PCB waste storage site is considered to result in an APEC on the Phase I Property.

Areas of Natural Significance

A search for areas of natural significance and features within the Phase I Study Area was conducted on the website of the Ontario Ministry of Natural Resources (MNR) on September 17, 2025. The search did not reveal any areas of natural significance within the Phase I Study Area.

Ministry of the Environment, Conservation and Parks Freedom of Information Request

MECP Submissions

A request was submitted to the MECP FOI office for information with respect to reports related to environmental conditions for the Phase I Property. A response from the MECP was received on August 20, 2025, indicating that no relevant records were found. The response noted the possible presence of inactive records prior to 1986; however, the search was not pursued further as it was considered unlikely to yield additional information. A copy of the response is included in Appendix 2.

MECP Incident Reports

A request was submitted to the MECP FOI office for information with respect to records concerning environmental incidents, orders, offences, spills, discharges of contaminants, inspections maintained by the MECP for the Phase I Property or neighbouring properties. A response from the MECP was received on August 20, 2025, indicating that no relevant records were found. The response noted the possible presence of inactive records prior to 1986; however, the search was not pursued further as it was considered unlikely to yield additional information. A copy of the response is included in Appendix 2.

MECP Instruments

A request was submitted to the MECP Freedom of Information (FOI) office for information with respect to certificates of approval, permits to take water, certificates of property use or any other similar MECP issued instruments for the site. A response from the MECP was received on August 20, 2025, indicating that no relevant records were found. The response noted the possible presence of inactive records prior to 1986; however, the search was not pursued further as it was considered unlikely to yield additional information. A copy of the response is included in Appendix 2.

MECP Waste Management Records

A request was submitted to the MECP FOI office for information with respect to waste management records. A response from the MECP was received on August 20, 2025, indicating that no relevant records were found. The response noted the possible presence of inactive records prior to 1986; however, the search was not pursued further as it was considered unlikely to yield additional information. A copy of the response is included in Appendix 2.

MECP Brownfields Environmental Site Registry

A search of the MECP Brownfields Environmental Site Registry (ESR) was conducted as part of this assessment for the site, neighbouring properties and the general area of the site. No record of site condition (RSC) was identified for the Phase I Property.

One active Record of Site Condition (RSC #B-403-1324869138) was identified for 1900 Baseline Road, located approximately 235 m east of the Phase I Property. The RSC was filed based on Phase I and Phase II Environmental Site Assessments (ESAs), which reported no contaminated soil or groundwater on that property.

The Conceptual Site Model (CSM) documents included in the RSC identified two groundwater plumes: one contaminated with tetrachloroethylene and another with benzene, located to the east and southeast of the Phase I Property. As discussed previously, the former dry cleaners at the shopping centre (approximately 95m southeast of the Phase I Property) and the former retail fuel outlet immediately east of the Phase I Property are considered APECs. These groundwater plumes are interpreted to be associated with those APECs.

MECP Waste Disposal Site Inventory

The Ontario Ministry of Environment document titled "Waste Disposal Site Inventory in Ontario, 1991" was reviewed as part of the historical research. This document includes all recorded active and closed waste disposal sites, industrial manufactured gas plants and coal tar distillation plants in the Province of Ontario. No such sites were listed in the database for the Phase I Property or properties within the Phase I Study Area.

Technical Standards and Safety Authority (TSSA)

The TSSA, Fuels Safety Branch in Toronto, was contacted electronically on June 22, 2025, and August 7, 2025, to inquire about current and former underground/aboveground storage tanks for the subject and neighbouring properties. The response from the TSSA indicated that no records were listed in the TSSA registry for the Phase I Property.

The response from the TSSA identified seven records related to 1980 Baseline Road and one record for 1900 Baseline Road. Two of the records (one for 1900 Baseline Road and one for 1980 Baseline Road) relate to propane cylinder exchanges and are not considered to pose a potential risk to the Phase I Property. The remaining records, all associated with 1980 Baseline Road, are expired and pertain to five fuel tanks and one gasoline station. As previously discussed, the

former retail fuel outlet at 1980 Baseline Road is considered to represent an APEC on the Phase I Property.

A copy of the TSSA correspondence is included in Appendix 2.

City of Ottawa Historical Land Use Inventory (HLUI)

A request for a search of the City of Ottawa's Historical Land Use Inventory (HLUI) database was submitted to the City of Ottawa. A response from the HLUI was received on October 17, 2025, indicating that no records were identified for the Phase I Property.

Records identified for surrounding properties were reviewed and were either associated with previously identified PCAs or were not considered PCAs within the Phase I Study Area. No new PCAs were identified based on the HLUI findings.

A copy of the HLUI response letter, map, and tables is provided in Appendix 2.

City of Ottawa Old Landfill Sites

The document prepared by Golder Associates entitled, "*Old Landfill Management Strategy, Phase I - Identification of Sites, City of Ottawa*", was reviewed as part of this assessment. No former landfill sites were identified on the Phase I Property, or within a 250 m radius of the Phase I Property.

City of Ottawa Former Industrial Sites

The document prepared by Intera Technologies Limited entitled, "*Mapping and Assessment of Former Industrial Sites, City of Ottawa*", was also reviewed as part of this assessment. No former industrial sites were identified on the Phase I Property, or within a 250 m radius of the Phase I Property.

Environmental Risk Information Service (ERIS) Report

An Environmental Risk Information Services (ERIS) report, dated July 24, 2025, was acquired for the Phase I Property and reviewed as part of this assessment. It should be noted that the ERIS report includes information that would normally be obtained through the MECP FOI, MECP well records search as well as several other records (i.e., incident reports, waste generators, etc.). The complete ERIS report has been included in Appendix 2.

☐ **On-Site Records:**

A total of three records were identified for the Phase I Property (1 of which is previous ERIS searches). The ERIS report identified two water well records for the

Phase I Property. Both records relate to monitoring wells installed in 2018, presumably as part of previous environmental monitoring, which is further discussed in the water well records section of this report.

❑ *Off-Site Records:*

A total of 251 records from various databases were identified for properties within a 250 m radius of the Phase I Property (13 of which are previous ERIS searches).

The ERIS report identified 3 National PCB Inventory records, and 6 Inventory of PCB Storage Sites records for surrounding properties within the Phase I Study Area. All records pertain to PCB storage at the Landawn Shopping Centre (Shoppers City West), former shopping centre, approximately 95 m southeast of the Phase I Property. This PCB waste storage site is considered a PCA within the Phase I Study Area and represents an APEC on the Phase I Property.

The ERIS report identified 7 Delisted Fuel Tank records, 5 Expired Fuel Safety Facility records, 2 one Private & Retail Fuel Storage Tank records, and 1 Retail Fuel Storage Tank record for the property located at 1980 Baseline Road, adjacent to the east of the Phase I Property. These records are associated with the property's former use as a retail fuel outlet. As previously discussed, the former retail fuel outlet at 1980 Baseline Road is considered to represent an APEC on the Phase I Property.

The ERIS report identified 25 Ontario Spill records and 2 Fuel Oil Spills and Leaks records for surrounding properties within the Phase I Study Area. One record for 1980 Baseline Road, dated 2002, documented a 320-litre fuel leak from an underground storage tank (UST). As discussed above, this property and its former use are considered an APEC. Another record, dated 1995, was identified for the Ontario Hydro transformer station at 1307 Woodroffe Avenue (currently 1299 Woodroffe Avenue), approximately 220 m north of the Phase I Property. This record involved a release of 743 litres of mineral oil (containing 2 ppm PCBs) onto a gravel surface. The presence of the transformer station is considered a PCA in the Phase I Study Area. Based on the separation distance and down-gradient orientation with respect to the Phase I Property, the identified transformer station and historical spill is not considered to result in an APEC on the Phase I Property. The remaining spill records consist of minimal hydraulic oil, oily water, diesel, sewage water, natural gas and coolant leak/spills occurring at properties a minimum of 30 m from the Phase I Property. Based on their respective separation distances and the nature of the spills, the records are not considered to represent an environmental concern to the Phase I Property.

The ERIS report identified 80 Waste Generator records for surrounding properties within the Phase I Study Area. Four records were identified for 1363 Woodroffe Avenue, associated with the former dry cleaners, with approval years ranging from 1990 to 2001. Halogenated solvents were listed as the waste class. As discussed previously, the former dry cleaners is considered an APEC on the Phase I Property. Two records were identified for 1379 Woodroffe Avenue, related to its use as an LCBO liquor store, listing PCBs as the waste class between 1995 and 2001. Based on the nature of these records, they are not considered to represent a PCA. Remaining waste generator records identified in the ERIS report are either related to a previously identified PCA or are not considered to represent PCAs based on information contained within the records.

The ERIS report identified four certificates of approval, four environmental registry, and seven environmental compliance approval records for surrounding property within the Phase I Study Area. The records are limited to air and sewer works and are not considered to pose an environmental risk to the Phase I Property.

The ERIS report identified 75 well records and 5 borehole records for surrounding properties within the Phase I Study Area, which are further discussed in the water well records section of this report.

The remaining records identified in the ERIS report contain minimal or non-pertinent information and/or include details that are not considered indicative of a potential environmental concern to the Phase I Property. The complete ERIS report has been included in Appendix 1.

4.3 Physical Setting Sources

Aerial Photographs

Historical air photos from the National Air Photo Library, GeoOttawa Website and Google Earth were reviewed in approximate ten (10) year intervals. Based on the review, the following observations have been made:

1945 (National Air Photo Library) The subject property consists of agricultural use land to the west, and Woodroffe Avenue extending north-south through the eastern portion of the Phase I Property. Baseline Road and Woodroffe Avenue are present at this time, however not in their present-day orientation. Pinecrest Creek is also observed north of the subject property. Surrounding properties in the area consist of agricultural land with occasional farmsteads.

- 1958 (National Air Photo Library) No significant changes are apparent with respect to the Phase I Property or surrounding properties.
- 1965 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property. Woodroffe Avenue has been realigned to run north-south to the west of the Phase I Property, with the portion on the eastern side of the Phase I Property remaining. East of the Phase I Property, a commercial retail store and a retail fuel outlet have been constructed. Further southeast a commercial shopping mall has been constructed. An automotive service garage has also been constructed north of the Phase I Property, across Baseline Road, since the previous photograph.
- 1976 (GeoOttawa) No significant changes are apparent with respect to the Phase I Property. Additional commercial buildings have been constructed northeast of the Phase I Property.
- 1991 (GeoOttawa) No significant changes are apparent with respect to the Phase I Property. A commercial building has been developed to the southeast of the Phase I Property.
- 2002 (GeoOttawa) The Phase I Property is undergoing development with the current commercial retail building at this time. The properties to the south and east are being redeveloped including demolition of the former RFO, shopping mall, and commercial retail buildings.
- 2011 (GeoOttawa) The commercial retail building on the Phase I Property has been constructed, with associated landscaped and paved areas. The redevelopment of the properties to the south and east has also been completed with commercial retail and restaurant buildings and associated parking.
- 2019 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property. The property west of the Phase I Property appears to be used as a construction staging yard.
- 2025 (Google Earth) No significant changes are apparent with regard to the Phase I Property or surrounding properties.

The identified construction staging yard at 2030 Baseline Road, approximately 45m southwest of the Phase I Property, is considered to a PCA in the I Study Area. Based on the separation distance and cross-gradient orientation with respect to the Phase I Property, the identified PCA is not considered to represent an APEC on the Phase I Property.

Copies of selected aerial photographs reviewed are included in Appendix 1.

Physiographic Maps

A Physiographic Map was reviewed from the Natural Resources Canada – The Atlas of Canada website. According to this physiographic map, the site is located in the St. Lawrence Lowlands. According to the mapping description provided: “The lowlands are plain-like areas that were all affected by the Pleistocene glaciations and are therefore covered by surficial deposits and other features associated with the ice sheets.” The Phase I Property is located in the Central St. Lawrence Lowland, which is generally less than 150 m above sea level.

Topographic Maps

Topographic maps were obtained from Natural Resources Canada – The Atlas of Canada website and from the City of Ottawa website. The topographic maps indicate that the elevation of the Phase I Property is approximately 80 m above sea level. The regional topography in the general area of the Phase I Property slopes down to the west and northwest. An illustration of the referenced topographic map is presented on Figure 2 – Topographic Map, appended to this report.

Geological Maps

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on the information from NRCAN, bedrock in the area of the site consists of shale of the Rockcliffe Formation. Based on the maps, the surficial geology consists of alluvial sediments of sand and silt with an overburden thickness ranging from 10 to 15m.

Water Well Records

A search of the MECPs website was conducted on August 19, 2025, for all drilled well records within a 250m radius of the Phase I Property. Four well records were identified for the Phase I Property, associated with monitoring wells installed between 2001 and 2019.

The search also identified 72 well records for surrounding properties within the Phase I Study Area. Seven records corresponded to domestic or commercial potable wells installed between 1958 and 1961. 18 records were related to well abandonment. The remaining 47 well records were related to monitoring well installed between 2001 to 2022, associated with former geotechnical and/or environmental investigations.

Based on the availability of municipal services, no drinking water wells are expected to be currently in use within the Phase I Study Area.

In general, according to the well records, the strata in the Phase I Study Area consists of sand over silty clay. Bedrock was encountered at depths ranging from 9.75 to 15.25 mbgs in the nearby well records identified within the Phase I Study Area.

5.0 INTERVIEWS

Property Owner Representatives

Ms. Barbara Farber, the President of Leikin Group (current property owner), was available by phone on August 6, 2025, to respond to questions pertaining to the current and historical use of the Phase I Property. According to Ms. Farber, the Phase I Property was purchased around 2005 by a joint partnership that includes the Leikin Group. Ms. Farber has been familiar with the property since before that time. Ms. Farber indicated that the larger parcel of land that encompasses present day College Square was previously developed with Shoppers City West. This previous development included a department store, grocery store, dry cleaners, a gas station, and various other commercial retail stores. Ms. Farber indicated that there had previously been contamination to the College Square property originating from the historical drycleaning operations but that it has subsequently been remediated. To Ms. Farber's knowledge, there is no present-day contamination to the Phase I Property or neighbouring properties, however, no previous reporting was made available for review. Ms. Farber was not aware of any fuel storage tanks or spills occurring on the Phase I Property.

The information obtained through the interview with Ms. Farber is considered to be consistent with site information obtained from other sources (aerial photos, ERIS Database Report and site observations) and is considered to be valid.

6.0 SITE RECONNAISSANCE

6.1 General Requirements

A site visit was conducted on July 23, 2025, by Paterson personnel from the environmental division. Mr. Chris Green completed the site visit. Weather conditions at the time of the site inspection were sunny and approximately 22°C. In addition to the site, the uses of neighbouring properties within the Phase I Study Area were assessed at the time of the site visit from publicly accessible areas.

6.2 Specific Observations at the Phase I Property

Buildings and Structures

The Phase I Property is occupied by a single storey slab-on-grade commercial building with associated asphalt parking, and landscaped areas, constructed in approximately 2002. The building is separated into a commercial retail area (southern portion) and a warehouse area (northern portion). The exterior of the building is finished with stucco panelling and a modified bituminous roof.

The Site Building is currently occupied by The Beer Store, operating as a retail store.

Subsurface Structures and Utilities

The Phase I Property is municipally serviced. Basen on private and public underground utility locates obtained for the Phase I Property, underground utilities identified on the Phase I Property include electrical, natural gas, water, sewer, telecommunication lines primarily entering from the north and west of the Phase I Property. Storm sewers are present in the southern portion of the Phase I Property, in the parking area, as well as catch basins and manholes observed in this area. A pad mounted transformer is present to the west of the subject building, which was installed concurrently with site development in approximately 2002. No other subsurface structures were identified at the time of the site inspection.

Site Features

The site topography is generally flat. The regional topography in the general area of the Phase I Property slopes down to the west and northwest, in the direction of the Ottawa River.

Water drainage on the Phase I Property occurs via sheet drainage to catch basins located in the parking areas and via infiltration in landscaped areas. No ponded water, stressed vegetation, surficial staining, or any other indications of potential sub-surface contamination were observed on the subject site at time of the site inspection.

No drains, pits or sumps were observed on the exterior of the Phase I Property at the time of the site inspection. No evidence of current or former railway lines or spur lines on the Phase I Property was observed at the time of the site inspection.

Site features are presented on Drawing PE7169-1 – Site Plan, provided in the Figures section following the text.

Potential Environmental Concerns

☐ **Groundwater Monitoring Wells**

Five monitoring wells were identified on the Phase I Property during the site assessment, associated with previous environmental monitoring. Additional monitoring wells were also observed across the larger College Square property.

☐ **Fuels and Chemical Storage**

No above ground fuel storage tanks (ASTs), or signs of USTs were observed on the exterior of the Phase I Property at the time of the site inspection. No chemicals were found to be stored on the exterior of the Phase I Property.

☐ **Waste Management**

Solid, non-hazardous waste and recyclable products are stored in metal containers located in the northeast corner of the Phase I Property and are collected regularly by a private contractor. No environmental concerns were identified with respect to waste management practices on the Phase I Property.

☐ **Polychlorinated Biphenyls (PCBs) and Transformer Oil**

A pad-mounted transformer was present to the west of the subject building, installed in 2002 concurrently with the site development. The transformer was noted to be in good condition at the time of the site visit. Based on the condition, date of construction and lack of spill/incident reports, this transformer is not considered to result in an APEC on the Phase I Property.

☐ **Fill Material**

No visual evidence of fill material was observed on the exterior of the Phase I Property during the site visit. However, fill material was likely imported during site development for grading, engineered fill around buildings, asphaltic surfaces, and below ground utilities. As a result, fill material of unknown quality is considered a PCA resulting in an APEC on the Phase I Property.

Interior Assessment

A general description of the interior of the commercial building is as follows:

- ☐ Floors consist of concrete and ceramic tiles;
- ☐ Walls consist of drywall and plywood panelling;
- ☐ Ceilings consist of primarily steel decking with suspended ceiling tiles in the breakroom and staff washroom;
- ☐ Lighting is provided by a combination of fluorescent and LED fixtures.

Potentially Hazardous Building Products

☐ **Asbestos-Containing Materials (ACMs)**

A designated substance survey (DSS) was completed in conjunction with the current investigation. Based on the analytical results, no asbestos containing materials were identified to be present in the subject building.

☐ **Lead-Based Paints (LBPs)**

A designated substance survey (DSS) was completed in conjunction with the current investigation. Based on the analytical results, no lead-based paints were identified to be present in the subject building.

☐ **Polychlorinated Biphenyls (PCBs) and Transformer Oil**

No concerns related to PCBs and transformers were noted inside the subject building.

Other Potential Environmental Concerns

☐ **Fuel and Chemical Storage**

No aboveground storage tanks (ASTs) or signs of underground storage tanks (USTs) were observed inside the subject building at the time of the site visit. The subject building is currently heated with a natural gas fired furnace.

Chemical products stored in the subject building were observed to be limited to commercially available cleaning products, stored in their original containers. No environmental concerns were identified with respect to chemical storage practices within the subject building.

☐ **Wastewater Discharge**

Wastewater generated on the Phase I Property, including wash water and sewage, is discharged to the municipal water system. Roof drainage is discharged into the asphaltic concrete areas of the Phase I Property or into the City of Ottawa storm water system via surface runoff.

☐ **Drains, Pits and Sumps**

No sump pits were observed within the subject building. Floor drains were present within the subject building. No odours, sheen or other indicators of potential contamination were observed in the floor drains. No environmental concerns were identified with respect to wastewater discharges at the Phase I Property.

☐ **Ozone Depleting Substances (ODSs)**

Potential sources of ODSs observed on-site include HVAC units, refrigerators and fire extinguishers. These appliances were noted to be in good condition at the time of the site inspection and should be regularly serviced by a licensed contractor.

☐ **Hydraulic Equipment**

No hydraulic equipment was observed on the Phase I Property at the time of inspection. A loading dock was observed on the east side of the subject building and is powered via electric means.

Neighbouring Properties

An inspection of the neighbouring properties was conducted from publicly accessible areas at the time of the site visit. Land use adjacent to the Phase I Property was as follows:

- ☐ North - Baseline Road, followed by commercial retail buildings and parkland;
- ☐ South - Commercial retail and restaurant buildings and associated parking areas;
- ☐ East - Commercial Parking lot, followed by commercial retail buildings;
- ☐ West - Woodroffe Avenue, followed by a construction staging yard and a new transit line.

Land use within the Phase I Study Area is primarily commercial, with some properties used for industrial and agricultural or other purposes. No previously unidentified PCAs were observed during the review of the current use of surrounding properties.

Current land use and PCAs identified in the Phase I Study Area are presented on Drawing PE7169-2 – Surrounding Land Use Plan.

7.0 REVIEW AND EVALUATION OF INFORMATION

7.1 Current and Past Uses

Based on a review of available historical records, the Phase I Property was first developed with a roadway (Woodroffe Avenue) along the eastern portion of the property (Community Use) prior to 1945. The Phase I Property was developed with the existing commercial building around 2002.

Potentially Contaminating Activities (PCAs) and Areas of Potential Environmental Concern (APECs)

Based on the findings of the Phase I ESA, the following on-site and off-site PCAs (as listed in Column A, Table 2 of O.Reg.153/04) were considered to result in seven APECs on the Phase I Property:

- ☐ PCA 30 – Importation of Fill Material of Unknown Quality – this PCA is associated with the potential presence of fill material of unknown quality on the Phase I Property (APEC 1).
- ☐ PCA N/A – Application of Road Salt – this PCA is associated with application of de-icing agents used for the purpose of vehicular safety on the parking area of the Phase I Property (APEC 2).
- ☐ PCA 28 – Former Retail Fuel Outlet (with 1 UST) – this PCA is associated with the historical off-site retail fuel outlet at the property addressed 1980 Baseline Road, adjacent to the east of the Phase I Property (APEC 3).
- ☐ PCA 28 – Former Retail Fuel Outlet (with 2 USTs) – this PCA is associated with the historical off-site retail fuel outlet at the property addressed 1983 Baseline Road, approximately 40 m north of the Phase I Property (APEC 4).
- ☐ PCA 52 – Former Automotive Service Garage – this PCA is associated with the historical off-site automotive service garage at the property addressed 1983 Baseline Road, approximately 40 m north of the Phase I Property (APEC 5).

- ❑ PCA 28 – Former Retail Fuel Outlet (with 1 UST) – this PCA is associated with the historical off-site retail fuel outlet at the property addressed 1945 and 1971 Baseline Road, approximately 40 m northeast of the Phase I Property (APEC 6).
- ❑ PCA 52 – Former Automotive Service Garage – this PCA is associated with the historical off-site automotive service garage and car dealership at the property addressed 1945 and 1971 Baseline Road, approximately 40 m northeast of the Phase I Property (APEC 7).
- ❑ PCA 37 – Former Dry Cleaners – this PCA is associated with the historical off-site dry cleaners at the property addressed 1363 and 1371 Woodroffe Avenue, at the location of the former shopping centre building, approximately 95 m southeast of the Phase I Property (APEC 6).
- ❑ PCA N/A – Former PCB Waste Storage Site – this PCA is associated with the historical off-site PCB waste storage site at the property addressed 1980 Baseline Road, at the location of the former shopping centre building, approximately 95m southeast of the Phase I Property (APEC 7).

The remaining off-site PCAs identified within the Phase I Study Area are not considered to result in APECs on the Phase I Property due to their separation distance and/or their down/cross-gradient orientation with respect to the Phase I Property.

All APECs are outlined on Drawing PE7169-2 – Site Plan, while all PCAs identified within the Phase I Study Area are presented on PE7169-3 – Surrounding Land Use Plan in the Figures section of this report, following the text.

Contaminants of Potential Concern (CPCs)

The contaminants of potential concern for the soil and/or groundwater on the Phase I Property include the following:

- ❑ Petroleum Hydrocarbons, fractions 1 – 4 (PHCs);
- ❑ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ❑ Volatile Organic Compounds (VOCs);
- ❑ Polychlorinated Biphenyls (PCBs);
- ❑ Polycyclic Aromatic Hydrocarbons (PAHs);
- ❑ Metals (including arsenic (As), antimony (Sb) and selenium (Se));

- ☐ Mercury (Hg);
- ☐ Chromium VI (Cr VI);
- ☐ Electrical Conductivity (EC);
- ☐ Sodium Adsorption Ratio (SAR).

These CPCs have the potential to be present in the soil matrix and/or groundwater situated beneath the Phase I Property, with the exception of EC and SAR, which are considered to be situated in the soil matrix only.

7.2 Conceptual Site Model

Geological and Hydrogeological Setting

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on the information from NRCAN, bedrock in the area of the site consists of shale of the Rockcliffe Formation. Based on the maps, the surficial geology consists of alluvial sediments of sand and silt with an overburden thickness ranging from 10 to 15 m.

The topographic maps indicate that the elevation of the Phase I Property is approximately 80 m above sea level. The regional topography in the general area of the Phase I Property slopes down to the west and northwest.

Fill Placement

Fill material of unknown quality is suspected to be present on the Phase I Property from previous development for grading, engineered fill around buildings, asphaltic surfaces, and below ground utilities.

Water Bodies and Areas of Natural Significance

A search for areas of natural significance and features within the Phase I Study Area was conducted on the website of the Ontario Ministry of Natural Resources (MNR) on September 17, 2025. The search did not reveal any areas of natural significance within the Phase I Study Area.

No water bodies are present on the Phase I Property. The nearest body of water is Pinecrest Creek, approximately 95 m north of the Phase I Property.

Potable Water Wells

A search of the MECs website was conducted on August 19, 2025, for all drilled well records within a 250 m radius of the Phase I Property. No potable water well records were identified on the Phase I Property. Seven potable well records were identified for surrounding properties in the Phase I Study Area, installed between 1958 and 1961. Based on the availability of municipal services, no drinking water wells are expected to be currently in use within the Phase I Study Area.

Monitoring Wells

Four well records were identified for the Phase I Property, associated with monitoring wells installed between 2001 and 2019.

The search also identified 47 well records for surrounding properties within the Phase I Study Area, associated with monitoring wells installed between 2001 and 2022 as part of former geotechnical and/or environmental investigations, as well as 18 records related to well abandonment.

In general, according to the well records, the strata in the Phase I Study Area consists of sand over silty clay. Bedrock was encountered at depths ranging from 9.75 to 15.25 mbgs in the nearby well records identified within the Phase I Study Area.

Existing Buildings and Structures

The Phase I Property is occupied by a single storey slab-on-grade commercial building with associated asphalt parking, and landscaped areas, constructed in approximately 2002. The building is separated into a commercial retail area (southern portion) and a warehouse area (northern portion). The exterior of the building is finished with stucco panelling and a modified bituminous roof.

The Site Building is currently occupied by The Beer Store, operating as a retail store.

Subsurface Structures and Utilities

The Phase I Property is municipally serviced. Based on private and public underground utility locates obtained for the Phase I Property, underground utilities identified on the Phase I Property include electrical, natural gas, water, sewer, telecommunication lines primarily entering from the north and west of the Phase I Property. Storm sewers are present in the southern portion of the Phase I Property, in the parking area, as well as catch basins and manholes observed in this area. A pad mounted transformer is present to the west of the subject building, which

was installed concurrently with site development in approximately 2002. No other subsurface structures were identified at the time of the site inspection.

Neighbouring Land Use

Land use within the Phase I Study Area is primarily commercial, with some properties used for industrial and agricultural or other purposes. No PCAs were observed during the review of the current use of surrounding properties.

Current land use and PCAs identified in the Phase I Study Area are presented on Drawing PE7169-3 – Surrounding Land Use Plan.

Potentially Contaminating Activities and Areas of Potential Environmental Concern

As previously discussed in Section 7.1, two on-site and five off-site PCAs are considered to result in nine APECs on the Phase I Property. The PCAs, APECs and associated CPCs are summarized in Table 3.

Table 3 - Areas of Potential Environmental Concern					
Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern with respect to Phase I-ESA Property	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 1 Fill Material of Unknown Quality	Throughout the Phase I Property	<i>"Item 30: Importation of Fill Material of Unknown Quality"</i>	On-site	BTEX PHCs Metals As, Se, Sb Mercury Cr(VI) PAHs	Soil
APEC 2 ¹ Application of Road Salt	Throughout parking areas on the Phase I Property	<i>"Item NA: Application of road salt for the safety of vehicular or pedestrian traffic under conditions of snow or ice"</i>	On-site	EC SAR	Soil
APEC 3 Former Retail Fuel Outlet (with 1 UST)	Eastern portion of the Phase I Property	<i>"Item 28: Gasoline and Associated Products Storage in Fixed Tanks"</i>	Off-site	BTEX PHCs VOCs	Soil Groundwater
APEC 4 Former Retail Fuel Outlet (with 2 USTs)	Northern portion of the Phase I Property	<i>"Item 28: Gasoline and Associated Products Storage in Fixed Tanks"</i>	Off-site	BTEX PHCs VOCs	Soil Groundwater

Table 3 - Areas of Potential Environmental Concern

Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern with respect to Phase I-ESA Property	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 5 Former Automotive Service Garage	Northern portion of the Phase I Property	<i>"Item 52: Storage, Maintenance, Fuelling and Repair of Equipment, Vehicles, and Material used to maintain Transportation Systems"</i>	Off-site	BTEX PHCs VOCs	Soil Groundwater
APEC 6 Former Retail Fuel Outlet (with 1 UST)	Northern portion of the Phase I Property	<i>"Item 28: Gasoline and Associated Products Storage in Fixed Tanks"</i>	Off-site	BTEX PHCs VOCs	Soil Groundwater
APEC 7 Former Automotive Service Garage	Northern portion of the Phase I Property	<i>"Item 52: Storage, Maintenance, Fuelling and Repair of Equipment, Vehicles, and Material used to maintain Transportation Systems"</i>	Off-site	BTEX PHCs VOCs	Soil Groundwater
APEC 8 Former Dry Cleaners	Throughout the Phase I Property	<i>"Item 37: Operation of Dry-Cleaning Equipment (where chemicals are used)"</i>	Off-site	BTEX PHCs VOCs	Soil Groundwater
APEC 9 Former PCB Waste Storage Site	Eastern portion of the Phase I Property	<i>"Item NA: Storage of PCB Waste"</i>	Off-site	PCBs	Soil Groundwater

¹ – In accordance with Section 49.1 of O. Reg 153/04 standards are deemed to be met if an applicable site condition standard is exceeded at a property solely because the qualified person has determined that a substance has been applied to surfaces for the safety of vehicular or pedestrian traffic under conditions of snow or ice or both. The exception outlined in Section 49.1 is being relied up with respect to the Phase I Property.

The remaining off-site PCAs identified within the Phase I Study Area are not considered to result in APECs on the Phase I Property due to their separation distance and/or their down/cross-gradient orientation with respect to the Phase I Property.

As previously discussed in Section 7.1, all APECs are outlined on Drawing PE7169-2 – Site Plan, while all PCAs identified within the Phase I Study Area are

presented on PE7169-3 – Surrounding Land Use Plan in the Figures section of this report, following the text.

Contaminants of Potential Concern

As per section 7.1 of this report and Table 3, CPCs in the soil and/or groundwater beneath the Phase I Property include the following:

- ☐ Petroleum Hydrocarbons, fractions 1 – 4 (PHCs);
- ☐ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ☐ Volatile Organic Compounds (VOCs);
- ☐ Polychlorinated Biphenyls (PCBs);
- ☐ Polycyclic Aromatic Hydrocarbons (PAHs);
- ☐ Metals (including arsenic (As), antimony (Sb) and selenium (Se));
- ☐ Mercury (Hg);
- ☐ Chromium VI (Cr VI);
- ☐ Electrical Conductivity (EC);
- ☐ Sodium Adsorption Ratio (SAR).

These CPCs have the potential to be present in the soil matrix and/or groundwater situated beneath the Phase I Property, with the exception of EC and SAR, which is associated with the soil matrix only.

Assessment of Uncertainty and/or Absence of Information

The information available for review as part of the preparation of this Phase I- ESA is considered to be sufficient to conclude that there are on-site PCAs and former off-site PCAs that have resulted in APECs on the Phase I Property. Additional off-site PCAs identified within the Phase I Study Area are not considered to represent APECs on the Phase I Property based on their separation distance and/or down/cross-gradient orientation with respect to the Phase I Property.

A variety of independent sources were consulted as part of this assessment, and as such, the conclusions of this report are not affected by uncertainty which may be present with respect to the individual sources.

8.0 CONCLUSIONS

8.1 Assessment

Paterson Group was retained by Chick-fil-A Canada ULC, to carry out a Phase I-Environmental Site Assessment (ESA) for 1984 Baseline Road, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and 250m Phase I Study Area, and to identify any environmental concerns with the potential to have impacted the Phase I Property.

Based on the available historical information, the Phase I Property was initially developed with a public roadway on the eastern portion of the subject site prior to 1945, with the remainder of the property consisting of agricultural use land. The Phase I Property was developed with the existing commercial building in approximately 2002. The building has operated as retail store since that time to the present day. Two potentially contaminating activities related to on-site activities were identified including the potential presence of fill material of unknown quality (APEC 1) and the use of de-icing agents for road and pedestrian safety (APEC 2).

Based on the available historical information, adjacent and surrounding properties within the Phase I Study Area have been developed primarily for commercial purposes. Off-site PCAs, including former retail fuel outlets and automotive service garages located to the north and east, and a former dry cleaner and PCB waste storage site located to the southeast, were identified and are considered to represent APECs on the Phase I Property. The remaining PCAs identified in the Phase I Study Area are not considered to represent APECs on the Phase I Property due to their separation distance and/or the down/cross-gradient orientation with respect to the Phase I Property.

Following the historical research, a site visit was conducted. The Phase I Property is occupied by a commercial building used for commercial retail purposes (The Beer Store). No environmental concerns were identified with the current use of the Phase I Property.

Land use within the Phase I Study Area is primarily commercial, with some properties used for industrial and agricultural or other purposes. No previously unidentified PCAs were observed during the review of the current use of surrounding properties.

Based on the findings of the Phase I ESA, it is **our opinion that a Phase II-Environmental Site Assessment is required for the Phase I Property.**

9.0 STATEMENT OF LIMITATIONS

This Phase I - Environmental Site Assessment report has been prepared in general accordance with O.Reg. 153/04, as amended, and meets the requirements of CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I - ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

Should any conditions be encountered at the Phase I property and/or historical information that differ from our findings, we request that we be notified immediately in order to allow for a reassessment.

This report was prepared for the sole use of Chick-fil-A Canada ULC. Permission and notification from Chick-fil-A Canada ULC and Paterson will be required to release this report to any other party.

Paterson Group Inc.



Kuldeep Panchal, M.Eng.



Jesse Andrechek, P.Eng, Q.P.ESA



Report Distribution:

- ☐ Chick-fil-A Canada ULC
- ☐ Paterson Group

10.0 REFERENCES

Federal Records

Air photos at the Energy Mines and Resources Air Photo Library.
National Archives.
Maps and photographs (Geological Survey of Canada surficial and subsurface mapping).
Natural Resources Canada – The Atlas of Canada.
Environment Canada, National Pollutant Release Inventory.
PCB Waste Storage Site Inventory.

Provincial Records

MECP Municipal Coal Gasification Plant Site Inventory, 1991.
MECP document titled “Waste Disposal Site Inventory in Ontario”.
MECP Brownfields Environmental Site Registry.
MNR Areas of Natural Significance.
MECP Water Well Record Inventory.
Maps and photographs (Geological Survey of Ontario surficial and subsurface mapping).
Chapman, L.J., and Putnam, D.F., 1984: ‘The Physiography of Southern Ontario, Third Edition’, Ontario Geological Survey Special Volume 2.

Municipal Records

geoOttawa: City of Ottawa electronic mapping website.
City of Ottawa Historical Land Use Inventory (HLUI) Database.

Local Information Sources

Personal Interviews
Previous Engineering Reports

Public Information Sources

Google Earth.
Google Maps/Street View.

Private Information Sources

Environmental Risk Information Services (ERIS) Report, July 24, 2025
Survey Plan, J.D. Barnes Limited, dated July 9, 2025

FIGURES

FIGURE 1 – KEY PLAN

FIGURE 2 – TOPOGRAPHIC MAP

DRAWING PE7169-2 – SITE PLAN

DRAWING PE7169-3 – SURROUNDING LAND USE PLAN

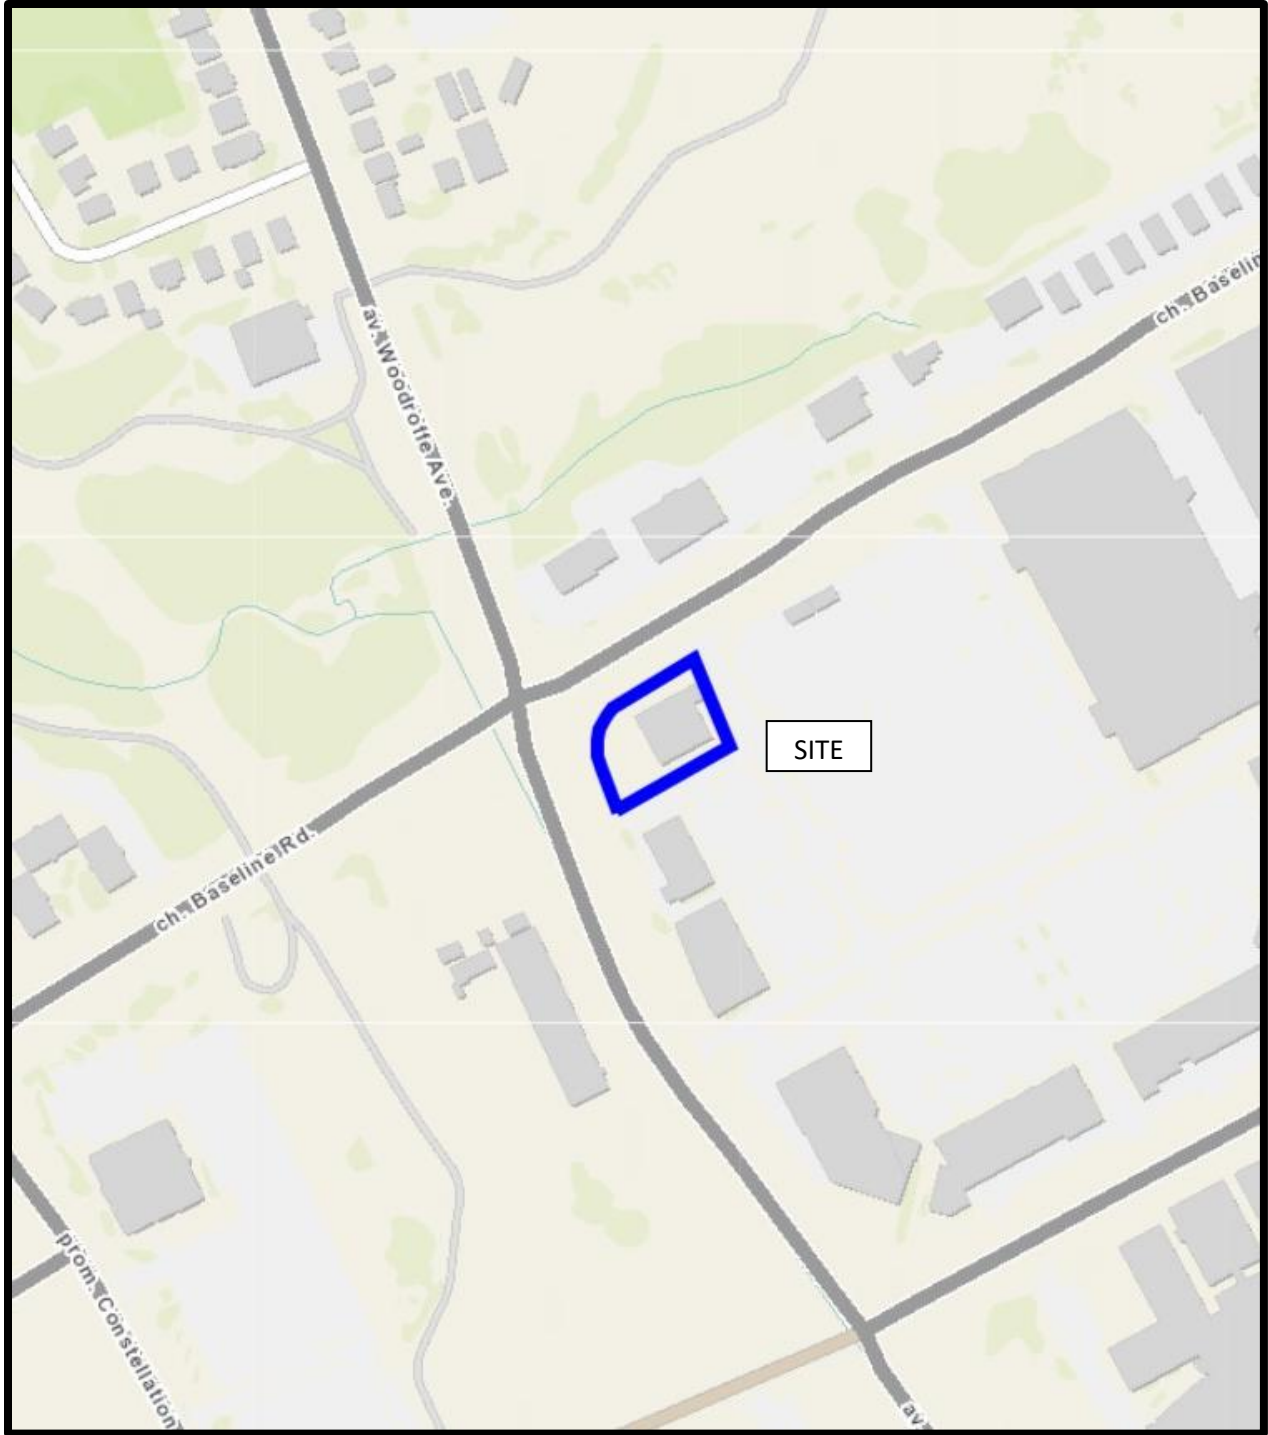


FIGURE 1
KEY PLAN


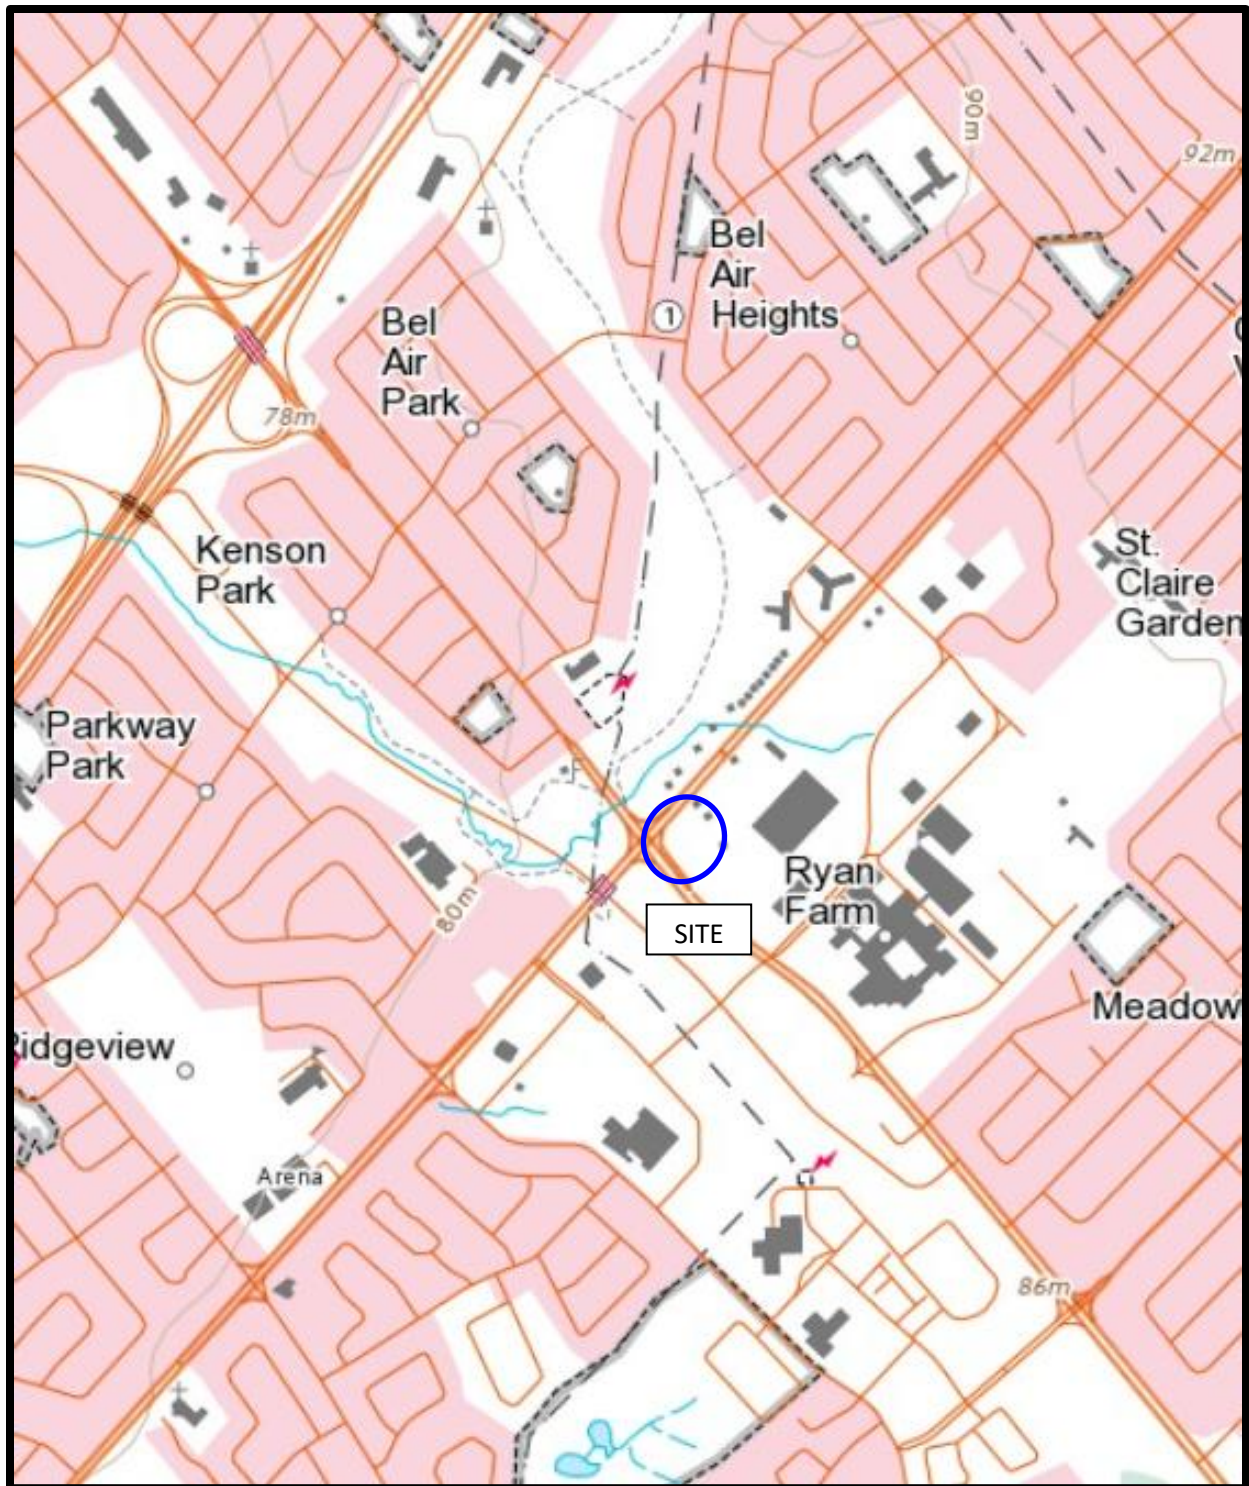


FIGURE 2
TOPOGRAPHIC MAP

WOODROFFE AVENUE


BASELINE ROAD

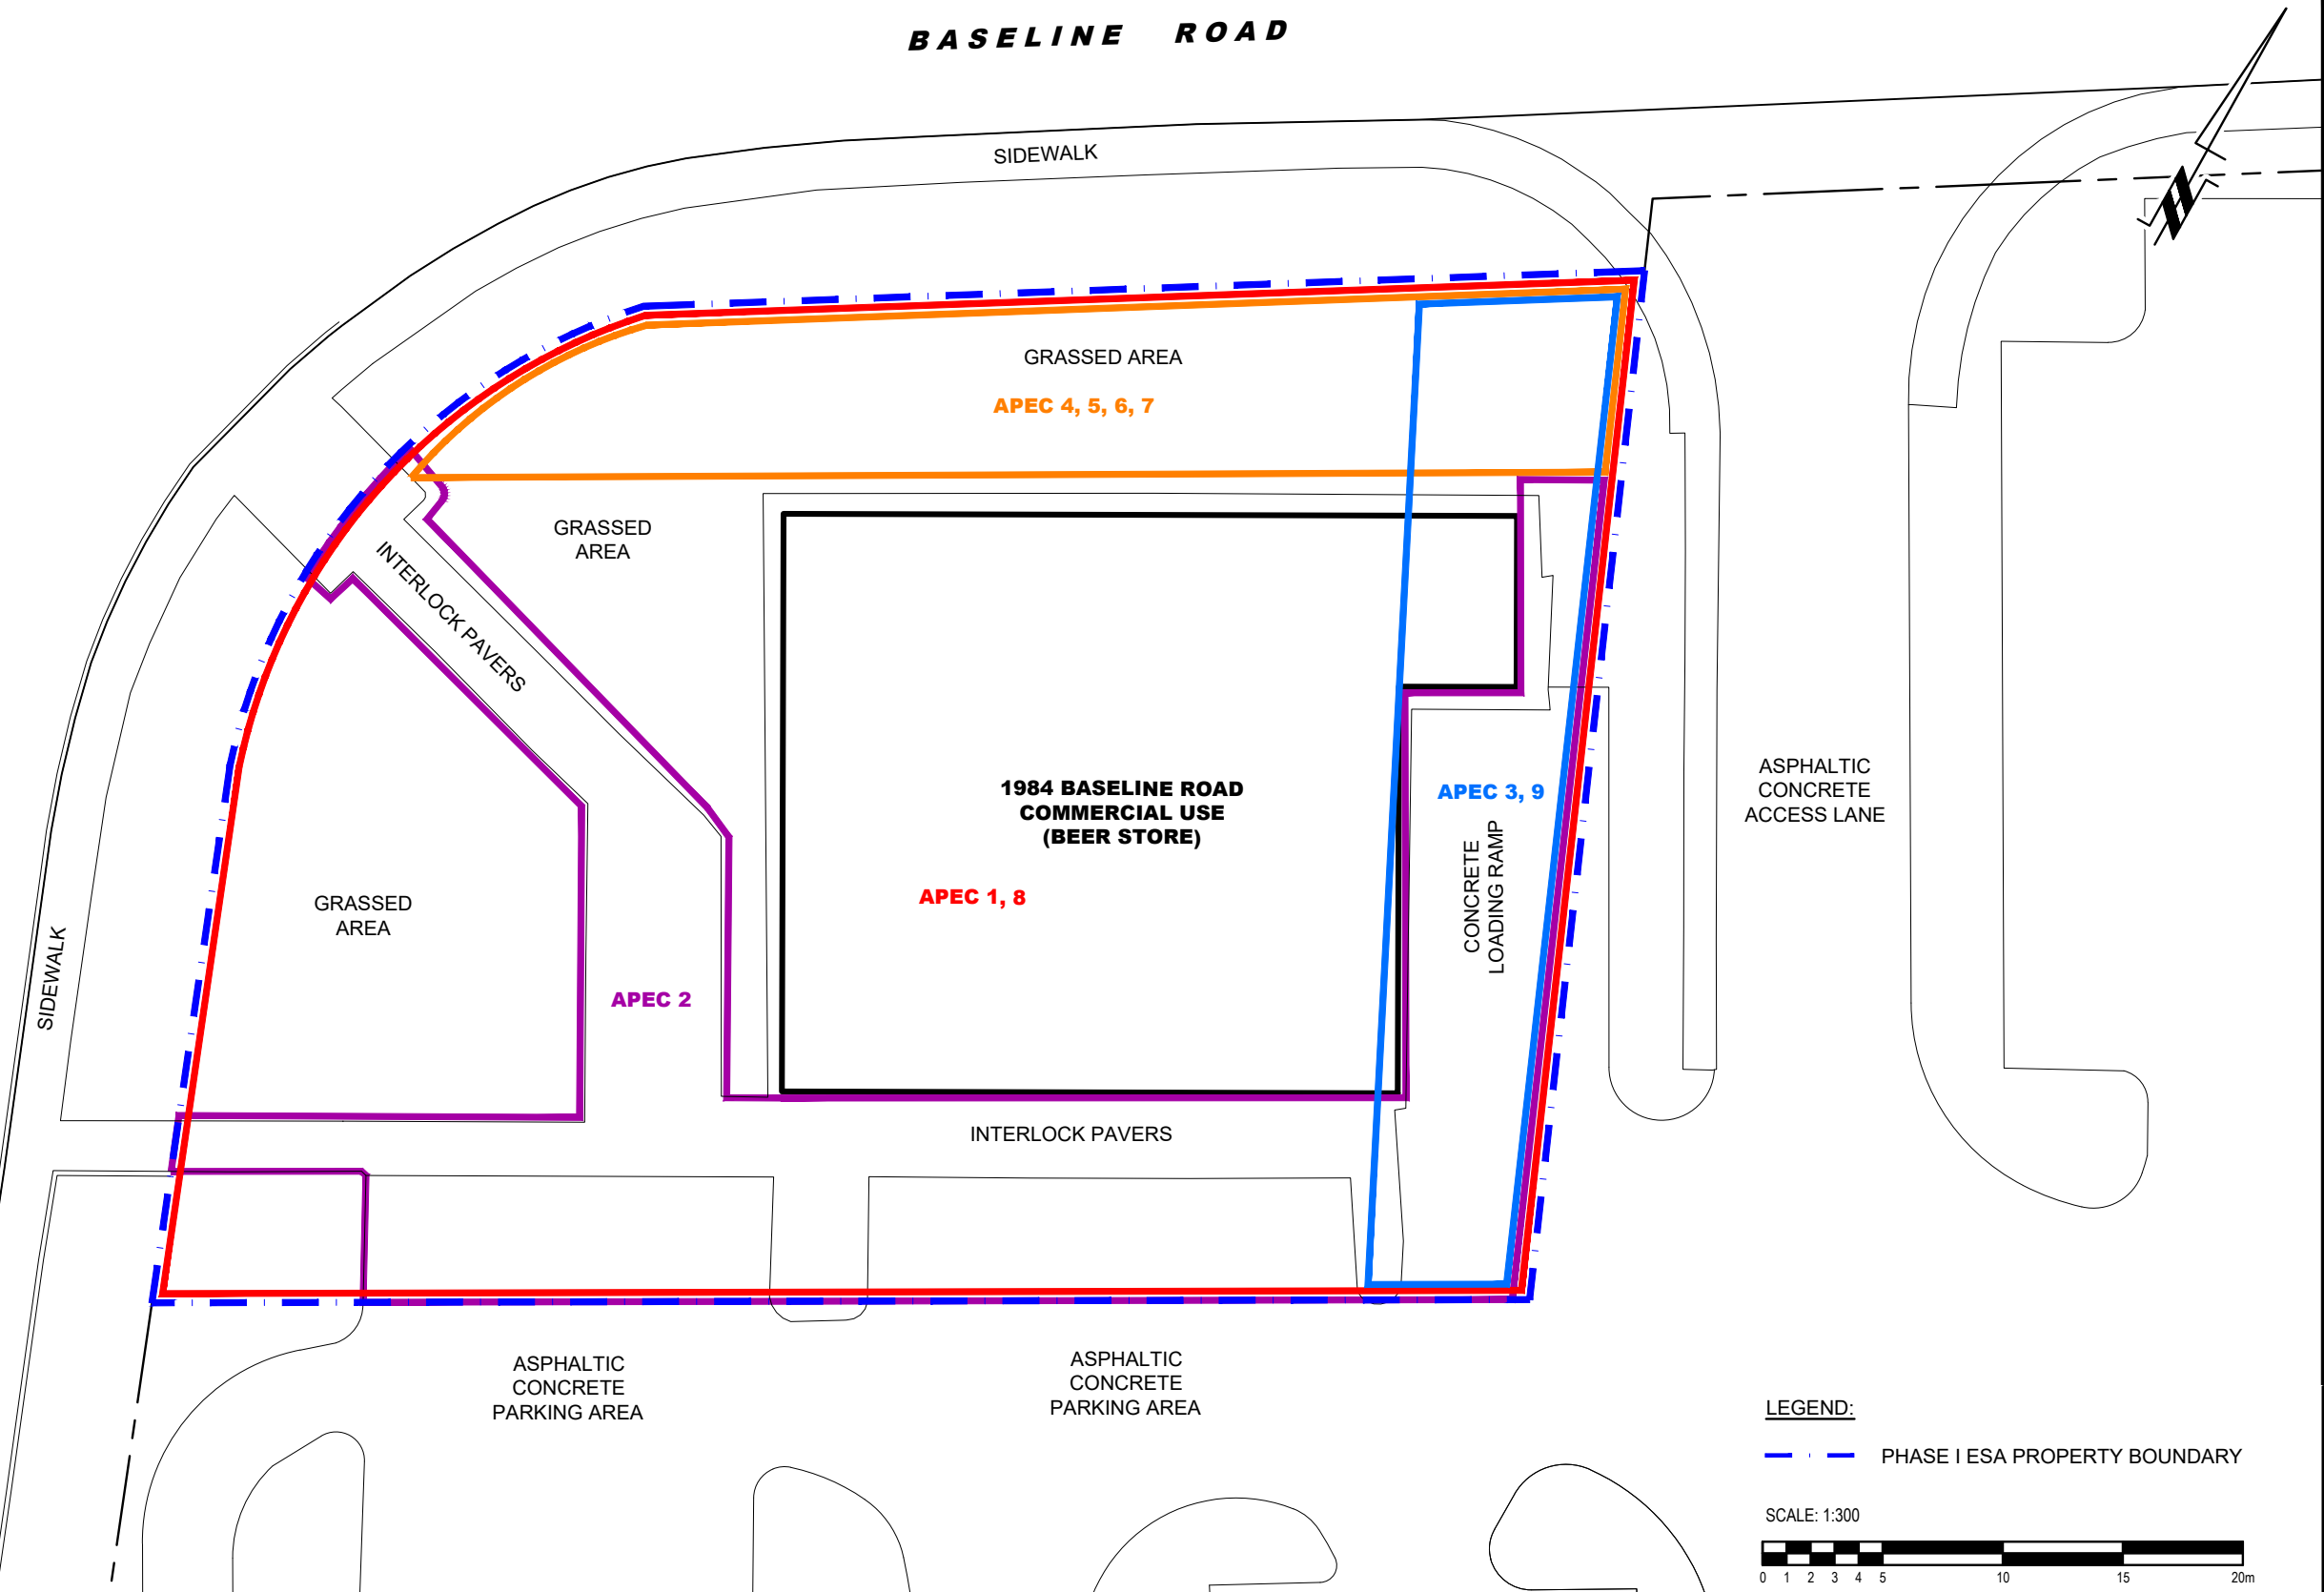

AREAS OF POTENTIAL ENVIRONMENTAL CONCERN :

ID #	PCA ID	DESCRIPTION
1	30	FILL MATERIAL OF UNKNOWN QUALITY
2	N/A	APPLICATION OF ROAD SALT
3	28	FORMER RETAIL FUEL OUTLET WITH ONE UNDERGROUND STORAGE TANK
4	28	FORMER RETAIL FUEL OUTLET WITH TWO UNDERGROUND STORAGE TANKS
5	52	FORMER AUTOMOTIVE SERVICE GARAGE
6	28	FORMER RETAIL FUEL OUTLET WITH ONE UNDERGROUND STORAGE TANK
7	52	FORMER AUTOMOTIVE SERVICE GARAGE
8	37	FORMER DRY CLEANERS
9	N/A	FORMER PCB WASTE STORAGE SITE

LEGEND:
— — — — — PHASE I ESA PROPERTY BOUNDARY





PATERSON GROUP
9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL


CHICK-FIL-A CANADA ULC
PHASE I - ENVIRONMENTAL SITE ASSESSMENT
1984 BASELINE ROAD

OTTAWA, ONTARIO

Title: SITE PLAN

Scale:	1:300	Date:	09/2025
Drawn by:	NFRV	Report No.:	PE7169-2
Checked by:	KMP	Dwg. No.:	PE7169-2
Approved by:	JA	Revision No.:	

p:\autocad\drawings\environmental\pe7169\pe7169-2 site plan.dwg

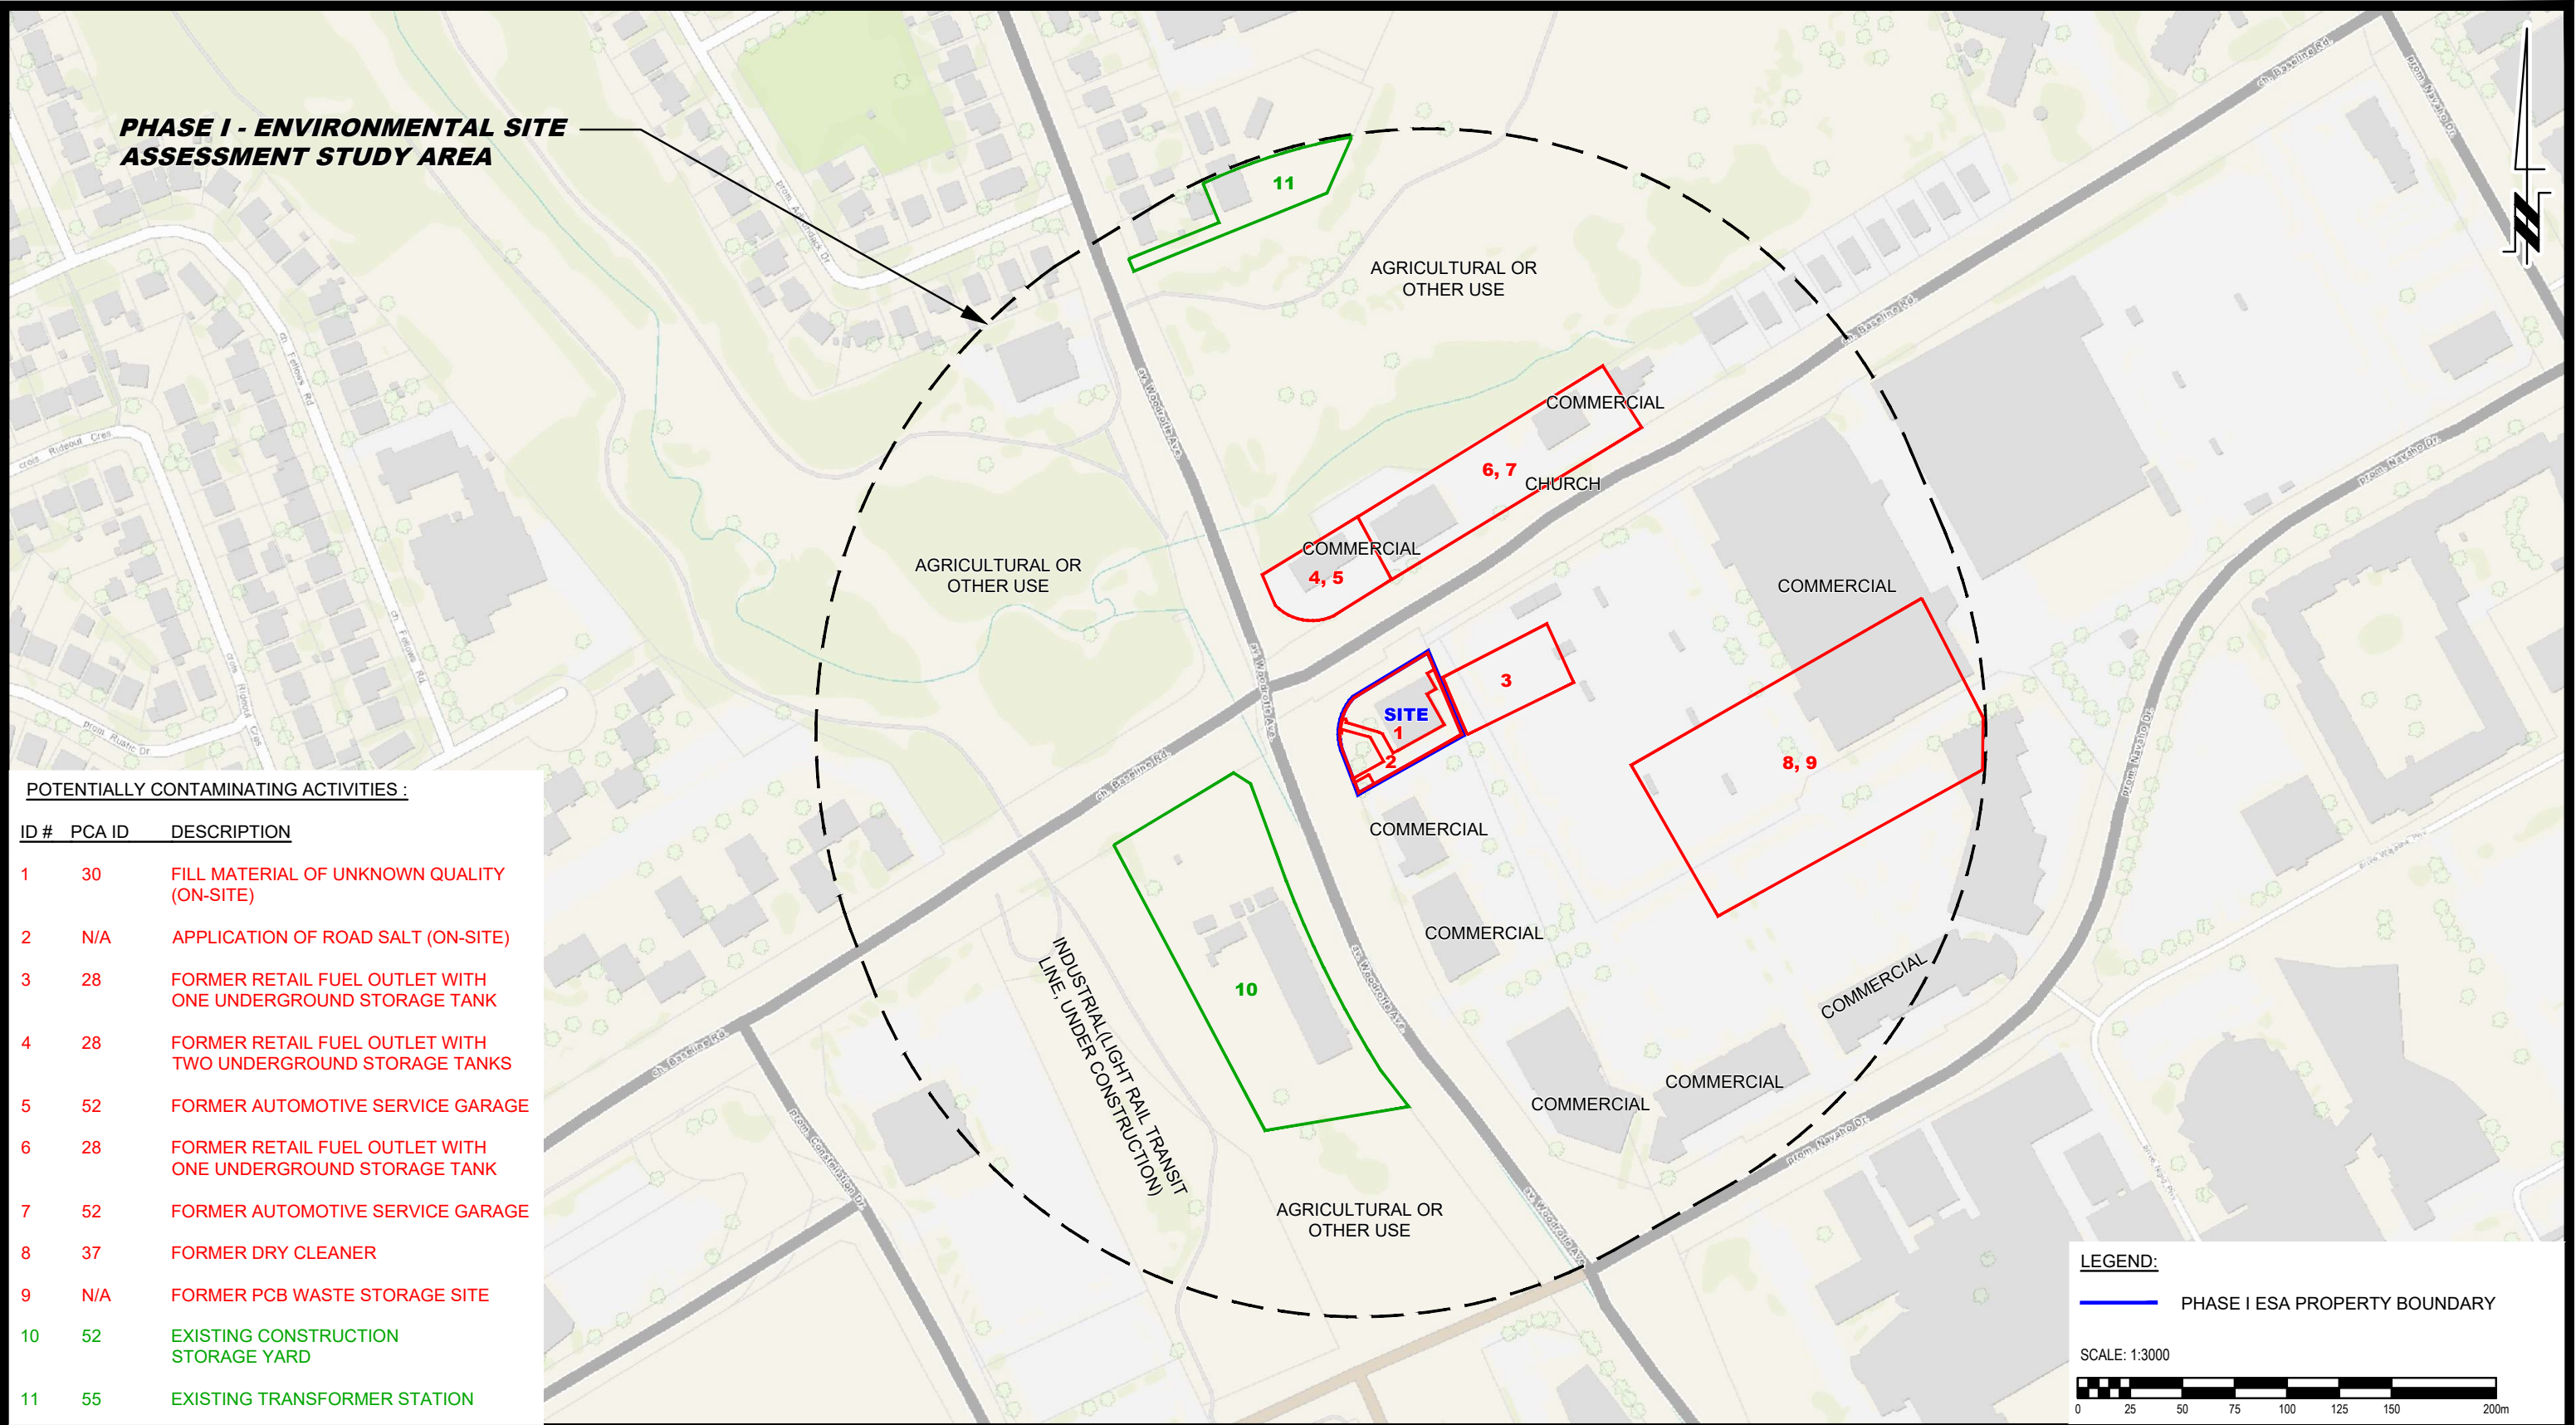

PHASE I - ENVIRONMENTAL SITE ASSESSMENT STUDY AREA

POTENTIALLY CONTAMINATING ACTIVITIES :

ID #	PCA ID	DESCRIPTION
1	30	FILL MATERIAL OF UNKNOWN QUALITY (ON-SITE)
2	N/A	APPLICATION OF ROAD SALT (ON-SITE)
3	28	FORMER RETAIL FUEL OUTLET WITH ONE UNDERGROUND STORAGE TANK
4	28	FORMER RETAIL FUEL OUTLET WITH TWO UNDERGROUND STORAGE TANKS
5	52	FORMER AUTOMOTIVE SERVICE GARAGE
6	28	FORMER RETAIL FUEL OUTLET WITH ONE UNDERGROUND STORAGE TANK
7	52	FORMER AUTOMOTIVE SERVICE GARAGE
8	37	FORMER DRY CLEANER
9	N/A	FORMER PCB WASTE STORAGE SITE
10	52	EXISTING CONSTRUCTION STORAGE YARD
11	55	EXISTING TRANSFORMER STATION

LEGEND:

— PHASE I ESA PROPERTY BOUNDARY

SCALE: 1:3000

0 25 50 75 100 125 150 200m



9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL

CHICK-FIL-A CANADA ULC

PHASE I - ENVIRONMENTAL SITE ASSESSMENT

1984 BASELINE ROAD

OTTAWA,
Title:

ONTARIO

SURROUNDING LAND USE PLAN

Scale: 1:3000

Drawn by: YA

Checked by: KMP

Approved by: JA

Date: 09/2025

Report No.: PE7169-2

Dwg. No.: **PE7169-3**

Revision No.:

APPENDIX 1

PLAN OF SURVEY

AERIAL PHOTOGRAPHS

SITE PHOTOGRAPHS




AERIAL PHOTOGRAPH
1945



AERIAL PHOTOGRAPH
1958



AERIAL PHOTOGRAPH
1965

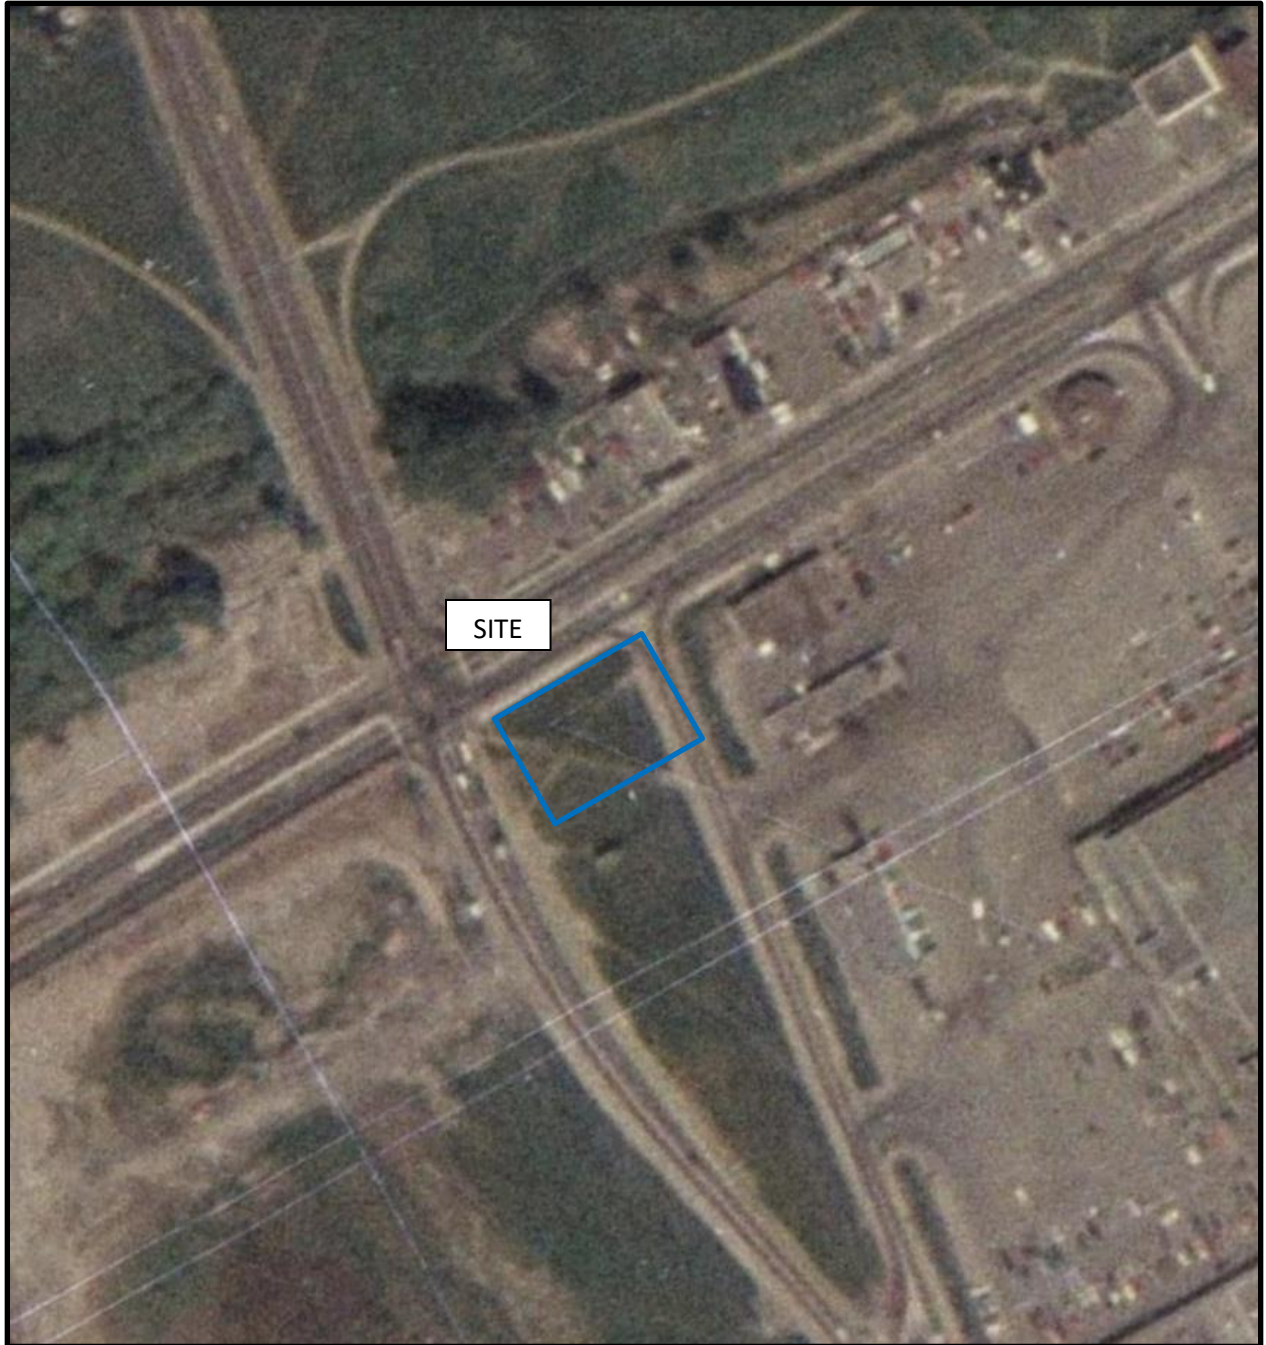


AERIAL PHOTOGRAPH
1976



AERIAL PHOTOGRAPH
1991



AERIAL PHOTOGRAPH
2002

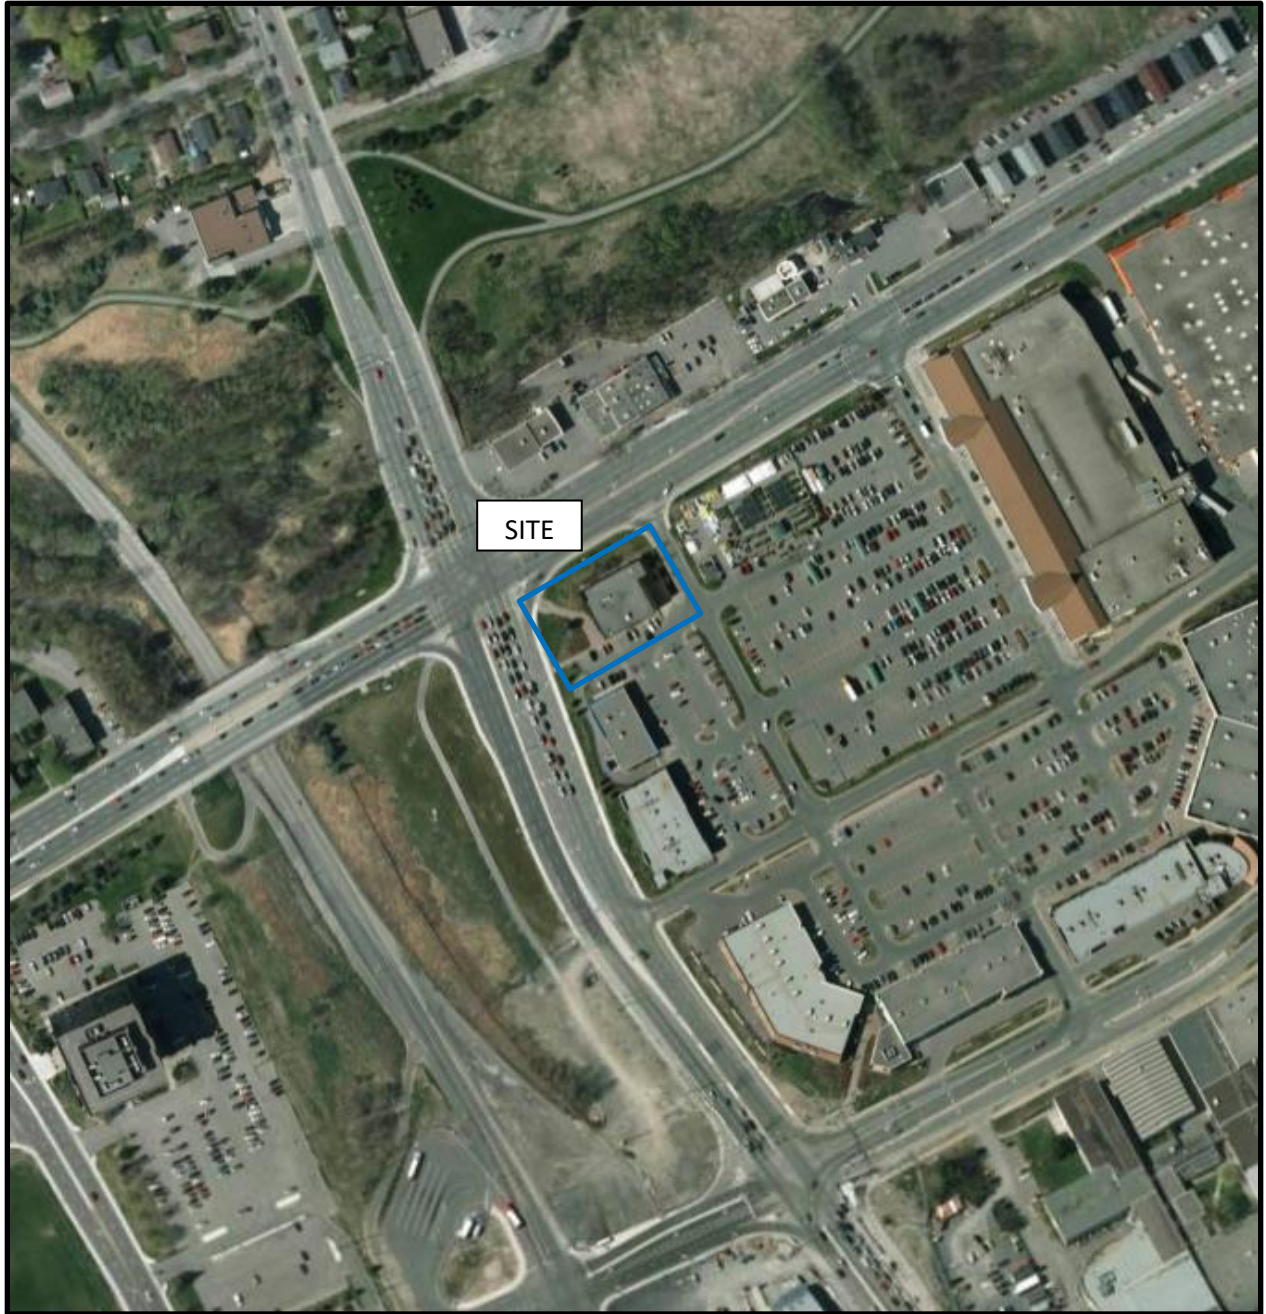

AERIAL PHOTOGRAPH
2011



AERIAL PHOTOGRAPH
2019



AERIAL PHOTOGRAPH
2025

Site Photographs

PE7169

1984 Baseline Road, Ottawa ON

July 23, 2025



Photograph 1: View of the southern portion of the Phase I Property, facing north.



Photograph 2: View of the western portion of the Phase I Property, facing north.

Site Photographs

PE7169

1984 Baseline Road, Ottawa ON

July 23, 2025



Photograph 3: View of northern portion of the Phase I Property, facing east.



Photograph 4: View of eastern portion of the Phase I Property, facing north.

APPENDIX 2

MECP FREEDOM OF INFORMATION

MECP WELL RECORDS

TSSA CORRESPONDENCE

CITY OF OTTAWA HLUI

ERIS REPORT



August 20, 2025

Mr. Mark Bujaki
Paterson Group
9 Auriga Drive
Ottawa, Ontario K2E 7T9
mbujaki@patersongroup.ca

Dear Mark Bujaki:

RE: **MECP FOI A-2025-04926, Your Reference PE7169 – Decision Letter**

This letter is in response to your request made pursuant to the Freedom of Information and Protection of Privacy Act (the Act) relating to:

1984 Baseline Road, Ottawa

Timeframe: January 1, 1900 to July 22, 2025

The ministry's District Office has advised that there may be inactive records in the Records Centre, Mississauga. If you would like us to retrieve these files, please submit a separate FOI request quoting this file number. The \$5 application fee will be applied towards any costs incurred with the retrieval of the records from the Records Centre. Please note there is no guarantee that any records will be located responsive to your request.

If you would like us to retrieve these files, **please submit a new request** and inform the analyst below. In the request description section, indicate you are seeking records from the Record Centre in relation to file number A-2025-04926. The \$5 application fee for your new FOI request will be applied towards any costs incurred with the retrieval of the records from the Records Centre.

You may request a review of my decision within 30 days from the date of this letter by contacting the Information and Privacy Commissioner/Ontario at <http://www.ipc.on.ca>. Please note there may be a fee associated with submitting the appeal.

If you have any questions, please contact Shannon Neita at foi.mecp@ontario.ca.

Yours truly,

Shannon Neita

for

Josephine DeSouza
Manager, Access and Privacy Office



The Ontario Water Resources Act

WATER WELL RECORD

Print only in spaces provided.
Mark correct box with a checkmark, where applicable.

1532165

Municipality

Con.

102

County or District Ottawa - Parleton.	Township/Borough/City/Town/Village Nepean.	Con block tract survey, etc. 2	Lot 35
Address Nepean St.		Date completed 17 day 07 month 01 year	

21

1 2

0
T
M

10

12 17

North

RC

Elevation

RC

Basin Code

ii iii iv

18 24

25

26

30

31

47

LOG OF OVERBURDEN AND BEDROCK MATERIALS (see instructions)[illegible]

41		42		43		44		45		46		47	
WATER RECORD													
Water found at - feet				Kind of water									
10-13				14									
70				☐ Fresh ☐ Sulphur ☐ Minerals ☐ Salty ☐ Gas									
15-18				19									
75				☐ Fresh ☐ Sulphur ☐ Minerals ☐ Salty ☐ Gas									
20-23				24									
				☐ Fresh ☐ Sulphur ☐ Minerals ☐ Salty ☐ Gas									
25-28				29									
				☐ Fresh ☐ Sulphur ☐ Minerals ☐ Salty ☐ Gas									
30-33				34									
				☐ Fresh ☐ Sulphur ☐ Minerals ☐ Salty ☐ Gas									

51 CASING & OPEN HOLE RECORD				
Inside diam inches	Material	Wall thickness inches	Depth - feet	
			From	To
10-11 8 1/4"	☒ Steel ☐ Galvanized ☐ Concrete ☐ Open hole ☐ Plastic	12 188	0	13-16 50
17-18 12"	☐ Steel ☐ Galvanized ☐ Concrete ☒ Open hole ☐ Plastic	19	0	20-23 48
24-25 8 1/4" 6"	☐ Steel ☐ Galvanized ☐ Concrete ☐ Open hole ☒ Plastic	26	48 200	27-30 200 250

SCREEN	Sizes of opening (Slot No.)	31-33	Diameter	34-38	Length	39-40
			inches		feet	
	Material and type			Depth at top of screen		
				41-44		30
				feet		

61				PLUGGING & SEALING RECORD			
☒ Annular space				☐ Abandonment			
Depth set at - feet		Material and type (Cement grout, bentonite, etc.)					
From	To						
10-13	14-17	Bentonite grout					
2	50						
18-21	22-25						
26-29	30-33	80					

PUMPING TEST	Pumping test method ¹⁰ 1 ☒ Pump 2 ☐ Bailer		Pumping rate ¹¹⁻¹⁴ 5 GPM		Duration of pumping ¹⁵⁻¹⁶ 1 Hours ¹⁷⁻¹⁸ 15 mins	
	Static level ¹⁹⁻²¹ 50 feet	Water level end of pumping ²²⁻²⁴ 250 feet	Water levels during ²⁵ 1 ☐ Pumping 2 ☒ Recovery			
			15 minutes ²⁶⁻²⁸ 50 feet	30 minutes ²⁹⁻³¹ 50 feet	45 minutes ³²⁻³⁴ 50 feet	60 minutes ³⁵⁻³⁷ 50 feet
	If flowing give rate ³⁸⁻⁴¹ GPM		Pump intake set at ⁴² feet		Water at end of test ☐ Clear ☒ Cloudy	
	Recommended pump type ☐ Shallow ☒ Deep	Recommended pump setting ⁴³⁻⁴⁵ 250 feet	Recommended pump rate ⁴⁶⁻⁴⁹ 5 GPM			
	50-53					

FINAL STATUS OF WELL			54
1 ☐ Water supply	5 ☐ Abandoned, insufficient supply	9 ☐ Unfinished	
2 ☐ Observation well	6 ☐ Abandoned, poor quality	10 ☐ Replacement well	
3 ☒ Test hole	7 ☐ Abandoned (Other)		
4 ☐ Recharge well	8 ☐ Dewatering		

WATER USE			55-56
1 ☐ Domestic	5 ☐ Commercial	9 ☒ Not use	
2 ☐ Stock	6 ☐ Municipal	10 ☐ Other	
3 ☐ Irrigation	7 ☐ Public supply		
4 ☐ Industrial	8 ☐ Cooling & air conditioning		

METHOD OF CONSTRUCTION			57
1 ☐ Cable tool	5 ☒ Air percussion	9 ☐ Driving	
2 ☐ Rotary (conventional)	6 ☐ Boring	10 ☐ Digging	
3 ☐ Rotary (reverse)	7 ☐ Diamond	11 ☐ Other	
4 ☐ Rotary (air)	8 ☐ Jetting		

LOCATION OF WELL

In diagram below show distances of well from road and lot line.
Indicate north by arrow.

Woodroffe Ave

Baseline Rd

90'

95'

234287

Name of Well Contractor	Well Contractor's Licence No.
Air Rock Drilling Ltd	1119
Address	
RR#2 Jasper, Ont	
Name of Well Technician	Well Technician's Licence No.
Shannon Purcell	T2122
Signature of Technician/Contractor	Submission date
	31 07 01 day mo yr

MINISTRY USE ONLY	Data source	58 Contractor	59-62	Date received	63-68	80
		1119		AUG 13 2001		
	Date of inspection		Inspector			
	Remarks					



Measurements recorded in: ☒ Metric ☐ Imperial

A254685 Tag#: A254685

LEIKIN GROUP INC

Well Location

Address of Well Location (Street Number/Name) 1984 Baseline Road		Township	Lot	Concession	
County/District/Municipality		City/Town/Village Oshawa	Province Ontario	Postal Code	
UTM Coordinates NAD 83	Zone 18	Easting 440312	Northings 5022292	Municipal Plan and Sublot Number	
				Other	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
BRN	top soil		soft	0	.31
BRN	sand	silt	soft	.31	2.79
GRY	clay	silt	soft	2.79	5.79
GRY	sand	silt	dense	5.79	7.01

Annular Space		
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0 .31	concrete / flush mount	
.31 3.66	ben to nite	
3.66 7.01	litter sand	

Method of Construction	Well Use
☐ Cable Tool ☐ Rotary (Conventional) ☐ Rotary (Reverse) ☐ Boring ☒ Air percussion ☐ Other, specify	☐ Public ☐ Domestic ☐ Livestock ☐ Irrigation ☐ Industrial ☐ Other, specify
☐ Diamond ☐ Jetting ☐ Driving ☐ Digging	☐ Commercial ☐ Municipal ☒ Test Hole ☐ Cooling & Air Conditioning ☐ Not used ☐ Dewatering ☒ Monitoring

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
5.20	PVC	.390	0 3.96		

☐ Water Supply
☐ Replacement Well
☐ Test Hole
☐ Recharge Well
☐ Dewatering Well
☒ Observation and/or Monitoring Hole
☐ Alteration (Construction)
☐ Abandoned, Insufficient Supply
☐ Abandoned, Poor Water Quality
☐ Abandoned, other, specify
☐ Other, specify

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)	
6.03	PVC	10	3.96	7.01

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft)	Diameter (cm/in)
		0 7.01	11.43

Well Contractor and Well Technician Information

Business Name of Well Contractor Strata Drilling Group	Well Contractor's Licence No. 7241
Business Address (Street Number/Name) 165 Shields Court	Municipality Markham
Province ON	Postal Code L3R 9V2
Business E-mail Address 2awrecords@strataoil.com	
Bus. Telephone No. (inc. area code) 905 940 7919	Name of Well Technician (Last Name, First Name) Beatty Brian
Well Technician's Licence No. 3616	Signature of Technician and/or Contractor [Signature]
	Date Submitted 2018/09/24

Results of Well Yield Testing			
After test of well yield, water was:		Draw Down	
☐ Clear and sand free ☐ Other, specify		Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Time (min)	Water Level (m/ft)
Pump intake set at (m/ft)		1	1
Pumping rate (l/min / GPM)		2	2
Duration of pumping hrs + min		3	3
Final water level end of pumping (m/ft)		4	4
If flowing give rate (l/min / GPM)		5	5
Recommended pump depth (m/ft)		10	10
Recommended pump rate (l/min / GPM)		15	15
Well production (l/min / GPM)		20	20
Disinfected?		25	25
☐ Yes ☐ No		30	30
		40	40
		50	50
		60	60

Map of Well Location

Please provide a map below following instructions on the back.

MW1850-01

Comments:

Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered Y Y Y Y M M D D 20180808	Date Work Completed 20180808


Ministry Use Only

Audit No. 2290685

NOV 19 2018

Received

S-22550

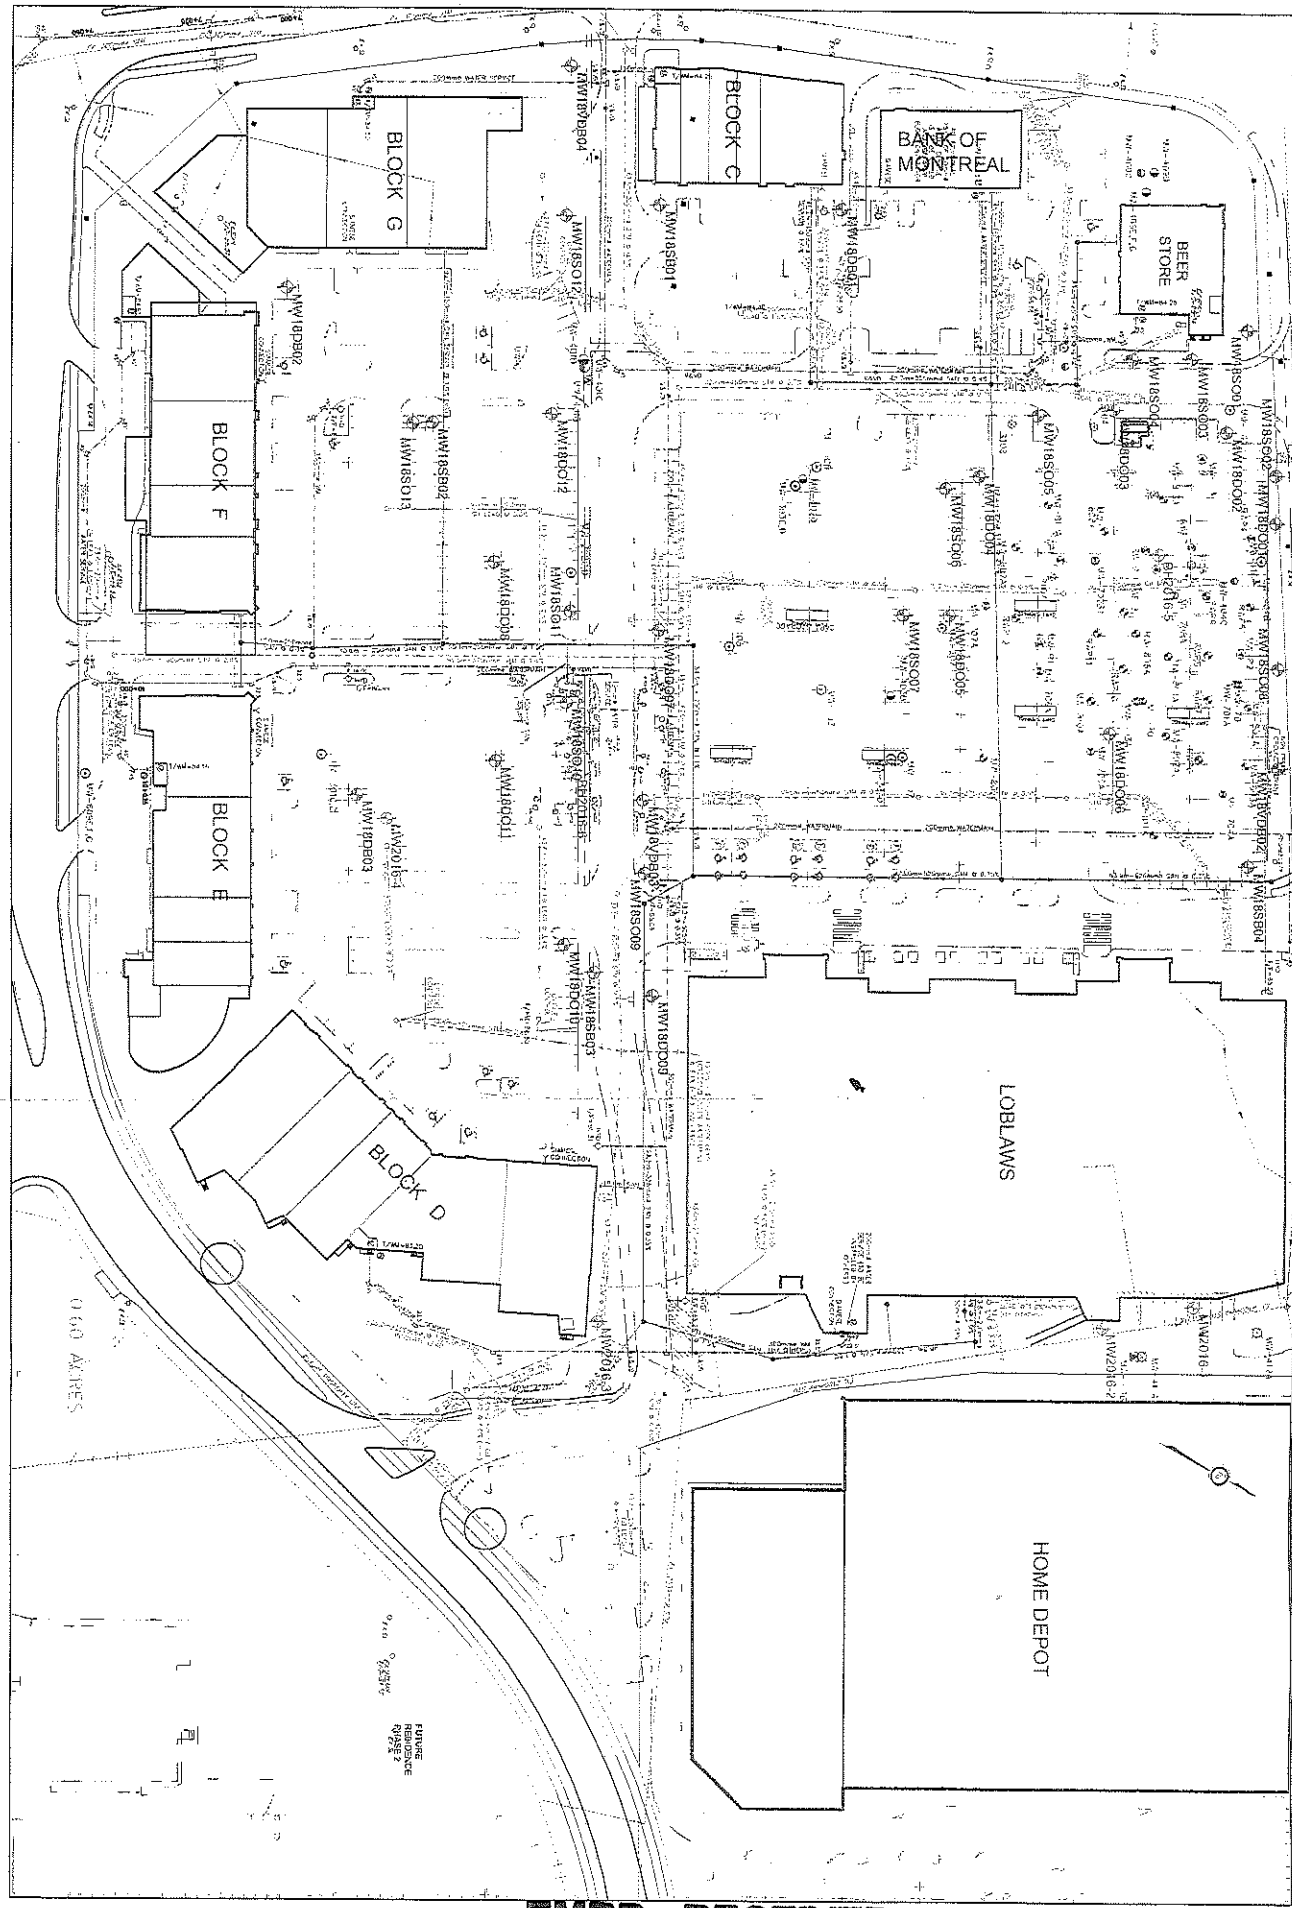

EMRB - RECEIVED

NOV 19 2018
C-7241
2290685

- LEGEND
- PROPOSED BOREHOLE LOCATIONS 2018
 - SO3 SHALLOW OVERBURDEN
 - DO3 DEEP OVERBURDEN
 - SB3 SHALLOW BEDROCK
 - DB3 DEEP BEDROCK
 - VB33 VERY DEEP BEDROCK

LOBLAW PROPERTIES LIMITED
COLLEGE SQUARE, OTTAWA
Proposed Well & U/G Utility Locations

AECOM

FIGURE 1

THIS DRAWING HAS BEEN PREPARED FOR THE USE OF AECOM'S CLIENT AND MAY NOT BE USED, REPRODUCED OR RELIED UPON BY THIRD PARTIES, EXCEPT AS AGREED BY AECOM AND ITS CLIENT, AS REQUIRED BY LAW OR FOR USE BY GOVERNMENTAL REVIEWING AGENCIES. AECOM ACCEPTS NO RESPONSIBILITY, AND DENIES ANY LIABILITY WHATSOEVER, TO ANY PARTY THAT MODIFIES THIS DRAWING WITHOUT AECOM'S EXPRESS WRITTEN CONSENT.

LEIKIN GROUP INC.

Address of Well Location (Street Number/Name) 1980 Baseline Road		Township		Lot		Concession	
County/District/Municipality		City/Town/Village Ottawa		Province Ontario		Postal Code	
UTM Coordinates NAD 83 10 440 205 50 22261		Municipal Plan and Sublot Number		Other			

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)					
General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft)	
Brown	Dark Sand Gravel			From	To
Brown	Clay moist			10	17
Grey	Clay till soft			17	33
Grey	Silt Sand till			33	39

Annular Space			
Depth Set at (m/ft)	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)	
From To			
0 1	Concrete		
1 28	Hole plug		
28 39	Sand #0		

Method of Construction		Well Use	
☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial
☒ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☒ Test Hole
☐ Boring	☐ Digging	☐ Irrigation	☒ Monitoring
☐ Air percussion		☐ Industrial	☐ Cooling & Air Conditioning
☐ Other, specify		☐ Other, specify	

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft)		
			From To		
2	Pvc	0.25	0 29	☐ Water Supply	
				☐ Replacement Well	
				☐ Test Hole	
				☐ Recharge Well	
				☐ Dewatering Well	
				☐ Observation and/or Monitoring Hole	
				☐ Alteration (Construction)	
				☐ Abandoned, Insufficient Supply	
				☐ Abandoned, Poor Water Quality	
				☐ Abandoned, other, specify	
				☐ Other, specify	

Construction Record - Screen			
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft)
			From To
2.25	Pvc	10	29 39

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft)	Diameter (cm/in)
		From To	
		0 39	8"

Well Contractor and Well Technician Information	
Business Name of Well Contractor Strata Soil Sampling Inc	Well Contractor's Licence No. 72411
Business Address (Street Number/Name) 165 Shields Court	Municipality Markham
Province Ontario	Postal Code L3R 0A2
Business E-mail Address wrcardse@stratasoil.com	
Bus. Telephone No. (inc. area code) 405 940 7919	Name of Well Technician (Last Name, First Name) Tesley Sean
Well Technician's Licence No. 37117	Signature of Technician and/or Contractor [Signature]
	Date Submitted 2019/01/25


Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered Y Y Y Y M M D D 2019 01 25	Date Work Completed Y Y Y Y M M D D 2019 01 25

Ministry Use Only	
Audit No. 2305257	Received MAR 15 2019

Well Map

C

Comments:



100m

0 10 20m

WOODROFFE AVE

BASELINE RD

+P

+E

+C

+A

+B


5-23-23

MAR 15 2019

230529

City of Ottawa, Province of Ontario, San Canada, San, HERE, Gromit, INCORPORATED, U.S. 501, 50A, 50B, 50C, 50D, 50E, 50F, 50G, 50H, 50I, 50J, 50K, 50L, 50M, 50N, 50O, 50P, 50Q, 50R, 50S, 50T, 50U, 50V, 50W, 50X, 50Y, 50Z, 50AA, 50AB, 50AC, 50AD, 50AE, 50AF, 50AG, 50AH, 50AI, 50AJ, 50AK, 50AL, 50AM, 50AN, 50AO, 50AP, 50AQ, 50AR, 50AS, 50AT, 50AU, 50AV, 50AW, 50AX, 50AY, 50AZ, 50BA, 50BB, 50BC, 50BD, 50BE, 50BF, 50BG, 50BH, 50BI, 50BJ, 50BK, 50BL, 50BM, 50BN, 50BO, 50BP, 50BQ, 50BR, 50BS, 50BT, 50BU, 50BV, 50BW, 50BX, 50BY, 50BZ, 50CA, 50CB, 50CC, 50CD, 50CE, 50CF, 50CG, 50CH, 50CI, 50CJ, 50CK, 50CL, 50CM, 50CN, 50CO, 50CP, 50CQ, 50CR, 50CS, 50CT, 50CU, 50CV, 50CW, 50CX, 50CY, 50CZ, 50DA, 50DB, 50DC, 50DD, 50DE, 50DF, 50DG, 50DH, 50DI, 50DJ, 50DK, 50DL, 50DM, 50DN, 50DO, 50DP, 50DQ, 50DR, 50DS, 50DT, 50DU, 50DV, 50DW, 50DX, 50DY, 50DZ, 50EA, 50EB, 50EC, 50ED, 50EE, 50EF, 50EG, 50EH, 50EI, 50EJ, 50EK, 50EL, 50EM, 50EN, 50EO, 50EP, 50EQ, 50ER, 50ES, 50ET, 50EU, 50EV, 50EW, 50EX, 50EY, 50EZ, 50FA, 50FB, 50FC, 50FD, 50FE, 50FF, 50FG, 50FH, 50FI, 50FJ, 50FK, 50FL, 50FM, 50FN, 50FO, 50FP, 50FQ, 50FR, 50FS, 50FT, 50FU, 50FV, 50FW, 50FX, 50FY, 50FZ, 50GA, 50GB, 50GC, 50GD, 50GE, 50GF, 50GG, 50GH, 50GI, 50GJ, 50GK, 50GL, 50GM, 50GN, 50GO, 50GP, 50GQ, 50GR, 50GS, 50GT, 50GU, 50GV, 50GW, 50GX, 50GY, 50GZ, 50HA, 50HB, 50HC, 50HD, 50HE, 50HF, 50HG, 50HH, 50HI, 50HJ, 50HK, 50HL, 50HM, 50HN, 50HO, 50HP, 50HQ, 50HR, 50HS, 50HT, 50HU, 50HV, 50HW, 50HX, 50HY, 50HZ, 50IA, 50IB, 50IC, 50ID, 50IE, 50IF, 50IG, 50IH, 50II, 50IJ, 50IK, 50IL, 50IM, 50IN, 50IO, 50IP, 50IQ, 50IR, 50IS, 50IT, 50IU, 50IV, 50IW, 50IX, 50IY, 50IZ, 50JA, 50JB, 50JC, 50JD, 50JE, 50JF, 50JG, 50JH, 50JI, 50JJ, 50JK, 50JL, 50JM, 50JN, 50JO, 50JP, 50JQ, 50JR, 50JS, 50JT, 50JU, 50JV, 50JW, 50JX, 50JY, 50JZ, 50KA, 50KB, 50KC, 50KD, 50KE, 50KF, 50KG, 50KH, 50KI, 50KJ, 50KK, 50KL, 50KM, 50KN, 50KO, 50KP, 50KQ, 50KR, 50KS, 50KT, 50KU, 50KV, 50KW, 50KX, 50KY, 50KZ, 50LA, 50LB, 50LC, 50LD, 50LE, 50LF, 50LG, 50LH, 50LI, 50LJ, 50LK, 50LL, 50LM, 50LN, 50LO, 50LP, 50LQ, 50LR, 50LS, 50LT, 50LU, 50LV, 50LW, 50LX, 50LY, 50LZ, 50MA, 50MB, 50MC, 50MD, 50ME, 50MF, 50MG, 50MH, 50MI, 50MJ, 50MK, 50ML, 50MM, 50MN, 50MO, 50MP, 50MQ, 50MR, 50MS, 50MT, 50MU, 50MV, 50MW, 50MX, 50MY, 50MZ, 50NA, 50NB, 50NC, 50ND, 50NE, 50NF, 50NG, 50NH, 50NI, 50NJ, 50NK, 50NL, 50NM, 50NN, 50NO, 50NP, 50NQ, 50NR, 50NS, 50NT, 50NU, 50NV, 50NW, 50NX, 50NY, 50NZ, 50OA, 50OB, 50OC, 50OD, 50OE, 50OF, 50OG, 50OH, 50OI, 50OJ, 50OK, 50OL, 50OM, 50ON, 50OO, 50OP, 50OQ, 50OR, 50OS, 50OT, 50OU, 50OV, 50OW, 50OX, 50OY, 50OZ, 50PA, 50PB, 50PC, 50PD, 50PE, 50PF, 50PG, 50PH, 50PI, 50PJ, 50PK, 50PL, 50PM, 50PN, 50PO, 50PP, 50PQ, 50PR, 50PS, 50PT, 50PU, 50PV, 50PW, 50PX, 50PY, 50PZ, 50QA, 50QB, 50QC, 50QD, 50QE, 50QF, 50QG, 50QH, 50QI, 50QJ, 50QK, 50QL, 50QM, 50QN, 50QO, 50QP, 50QQ, 50QR, 50QS, 50QT, 50QU, 50QV, 50QW, 50QX, 50QY, 50QZ, 50RA, 50RB, 50RC, 50RD, 50RE, 50RF, 50RG, 50RH, 50RI, 50RJ, 50RK, 50RL, 50RM, 50RN, 50RO, 50RP, 50RQ, 50RR, 50RS, 50RT, 50RU, 50RV, 50RW, 50RX, 50RY, 50RZ, 50SA, 50SB, 50SC, 50SD, 50SE, 50SF, 50SG, 50SH, 50SI, 50SJ, 50SK, 50SL, 50SM, 50SN, 50SO, 50SP, 50SQ, 50SR, 50SS, 50ST, 50SU, 50SV, 50SW, 50SX, 50SY, 50SZ, 50TA, 50TB, 50TC, 50TD, 50TE, 50TF, 50TG, 50TH, 50TI, 50TJ, 50TK, 50TL, 50TM, 50TN, 50TO, 50TP, 50TQ, 50TR, 50TS, 50TT, 50TU, 50TV, 50TW, 50TX, 50TY, 50TZ, 50UA, 50UB, 50UC, 50UD, 50UE, 50UF, 50UG, 50UH, 50UI, 50UJ, 50UK, 50UL, 50UM, 50UN, 50UO, 50UP, 50UQ, 50UR, 50US, 50UT, 50UU, 50UV, 50UW, 50UX, 50UY, 50UZ, 50VA, 50VB, 50VC, 50VD, 50VE, 50VF, 50VG, 50VH, 50VI, 50VJ, 50VK, 50VL, 50VM, 50VN, 50VO, 50VP, 50VQ, 50VR, 50VS, 50VT, 50VU, 50VV, 50VW, 50VX, 50VY, 50VZ, 50WA, 50WB, 50WC, 50WD, 50WE, 50WF, 50WG, 50WH, 50WI, 50WJ, 50WK, 50WL, 50WM, 50WN, 50WO, 50WP, 50WQ, 50WR, 50WS, 50WT, 50WU, 50WV, 50WW, 50WX, 50WY, 50WZ, 50XA, 50XB, 50XC, 50XD, 50XE, 50XF, 50XG, 50XH, 50XI, 50XJ, 50XK, 50XL, 50XM, 50XN, 50XO, 50XP, 50XQ, 50XR, 50XS, 50XT, 50XU, 50XV, 50XW, 50XX, 50XY, 50XZ, 50YA, 50YB, 50YC, 50YD, 50YE, 50YF, 50YG, 50YH, 50YI, 50YJ, 50YK, 50YL, 50YM, 50YN, 50YO, 50YP, 50YQ, 50YR, 50YS, 50YT, 50YU, 50YV, 50YW, 50YX, 50YY, 50YZ, 50ZA, 50ZB, 50ZC, 50ZD, 50ZE, 50ZF, 50ZG, 50ZH, 50ZI, 50ZJ, 50ZK, 50ZL, 50ZM, 50ZN, 50ZO, 50ZP, 50ZQ, 50ZR, 50ZS, 50ZT, 50ZU, 50ZV, 50ZW, 50ZX, 50ZY, 50ZZ





1001

CASELINE RD

0 10 20m

WOODROFFE AVE

1001

1001

1001

1001

1001

5-23-25

0925062

MAR 15 2013

City of Ottawa, Province of Ontario, Enl Canada, Enl HERE, Germany, INCORPORATED P. U.S.A. EPA, USDA, NASC, NRC



UTM 18 440385
5 5021900
Elev. 40280
Basin 25 1 Carlton
County or District
Con. 1 R.F. Lot 35
Owner M. Loch Ltd.
(print in block letters)

3195

APL
The Ontario Water Resources Commission Act

GROUND WATER No. 5881
Well # 11
Township, Village, Town or City Nepesin
Date completed 21 Feb. 1961
(day month year)
Address 490 Industrial Ave.

WATER WELL RECORD

No. 1

Casing and Screen Record	Pumping Test
Inside diameter of casing <u>6 1/2"</u>	Static level <u>12'</u>
Total length of casing <u>48'</u>	Test-pumping rate <u>10</u> G.P.M.
Type of screen <u>✓</u>	Pumping level <u>300'</u>
Length of screen <u>✓</u>	Duration of test pumping <u>1 HR.</u>
Depth to top of screen <u>✓</u>	Water clear or cloudy at end of test <u>CLEAR</u>
Diameter of finished hole <u>6"</u>	Recommended pumping rate <u>10</u> G.P.M.
	with pump setting of <u>300</u> feet below ground surface

Well Log	Water Record			
Overburden and Bedrock Record	From ft.	To ft.	Depth(s) at which water(s) found	Kind of water (fresh, salty, sulphur)
<u>0</u> <u>SILT & Boulders</u>	<u>0</u>	<u>48</u>		
<u>limestone</u>	<u>48</u>	<u>315</u>	<u>140'</u>	<u>fresh</u>

For what purpose(s) is the water to be used? shopping centre (to be abandoned for city water)

Is well on upland, in valley or on hillside? upland

Drilling or Boring Firm McLean Water Supply Ltd.

Address 1532 Raven Ave. Ottawa

Licence Number 476 196

Name of Driller or Borer A. Scharf

Address _____

Date May 16 1961

(Signature of Licensed Drilling or Boring Contractor)

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

SEE
 Attached
 MAP
 on back
 #1

UTM

Elev

Basin

County or District

Con.

Owner

(print in block letters)

3195



The Ontario Water Resources Commission Act

WATER WELL RECORD

3

Township, Village, Town or City

Date completed

(day)

month

year

Address

Casing and Screen Record

Inside diameter of casing 6 1/2"
 Total length of casing 10'
 Type of screen ✓
 Length of screen ✓
 Depth to top of screen ✓
 Diameter of finished hole 6"

Pumping Test

Static level 10'
 Test-pumping rate 35 U.S. G.P.M.
 Pumping level 140'
 Duration of test pumping 24 HRS.
 Water clear or cloudy at end of test CLEAR
 Recommended pumping rate 35 U.S. G.P.M.
 with pump setting of 150 feet below ground surface

Well Log

Overburden and Bedrock Record

silt & boulders
limestone

Water Record

	From ft.	To ft.	Depth(s) at which water(s) found	Kind of water (fresh, salty, sulphur)
	0	50		
	50	250	250	Fresh

For what purpose(s) is the water to be used? to be abandonedshopping centre for city waterIs well on upland, in valley, or on hillside? upland

Drilling or Boring Firm

McLean Water Supply Ltd.Address 1532 Raven Ave. OttawaLicence Number 476

Name of Driller or Borer

A. Scharf

Address

Date

May 16
[Signature]

(Signature of Licensed Drilling or Boring Contractor)

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

SEE

Attached

5881

MMP

on back of #1 well #3

UTM 11 18 2 44 0 0 6 5 E

19 R 5 0 2 2 0 0 1 0 N

Elev. 912 0 2 8 0

Basin 25



The Well Drillers Act
Department of Mines, Province of Ontario

15 No 7860

RECEIVED

APR - 1 1952

GEOLOGICAL BRANCH

DEPARTMENT of MINES

Water Well Record

Village, Town or City.....*Ottawa*
Town or City.....*Baseline Road*
.....*Carleton Place, Ontario*
Date Completed...*Nov 30* (day) *1951* (month) (year) Cost of Well (excluding pump).....

Pipe and Casing Record

Pumping Test

Casing diameter(s)..... <i>4"</i>	Date <i>Nov 30 / 51</i>
Length(s) of casing(s)..... <i>46 ft</i>	Static level..... <i>41.0</i>
Type of screen.....	Pumping level..... <i>41.0</i>
Length of screen.....	Pumping rate..... <i>200 gpm</i>
Distance from top of screen to ground level.....	Duration of test..... <i>1 hr</i>
Is well a gravel-wall type?..... <i>Rock</i>	Distance from cylinder or bowls to ground level.....

Water Record

Kind (fresh or mineral)..... <i>fresh</i>	Depth(s) to Water Horizon(s)	Kind of Water	No. of Feet Water Rises
Quality (hard, soft, contains iron, sulphur, etc.)..... <i>good</i>	<i>50</i>	<i>[Handwritten diagram showing water level fluctuations]</i>	<i>7.7</i>
Appearance (clear, cloudy, coloured)..... <i>clear</i>	<i>65</i>		
For what purpose(s) is the water to be used?..... <i>domestic</i>	<i>100</i>		
How far is well from possible source of contamination?..... <i>50 ft</i>			
What is the source of contamination?..... <i>Septic tank</i>	<i>117</i>		
Enclose a copy of any mineral analysis that has been made of water.....			

Well Log


Overburden and Bedrock Record

From	To
0 ft.	ft.

<i>40 ft Blue Clay</i>	<i>0</i>	<i>40</i>
<i>17 Blue limestone</i>	<i>40</i>	<i>117</i>

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

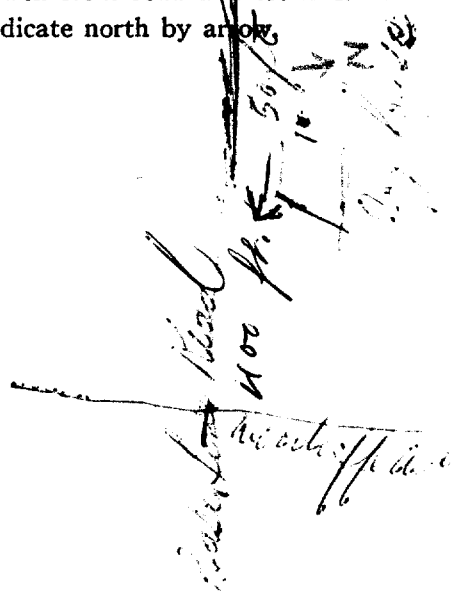

Situation: Is well on upland, in valley, or on hillside?.....
Drilling Firm...*J. H. Muligan*
Address.....
Name of Driller...*B. J. Carter* Address...*City View*
Date...*Nov 30 / 51* Licence Number...*117*
.....*B. J. Carter*

Signature of Licensee

Baseline Road

BASELINE



UTM 118Z 4410131210E

15R 50121211615N

The Ontario Water Resources Commission Act

15 No 7889

Elev. 15R 01210

WATER WELL RECORD

Basin 25 CARLETON

Township, Village, Town or City

OTTAWA

Con. Lot

Date completed 4 JULY 1961

Owner SUN OIL CO. LTD.

Address TORONTO, ONT.

(print in block letters)

Casing and Screen Record

Pumping Test

Inside diameter of casing 6"

Total length of casing 35'

Type of screen NONE

Length of screen -

Depth to top of screen -

Diameter of finished hole 6"

Static level 30'

Test-pumping rate 120 G.P.M.

Pumping level 100'

Duration of test pumping 1 HOUR

Water clear or cloudy at end of test CLEAR

Recommended pumping rate 2 G.P.M.

with pump setting of 100' feet below ground surface

Well Log

Water Record

Overburden and Bedrock Record

From ft.

To ft.

Depth(s) at which water(s) found

Kind of water (fresh, salty, sulphur)

Blue Clay
Black Shale0'
32'32'
272'

150'-260'

FRESH

For what purpose(s) is the water to be used? SERVICE

STATION

Is well on upland, in valley, or on hillside? UPLAND.

Drilling or Boring Firm J.B. DUFRESNE

& Co. LTD.

Address 1014 MAITLAND AVE.

OTTAWA, ONT.

Licence Number 194

Name of Driller or Borer W. ROY

Address HULL, P.Q.

Date 4 July 1961


(Signature of Licensed Drilling or Boring Contractor)

Form 7 15M Sets 60-5930

OWRC COPY

Location of Well

In diagram below show distances of well from road and lot line. Indicate north by arrow.

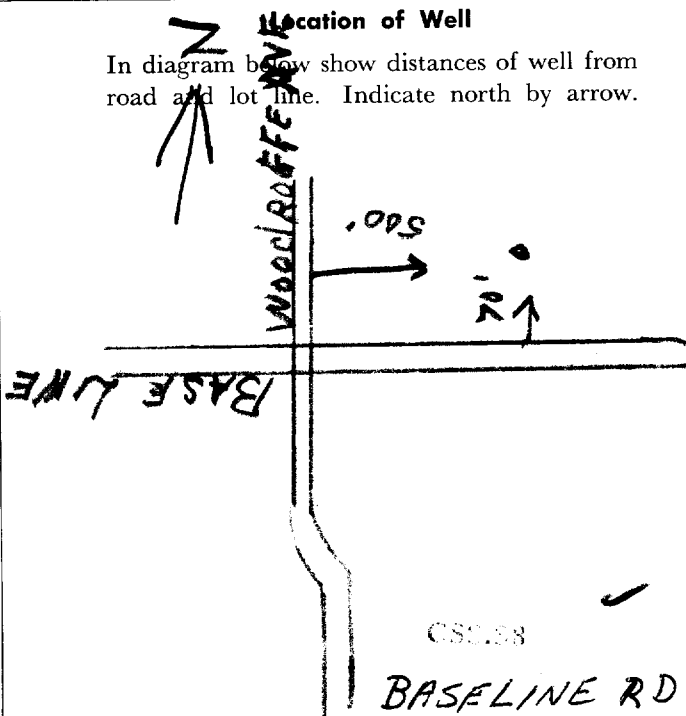

CS238

BASELINE RD

Mark Bujaki

From: Public Information Services <publicinformationservices@tssa.org>
Sent: July 22, 2025 2:19 PM
To: Mark Bujaki
Subject: RE: PE7169 - Records Search Request

External Email: Do not click on links or open attachments unless you trust the sender.

Hello ,

RECORD FOUND IN CURRENT DATABASE:

- We confirm that there are **fuels records** in our database at the subject address(es).

Inventory Number ▾	Address ▾	City ▾	Province ▾	Postal Code ▾	Status ▾	Reason Code ▾	Asset Class / Inventory Context ▾	Asset Type / Inventory Item ▾
10299761	1900 BASELINE RD	OTTAWA	ON	K2C 3Z6	Active	Active	Propane	FS PROPANE CYLR HANDLING FACILITY

***NO OTHER FUELS RECORDS FOUND IN CURRENT DATABASE FOR THIS REQUEST**

For a further search in our archives, please go to the [TSSA Client Portal](#) to complete an Application for Release of Public Information. Please refer to [Training \(tssa.org\)](#) for instructions on how to use the portal. Please refer to [How to Submit a Public Information Request \(tssa.org\)](#) for instructions.

The associated fee must be paid via credit card (Visa or MasterCard).

Once all steps have been successfully completed you will receive your payment receipt via email.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

If you have any questions or concerns, please do not hesitate to contact our Public Information Release team at publicinformationservices@tssa.org.

Kind regards,



Aleena Tahir | Public Information & Records Agent
Public Information
345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel: +1 416-734-3546 | E-Mail: ATahir@tssa.org
www.tssa.org





Winner of 2024 5-Star Safety Cultures Award

From: Mark Bujaki <mbujaki@Patersongroup.ca>
Sent: Tuesday, July 22, 2025 2:08 PM
To: Public Information Services <publicinformationservices@tssa.org>
Subject: PE7169 - Records Search Request

[CAUTION]: This email originated outside the organisation.
Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

Hello,

Could you please complete a search of your records for underground/aboveground storage tanks for the following addresses located in Ottawa, Ontario.

1900 Baseline Road
1945 Baseline Road
1981 Baseline Road
1983 Baseline Road
1984 Baseline Road
2030 Baseline Road

1363 Woodroffe Avenue
1377 Woodroffe Avenue
1379 Woodroffe Avenue
1381 Woodroffe Avenue

Thank you



PATERSON GROUP
SOLUTION ORIENTED
ENGINEERING

Mark Bujaki, B.Sc., MBA
Junior Environmental Scientist
Environmental Division
TEL: (613) 226-7381 ext. 335
DIRECT: (613) 299-4209
9 AURIGA DRIVE
OTTAWA ON K2E 7T9
patersongroup.ca

TEMPORARY SHORING DESIGN SERVICES ARE NOW AVAILABLE, PLEASE CONTACT US TO SEE HOW WE CAN HELP!
NEW OFFICE OPEN IN THE GREATER TORONTO AREA WITH OUR EXPANSIVE LIST OF SERVICES NOW AVAILABLE!

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

Mark Bujaki

From: Public Information Services <publicinformationservices@tssa.org>
Sent: August 7, 2025 9:38 AM
To: Mark Bujaki
Subject: RE: PE7169 - Records Search Request

External Email: Do not click on links or open attachments unless you trust the sender.

Hello ,

RECORD FOUND IN CURRENT DATABASE:

- We confirm that there are **fuels records** in our database at the subject address(es).

Inventory Number	Address	City	Province	Postal Code	Status	Reason Code	Asset Class / Inventory Context	Asset Type / Inventory Item
10102201	1980 BASELINE RD	OTTAWA	ON	K2C 0C6	EXPIRED	EXPIRED	FS Facility	FS PROPANE CYLR HANDLING FACILITY
10298797	1980 BASELINE RD	OTTAWA	ON	K2C 0C6	EXPIRED	EXPIRED	FS Facility	FS GASOLINE STATION - SPLIT SERVE
11607491	1980 BASELINE RD	OTTAWA	ON	K2C 0C6	EXPIRED	EXPIRED	FS Liquid Fuel Tank	FS LIQUID FUEL TANK
11607508	1980 BASELINE RD	OTTAWA	ON	K2C 0C6	EXPIRED	EXPIRED	FS Liquid Fuel Tank	FS LIQUID FUEL TANK
11607521	1980 BASELINE RD	OTTAWA	ON	K2C 0C6	EXPIRED	EXPIRED	FS Liquid Fuel Tank	FS LIQUID FUEL TANK
11607536	1980 BASELINE RD	OTTAWA	ON	K2C 0C6	EXPIRED	EXPIRED	FS Liquid Fuel Tank	FS LIQUID FUEL TANK
11607548	1980 BASELINE RD	OTTAWA	ON	K2C 0C6	EXPIRED	EXPIRED	FS Liquid Fuel Tank	FS LIQUID FUEL TANK
48370909	1980 BASELINE RD	OTTAWA	ON	K2C 0C6	Active	Active	Propane	FS CYLINDER EXCHANGE

***NO OTHER RECORDS FOUND IN CURRENT DATABASE FOR THIS REQUEST**

For a further search in our archives, please go to the [TSSA Client Portal](#) to complete an Application for Release of Public Information. Please refer to [Training \(tssa.org\)](#) for instructions on how to use the portal. Please refer to [How to Submit a Public Information Request \(tssa.org\)](#) for instructions.

The associated fee must be paid via credit card (Visa or MasterCard).

Once all steps have been successfully completed you will receive your payment receipt via email.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

If you have any questions or concerns, please do not hesitate to contact our Public Information Release team at publicinformationservices@tssa.org.

Kind regards,



Aleena Tahir | Public Information & Records Agent
Public Information
345 Carlingview Drive
Toronto, Ontario M9W 6N9
Tel: +1 416-734-3546 | E-Mail: ATahir@tssa.org
www.tssa.org



Winner of 2024 5-Star Safety Cultures Award

From: Mark Bujaki <mbujaki@Patersongroup.ca>
Sent: Wednesday, August 6, 2025 3:13 PM
To: Public Information Services <publicinformationservices@tssa.org>
Subject: PE7169 - Records Search Request

[CAUTION]: This email originated outside the organisation.
Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

Hello

Can you please complete a search of your records for underground/aboveground storage tanks for the following addresses located in Ottawa, Ontario?
Thank you,

1920 Baseline Road
1940 Baseline Road
1980 Baseline Road

1365 Woodroffe Avenue
1367 Woodroffe Avenue
1369 Woodroffe Avenue
1371 Woodroffe Avenue
1373 Woodroffe Avenue
1375 Woodroffe Avenue
1505 Woodroffe Avenue



Mark Bujaki, B.Sc., MBA
Junior Environmental Scientist
Environmental Division
TEL: (613) 226-7381 ext. 335
DIRECT: (613) 299-4209
9 AURIGA DRIVE
OTTAWA ON K2E 7T9
patersongroup.ca

TEMPORARY SHORING DESIGN SERVICES ARE NOW AVAILABLE, PLEASE CONTACT US TO SEE HOW WE CAN HELP!
NEW OFFICE OPEN IN THE GREATER TORONTO AREA WITH OUR EXPANSIVE LIST OF SERVICES NOW AVAILABLE!

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.



File Number: D06-03-25-0108

October 17, 2025

Kuldeep Panchal
Paterson Group Inc.

Sent via email [kpanchal@patersongroup.ca]

Dear Kuldeep Panchal,

Re: Information Request
1984 Baseline Road, Ottawa, Ontario ("Subject Property")

Internal Department Circulation:

The Planning, Infrastructure and Economic Development Department has the following information in response to your request for information regarding the Subject Property:

- **Environmental Remediation Unit:** The City's Environmental Remediation Unit (ERU) does not have any environmental records for this property.
- **Sewer Use Program:** No information found pertaining to the subject property.
- **Solid Waste Services:** No information found pertaining to the subject property.
- **Ottawa Public Health - Environmental Health:** all public inspection results are publicly available on the Ottawa Public Health website:
<https://www.ottawapublichealth.ca/en/public-health-services/public-health-inspections.aspx>

Documents Provided:

HLUI Summary Report and HLUI Map

The HLUI Summary Report Excel spreadsheet identifies HLUI area, point and line features within 250 metres of the Subject Property, as shown on the provided HLUI Map PDF. Within 500 metres of the Subject Property, landfills and Environmental Risk Management Area (ERMA) are also identified if applicable.

For more information on how to interpret the HLUI data identified in the attached excel sheet ('HLUI Summary report – 1984 Baseline Rd.xlsx'), please refer to the [Overview and User Guide](#)."

Additional information may be obtained by contacting:

Ontario's Environmental Registry

The Environmental Registry found at <https://ero.ontario.ca/> contains "public notices" about environmental matters being proposed by all government ministries covered by the Environmental Bill of Rights. The public notices may contain information about proposed new laws, regulations, policies and programs or about proposals to change or eliminate existing ones. By using key words i.e. name of proponent/owner and the address one can ascertain if there is any information on the proponent and address under the following categories: Ministry, keywords, notice types, Notice Status, Acts, Instruments and published date (all years).

The Ontario Land Registry Office

Registration of real property is recorded in the Ontario Land Registry Office through the Land Titles Act or the Registry Act. Documents relating to title and other agreements that may affect your property are available to the public for a fee. It is recommended that a property search at the Land Registry Office be included in any investigation as to the historic use of your property. The City of Ottawa cannot comment on any documents to which it is not a party.

Court House
161 Elgin Street 4th Floor
Ottawa ON K2P 2K1
Tel: (613) 239-1230
Fax: (613) 239-1422

Ottawa Public Health

Ottawa Public Health inspects many different types of establishments. To view inspection results, please visit the Ottawa Public Health website: [Public Health Inspections - Ottawa Public Health](#)

Please note that Ottawa Public Health is not the lead agency on land use contamination in the City of Ottawa – contact the Ministry of Environment Conservation and Parks (MECP) for further information.

Please note, as per the HLUI Disclaimer, that the information contained in the HLUI database has been compiled from publicly available records and other sources of information. The HLUI may contain erroneous information given that the records used as sources of information may be flawed. For instance, changes in municipal addresses over time may introduce error. Accordingly, all information from the HLUI database is provided on an “as is” basis with no representation or warranty by the City with respect to the information’s accuracy or exhaustiveness in responding to the request.

Furthermore, the HLUI database and the results of this search in no way confirm the presence or absence of contamination or pollution of any kind. This information is provided on the assumption that it will not be relied upon by any person for any

purpose whatsoever. The City of Ottawa denies all liability to any persons attempting to rely on any information provided from the HLUI database.

Please note that in responding to your request, the City of Ottawa does not guarantee or comment on the environmental condition of the Subject Property. You may wish to contact the Ontario Ministry of Environment and Climate Change for additional information.

If you have any further questions or comments, please contact HLUI@ottawa.ca.

Sincerely,

Bator Toth

Student Planner | Étudiant en Urbanism

Development Review | Examen des projets d'aménagement


City of Ottawa | Ville d'Ottawa

Enclosures: (2)

1. HLUI Map
2. HLUI Summary Report

cc: File no. D06-03-25-0108

HISTORIC LAND USE INVENTORY (HLUI) - REPORT REFERENCE MAP

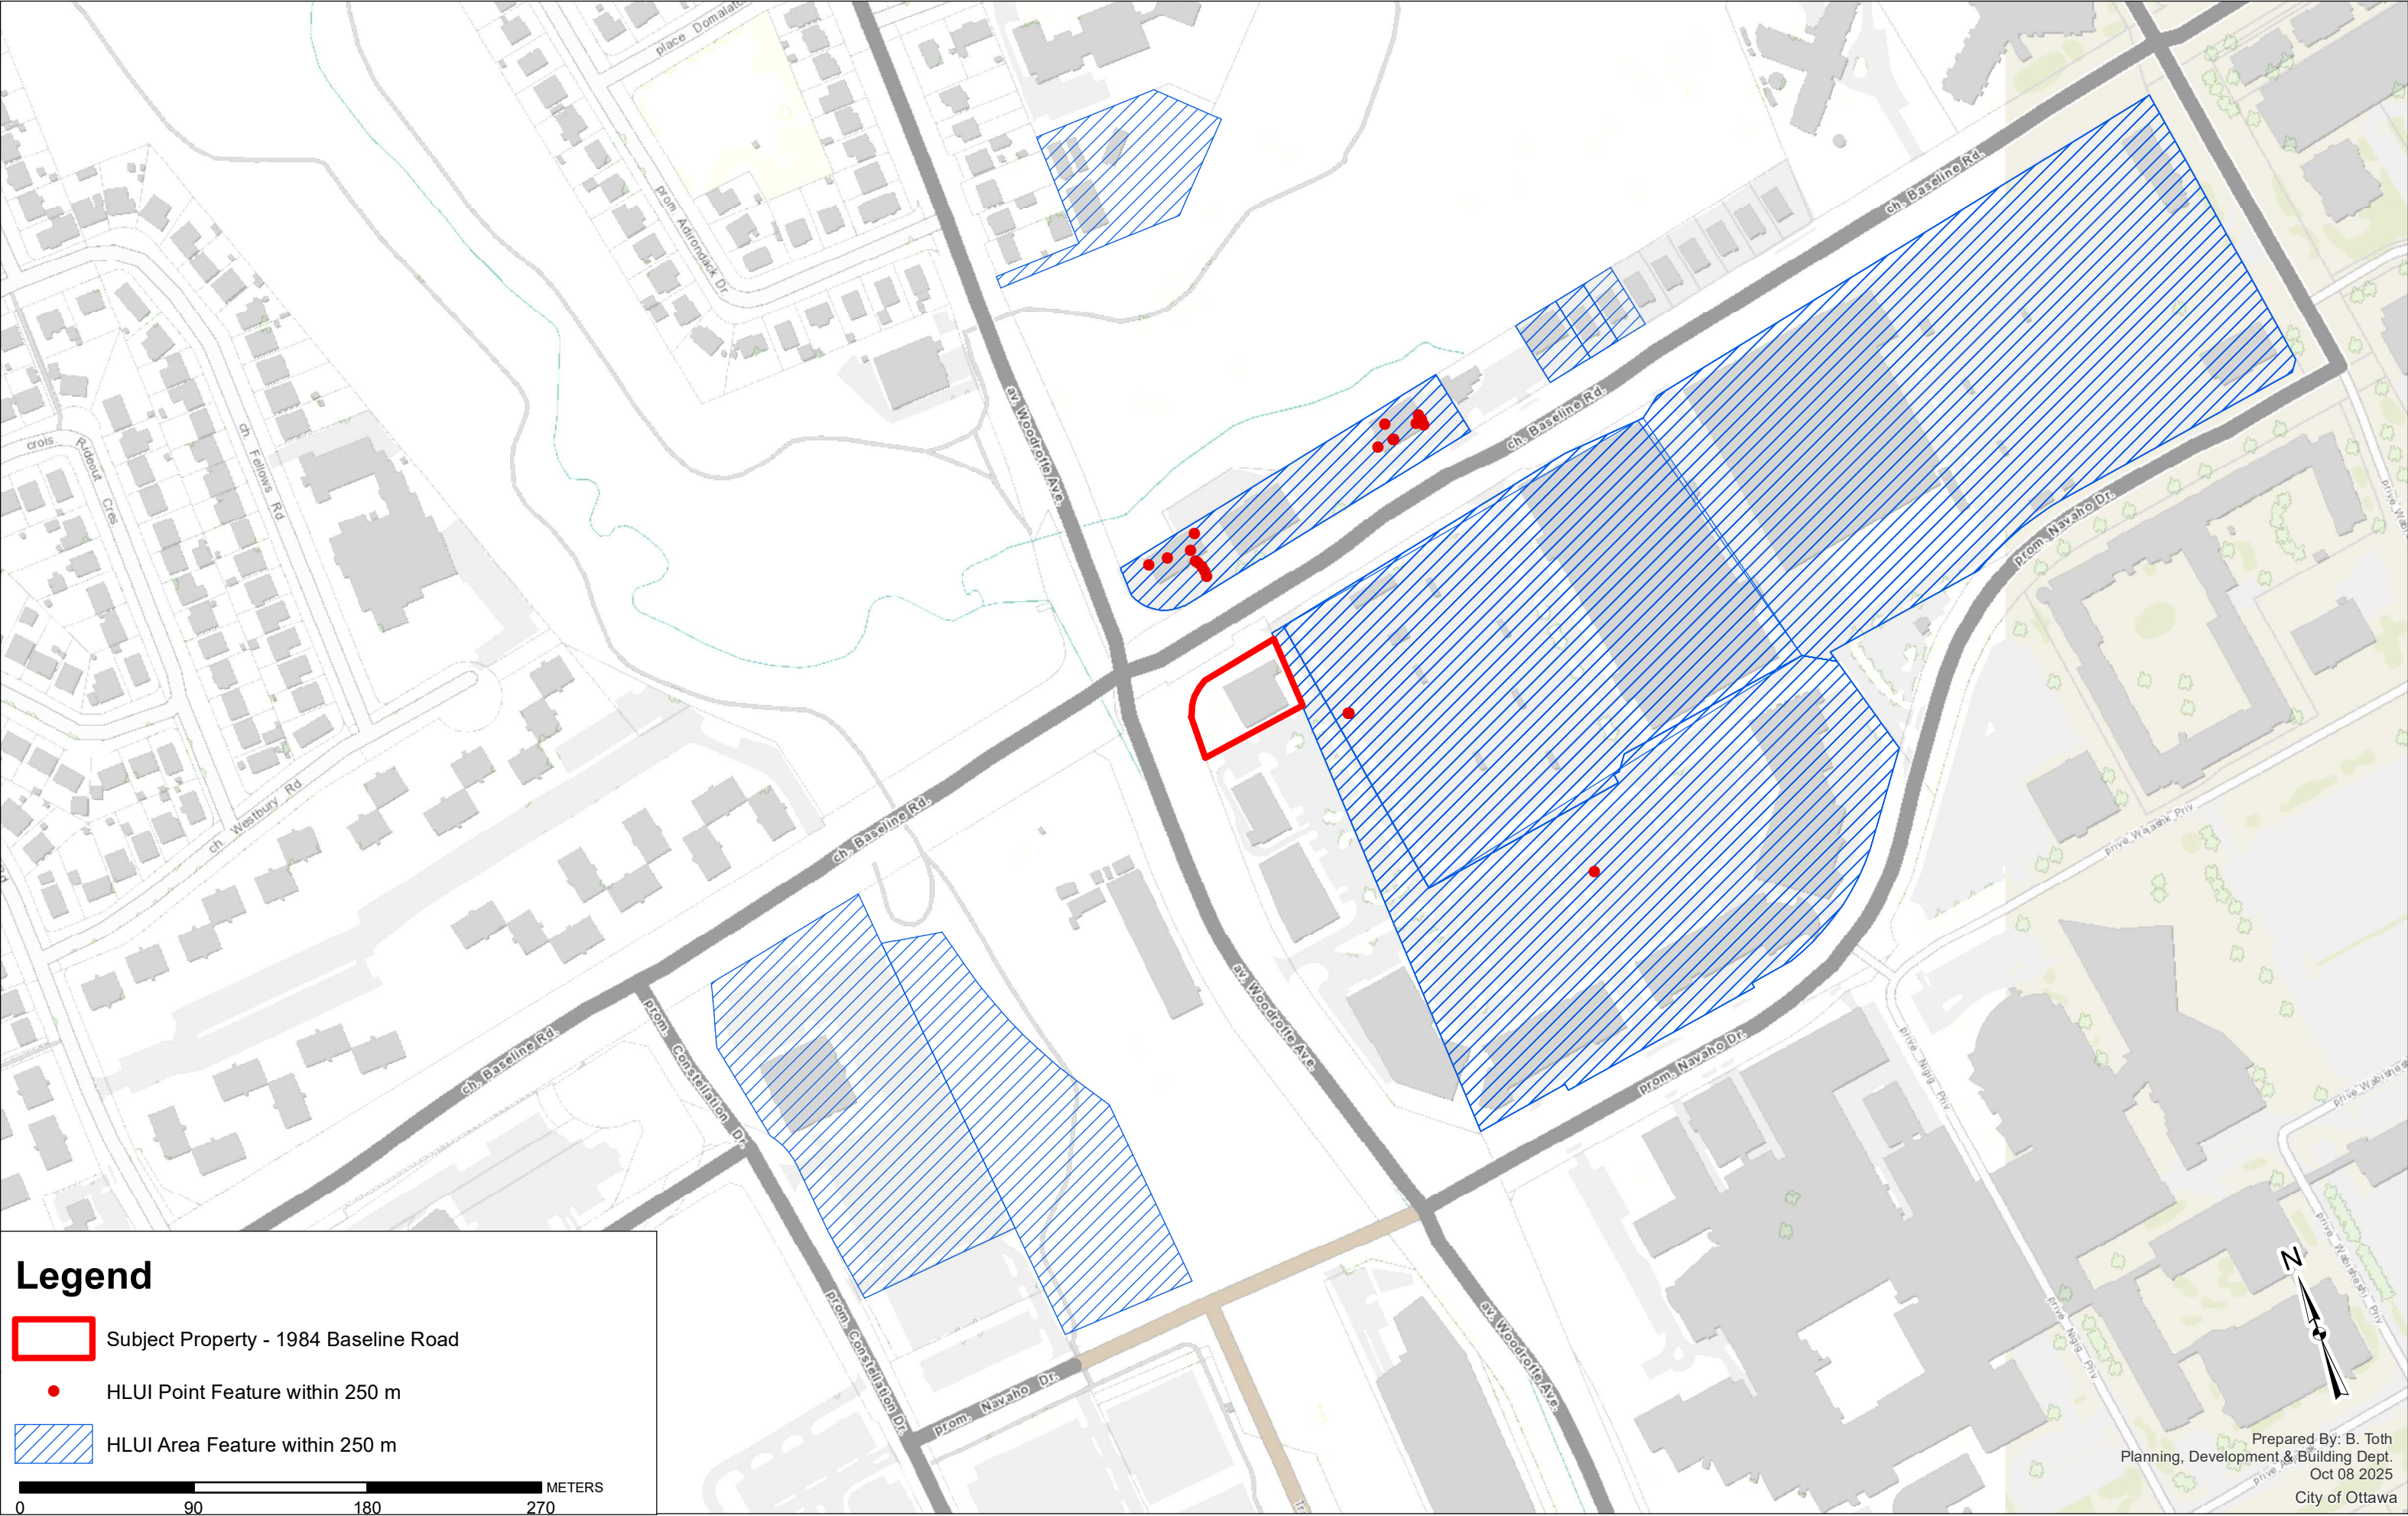

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
10131	LANDAWN SHOPPING CENTRE LIMITED	Electric Power Systems Industry	1995-MOEE-PCB-Inventory; 2004-GWStudy	1	1995	c. 1995	1980.00000000000000	BASELINE	RD		OTTAWA	1900	BASELINE	RD		K2C3Z6	046910233	OLD OTTAWA	221111; 221112; 221113; 221119; 221121; 221122; 493120; 493130; 493190	479; 491	MOEE PCB Site # 40294A016. Oils containing low PCB levels (<1000ppm) are stored on site.		82535.994855517012184	1387.393776546580057
6293	BELL NORTHERN RESEARCH	Communication and Other Electronic Equipment Industries	2000-PID	1	2000	c. 2000	2.00000000000000	CONSTELLATION	DR		NEPEAN	2	CONSTELLATION	DR		K2G5J9	046921302	NEPEAN	334220; 334410				17112.986134550599672	551.053881778013078
10098	PIONEER PETROLEUMS	Gasoline Service Stations	2001-ES; 2005-SelectPhone; 2012-ES	1	2001-2012	c. 2001; c. 2005	1980.00000000000000	BASELINE	RD			1900	BASELINE	RD		K2C3Z6	046910233	OLD OTTAWA	447110; 447190				82535.994855517012184	1387.393776546580057
10511	TONY GRAHAM LEXUS MOTORS	Motor Vehicle Repair Shops	1990-CD; 1998-SC	1	1990-1998	c. 1998	1971.00000000000000	BASELINE	RD		OTTAWA	1945	BASELINE	RD		K2C0C7	039920006	OLD OTTAWA	811112; 811119; 811121	635			6540.454802274960457	445.671215764299006
10513	TONY GRAHAM TOYOTA CENTRE	Motor Vehicle Repair Shops	1980-M	1	1960-1980	c. 1980	1945.00000000000000	BASELINE	RD		OTTAWA	1915	BASELINE	RD		K2C0C7	039920008	OLD OTTAWA	447110; 447190; 811112; 811119; 811121; 811199	633; 635			577.321755820029125	102.401360540708012
17647	TOWERS DEPARTMENT STORE STORE #54	Vendor	2004-GWStudy	2	2004	GW Study 2004 Renfrew Watershed					NEPEAN	1900	BASELINE	RD		K2C3Z6	046910233	OLD OTTAWA				33322.707949359595659	743.388719658151103	
6297	LAUNDRY LINE	Laundries and Cleaners	2000-PID	1	2000	c. 2000; c. 2001	1363.00000000000000	WOODROFFE	AVE		NEPEAN	1363	WOODROFFE	AVE		K2G1V7	046910250	NEPEAN	812320				35853.883215601599659	1067.044372329949965
6298	NORTEI - WOODLINE	Communication and Other Electronic Equipment Industries, Laboratories	1998-SC; 2000-PID; 2001-ES; 2003-PID	1	2000	c. 2000; c. 2001; c. 2003	100.00000000000000	CONSTELLATION	DR		NEPEAN	100	CONSTELLATION	DR		K2G6J8	046921269	NEPEAN	334220; 334290; 334410				12712.792887603500276	553.768921951587004
7938	CLEANAWAY LTD	Laundries and Cleaners	1980-M	1	1980		1371.00000000000000	WOODROFFE	AVE		OTTAWA	1371	WOODROFFE	AVE			046910250	OTTAWA					35853.883215601599659	1067.044372329949965
10512	BILL SHAW ESSO SERVICE STATION	Gasoline Service Stations	1960-M; 1965-FIP-430-40090; 1965-M	1	1960-1980	c. 1960-1983; c. 1965	1983.00000000000000	BASELINE	RD		OTTAWA	1945	BASELINE	RD		K2C0C7	039920006	OLD OTTAWA	447110; 447190; 811112; 811119; 811121; 811199	633; 635		2 UST - gasoline	6540.454802274960457	445.671215764299006
10100	FRANK JEWELLERY	Jewellery Stores and Watch And Jewellery Repair Shops	2001-ES	1	2001	c. 2001	1980.00000000000000	BASELINE	RD		OTTAWA	1900	BASELINE	RD		K2C3Z6	046910233	OLD OTTAWA	448310				82535.994855517012184	1387.393776546580057
10514	ECHO DENTAL LAB LIMITED	Stamped, Pressed and Coated Metal Products Industries	1998-SC; 2001-ES; 2006-ES	1	1998-2001	c. 1998; c. 2001	1915.00000000000000	BASELINE	RD		OTTAWA	1915	BASELINE	RD		K2C0C7	039920008	OLD OTTAWA	334610; 339910	399			577.321755820029125	102.401360540708012
6295	CLASSIC CLEANERS & LAUNDERERS	Laundries and Cleaners	1970-M; 1980-M; 1994-PID	1	1970-1994	c. 1970; c. 1980; c. 1994	1371.00000000000000	WOODROFFE	AVE		OTTAWA	1363	WOODROFFE	AVE		K2G1V7	046910250	NEPEAN	561740; 812310; 812320; 812330	972	Located where Shoppers City West is today.		35853.883215601599659	1067.044372329949965
10510	ALGONQUIN ANIMAL HOSPITAL	Services Incidental to Livestock and Animal Specialties	2000-PID; 2001-ES; 2003-PID; 2006-ES; 2012-ES; 2016-PID	1	2000-2016	ES 2001; ES 2006; ES 2012	1945.00000000000000	BASELINE	RD			1945	BASELINE	RD		K2C0C7	039920006	OLD OTTAWA	541940				6540.454802274960457	445.671215764299006
6296	FOTOMAT	Platemaking, Typesetting and Bindery Industry	1980-M	1	1980	c. 1980	1363.00000000000000	WOODROFFE	AVE		OTTAWA	1363	WOODROFFE	AVE		K2G1V7	046910250	NEPEAN	323120; 443130; 812921; 812922	282; 657	Unit D; Located in Shoppers City West		35853.883215601599659	1067.044372329949965
8441	BETONEL LTEE	Lumber and Building Materials, Wholesale	2005-SelectPhone	1	2005	c. 2001; c. 2005	1919.00000000000000	BASELINE	RD			1917	BASELINE	RD		K2C0C7	039920004	OLD OTTAWA	444120				839.612856897154984	117.635782720330994
7882	FREIMART TIRE MART	Motor Vehicle Repair Shops	1965-1980-M	1	1965-1980		1980.00000000000000	BASELINE	RD		OTTAWA	1980	BASELINE	RD			046910233	OTTAWA					82535.994855517012184	1387.393776546580057
8440	DULUX PAINTS	Paint-Manufacturers	2012-ES; 2017-SalesGenie	1	2012-2017	ES 2012	1919.00000000000000	BASELINE	RD			1917	BASELINE	RD		K2C0C7	039920004	OLD OTTAWA	444120				839.612856897154984	117.635782720330994

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	SOURCE_UPDATE_SORTED	QAQC	YEAR	YEAR_1	ST_NUM	ST_NAME	ST_SUFFIX	ST_DIR	MUNICIPALITY	ST_NUM2017	ST_NAME2017	ST_SUFFIX2017	ST_DIR2017	POSTAL_CODE2017	PIN2017	MUNICIPALITY2017	NAICS	SIC	COMMENTS	STORAGE_TANK	Shape_Length	Shape_Area
10097	PETRO-CANADA LTD	Gas Station	1990-CD	1	1990	CD 1990	1850.00000 000000000 0	BASELINE	RD			1900	BASELINE	RD		K2C3Z6	046910233	OLD OTTAWA					82535.994855517012184	1387.393776546580057
10099	FIRESTONE STORE	Motor Vehicle Repair Shops	1965-FIP-430-40094; 1966-M	1	1965	c. 1965-1980; c. 1980	1980.00000 000000000 0	BASELINE	RD		OTTAWA	1900	BASELINE	RD		K2C3Z6	046910233	OLD OTTAWA	322220; 326290; 339110; 339990; 415210; 415290; 493120; 493130; 493190; 811112; 811119; 811121	159; 479; 552; 635	#NAME?	1 UST - gasoline	82535.994855517012184	1387.393776546580057
10515	TRANSFORMER STATION, HYDRO OTTAWA	Transformer Station	1922-DMD-TM-Ottawa; 1948-DND-ASE-NTS-31G/5; 1951-DND-ASE-NTS-31G/4E-4thed; 1966-EMR-SMB-NTS-31G/4-5thed; 1967-EMR-SMB-NTS-31G/5-7thed; 1968-Topo; 1975-EMR-SMB-NTS-31G/4-6thed; 1979-EMR-SMB-NTS-31G/4-7thed; 1985-EMR-SMB-NTS-31G/5-11thed; Sheet#14	1	1922-2016	1968, 1979 Topographic Map						1299	WOODROFFE	AVE			039920013	OLD OTTAWA					5208.957548235550348	369.797140524691997
11294	TOP VALU GAS MART	Gasoline Service Stations	1965-FIP-430-40094; 1965-M; 1970-M; 1980-M	1	1960-1980	c. 1965-1999	1980.00000 000000000 0	BASELINE	RD		OTTAWA	1900	BASELINE	RD		K2C3Z6	046910233	OLD OTTAWA	447110; 447190; 811199	633	Firestone Store also listed at 1980 Baseline Rd. in 1980 at the same time as Top Valu Gas Mart.	1 UST - gasoline	34022.421583989598730	753.720572421087013
5258	ZOHRA'S ALTERATIONS	Manufacturing	2012-ES	1			1911.00000 000000000 0	BASELINE	RD			1911	BASELINE	RD		K2C0C7	039920009	OLD OTTAWA	315233				577.301215540119983	102.399710296128006
6294	LAURIER DRY CLEANERS & CUSTOM TAILORING	Laundries and Cleaners	2001-ES	1	2001	ES 2001	1375.00000 000000000 0	WOODROFFE	AVE			1363	WOODROFFE	AVE		K2G1V7	046910250	NEPEAN	812320		historic address		35853.883215601599659	1067.044372329949965
8019	SMITH SUNOCO SERVICE STATION	Gasoline Service Stations	1965-FIP-430-40090	1	1965		1983.00000 000000000 0	BASELINE	RD		OTTAWA	1983	BASELINE	RD			039920006	OTTAWA					6540.454802274960457	445.671215764299006

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	TANK_LOCATIO N	TANK_CONT ENT	TANK_SIZE	TANK_TYPE	TANK_STAT US	SOURCE	INSTALLED_S T_NUM	INSTALLED_ST_NAM E	INSTALLE D_ST_ABR	INSTALL ED_ST_ DIR	COMMENT	MTM_X	MTM_Y	IMAGE_MAP	IMAGE_CERTAIN TY	IMAGE_MAP_ 2	TANK_MATE RIAL	TANK_ID	TANK_LEAKI NG	TANK_REMO VED	REMOVED_DA TE	DATE_INSTALL ED	NATURE_OF_B USINESS	SCANNED _DRAWING	TEMPRec ordID	CAPACITY _UOM	MUNICIPA LITY	POSTCOD E	
4082	IMPERIAL OIL LTD		UST	gasoline	22700.0000 0000000000	Existing	Active	Bylaw No. 304-60 VAH6100; 0048 - P1832	1945	BASELINE	RD		22/02/10 Location Updated. new pumps address verified from dwg & geoottawa, Baseline Rd & Woodroffe Ave Ottawa ON	362589.13465819 0014306	5023827.9548755 59546053	FR300-VAH6100- 0048_002.jpg	2	FR300- VAH6000- BASE 01983_002.j pg		ST2431	N	N		15/06/1959	1 - 3000 gal gasoline 1 - 4000 gal gasoline; 1 - 5000 gal gasoline; 1 - 1000 gal fuel oil; & 1 - 500 gal waste oil	Yes					
7668	PETRO CANADA - ROBERT TESSIER	Gasoline Station-SS		gasoline	35000.0000 0000000000	Cancelled	Previous	GW Study 2004	1850	BASE LINE	RD	<Null>	22/03/28 Location Updated	362667.25586356 0014404	5023749.8185825 19888878		2							19830401	Retail		1049.000 00000000 0000	L	OTTAWA	K2C 0C6	
4088	SUN OIL CO LTD		UST	gasoline	22700.0000 0000000000	Permit		Bylaw No. 304-60 - P2791	1945	BASELINE	RD		22/02/10 Location Updated	362702.22155279 0026180	5023900.0538030 49959242		2				ST4066				27067						
4688	SUN OIL CO LTD		UST	gasoline	18160.0000 0000000000	Permit		Bylaw No. 304-60 VAH6100; 0050 - P1742	1945	BASELINE	RD		22/02/10 Location Updated. dwg shows dry well address verified from dwg & geoottawa; site located on e portion of property, Lots 5, 6 & 7 Reg Plan 369253 NS Baseline Rd, Ottawa ON	362706.09815316 0011861	5023898.9076791 09834135	FR300-VAH6100- 0050_002.jpg	1				ST4064				22197		Yes				
2033	GARAGE	Garage	UST					FIP1956	1983	BASELINE	RD		22/02/10 Location Updated. historical address - 1983 Baseline Rd	362585.25148585 0021709	5023834.0364628 09890509	Volume4_430.jpg	1														
4086	IMPERIAL OIL LTD		UST	waste oil	2270.00000 0000000000	Permit		Bylaw No. 304-60 VAH6000; BASE 01983 - P2103	1945	BASELINE	RD		22/02/10 Location Updated.	362587.68532469 0013658	5023828.6095262 49580085	FR300-VAH6000- BASE 01983_002.jpg	1				ST5151				29/09/1964		Yes				
4087	IMPERIAL OIL LTD		UST	gasoline	13620.0000 0000000000	Existing	Active	Bylaw No. 304-60 VAH6000; BASE 01983 - P2103	1945	BASELINE	RD		22/02/10 Location Updated.	362591.05960552 9997498	5023826.0201688 10151517	FR300-VAH6000- BASE 01983_002.jpg	1				ST0506	N	N		15/06/1959	1 - 3000 gal gasoline 1 - 4000 gal gasoline; 1 - 5000 gal gasoline; 1 - 1000 gal fuel oil; & 1 - 500 gal waste oil	Yes				
4689	SUN OIL CO LTD		UST	gasoline	18160.0000 0000000000	Permit		Bylaw No. 304-60 VAH6100; 0050 - P1742	1945	BASELINE	RD		22/02/10 Location Updated. dwg shows dry well address verified from dwg & geoottawa; site located on e portion of property, Lots 5, 6 & 7 Reg Plan 369253 NS Baseline Rd, Ottawa ON	362703.52257973 9976209	5023904.3299845 90411186	FR300-VAH6100- 0050_002.jpg	1				ST4877				22197		Yes				
4692	SUN OIL CO LTD		UST	waste oil	4540.00000 0000000000	Permit		Bylaw No. 304-60 VAH6100; 0050 - P1742	1945	BASELINE	RD		22/02/10 Location Updated. dwg shows dry well address verified from dwg & geoottawa; site located on e portion of property, Lots 5, 6 & 7 Reg Plan 369253 NS Baseline Rd, Ottawa ON	362682.28386750 9977426	5023887.5919670 09939253	FR300-VAH6100- 0050_002.jpg	1				ST5583				22197		Yes				
8078	PIONEER PETROLEUMS	Gasoline Station-FS&SS		gasoline	45500.0000 0000000000	Cancelled	Previous	GW Study 2004	1980	BASE LINE	RD	<Null>	22/03/28 Location Updated	362667.25586356 0014404	5023749.8185825 19888878		2							19830401	Retail		711.0000 00000000 000	L	OTTAWA	K2C 0C6	
8079	PIONEER PETROLEUMS	Gasoline Station-FS&SS		gasoline	36300.0000 0000000000	Cancelled	Current	GW Study 2004	1980	BASE LINE	RD	<Null>	22/03/28 Location Updated	362667.25586356 0014404	5023749.8185825 19888878		2							19830401	Retail		712.0000 00000000 000	L	OTTAWA	K2C 0C6	
8496	PETRO CANADA - ROBERT TESSIER	Gasoline Station-SS		gasoline	35000.0000 0000000000	Cancelled	Current	GW Study 2004	1850	BASE LINE	RD	<Null>	22/03/28 Location Updated	362667.25586356 0014404	5023749.8185825 19888878		2							19830401	Retail		2567.000 00000000 0000	L	OTTAWA	K2C 0C6	
2032	GARAGE	Garage	UST					FIP1956	1983	BASELINE	RD		22/02/10 Location Updated. historical address - 1983 Baseline Rd	362573.42176643 9976636	5023829.8437115 19613862	Volume4_430.jpg	1														
4085	IMPERIAL OIL LTD		UST	gasoline	22700.0000 0000000000	Permit		Bylaw No. 304-60 VAH6000; BASE 01983 - P2103	1945	BASELINE	RD		22/02/10 Location Updated.	362593.68670601 9972917	5023820.5982241 20214581	FR300-VAH6000- BASE 01983_002.jpg	1				ST4065				29/09/1964		Yes				
8080	PIONEER PETROLEUMS	Gasoline Station-FS&SS		gasoline	36300.0000 0000000000	Cancelled	Current	GW Study 2004	1980	BASE LINE	RD	<Null>	22/03/28 Location Updated	362667.25586356 0014404	5023749.8185825 19888878		2							19830401	Retail		713.0000 00000000 000	L	OTTAWA	K2C 0C6	
8081	PIONEER PETROLEUMS	Gasoline Station-FS&SS		gasoline	22700.0000 0000000000	Cancelled	Current	GW Study 2004	1980	BASE LINE	RD	<Null>	22/03/28 Location Updated	362667.25586356 0014404	5023749.8185825 19888878		2							19830401	Retail		714.0000 00000000 000	L	OTTAWA	K2C 0C6	
1757			UST	fuel oil				ROW	1945	BASELINE	RD		22/02/10 Location Updated	362690.59806167 0025345	5023891.5728308 10211599		2				ST7434				1 tank						
4083	IMPERIAL OIL LTD		UST	gasoline	18160.0000 0000000000	Existing	Active	Bylaw No. 304-60 VAH6100; 0048 - P1832	1945	BASELINE	RD		22/02/10 Location Updated. new pumps address verified from dwg & geoottawa, Baseline Rd & Woodroffe Ave Ottawa ON	362592.52689000 9990893	5023823.4133530 60372174	FR300-VAH6100- 0048_002.jpg	2	FR300- VAH6000- BASE 01983_002.j pg		ST1871	N	N		15/06/1959		Yes					
4690	SUN OIL CO LTD		UST	gasoline	18160.0000 0000000000	Permit		Bylaw No. 304-60 VAH6100; 0050 - P1742	1945	BASELINE	RD		22/02/10 Location Updated. dwg shows dry well address verified from dwg & geoottawa; site located on e portion of property, Lots 5, 6 & 7 Reg Plan 369253 NS Baseline Rd, Ottawa ON	362705.04134527 0001329	5023901.7237687 39961088	FR300-VAH6100- 0050_002.jpg	1				ST5228				22197		Yes				
8478			UST	fuel oil				ROW	1945	BASELINE	RD		22/02/10 Location Updated	362690.59806167 0025345	5023891.5728308 10211599		2				ST7547				2 tanks						
8498	PETRO CANADA - ROBERT TESSIER	Gasoline Station-SS		diesel	25000.0000 0000000000	Cancelled	Current	GW Study 2004	1850	BASE LINE	RD	<Null>	22/03/28 Location Updated	362667.25586356 0014404	5023749.8185825 19888878			3						19830401	Retail		2569.000 00000000 0000	L	OTTAWA	K2C 0C6	
4084	IMPERIAL OIL LTD		UST	fuel oil	4540.00000 0000000000	Existing	Active	Bylaw No. 304-60 VAH6100; 0048 - P1832	1945	BASELINE	RD		22/02/10 Location Updated. new pumps address verified from dwg & geoottawa, Baseline Rd & Woodroffe Ave Ottawa ON	362563.78396497 9986195	5023826.7467227 29876637	FR300-VAH6100- 0048_002.jpg	2	FR300- VAH6000- BASE 01983_002.j pg		ST2688	N	N		15/06/1959		Yes					
4691	SUN OIL CO LTD		UST	fuel oil	4540.00000 0000000000	Permit		Bylaw No. 304-60 VAH6100; 0050 - P1742	1945	BASELINE	RD		22/02/10 Location Updated. dwg shows dry well address verified from dwg & geoottawa; site located on e portion of property, Lots 5, 6 & 7 Reg Plan 369253 NS Baseline Rd, Ottawa ON	362685.83406229 9982179	5023899.5438732 19750822	FR300-VAH6100- 0050_002.jpg	1				ST5420				22197		Yes				
209	GARAGE	Garage	UST					FIP1956	1945	BASELINE	RD		historical address - 1945 Baseline Rd	362690.59806167 0025345	5023891.5728308 10211599	Volume4_430.jpg	1														
1391			UST	fuel oil				ROW	1945	BASELINE	RD		22/02/10 Location Updated.	362690.59806167 0025345	5023891.5728308 10211599		2				ST7670				2 tanks						
4354	BREWERS RETAIL STORE, SHOPPERS CITY		UST	oil	4540.00000 0000000000	Permit		Bylaw No. 304-60 VAH6100; 0051 - P2039	1900	BASELINE	RD		22/03/28 Location Updated. address verified from dwg & geoottawa, Brewers Retail Store, Shoppers City, Baseline Rd, Ottawa	362794.37195319 0013301	5023667.5998697 40195572	FR300-VAH6100- 0051_002.jpg	1				ST4696				27/12/1963		Yes				
207	GAS BAR	Gas Bar	UST					FIP1956	1980	BASELINE	RD		22/03/24 Location Updated. historical address - 1980 Baseline Rd	362667.25586356 0014404	5023749.8185825 19888878	Volume4_430.jpg	1														

OBJECTID	ACTIVITY_NAME	FACILITY_TYPE	TANK_LOCATION	TANK_CONTENT	TANK_SIZE	TANK_TYPE	TANK_STATUS	SOURCE	INSTALLED_ST_NUM	INSTALLED_ST_NAME	INSTALLED_ST_ABR	INSTALLED_ST_DIR	COMMENT	MTM_X	MTM_Y	IMAGE_MAP	IMAGE_CERTAINTY	IMAGE_MAP_2	TANK_MATERIAL	TANK_ID	TANK_LEAKING	TANK_REMOVED	REMOVED_DATE	DATE_INSTALLED	NATURE_OF_BUSINESS	SCANNED_DRAWING	TEMPRECordID	CAPACITY_UOM	MUNICIPALITY	POSTCODE
4089	IMPERIAL OIL		UST	waste oil	2270.0000000000000	Permit		Bylaw No. 8022 - P1522, 1523, 1524, 1525, 1526	1945	BASELINE	RD		22/02/10 Location Updated. 1983 baseline rd subordinate address address verified from 1960 city directory, Baseline Rd & Woodroffe Ave	362587.193187460012268	5023842.939223320223391		2			ST2913				15/06/1959	1 - 3000 gal gasoline; 1 - 4000 gal gasoline; 1 - 5000 gal gasoline; 1 - 1000 gal fuel oil; & 1 - 500 gal waste oil					
8082	PIONEER PETROLEUMS	Gasoline Station-FS&SS		diesel	22700.0000000000000	Cancelled	Current	GW Study 2004	1980	BASE LINE	RD	<Null>	22/03/28 Location Updated	362667.255863560014404	5023749.818582519888878		2							19830401	Retail		715.0000000000000	L	OTTAWA	K2C 0C6
8497	PETRO CANADA - ROBERT TESSIER	Gasoline Station-SS		gasoline	35000.0000000000000	Cancelled	Current	GW Study 2004	1850	BASE LINE	RD	<Null>	22/03/28 Location Updated	362667.255863560014404	5023749.818582519888878			3						19830401	Retail		2568.0000000000000	L	OTTAWA	K2C 0C6



DATABASE REPORT

Project Property:	<i>PE7169 - 1984 Baseline Road PE7169 Ottawa ON 63647</i>
Project No:	
Report Type:	<i>Standard Report</i>
Order No:	<i>25072400010</i>
Requested by:	<i>Paterson Group Inc.</i>
Date Completed:	<i>July 24, 2025</i>

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	7
Executive Summary: Site Report Summary - Surrounding Properties.....	8
Executive Summary: Summary By Data Source.....	28
Map.....	53
Aerial.....	54
Topographic Map.....	55
Detail Report.....	56
Unplottable Summary.....	377
Unplottable Report.....	379
Appendix: Database Descriptions.....	426
Definitions.....	436

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: PE7169 - 1984 Baseline Road
PE7169 Ottawa ON

Project No: 63647

Coordinates:

Latitude: 45.3514095
Longitude: -75.7620936
UTM Northing: 5,022,271.20
UTM Easting: 440,303.68
UTM Zone: 18T

Elevation: 269 FT
81.88 M

Order Information:

Order No: 25072400010
Date Requested: July 24, 2025
Requested by: Paterson Group Inc.
Report Type: Standard Report

Historical/Products:

Executive Summary: Report Summary

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Within 0.25 km</i>	<i>Total</i>
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	5	5
CA	Certificates of Approval	Y	0	4	4
CDRY	Dry Cleaning Facilities	Y	0	0	0
CFOT	Commercial Fuel Oil Tanks	Y	0	0	0
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	7	7
EASR	Environmental Activity and Sector Registry	Y	0	0	0
EBR	Environmental Registry	Y	0	4	4
ECA	Environmental Compliance Approval	Y	0	7	7
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	1	13	14
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	5	5
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	0	0
FSTH	Fuel Storage Tank - Historic	Y	0	0	0
GEN	Ontario Regulation 347 Waste Generators Summary	Y	0	80	80
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	0	0
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0

Database	Name	Searched	Project Property	Within 0.25 km	Total
INC	Fuel Oil Spills and Leaks	Y	0	2	2
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	3	3
NPR2	National Pollutant Release Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory - Historic	Y	0	0	0
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	6	6
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	11	11
PFAS	Ontario PFAS Spills	Y	0	0	0
PFCH	NPRI Reporters - PFAS Substances	Y	0	0	0
PFHA	Potential PFAS Handlers from NPRI	Y	0	0	0
PINC	Pipeline Incidents	Y	0	0	0
PPHA	Potential PFAS Handlers from EASR	Y	0	0	0
PRT	Private and Retail Fuel Storage Tanks	Y	0	2	2
PTTW	Permit to Take Water	Y	0	0	0
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	0	0
RST	Retail Fuel Storage Tanks	Y	0	1	1
SCT	Scott's Manufacturing Directory	Y	0	1	1
SPL	Ontario Spills	Y	0	25	25
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	2	75	77

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Within 0.25 km</i>	<i>Total</i>
		Total:	3	251	254

Executive Summary: Site Report Summary - Project Property

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>3</u>	WWIS		1984 BASELINE ROAD Ottawa ON <i>Well ID:</i> 7328524	NNE/22.4	0.00	<u>56</u>
<u>4</u>	WWIS		1984 BASELINE ROAD Ottawa ON <i>Well ID:</i> 7328525	NE/27.0	0.00	<u>59</u>
<u>103</u>	EHS		1363,1365,1371,1379, 1381 Woodroffe Ave, 2301 Navaho Dr, 1850, 1900,1984, Baseline Rd Ottawa ON	E/231.8	2.00	<u>62</u>

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
1	WWIS		1980 Baseline Road lot 35 con 1 Ottawa ON Well ID: 7329943	NNE/21.2	0.00	63
2	WWIS		1980 Baseline Road lot 35 con 2 Ottawa ON Well ID: 7329941	WSW/21.3	0.00	66
5	WWIS		1980 baeline lot 35 con 1 Ottawa ON Well ID: 7328587	E/31.5	0.00	69
6	WWIS		1980 BASELINE RD. OTTAWA ON Well ID: 7296611	NNE/39.9	0.00	73
7	WWIS		1980 BASELINE ROAD lot 35 con 1 OTTAWA ON Well ID: 7328552	E/40.4	0.00	75
8	WWIS		lot 35 con 2 ON Well ID: 1532165	WSW/42.1	-0.15	78
9	WWIS		1980 BASELINE ROAD lot 35 con 1 Ottawa ON Well ID: 7328498	E/42.3	0.00	82
10	WWIS		1980 BASELINE ROAD Ottawa ON Well ID: 7328504	NE/42.7	0.00	85
11	WWIS		ON Well ID: 7406934	ENE/49.1	0.00	88
12	WWIS		1980 Baseline Road lot 35 con 1 Ottawa ON Well ID: 7329942	SE/50.8	0.00	89
13	WWIS		1980 BASELINE RD Ottawa ON Well ID: 7328523	NE/58.8	0.00	92
14	WWIS		1980 BASE LINE RD. NEPEAN ON	ENE/65.9	0.00	96

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7297590			
15	SPL	Kiewit Eurovia Vinci	Ottawa ON	WNW/67.8	-1.00	98
16	WWIS		1980 BASELINE RD. NEPEAN ON Well ID: 7297593	ENE/68.2	0.00	99
17	EHS		Woodroffe Ave & Baseline Rd Ottawa ON	W/69.2	-1.00	101
17	GEN	OTTAWA-CARLETON, REG'L MNCPLTY. OF	PARKN'RIDE FCLTY, WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	W/69.2	-1.00	102
17	GEN	OTTAWA-CARLTON, REG'L MNCPLTY. OF	PARKN'RIDE FCLTY, WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	W/69.2	-1.00	102
17	GEN	OTTAWA-CARLTON, REG'L (OUT OF BUSINESS)	PARKN'RIDE FCLTY, WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	W/69.2	-1.00	103
17	GEN	OTTAWA-CARLTON, REG'L MNCPLTY. OF 29-406	PARKN'RIDE FCLTY, WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	W/69.2	-1.00	104
17	GEN	OTTAWA-CARLTON (OUT OF BUSINESS)	PARK N' RIDE FACILITY WOODROFFE AVENUE & BASELINE ROAD NEPEAN ON	W/69.2	-1.00	105
18	SPL	UNITED CO-OP	WOODROFFE AVE/HWY #16 TANK TRUCK (CARGO) OTTAWA CITY ON	W/69.2	-1.00	106
18	SPL	OTTAWA-CARLETON, R.M. OF	INTERSECTION OF HWY # 16 AND WOODROFFE AVE. SANITARY SEWER SYSTEM NEPEAN CITY ON	W/69.2	-1.00	107
18	SPL	OTTAWA-CARLETON, R.M. OF	HWY 16 AND WOODRUFF AVE. SANITARY SEWER SYSTEM NEPEAN CITY ON	W/69.2	-1.00	108

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>18</u>	SPL	OTTAWA-CARLETON, R.M. OF	100 M FROM WOODROOFE AND HWY 16. SANITARY SEWER SYSTEM OTTAWA ON	W/69.2	-1.00	<u>109</u>
<u>18</u>	SPL	City of Ottawa	Baseline & Woodroffe Ave Ottawa ON	W/69.2	-1.00	<u>110</u>
<u>18</u>	SPL	Kiewit Eurovia Vinci; Badger Daylighting Ottawa Ltd.	Intersection of Baseline Rd. & Woodruff Ave. Ottawa ON	W/69.2	-1.00	<u>111</u>
<u>18</u>	SPL	Kiewit Eurovia Vinci	Baseline and Woodruff Ottawa ON	W/69.2	-1.00	<u>112</u>
<u>18</u>	SPL	KIEWIT EUROVIA VINCI	Baseline road and Woodroffe, Ottawa OTTAWA ON	W/69.2	-1.00	<u>113</u>
<u>19</u>	BORE		ON	N/71.3	0.00	<u>113</u>
<u>20</u>	WWIS		1980 Baseline Rd Ottawa ON Well ID: 7346097	ENE/73.1	0.00	<u>115</u>
<u>21</u>	WWIS		1980 BASELINE RD. OTTAWA ON Well ID: 7296610	NE/75.3	0.00	<u>117</u>
<u>22</u>	WWIS		1980 BASELINE RD. NEPEAN ON Well ID: 7297588	ENE/78.9	0.00	<u>120</u>
<u>23</u>	WWIS		1980 Baseline Rd Ottawa ON Well ID: 7346095	E/78.9	0.54	<u>122</u>
<u>24</u>	WWIS		1980 BASE LINE RD. NEPEAN ON Well ID: 7297592	ENE/79.7	0.00	<u>124</u>
<u>25</u>	WWIS		1980 Baseline Rd KANATA ON Well ID: 7346096	ENE/81.7	0.00	<u>126</u>
<u>26</u>	WWIS		1980 BASELINE ROAD lot 35 con 1 Ottawa ON Well ID: 7328522	E/83.6	1.00	<u>129</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
27	WWIS		1980 BASE LINE RD. NEPEAN ON Well ID: 7297589	ENE/83.9	0.00	132
28	WWIS		1980 BASE LINE RD. NEPEAN ON Well ID: 7297591	ENE/84.3	0.00	134
29	SPL		45.3506963, - 75.7628639 OTTAWA ON	WSW/87.6	0.00	137
30	BORE		ON	WSW/88.0	0.00	137
31	WWIS		1980 BASELINE RD. OTTAWA ON Well ID: 7296608	ENE/90.1	0.31	140
32	WWIS		1980 BASELINE AVE lot 35 con 1 Ottawa ON Well ID: 7328499	ESE/91.2	1.00	142
33	WWIS		ON Well ID: 7189220	WNW/91.7	-1.00	146
34	SPL	Kiewit Eurovia Vinci	Ottawa ON	W/92.4	-1.00	146
35	WWIS		1980 BASELINE RD. OTTAWA ON Well ID: 7296609	E/92.5	1.00	147
36	BORE		ON	NNE/94.8	0.00	150
37	WWIS		ON Well ID: 1509083	WNW/95.0	-1.00	151
38	WWIS		1980 Baseline Rd Ottawa ON Well ID: 7346094	ESE/96.9	1.00	154
39	WWIS		1980 BASE LINE RD lot 35 con 1 NEPEAN ON Well ID: 1535159	E/103.5	1.00	156

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>40</u>	GEN	LIQUOR CONTROL BOARD OF ONTARIO	LCBO STORE #431 1379 WOODROFFE AVE. NEPEAN ON K2G 1V7	SSE/103.7	0.20	<u>159</u>
<u>40</u>	GEN	LIQUOR CONTROL BOARD OF ONTARIO	LCBO STORE #431 1379 WOODROFFE AVENUE NEPEAN ON K2G 1V7	SSE/103.7	0.20	<u>159</u>
<u>40</u>	EHS		1379 Woodroffe Ave Ottawa ON K2G1V7	SSE/103.7	0.20	<u>160</u>
<u>41</u>	WWIS		1980 Baseline Ottawa ON Well ID: 7382679	ENE/109.3	0.00	<u>160</u>
<u>42</u>	WWIS		1980 BASELINE RD OTTAWA ON Well ID: 7272050	ENE/111.2	0.00	<u>162</u>
<u>43</u>	WWIS		1980 baeline lot 35 con 1 Ottawa ON Well ID: 7328585	E/111.4	1.00	<u>165</u>
<u>44</u>	WWIS		1980 BASELINE ROAD Ottawa ON Well ID: 7328501	ENE/113.2	0.00	<u>168</u>
<u>45</u>	WWIS		1980 Baseline Road lot 35 con 1 Ottawa ON Well ID: 7329944	ESE/114.1	1.00	<u>172</u>
<u>46</u>	BORE		ON	NW/123.1	-1.00	<u>175</u>
<u>47</u>	WWIS		1980 BASELINE lot 35 con 1 OTTAWA ON Well ID: 7328571	E/123.7	1.00	<u>176</u>
<u>48</u>	WWIS		ON Well ID: 7406937	E/124.1	1.00	<u>180</u>
<u>49</u>	WWIS		ON Well ID: 1507889	NNE/125.0	0.00	<u>181</u>
<u>50</u>	WWIS		ON Well ID: 7406933	SSE/127.8	0.95	<u>183</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
51	WWIS		1980 BASELINE ROAD lot 35 con 1 Ottawa ON Well ID: 7328500	E/129.1	1.00	184
52	WWIS		1980 Baseline Rd Ottawa ON Well ID: 7346093	ESE/131.9	1.00	187
53	WWIS		1980 BASELINE ROAD lot 35 con 2 OTTAWA ON Well ID: 7328553	SSE/136.1	0.95	189
54	WWIS		ON Well ID: 7406939	ENE/143.9	1.03	193
55	WWIS		1980 Baseline Rd Ottawa ON Well ID: 7346090	ESE/144.3	1.00	193
56	WWIS		ON Well ID: 7406935	E/144.6	1.00	196
57	GEN	ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE/150.1	0.00	197
57	GEN	ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE/150.1	0.00	197
57	GEN	ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON	NE/150.1	0.00	198
57	GEN	ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE/150.1	0.00	198
57	GEN	ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE/150.1	0.00	199
57	GEN	ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE/150.1	0.00	199
57	GEN	ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE/150.1	0.00	200

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>57</u>	GEN	ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE/150.1	0.00	<u>200</u>
<u>57</u>	GEN	ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE/150.1	0.00	<u>201</u>
<u>57</u>	GEN	ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON	NE/150.1	0.00	<u>201</u>
<u>57</u>	GEN	Algonquin Animal Hospital	1945 Baseline Road Ottawa ON	NE/150.1	0.00	<u>205</u>
<u>58</u>	GEN	ALGONQUIN ANIMAL HOSPITAL	1369 WOODROFE AVENUE NEPEAN ON K2G 1V7	SSE/150.9	0.31	<u>205</u>
<u>58</u>	GEN	ALGONQUIN ANIMAL HOSPITAL 02-224	1369 WOODROFE AVENUE NEPEAN ON K2G 1V7	SSE/150.9	0.31	<u>206</u>
<u>59</u>	EHS		1850 Baseline Rd Ottawa ON K2C 3Z6	ESE/157.5	1.00	<u>206</u>
<u>60</u>	WWIS		BEL-AIR PARK lot 26 con 2 Ottawa ON Well ID: 7318407	NNW/157.9	-1.00	<u>206</u>
<u>61</u>	WWIS		ON Well ID: 7387054	SSE/158.1	0.31	<u>209</u>
<u>62</u>	WWIS		1980 BASELINE RD lot 35 con 1 Ottawa ON Well ID: 7328502	ESE/163.8	1.00	<u>210</u>
<u>63</u>	SPL	KIEWIT EUROVIA VINCI OTTAWA PARTERSHIP	OTTAWA ON	SSW/164.0	0.00	<u>213</u>
<u>64</u>	WWIS		ON Well ID: 7406940	SE/164.8	1.00	<u>214</u>
<u>65</u>	WWIS		1980 Baseline Road Ottawa ON Well ID: 7337704	ESE/165.2	1.00	<u>215</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>66</u>	WWIS		1980 Baseline Road lot 35 con 1 Ottawa ON Well ID: 7329945	E/166.0	1.00	<u>218</u>
<u>67</u>	WWIS		1980 Baseline Rd Ottawa ON Well ID: 7346092	ESE/167.0	1.00	<u>222</u>
<u>68</u>	WWIS		ON Well ID: 7413187	E/169.0	1.00	<u>224</u>
<u>69</u>	GEN	Kiewit-Eurovia-VINCI, Ottawa Partnership	1370 Woodroffe Ave Ottawa ON K2G 4S7	SSW/170.6	0.00	<u>225</u>
<u>69</u>	GEN	Kiewit-Eurovia-VINCI, Ottawa Partnership	1370 Woodroffe Ave Ottawa ON K2G 4S7	SSW/170.6	0.00	<u>225</u>
<u>69</u>	GEN	KIEWIT/EUROVIA/VINCI PARTNERSHIP	1370 Woodroffe Ave Ottawa ON	SSW/170.6	0.00	<u>226</u>
<u>69</u>	SPL		1370 Woodroffe Ave, Ottawa OTTAWA ON	SSW/170.6	0.00	<u>229</u>
<u>70</u>	WWIS		1980 baeline Ottawa ON Well ID: 7328586	ESE/171.0	1.00	<u>230</u>
<u>71</u>	WWIS		1980 basline Ottawa ON Well ID: 7328582	ESE/172.6	1.00	<u>233</u>
<u>72</u>	WWIS		1980 Baseline Rd Ottawa ON Well ID: 7346091	ESE/174.6	1.00	<u>235</u>
<u>73</u>	WWIS		ON Well ID: 7406938	E/174.7	1.00	<u>237</u>
<u>74</u>	GEN	Loblaws Inc.	1980 Baseline Rd. Nepean ON	ENE/176.0	0.31	<u>238</u>
<u>75</u>	WWIS		1980 BASELINE lot 35 con 1 Ottawa ON Well ID: 7328503	SE/176.2	1.00	<u>247</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
76	WWIS		1980 BASELINE ROAD lot 35 con 1 OTTAWA ON <i>Well ID:</i> 7328572	SE/178.4	1.00	251
77	BORE		ON	SE/182.5	1.00	254
78	WWIS		lot 35 con 1 ON <i>Well ID:</i> 1505882	SE/182.6	1.00	255
79	ECA	City of Ottawa	Southwest Transitway at Baseline Rd Ottawa ON K2G 6J8	WSW/182.8	-1.69	258
80	SPL		45.350506, -75.764057 OTTAWA ON	WSW/183.7	-1.00	258
81	WWIS		1980 BASELINE RD OTTAWA ON <i>Well ID:</i> 7272051	ESE/185.2	1.00	259
82	NPCB	LANDAWN SHOPPING CENTRE LTD.	1375 WOODROFFE AVENUE NEPEAN ON K2G 1V7	SSE/185.4	1.00	262
83	SPL		Experimental Farm Pathway, Ottawa, ON K2C 2T7 OTTAWA ON	NNW/185.4	-1.00	262
84	WWIS		ON <i>Well ID:</i> 7406936	E/186.3	1.00	263
85	WWIS		lot 35 con 1 ON <i>Well ID:</i> 1505881	SE/186.6	1.00	264
86	SPL		45.35295849 -75.7631379 OTTAWA ON	NW/190.5	-1.00	266
87	WWIS		ON <i>Well ID:</i> 1509082	NW/196.5	-1.00	267
88	WWIS		BASE LINE TRANSIT WAY OTTAWA ON <i>Well ID:</i> 7300713	SW/201.7	0.00	270

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>89</u>	EHS		1943 Baseline Rd. Ottawa ON K2C 0C7	NE/203.4	0.00	<u>273</u>
<u>89</u>	EHS		1943 BASELINE RD OTTAWA ON K2C 0C7	NE/203.4	0.00	<u>273</u>
<u>89</u>	EHS		1943 Baseline Rd Ottawa ON K2C 0C7	NE/203.4	0.00	<u>273</u>
<u>89</u>	EHS		1943 Baseline Road Ottawa ON K2C 0C7	NE/203.4	0.00	<u>273</u>
<u>89</u>	EHS		1943 Baseline Rd Ottawa ON K2C0C7	NE/203.4	0.00	<u>273</u>
<u>89</u>	EHS		1943 Baseline Rd Ottawa ON K2C0C7	NE/203.4	0.00	<u>274</u>
<u>90</u>	WWIS		ON Well ID: 7413186	E/205.3	1.00	<u>274</u>
<u>91</u>	WWIS		1980 BASELINE RD lot 35 con 1 OTTAWA ON Well ID: 7328570	ENE/211.9	1.00	<u>275</u>
<u>92</u>	EHS		1980 Baseline Road Ottawa ON K2C 3Y9	ENE/211.9	1.00	<u>278</u>
<u>93</u>	WWIS		ON Well ID: 1507860	W/213.7	-2.00	<u>278</u>
<u>94</u>	WWIS		1980 baseline rd lot 35 con 1 Ottawa ON Well ID: 7328632	ESE/216.4	1.00	<u>281</u>
<u>95</u>	WWIS		1980 basline lot 35 con 1 Ottawa ON Well ID: 7328583	E/219.3	2.00	<u>284</u>
<u>96</u>	WWIS		1980 Baseline Road Ottawa ON Well ID: 7337703	ESE/221.5	2.00	<u>287</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>97</u>	SPL		culvert near Transitway [45.3515083, -75.7649555] OTTAWA ON	W/224.5	-2.00	<u>290</u>
<u>98</u>	WWIS		ON Well ID: 1507887	ENE/226.0	1.00	<u>291</u>
<u>99</u>	EHS		Baseline Rd Ottawa ON	SSE/226.1	1.00	<u>294</u>
<u>100</u>	WWIS		1980 BASELINE RD OTTAWA ON Well ID: 7261828	ESE/228.9	1.69	<u>294</u>
<u>101</u>	SPL		45.349334, -75.762025 OTTAWA ON	S/230.6	1.00	<u>297</u>
<u>102</u>	SPL	UNKNOWN	1980 BASELINE ROAD NEPEAN CITY ON K2C 0C6	ENE/231.0	1.00	<u>298</u>
<u>102</u>	NPCB	LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON	ENE/231.0	1.00	<u>299</u>
<u>102</u>	PRT	TOP VALU GAS BAR BOB MITCHELL	1980 BASELINE RD OTTAWA ON K2C3Z4	ENE/231.0	1.00	<u>300</u>
<u>102</u>	PRT	C CORP (ONTARIO) INC ATTN ACCOUNTS PAYABLE	1980 BASELINE RD NEPEAN ON K2C3Z4	ENE/231.0	1.00	<u>301</u>
<u>102</u>	PES	LOBLAWS SUPERMARKETS LIMITED	1980 BASELINE ROAD OTTAWA ON K2C 0C6	ENE/231.0	1.00	<u>301</u>
<u>102</u>	PES	TOWERS DEPARTMENT STORE STORE #54	1980 BASE LINE ROAD NEPEAN ON K1C 2K3	ENE/231.0	1.00	<u>301</u>
<u>102</u>	RST	PIONEER PETROLEUMS	1980 BASE LINE RD OTTAWA ON K2C0C6	ENE/231.0	1.00	<u>301</u>
<u>102</u>	SPL	PRIVATE BUSINESS	SHOPPER CITY WEST EXCAVATION SITE, 1980 BASELINE ROAD STORAGE TANK OTTAWA CITY ON K2C 0C6	ENE/231.0	1.00	<u>302</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
102	EBR	Loblaw Properties Limited	1980 Baseline Road Ottawa Ontario Ottawa ON	ENE/231.0	1.00	303
102	EHS		1980 Baseline Rd. Nepean ON K2C 0C6	ENE/231.0	1.00	303
102	OPCB	LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE/231.0	1.00	303
102	OPCB	LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE/231.0	1.00	303
102	OPCB	LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE/231.0	1.00	304
102	OPCB	LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE/231.0	1.00	304
102	OPCB	LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE/231.0	1.00	304
102	PES	ZELLERS STORE #26	1980 BASE LINE ROAD NEPEAN ON K2C0C6	ENE/231.0	1.00	304
102	PES	LOBLAWS SUPERMARKETS LIMITED	1980 BASELINE ROAD OTTAWA ON K2C0C6	ENE/231.0	1.00	304
102	GEN	HARZENA HOLDINGS LIMITED	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	305
102	GEN	PHOTO QUICK	1980 BASELINE ROAD SHOPPERS CITY WEST NEPEAN ON K2C 0C6	ENE/231.0	1.00	305
102	EHS		1980 Baseline Road Ottawa ON K2C 0C6	ENE/231.0	1.00	306

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>102</u>	OPCB	LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE/231.0	1.00	<u>306</u>
<u>102</u>	GEN	LEIKIN GROUP INC.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	<u>306</u>
<u>102</u>	WWIS		1980 BASELINE RD NEPEAN ON Well ID: 1535160	ENE/231.0	1.00	<u>307</u>
<u>102</u>	EBR	Loblaw Properties Limited	1980 Baseline Road Ottawa Ontario Ottawa ON	ENE/231.0	1.00	<u>309</u>
<u>102</u>	SPL	Loblaws Supermarkets Limited	1980 Baseline Road Ottawa ON K2C 0C6	ENE/231.0	1.00	<u>310</u>
<u>102</u>	SPL		1980 Baseline Rd Ottawa ON K2C 0C6	ENE/231.0	1.00	<u>311</u>
<u>102</u>	PES	LOBLAWS SUPERMARKET LTD, STORE #1050	1980 BASELINE RD OTTAWA ON K2C 0C6	ENE/231.0	1.00	<u>311</u>
<u>102</u>	NPCB	LANDWAN SHOPPING CENRTE LTD.	1980 BASELINE ROAD NEPEAN ON	ENE/231.0	1.00	<u>312</u>
<u>102</u>	CA	Loblaw Properties Limited	1980 Baseline Road Ottawa ON K2C 0C6	ENE/231.0	1.00	<u>312</u>
<u>102</u>	CA	Loblaw Properties Limited	1980 Baseline Road Ottawa ON K2C 0C6	ENE/231.0	1.00	<u>312</u>
<u>102</u>	DTNK	PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON K2C 0C6	ENE/231.0	1.00	<u>313</u>
<u>102</u>	DTNK	TOP VALU GAS BAR BOB MITCHELL	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	<u>313</u>
<u>102</u>	DTNK	PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	<u>314</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
102	DTNK	PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	314
102	DTNK	PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	315
102	DTNK	PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	316
102	DTNK	PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	316
102	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	317
102	GEN	Loblaws, Store 1050	1980 Baseline Rd Ottawa ON K2C 0C6	ENE/231.0	1.00	317
102	PES	LOBLAWS SUPERMARKET LTD, STORE #1050	1980 BASELINE RD OTTAWA ON K2C 0C6	ENE/231.0	1.00	318
102	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	318
102	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	318
102	PES	LOBLAWS INC. #1050	1980 BASELINE RD OTTAWA ON K2COC6	ENE/231.0	1.00	319
102	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	319
102	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON	ENE/231.0	1.00	320

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>102</u>	EBR	Loblaw Properties Limited / Proprietes Loblaw Limitee	1980 Baseline Road Ottawa CITY OF OTTAWA ON	ENE/231.0	1.00	<u>321</u>
<u>102</u>	ECA	Loblaw Properties Limited / Proprietes Loblaw Limitee	1980 Baseline Rd Ottawa ON L6Y 5S5	ENE/231.0	1.00	<u>321</u>
<u>102</u>	INC		1980 BASELINE RD, OTTAWA ON	ENE/231.0	1.00	<u>321</u>
<u>102</u>	ECA	Loblaw Properties Limited	1980 Baseline Rd Ottawa ON M4T 2S5	ENE/231.0	1.00	<u>322</u>
<u>102</u>	ECA	Loblaw Properties Limited	1980 Baseline Rd Ottawa ON M4T 2S5	ENE/231.0	1.00	<u>322</u>
<u>102</u>	GEN	Loblaw Companies Inc	1980 Baseline Rd. Nepean ON K2C 0C6	ENE/231.0	1.00	<u>323</u>
<u>102</u>	GEN	Loblaw Companies Inc	1980 Baseline Rd. Nepean ON K2C 0C6	ENE/231.0	1.00	<u>324</u>
<u>102</u>	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	<u>325</u>
<u>102</u>	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	<u>325</u>
<u>102</u>	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	<u>326</u>
<u>102</u>	GEN	LOBLAWS INC.	1980 Baseline Rd. Nepean ON K2C 0C6	ENE/231.0	1.00	<u>326</u>
<u>102</u>	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	<u>329</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
102	PES	LOBLAWS INC. #1050	1980 BASELINE RD OTTAWA ON K2C0C6	ENE/231.0	1.00	330
102	PES	LOBLAWS INC. #1050	1980 BASELINE RD OTTAWA ON K2C0C6	ENE/231.0	1.00	330
102	PES	LOBLAWS SUPERMARKETS LIMITED	1980 BASELINE ROAD OTTAWA ON K2C0C6	ENE/231.0	1.00	330
102	PES	ZELLERS STORE #26	1980 BASE LINE ROAD NEPEAN ON K2C0C6	ENE/231.0	1.00	331
102	GEN	LOBLAWS INC.	1980 Baseline Rd. Nepean ON K2C 0C6	ENE/231.0	1.00	331
102	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	334
102	GEN	LOBLAWS INC.	1980 Baseline Rd. Nepean ON K2C 0C6	ENE/231.0	1.00	334
102	GEN	College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS CITY WEST OTTAWA ON K2C 0C6	ENE/231.0	1.00	337
102	GEN	LEIKIN GROUP INC. on behalf of COLLEGE SQUARE, FORMERLY SHOPPERSa€™ CITY	WEST COLLEGE SQUARE, 1980 BASELINE ROAD, FORMERLY SHOPPERS' CITY WEST OTTAWA ON	ENE/231.0	1.00	338
102	EXP	PIONEER ENERGY MANAGEMENT INC	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	341
102	EXP	PIONEER ENERGY MANAGEMENT INC	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	342
102	EXP	PIONEER ENERGY MANAGEMENT INC	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	342

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
102	EXP	PIONEER ENERGY MANAGEMENT INC	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	342
102	EXP	PIONEER ENERGY MANAGEMENT INC	1980 BASELINE RD OTTAWA ON	ENE/231.0	1.00	342
102	SPL	LOBLAW PROPERTIES LIMITED/PROPRIETES LOBLAW LIMITEE	Loblaws, 1980 Baseline Rd., Ottawa OTTAWA ON	ENE/231.0	1.00	343
104	SPL		45.353276, -75.760728 OTTAWA ON	NE/233.3	0.00	344
105	WWIS		1980 BASELINE OTTAWA ON <i>Well ID:</i> 7328581	ENE/233.6	1.00	344
106	WWIS		1980 BASELINE RD OTTAWA ON <i>Well ID:</i> 7261829	ENE/238.6	1.00	348
107	GEN	City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW/245.0	-2.00	351
107	GEN	City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW/245.0	-2.00	351
107	GEN	City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW/245.0	-2.00	352
107	GEN	City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW/245.0	-2.00	352
107	GEN	City of Ottawa	1300 Woodroffe Ave. Ottawa ON	WNW/245.0	-2.00	352
107	ECA	City of Ottawa	1300 Woodroffe Ave Carleton Ottawa ON K1P 1J1	WNW/245.0	-2.00	353
107	GEN	City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW/245.0	-2.00	353

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>107</u>	GEN	City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW/245.0	-2.00	<u>353</u>
<u>107</u>	GEN	City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW/245.0	-2.00	<u>354</u>
<u>107</u>	GEN	City of Ottawa Public Works	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW/245.0	-2.00	<u>354</u>
<u>107</u>	GEN	City of Ottawa Public Works	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW/245.0	-2.00	<u>354</u>
<u>107</u>	GEN	City of Ottawa Public Works	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW/245.0	-2.00	<u>355</u>
<u>107</u>	GEN	City of Ottawa Facility Operations Service	1300 Woodroffe Avenue Ottawa ON	WNW/245.0	-2.00	<u>355</u>
<u>108</u>	GEN	LAUNDRY LAND 24-960	1363 WOODROFFE AVENUE NEPEAN ON K2G 1V7	E/245.9	2.00	<u>358</u>
<u>108</u>	GEN	CLENNAWAY LTD.	1363 WOODROFFE NEPEAN ON K2G 1V7	E/245.9	2.00	<u>358</u>
<u>108</u>	GEN	LAUNDRY LINE 08-737	1363 WOODROFFE NEPEAN ON K2G 1V7	E/245.9	2.00	<u>359</u>
<u>108</u>	GEN	LAUNDRY LINE	1363 WOODROFFE NEPEAN ON K2G 1V7	E/245.9	2.00	<u>359</u>
<u>108</u>	GEN	Rexall Pharmacy Group Ltd.	1363B Woodroffe Avenue Nepean ON K2G 1V7	E/245.9	2.00	<u>360</u>
<u>108</u>	GEN	Pharma Plus Drugmarts Ltd	1363B Woodroffe Avenue Nepean ON K2G 1V7	E/245.9	2.00	<u>360</u>
<u>108</u>	GEN	Pharma Plus Drugmarts Ltd	1363B Woodroffe Avenue Nepean ON K2G 1V7	E/245.9	2.00	<u>360</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>108</u>	GEN	Rexall Pharmacy Group Ltd.	1363B Woodroffe Avenue Nepean ON K2G 1V7	E/245.9	2.00	<u>361</u>
<u>108</u>	GEN	Rexall Pharmacy Group Ltd.	1363B Woodroffe Avenue Nepean ON K2G 1V7	E/245.9	2.00	<u>361</u>
<u>108</u>	GEN	Rexall Pharmacy Group Ltd.	1363B Woodroffe Avenue Nepean ON K2G 1V7	E/245.9	2.00	<u>362</u>
<u>108</u>	GEN	Rexall Pharmacy Group Ltd	1363B Woodroffe Avenue Nepean ON	E/245.9	2.00	<u>362</u>
<u>109</u>	SPL	ONTARIO HYDRO	1307 WOODROOFE AVENUE TRANSFORMER OTTAWA CITY ON	NW/245.9	-1.69	<u>365</u>
<u>109</u>	EBR	Hydro One Networks Inc.	1307 Woodroffe Avenue Ottawa CITY OF OTTAWA ON	NW/245.9	-1.69	<u>366</u>
<u>109</u>	CA	Hydro One Networks Inc.	1307 Woodroffe Ave Ottawa ON	NW/245.9	-1.69	<u>366</u>
<u>109</u>	CA	Hydro One Networks Inc.	1307 Woodroffe Ave Ottawa ON	NW/245.9	-1.69	<u>367</u>
<u>109</u>	GEN	Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	NW/245.9	-1.69	<u>367</u>
<u>109</u>	GEN	Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	NW/245.9	-1.69	<u>367</u>
<u>109</u>	GEN	Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	NW/245.9	-1.69	<u>368</u>
<u>109</u>	GEN	Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	NW/245.9	-1.69	<u>368</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>109</u>	GEN	Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	NW/245.9	-1.69	<u>369</u>
<u>109</u>	ECA	Hydro One Networks Inc.	1307 Woodroffe Ave Ottawa ON M5G 2P5	NW/245.9	-1.69	<u>369</u>
<u>109</u>	ECA	Hydro One Networks Inc.	1307 Woodroffe Ave Ottawa ON M5G 2P5	NW/245.9	-1.69	<u>369</u>
<u>109</u>	GEN	Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	NW/245.9	-1.69	<u>370</u>
<u>109</u>	GEN	Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	NW/245.9	-1.69	<u>370</u>
<u>109</u>	GEN	Hydro One Networks Inc.	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	NW/245.9	-1.69	<u>370</u>
<u>109</u>	GEN	Hydro One Networks Inc.	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	NW/245.9	-1.69	<u>371</u>
<u>109</u>	GEN	Hydro One Networks Inc.	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	NW/245.9	-1.69	<u>371</u>
<u>109</u>	GEN	Hydro One Networks Inc.	Woodroffe Transformer Station, 1307 Woodroffe Avenue Ottawa ON	NW/245.9	-1.69	<u>372</u>
<u>110</u>	GEN	Hydro Ottawa	1299 Woodroffe Ave Ottawa ON K2C 2T7	NNW/248.1	-1.00	<u>374</u>
<u>111</u>	SCT	Echo Dental Lab Ltd.	1915 Baseline Rd Unit 1 Ottawa ON K2C 0C7	NE/248.6	1.00	<u>375</u>
<u>111</u>	INC		2-1915 Baseline Road, Ottawa ON	NE/248.6	1.00	<u>375</u>

Executive Summary: Summary By Data Source

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 5 BORE site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	N	71.33	<u>19</u>
	ON	WSW	87.97	<u>30</u>
	ON	NNE	94.83	<u>36</u>
	ON	SE	182.49	<u>77</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	NW	123.12	<u>46</u>

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 4 CA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Loblaw Properties Limited	1980 Baseline Road Ottawa ON K2C 0C6	ENE	231.05	<u>102</u>
Loblaw Properties Limited	1980 Baseline Road Ottawa ON K2C 0C6	ENE	231.05	<u>102</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Hydro One Networks Inc.	1307 Woodroffe Ave Ottawa ON	NW	245.93	109
Hydro One Networks Inc.	1307 Woodroffe Ave Ottawa ON	NW	245.93	109

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Oct 2023 has found that there are 7 DTNK site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON K2C 0C6	ENE	231.05	102
TOP VALU GAS BAR BOB MITCHELL	1980 BASELINE RD OTTAWA ON	ENE	231.05	102
PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON	ENE	231.05	102
PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON	ENE	231.05	102
PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON	ENE	231.05	102
PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON	ENE	231.05	102
PIONEER ENERGY MANAGEMENT INC.	1980 BASELINE RD OTTAWA ON	ENE	231.05	102

EBR - Environmental Registry

A search of the EBR database, dated 1994 - Jun 30, 2025 has found that there are 4 EBR site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Loblaw Properties Limited	1980 Baseline Road Ottawa Ontario Ottawa ON	ENE	231.05	102
Loblaw Properties Limited / Proprietes Loblaw Limitee	1980 Baseline Road Ottawa CITY OF OTTAWA ON	ENE	231.05	102
Loblaw Properties Limited	1980 Baseline Road Ottawa Ontario Ottawa ON	ENE	231.05	102
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Hydro One Networks Inc.	1307 Woodroffe Avenue Ottawa CITY OF OTTAWA ON	NW	245.93	109

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011 - Jun 30, 2025 has found that there are 7 ECA site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Loblaw Properties Limited	1980 Baseline Rd Ottawa ON M4T 2S5	ENE	231.05	102
Loblaw Properties Limited	1980 Baseline Rd Ottawa ON M4T 2S5	ENE	231.05	102
Loblaw Properties Limited / Proprietes Loblaw Limitee	1980 Baseline Rd Ottawa ON L6Y 5S5	ENE	231.05	102
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
City of Ottawa	Southwest Transitway at Baseline Rd Ottawa ON K2G 6J8	WSW	182.82	79

City of Ottawa	1300 Woodroffe Ave Carleton Ottawa ON K1P 1J1	WNW	245.04	107
Hydro One Networks Inc.	1307 Woodroffe Ave Ottawa ON M5G 2P5	NW	245.93	109
Hydro One Networks Inc.	1307 Woodroffe Ave Ottawa ON M5G 2P5	NW	245.93	109

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Aug 31, 2024 has found that there are 14 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1379 Woodroffe Ave Ottawa ON K2G1V7	SSE	103.71	40
	1850 Baseline Rd Ottawa ON K2C 3Z6	ESE	157.46	59
	1943 Baseline Rd. Ottawa ON K2C 0C7	NE	203.42	89
	1943 BASELINE RD OTTAWA ON K2C 0C7	NE	203.42	89
	1943 Baseline Rd Ottawa ON K2C 0C7	NE	203.42	89
	1943 Baseline Road Ottawa ON K2C 0C7	NE	203.42	89
	1943 Baseline Rd Ottawa ON K2C0C7	NE	203.42	89
	1943 Baseline Rd Ottawa ON K2C0C7	NE	203.42	89

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1980 Baseline Road Ottawa ON K2C 3Y9	ENE	211.87	92
	Baseline Rd Ottawa ON	SSE	226.06	99
	1980 Baseline Road Ottawa ON K2C 0C6	ENE	231.05	102
	1980 Baseline Rd. Nepean ON K2C 0C6	ENE	231.05	102
	1363,1365,1371,1379, 1381 Woodroffe Ave, 2301 Navaho Dr, 1850, 1900,1984, Baseline Rd Ottawa ON	E	231.80	103

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Woodroffe Ave & Baseline Rd Ottawa ON	W	69.17	17

EXP - List of Expired Fuels Safety Facilities

A search of the EXP database, dated Oct 2023 has found that there are 5 EXP site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PIONEER ENERGY MANAGEMENT INC	1980 BASELINE RD OTTAWA ON	ENE	231.05	102
PIONEER ENERGY MANAGEMENT INC	1980 BASELINE RD OTTAWA ON	ENE	231.05	102
PIONEER ENERGY MANAGEMENT INC	1980 BASELINE RD OTTAWA ON	ENE	231.05	102

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PIONEER ENERGY MANAGEMENT INC	1980 BASELINE RD OTTAWA ON	ENE	231.05	<u>102</u>
PIONEER ENERGY MANAGEMENT INC	1980 BASELINE RD OTTAWA ON	ENE	231.05	<u>102</u>

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Dec 31, 2024 has found that there are 80 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
LIQUOR CONTROL BOARD OF ONTARIO	LCBO STORE #431 1379 WOODROFFE AVE. NEPEAN ON K2G 1V7	SSE	103.71	<u>40</u>
LIQUOR CONTROL BOARD OF ONTARIO	LCBO STORE #431 1379 WOODROFFE AVENUE NEPEAN ON K2G 1V7	SSE	103.71	<u>40</u>
ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE	150.06	<u>57</u>
ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE	150.06	<u>57</u>
ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON	NE	150.06	<u>57</u>
ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE	150.06	<u>57</u>
ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE	150.06	<u>57</u>
ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE	150.06	<u>57</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE	150.06	<u>57</u>
ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE	150.06	<u>57</u>
ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON K2C 0C7	NE	150.06	<u>57</u>
ALGONQUIN ANIMAL HOSPITAL	1945 BASELINE ROAD OTTAWA ON	NE	150.06	<u>57</u>
Algonquin Animal Hospital	1945 Baseline Road Ottawa ON	NE	150.06	<u>57</u>
ALGONQUIN ANIMAL HOSPITAL	1369 WOODROFE AVENUE NEPEAN ON K2G 1V7	SSE	150.87	<u>58</u>
ALGONQUIN ANIMAL HOSPITAL 02-224	1369 WOODROFE AVENUE NEPEAN ON K2G 1V7	SSE	150.87	<u>58</u>
Kiewit-Eurovia-VINCI, Ottawa Partnership	1370 Woodroffe Ave Ottawa ON K2G 4S7	SSW	170.63	<u>69</u>
Kiewit-Eurovia-VINCI, Ottawa Partnership	1370 Woodroffe Ave Ottawa ON K2G 4S7	SSW	170.63	<u>69</u>
KIEWIT/EUROVIA/VINCI PARTNERSHIP	1370 Woodroffe Ave Ottawa ON	SSW	170.63	<u>69</u>
Loblaws Inc.	1980 Baseline Rd. Nepean ON	ENE	176.00	<u>74</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
HARZENA HOLDINGS LIMITED	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
PHOTO QUICK	1980 BASELINE ROAD SHOPPERS CITY WEST NEPEAN ON K2C 0C6	ENE	231.05	<u>102</u>
LEIKIN GROUP INC.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
Loblaws, Store 1050	1980 Baseline Rd Ottawa ON K2C 0C6	ENE	231.05	<u>102</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON	ENE	231.05	<u>102</u>
Loblaw Companies Inc	1980 Baseline Rd. Nepean ON K2C 0C6	ENE	231.05	<u>102</u>
Loblaw Companies Inc	1980 Baseline Rd. Nepean ON K2C 0C6	ENE	231.05	<u>102</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
LOBLAWS INC.	1980 Baseline Rd. Nepean ON K2C 0C6	ENE	231.05	<u>102</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
LOBLAWS INC.	1980 Baseline Rd. Nepean ON K2C 0C6	ENE	231.05	<u>102</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
LOBLAWS INC.	1980 Baseline Rd. Nepean ON K2C 0C6	ENE	231.05	<u>102</u>
College Square Properties Inc.	COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS CITY WEST OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
LEIKIN GROUP INC. on behalf of COLLEGE SQUARE, FORMERLY SHOPPERSa€™ CITY	WEST COLLEGE SQUARE, 1980 BASELINE ROAD, FORMERLY SHOPPERS' CITY WEST OTTAWA ON	ENE	231.05	<u>102</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Rexall Pharmacy Group Ltd.	1363B Woodroffe Avenue Nepean ON K2G 1V7	E	245.89	<u>108</u>
Rexall Pharmacy Group Ltd.	1363B Woodroffe Avenue Nepean ON K2G 1V7	E	245.89	<u>108</u>
Rexall Pharmacy Group Ltd	1363B Woodroffe Avenue Nepean ON	E	245.89	<u>108</u>
LAUNDRY LAND 24-960	1363 WOODROFFE AVENUE NEPEAN ON K2G 1V7	E	245.89	<u>108</u>
CLENNAWAY LTD.	1363 WOODROFFE NEPEAN ON K2G 1V7	E	245.89	<u>108</u>
LAUNDRY LINE 08-737	1363 WOODROFFE NEPEAN ON K2G 1V7	E	245.89	<u>108</u>
LAUNDRY LINE	1363 WOODROFFE NEPEAN ON K2G 1V7	E	245.89	<u>108</u>
Rexall Pharmacy Group Ltd.	1363B Woodroffe Avenue Nepean ON K2G 1V7	E	245.89	<u>108</u>
Pharma Plus Drugmarts Ltd	1363B Woodroffe Avenue Nepean ON K2G 1V7	E	245.89	<u>108</u>
Pharma Plus Drugmarts Ltd	1363B Woodroffe Avenue Nepean ON K2G 1V7	E	245.89	<u>108</u>
Rexall Pharmacy Group Ltd.	1363B Woodroffe Avenue Nepean ON K2G 1V7	E	245.89	<u>108</u>

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>

OTTAWA-CARLETON, REG'L MNCPLTY. OF	PARKN'RIDE FCLTY,WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	W	69.17	17
OTTAWA-CARLTON, REG'L MNCPLTY. OF	PARKN'RIDE FCLTY,WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	W	69.17	17
OTTAWA-CARLTON, REG'L (OUT OF BUSINESS)	PARKN'RIDE FCLTY,WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	W	69.17	17
OTTAWA-CARLTON, REG'L MNCPLTY. OF 29-406	PARKN'RIDE FCLTY,WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	W	69.17	17
OTTAWA-CARLTON (OUT OF BUSINESS)	PARK N' RIDE FACILITY WOODROFFE AVENUE & BASELINE ROAD NEPEAN ON	W	69.17	17
City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW	245.04	107
City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW	245.04	107
City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW	245.04	107
City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW	245.04	107
City of Ottawa	1300 Woodroffe Ave. Ottawa ON	WNW	245.04	107
City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW	245.04	107
City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW	245.04	107

City of Ottawa	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW	245.04	107
City of Ottawa Public Works	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW	245.04	107
City of Ottawa Public Works	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW	245.04	107
City of Ottawa Public Works	1300 Woodroffe Ave. Ottawa ON K2C 3X4	WNW	245.04	107
City of Ottawa Facility Operations Service	1300 Woodroffe Avenue Ottawa ON	WNW	245.04	107
Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	NW	245.93	109
Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	NW	245.93	109
Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	NW	245.93	109
Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	NW	245.93	109
Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	NW	245.93	109
Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	NW	245.93	109
Hydro One Networks Inc	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	NW	245.93	109

Hydro One Networks Inc.	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	NW	245.93	109
Hydro One Networks Inc.	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	NW	245.93	109
Hydro One Networks Inc.	Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	NW	245.93	109
Hydro One Networks Inc.	Woodroffe Transformer Station, 1307 Woodroffe Avenue Ottawa ON	NW	245.93	109
Hydro Ottawa	1299 Woodroffe Ave Ottawa ON K2C 2T7	NNW	248.13	110

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated 31 Oct, 2023 has found that there are 2 INC site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1980 BASELINE RD, OTTAWA ON	ENE	231.05	102
	2-1915 Baseline Road, Ottawa ON	NE	248.63	111

NPCB - National PCB Inventory

A search of the NPCB database, dated 1988-2008* has found that there are 3 NPCB site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
LANDAWN SHOPPING CENTRE LTD.	1375 WOODROFFE AVENUE NEPEAN ON K2G 1V7	SSE	185.37	82
LANDWAN SHOPPING CENRTE LTD.	1980 BASELINE ROAD NEPEAN ON	ENE	231.05	102

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON	ENE	231.05	102

OPCB - Inventory of PCB Storage Sites

A search of the OPCB database, dated 1987-Oct 2004; 2012-Dec 2013 has found that there are 6 OPCB site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE	231.05	102
LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE	231.05	102
LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE	231.05	102
LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE	231.05	102
LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE	231.05	102
LANDAWN SHOPPING CENTRE LTD.	1980 BASELINE ROAD NEPEAN ON K2C 0C6	ENE	231.05	102

PES - Pesticide Register

A search of the PES database, dated Oct 2011 - Jun 30, 2025 has found that there are 11 PES site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
TOWERS DEPARTMENT STORE STORE #54	1980 BASE LINE ROAD NEPEAN ON K1C 2K3	ENE	231.05	102

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
ZELLERS STORE #26	1980 BASE LINE ROAD NEPEAN ON K2C0C6	ENE	231.05	<u>102</u>
LOBLAWS SUPERMARKETS LIMITED	1980 BASELINE ROAD OTTAWA ON K2C0C6	ENE	231.05	<u>102</u>
LOBLAWS SUPERMARKET LTD, STORE #1050	1980 BASELINE RD OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
LOBLAWS SUPERMARKETS LIMITED	1980 BASELINE ROAD OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
LOBLAWS SUPERMARKET LTD, STORE #1050	1980 BASELINE RD OTTAWA ON K2C 0C6	ENE	231.05	<u>102</u>
LOBLAWS INC. #1050	1980 BASELINE RD OTTAWA ON K2C0C6	ENE	231.05	<u>102</u>
ZELLERS STORE #26	1980 BASE LINE ROAD NEPEAN ON K2C0C6	ENE	231.05	<u>102</u>
LOBLAWS INC. #1050	1980 BASELINE RD OTTAWA ON K2C0C6	ENE	231.05	<u>102</u>
LOBLAWS INC. #1050	1980 BASELINE RD OTTAWA ON K2C0C6	ENE	231.05	<u>102</u>
LOBLAWS SUPERMARKETS LIMITED	1980 BASELINE ROAD OTTAWA ON K2C0C6	ENE	231.05	<u>102</u>

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 2 PRT site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
TOP VALU GAS BAR BOB MITCHELL	1980 BASELINE RD OTTAWA ON K2C3Z4	ENE	231.05	102
C CORP (ONTARIO) INC ATTN ACCOUNTS PAYABLE	1980 BASELINE RD NEPEAN ON K2C3Z4	ENE	231.05	102

RST - Retail Fuel Storage Tanks

A search of the RST database, dated 1999-Apr 30, 2025 has found that there are 1 RST site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
PIONEER PETROLEUMS	1980 BASE LINE RD OTTAWA ON K2C0C6	ENE	231.05	102

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 1 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Echo Dental Lab Ltd.	1915 Baseline Rd Unit 1 Ottawa ON K2C 0C7	NE	248.63	111

SPL - Ontario Spills

A search of the SPL database, dated 1988-Jun 2024; Aug; Oct-Apr 2025 has found that there are 25 SPL site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	45.3506963, - 75.7628639 OTTAWA ON	WSW	87.60	29
KIEWIT EUROVIA VINCI OTTAWA PARTERSHIP	OTTAWA ON	SSW	164.02	63
	1370 Woodroffe Ave, Ottawa OTTAWA ON	SSW	170.63	69

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	45.349334, -75.762025 OTTAWA ON	S	230.65	<u>101</u>
Loblaws Supermarkets Limited	1980 Baseline Road Ottawa ON K2C 0C6	ENE	231.05	<u>102</u>
	1980 Baseline Rd Ottawa ON K2C 0C6	ENE	231.05	<u>102</u>
UNKNOWN	1980 BASELINE ROAD NEPEAN CITY ON K2C 0C6	ENE	231.05	<u>102</u>
LOBLAW PROPERTIES LIMITED/PROPRIETES LOBLAW LIMITEE	Loblaws, 1980 Baseline Rd., Ottawa OTTAWA ON	ENE	231.05	<u>102</u>
PRIVATE BUSINESS	SHOPPER CITY WEST EXCAVATION SITE, 1980 BASELINE ROAD STORAGE TANK OTTAWA CITY ON K2C 0C6	ENE	231.05	<u>102</u>
	45.353276, -75.760728 OTTAWA ON	NE	233.33	<u>104</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
Kiewit Eurovia Vinci	Ottawa ON	WNW	67.84	<u>15</u>
UNITED CO-OP	WOODROFFE AVE/HWY #16 TANK TRUCK (CARGO) OTTAWA CITY ON	W	69.19	<u>18</u>
OTTAWA-CARLETON, R.M. OF	INTERSECTION OF HWY # 16 AND WOODROFFE AVE. SANITARY SEWER SYSTEM NEPEAN CITY ON	W	69.19	<u>18</u>

OTTAWA-CARLETON, R.M. OF	HWY 16 AND WOODRUFF AVE. SANITARY SEWER SYSTEM NEPEAN CITY ON	W	69.19	<u>18</u>
OTTAWA-CARLETON, R.M. OF	100 M FROM WOODROOFE AND HWY 16. SANITARY SEWER SYSTEM OTTAWA ON	W	69.19	<u>18</u>
City of Ottawa	Baseline & Woodroffe Ave Ottawa ON	W	69.19	<u>18</u>
Kiewit Eurovia Vinci; Badger Daylighting Ottawa Ltd.	Intersection of Baseline Rd. & Woodruff Ave. Ottawa ON	W	69.19	<u>18</u>
Kiewit Eurovia Vinci	Baseline and Woodruff Ottawa ON	W	69.19	<u>18</u>
KIEWIT EUROVIA VINCI	Baseline road and Woodroffe, Ottawa OTTAWA ON	W	69.19	<u>18</u>
Kiewit Eurovia Vinci	Ottawa ON	W	92.36	<u>34</u>
	45.350506, -75.764057 OTTAWA ON	WSW	183.66	<u>80</u>
	Experimental Farm Pathway, Ottawa, ON K2C 2T7 OTTAWA ON	NNW	185.40	<u>83</u>
	45.35295849 -75.7631379 OTTAWA ON	NW	190.55	<u>86</u>
	culvert near Transitway [45.3515083, -75.7649555] OTTAWA ON	W	224.46	<u>97</u>
ONTARIO HYDRO	1307 WOODROOFE AVENUE TRANSFORMER OTTAWA CITY ON	NW	245.93	<u>109</u>

WWIS - Water Well Information System

A search of the WWIS database, dated Dec 31 2023 has found that there are 77 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1980 Baseline Road lot 35 con 1 Ottawa ON <i>Well ID: 7329943</i>	NNE	21.24	<u>1</u>
	1980 Baseline Road lot 35 con 2 Ottawa ON <i>Well ID: 7329941</i>	WSW	21.28	<u>2</u>
	1984 BASELINE ROAD Ottawa ON <i>Well ID: 7328524</i>	NNE	22.40	<u>3</u>
	1984 BASELINE ROAD Ottawa ON <i>Well ID: 7328525</i>	NE	26.96	<u>4</u>
	1980 baeline lot 35 con 1 Ottawa ON <i>Well ID: 7328587</i>	E	31.49	<u>5</u>
	1980 BASELINE RD. OTTAWA ON <i>Well ID: 7296611</i>	NNE	39.86	<u>6</u>
	1980 BASELINE ROAD lot 35 con 1 OTTAWA ON <i>Well ID: 7328552</i>	E	40.38	<u>7</u>
	1980 BASELINE ROAD lot 35 con 1 Ottawa ON <i>Well ID: 7328498</i>	E	42.34	<u>9</u>
	1980 BASELINE ROAD Ottawa ON <i>Well ID: 7328504</i>	NE	42.69	<u>10</u>
	ON <i>Well ID: 7406934</i>	ENE	49.07	<u>11</u>
	1980 Baseline Road lot 35 con 1 Ottawa ON	SE	50.83	<u>12</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	<i>Well ID:</i> 7329942			
	1980 BASELINE RD Ottawa ON	NE	58.80	<u>13</u>
	<i>Well ID:</i> 7328523			
	1980 BASE LINE RD. NEPEAN ON	ENE	65.89	<u>14</u>
	<i>Well ID:</i> 7297590			
	1980 BASELINE RD. NEPEAN ON	ENE	68.19	<u>16</u>
	<i>Well ID:</i> 7297593			
	1980 Baseline Rd Ottawa ON	ENE	73.13	<u>20</u>
	<i>Well ID:</i> 7346097			
	1980 BASELINE RD. OTTAWA ON	NE	75.34	<u>21</u>
	<i>Well ID:</i> 7296610			
	1980 BASELINE RD. NEPEAN ON	ENE	78.93	<u>22</u>
	<i>Well ID:</i> 7297588			
	1980 Baseline Rd Ottawa ON	E	78.94	<u>23</u>
	<i>Well ID:</i> 7346095			
	1980 BASE LINE RD. NEPEAN ON	ENE	79.66	<u>24</u>
	<i>Well ID:</i> 7297592			
	1980 Baseline Rd KANATA ON	ENE	81.70	<u>25</u>
	<i>Well ID:</i> 7346096			
	1980 BASELINE ROAD lot 35 con 1 Ottawa ON	E	83.56	<u>26</u>
	<i>Well ID:</i> 7328522			
	1980 BASE LINE RD. NEPEAN ON	ENE	83.86	<u>27</u>
	<i>Well ID:</i> 7297589			


<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1980 BASE LINE RD. NEPEAN ON	ENE	84.30	<u>28</u>
	Well ID: 7297591			
	1980 BASELINE RD. OTTAWA ON	ENE	90.13	<u>31</u>
	Well ID: 7296608			
	1980 BASELINE AVE lot 35 con 1 Ottawa ON	ESE	91.17	<u>32</u>
	Well ID: 7328499			
	1980 BASELINE RD. OTTAWA ON	E	92.53	<u>35</u>
	Well ID: 7296609			
	1980 Baseline Rd Ottawa ON	ESE	96.95	<u>38</u>
	Well ID: 7346094			
	1980 BASE LINE RD lot 35 con 1 NEPEAN ON	E	103.49	<u>39</u>
	Well ID: 1535159			
	1980 Baseline Ottawa ON	ENE	109.34	<u>41</u>
	Well ID: 7382679			
	1980 BASELINE RD OTTAWA ON	ENE	111.15	<u>42</u>
	Well ID: 7272050			
	1980 baeline lot 35 con 1 Ottawa ON	E	111.37	<u>43</u>
	Well ID: 7328585			
	1980 BASELINE ROAD Ottawa ON	ENE	113.20	<u>44</u>
	Well ID: 7328501			
	1980 Baseline Road lot 35 con 1 Ottawa ON	ESE	114.10	<u>45</u>
	Well ID: 7329944			
	1980 BASELINE lot 35 con 1 OTTAWA ON	E	123.72	<u>47</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7328571			
	ON	E	124.13	<u>48</u>
	Well ID: 7406937			
	ON	NNE	124.98	<u>49</u>
	Well ID: 1507889			
	ON	SSE	127.77	<u>50</u>
	Well ID: 7406933			
	1980 BASELINE ROAD lot 35 con 1 Ottawa ON	E	129.11	<u>51</u>
	Well ID: 7328500			
	1980 Baseline Rd Ottawa ON	ESE	131.86	<u>52</u>
	Well ID: 7346093			
	1980 BASELINE ROAD lot 35 con 2 OTTAWA ON	SSE	136.08	<u>53</u>
	Well ID: 7328553			
	ON	ENE	143.89	<u>54</u>
	Well ID: 7406939			
	1980 Baseline Rd Ottawa ON	ESE	144.34	<u>55</u>
	Well ID: 7346090			
	ON	E	144.55	<u>56</u>
	Well ID: 7406935			
	ON	SSE	158.14	<u>61</u>
	Well ID: 7387054			
	1980 BASELINE RD lot 35 con 1 Ottawa ON	ESE	163.75	<u>62</u>
	Well ID: 7328502			

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	SE	164.80	<u>64</u>
	Well ID: 7406940			
	1980 Baseline Road Ottawa ON	ESE	165.21	<u>65</u>
	Well ID: 7337704			
	1980 Baseline Road lot 35 con 1 Ottawa ON	E	166.02	<u>66</u>
	Well ID: 7329945			
	1980 Baseline Rd Ottawa ON	ESE	167.05	<u>67</u>
	Well ID: 7346092			
	ON	E	169.04	<u>68</u>
	Well ID: 7413187			
	1980 baeline Ottawa ON	ESE	171.04	<u>70</u>
	Well ID: 7328586			
	1980 basline Ottawa ON	ESE	172.61	<u>71</u>
	Well ID: 7328582			
	1980 Baseline Rd Ottawa ON	ESE	174.62	<u>72</u>
	Well ID: 7346091			
	ON	E	174.71	<u>73</u>
	Well ID: 7406938			
	1980 BASELINE lot 35 con 1 Ottawa ON	SE	176.19	<u>75</u>
	Well ID: 7328503			
	1980 BASELINE ROAD lot 35 con 1 OTTAWA ON	SE	178.36	<u>76</u>
	Well ID: 7328572			
	lot 35 con 1 ON	SE	182.60	<u>78</u>

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 1505882			
	1980 BASELINE RD OTTAWA ON	ESE	185.18	<u>81</u>
	Well ID: 7272051			
	ON	E	186.34	<u>84</u>
	Well ID: 7406936			
	lot 35 con 1 ON	SE	186.58	<u>85</u>
	Well ID: 1505881			
	BASE LINE TRANSIT WAY OTTAWA ON	SW	201.74	<u>88</u>
	Well ID: 7300713			
	ON	E	205.27	<u>90</u>
	Well ID: 7413186			
	1980 BASELINE RD lot 35 con 1 OTTAWA ON	ENE	211.86	<u>91</u>
	Well ID: 7328570			
	1980 baseline rd lot 35 con 1 Ottawa ON	ESE	216.44	<u>94</u>
	Well ID: 7328632			
	1980 basline lot 35 con 1 Ottawa ON	E	219.26	<u>95</u>
	Well ID: 7328583			
	1980 Baseline Road Ottawa ON	ESE	221.53	<u>96</u>
	Well ID: 7337703			
	ON	ENE	226.04	<u>98</u>
	Well ID: 1507887			
	1980 BASELINE RD OTTAWA ON	ESE	228.93	<u>100</u>
	Well ID: 7261828			

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1980 BASELINE RD NEPEAN ON <i>Well ID:</i> 1535160	ENE	231.05	<u>102</u>
	1980 BASELINE OTTAWA ON <i>Well ID:</i> 7328581	ENE	233.59	<u>105</u>
	1980 BASELINE RD OTTAWA ON <i>Well ID:</i> 7261829	ENE	238.57	<u>106</u>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction</u>	<u>Distance (m)</u>	<u>Map Key</u>
	lot 35 con 2 ON <i>Well ID:</i> 1532165	WSW	42.14	<u>8</u>
	ON <i>Well ID:</i> 7189220	WNW	91.72	<u>33</u>
	ON <i>Well ID:</i> 1509083	WNW	94.98	<u>37</u>
	BEL-AIR PARK lot 26 con 2 Ottawa ON <i>Well ID:</i> 7318407	NNW	157.87	<u>60</u>
	ON <i>Well ID:</i> 1509082	NW	196.52	<u>87</u>
	ON <i>Well ID:</i> 1507860	W	213.72	<u>93</u>

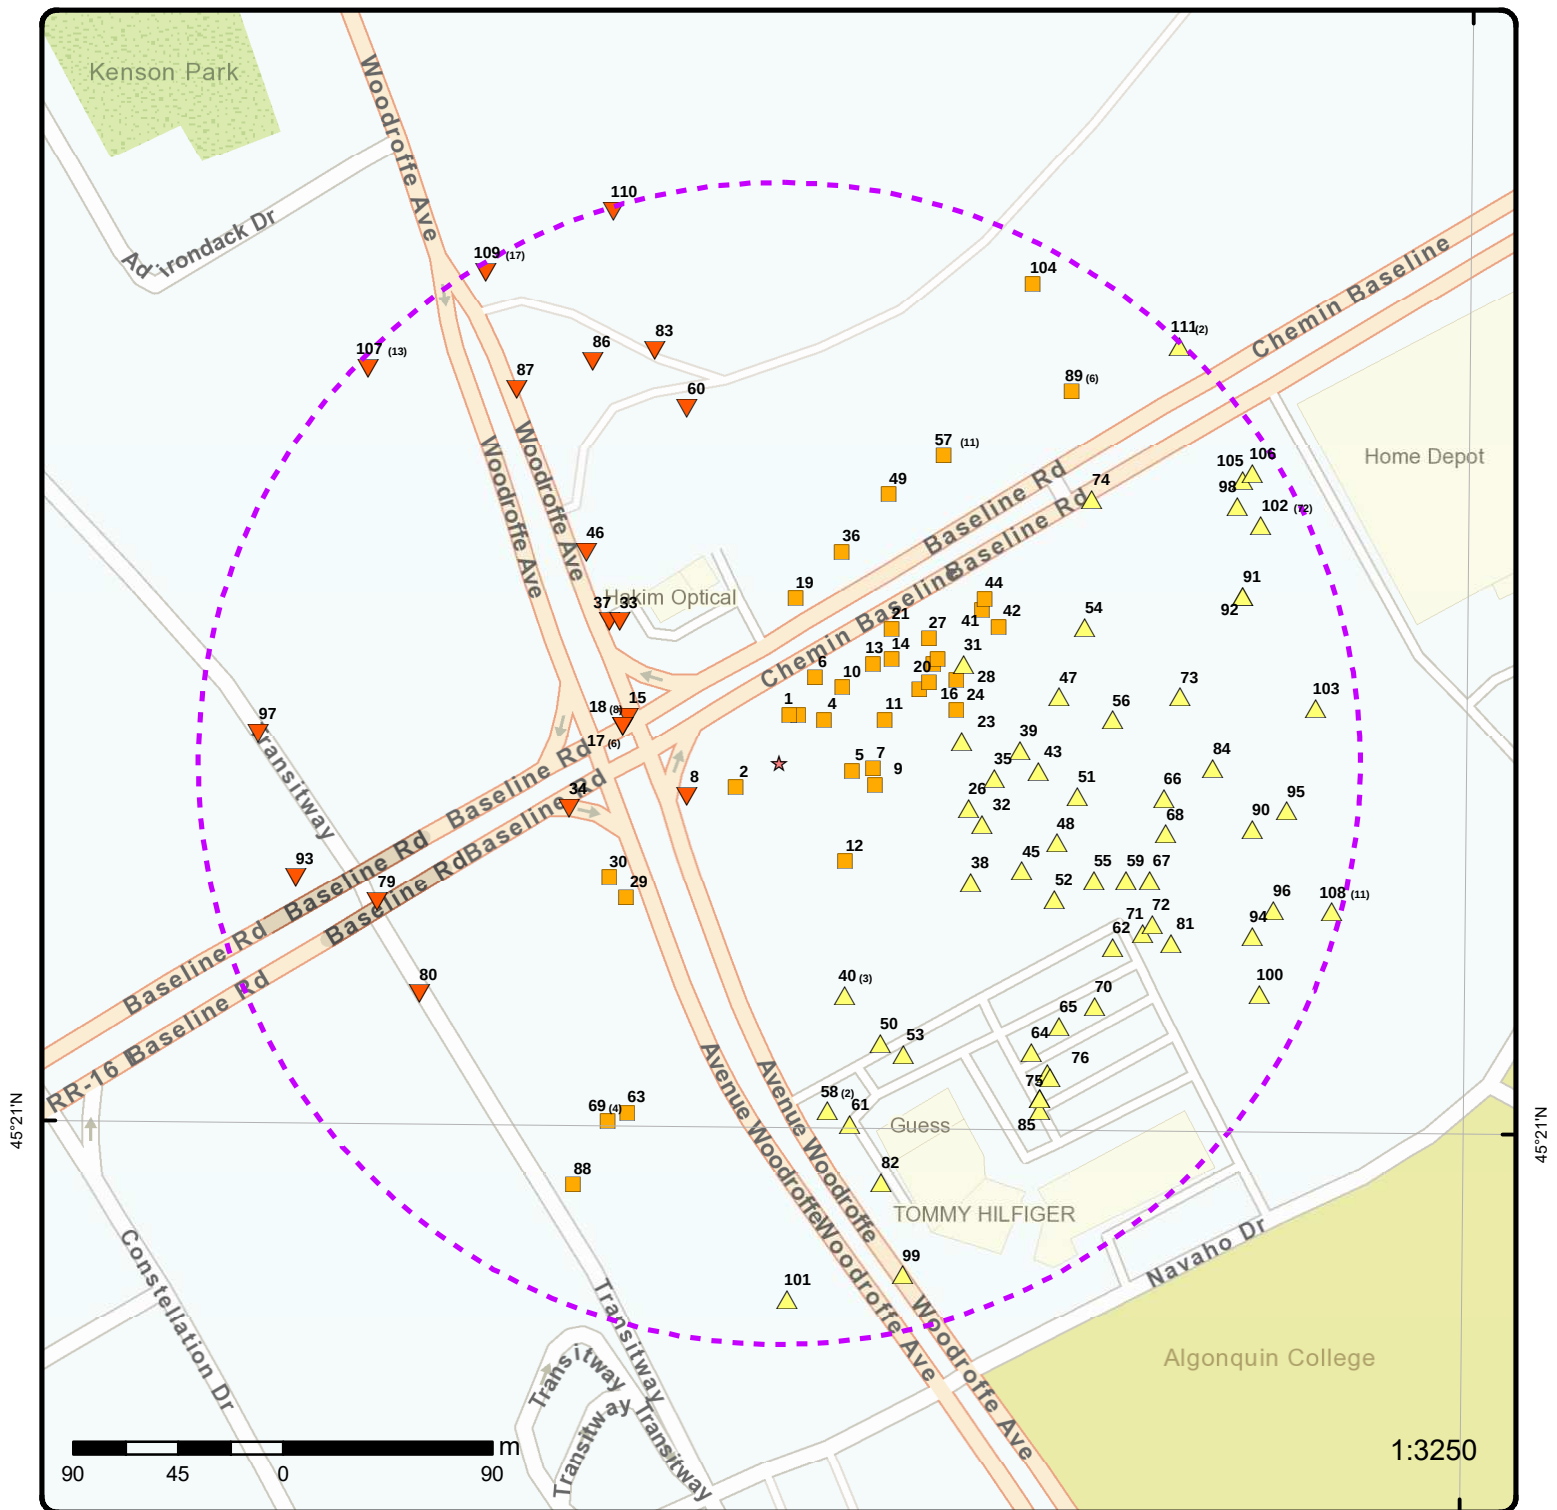


Map: 0.25 Kilometer Radius

Order Number: 25072400010

Address: PE7169, Ottawa, ON



★ Project Property	Freeways; Highways	Beach	Shopping & Sports Area
Buffer Outline	Traffic Circle; Ramp	Airport	University/College
Eris Sites with Higher Elevation	Major Arterial; Minor Arterial	Industrial Area	Cemetery; Golf Course
Eris Sites with Same Elevation	Local Road	Military Base	Parkt (National)
Eris Sites with Lower Elevation	Service Road; Traffic Circle; Ramp	Aircraft Roads	Park (City/County)
Eris Sites with Unknown Elevation	Rail	Native Reservation	Hospital

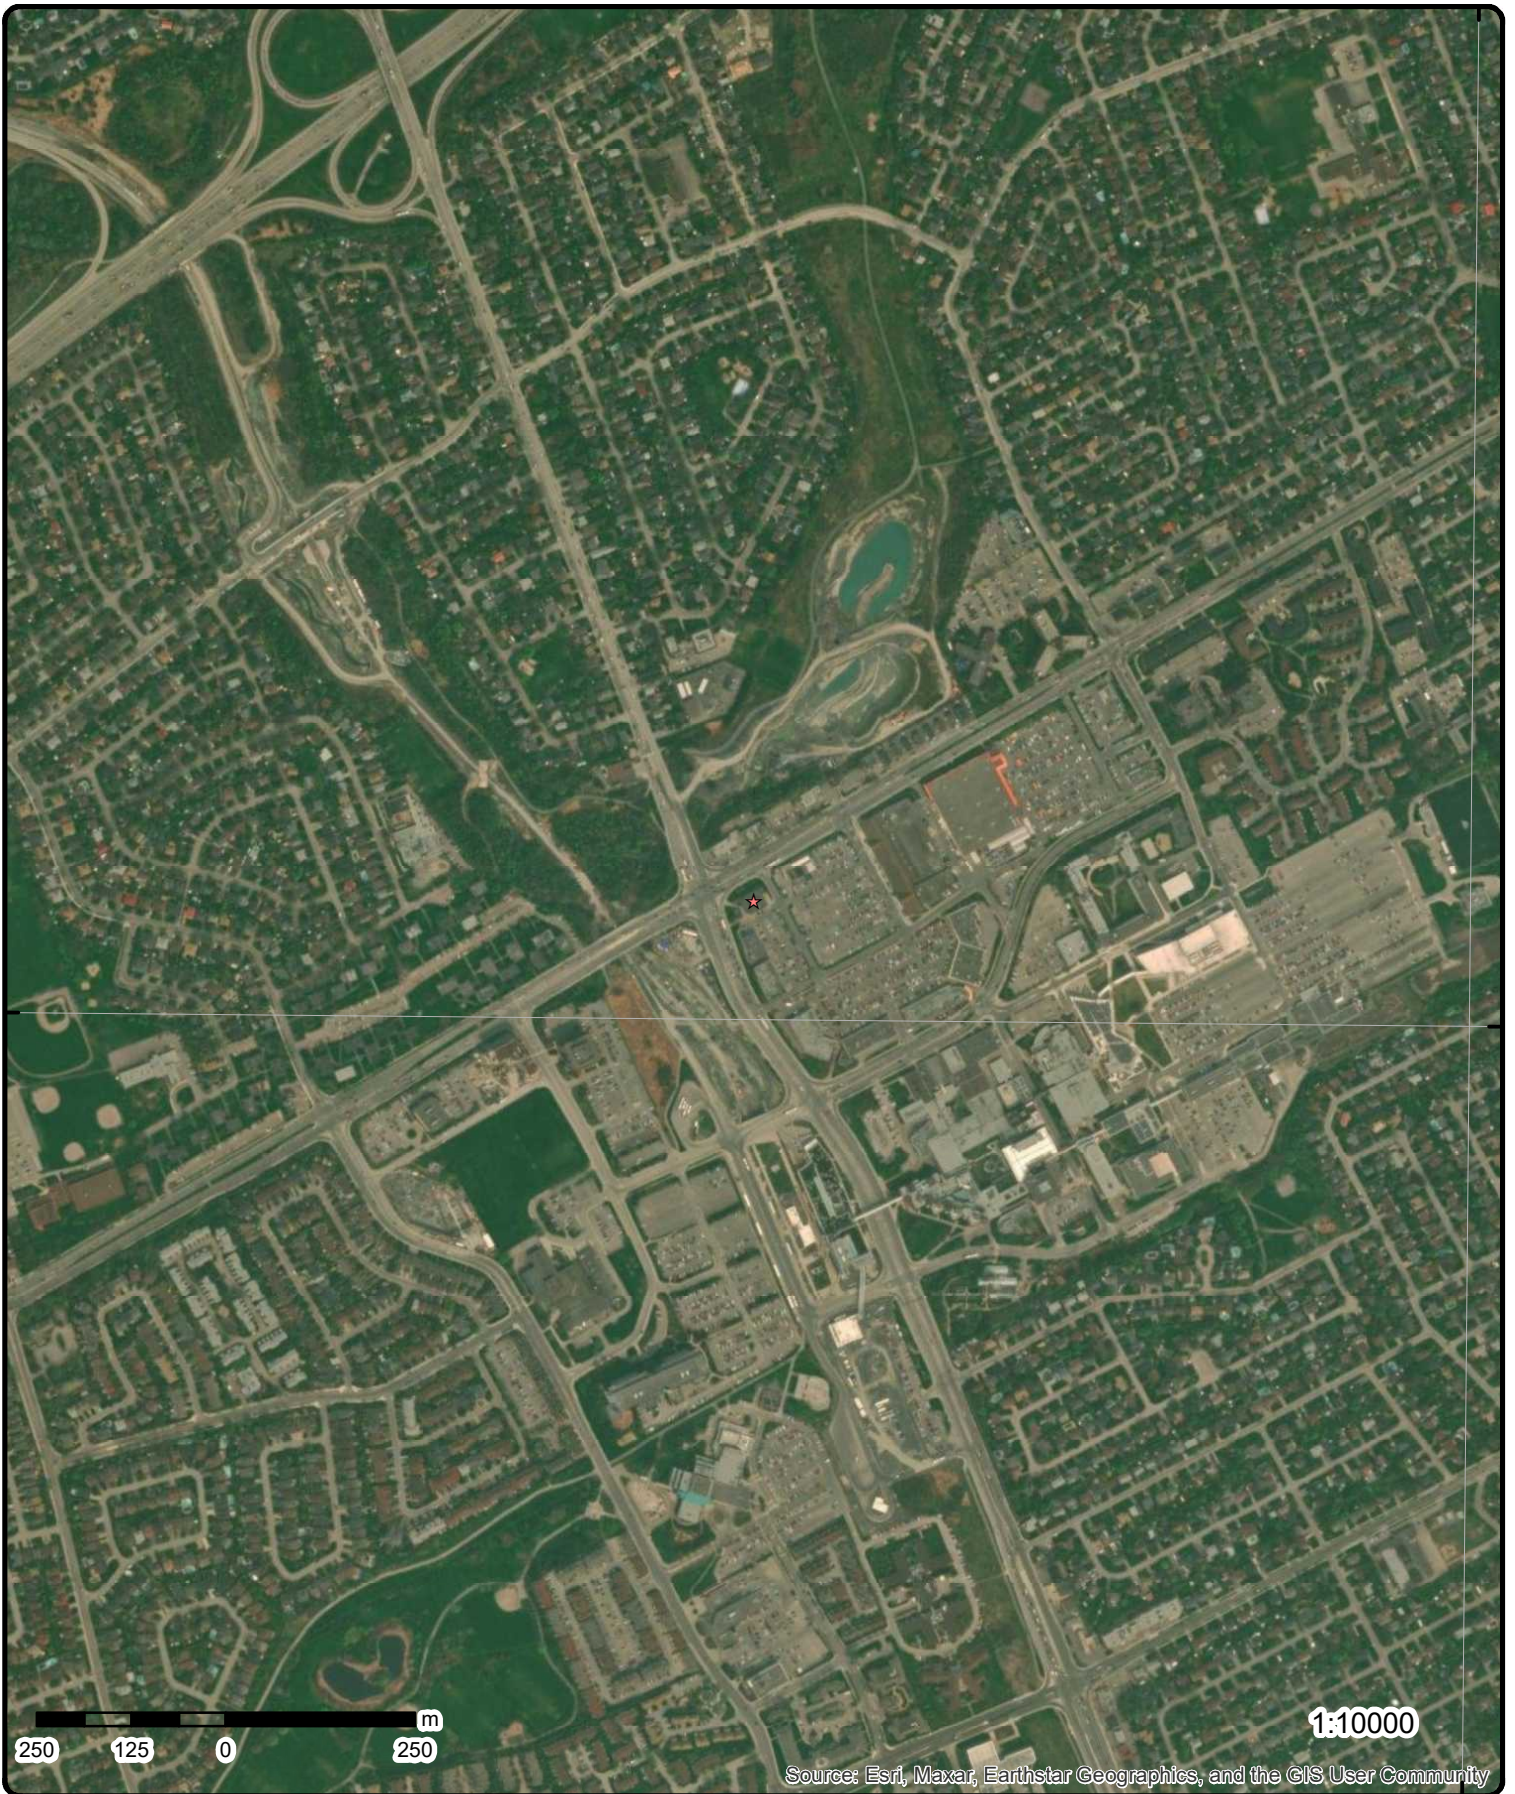

Aerial Year: 2023

Order Number: 25072400010

Address: PE7169, Ottawa, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

75°46'30"W


75°45'W

45°22'30"N

45°22'30"N

45°21'N

45°21'N

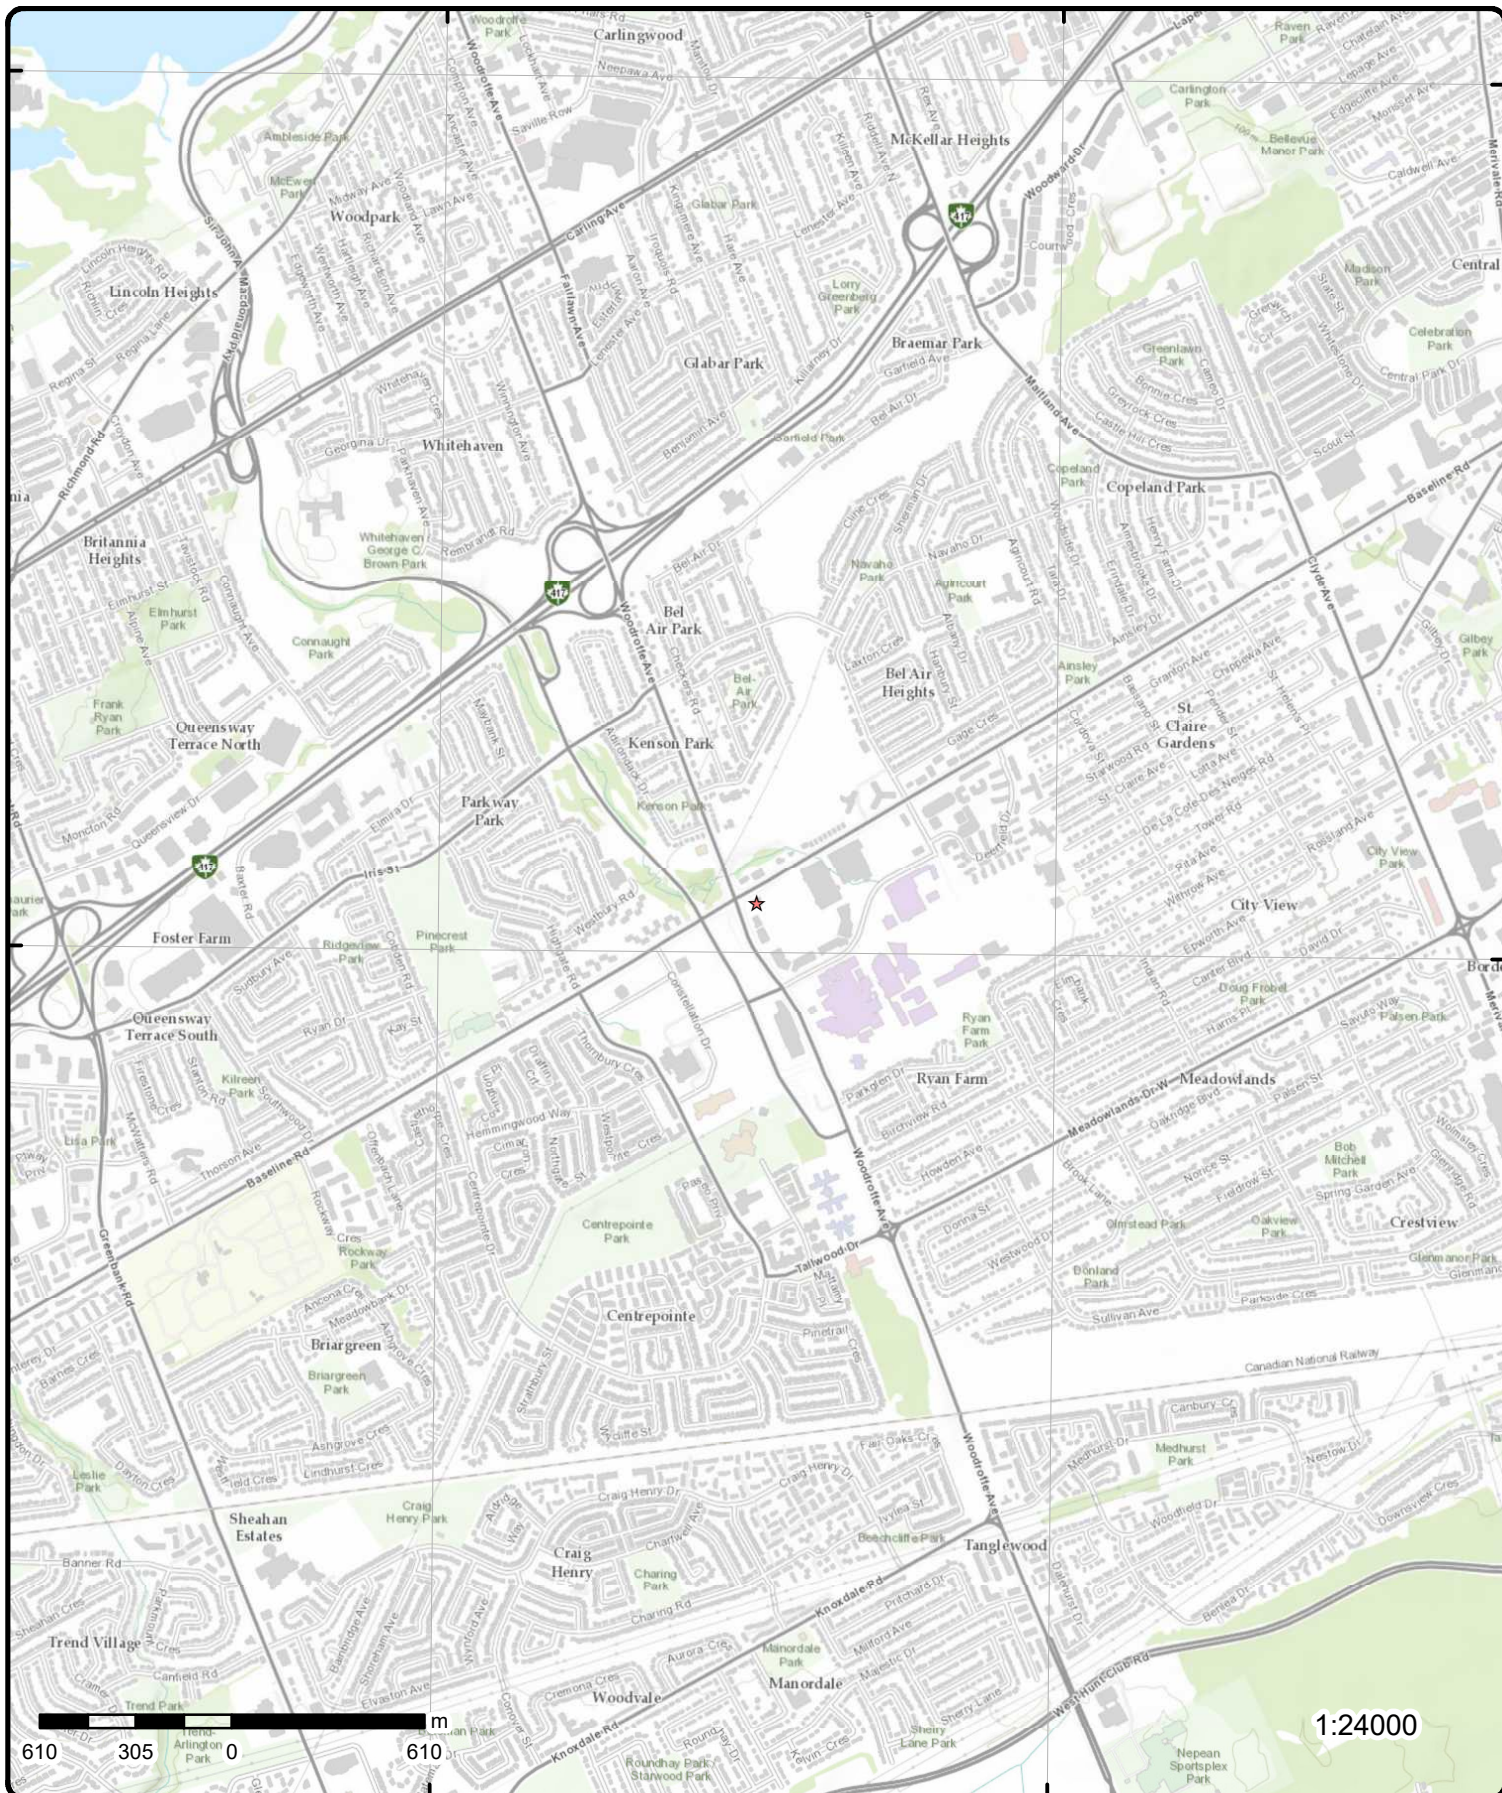

Topographic Map

Address: PE7169, ON

Source: ESRI World Topographic Map

Order Number: 25072400010



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
3	1 of 1	NNE/22.4	81.9 / 0.00	1984 BASELINE ROAD Ottawa ON	WWIS
Well ID:		7328524	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Test Hole	Data Entry Status:		
Use 2nd:		Monitoring	Data Src:		
Final Well Status:		Test Hole	Date Received:		11/19/2018
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z290685	Contractor:		7241
Tag:		A254685	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328524.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/08/2018			
Year Completed:		2018			
Depth (m):		7.01			
Latitude:		45.3515974022351			
Longitude:		-75.7619898453712			
X:		-75.76198968296632			
Y:		45.35159739553323			
Path:		732\7328524.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007375496	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		18
Code OB:			East83:		440312.00
Code OB Desc:			North83:		5022292.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		4
Date Completed:		08/08/2018	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:			Location Method:		wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007670031			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.740000009536743			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007670032			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		2.740000009536743			
Formation End Depth:		5.789999961853027			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007670030			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007670033			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		5.789999961853027			
Formation End Depth:		7.010000228881836			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007670043			
Layer:		3			
Plug From:		3.6600000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007670042			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007670041			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1007670040			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007670029			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007670036			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1007670037			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.9600000381469727			
Screen End Depth:		7.010000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007670035			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007670034			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		7.010000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>4</u>	1 of 1	NE/27.0	81.9 / 0.00	1984 BASELINE ROAD Ottawa ON	WWIS
Well ID:	7328525			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z290686			Contractor:	7241
Tag:	A254684			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1007375499			Tag No:	A254684
Depth M:	7.01			Contractor:	7241
Year Completed:	2018			Latitude:	45.3515803378061
Well Completed Dt:	08/08/2018			Longitude:	-75.7618491879615

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:	Z290686			Y:	45.351580330996924
Path:				X:	-75.76184902660378
<u>Bore Hole Information</u>					
Bore Hole ID:	1007375499			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440323.00
Code OB Desc:				North83:	5022290.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/08/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007670100				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	2.740000009536743				
Formation End Depth:	5.789999961853027				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007670099				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	2.740000009536743				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007670098				
Layer:	1				
Color:	6				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BROWN			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007670101			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		5.789999961853027			
Formation End Depth:		7.010000228881836			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007670110			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007670114			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007670116			
Layer:		3			
Plug From:		3.6600000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007670108			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1007670097			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007670104			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007670105			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.9600000381469727			
Screen End Depth:		7.010000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007670103			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007670102			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		7.010000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

103	1 of 1	E/231.8	83.9 / 2.00	1363,1365,1371,1379, 1381 Woodroffe Ave, 2301 Navaho Dr, 1850, 1900,1984, Baseline Rd Ottawa ON	EHS
Order No:	20150609033			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	RSC Report - Quote			Client Prov/State:	ON
Report Date:	16-JUN-15			Search Radius (km):	.3
Date Received:	09-JUN-15			X:	-75.759153
Previous Site Name:				Y:	45.351642
Lot/Building Size:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:					
1	1 of 1	NNE/21.2	81.9 / 0.00	1980 Baseline Road lot 35 con 1 Ottawa ON	WWIS
Well ID:		7329943	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring and Test Hole	Data Entry Status:		
Use 2nd:			Data Src:		
Final Well Status:			Date Received:		03/15/2019
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z305260	Contractor:		7241
Tag:		A263036	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		035
Depth to Bedrock:			Concession:		01
Well Depth:			Concession Name:		RF
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7329943.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		01/25/2019			
Year Completed:		2019			
Depth (m):		11.8872			
Latitude:		45.3515970615676			
Longitude:		-75.7620409056918			
X:		-75.7620407440885			
Y:		45.35159705526756			
Path:		732\7329943.pdf			
Bore Hole Information					
Bore Hole ID:		1007410845	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		18
Code OB:			East83:		440308.00
Code OB Desc:			North83:		5022292.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		4
Date Completed:		01/25/2019	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:			Location Method:		wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007800357			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		14.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007800358			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:		14.0			
Formation End Depth:		30.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007800359			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:		30.0			
Formation End Depth:		39.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007801643			
Layer:		3			
Plug From:		28.0			
Plug To:		39.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007801641			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007801642			
Layer:		2			
Plug From:		1.0			
Plug To:		28.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007803062			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007798852			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007803310			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		29.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007803976			
Layer:		1			
Slot:		10			
Screen Top Depth:		29.0			
Screen End Depth:		39.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007804590			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Flowing Rate: Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007802445 Diameter: 8.0 Depth From: 0.0 Depth To: 39.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
2	1 of 1	WSW/21.3	81.9 / 0.00	1980 Baseline Road lot 35 con 2 Ottawa ON	WWIS
Well ID: 7329941 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z305257 Tag: A263034 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 03/15/2019 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: 035 Concession: 02 Concession Name: RF Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7329941.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 01/25/2019 Year Completed: 2019 Depth (m): 11.8872 Latitude: 45.3513160845312 Longitude: -75.7623307565456 X: -75.7623305953242 Y: 45.35131607792225 Path: 732\7329941.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007410839 DP2BR: Spatial Status:					
Elevation: Elevrc: Zone: 18					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	440285.00
Code OB Desc:				North83:	5022261.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/25/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007800353			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		34			
Material 2 Desc:		TILL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		17.0			
Formation End Depth:		33.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007800352			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		10.0			
Formation End Depth:		17.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007800354			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:		33.0			
Formation End Depth:		39.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007800351			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		10.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007801636			
Layer:		2			
Plug From:		1.0			
Plug To:		28.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007801637			
Layer:		3			
Plug From:		28.0			
Plug To:		39.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007801635			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007803056			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007798850			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1007803308			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		29.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007803970			
Layer:		1			
Slot:		10			
Screen Top Depth:		29.0			
Screen End Depth:		39.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007804588			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007802443			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		39.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
<u>5</u>	1 of 1	E/31.5	81.9 / 0.00	1980 baeline lot 35 con 1 Ottawa ON	WWIS
Well ID:	7328587			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Material:				Abandonment Rec:	
Audit No:	Z229632			Contractor:	7241
Tag:	A254670			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328587.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/08/2018				
Year Completed:	2018				
Depth (m):	7.01				
Latitude:	45.3513833468541				
Longitude:	-75.7616933508262				
X:	-75.76169318963157				
Y:	45.35138334011796				
Path:	732\7328587.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1007379335			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440335.00
Code OB Desc:				North83:	5022268.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/08/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007702105				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	2.740000009536743				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702107			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		5.789999961853027			
Formation End Depth:		7.010000228881836			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702104			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702106			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		2.740000009536743			
Formation End Depth:		5.789999961853027			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702331			
Layer:		3			
Plug From:		3.66000000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1007702330			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702329			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007702581			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007701897			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007702637			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007702755			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.9600000381469727			
Screen End Depth:		7.010000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Hole Diameter</u>					
Hole ID:		1007702498			
Diameter:		11.430000305175781			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		7.010000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
6	1 of 1	NNE/39.9	81.9 / 0.00	1980 BASELINE RD. OTTAWA ON	WWIS
Well ID:		7296611		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Monitoring		Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	
Water Type:				10/05/2017	
Casing Material:				Selected Flag:	
Audit No:		Z263614		TRUE	
Tag:				Abandonment Rec:	
Constructn Method:				Yes	
Elevation (m):				Contractor:	
Elevatn Reliabilty:				7241	
Depth to Bedrock:				Form Version:	
Well Depth:				7	
Overburden/Bedrock:				Owner:	
Pump Rate:				County:	
Static Water Level:				OTTAWA-CARLETON	
Clear/Cloudy:				Lot:	
Municipality:		OTTAWA CITY		Concession:	
Site Info:				Concession Name:	
				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7296611.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/21/2017			
Year Completed:		2017			
Depth (m):					
Latitude:		45.3517420075213			
Longitude:		-75.7619024221337			
X:		-75.76190226073619			
Y:		45.35174200097824			
Path:		729\7296611.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006758943		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				440319.00	
Cluster Kind:				North83:	
Date Completed:		08/21/2017		5022308.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				4	
Location Source Date:				UTMRC:	
Improvement Location Source:				margin of error : 30 m - 100 m	
Improvement Location Method:				wwwr	
Source Revision Comment:				Location Method:	
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1006954725			
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006954733			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006954734			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.260000228881836			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1006954732			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006954724			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1006954728			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID: 1006954729 Layer: Slot: Screen Top Depth: Screen End Depth: Screen Material: Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter:					
Water Details					
Water ID: 1006954727 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
Hole Diameter					
Hole ID: 1006954726 Diameter: Depth From: Depth To: Hole Depth UOM: ft Hole Diameter UOM: inch					
7	1 of 1	E/40.4	81.9 / 0.00	1980 BASELINE ROAD lot 35 con 1 OTTAWA ON	WWIS
Well ID: 7328552 Construction Date: Use 1st: Test Hole Use 2nd: Monitoring Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z281954 Tag: A254663 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 11/19/2018 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: 035 Concession: 01 Concession Name: RF Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328552.pdf					
Additional Detail(s) (Map)					
Well Completed Date: 08/23/2018 Year Completed: 2018 Depth (m): 11.28 Latitude: 45.3513931135461 Longitude: -75.7615785862448					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
X:		-75.76157842450134			
Y:		45.351393107541305			
Path:		732\7328552.pdf			

Bore Hole Information

Bore Hole ID:	1007377838	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440344.00
Code OB Desc:		North83:	5022269.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	08/23/2018	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	1007636538
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	28
Material 1 Desc:	SAND
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	85
Material 3 Desc:	SOFT
Formation Top Depth:	0.3100000023841858
Formation End Depth:	2.440000057220459
Formation End Depth UOM:	m

Overburden and Bedrock

Materials Interval

Formation ID:	1007636540
Layer:	4
Color:	2
General Color:	GREY
Material 1:	06
Material 1 Desc:	SILT
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	66
Material 3 Desc:	DENSE
Formation Top Depth:	5.179999828338623
Formation End Depth:	11.279999732971191
Formation End Depth UOM:	m

Overburden and Bedrock

Materials Interval

Formation ID:	1007636537
Layer:	1

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		6			
General Color:		BROWN			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007636539			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		2.4400000057220459			
Formation End Depth:		5.179999828338623			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007636548			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007636550			
Layer:		3			
Plug From:		7.9600000038146973			
Plug To:		11.279999732971191			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007636549			
Layer:		2			
Plug From:		0.3700000047683716			
Plug To:		7.920000076293945			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1007636547			
Method Construction Code:		5			
Method Construction:		Air Percussion			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007636536			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007636543			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		8.229999542236328			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007636544			
Layer:		1			
Slot:		10			
Screen Top Depth:		8.229999542236328			
Screen End Depth:		11.279999732971191			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007636542			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007636541			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		11.279999732971191			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>8</u>	1 of 1	WSW/42.1	81.7 / -0.15	lot 35 con 2 ON	WWIS
Well ID:	1532165			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Not Used			Data Entry Status:	
Use 2nd:				Data Src:	1
Final Well Status:	Test Hole			Date Received:	08/13/2001
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:	234287			Contractor:	1119
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035
Depth to Bedrock:				Concession:	02
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		MARCH TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/153\1532165.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		07/17/2001			
Year Completed:		2001			
Depth (m):		79.248			
Latitude:		45.3512782926907			
Longitude:		-75.7625983383519			
X:		-75.76259817641244			
Y:		45.35127828653667			
Path:		153\1532165.pdf			
Bore Hole Information					
Bore Hole ID:	10516615			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440264.00
Code OB Desc:				North83:	5022257.00
Open Hole:				Org CS:	N83
Cluster Kind:				UTMRC:	3
Date Completed:	07/17/2001			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	
Location Method Desc:					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:	932832046				
Layer:	1				
Color:					
General Color:					
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	13				
Material 3 Desc:	BOULDERS				
Formation Top Depth:	0.0				
Formation End Depth:	48.0				
Formation End Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932832047			
Layer:		2			
Color:		4			
General Color:		GREEN			
Material 1:		18			
Material 1 Desc:		SANDSTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		48.0			
Formation End Depth:		260.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933219621			
Layer:		1			
Plug From:		2.0			
Plug To:		50.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961532165			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		11065185			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930094251			
Layer:		3			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:					
Casing Diameter:		8.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930094249			
Layer:		1			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter:		12.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930094250			
Layer:		2			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:					
Casing Diameter:		8.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991532165			
Pump Set At:					
Static Level:		50.0			
Final Level After Pumping:		250.0			
Recommended Pump Depth:		250.0			
Pumping Rate:		5.0			
Flowing Rate:					
Recommended Pump Rate:		5.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		2			
Water State After Test:		CLOUDY			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:					
Flowing:		No			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934399357			
Test Type:		Recovery			
Test Duration:		30			
Test Level:		50.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934659878			
Test Type:		Recovery			
Test Duration:		45			
Test Level:		50.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					
Pump Test Detail ID:		934917182			
Test Type:		Recovery			
Test Duration:		60			
Test Level:		50.0			
Test Level UOM:		ft			
<u>Draw Down & Recovery</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test Detail ID:		934115743			
Test Type:		Recovery			
Test Duration:		15			
Test Level:		50.0			
Test Level UOM:		ft			
<u>Water Details</u>					
Water ID:		934008282			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		70.0			
Water Found Depth UOM:		ft			
9	1 of 1	E/42.3	81.9 / 0.00	1980 BASELINE ROAD lot 35 con 1 Ottawa ON	WWIS
Well ID:	7328498			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z229622			Contractor:	7241
Tag:	A254686			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328498.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/07/2018				
Year Completed:	2018				
Depth (m):	7.01				
Latitude:	45.3513301946417				
Longitude:	-75.7615649761987				
X:	-75.7615648141363				
Y:	45.351330188026836				
Path:	732\7328498.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1007375349			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440345.00
Code OB Desc:				North83:	5022262.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Completed:		08/07/2018		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007668893			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		3.6600000858306885			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007668892			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		3.6600000858306885			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007668891			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1007668894			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		6.099999904632568			
Formation End Depth:		7.010000228881836			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007668902			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007668904			
Layer:		3			
Plug From:		3.6600000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007668903			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007668901			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007668890			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007668897			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007668898			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.9600000381469727			
Screen End Depth:		7.010000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Water Details</u>					
Water ID:		1007668896			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1007668895			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		7.010000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
10	1 of 1	NE/42.7	81.9 / 0.00	1980 BASELINE ROAD Ottawa ON	WWIS
Well ID:	7328504			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z290592			Contractor:	7241
Tag:	A254683			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1007375367			Tag No:	A254683
Depth M:	10.36			Contractor:	7241
Year Completed:	2018			Latitude:	45.3517070269781
Well Completed Dt:	08/20/2018			Longitude:	-75.7617487577878
Audit No:	Z290592			Y:	45.35170702037807
Path:				X:	-75.76174859677417
<u>Bore Hole Information</u>					
Bore Hole ID:	1007375367			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440331.00
Code OB Desc:				North83:	5022304.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/20/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007669184				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	2.440000057220459				
Formation End Depth:	5.179999828338623				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007669185				
Layer:	4				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	5.179999828338623				
Formation End Depth:	10.359999656677246				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007669183			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007669182			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007669195			
Layer:		3			
Plug From:		7.010000228881836			
Plug To:		10.359999656677246			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007669194			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007669193			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007669192			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007669181			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007669188			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		7.320000171661377			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007669189			
Layer:		1			
Slot:		10			
Screen Top Depth:		7.320000171661377			
Screen End Depth:		10.359999656677246			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007669187			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007669186			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		10.359999656677246			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
11	1 of 1	ENE/49.1	81.9 / 0.00	ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7406934			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	12/29/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z368028			Contractor:	7241
Tag:	A320467			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008904086			Tag No:	A320467
Depth M:				Contractor:	7241
Year Completed:	2021			Latitude:	45.3515825511795
Well Completed Dt:	11/10/2021			Longitude:	-75.7615172959447
Audit No:	Z368028			Y:	45.35158254430283
Path:				X:	-75.76151713425035
<u>Bore Hole Information</u>					
Bore Hole ID:	1008904086			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440349.00
Code OB Desc:				North83:	5022290.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/10/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>12</u>	1 of 1	SE/50.8	81.9 / 0.00	1980 Baseline Road lot 35 con 1 Ottawa ON	WWIS
Well ID:	7329942			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	03/15/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z305256			Contractor:	7241
Tag:	A263035			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliability:			Lot:	035	
Depth to Bedrock:			Concession:	01	
Well Depth:			Concession Name:	RF	
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7329942.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		01/25/2019			
Year Completed:		2019			
Depth (m):		7.0104			
Latitude:		45.3510320690545			
Longitude:		-75.7617269370214			
X:		-75.76172677496379			
Y:		45.3510320619551			
Path:		732\7329942.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007410842		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440332.00
Code OB Desc:				North83:	5022229.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		01/25/2019		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007800355			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		9.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007800356			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:		9.0			
Formation End Depth:		23.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007801639			
Layer:		2			
Plug From:		1.0			
Plug To:		12.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007801640			
Layer:		3			
Plug From:		12.0			
Plug To:		23.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007801638			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007803058			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007798851			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007803309			
Layer:		1			
Material:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		13.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007803972			
Layer:		1			
Slot:		10			
Screen Top Depth:		13.0			
Screen End Depth:		23.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007804589			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007802444			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		23.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
13	1 of 1	NE/58.8	81.9 / 0.00	1980 BASELINE RD Ottawa ON	WWIS
Well ID:		7328523		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Monitoring		Data Src:	
Final Well Status:		Test Hole		Date Received:	
Water Type:				11/19/2018	
Casing Material:				Selected Flag:	
Audit No:		Z290589		Abandonment Rec:	
Tag:		A254688		Contractor:	
Constructn Method:				7241	
Elevation (m):				Form Version:	
				7	
				Owner:	
				County:	
				OTTAWA-CARLETON	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			OTTAWA CITY	Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328523.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/20/2018			
Year Completed:		2018			
Depth (m):		10.36			
Latitude:		45.3517981393802			
Longitude:		-75.761584018613			
X:		-75.76158385747601			
Y:		45.35179813236449			
Path:		732\7328523.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007375493		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440344.00
Code OB Desc:				North83:	5022314.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		08/20/2018		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007670015			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007670018			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		9.140000343322754			
Formation End Depth:		10.359999656677246			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007670017			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		5.489999771118164			
Formation End Depth:		9.140000343322754			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007670016			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		5.489999771118164			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007670027			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007670028			
Layer:		3			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		7.010000228881836			
Plug To:		10.359999656677246			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007670026			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007670025			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007670014			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007670021			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		7.320000171661377			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007670022			
Layer:		1			
Slot:		10			
Screen Top Depth:		7.320000171661377			
Screen End Depth:		10.359999656677246			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Water Details</u>					
Water ID:		1007670020			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1007670019			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		10.359999656677246			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
14	1 of 1	ENE/65.9	81.9 / 0.00	1980 BASE LINE RD. NEPEAN ON	WWIS
Well ID:	7297590			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	0			Date Received:	10/20/2017
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z257161			Contractor:	7424
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7297590.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	09/28/2017				
Year Completed:	2017				
Depth (m):					
Latitude:	45.3518168214343				
Longitude:	-75.7614821390074				
X:	-75.76148197777518				
Y:	45.351816814195764				
Path:	729\7297590.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1006770600			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440352.00
Code OB Desc:				North83:	5022316.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/28/2017			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006928477			
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006928483			
Layer:		1			
Plug From:		0.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006928484			
Layer:		2			
Plug From:		2.0			
Plug To:		21.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006928482			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006928476			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006928480			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006928481			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006928479			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006928478			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

<u>15</u>	1 of 1	WNW/67.8	80.9 / -1.00	Kiewit Eurovia Vinci	SPL
				Ottawa ON	
Ref No:		0601-BL2TDK			
Year:					
Incident Dt:		2020/01/21			
Dt MOE Arvl on Scn:					
MOE Reported Dt:		2020/01/21			
Dt Document Closed:		2020/05/13			
Site No:		NA			
MOE Response:		No			
Site County/District:					
Site Geo Ref Meth:					
Site District Office:		Ottawa			
Nearest Watercourse:					
Site Name:		job site - 100 metres south-west of the intersection of Woodroffe Ave. and Baseline Rd.<UNOFFICIAL>			
Site Address:					
Site Region:		Eastern			
Site Municipality:		Ottawa			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:		5022291.03			
Easting:		440238.8			
Entity Operating Name:					
Client Name:		Kiewit Eurovia Vinci			

16

1 of 1

ENE/68.2

81.9 / 0.00

1980 BASELINE RD.
NEPEAN ON

WWIS

Well ID:

7297593

Construction Date:

Use 1st:

Use 2nd:

Final Well Status:

Abandoned-Other

Water Type:

Casing Material:

Audit No:

Z257158

Tag:

Constructn Method:

Elevation (m):

Elevatn Reliabilty:

Depth to Bedrock:

Well Depth:

Overburden/Bedrock:

Pump Rate:

Static Water Level:

Clear/Cloudy:

Municipality:

OTTAWA CITY

Site Info:

Flowing (Y/N):

Flow Rate:

Data Entry Status:

Data Src:

Date Received:

10/20/2017

Selected Flag:

TRUE

Abandonment Rec:

Yes

Contractor:

7424

Form Version:

7

Owner:

County:

OTTAWA-CARLETON

Lot:

Concession:

Concession Name:

Easting NAD83:

Northing NAD83:

Zone:

UTM Reliability:

PDF URL (Map):

https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7297593.pdf

Additional Detail(s) (Map)

Well Completed Date:

09/28/2017

Year Completed:

2017

Depth (m):

Latitude:

45.3517008351562

Longitude:

-75.7613273885922

X:

-75.7613272277572

Y:

45.35170082800192

Path:

729\7297593.pdf

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1006770623			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440364.00
Code OB Desc:				North83:	5022303.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/28/2017			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006928510				
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006928516				
Layer:	1				
Plug From:	0.0				
Plug To:	2.0				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006928517				
Layer:	2				
Plug From:	2.0				
Plug To:	21.0				
Plug Depth UOM:	ft				
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:	1006928515				
Method Construction Code:					
Method Construction:					
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1006928509			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006928513			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006928514			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006928512			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006928511			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
17	1 of 6	W/69.2	80.9 / -1.00	Woodroffe Ave & Baseline Rd Ottawa ON	EHS
Order No:	20010716001			Nearest Intersection:	Woodroffe and Baseline
Status:	C			Municipality:	Ottawa
Report Type:	Complete Report			Client Prov/State:	ON
Report Date:	7/24/01			Search Radius (km):	0.25
Date Received:	7/16/01			X:	-75.763474
Previous Site Name:				Y:	45.352011
Lot/Building Size:	no buildigns				
Additional Info Ordered:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
17	2 of 6	W/69.2	80.9 / -1.00	OTTAWA-CARLETON, REG'L MNCPLTY. OF PARKN'RIDE FCLTY, WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	GEN
<u>Generator Info</u>					
Generator No:	ON0303111			Choice of Contact:	
Approval Years:	88			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	4599
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER TRANS. SERV.			
<u>Waste Detail(s)</u>					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				
<u>Waste Detail(s)</u>					
Waste Class:	148				
Waste Class Name:	INORGANIC LABORATORY CHEMICALS				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
<u>Waste Detail(s)</u>					
Waste Class:	263				
Waste Class Name:	ORGANIC LABORATORY CHEMICALS				
<u>Waste Detail(s)</u>					
Waste Class:	331				
Waste Class Name:	WASTE COMPRESSED GASES				
17	3 of 6	W/69.2	80.9 / -1.00	OTTAWA-CARLTON, REG'L MNCPLTY. OF PARKN'RIDE FCLTY, WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON0303111 89,90			Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 4599	
		OTHER TRANS. SERV.			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		145 PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		148 INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		213 PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		221 LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		261 PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		263 ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		331 WASTE COMPRESSED GASES			
17	4 of 6	W/69.2	80.9 / -1.00	OTTAWA-CARLTON, REG'L (OUT OF BUSINESS) PARKN'RIDE FCLTY, WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:	ON0303111			Choice of Contact:	
Approval Years:	92,93,96,97			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	4599
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER TRANS. SERV.			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
17	5 of 6	W/69.2	80.9 / -1.00	OTTAWA-CARLTON, REG'L MNCPLTY. OF 29-406 PARKN'RIDE FCLTY, WOODROFFE AVE/BASELINE C/O 495 RICHMOND ROAD OTTAWA ON K2A 0G3	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON0303111 Approval Years: 94,95 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: OTHER TRANS. SERV. Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 4599					
<u>Waste Detail(s)</u>					
Waste Class: 221 Waste Class Name: LIGHT FUELS					
<u>Waste Detail(s)</u>					
Waste Class: 331 Waste Class Name: WASTE COMPRESSED GASES					
<u>Waste Detail(s)</u>					
Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES					
<u>Waste Detail(s)</u>					
Waste Class: 261 Waste Class Name: PHARMACEUTICALS					
<u>Waste Detail(s)</u>					
Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES					
<u>Waste Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
17	6 of 6	W/69.2	80.9 / -1.00	OTTAWA-CARLTON (OUT OF BUSINESS) PARK N' RIDE FACILITY WOODROFFE AVENUE & BASELINE ROAD NEPEAN ON	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON0303111 Approval Years: 98 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: OTHER TRANS. SERV. Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 4599					
<u>Waste Detail(s)</u>					
Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES					
<u>Waste Detail(s)</u>					
Waste Class: 221 Waste Class Name: LIGHT FUELS					
<u>Waste Detail(s)</u>					
Waste Class: 261 Waste Class Name: PHARMACEUTICALS					
<u>Waste Detail(s)</u>					
Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 331 Waste Class Name: WASTE COMPRESSED GASES					
<u>Waste Detail(s)</u>					
Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES					
<u>Waste Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
18	1 of 8	W/69.2	80.9 / -1.00	UNITED CO-OP WOODROFFE AVE/HWY #16 TANK TRUCK (CARGO) OTTAWA CITY ON	SPL
Ref No: 56246 Year: Incident Dt: 8/27/1991 Municipality No: 20101 Nature of Damage: Discharger Report:					

18	2 of 8	W/69.2	80.9 / -1.00	OTTAWA-CARLETON, R.M. OF INTERSECTION OF HWY # 16 AND WOODROFFE AVE. SANITARY SEWER SYSTEM NEPEAN CITY ON	SPL
Ref No:	135769			Municipality No:	20104
Year:				Nature of Damage:	
Incident Dt:	12/31/1996			Discharger Report:	
Dt MOE Arvi on Scn:				Material Group:	
MOE Reported Dt:	1/3/1997			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: NEPEAN CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: VALVE/FITTING LEAK OR FAILURE Incident Preceding Spill: Incident Reason: EQUIPMENT FAILURE Incident Summary: OTTAWA-CARLETON REGION RAW SEWAGE OVERFLOW FROM FORCEMAIN DUE TO LEAK Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Soil contamination Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
18	3 of 8	W/69.2	80.9 / -1.00	OTTAWA-CARLETON, R.M. OF HWY 16 AND WOODRUFF AVE. SANITARY SEWER SYSTEM NEPEAN CITY ON	SPL
Ref No: 164933 Year: Incident Dt: 2/24/1999 Dt MOE Arvl on Scn: MOE Reported Dt: 2/24/1999 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: NEPEAN CITY Site Lot: Site Conc: Site Geo Ref Accu:					
Municipality No: 20104 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Map Datum: Northings: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: VALVE/FITTING LEAK OR FAILURE Incident Preceding Spill: Incident Reason: UNKNOWN Incident Summary: R.M.OTTAWA-CARLETON- UNK QTY SEWAGE TO DITCH DUE TO FORCE MAIN BRK. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Soil contamination Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
18	4 of 8	W/69.2	80.9 / -1.00	OTTAWA-CARLETON, R.M. OF 100 M FROM WOODROOFE AND HWY 16. SANITARY SEWER SYSTEM OTTAWA ON	SPL
Ref No: 189626 Year: Incident Dt: 11/1/2000 Dt MOE Arvl on Scn: MOE Reported Dt: 11/1/2000 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northings: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: PIPE/HOSE LEAK					
				Municipality No: 20107 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Preceding Spill: Incident Reason: EQUIPMENT FAILURE Incident Summary: OTTAWA/CARLETON-1/2 M3 RAW SEWAGE TO DITCH,MAIN BREAK,CLEANUP ONGOING. Environment Impact: NOT ANTICIPATED Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
18	5 of 8	W/69.2	80.9 / -1.00	City of Ottawa Baseline & Woodroffe Ave Ottawa ON	SPL
Ref No: 5744-84CKHU Year: Incident Dt: Dt MOE Arvl on Scn: 4/9/2010 MOE Reported Dt: 4/9/2010 Dt Document Closed: 4/22/2010 Site No: MOE Response: Planned Field Response Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: excavation pit<UNOFFICIAL> Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: City of Ottawa Client Type: Source Type: Incident Cause: Pipe Or Hose Leak Incident Preceding Spill: Incident Reason: Unknown - Reason not determined Incident Summary: City of Ottawa: pos force main break. Ottawa Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:		44 SEWAGE,RAW UNCHLORINATED Pipeline Land Spills			
18	6 of 8	W/69.2	80.9 / -1.00	Kiewit Eurovia Vinci; Badger Daylighting Ottawa Ltd. Intersection of Baseline Rd. & Woodruff Ave. Ottawa ON	SPL
Ref No: Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed:		5765-BZ5QV3 2021/03/15 2021/03/15 2021/04/19 NA No Ottawa Hydraulic Oil Spill Site<UNOFFICIAL> Intersection of Baseline Rd. & Woodruff Ave. Eastern Ottawa 5022646 440421 Kiewit Eurovia Vinci; Badger Daylighting Ottawa Ltd. Corporation; Corporation Valve/Fitting/Piping Leak/Break Unknown / N/A KEV: 1L Hydraulic Oil to Ground, Cleaned 1 L 1 L 15 HYDRAULIC OIL n/a Land		Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:	2 - Minor Environment

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Property Tertiary Watershed: Sector Type: Miscellaneous Industrial SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					
18	7 of 8	W/69.2	80.9 / -1.00	Kiewit Eurovia Vinci Baseline and Woodruff Ottawa ON	SPL
Ref No: 5087-BYJQ94 Year: Incident Dt: 2021/02/24 Dt MOE Arvl on Scn: MOE Reported Dt: 2021/02/24 Dt Document Closed: 2021/04/11 Site No: NA MOE Response: No Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: Ottawa LRT Project<UNOFFICIAL> Site Address: Baseline and Woodruff Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: NAD83 Northing: 5022634 Easting: 440445 Entity Operating Name: Client Name: Kiewit Eurovia Vinci Client Type: Corporation Source Type: Valve/Fitting/Piping Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Material Failure - Poor Design/Substandard Material Incident Summary: KEV: 5L hydraulic oil to ground/contained/no impacts Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 5 L Contaminant Qty 1: 5 Contaminant Unit: L Contaminant Code: 15 Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: n/a Receiving Medium: Land; Source Water Zone Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Unknown / N/A SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
18	8 of 8	W/69.2	80.9 / -1.00	KIEWIT EUROVIA VINCI Baseline road and Woodroofe, Ottawa OTTAWA ON	SPL
Ref No: 1-3M18FK Year: Incident Dt: 7/6/2023 6:00:54 AM Dt MOE Arvl on Scn: MOE Reported Dt: 7/7/2023 4:50:54 PM Dt Document Closed: 8/3/2023 4:01:49 PM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: Baseline road and Woodroofe, Ottawa Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: KIEWIT EUROVIA VINCI Client Type: Private Business Source Type: Valve/Fitting/Piping Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Equipment failure/malfunction Incident Summary: Kiewit - Late Report / 2L of hydraulic oil released to ground - cleaned Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 2 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Normal operations Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: OTHER HEAVY AND CIVIL ENGINEERING CONSTRUCTION SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004306933"],"wks":["POINT (-75.7630257000 45.3513696000)","creation_date":"2023-07-07"} Time Reported: System Facility Address: Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					
19	1 of 1	N/71.3	81.9 / 0.00	ON	BORE
Borehole ID: 612525 OGF ID: 215513831 Status: Type: Borehole Use: Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Completion Date: MAY-1971 Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: 5 Depth Ref: Ground Surface Depth Elev: Drill Method: Orig Ground Elev m: 84.7 Elev Reliabil Note: DEM Ground Elev m: 85.7 Concession: Location D: Survey D: Comments:					
Municipality: Lot: Township: Latitude DD: 45.352049 Longitude DD: -75.762013 UTM Zone: 18 Easting: 440311 Northing: 5022342 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218391592 Top Depth: 4.6 Bottom Depth: 5 Material Color: Material 1: Sand Material 2: Silt Material 3: Gravel Material 4: Gsc Material Description: Stratum Description: SAND. VERY DENSE. 00000 027 00025 027 00036 038 00075 043 00150 015 000000100 **Note: Many records provided by the department have a truncated [Stratum Description] field.					
Mat Consistency: Dense Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218391588 Top Depth: 0 Bottom Depth: .8 Material Color: Material 1: Material 2: Sand Material 3: Bedrock Material 4: Gsc Material Description: Stratum Description: ARTIFICIAL.					
Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218391589 Top Depth: .8 Bottom Depth: 1.1 Material Color: Material 1: Silt Material 2: Clay Material 3: Material 4: Gsc Material Description: Stratum Description: SILT. DENSE.					
Mat Consistency: Dense Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218391591 Top Depth: 2.3 Bottom Depth: 4.6 Material Color: Brown Material 1: Clay Material 2: Silt Material 3: Sand Material 4: Gsc Material Description: Stratum Description: CLAY. BROWN,GREY, STIFF TO VERY STIFF,FISSURED.					
Mat Consistency: Stiff Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218391590 Top Depth: 1.1 Mat Consistency: Hard Material Moisture:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bottom Depth:2.3 Material Color:Brown Material 1:Clay Material 2:Sand Material 3:Silt Material 4: Gsc Material Description: Stratum Description:CLAY. BROWN,GREY,VERY STIFF TO HARD. Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Source Source Type:Data Survey Source Orig:Geological Survey of Canada Source Date:1956-1972 Confidence:H Observatio: Source Name:Urban Geology Automated Information System (UGAIS) Source Details:File: OTTAWA1.txt RecordID: 050330 NTS_Sheet: 31G05C Confiden 1:Logged by professional. Exact and complete description of material and properties. Source Appl:Spatial/Tabular Source Iden:1 Scale or Res:Varies Horizontal:NAD27 Verticalda:Mean Average Sea Level					
Source List Source Identifier:1 Source Type:Data Survey Source Date:1956-1972 Scale or Resolution:Varies Source Name:Urban Geology Automated Information System (UGAIS) Source Originators:Geological Survey of Canada Horizontal Datum:NAD27 Vertical Datum:Mean Average Sea Level Projection Name:Universal Transverse Mercator					
20	1 of 1	ENE/73.1	81.9 / 0.00	1980 Baseline Rd Ottawa ON	WWIS
Well ID:7346097 Construction Date: Use 1st:Monitoring and Test Hole Use 2nd: Final Well Status:Abandoned Monitoring and Test Hole Water Type: Casing Material: Audit No:Z324289 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality:NEPEAN TOWNSHIP Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received:10/30/2019 Selected Flag:TRUE Abandonment Rec:Yes Contractor:7241 Form Version:7 Owner: County:OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map) Bore Hole ID:1007697748 Depth M: Year Completed:2019 Well Completed Dt:09/24/2019 Audit No:Z324289 Path: Tag No: Contractor:7241 Latitude:45.351728177229 Longitude:-75.7612766901843 Y:45.35172816994926 X:-75.76127652865367					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1007697748			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440368.00
Code OB Desc:				North83:	5022306.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/24/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1007899682				
Layer:	2				
Plug From:	0.5				
Plug To:	3.0999999046325684				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1007899681				
Layer:	1				
Plug From:	0.0				
Plug To:	0.5				
Plug Depth UOM:	m				
<u>Pipe Information</u>					
Pipe ID:	1007897631				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1007901155				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:					
Casing Diameter:	5.199999809265137				
Casing Diameter UOM:	cm				
Casing Depth UOM:					
<u>Construction Record - Screen</u>					
Screen ID:	1007901466				
Layer:	1				
Slot:					
Screen Top Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		cm			
Screen Diameter UOM:		6.03000020980835			
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007902022			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007900399			
Diameter:		6.03000020980835			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

21	1 of 1	NE/75.3	81.9 / 0.00	1980 BASELINE RD. OTTAWA ON	WWIS
Well ID:		7296610		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Monitoring		Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	10/05/2017
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:		Z263615		Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7296610.pdf			

Additional Detail(s) (Map)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		08/21/2017			
Year Completed:		2017			
Depth (m):					
Latitude:		45.3519338288944			
Longitude:		-75.7614837081708			
X:		-75.7614835462232			
Y:		45.35193382220556			
Path:		729\7296610.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1006758940			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440352.00
Code OB Desc:				North83:	5022329.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/21/2017			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006954714				
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006954723				
Layer:	2				
Plug From:	0.3100000023841858				
Plug To:	6.099999904632568				
Plug Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006954722				
Layer:	1				
Plug From:	0.0				
Plug To:	0.3100000023841858				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006954721			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006954713			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006954717			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006954718			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006954716			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006954715			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
22	1 of 1	ENE/78.9	81.9 / 0.00	1980 BASELINE RD. NEPEAN ON	WWIS
Well ID:		7297588	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:			Data Entry Status:		
Use 2nd:			Data Src:		
Final Well Status:		Abandoned-Other	Date Received:		10/20/2017
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		Yes
Audit No:		Z266197	Contractor:		7424
Tag:			Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7297588.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		09/28/2017			
Year Completed:		2017			
Depth (m):					
Latitude:		45.3518003519914			
Longitude:		-75.7612521253027			
X:		-75.76125196332595			
Y:		45.35180034503061			
Path:		729\7297588.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006770594	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		
Code OB:			East83:		
Code OB Desc:			North83:		
Open Hole:			Org CS:		
Cluster Kind:			UTMRC:		
Date Completed:		09/28/2017	UTMRC Desc:		
Remarks:			Location Method:		
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006928441			
Layer:					
Color:					
General Color:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:					
		1006928448			
Layer:					
		2			
Plug From:					
		2.0			
Plug To:					
		21.0			
Plug Depth UOM:					
		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:					
		1006928447			
Layer:					
		1			
Plug From:					
		0.0			
Plug To:					
		2.0			
Plug Depth UOM:					
		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:					
		1006928446			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:					
		1006928440			
Casing No:					
		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:					
		1006928444			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:					
		inch			
Casing Depth UOM:					
		ft			
<u>Construction Record - Screen</u>					
Screen ID:					
		1006928445			
Layer:					
Slot:					
Screen Top Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen End Depth: Screen Material: Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter:					
Water Details					
Water ID: 1006928443 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
Hole Diameter					
Hole ID: 1006928442 Diameter: Depth From: Depth To: Hole Depth UOM: ft Hole Diameter UOM: inch					
23	1 of 1	E/78.9	82.4 / 0.54	1980 Baseline Rd Ottawa ON	WWIS
Well ID: 7346095 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Abandoned Monitoring and Test Hole Water Type: Casing Material: Audit No: Z324301 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 10/30/2019 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map)					
Bore Hole ID: 1007697742 Depth M: Year Completed: 2019 Well Completed Dt: 09/24/2019 Audit No: Z324301 Path:					
Tag No: Contractor: 7241 Latitude: 45.3515043538958 Longitude: -75.7610949625507 Y: 45.35150434699491 X: -75.76109480134751					
Bore Hole Information					
Bore Hole ID: 1007697742 DP2BR: Spatial Status:					
Elevation: Elevrc: Zone: 18					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	440382.00
Code OB Desc:				North83:	5022281.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/24/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007899678			
Layer:		2			
Plug From:		0.5			
Plug To:		5.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007899677			
Layer:		1			
Plug From:		0.0			
Plug To:		0.5			
Plug Depth UOM:		m			
<u>Pipe Information</u>					
Pipe ID:		1007897629			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007901153			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:					
<u>Construction Record - Screen</u>					
Screen ID:		1007901464			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:					
Screen Diameter UOM:					
Screen Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:	1007902020				
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:	m				
Rate UOM:	LPM				
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:	0				
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:	1007900397				
Diameter:	6.03000020980835				
Depth From:	0.0				
Depth To:	5.5				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				

24	1 of 1	ENE/79.7	81.9 / 0.00	1980 BASE LINE RD. NEPEAN ON	WWIS
Well ID:	7297592			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	10/20/2017
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z257159			Contractor:	7424
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7297592.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	09/28/2017				
Year Completed:	2017				
Depth (m):					
Latitude:	45.3516211912415				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Longitude:		-75.7611220610756			
X:		-75.76112189900918			
Y:		45.35162118393967			
Path:		729\7297592.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1006770620			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440380.00
Code OB Desc:				North83:	5022294.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/28/2017			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006928498				
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006928504				
Layer:	1				
Plug From:	0.0				
Plug To:	2.0				
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006928505				
Layer:	2				
Plug From:	2.0				
Plug To:	23.0				
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction ID: 1006928503 Method Construction Code: Method Construction: Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1006928497 Casing No: 0 Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1006928501 Layer: Material: Open Hole or Material: Depth From: Depth To: Casing Diameter: Casing Diameter UOM: inch Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1006928502 Layer: Slot: Screen Top Depth: Screen End Depth: Screen Material: Screen Depth UOM: ft Screen Diameter UOM: inch Screen Diameter:					
<u>Water Details</u>					
Water ID: 1006928500 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006928499 Diameter: Depth From: Depth To: Hole Depth UOM: ft Hole Diameter UOM: inch					
25	1 of 1	ENE/81.7	81.9 / 0.00	1980 Baseline Rd KANATA ON	WWIS
Well ID: 7346096 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:	Abandoned Monitoring and Test Hole			Date Received:	10/30/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z324302			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
 <u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1007697745			Tag No:	
Depth M:				Contractor:	7241
Year Completed:	2019			Latitude:	45.3518185233013
Well Completed Dt:	09/24/2019			Longitude:	-75.7612268363744
Audit No:	Z324302			Y:	45.351818516148995
Path:				X:	-75.76122667396089
 <u>Bore Hole Information</u>					
Bore Hole ID:	1007697745			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440372.00
Code OB Desc:				North83:	5022316.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/24/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1007899680				
Layer:	2				
Plug From:	0.5				
Plug To:	4.0				
Plug Depth UOM:	m				
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1007899679				
Layer:	1				
Plug From:	0.0				
Plug To:	0.5				
Plug Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1007897630			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007901154			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:					
<u>Construction Record - Screen</u>					
Screen ID:		1007901465			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:					
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007902021			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007900398			
Diameter:		6.03000020980835			
Depth From:		0.0			
Depth To:		4.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
26	1 of 1	E/83.6	82.9 / 1.00	1980 BASELINE ROAD lot 35 con 1 Ottawa ON	WWIS
Well ID: 7328522				Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st: Test Hole				Data Entry Status:	
Use 2nd: Monitoring				Data Src:	
Final Well Status: Recharge Well				Date Received: 11/19/2018	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No: Z229639				Contractor: 7241	
Tag: A254667				Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot: 035	
Depth to Bedrock:				Concession: 01	
Well Depth:				Concession Name: RF	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality: NEPEAN TOWNSHIP					
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1007375490				Tag No: A254667	
Depth M: 10.67				Contractor: 7241	
Year Completed: 2018				Latitude: 45.3512435923902	
Well Completed Dt: 08/10/2018				Longitude: -75.7610531689515	
Audit No: Z229639				Y: 45.351243585256455	
Path:				X: -75.76105300726488	
<u>Bore Hole Information</u>					
Bore Hole ID: 1007375490				Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 18	
Code OB:				East83: 440385.00	
Code OB Desc:				North83: 5022252.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed: 08/10/2018				UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Location Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1007670000					
Layer: 1					
Color: 8					
General Color: BLACK					
Material 1:					
Material 1 Desc:					
Material 2: 11					
Material 2 Desc: GRAVEL					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007670001			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		3.3499999046325684			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007670002			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		3.3499999046325684			
Formation End Depth:		7.010000228881836			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007670003			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		7.010000228881836			
Formation End Depth:		10.670000076293945			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007670011			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007670012			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		7.320000171661377			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007670013			
Layer:		3			
Plug From:		7.320000171661377			
Plug To:		10.670000076293945			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007670010			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007669999			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007670006			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		7.619999885559082			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007670007			
Layer:		1			
Slot:		10			
Screen Top Depth:		7.619999885559082			
Screen End Depth:		10.670000076293945			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		1007670005			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007670004			
Diameter:		11.45300006866455			
Depth From:		0.0			
Depth To:		10.670000076293945			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
27	1 of 1	ENE/83.9	81.9 / 0.00	1980 BASE LINE RD. NEPEAN ON	WWIS
Well ID:	7297589			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	10/20/2017
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z257162			Contractor:	7424
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7297589.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	09/28/2017				
Year Completed:	2017				
Depth (m):					
Latitude:	45.3518991881423				
Longitude:	-75.7612789829544				
X:	-75.76127882113902				
Y:	45.35189918135651				
Path:	729\7297589.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1006770597			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440368.00
Code OB Desc:				North83:	5022325.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/28/2017			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006928462			
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006928469			
Layer:		2			
Plug From:		2.0			
Plug To:		21.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1006928468			
Layer:		1			
Plug From:		0.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1006928467			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1006928461			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1006928465			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006928466			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006928464			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006928463			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>28</u>	1 of 1	ENE/84.3	81.9 / 0.00	1980 BASE LINE RD. NEPEAN ON	WWIS
Well ID:	7297591			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	10/20/2017
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z257160			Contractor:	7424
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7297591.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		09/28/2017			
Year Completed:		2017			
Depth (m):					
Latitude:		45.3517381987154			
Longitude:		-75.7611236294864			
X:		-75.76112346745722			
Y:		45.3517381923539			
Path:		729\7297591.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1006770603			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440380.00
Code OB Desc:				North83:	5022307.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/28/2017			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006928489				
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006928496				
Layer:	2				
Plug From:	2.0				
Plug To:	23.0				
Plug Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006928495			
Layer:		1			
Plug From:		0.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006928494			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006928488			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006928492			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006928493			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006928491			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006928490			
Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From: Depth To: Hole Depth UOM: ft Hole Diameter UOM: inch					
29	1 of 1	WSW/87.6	81.9 / 0.00	45.3506963, - 75.7628639 OTTAWA ON	SPL
Ref No: 1-O2SVER Year: Incident Dt: Apr 23,2025 8:00:17 AM Dt MOE Arvl on Scn: MOE Reported Dt: Apr 23,2025 5:28:16 PM Dt Document Closed: May 20,2025 12:54:11 PM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 45.3506963, - 75.7628639 Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northings: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Container/Drum/Tote Incident Cause: Incident Preceding Spill: Overflow/Surcharge Incident Reason: Unknown Incident Summary: Kiewit Eurovia Vinci: 8L oily mixture to gravel, cntd and clnd Environment Impact: Health Env Consequence: Not Anticipated Nature of Impact: Contaminant Qty: 8 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: OILY WATER Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Cleaning Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: URBAN TRANSIT SYSTEMS SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004306933"],"wks":["POINT (-75.7629282751 45.3508847672)"],"creation_date":"2025-04-23"} Time Reported: System Facility Address:					
30	1 of 1	WSW/88.0	81.9 / 0.00	ON	BORE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Borehole ID:	612509			Inclin FLG:	No
OGF ID:	215513816			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	NOV-1963			Municipality:	
Static Water Level:	1.2			Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.350962
Total Depth m:	-999			Longitude DD:	-75.76302
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	440231
Drill Method:				Northing:	5022222
Orig Ground Elev m:	86.1			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	85.7				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218391537			Mat Consistency:	
Top Depth:	13.1			Material Moisture:	
Bottom Depth:	15.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Boulders			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL.				
Geology Stratum ID:	218391535			Mat Consistency:	Compact
Top Depth:	10.7			Material Moisture:	
Bottom Depth:	12.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL. COMPACT.				
Geology Stratum ID:	218391534			Mat Consistency:	Soft
Top Depth:	7.5			Material Moisture:	
Bottom Depth:	10.7			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	CLAY. GREY,SOFT,FRACTURED.				
Geology Stratum ID:	218391538			Mat Consistency:	Dense
Top Depth:	15.2			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stratum Description:		BEDROCK. 3002150190041003100275DENSE. 00000076001200600025009700450065002700014502700 **Note: Many records provided by the department have a truncated [Stratum Description] field.			
Geology Stratum ID:	218391530			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Soil			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SOIL.				
Geology Stratum ID:	218391531			Mat Consistency:	Stiff
Top Depth:	.5			Material Moisture:	
Bottom Depth:	3.8			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	CLAY. BROWN,STIFF,FRACTURED.				
Geology Stratum ID:	218391532			Mat Consistency:	
Top Depth:	3.8			Material Moisture:	
Bottom Depth:	5.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND,SILT. WATER STABLE AT 278.5 FEET.				
Geology Stratum ID:	218391533			Mat Consistency:	Loose
Top Depth:	5.5			Material Moisture:	
Bottom Depth:	7.5			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	CLAY. GREY,LOOSE,FRACTURED.				
Geology Stratum ID:	218391536			Mat Consistency:	Compact
Top Depth:	12.2			Material Moisture:	
Bottom Depth:	13.1			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Till			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	TILL. COMPACT.				
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:				Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: OTTAWA1.txt RecordID: 050170 NTS_Sheet: 31G05C			
Confiden 1:					
<u>Source List</u>					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				

31	1 of 1	ENE/90.1	82.2 / 0.31	1980 BASELINE RD. OTTAWA ON	WWIS
Well ID:	7296608			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	10/05/2017
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z263602			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7296608.pdf				

Additional Detail(s) (Map)

Well Completed Date:	08/21/2017
Year Completed:	2017
Depth (m):	
Latitude:	45.3518014579353
Longitude:	-75.7610861786331
X:	-75.76108601759836
Y:	45.351801451048
Path:	729\7296608.pdf

Bore Hole Information

Bore Hole ID:	1006758934	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440383.00
Code OB Desc:		North83:	5022314.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	08/21/2017	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006954683			
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006954692			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		6.099999904632568			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006954691			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006954690			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006954682			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006954686			
Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM: inch					
Casing Depth UOM: ft					
<u>Construction Record - Screen</u>					
Screen ID: 1006954687					
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM: ft					
Screen Diameter UOM: inch					
Screen Diameter:					
<u>Water Details</u>					
Water ID: 1006954685					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: ft					
<u>Hole Diameter</u>					
Hole ID: 1006954684					
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM: ft					
Hole Diameter UOM: inch					

32	1 of 1	ESE/91.2	82.9 / 1.00	1980 BASELINE AVE lot 35 con 1 Ottawa ON	WWIS
Well ID:	7328499			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z229634			Contractor:	7241
Tag:	A254668			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328499.pdf			
Additional Detail(s) (Map)					
Well Completed Date:	08/09/2018				
Year Completed:	2018				
Depth (m):	7.01				
Latitude:	45.3511810986859				
Longitude:	-75.7609757345772				
X:	-75.76097557341666				
Y:	45.35118109233142				
Path:	732\7328499.pdf				
Bore Hole Information					
Bore Hole ID:	1007375352	Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone:		18	
Code OB:		East83:		440391.00	
Code OB Desc:		North83:		5022245.00	
Open Hole:		Org CS:		UTM83	
Cluster Kind:		UTMRC:		4	
Date Completed:	08/09/2018	UTMRC Desc:		margin of error : 30 m - 100 m	
Remarks:		Location Method:		wwr	
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:	1007668949				
Layer:	1				
Color:	8				
General Color:	BLACK				
Material 1:					
Material 1 Desc:					
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	0.0				
Formation End Depth:	0.3100000023841858				
Formation End Depth UOM:	m				
Overburden and Bedrock					
Materials Interval					
Formation ID:	1007668951				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	66				
Material 3 Desc:	DENSE				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		3.6600000858306885			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007668952			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		06			
Material 3 Desc:		SILT			
Formation Top Depth:		6.099999904632568			
Formation End Depth:		7.010000228881836			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007668950			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		3.6600000858306885			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007668962			
Layer:		3			
Plug From:		3.6600000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007668961			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007668960			
Layer:		1			
Plug From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007668959			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007668948			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007668955			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007668956			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.9600000381469727			
Screen End Depth:		7.010000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007668954			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007668953			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		7.010000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
33	1 of 1	WNW/91.7	80.9 / -1.00	ON	WWIS
Well ID: 7189220 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: M05030 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 10/05/2012 Selected Flag: TRUE Abandonment Rec: Contractor: 6894 Form Version: 5 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
Additional Detail(s) (Map)					
Bore Hole ID: 1004174691 Depth M: Year Completed: Well Completed Dt: Audit No: M05030 Path: Tag No: Contractor: 6894 Latitude: 45.3519508632115 Longitude: -75.7629775940198 Y: 45.35195085639048 X: -75.76297743236633					
Bore Hole Information					
Bore Hole ID: 1004174691 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 440235.00 North83: 5022332.00 Org CS: UTM83 UTMRC: 3 UTMRC Desc: margin of error : 10 - 30 m Location Method: wwr					
34	1 of 1	W/92.4	80.9 / -1.00	Kiewit Eurovia Vinci	SPL
Ottawa ON					
Ref No: 2250-BR9P3U Year: Incident Dt: 2020/07/06 Dt MOE Arvl on Scn: MOE Reported Dt: 2020/07/06 Dt Document Closed: 2020/09/21 Site No: NA Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 2 - Minor Environment Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MOE Response:		No			
Site County/District:					
Site Geo Ref Meth:					
Site District Office:		Ottawa			
Nearest Watercourse:					
Site Name:		Southwest corner of intersection - Baseline Road and Woodroffe Ave<UNOFFICIAL>			
Site Address:					
Site Region:		Eastern			
Site Municipality:		Ottawa			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:		5022252.11			
Easting:		440213.31			
Entity Operating Name:					
Client Name:		Kiewit Eurovia Vinci			
Client Type:		Corporation			
Source Type:		Container/Drum/Tote			
Incident Cause:					
Incident Preceding Spill:		Operator/Human error			
Incident Reason:		Operator/Human Error			
Incident Summary:		KEV: 5L hydraulic oil to gravel; cleaned			
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:		5 L			
Contaminant Qty 1:		5			
Contaminant Unit:		L			
Contaminant Code:		15			
Contaminant Name:		HYDRAULIC OIL			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:		n/a			
Receiving Medium:		Land			
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:		Miscellaneous Industrial			
SAC Action Class:					
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					

35	1 of 1	E/92.5	82.9 / 1.00	1980 BASELINE RD. OTTAWA ON	WWIS
Well ID:		7296609		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Test Hole		Data Entry Status:	
Use 2nd:		Monitoring		Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	10/05/2017
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:		Z263616		Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:		UTM Reliability:			
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/729\7296609.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/21/2017			
Year Completed:		2017			
Depth (m):					
Latitude:		45.3513615354386			
Longitude:		-75.7609143218685			
X:		-75.7609141600973			
Y:		45.351361528134206			
Path:		729\7296609.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1006758937	Elevation:			
DP2BR:		Elevrc:			
Spatial Status:		Zone:		18	
Code OB:		East83:		440396.00	
Code OB Desc:		North83:		5022265.00	
Open Hole:		Org CS:		UTM83	
Cluster Kind:		UTMRC:		4	
Date Completed:	08/21/2017	UTMRC Desc:		margin of error : 30 m - 100 m	
Remarks:		Location Method:		wwr	
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006954694				
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006954703				
Layer:	2				
Plug From:	0.3100000023841858				
Plug To:	6.099999904632568				
Plug Depth UOM:	ft				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006954702			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006954701			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006954693			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006954697			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006954698			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006954696			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006954695			
Diameter:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From: Depth To: Hole Depth UOM: ft Hole Diameter UOM: inch					
36	1 of 1	NNE/94.8	81.9 / 0.00	ON	BORE
Borehole ID: 612529 OGF ID: 215513835 Status: Type: Borehole Use: Completion Date: MAY-1971 Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: 5.6 Depth Ref: Ground Surface Depth Elev: Drill Method: Orig Ground Elev m: 85 Elev Reliabil Note: DEM Ground Elev m: 85.7 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 45.35223 Longitude DD: -75.76176 UTM Zone: 18 Easting: 440331 Northing: 5022362 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218391608 Top Depth: 3.7 Bottom Depth: 3.8 Material Color: Brown Material 1: Clay Material 2: Sand Material 3: Silt Material 4: Gsc Material Description: Stratum Description: CLAY. BROWN,GREY,STIFF.					
Mat Consistency: Stiff Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218391606 Top Depth: 1.9 Bottom Depth: 2 Material Color: Material 1: Silt Material 2: Clay Material 3: Material 4: Gsc Material Description: Stratum Description: SILT. DENSE.					
Mat Consistency: Dense Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218391605 Top Depth: 0 Bottom Depth: 1.9 Material Color: Material 1: Material 2: Asphalt Material 3: Clay Material 4: Sand Gsc Material Description: Stratum Description: ARTIFICIAL.					
Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:		OTTAWA CITY			UTM Reliability:
Municipality:					
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1509083.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/22/1959			
Year Completed:		1959			
Depth (m):		29.5656			
Latitude:		45.351950496516			
Longitude:		-75.7630324841934			
X:		-75.76303232210697			
Y:		45.35195049024414			
Path:		150\1509083.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10031117			Elevation:
DP2BR:					Elevrc:
Spatial Status:					Zone:
Code OB:					East83:
Code OB Desc:					North83:
Open Hole:					Org CS:
Cluster Kind:					UTMRC:
Date Completed:		07/22/1959			UTMRC Desc:
Remarks:					Location Method:
Location Method Desc:		Original Pre1985 UTM Rel Code 5: margin of error : 100 m - 300 m			margin of error : 100 m - 300 m
Elevrc Desc:					p5
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931011413			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		22.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931011415			
Layer:		3			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		50.0			
Formation End Depth:		97.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931011414			
Layer:		2			
Color:					
General Color:					
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		13			
Material 2 Desc:		BOULDERS			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		22.0			
Formation End Depth:		50.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961509083			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10579687			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930054881			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		53.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930054882			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		97.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:	PUMP				
Pump Test ID:	991509083				
Pump Set At:					
Static Level:	35.0				
Final Level After Pumping:	80.0				
Recommended Pump Depth:	80.0				
Pumping Rate:	8.0				
Flowing Rate:					
Recommended Pump Rate:	8.0				
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:	1				
Water State After Test:	CLEAR				
Pumping Test Method:	1				
Pumping Duration HR:	2				
Pumping Duration MIN:	0				
Flowing:	No				
<u>Water Details</u>					
Water ID:	933463878				
Layer:	1				
Kind Code:	1				
Kind:	FRESH				
Water Found Depth:	90.0				
Water Found Depth UOM:	ft				
<u>38</u>	1 of 1	ESE/96.9	82.9 / 1.00	1980 Baseline Rd Ottawa ON	WWIS
Well ID:	7346094			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned Monitoring and Test Hole			Date Received:	10/30/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z324297			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1007697739			Tag No:	
Depth M:				Contractor:	7241
Year Completed:	2019			Latitude:	45.350955659016
Well Completed Dt:	09/24/2019			Longitude:	-75.7610365437506
Audit No:	Z324297			Y:	45.35095565235355

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:				X:	-75.76103638217387
<u>Bore Hole Information</u>					
Bore Hole ID:	1007697739			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440386.00
Code OB Desc:				North83:	5022220.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/24/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1007899676				
Layer:	1				
Plug From:	0.0				
Plug To:	2.0				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1007899675				
Layer:	2				
Plug From:	2.0				
Plug To:	6.199999809265137				
Plug Depth UOM:	m				
<u>Pipe Information</u>					
Pipe ID:	1007897628				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1007901152				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:					
Casing Diameter:	5.199999809265137				
Casing Diameter UOM:	cm				
Casing Depth UOM:					
<u>Construction Record - Screen</u>					
Screen ID:	1007901463				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:					
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007902019			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1007900396			
Diameter:		6.03000020980835			
Depth From:		2.0			
Depth To:		6.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1007900395			
Diameter:		15.239999771118164			
Depth From:		0.0			
Depth To:		2.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
39	1 of 1	E/103.5	82.9 / 1.00	1980 BASE LINE RD lot 35 con 1 NEPEAN ON	WWIS
Well ID:	1535159			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Not Used			Data Entry Status:	
Use 2nd:				Data Src:	1
Final Well Status:	Observation Wells			Date Received:	11/25/2004
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z05457			Contractor:	6032
Tag:	A005119			Form Version:	3
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/153\1535159.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/23/2004			
Year Completed:		2004			
Depth (m):		7.62			
Latitude:		45.3514704777434			
Longitude:		-75.7607753536187			
X:		-75.76077519255625			
Y:		45.351470471009094			
Path:		153\1535159.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		11172911		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440407.00
Code OB Desc:				North83:	5022277.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		07/23/2004		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932969133			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		3.049999952316284			
Formation End Depth:		7.619999885559082			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932969132			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		0.07000000029802322			
Formation End Depth:		3.049999952316284			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932969131			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.07000000029802322			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933253310			
Layer:		2			
Plug From:		1.0			
Plug To:		1.7999999523162842			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		933253309			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961535159			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		11181430			
Casing No:		1			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		930843255			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.30000001192092896			
Depth To:		3.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933409121			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		7.619999885559082			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		5.0			
<u>Hole Diameter</u>					
Hole ID:		11306111			
Diameter:		20.0			
Depth From:		0.0			
Depth To:		7.619999885559082			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
40	1 of 3	SSE/103.7	82.1 / 0.20	LIQUOR CONTROL BOARD OF ONTARIO LCBO STORE #431 1379 WOODROFFE AVE. NEPEAN ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No:	ON0755006			Choice of Contact:	
Approval Years:	95,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6021
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	LIQUOR STORES				
<u>Waste Detail(s)</u>					
Waste Class:	243				
Waste Class Name:	PCB'S				
40	2 of 3	SSE/103.7	82.1 / 0.20	LIQUOR CONTROL BOARD OF ONTARIO LCBO STORE #431 1379 WOODROFFE AVENUE NEPEAN ON K2G 1V7	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON0755006			Choice of Contact:	
Approval Years:	99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6021
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		LIQUOR STORES			
<u>Waste Detail(s)</u>					
Waste Class:	243				
Waste Class Name:	PCB'S				
40	3 of 3	SSE/103.7	82.1 / 0.20	1379 Woodroffe Ave Ottawa ON K2G1V7	EHS
Order No:	20170216160			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	22-FEB-17			Search Radius (km):	.25
Date Received:	16-FEB-17			X:	-75.761806
Previous Site Name:				Y:	45.350458
Lot/Building Size:					
Additional Info Ordered:					
41	1 of 1	ENE/109.3	81.9 / 0.00	1980 Baseline Ottawa ON	WWIS
Well ID:	7382679			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	03/18/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z343136			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/738\7382679.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	01/17/2021				
Year Completed:	2021				
Depth (m):					
Latitude:	45.3520091516178				
Longitude:	-75.7609868320024				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
X:		-75.76098667023145			
Y:		45.35200914524876			
Path:		738\7382679.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1008639025			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440391.00
Code OB Desc:				North83:	5022337.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/17/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1009824342				
Layer:	1				
Plug From:	0.0				
Plug To:	0.3100000023841858				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1009824344				
Layer:	3				
Plug From:	0.9100000262260437				
Plug To:	7.619999885559082				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1009824343				
Layer:	2				
Plug From:	0.3100000023841858				
Plug To:	0.9100000262260437				
Plug Depth UOM:	m				
<u>Pipe Information</u>					
Pipe ID:	1009718261				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1009826393				
Layer:	1				

162 erisinfo.com | Environmental Risk Information Services Order No: 25072400010

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1006251902			Tag No:	
Depth M:				Contractor:	7241
Year Completed:	2016			Latitude:	45.3519467429262
Well Completed Dt:	09/01/2016			Longitude:	-75.7608966314834
Audit No:	Z214945			Y:	45.35194673649888
Path:				X:	-75.76089646953062
<u>Bore Hole Information</u>					
Bore Hole ID:	1006251902			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440398.00
Code OB Desc:				North83:	5022330.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/01/2016			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006469620				
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006469628				
Layer:	1				
Plug From:	0.0				
Plug To:	1.0				
Plug Depth UOM:	ft				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006469629				
Layer:	2				
Plug From:	1.0				
Plug To:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006469627			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006469619			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006469623			
Layer:		1			
Material:		7			
Open Hole or Material:		OTHER			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		2.6700000762939453			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1006469624			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1006469622			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1006469621			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
43	1 of 1	E/111.4	82.9 / 1.00	1980 baeline lot 35 con 1 Ottawa ON	WWIS
Well ID:7328585 Construction Date: Use 1st:Monitoring and Test Hole Use 2nd: Final Well Status:Monitoring and Test Hole Water Type: Casing Material: Audit No:Z229633 Tag:A254669 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality:NEPEAN TOWNSHIP Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received:11/19/2018 Selected Flag:TRUE Abandonment Rec: Contractor:7241 Form Version:7 Owner: County:OTTAWA-CARLETON Lot:035 Concession:01 Concession Name:RF Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328585.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/09/2018			
Year Completed:		2018			
Depth (m):		11.13			
Latitude:		45.3513901527365			
Longitude:		-75.7606721480031			
X:		-75.76067198605259			
Y:		45.351390146088754			
Path:		732\7328585.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007379308			
DP2BR:		Elevation:			
Spatial Status:		Elevrc:			
Code OB:		Zone:18			
Code OB Desc:		East83:440415.00			
Open Hole:		North83:5022268.00			
Cluster Kind:		Org CS:UTM83			
Date Completed:		UTMRC:4			
Remarks:		UTMRC Desc:margin of error : 30 m - 100 m			
Location Method Desc:		Location Method:wwr			
Elevrc Desc:		on Water Well Record			
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007702192			
Layer:		1			
Color:		8			
General Color:		BLACK			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702195			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		3.9600000381469727			
Formation End Depth:		9.140000343322754			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702193			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.130000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702194			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		05			
Material 3 Desc:		CLAY			
Formation Top Depth:		2.130000114440918			
Formation End Depth:		3.9600000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1007702196			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		9.140000343322754			
Formation End Depth:		11.130000114440918			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702419			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702421			
Layer:		3			
Plug From:		7.769999980926514			
Plug To:		11.130000114440918			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702420			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		7.769999980926514			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007702610			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007701930			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007702635			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		8.079999923706055			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007702753			
Layer:		1			
Slot:		10			
Screen Top Depth:		8.079999923706055			
Screen End Depth:		11.130000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007702780			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1007702530			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		11.130000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

44	1 of 1	ENE/113.2	81.9 / 0.00	1980 BASELINE ROAD Ottawa ON	WWIS
Well ID:	7328501			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z290593			Contractor:	7241
Tag:	A254666			Form Version:	7

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB	
Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Owner: County: Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	OTTAWA-CARLETON	
<u>Additional Detail(s) (Map)</u>						
Bore Hole ID: Depth M: Year Completed: Well Completed Dt: Audit No: Path:	1007375358 7.01 2018 08/21/2018 Z290593	Tag No: Contractor: Latitude: Longitude: Y: X:				A254666 7241 45.352054239543 -75.7609746699512 45.35205423323446 -75.76097450794101
<u>Bore Hole Information</u>						
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1007375358 08/21/2018 on Water Well Record	Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:				 18 440392.00 5022342.00 UTM83 4 margin of error : 30 m - 100 m wwr
<u>Overburden and Bedrock</u>						
<u>Materials Interval</u>						
Formation ID: Layer: Color: General Color: Material 1: Material 1 Desc: Material 2: Material 2 Desc: Material 3: Material 3 Desc: Formation Top Depth: Formation End Depth: Formation End Depth UOM:	1007668987 3 2 GREY 05 CLAY 06 SILT 66 DENSE 2.440000057220459 5.489999771118164 m					
<u>Overburden and Bedrock</u>						
<u>Materials Interval</u>						
Formation ID: Laver:	1007668985 1					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007668988			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		5.489999771118164			
Formation End Depth:		7.010000228881836			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007668986			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007668996			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007668997			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.6600000858306885			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007668998			
Layer:		3			
Plug From:		3.6600000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007668995			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007668984			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007668991			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007668992			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.9600000381469727			
Screen End Depth:		7.010000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007668990			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: 1007668989 Diameter: 11.430000305175781 Depth From: 0.0 Depth To: 7.010000228881836 Hole Depth UOM: m Hole Diameter UOM: cm					
45	1 of 1	ESE/114.1	82.9 / 1.00	1980 Baseline Road lot 35 con 1 Ottawa ON	WWIS
Well ID: 7329944 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z305259 Tag: A263032 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info: PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7329944.pdf					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status:					
Data Src:					
Date Received: 03/15/2019					
Selected Flag: TRUE					
Abandonment Rec:					
Contractor: 7241					
Form Version: 7					
Owner:					
County: OTTAWA-CARLETON					
Lot: 035					
Concession: 01					
Concession Name: RF					
Easting NAD83:					
Northing NAD83:					
Zone:					
UTM Reliability:					
Additional Detail(s) (Map)					
Well Completed Date: 01/24/2019 Year Completed: 2019 Depth (m): 7.62 Latitude: 45.3510025327991 Longitude: -75.7607563180123 X: -75.76075615640308 Y: 45.35100252648752 Path: 732\7329944.pdf					
Bore Hole Information					
Bore Hole ID: 1007410848 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 01/24/2019 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 440408.00 North83: 5022225.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007800360			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007800361			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		12			
Material 3 Desc:		STONES			
Formation Top Depth:		8.0			
Formation End Depth:		25.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007801644			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007801646			
Layer:		3			
Plug From:		14.0			
Plug To:		25.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007801645			
Layer:		2			
Plug From:		1.0			
Plug To:		14.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007803064			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007798853			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007803311			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		15.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		1007803312			
Layer:		2			
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		Inch			
Casing Depth UOM:					
<u>Construction Record - Screen</u>					
Screen ID:		1007803978			
Layer:		1			
Slot:		10			
Screen Top Depth:		15.0			
Screen End Depth:		25.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007804591			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Recommended Pump Rate: Levels UOM: ft Rate UOM: GPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1007802446 Diameter: 8.0 Depth From: 0.0 Depth To: 25.0 Hole Depth UOM: ft Hole Diameter UOM: Inch					
46	1 of 1	NW/123.1	80.9 / -1.00	ON	BORE
Borehole ID: 612528 OGF ID: 215513834 Status: Type: Borehole Use: Completion Date: NOV-1963 Static Water Level: 1.8 Primary Water Use: Sec. Water Use: Total Depth m: -999 Depth Ref: Ground Surface Depth Elev: Drill Method: Orig Ground Elev m: 83.6 Elev Reliabil Note: DEM Ground Elev m: 82.1 Concession: Location D: Survey D: Comments:					
Inclin FLG: No SP Status: Initial Entry Surv Elev: No Piezometer: No Primary Name: Municipality: Lot: Township: Latitude DD: 45.352221 Longitude DD: -75.763164 UTM Zone: 18 Easting: 440221 Northing: 5022362 Location Accuracy: Accuracy: Not Applicable					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID: 218391600 Top Depth: 0 Bottom Depth: 6.1 Material Color: Brown Material 1: Clay Material 2: Silt Material 3: Sand Material 4: Gsc Material Description: Stratum Description: CLAY. BROWN,HARD,FRACTURED.					
Mat Consistency: Hard Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen:					
Geology Stratum ID: 218391604 Top Depth: 10.1 Bottom Depth: Material Color: Material 1: Bedrock Material 2: Material 3:					
Mat Consistency: Dense Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 4: Gsc Material Description: Stratum Description:				Depositional Gen: BEDROCK. AND. VERY DENSE. 00000 027 00025 027 00036 038 00075 043 00150 015 **Note: Many records provided by the department have a truncated [Stratum Description] field.	
Geology Stratum ID: 218391601 Top Depth: 6.1 Bottom Depth: 6.9 Material Color: Material 1: Sand Material 2: Silt Material 3: Material 4: Gsc Material Description: Stratum Description:				Mat Consistency: Material Moisture: Material Texture: Non Geo Mat Type: Geologic Formation: Geologic Group: Geologic Period: Depositional Gen: 	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z229641			Contractor:	7241
Tag:	A254664			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328571.pdf			

Additional Detail(s) (Map)

Well Completed Date: 08/22/2018
Year Completed: 2018
Depth (m): 10.06
Latitude: 45.3516789362693
Longitude: -75.7605611204877
X: -75.76056095878731
Y: 45.35167892902252
Path: 732\7328571.pdf

Bore Hole Information

Bore Hole ID:	1007378985	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440424.00
Code OB Desc:		North83:	5022300.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	08/22/2018	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID: 1007637478
Layer: 1
Color: 8
General Color: BLACK
Material 1:
Material 1 Desc:
Material 2: 11
Material 2 Desc: GRAVEL
Material 3: 66

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007637479			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007637481			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		7.619999885559082			
Formation End Depth:		10.0600004196167			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007637480			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		2.440000057220459			
Formation End Depth:		7.619999885559082			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007637613			
Layer:		2			
Plug From:		0.3100000023841858			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		6.710000038146973			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637614			
Layer:		3			
Plug From:		6.710000038146973			
Plug To:		10.0600004196167			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637489			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007637488			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007637477			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007637484			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		7.010000228881836			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007637485			
Layer:		1			
Slot:		10			
Screen Top Depth:		7.010000228881836			
Screen End Depth:		10.0600004196167			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Water Details</u>					
Water ID:		1007637483			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007637482			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		10.0600004196167			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>48</u>	1 of 1	E/124.1	82.9 / 1.00	ON	WWIS
Well ID:	7406937			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	12/29/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z368032			Contractor:	7241
Tag:	A320464			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008904461			Tag No:	A320464
Depth M:				Contractor:	7241
Year Completed:	2021			Latitude:	45.3511118149432
Well Completed Dt:	11/18/2021			Longitude:	-75.7605662904256
Audit No:	Z368032			Y:	45.351111808428115
Path:				X:	-75.76056612863817
<u>Bore Hole Information</u>					
Bore Hole ID:	1008904461			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440423.00
Code OB Desc:				North83:	5022237.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/18/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Additional Detail(s) (Map)

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008290			
Layer:		1			
Color:		3			
General Color:		BLUE			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		32.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		931008291			
Layer:		2			
Color:		8			
General Color:		BLACK			
Material 1:		17			
Material 1 Desc:		SHALE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		32.0			
Formation End Depth:		272.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961507889			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578494			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052505			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		272.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		930052504			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		35.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991507889			
Pump Set At:					
Static Level:		30.0			
Final Level After Pumping:		100.0			
Recommended Pump Depth:		100.0			
Pumping Rate:		2.0			
Flowing Rate:					
Recommended Pump Rate:		2.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462175			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		150.0			
Water Found Depth UOM:		ft			
50	1 of 1	SSE/127.8	82.8 / 0.95	ON	WWIS
Well ID:	7406933			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	12/29/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z368029			Contractor:	7241
Tag:	A320468			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Municipality: Site Info:		OTTAWA CITY			
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008904083			Tag No:	A320468
Depth M:				Contractor:	7241
Year Completed:	2021			Latitude:	45.3503313010013
Well Completed Dt:	11/10/2021			Longitude:	-75.7615260475255
Audit No:	Z368029			Y:	45.35033129451972
Path:				X:	-75.76152588663942
<u>Bore Hole Information</u>					
Bore Hole ID:	1008904083			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440347.00
Code OB Desc:				North83:	5022151.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/10/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>51</u>	1 of 1	E/129.1	82.9 / 1.00	1980 BASELINE ROAD lot 35 con 1 Ottawa ON	WWIS
Well ID:	7328500			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z290590			Contractor:	7241
Tag:	A254689			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328500.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/17/2018				
Year Completed:	2018				
Depth (m):	7.01				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:		45.351292591465			
Longitude:		-75.7604538164203			
X:		-75.76045365419662			
Y:		45.35129258408804			
Path:		732\7328500.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1007375355			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440432.00
Code OB Desc:				North83:	5022257.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/17/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007668968				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	2.130000114440918				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007668970				
Layer:	4				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	5.489999771118164				
Formation End Depth:	7.010000228881836				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007668967			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007668969			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		2.130000114440918			
Formation End Depth:		5.489999771118164			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007668980			
Layer:		3			
Plug From:		3.6600000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007668979			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007668978			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007668977			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007668966			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007668973			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007668974			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.9600000381469727			
Screen End Depth:		7.010000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007668972			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007668971			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		7.010000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>52</u>	1 of 1	ESE/131.9	82.9 / 1.00	1980 Baseline Rd Ottawa ON	WWIS
Well ID:		7346093		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Abandoned Monitoring and Test Hole		Date Received:	10/30/2019

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Type: Casing Material: Audit No: Z324296 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:				Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1007697736 Depth M: Year Completed: 2019 Well Completed Dt: 09/24/2019 Audit No: Z324296 Path:				Tag No: Contractor: 7241 Latitude: 45.3508957160872 Longitude: -75.7605761620156 Y: 45.350895708925506 X: -75.7605760002399	
<u>Bore Hole Information</u>					
Bore Hole ID: 1007697736 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 09/24/2019 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:				Elevation: Elevrc: Zone: 18 East83: 440422.00 North83: 5022213.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr	
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1007899674 Layer: 2 Plug From: 0.5 Plug To: 6.199999809265137 Plug Depth UOM: m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1007899673 Layer: 1 Plug From: 0.0 Plug To: 0.5 Plug Depth UOM: m					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1007897627			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007901151			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:					
<u>Construction Record - Screen</u>					
Screen ID:		1007901462			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:					
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007902018			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007900394			
Diameter:		6.03000020980835			
Depth From:		0.0			
Depth To:		6.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
53	1 of 1	SSE/136.1	82.8 / 0.95	1980 BASELINE ROAD lot 35 con 2	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OTTAWA ON					
Well ID:	7328553			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z290597			Contractor:	7241
Tag:	A254619			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035
Depth to Bedrock:				Concession:	02
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328553.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/29/2018				
Year Completed:	2018				
Depth (m):	7.01				
Latitude:	45.350287149151				
Longitude:	-75.7613977961282				
X:	-75.76139763421253				
Y:	45.35028714201859				
Path:	732\7328553.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1007377849			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440357.00
Code OB Desc:				North83:	5022146.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/29/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007636554				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	05				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		2.440000057220459			
Formation End Depth:		7.010000228881836			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007636553			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007636552			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007636562			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007636563			
Layer:		3			
Plug From:		3.6600000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1007636561			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007636560			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007636551			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007636557			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007636558			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.9600000381469727			
Screen End Depth:		7.010000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007636556			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007636555			
Diameter:		11.430000305175781			
Depth From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth To:		7.010000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
54	1 of 1	ENE/143.9	82.9 / 1.03	ON	WWIS
Well ID:		7406939		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	
Water Type:				Selected Flag:	
Casing Material:				Abandonment Rec:	
Audit No:		Z368026		Contractor:	
Tag:		A320462		Form Version:	
Constructn Method:				Owner:	
Elevation (m):				County:	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:		1008904467		Tag No:	
Depth M:				Contractor:	
Year Completed:		2021		Latitude:	
Well Completed Dt:		11/24/2021		Longitude:	
Audit No:		Z368026		Y:	
Path:				X:	
<u>Bore Hole Information</u>					
Bore Hole ID:		1008904467		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		11/24/2021		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
55	1 of 1	ESE/144.3	82.9 / 1.00	1980 Baseline Rd Ottawa ON	WWIS
Well ID:		7346090		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:	Abandoned Monitoring and Test Hole			Date Received:	10/30/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z324293			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					

Additional Detail(s) (Map)

Bore Hole ID:	1007697727	Tag No:	
Depth M:		Contractor:	7241
Year Completed:	2019	Latitude:	45.350969165588
Well Completed Dt:	09/24/2019	Longitude:	-75.7603601224364
Audit No:	Z324293	Y:	45.3509691590273
Path:		X:	-75.76035995997097

Bore Hole Information

Bore Hole ID:	1007697727	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440439.00
Code OB Desc:		North83:	5022221.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	09/24/2019	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Annular Space/Abandonment Sealing Record

Plug ID:	1007899669
Layer:	2
Plug From:	2.0
Plug To:	3.0
Plug Depth UOM:	m

Annular Space/Abandonment Sealing Record

Plug ID:	1007899668
Layer:	1
Plug From:	0.0
Plug To:	2.0
Plug Depth UOM:	m

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1007897624			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007901148			
Layer:		2			
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		cm			
Casing Depth UOM:					
<u>Construction Record - Casing</u>					
Casing ID:		1007901147			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:					
<u>Construction Record - Screen</u>					
Screen ID:		1007901459			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:					
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007902015			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007900390			
Diameter:		6.03000020980835			
Depth From:		2.0			
Depth To:		3.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007900389			
Diameter:		15.239999771118164			
Depth From:		0.0			
Depth To:		2.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
56	1 of 1	E/144.6	82.9 / 1.00	ON	WWIS
Well ID:	7406935			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	12/29/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z368030			Contractor:	7241
Tag:	A320466			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008904455			Tag No:	A320466
Depth M:				Contractor:	7241
Year Completed:	2021			Latitude:	45.3515908852273
Well Completed Dt:	11/09/2021			Longitude:	-75.7602663179966
Audit No:	Z368030			Y:	45.3515908779734
Path:				X:	-75.76026615607071
<u>Bore Hole Information</u>					
Bore Hole ID:	1008904455			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440447.00
Code OB Desc:				North83:	5022290.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Completed: 11/09/2021 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
UTMRC Desc: margin of error : 30 m - 100 m Location Method: www					
57	1 of 11	NE/150.1	81.9 / 0.00	ALGONQUIN ANIMAL HOSPITAL 1945 BASELINE ROAD OTTAWA ON K2C 0C7	GEN
<u>Generator Info</u>					
Generator No: ON0828600 Approval Years: 03,04,05,06,07,08 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
<u>Waste Detail(s)</u>					
Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
57	2 of 11	NE/150.1	81.9 / 0.00	ALGONQUIN ANIMAL HOSPITAL 1945 BASELINE ROAD OTTAWA ON K2C 0C7	GEN
<u>Generator Info</u>					
Generator No: ON0828600 Approval Years: 2009 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Veterinary Services					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 541940					
<u>Waste Detail(s)</u>					
Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
57	3 of 11	NE/150.1	81.9 / 0.00	ALGONQUIN ANIMAL HOSPITAL 1945 BASELINE ROAD OTTAWA ON	GEN
Generator Info					
Generator No:		ON0828600		Choice of Contact:	
Approval Years:		2013		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	541940
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		VETERINARY SERVICES			
Waste Detail(s)					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Detail(s)					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
57	4 of 11	NE/150.1	81.9 / 0.00	ALGONQUIN ANIMAL HOSPITAL 1945 BASELINE ROAD OTTAWA ON K2C 0C7	GEN
Generator Info					
Generator No:		ON0828600		Choice of Contact:	CO_OFFICIAL
Approval Years:		2016		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	541940
Country:		Canada			
Co Admin:		Tama Scott-Snyder			
Phone No Admin:		6132245701 Ext.			
SIC Description:		VETERINARY SERVICES			
Waste Detail(s)					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
Waste Detail(s)					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
Waste Detail(s)					
Waste Class:		261			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		PHARMACEUTICALS			
57	5 of 11	NE/150.1	81.9 / 0.00	ALGONQUIN ANIMAL HOSPITAL 1945 BASELINE ROAD OTTAWA ON K2C 0C7	GEN
<u>Generator Info</u>					
Generator No:	ON0828600			Choice of Contact:	CO_OFFICIAL
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	541940
Country:	Canada				
Co Admin:	Tama Scott-Snider				
Phone No Admin:	6132245701 Ext.				
SIC Description:	VETERINARY SERVICES				
<u>Waste Detail(s)</u>					
Waste Class:	312				
Waste Class Name:	PATHOLOGICAL WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	261				
Waste Class Name:	PHARMACEUTICALS				
57	6 of 11	NE/150.1	81.9 / 0.00	ALGONQUIN ANIMAL HOSPITAL 1945 BASELINE ROAD OTTAWA ON K2C 0C7	GEN
<u>Generator Info</u>					
Generator No:	ON0828600			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	541940
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:	VETERINARY SERVICES				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	261				
Waste Class Name:	PHARMACEUTICALS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
57	9 of 11	NE/150.1	81.9 / 0.00	ALGONQUIN ANIMAL HOSPITAL 1945 BASELINE ROAD OTTAWA ON K2C 0C7	GEN

Generator Info

Generator No:	ON0828600	Choice of Contact:
Approval Years:	As of Nov 2021	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	Pharmaceuticals

57	10 of 11	NE/150.1	81.9 / 0.00	ALGONQUIN ANIMAL HOSPITAL 1945 BASELINE ROAD OTTAWA ON	GEN

Generator Info

Generator No:	ON0828600	Choice of Contact:
Approval Years:	As of Oct 2022	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	261 A
Waste Class Name:	PHARMACEUTICALS

Generator Info as of Dec 2024

Generator No:	ON0828600
Generator Company Name:	ALGONQUIN ANIMAL HOSPITAL
Street:	1945 BASELINE ROAD
City:	OTTAWA

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2C0C7			
Waste Class:		261 A, 312 P			
Waste Class Decoded:					
261 - PHARMACEUTICALS; 312 - PATHOLOGICAL WASTES					
Generator Info as of Dec 2024					
Generator No:		ON0828600			
Generator Company Name:		ALGONQUIN ANIMAL HOSPITAL			
Street:		1945 BASELINE ROAD			
City:		OTTAWA			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2C0C7			
Waste Class:		312 P,261 A,312 P			
Waste Class Decoded:					
312 - PATHOLOGICAL WASTES; 261 - PHARMACEUTICALS; 312 - PATHOLOGICAL WASTES					
2017 Generator Info					
Gen No:	ON0828600	Choice of Contact:	CO_OFFICIAL		
ID:	5240	Phone No Official:	613 224-5701 Ext.		
Contaminated Fac:	N	Phone No Admin:	6132245701 Ext.		
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)		
NAICS Code1:	541940	County Out:			
NAICS Code2:		District:	402		
NAICS Code3:					
Gen Name:	ALGONQUIN ANIMAL HOSPITAL				
Gen Div:					
Gen Op Name:	ALGONQUIN ANIMAL HOSPITAL				
Gen Op Div:					
Site Adrs1:	1945 BASELINE ROAD				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	OTTAWA				
Province Out:					
Site Postal Code:	K2C 0C7				
Site Country:	Canada				
Co Official:	Kevin McIntosh				
Co Admin:	Tama Scott-Snider				
2017 Generator Manifest					
ID:	19964	Sum Received Qty:	130.0		
Generator No:	ON0828600	Waste Class Name:	PATHOLOGICAL WASTES		
Receiver Type:	035	Count Manifests:	8		
Waste Char:	P	District:	302		
Waste Code:	312				
2018 Generator Info					
Gen No:	ON0828600	Choice of Contact:	CO OFFICIAL		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ID:	5114			Phone No Official:	613 224-5701 Ext.
Contaminated Fac:	N			Phone No Admin:	6132245701 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	541940			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		ALGONQUIN ANIMAL HOSPITAL			
Gen Div:					
Gen Op Name:		ALGONQUIN ANIMAL HOSPITAL			
Gen Op Div:					
Site Adrs1:		1945 BASELINE ROAD			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K2C 0C7			
Site Country:		Canada			
Co Official:		Kevin McIntosh			
Co Admin:		Tama Scott-Snyder			
<u>2018 Generator Manifest</u>					
ID:	19684			Sum Received Qty:	149.5
Generator No:	ON0828600			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	7
Waste Char:	P			District:	302
Waste Code:	312				
<u>2019 Generator Info</u>					
Gen No:	ON0828600			Choice of Contact:	CO_OFFICIAL
ID:	4981			Phone No Official:	613 224-5701 Ext.
Contaminated Fac:	N			Phone No Admin:	6132245701 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	541940			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		ALGONQUIN ANIMAL HOSPITAL			
Gen Div:					
Gen Op Name:		ALGONQUIN ANIMAL HOSPITAL			
Gen Op Div:					
Site Adrs1:		1945 BASELINE ROAD			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K2C 0C7			
Site Country:		Canada			
Co Official:		Kevin McIntosh			
Co Admin:		Tama Scott-Snyder			
<u>2019 Generator Manifest</u>					
ID:	19295			Sum Received Qty:	180.0
Generator No:	ON0828600			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	13
Waste Char:	P			District:	302
Waste Code:	312				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2020 Generator Info</u>					
Gen No:	ON0828600			Choice of Contact:	CO_OFFICIAL
ID:	4829			Phone No Official:	613 224-5701 Ext.
Contaminated Fac:	N			Phone No Admin:	6132245701 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	541940			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	ALGONQUIN ANIMAL HOSPITAL				
Gen Div:					
Gen Op Name:	ALGONQUIN ANIMAL HOSPITAL				
Gen Op Div:					
Site Adrs1:	1945 BASELINE ROAD				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	OTTAWA				
Province Out:					
Site Postal Code:	K2C 0C7				
Site Country:	Canada				
Co Official:	Kevin McIntosh				
Co Admin:	Tama Scott-Snider				
<u>2020 Generator Manifest</u>					
ID:	17252			Sum Received Qty:	112.9
Generator No:	ON0828600			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	7
Waste Char:	P			District:	302
Waste Code:	312				
<u>2021 Generator Info</u>					
Gen No:	ON0828600			Choice of Contact:	CO_OFFICIAL
ID:	4731			Phone No Official:	613 224-5701 Ext.
Contaminated Fac:	N			Phone No Admin:	6132245701 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	541940			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	ALGONQUIN ANIMAL HOSPITAL				
Gen Div:					
Gen Op Name:	ALGONQUIN ANIMAL HOSPITAL				
Gen Op Div:					
Site Adrs1:	1945 BASELINE ROAD				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	OTTAWA				
Province Out:					
Site Postal Code:	K2C 0C7				
Site Country:	Canada				
Co Official:	Kevin McIntosh				
Co Admin:	Tama Scott-Snider				
<u>2021 Generator Manifest</u>					
ID:	17576			Sum Received Qty:	15.0
Generator No:	ON0828600			Waste Class Name:	PHARMACEUTICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiver Type:	035			Count Manifests:	1
Waste Char:	A			District:	302
Waste Code:	261				
<u>2021 Generator Manifest</u>					
ID:	17577			Sum Received Qty:	125.0
Generator No:	ON0828600			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	6
Waste Char:	P			District:	302
Waste Code:	312				
57	11 of 11	NE/150.1	81.9 / 0.00	Algonquin Animal Hospital 1945 Baseline Road Ottawa ON	GEN
<u>Generator Info as of Dec 2024</u>					
Generator No:	ON001068376				
Generator Company Name:	Algonquin Animal Hospital				
Street:	1945 Baseline Road				
City:	Ottawa				
Province State:	Ontario				
Country:	Canada				
Postal Code:	K2C 0C7				
Waste Class:	312 P,261 A,312 P				
Waste Class Decoded:					
312 - PATHOLOGICAL WASTES; 261 - PHARMACEUTICALS; 312 - PATHOLOGICAL WASTES					
58	1 of 2	SSE/150.9	82.2 / 0.31	ALGONQUIN ANIMAL HOSPITAL 1369 WOODROFE AVENUE NEPEAN ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No:	ON0828600				
Approval Years:	86,87,88,89,90,97,98,99,00,01				
Status:					
PO Box No:					
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	*** NOT DEFINED ***				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	312				
Waste Class Name:	PATHOLOGICAL WASTES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
58	2 of 2	SSE/150.9	82.2 / 0.31	ALGONQUIN ANIMAL HOSPITAL 02-224 1369 WOODROFE AVENUE NEPEAN ON K2G 1V7	GEN

Generator Info

Generator No:	ON0828600	Choice of Contact:	
Approval Years:	92,93,94,95,96	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	0211
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	VETERINARY SERVICE		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

59	1 of 1	ESE/157.5	82.9 / 1.00	1850 Baseline Rd Ottawa ON K2C 3Z6	EHS
Order No:	21071900556	Nearest Intersection:			
Status:	C	Municipality:			
Report Type:	Custom Report	Client Prov/State:	ON		
Report Date:	26-AUG-21	Search Radius (km):	.25		
Date Received:	19-JUL-21	X:	-75.76018343		
Previous Site Name:		Y:	45.35096816		
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; Aerial Photos				

60	1 of 1	NNW/157.9	80.9 / -1.00	BEL-AIR PARK lot 26 con 2 Ottawa ON	WWIS
Well ID:	7318407	Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:	Test Hole	Data Entry Status:			
Use 2nd:	Monitoring	Data Src:			
Final Well Status:	Test Hole	Date Received:	08/31/2018		
Water Type:		Selected Flag:	TRUE		
Casing Material:		Abandonment Rec:			
Audit No:	Z290611	Contractor:	7241		
Tag:	A251625	Form Version:	7		
Constructn Method:		Owner:			
Elevation (m):		County:	OTTAWA-CARLETON		
Elevatn Reliability:		Lot:	026		
Depth to Bedrock:		Concession:	02		
Well Depth:		Concession Name:	OF		
Overburden/Bedrock:		Easting NAD83:			
Pump Rate:		Northing NAD83:			
Static Water Level:		Zone:			
Clear/Cloudy:		UTM Reliability:			
Municipality:	NEPEAN TOWNSHIP				
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7318407.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		06/20/2018			
Year Completed:		2018			
Depth (m):		6.2			
Latitude:		45.3527813880903			
Longitude:		-75.7626185259674			
X:		-75.76261836411764			
Y:		45.35278138149156			
Path:		731\7318407.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007283757		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		06/20/2018		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				wwr	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007459258			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007459257			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007459259			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		6.199999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007459269			
Layer:		3			
Plug From:		2.7899999618530273			
Plug To:		6.199999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007459268			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.7899999618530273			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007459267			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007459266			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007459256			
Casing No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Comment: Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007459262			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007459263			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.199999809265137			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007459261			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007459260			
Diameter:		11.399999618530273			
Depth From:		0.0			
Depth To:		6.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
61	1 of 1	SSE/158.1	82.2 / 0.31	ON	WWIS
Well ID:	7387054			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	04/23/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	C00668			Contractor:	1119
Tag:	A261040			Form Version:	6
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			OTTAWA CITY	Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008670739			Tag No:	A261040
Depth M:				Contractor:	1119
Year Completed:	2018			Latitude:	45.3500151742819
Well Completed Dt:	11/13/2018			Longitude:	-75.7616877643138
Audit No:	C00668			Y:	45.3500151669986
Path:				X:	-75.76168760222843
<u>Bore Hole Information</u>					
Bore Hole ID:	1008670739			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440334.00
Code OB Desc:				North83:	5022116.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/13/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
62	1 of 1	ESE/163.8	82.9 / 1.00	1980 BASELINE RD lot 35 con 1 Ottawa ON	WWIS
Well ID:	7328502			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z290594			Contractor:	7241
Tag:	A254665			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328502.pdf				
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		08/21/2018			
Year Completed:		2018			
Depth (m):		7.1			
Latitude:		45.3507088286266			
Longitude:		-75.7602545082069			
X:		-75.7602543459984			
Y:		45.35070882221367			
Path:		732\7328502.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1007375361			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440447.00
Code OB Desc:				North83:	5022192.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/21/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007669026				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	3.0999999046325684				
Formation End Depth:	5.739999771118164				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007669025				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	3.0999999046325684				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007669027			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		5.739999771118164			
Formation End Depth:		7.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007669024			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007669036			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.859999895095825			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007669037			
Layer:		3			
Plug From:		3.6600000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007669035			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007669034			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007669023			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007669030			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007669031			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.9600000381469727			
Screen End Depth:		7.010000228881836			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007669029			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007669028			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		7.010000228881836			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
63	1 of 1	SSW/164.0	81.9 / 0.00	KIEWIT EUROVIA VINCI OTTAWA PARTNERSHIP OTTAWA ON	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ref No:	1-2AYIM5			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	12/7/2022 3:00:00 PM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	12/9/2022 10:02:29 AM			Impact to Health:	0 No Impact
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:	Desktop Response				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa District Office				
Nearest Watercourse:	no				
Site Name:					
Site Address:					
Site Region:					
Site Municipality:	OTTAWA				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:	KIEWIT EUROVIA VINCI OTTAWA PARTERSHIP				
Client Type:	Private Business				
Source Type:	Truck - Transport/Hauling				
Incident Cause:					
Incident Preceding Spill:	Leak/Break				
Incident Reason:					
Incident Summary:	OLRT: 5 L hydraulic oil spill to gravel, cntd & clnd				
Environment Impact:	1 Minor Impact				
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	5 litre (L)				
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:	HYDRAULIC OIL				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:	Land				
Activity Preceding Spill:					
Property 2nd Watershed:	Central Ottawa				
Property Tertiary Watershed:	02KF-Central Ottawa - Mississippi				
Sector Type:	CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING				
SAC Action Class:					
Call Report Locatn Geodata:	{ "integration_ids":["PR00003889180"],"wks":["POINT (-75.7629100000 45.3500500000)"],"creation_date":"2022-12-09" }				
Time Reported:					
System Facility Address:					

64	1 of 1	SE/164.8	82.9 / 1.00	ON	WWIS
Well ID:	7406940	Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:		Data Entry Status:	Yes		
Use 2nd:		Data Src:			
Final Well Status:		Date Received:	12/29/2021		
Water Type:		Selected Flag:	TRUE		
Casing Material:		Abandonment Rec:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Audit No:	Z368025			Contractor:	7241
Tag:	A320461			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					

Additional Detail(s) (Map)

Bore Hole ID:	1008904470	Tag No:	A320461
Depth M:		Contractor:	7241
Year Completed:	2021	Latitude:	45.3503008278497
Well Completed Dt:	11/03/2021	Longitude:	-75.7606958533044
Audit No:	Z368025	Y:	45.3503008211982
Path:		X:	-75.76069569177918

Bore Hole Information

Bore Hole ID:	1008904470	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440412.00
Code OB Desc:		North83:	5022147.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	11/03/2021	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

65	1 of 1	ESE/165.2	82.9 / 1.00	1980 Baseline Road Ottawa ON	WWIS
Well ID:	7337704	Flowing (Y/N):			
Construction Date:		Flow Rate:			
Use 1st:	Monitoring and Test Hole	Data Entry Status:			
Use 2nd:		Data Src:			
Final Well Status:	Test Hole	Date Received:	05/28/2019		
Water Type:		Selected Flag:	TRUE		
Casing Material:		Abandonment Rec:			
Audit No:	Z311190	Contractor:	7241		
Tag:	A254661	Form Version:	7		
Constructn Method:		Owner:			
Elevation (m):		County:	OTTAWA-CARLETON		
Elevatn Reliability:		Lot:			
Depth to Bedrock:		Concession:			
Well Depth:		Concession Name:			
Overburden/Bedrock:		Easting NAD83:			
Pump Rate:		Northing NAD83:			
Static Water Level:		Zone:			
Clear/Cloudy:		UTM Reliability:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/733\7337704.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/24/2018			
Year Completed:		2018			
Depth (m):		12			
Latitude:		45.350400854318			
Longitude:		-75.7605440018337			
X:		-75.76054384060535			
Y:		45.35040084699441			
Path:		733\7337704.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007528427	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		18
Code OB:			East83:		440424.00
Code OB Desc:			North83:		5022158.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		4
Date Completed:		08/24/2018	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:			Location Method:		wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007866354			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007866355			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:		GRAVEL			
Material 3:		79			
Material 3 Desc:		PACKED			
Formation Top Depth:		1.5			
Formation End Depth:		12.0			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007866356			
Layer:		3			
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		12.0			
Formation End Depth:					
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007867568			
Layer:		3			
Plug From:		8.800000190734863			
Plug To:		12.0			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007867566			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007867567			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		8.800000190734863			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007868964			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID:		1007864842			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007869314			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		9.0			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1007869764			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.0			
Screen End Depth:		12.0			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007870378			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1007868477			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		12.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
66	1 of 1	E/166.0	82.9 / 1.00	1980 Baseline Road lot 35 con 1 Ottawa ON	WWIS
Well ID:	7329945			Flowing (Y/N):	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:				Date Received: 03/15/2019	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:	Z305258			Contractor: 7241	
Tag:	A263033			Form Version: 7	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot: 035	
Depth to Bedrock:				Concession: 01	
Well Depth:				Concession Name: RF	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7329945.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	01/25/2019				
Year Completed:	2019				
Depth (m):	11.5824				
Latitude:	45.351286734612				
Longitude:	-75.7599813903145				
X:	-75.75998122854907				
Y:	45.351286728146334				
Path:	732\7329945.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1007410851			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone: 18	
Code OB:				East83: 440469.00	
Code OB Desc:				North83: 5022256.00	
Open Hole:				Org CS: UTM83	
Cluster Kind:				UTMRC: 4	
Date Completed:	01/25/2019			UTMRC Desc: margin of error : 30 m - 100 m	
Remarks:				Location Method: wwr	
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1007800363				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:		8.0			
Formation End Depth:		32.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007800364			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		12			
Material 2 Desc:		STONES			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		32.0			
Formation End Depth:		38.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007800362			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		8.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007801647			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007801649			
Layer:		3			
Plug From:		27.0			
Plug To:		38.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1007801648			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Plug From:		1.0			
Plug To:		27.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007803065			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007798854			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007803313			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		28.0			
Casing Diameter:		2.0			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1007803979			
Layer:		1			
Slot:		10			
Screen Top Depth:		28.0			
Screen End Depth:		38.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.25			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007804592			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007802447			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		38.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			

67	1 of 1	ESE/167.0	82.9 / 1.00	1980 Baseline Rd Ottawa ON	WWIS
Well ID:	7346092			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned Monitoring and Test Hole			Date Received:	10/30/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z324295			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					

Additional Detail(s) (Map)

Bore Hole ID:	1007697733	Tag No:	
Depth M:		Contractor:	7241
Year Completed:	2019	Latitude:	45.350971204721
Well Completed Dt:	09/24/2019	Longitude:	-75.7600537637674
Audit No:	Z324295	Y:	45.35097119811894
Path:		X:	-75.76005360222102

Bore Hole Information

Bore Hole ID:	1007697733	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440463.00
Code OB Desc:		North83:	5022221.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	09/24/2019	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007899671			
Layer:		1			
Plug From:		0.0			
Plug To:		2.0			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007899672			
Layer:		2			
Plug From:		2.0			
Plug To:		4.0			
Plug Depth UOM:		m			
<u>Pipe Information</u>					
Pipe ID:		1007897626			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007901150			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:					
<u>Construction Record - Screen</u>					
Screen ID:		1007901461			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:					
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007902017			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007900392			
Diameter:		15.239999771118164			
Depth From:		0.0			
Depth To:		2.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007900393			
Diameter:		6.03000020980835			
Depth From:		2.0			
Depth To:		4.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

68	1 of 1	E/169.0	82.9 / 1.00	ON	WWIS
Well ID:	7413187			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	03/22/2022
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z379500			Contractor:	7241
Tag:	A342689			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008981762			Tag No:	A342689
Depth M:				Contractor:	7241
Year Completed:	2021			Latitude:	45.3511518108795
Well Completed Dt:	11/17/2021			Longitude:	-75.7599668183687
Audit No:	Z379500			Y:	45.35115180440947
Path:				X:	-75.75996665609479

Bore Hole Information

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:	1008981762			Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	18 440470.00 5022241.00 UTM83 4 margin of error : 30 m - 100 m wwr

[69](#)

1 of 4

SSW/170.6

81.9 / 0.00

Kiewit-Eurovia-VINCI, Ottawa Partnership
1370 Woodroffe Ave
Ottawa ON K2G 4S7

GEN

Generator Info

Generator No: ON3470141
Approval Years: As of Jul 2020
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 221 L
Waste Class Name: Light fuels

Waste Detail(s)

Waste Class: 252 L
Waste Class Name: Waste crankcase oils and lubricants

[69](#)

2 of 4

SSW/170.6

81.9 / 0.00

Kiewit-Eurovia-VINCI, Ottawa Partnership
1370 Woodroffe Ave
Ottawa ON K2G 4S7

GEN

Generator Info

Generator No: ON3470141
Approval Years: As of Nov 2021
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		221 L			
Waste Class Name:		Light fuels			

69	3 of 4	SSW/170.6	81.9 / 0.00	KIEWIT/EUROVIA/VINCI PARTNERSHIP 1370 Woodroffe Ave Ottawa ON	GEN

Generator Info

Generator No:	ON3470141	Choice of Contact:
Approval Years:	As of Oct 2022	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	263 L
Waste Class Name:	ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	252 L
Waste Class Name:	WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class:	221 L
Waste Class Name:	LIGHT FUELS

Waste Detail(s)

Waste Class:	263 I
Waste Class Name:	ORGANIC LABORATORY CHEMICALS

Generator Info as of Dec 2024

Generator No:	ON3470141
Generator Company Name:	KIEWIT/EUROVIA/VINCI PARTNERSHIP
Street:	1370 Woodroffe Ave
City:	Ottawa
Province State:	Ontario
Country:	Canada

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Postal Code:		K2G4S7			
Waste Class:		331 I, 221 L, 112 C, 252 L, 263 I, 263 L, 212 L			
Waste Class Decoded:					
331 - WASTE COMPRESSED GASES; 221 - LIGHT FUELS; 112 - ACID WASTE - HEAVY METALS; 252 - WASTE OILS & LUBRICANTS; 263 - ORGANIC LABORATORY CHEMICALS; 263 - ORGANIC LABORATORY CHEMICALS; 212 - ALIPHATIC SOLVENTS					
Generator Info as of Dec 2024					
Generator No:		ON3470141			
Generator Company Name:		KIEWIT/EUROVIA/VINCI PARTNERSHIP			
Street:		1370 Woodroffe Ave			
City:		Ottawa			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2G4S7			
Waste Class:		112 C,221 L,331 I,252 L,122 C,263 I,148 L,263 L,212 L			
Waste Class Decoded:					
112 - ACID WASTE - HEAVY METALS; 221 - LIGHT FUELS; 331 - WASTE COMPRESSED GASES; 252 - WASTE OILS & LUBRICANTS; 122 - ALKALINE WASTES - OTHER METALS; 263 - ORGANIC LABORATORY CHEMICALS; 148 - INORGANIC LABORATORY CHEMICALS; 263 - ORGANIC LABORATORY CHEMICALS; 212 - ALIPHATIC SOLVENTS					
2019 Generator Info					
Gen No:	ON3470141	Choice of Contact:	CO_OFFICIAL		
ID:	13609	Phone No Official:	514-206-3294 Ext.		
Contaminated Fac:	N	Phone No Admin:	343-551-5098 Ext.		
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)		
NAICS Code1:	237990	County Out:			
NAICS Code2:		District:	402		
NAICS Code3:					
Gen Name:	Kiewit-Eurovia-VINCI, Ottawa Partnership				
Gen Div:					
Gen Op Name:	Kiewit-Eurovia-VINCI, Ottawa Partnership				
Gen Op Div:					
Site Adrs1:	1370 Woodroffe Ave				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2G 4S7				
Site Country:	Canada				
Co Official:	Kerry Pike				
Co Admin:	Karolynn Battley				
2020 Generator Info					
Gen No:	ON3470141	Choice of Contact:	CO_OFFICIAL		
ID:	13275	Phone No Official:	514-206-3294 Ext.		
Contaminated Fac:	N	Phone No Admin:	343-551-5098 Ext.		
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)		
NAICS Code1:	237990	County Out:			
NAICS Code2:		District:	402		
NAICS Code3:					
Gen Name:	Kiewit-Eurovia-VINCI, Ottawa Partnership				
Gen Div:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Op Name:		Kiewit-Eurovia-VINCI, Ottawa Partnership			
Gen Op Div:					
Site Adrs1:		1370 Woodroffe Ave			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2G 4S7			
Site Country:		Canada			
Co Official:		Kerry Pike			
Co Admin:		Karolynn Battley			
<u>2020 Generator Manifest</u>					
ID:	32690			Sum Received Qty:	18220.0
Generator No:	ON3470141			Waste Class Name:	LIGHT FUELS
Receiver Type:	035			Count Manifests:	3
Waste Char:	L			District:	402
Waste Code:	221				
<u>2020 Generator Manifest</u>					
ID:	32689			Sum Received Qty:	1230.0
Generator No:	ON3470141			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	2
Waste Char:	L			District:	306
Waste Code:	252				
<u>2021 Generator Info</u>					
Gen No:	ON3470141			Choice of Contact:	CO_ADMIN
ID:	13135			Phone No Official:	514-206-3294 Ext.
Contaminated Fac:	N			Phone No Admin:	514-206-3294 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	237990			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Kiewit-Eurovia-VINCI, Ottawa Partnership				
Gen Div:					
Gen Op Name:	Kiewit-Eurovia-VINCI, Ottawa Partnership				
Gen Op Div:					
Site Adrs1:	1370 Woodroffe Ave				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2G 4S7				
Site Country:	Canada				
Co Official:	Kerry Pike				
Co Admin:	Kerry Pike				
<u>2021 Generator Manifest</u>					
ID:	33200			Sum Received Qty:	2460.0
Generator No:	ON3470141			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	6
Waste Char:	L			District:	306
Waste Code:	252				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2021 Generator Manifest</u>					
ID:	33201			Sum Received Qty:	2000.0
Generator No:	ON3470141			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	33199			Sum Received Qty:	205.0
Generator No:	ON3470141			Waste Class Name:	LIGHT FUELS
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	306
Waste Code:	221				
<u>69</u>	4 of 4	SSW/170.6	81.9 / 0.00	1370 Woodroffe Ave, Ottawa OTTAWA ON	SPL
Ref No:	1-24VSGU			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	9/1/2022 7:29:00 PM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	9/1/2022 7:58:17 PM			Impact to Health:	0 No Impact
Dt Document Closed:	9/28/2022 1:44:18 PM			Agency Involved:	
Site No:					
MOE Response:	Desktop Response				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa District Office				
Nearest Watercourse:					
Site Name:					
Site Address:	1370 Woodroffe Ave, Ottawa				
Site Region:					
Site Municipality:	OTTAWA				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:					
Incident Preceding Spill:					
Incident Reason:					
Incident Summary:	KEV - 3L hydraulic oil to roadway, cleaning				
Environment Impact:	1 Minor Impact				
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	3 litre (L)				
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:	HYDRAULIC OIL				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:					
Activity Preceding Spill:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Property 2nd Watershed: Property Tertiary Watershed: Sector Type:		Central Ottawa			
SAC Action Class: Call Report Locatn Geodata:		CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING			
Time Reported: System Facility Address:		{ "integration_ids": ["PR00003889180"], "wks": ["POINT (-75.7629100000 45.3500500000)", "POINT (-75.7629100000 45.3500500000)"], "creation_date": "2022-09-01" }			

70	1 of 1	ESE/171.0	82.9 / 1.00	1980 baeline Ottawa ON	WWIS
Well ID:	7328586			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z229635			Contractor:	7241
Tag:	A155582			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					

Additional Detail(s) (Map)

Bore Hole ID:	1007379323	Tag No:	A155582
Depth M:	12	Contractor:	7241
Year Completed:	2018	Latitude:	45.3504827981457
Well Completed Dt:	08/16/2018	Longitude:	-75.7603500352973
Audit No:	Z229635	Y:	45.35048279134654
Path:		X:	-75.76034987373156

Bore Hole Information

Bore Hole ID:	1007379323	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440439.28
Code OB Desc:		North83:	5022166.96
Open Hole:		Org CS:	N27e
Cluster Kind:		UTMRC:	4
Date Completed:	08/16/2018	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702102			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.6100000143051147			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702101			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.6100000143051147			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702103			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		34			
Material 3 Desc:		TILL			
Formation Top Depth:		4.880000114440918			
Formation End Depth:		12.0			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702327			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		8.84000015258789			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID: 1007702328					
Layer: 3					
Plug From: 8.84000015258789					
Plug To: 12.0					
Plug Depth UOM: m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1007702326					
Layer: 1					
Plug From: 0.0					
Plug To: 0.3100000023841858					
Plug Depth UOM: m					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1007702580					
Method Construction Code: 2					
Method Construction: Rotary (Convent.)					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1007701896					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1007702636					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 9.0					
Casing Diameter: 5.199999809265137					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1007702754					
Layer: 1					
Slot: 10					
Screen Top Depth: 9.0					
Screen End Depth: 12.0					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 6.03000020980835					
<u>Hole Diameter</u>					
Hole ID: 1007702497					
Diameter: 20.31999969482422					
Depth From: 0.0					
Depth To: 12.0					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
71	1 of 1	ESE/172.6	82.9 / 1.00	1980 basline Ottawa ON	WWIS
Well ID:		7328582		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z229618		Contractor:	7241
Tag:		A254642		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:		1007379278		Tag No:	A254642
Depth M:		2.322576		Contractor:	7241
Year Completed:		2018		Latitude:	45.350763936572
Well Completed Dt:		08/31/2018		Longitude:	-75.7600892875635
Audit No:		Z229618		Y:	45.35076393002459
Path:				X:	-75.76008912610479
<u>Bore Hole Information</u>					
Bore Hole ID:		1007379278		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440460.00
Code OB Desc:				North83:	5022198.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	5
Date Completed:		08/31/2018		UTMRC Desc:	margin of error : 100 m - 300 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007702094			
Layer:		2			
Color:		2			
General Color:		GREY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		7.619999885559082			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702093			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		79			
Material 3 Desc:		PACKED			
Formation Top Depth:		0.0			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702319			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		7.619999885559082			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702318			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702317			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007702577			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:			1007701893		
Casing No:			0		
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:			1007702633		
Layer:			1		
Material:			5		
Open Hole or Material:			PLASTIC		
Depth From:			0.0		
Depth To:			4.570000171661377		
Casing Diameter:			5.199999809265137		
Casing Diameter UOM:			inch		
Casing Depth UOM:			ft		
<u>Construction Record - Screen</u>					
Screen ID:			1007702751		
Layer:			1		
Slot:			10		
Screen Top Depth:			4.570000171661377		
Screen End Depth:			7.619999885559082		
Screen Material:			5		
Screen Depth UOM:			ft		
Screen Diameter UOM:			inch		
Screen Diameter:			6.03000020980835		
<u>Hole Diameter</u>					
Hole ID:			1007702494		
Diameter:			15.319999694824219		
Depth From:			0.0		
Depth To:			7.619999885559082		
Hole Depth UOM:			ft		
Hole Diameter UOM:			inch		
72	1 of 1	ESE/174.6	82.9 / 1.00	1980 Baseline Rd Ottawa ON	WWIS
Well ID:	7346091			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned Monitoring and Test Hole			Date Received:	10/30/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z324294			Contractor:	7241
Tag:				Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1007697730			Tag No:	
Depth M:				Contractor:	7241
Year Completed:	2019			Latitude:	45.3508002786767
Well Completed Dt:	09/24/2019			Longitude:	-75.7600387098543
Audit No:	Z324294			Y:	45.350800272289696
Path:				X:	-75.760038548273
<u>Bore Hole Information</u>					
Bore Hole ID:	1007697730			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440464.00
Code OB Desc:				North83:	5022202.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/24/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1007899670				
Layer:	1				
Plug From:	0.0				
Plug To:	2.0				
Plug Depth UOM:	m				
<u>Pipe Information</u>					
Pipe ID:	1007897625				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1007901149				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:					
<u>Construction Record - Screen</u>					
Screen ID:	1007901460				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:					
Screen Diameter UOM:					
Screen Diameter:					
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007902016			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
 <u>Hole Diameter</u>					
Hole ID:		1007900391			
Diameter:		6.03000020980835			
Depth From:		0.0			
Depth To:		2.0			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>73</u>	1 of 1	E/174.7	82.9 / 1.00	ON	WWIS
Well ID:	7406938			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	Yes
Use 2nd:				Data Src:	
Final Well Status:				Date Received:	12/29/2021
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z368027			Contractor:	7241
Tag:	A320463			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008904464			Tag No:	A320463
Depth M:				Contractor:	7241
Year Completed:	2021			Latitude:	45.3516833545737
Well Completed Dt:	11/04/2021			Longitude:	-75.7598973350644
Audit No:	Z368027			Y:	45.35168334805108
Path:				X:	-75.75989717318213
<u>Bore Hole Information</u>					
Bore Hole ID:	1008904464			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440476.00
Code OB Desc:				North83:	5022300.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/04/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

74	1 of 1	ENE/176.0	82.2 / 0.31	Loblaws Inc. 1980 Baseline Rd. Nepean ON	GEN

Generator Info

Generator No:	ON6091068	Choice of Contact:	
Approval Years:	As of Oct 2022	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	331 I
Waste Class Name:	WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class:	148 A
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	212 I
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		252 L WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		263 L ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		269 T NON-HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		263 A ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		261 A PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		146 T OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		262 C DETERGENTS/SOAPS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		262 L DETERGENTS/SOAPS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		148 I INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		261 L PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		242 T HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		212 L ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		122 C ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		331 L WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		112 C ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		263 C ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		261 I PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		312 P PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		145 I PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		242 L HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		269 L NON-HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		261 B PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		145 L			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Generator Info as of Dec 2024

Generator No: ON6091068
Generator Company Name: Loblaws Inc.
Street: 1980 Baseline Rd.
City: Nepean
Province State: Ontario
Country: Canada
Postal Code: K2C0C6
Waste Class: 312 P,262 L,112 C,122 C,145 I,145 L,146 T,148 A,148 I,212 I,212 L,242 L,242 T,252 L,261 A,261 B,261 I,261 L,262 C,263 A,263 C,263 L,269 L,269 T,331 I,148 C

Waste Class Decoded:

312 - PATHOLOGICAL WASTES; 262 - DETERGENTS/SOAPS; 112 - ACID WASTE - HEAVY METALS; 122 - ALKALINE WASTES - OTHER METALS; 145 - PAINT/PIGMENT/COATING RESIDUES; 145 - PAINT/PIGMENT/COATING RESIDUES; 146 - OTHER SPECIFIED INORGANICS; 148 - INORGANIC LABORATORY CHEMICALS; 148 - INORGANIC LABORATORY CHEMICALS; 212 - ALIPHATIC SOLVENTS; 212 - ALIPHATIC SOLVENTS; 242 - HALOGENATED PESTICIDES; 242 - HALOGENATED PESTICIDES; 252 - WASTE OILS & LUBRICANTS; 261 - PHARMACEUTICALS; 261 - PHARMACEUTICALS; 261 - PHARMACEUTICALS; 261 - PHARMACEUTICALS; 262 - DETERGENTS/SOAPS; 263 - ORGANIC LABORATORY CHEMICALS; 263 - ORGANIC LABORATORY CHEMICALS; 263 - ORGANIC LABORATORY CHEMICALS; 269 - NON-HALOGENATED PESTICIDES; 269 - NON-HALOGENATED PESTICIDES; 331 - WASTE COMPRESSED GASES; 148 - INORGANIC LABORATORY CHEMICALS

2017 Generator Info

Gen No:	ON6091068	Choice of Contact:	CO_ADMIN
ID:	23987	Phone No Official:	905 459 2500 Ext.61368
Contaminated Fac:	N	Phone No Admin:	8552770388 Ext.
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	445110	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	LOBLAWS INC.		
Gen Div:			
Gen Op Name:	Loblaw Companies Inc		
Gen Op Div:			
Site Adrs1:	1980 Baseline Rd.		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Nepean		
Province Out:			
Site Postal Code:	K2C 0C6		
Site Country:	Canada		
Co Official:	Dan Romano		
Co Admin:	Craig Hudak		

2017 Generator Manifest

ID:	49228	Sum Received Qty:	63.0
Generator No:	ON6091068	Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	030	Count Manifests:	9
Waste Char:	A	District:	402
Waste Code:	148		

2017 Generator Manifest

ID:	49231	Sum Received Qty:	345.0
Generator No:	ON6091068	Waste Class Name:	DETERGENTS/SOAPS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiver Type:	030			Count Manifests:	4
Waste Char:	L			District:	402
Waste Code:	262				
<u>2017 Generator Manifest</u>					
ID:	49225			Sum Received Qty:	8.0
Generator No:	ON6091068			Waste Class Name:	ACID WASTE - HEAVY METALS
Receiver Type:	030			Count Manifests:	4
Waste Char:	C			District:	402
Waste Code:	112				
<u>2017 Generator Manifest</u>					
ID:	49235			Sum Received Qty:	48.0
Generator No:	ON6091068			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	8
Waste Char:	I			District:	402
Waste Code:	331				
<u>2017 Generator Manifest</u>					
ID:	49227			Sum Received Qty:	9.0
Generator No:	ON6091068			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	030			Count Manifests:	5
Waste Char:	T			District:	402
Waste Code:	146				
<u>2017 Generator Manifest</u>					
ID:	49230			Sum Received Qty:	1.0
Generator No:	ON6091068			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	261				
<u>2017 Generator Manifest</u>					
ID:	49232			Sum Received Qty:	19.0
Generator No:	ON6091068			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	2
Waste Char:	A			District:	402
Waste Code:	263				
<u>2017 Generator Manifest</u>					
ID:	49234			Sum Received Qty:	21.9
Generator No:	ON6091068			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2017 Generator Manifest</u>					
ID:	49226			Sum Received Qty:	33.0
Generator No:	ON6091068			Waste Class Name:	ALKALINE WASTES - OTHER METALS
Receiver Type:	030			Count Manifests:	4
Waste Char:	C			District:	402
Waste Code:	122				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2017 Generator Manifest</u>					
ID:	49229			Sum Received Qty:	42.0
Generator No:	ON6091068			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	030			Count Manifests:	4
Waste Char:	I			District:	402
Waste Code:	212				
<u>2017 Generator Manifest</u>					
ID:	49233			Sum Received Qty:	192.0
Generator No:	ON6091068			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	2
Waste Char:	L			District:	402
Waste Code:	263				
<u>2018 Generator Info</u>					
Gen No:	ON6091068			Choice of Contact:	CO_OFFICIAL
ID:	24263			Phone No Official:	905 459 2500 Ext.61368
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	445110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	LOBLAWS INC.				
Gen Div:					
Gen Op Name:	Loblaw Companies Inc				
Gen Op Div:					
Site Adrs1:	1980 Baseline Rd.				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Nepean				
Province Out:					
Site Postal Code:	K2C 0C6				
Site Country:	Canada				
Co Official:	Dan Romano				
Co Admin:	Alyson Roberts				
<u>2018 Generator Manifest</u>					
ID:	49108			Sum Received Qty:	28.0
Generator No:	ON6091068			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	030			Count Manifests:	3
Waste Char:	I			District:	402
Waste Code:	212				
<u>2018 Generator Manifest</u>					
ID:	49112			Sum Received Qty:	18.1
Generator No:	ON6091068			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2018 Generator Manifest</u>					
ID:	49110			Sum Received Qty:	10.0
Generator No:	ON6091068			Waste Class Name:	ORGANIC LABORATORY CHEMICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiver Type:	030			Count Manifests:	1
Waste Char:	A			District:	402
Waste Code:	263				
<u>2018 Generator Manifest</u>					
ID:	49107			Sum Received Qty:	37.0
Generator No:	ON6091068			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	8
Waste Char:	A			District:	402
Waste Code:	148				
<u>2018 Generator Manifest</u>					
ID:	49113			Sum Received Qty:	30.0
Generator No:	ON6091068			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	7
Waste Char:	I			District:	402
Waste Code:	331				
<u>2018 Generator Manifest</u>					
ID:	49109			Sum Received Qty:	2.0
Generator No:	ON6091068			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	261				
<u>2018 Generator Manifest</u>					
ID:	49111			Sum Received Qty:	436.0
Generator No:	ON6091068			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	4
Waste Char:	L			District:	402
Waste Code:	263				
<u>2019 Generator Info</u>					
Gen No:	ON6091068			Choice of Contact:	CO_OFFICIAL
ID:	24427			Phone No Official:	905 459 2500 Ext.61368
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	445110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	LOBLAWS INC.				
Gen Div:					
Gen Op Name:	Loblaw Companies Inc				
Gen Op Div:					
Site Adrs1:	1980 Baseline Rd.				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Nepean				
Province Out:					
Site Postal Code:	K2C 0C6				
Site Country:	Canada				
Co Official:	Dan Romano				
Co Admin:	Alyson Roberts				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2019 Generator Manifest</u>					
ID:	48949			Sum Received Qty:	20.0
Generator No:	ON6091068			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	4
Waste Char:	I			District:	402
Waste Code:	331				
<u>2019 Generator Manifest</u>					
ID:	48946			Sum Received Qty:	38.0
Generator No:	ON6091068			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	030			Count Manifests:	4
Waste Char:	I			District:	402
Waste Code:	212				
<u>2019 Generator Manifest</u>					
ID:	48948			Sum Received Qty:	20.0
Generator No:	ON6091068			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2019 Generator Manifest</u>					
ID:	48947			Sum Received Qty:	516.0
Generator No:	ON6091068			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	4
Waste Char:	L			District:	402
Waste Code:	263				
<u>2019 Generator Manifest</u>					
ID:	48945			Sum Received Qty:	78.0
Generator No:	ON6091068			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	7
Waste Char:	A			District:	402
Waste Code:	148				
<u>2020 Generator Info</u>					
Gen No:	ON6091068			Choice of Contact:	CO_OFFICIAL
ID:	24133			Phone No Official:	905 459 2500 Ext.
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	445110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		LOBLAWS INC.			
Gen Div:					
Gen Op Name:		Loblaws Companies Inc			
Gen Op Div:					
Site Adrs1:		1980 Baseline Rd.			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Nepean			
Province Out:					
Site Postal Code:		K2C 0C6			
Site Country:		Canada			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Official:		Morgan Lamprey			
Co Admin:		Alyson Roberts			
<u>2020 Generator Manifest</u>					
ID:	45454			Sum Received Qty:	41.0
Generator No:	ON6091068			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	7
Waste Char:	A			District:	402
Waste Code:	148				
<u>2020 Generator Manifest</u>					
ID:	45458			Sum Received Qty:	1.0
Generator No:	ON6091068			Waste Class Name:	NON-HALOGENATED PESTICIDES
Receiver Type:	030			Count Manifests:	1
Waste Char:	T			District:	402
Waste Code:	269				
<u>2020 Generator Manifest</u>					
ID:	45456			Sum Received Qty:	2.0
Generator No:	ON6091068			Waste Class Name:	PHARMACEUTICALS
Receiver Type:	030			Count Manifests:	2
Waste Char:	L			District:	402
Waste Code:	261				
<u>2020 Generator Manifest</u>					
ID:	45457			Sum Received Qty:	452.0
Generator No:	ON6091068			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	4
Waste Char:	L			District:	402
Waste Code:	263				
<u>2020 Generator Manifest</u>					
ID:	45455			Sum Received Qty:	30.0
Generator No:	ON6091068			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	030			Count Manifests:	5
Waste Char:	I			District:	402
Waste Code:	212				
<u>2020 Generator Manifest</u>					
ID:	45459			Sum Received Qty:	12.0
Generator No:	ON6091068			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	4
Waste Char:	I			District:	402
Waste Code:	331				
<u>2021 Generator Info</u>					
Gen No:	ON6091068			Choice of Contact:	CO_OFFICIAL
ID:	24518			Phone No Official:	905 459 2500 Ext.
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	445110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Name: LOBLAWS INC. Gen Div: Gen Op Name: Loblaw Companies Inc Gen Op Div: Site Adrs1: 1980 Baseline Rd. Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Site City: Nepean Province Out: Site Postal Code: K2C 0C6 Site Country: Canada Co Official: Morgan Lamprey Co Admin: Alyson Roberts					
<u>2021 Generator Manifest</u>					
ID:	47293			Sum Received Qty:	640.0
Generator No:	ON6091068			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	4
Waste Char:	L			District:	402
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	47291			Sum Received Qty:	28.0
Generator No:	ON6091068			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	4
Waste Char:	A			District:	402
Waste Code:	148				
<u>2021 Generator Manifest</u>					
ID:	47292			Sum Received Qty:	24.0
Generator No:	ON6091068			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	030			Count Manifests:	4
Waste Char:	I			District:	402
Waste Code:	212				
<u>2021 Generator Manifest</u>					
ID:	47294			Sum Received Qty:	14.0
Generator No:	ON6091068			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	4
Waste Char:	I			District:	402
Waste Code:	331				
75	1 of 1	SE/176.2	82.9 / 1.00	1980 BASELINE lot 35 con 1 Ottawa ON	WWIS
Well ID:	7328503			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z290591			Contractor:	7241
Tag:	A254690			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty:			Lot:	035	
Depth to Bedrock:			Concession:	01	
Well Depth:			Concession Name:	RF	
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328503.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		08/16/2018			
Year Completed:		2018			
Depth (m):		18.29			
Latitude:		45.3502204177333			
Longitude:		-75.7606054147227			
X:		-75.7606052530264			
Y:		45.35022041128545			
Path:		732\7328503.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007375364		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440419.00
Code OB Desc:				North83:	5022138.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		08/16/2018		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007669102			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1007669104			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		2.740000009536743			
Formation End Depth:		8.229999542236328			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007669103			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		2.740000009536743			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007669105			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		8.229999542236328			
Formation End Depth:		13.109999656677246			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1007669106			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:		17			
Material 2 Desc:		SHALE			
Material 3:		74			
Material 3 Desc:		LAYERED			
Formation Top Depth:		13.109999656677246			
Formation End Depth:		18.290000915527344			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007669117			
Layer:		3			
Plug From:		14.9399995803833			
Plug To:		18.290000915527344			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007669115			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007669116			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		14.9399995803833			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007669114			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007669101			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007669110			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		15.239999771118164			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007669111			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Slot:		10			
Screen Top Depth:		15.239999771118164			
Screen End Depth:		18.290000915527344			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007669109			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007669108			
Diameter:		7.619999885559082			
Depth From:		13.109999656677246			
Depth To:		18.290000915527344			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1007669107			
Diameter:		11.430000305175781			
Depth From:		0.0			
Depth To:		13.109999656677246			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>76</u>	1 of 1	SE/178.4	82.9 / 1.00	1980 BASELINE ROAD lot 35 con 1 OTTAWA ON	WWIS
Well ID:	7328572			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z229640			Contractor:	7241
Tag:	A254662			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328572.pdf			

Additional Detail(s) (Map)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date: 08/23/2018					
Year Completed: 2018					
Depth (m): 7.01					
Latitude: 45.3502025015832					
Longitude: -75.7605924088344					
X: -75.76059224722357					
Y: 45.350202495333086					
Path: 732\7328572.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007378988					
DP2BR:					
Spatial Status:					
Code OB:					
Code OB Desc:					
Open Hole:					
Cluster Kind:					
Date Completed: 08/23/2018					
Remarks:					
Location Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1007637491					
Layer: 1					
Color: 8					
General Color: BLACK					
Material 1:					
Material 1 Desc:					
Material 2: 11					
Material 2 Desc: GRAVEL					
Material 3: 66					
Material 3 Desc: DENSE					
Formation Top Depth: 0.0					
Formation End Depth: 0.3100000023841858					
Formation End Depth UOM: m					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID: 1007637492					
Layer: 2					
Color: 6					
General Color: BROWN					
Material 1: 28					
Material 1 Desc: SAND					
Material 2: 05					
Material 2 Desc: CLAY					
Material 3: 85					
Material 3 Desc: SOFT					
Formation Top Depth: 0.3100000023841858					
Formation End Depth: 3.0999999046325684					
Formation End Depth UOM: m					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007637493			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		7.010000228881836			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637501			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637502			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637503			
Layer:		3			
Plug From:		3.6600000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007637500			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007637490			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 1007637496					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 3.9600000381469727					
Casing Diameter: 5.199999809265137					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1007637497					
Layer: 1					
Slot: 10					
Screen Top Depth: 3.9600000381469727					
Screen End Depth: 7.010000228881836					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 6.03000020980835					
<u>Water Details</u>					
Water ID: 1007637495					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1007637494					
Diameter: 11.420000076293945					
Depth From: 0.0					
Depth To: 7.010000228881836					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>77</u>	1 of 1	SE/182.5	82.9 / 1.00	ON	BORE
Borehole ID: 612504					
OGF ID: 215513811					
Status:					
Type: Borehole					
Use:					
Completion Date: FEB-1961					
Static Water Level: 1.8					
Primary Water Use:					
Sec. Water Use:					
Total Depth m: 76.2					
Depth Ref: Ground Surface					
Depth Elev:					
Drill Method:					
Orig Ground Elev m: 85.3					
Elev Reliabil Note:					
DEM Ground Elev m: 86.8					
Concession:					
Location D:					
Inclin FLG: No					
SP Status: Initial Entry					
Surv Elev: No					
Piezometer: No					
Primary Name:					
Municipality:					
Lot:					
Township:					
Latitude DD: 45.350122					
Longitude DD: -75.760647					
UTM Zone: 18					
Easting: 440416					
Northing: 5022127					
Location Accuracy:					
Accuracy: Not Applicable					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Survey D: Comments:					
Borehole Geology Stratum					
Geology Stratum ID:	218391520			Mat Consistency:	
Top Depth:	15.2			Material Moisture:	
Bottom Depth:	76.2			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Limestone			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	LIMESTONE. 0025000200 274.0 FEET.CLAY. GREY. SAND. SAND. CLAY. TILL. BEDROCK.				
Geology Stratum ID:	218391519			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	15.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Boulders			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SILT.				
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:				Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Details:	File: OTTAWA1.txt RecordID: 05012 NTS_Sheet:				
Confiden 1:					
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
78	1 of 1	SE/182.6	82.9 / 1.00	lot 35 con 1 ON	WWIS
Well ID:	1505882			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Commerical			Data Entry Status:	
Use 2nd:	0			Data Src:	1
Final Well Status:	Water Supply			Date Received:	08/02/1961
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:				Contractor:	3504
Tag:				Form Version:	1
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1505882.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		02/28/1961			
Year Completed:		1961			
Depth (m):		76.2			
Latitude:		45.3501211308401			
Longitude:		-75.7606462122622			
X:		-75.76064605000995			
Y:		45.350121124431105			
Path:		150\1505882.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10027925		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440415.70
Code OB Desc:				North83:	5022127.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	5
Date Completed:		02/28/1961		UTMRC Desc:	margin of error : 100 m - 300 m
Remarks:				Location Method:	p5
Location Method Desc:		Original Pre1985 UTM Rel Code 5: margin of error : 100 m - 300 m			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931003198			
Layer:		1			
Color:					
General Color:					
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		13			
Material 2 Desc:		BOULDERS			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		50.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931003199			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		50.0			
Formation End Depth:		250.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961505882			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10576495			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930048605			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		10.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930048607			
Layer:		3			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		250.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930048606			
Layer:		2			
Material:					
Open Hole or Material:					
Depth From:					
Depth To:		50.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:	PUMP				
Pump Test ID:	991505882				
Pump Set At:					
Static Level:	10.0				
Final Level After Pumping:	140.0				
Recommended Pump Depth:	150.0				
Pumping Rate:	30.0				
Flowing Rate:					
Recommended Pump Rate:	30.0				
Levels UOM:	ft				
Rate UOM:	GPM				
Water State After Test Code:	1				
Water State After Test:	CLEAR				
Pumping Test Method:	1				
Pumping Duration HR:	24				
Pumping Duration MIN:	0				
Flowing:	No				
<u>Water Details</u>					
Water ID:	933459907				
Layer:	1				
Kind Code:	1				
Kind:	FRESH				
Water Found Depth:	250.0				
Water Found Depth UOM:	ft				
79	1 of 1	WSW/182.8	80.2 / -1.69	City of Ottawa Southwest Transitway at Baseline Rd Ottawa ON K2G 6J8	ECA
Approval No:	8261-8EBKZB			MOE District:	
Approval Date:	2011-03-31			City:	
Status:	Approved			Longitude:	
Record Type:	ECA			Latitude:	
Link Source:	IDS			Geometry X:	
SWP Area Name:				Geometry Y:	
Approval Type:	ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS				
Project Type:	MUNICIPAL AND PRIVATE SEWAGE WORKS				
Business Name:	City of Ottawa				
Address:	Southwest Transitway at Baseline Rd				
Full Address:					
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/7921-8B9HHW-14.pdf				
PDF Site Location:					
80	1 of 1	WSW/183.7	80.9 / -1.00	45.350506, -75.764057 OTTAWA ON	SPL
Ref No:	1-3RCW16			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	8/21/2023 1:30:17 PM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	8/21/2023 4:08:17 PM			Impact to Health:	
Dt Document Closed:	8/24/2023 9:35:53 AM			Agency Involved:	
Site No:					
MOE Response:	Desktop Response				
Site County/District:					
Site Geo Ref Meth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site District Office:		Ottawa District Office			
Nearest Watercourse:		n/a			
Site Name:					
Site Address:		45.350506, -75.764057			
Site Region:					
Site Municipality:		OTTAWA			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:		Sewer (Private or Municipal)			
Incident Cause:					
Incident Preceding Spill:		Unknown / N/A			
Incident Reason:					
Incident Summary:		Kiewit Eurovia Vinci: Broken Sanitary Water Pipe Releasing Sanitary Water into Excavation Site			
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:		0 other - see notes			
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:		SEWAGE, RAW UNCHLORINATED			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		Land			
Activity Preceding Spill:		Construction or repair			
Property 2nd Watershed:		Central Ottawa			
Property Tertiary Watershed:		02KF-Central Ottawa - Mississippi			
Sector Type:		WATER AND SEWER LINE AND RELATED STRUCTURES CONSTRUCTION			
SAC Action Class:		Municipal Sewage			
Call Report Locatn Geodata:		{ "integration_ids": ["PR00003889180"], "wkts": ["POINT (-75.7640570000 45.3505060000)"], "creation_date": "2023-08-21" }			
Time Reported:					
System Facility Address:					

81	1 of 1	ESE/185.2	82.9 / 1.00	1980 BASELINE RD OTTAWA ON	WWIS
Well ID:		7272051	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring and Test Hole	Data Entry Status:		
Use 2nd:		0	Data Src:		
Final Well Status:		Abandoned-Other	Date Received:		09/22/2016
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		Yes
Audit No:		Z214946	Contractor:		7241
Tag:			Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		NEPEAN TOWNSHIP			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1006251905			Tag No:	
Depth M:				Contractor:	7241
Year Completed:	2016			Latitude:	45.3507289535589
Well Completed Dt:	09/01/2016			Longitude:	-75.7599356269574
Audit No:	Z214946			Y:	45.35072894692596
Path:				X:	-75.75993546573602
<u>Bore Hole Information</u>					
Bore Hole ID:	1006251905			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440472.00
Code OB Desc:				North83:	5022194.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/01/2016			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006469652				
Layer:					
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006469660				
Layer:	1				
Plug From:	0.0				
Plug To:	0.3100000023841858				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1006469662				
Layer:	3				
Plug From:	1.83000000429153442				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006469661			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.83000000429153442			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006469659			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006469651			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006469655			
Layer:		1			
Material:		7			
Open Hole or Material:		OTHER			
Depth From:					
Depth To:					
Casing Diameter:		3.4500000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006469656			
Layer:		1			
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1006469654			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1006469653			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
82	1 of 1	SSE/185.4	82.9 / 1.00	LANDAWN SHOPPING CENTRE LTD. 1375 WOODROFFE AVENUE NEPEAN ON K2G 1V7	NPCB
Company Code:		F1447			
Industry:					
Site Status:					
Transaction Date:					
Inspection Date:					
83	1 of 1	NNW/185.4	80.9 / -1.00	Experimental Farm Pathway, Ottawa, ON K2C 2T7 OTTAWA ON	SPL
Ref No:	1-3W7RLE			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	10/2/2023 11:30:46 AM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	10/2/2023 3:24:46 PM			Impact to Health:	
Dt Document Closed:	10/26/2023 2:22:10 PM			Agency Involved:	
Site No:					
MOE Response:	Desktop Response				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa District Office				
Nearest Watercourse:					
Site Name:					
Site Address:	Experimental Farm Pathway, Ottawa, ON K2C 2T7				
Site Region:					
Site Municipality:	OTTAWA				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:					
Incident Preceding Spill:					
Incident Reason:					
Incident Summary:	KVE: 2 L oil spilled to gravel				
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	2 litre (L)				
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:	OIL (PETROLEUM BASED, NOT SPECIFIED)				
Contaminant Limit 1:					
Contam Limit Freq 1:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: 02K Central Ottawa River Property Tertiary Watershed: 02KF Mississippi River - Central Ottawa River Sector Type: OTHER HEAVY AND CIVIL ENGINEERING CONSTRUCTION SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003852812"],"wkts":["POINT (-75.7627972000 45.3530028000)"],"creation_date":"2023-10-02"} Time Reported: System Facility Address:					

84	1 of 1	E/186.3	82.9 / 1.00	ON	WWIS
Well ID: 7406936 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z368031 Tag: A320465 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 12/29/2021 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Additional Detail(s) (Map)

Bore Hole ID:	1008904458	Tag No:	A320465
Depth M:		Contractor:	7241
Year Completed:	2021	Latitude:	45.351405525538
Well Completed Dt:	11/09/2021	Longitude:	-75.7597148904481
Audit No:	Z368031	Y:	45.35140551939183
Path:		X:	-75.75971472812685

Bore Hole Information

Bore Hole ID:	1008904458	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	440490.00
Code OB Desc:		North83:	5022269.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	11/09/2021	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
85	1 of 1	SE/186.6	82.9 / 1.00	lot 35 con 1 ON	WWIS
Well ID:		1505881	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Commerical	Data Entry Status:		
Use 2nd:		0	Data Src:		
Final Well Status:		Water Supply	Date Received:		
Water Type:			Selected Flag:		
Casing Material:			Abandonment Rec:		
Audit No:			Contractor:		
Tag:			Form Version:		
Constructn Method:			Owner:		
Elevation (m):			County:		
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1505881.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		02/21/1961			
Year Completed:		1961			
Depth (m):		96.012			
Latitude:		45.350076127948			
Longitude:		-75.7606456094385			
X:		-75.76064544724441			
Y:		45.35007612139456			
Path:		150\1505881.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10027924	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		
Code OB:			East83:		
Code OB Desc:			North83:		
Open Hole:			Org CS:		
Cluster Kind:			UTMRC:		
Date Completed:		02/21/1961	UTMRC Desc:		
Remarks:			Location Method:		
Location Method Desc:		Original Pre1985 UTM Rel Code 5: margin of error : 100 m - 300 m			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931003197			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		48.0			
Formation End Depth:		315.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931003196			
Layer:		1			
Color:					
General Color:					
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		13			
Material 2 Desc:		BOULDERS			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		48.0			
Formation End Depth UOM:		ft			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		961505881			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		10576494			
Casing No:		1			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		930048604			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		315.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Casing</u>					
Casing ID:		930048603			
Layer:		1			
Material:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		48.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991505881			
Pump Set At:					
Static Level:		12.0			
Final Level After Pumping:		300.0			
Recommended Pump Depth:		300.0			
Pumping Rate:		10.0			
Flowing Rate:					
Recommended Pump Rate:		10.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933459906			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		140.0			
Water Found Depth UOM:		ft			
86	1 of 1	NW/190.5	80.9 / -1.00	45.35295849 -75.7631379 OTTAWA ON	SPL
Ref No:		1-4FJ39R		Municipality No:	
Year:				Nature of Damage:	
Incident Dt:		11/16/2023 8:30:23 AM		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		11/16/2023 11:11:23 AM		Impact to Health:	
Dt Document Closed:		11/16/2023 12:13:04 PM		Agency Involved:	
Site No:					
MOE Response:		Desktop Response			
Site County/District:					
Site Geo Ref Meth:					
Site District Office:		Ottawa District Office			
Nearest Watercourse:					
Site Name:					
Site Address:		45.35295849 -75.7631379			
Site Region:					
Site Municipality:		OTTAWA			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Client Type: Source Type: Motor Vehicle Incident Cause: Incident Preceding Spill: Incident Reason: Equipment failure/malfunction Incident Summary: KEV Ottawa: 4L hydraulic oil to grnd. Clnd. Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 4 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: 02K Central Ottawa River Property Tertiary Watershed: 02KF Mississippi River - Central Ottawa River Sector Type: OTHER HEAVY AND CIVIL ENGINEERING CONSTRUCTION SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003852812"],"wks":["POINT (-75.7631379000 45.3529584900)"],"creation_date":"2023-11-16"} Time Reported: System Facility Address:					

87	1 of 1	NW/196.5	80.9 / -1.00	ON	WWIS
Well ID: 1509082 Construction Date: Use 1st: Domestic Use 2nd: 0 Final Well Status: Water Supply Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1509082.pdf					

Additional Detail(s) (Map)

Well Completed Date: 11/29/1955
Year Completed: 1955
Depth (m): 33.528
Latitude: 45.3528471410022
Longitude: -75.7635551938668
X: -75.76355503265697
Y: 45.35284713451376

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Path:		150\1509082.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	10031116			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440190.70
Code OB Desc:				North83:	5022432.00
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	5
Date Completed:	11/29/1955			UTMRC Desc:	margin of error : 100 m - 300 m
Remarks:				Location Method:	p5
Location Method Desc:	Original Pre1985 UTM Rel Code 5: margin of error : 100 m - 300 m				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	931011412				
Layer:	2				
Color:					
General Color:					
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	32.0				
Formation End Depth:	110.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	931011411				
Layer:	1				
Color:					
General Color:					
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	0.0				
Formation End Depth:	32.0				
Formation End Depth UOM:	ft				
<u>Method of Construction & Well Use</u>					
Method Construction ID:	961509082				
Method Construction Code:	1				
Method Construction:	Cable Tool				
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		10579686			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930054880			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		110.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930054879			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		32.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991509082			
Pump Set At:					
Static Level:		30.0			
Final Level After Pumping:		34.0			
Recommended Pump Depth:					
Pumping Rate:		5.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		30			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933463877			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		110.0			
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
88	1 of 1	SW/201.7	81.9 / 0.00	BASE LINE TRANSIT WAY OTTAWA ON	WWIS
Well ID: 7300713 Construction Date: Use 1st: Test Hole Use 2nd: Monitoring Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z258448 Tag: A189926 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 12/05/2017 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/730\7300713.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/02/2017			
Year Completed:		2017			
Depth (m):		6.1			
Latitude:		45.3497710190448			
Longitude:		-75.7632036210356			
X:		-75.76320345938166			
Y:		45.34977101215544			
Path:		730\7300713.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1006862418		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		10/02/2017		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		on Water Well Record		wwr	
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007045512			
Layer:		1			
Color:		2			
General Color:		GREY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:					
Material 2 Desc:					
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007045513			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		3.6600000858306885			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007045514			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		3.6600000858306885			
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007045523			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007045524			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.099999904632568			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007045522			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007045521			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007045511			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007045517			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007045518			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1007045516			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007045515			
Diameter:		15.199999809265137			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
89	1 of 6	NE/203.4	81.9 / 0.00	1943 Baseline Rd. Ottawa ON K2C 0C7	EHS
Order No:		20020923018		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Site Report		Client Prov/State:	ON
Report Date:		9/27/02		Search Radius (km):	0.25
Date Received:		9/23/02		X:	-75.760582
Previous Site Name:				Y:	45.352775
Lot/Building Size:					
Additional Info Ordered:					
89	2 of 6	NE/203.4	81.9 / 0.00	1943 BASELINE RD OTTAWA ON K2C 0C7	EHS
Order No:		20050725023		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Basic Report		Client Prov/State:	ON
Report Date:		7/26/2005		Search Radius (km):	0.25
Date Received:		7/25/2005		X:	-75.760727
Previous Site Name:				Y:	45.352892
Lot/Building Size:					
Additional Info Ordered:					
89	3 of 6	NE/203.4	81.9 / 0.00	1943 Baseline Rd Ottawa ON K2C 0C7	EHS
Order No:		20100408065		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		4/19/2010		Search Radius (km):	0.25
Date Received:		4/8/2010		X:	-75.760534
Previous Site Name:				Y:	45.352723
Lot/Building Size:					
Additional Info Ordered:					
89	4 of 6	NE/203.4	81.9 / 0.00	1943 Baseline Road Ottawa ON K2C 0C7	EHS
Order No:		20120508051		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Standard Report		Client Prov/State:	ON
Report Date:		5/11/2012		Search Radius (km):	0.25
Date Received:		5/8/2012		X:	-75.760453
Previous Site Name:				Y:	45.352779
Lot/Building Size:					
Additional Info Ordered:					
89	5 of 6	NE/203.4	81.9 / 0.00	1943 Baseline Rd Ottawa ON K2C0C7	EHS
Order No:		20141119015		Nearest Intersection:	
Status:		C		Municipality:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type: Standard Report Report Date: 25-NOV-14 Date Received: 19-NOV-14 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Client Prov/State: ON Search Radius (km): .25 X: -75.760507 Y: 45.352859					
89	6 of 6	NE/203.4	81.9 / 0.00	1943 Baseline Rd Ottawa ON K2C0C7	EHS
Order No: 20180308161 Status: C Report Type: Standard Report Report Date: 15-MAR-18 Date Received: 08-MAR-18 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.760507 Y: 45.352859					
90	1 of 1	E/205.3	82.9 / 1.00	ON	WWIS
Well ID: 7413186 Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Z379504 Tag: A342690 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Yes Data Src: Date Received: 03/22/2022 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008981759 Depth M: Year Completed: 2021 Well Completed Dt: 11/17/2021 Audit No: Z379504 Path:					
Tag No: A342690 Contractor: 7241 Latitude: 45.3511729537414 Longitude: -75.7594947546183 Y: 45.35117294724384 X: -75.75949459336421					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008981759 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind:					
Elevation: Elevrc: Zone: 18 East83: 440507.00 North83: 5022243.00 Org CS: UTM83 UTMRC: 4					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Completed: 11/17/2021 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
91	1 of 1	ENE/211.9	82.9 / 1.00	1980 BASELINE RD lot 35 con 1 OTTAWA ON	WWIS
Well ID: 7328570 Construction Date: Use 1st: Test Hole Use 2nd: Monitoring Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z229623 Tag: A254687 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 11/19/2018 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: 035 Concession: 01 Concession Name: RF Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1007378982 Depth M: 7.01 Year Completed: 2018 Well Completed Dt: 08/07/2018 Audit No: Z229623 Path:					
Tag No: A254687 Contractor: 7241 Latitude: 45.3520726720206 Longitude: -75.75955785436 Y: 45.35207266493513 X: -75.75955769272916					
<u>Bore Hole Information</u>					
Bore Hole ID: 1007378982 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 08/07/2018 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 440503.00 North83: 5022343.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007637435			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		3.9600000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007637434			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007637437			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		5.789999961853027			
Formation End Depth:		7.010000228881836			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007637436			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		66			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		DENSE			
Formation Top Depth:		3.9600000381469727			
Formation End Depth:		5.789999961853027			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637447			
Layer:		3			
Plug From:		3.6600000858306885			
Plug To:		7.010000228881836			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637446			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.6600000858306885			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637445			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007637444			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007637433			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007637440			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.9600000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID: 1007637441 Layer: 1 Slot: 10 Screen Top Depth: 3.9600000381469727 Screen End Depth: 7.010000228881836 Screen Material: 5 Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter: 6.03000020980835					
Water Details					
Water ID: 1007637439 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
Hole Diameter					
Hole ID: 1007637438 Diameter: 11.430000305175781 Depth From: 0.0 Depth To: 7.010000228881836 Hole Depth UOM: m Hole Diameter UOM: cm					
92	1 of 1	ENE/211.9	82.9 / 1.00	1980 Baseline Road Ottawa ON K2C 3Y9	EHS
Order No: 20301500331 Status: C Report Type: Standard Report Report Date: 20-OCT-20 Date Received: 15-OCT-20 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7595588 Y: 45.3520746					
93	1 of 1	W/213.7	79.9 / -2.00	ON	WWIS
Well ID: 1507860 Construction Date: Use 1st: Domestic Use 2nd: 0 Final Well Status: Water Supply Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: 1 Date Received: 04/01/1952 Selected Flag: TRUE Abandonment Rec: Contractor: 3718 Form Version: 1 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1507860.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		11/30/1951			
Year Completed:		1951			
Depth (m):		35.6616			
Latitude:		45.350948908126			
Longitude:		-75.7647424455203			
X:		-75.7647422845318			
Y:		45.350948901367076			
Path:		150\1507860.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10029895	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		18
Code OB:			East83:		440095.70
Code OB Desc:			North83:		502222.00
Open Hole:			Org CS:		
Cluster Kind:			UTMRC:		9
Date Completed:		11/30/1951	UTMRC Desc:		unknown UTM
Remarks:			Location Method:		p9
Location Method Desc:		Original Pre1985 UTM Rel Code 9: unknown UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008218			
Layer:		1			
Color:		3			
General Color:		BLUE			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		40.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008219			
Layer:		2			
Color:		3			
General Color:		BLUE			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		40.0			
Formation End Depth:		117.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961507860			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578465			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052446			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		40.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052447			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		117.0			
Casing Diameter:		4.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991507860			
Pump Set At:					
Static Level:		40.0			
Final Level After Pumping:		40.0			
Recommended Pump Depth:					
Pumping Rate:		3.0			
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			
Pumping Test Method:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
<u>Water Details</u>					
Water ID:		933462135			
Layer:		3			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		100.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		933462134			
Layer:		2			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		65.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		933462133			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		50.0			
Water Found Depth UOM:		ft			
<u>Water Details</u>					
Water ID:		933462136			
Layer:		4			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		117.0			
Water Found Depth UOM:		ft			
<u>94</u>	1 of 1	ESE/216.4	82.9 / 1.00	1980 baseline rd lot 35 con 1 Ottawa ON	WWIS
Well ID:		7328632		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z229620		Contractor:	7241
Tag:		A254645		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	035
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1007380162			Tag No:	A254645
Depth M:	7.3			Contractor:	7241
Year Completed:	2018			Latitude:	45.3507589270866
Well Completed Dt:	09/06/2018			Longitude:	-75.7594892168858
Audit No:	Z229620			Y:	45.3507589199703
Path:				X:	-75.75948905528743
<u>Bore Hole Information</u>					
Bore Hole ID:	1007380162			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440507.00
Code OB Desc:				North83:	5022197.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/06/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007702073				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	11				
Material 3 Desc:	GRAVEL				
Formation Top Depth:	3.0999999046325684				
Formation End Depth:	7.300000190734863				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007702072				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	79				
Material 3 Desc:	PACKED				
Formation Top Depth:	0.0				
Formation End Depth:	3.0999999046325684				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702289			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702291			
Layer:		3			
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702290			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.4600000381469727			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007702569			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007701883			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007702683			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.269999980926514			
Casing Diameter:		5.1999999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007702734			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Slot:		10			
Screen Top Depth:		4.269999980926514			
Screen End Depth:		7.300000190734863			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007702794			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1007702485			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		7.300000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>95</u>	1 of 1	E/219.3	83.9 / 2.00	1980 baseline lot 35 con 1 Ottawa ON	WWIS
Well ID:	7328583			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z229608			Contractor:	7241
Tag:	A254643			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	035
Depth to Bedrock:				Concession:	01
Well Depth:				Concession Name:	RF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328583.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		09/04/2018			
Year Completed:		2018			
Depth (m):		3.13944			
Latitude:		45.3512462314852			
Longitude:		-75.759304242582			
X:		-75.75930408141059			
Y:		45.35124622401113			
Path:		732\7328583.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1007379281			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440522.00
Code OB Desc:				North83:	5022251.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	09/04/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007702095				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	3.0999999046325684				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007702096				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	11				
Material 3 Desc:	GRAVEL				
Formation Top Depth:	3.0999999046325684				
Formation End Depth:	7.619999885559082				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702097			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		7.619999885559082			
Formation End Depth:		10.300000190734863			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702321			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		7.010000228881836			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702320			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702322			
Layer:		3			
Plug From:		7.010000228881836			
Plug To:		10.300000190734863			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007702578			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007701894			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1007702634			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		23.0			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007702752			
Layer:		1			
Slot:		10			
Screen Top Depth:		7.300000190734863			
Screen End Depth:		10.300000190734863			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		6.03000020980835			
<u>Hole Diameter</u>					
Hole ID:		1007702495			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		10.300000190734863			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
96	1 of 1	ESE/221.5	83.9 / 2.00	1980 Baseline Road Ottawa ON	WWIS
Well ID:	7337703			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	05/28/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z311191			Contractor:	7241
Tag:	A254620			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/733\7337703.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/28/2018				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year Completed:		2018			
Depth (m):		10			
Latitude:		45.3508586973584			
Longitude:		-75.7593756568201			
X:		-75.75937549568826			
Y:		45.35085869054348			
Path:		733\7337703.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1007528424			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440516.00
Code OB Desc:				North83:	5022208.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/28/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007866352				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	28				
Material 3 Desc:	SAND				
Formation Top Depth:	1.5				
Formation End Depth:	10.0				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007866353				
Layer:	3				
Color:					
General Color:					
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:	10.0				
Formation End Depth:					
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1007866351			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.5			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007867564			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		6.699999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007867563			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007867565			
Layer:		3			
Plug From:		6.699999809265137			
Plug To:		10.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007868963			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007864841			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007869309			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:					
		1			
Material:					
		5			
Open Hole or Material:					
		PLASTIC			
Depth From:					
		0.0			
Depth To:					
		7.0			
Casing Diameter:					
		5.199999809265137			
Casing Diameter UOM:					
		cm			
Casing Depth UOM:					
		m			
<u>Construction Record - Screen</u>					
Screen ID:					
		1007869759			
Layer:					
		1			
Slot:					
		10			
Screen Top Depth:					
		7.0			
Screen End Depth:					
		10.0			
Screen Material:					
		5			
Screen Depth UOM:					
		m			
Screen Diameter UOM:					
		cm			
Screen Diameter:					
		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
		1007870373			
Pump Test ID:					
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
		m			
Rate UOM:					
		LPM			
Water State After Test Code:					
Water State After Test:					
		0			
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:					
		1007868476			
Diameter:					
		11.430000305175781			
Depth From:					
		0.0			
Depth To:					
		10.0			
Hole Depth UOM:					
		m			
Hole Diameter UOM:					
		cm			
97	1 of 1	W/224.5	79.9 / -2.00	culvert near Transitway [45.3515083, -75.7649555] OTTAWA ON	SPL
Ref No:					
		1-32WIYX			
Year:					
Incident Dt:					
		3/16/2023 3:30:43 PM			
Dt MOE Arvl on Scn:					
MOE Reported Dt:					
		3/16/2023 3:54:43 PM			
Dt Document Closed:					
		3/28/2023 9:35:54 AM			
Site No:					
MOE Response:					
		Desktop Response			
Municipality No:					
Nature of Damage:					
Discharger Report:					
Material Group:					
Impact to Health:					
		0 No Impact			
Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: culvert near Transitway [45.3515083, -75.7649555] Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: KEV: 15L unknown substance to concrete Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 8.5 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: DIESEL FUEL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: 02K Central Ottawa River Property Tertiary Watershed: 02KF Mississippi River - Central Ottawa River Sector Type: ENGINEERING SERVICES SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003849679"],"wks":["POINT (-75.7649555000 45.3515083000)"],"creation_date":"2023-03-16"} Time Reported: System Facility Address:					

<u>98</u>	1 of 1	ENE/226.0	82.9 / 1.00	ON	WWIS
Well ID: 1507887 Construction Date: Use 1st: Livestock Use 2nd: Domestic Final Well Status: Water Supply Water Type: Casing Material: Audit No: Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: 1 Date Received: 06/27/1960 Selected Flag: TRUE Abandonment Rec: Contractor: 3601 Form Version: 1 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:		OTTAWA CITY			UTM Reliability:
Municipality:					
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/150\1507887.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/21/1960			
Year Completed:		1960			
Depth (m):		44.196			
Latitude:		45.3524234992747			
Longitude:		-75.7595919101538			
X:		-75.75959174871886			
Y:		45.35242349221725			
Path:		150\1507887.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		10029922		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		04/21/1960		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		Original Pre1985 UTM Rel Code 5: margin of error : 100 m - 300 m			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008287			
Layer:		2			
Color:					
General Color:					
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		47.0			
Formation End Depth:		145.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		931008286			
Layer:		1			
Color:					
General Color:					
Material 1:		05			
Material 1 Desc:		CLAY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		47.0			
Formation End Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961507887			
Method Construction Code:		1			
Method Construction:		Cable Tool			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		10578492			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930052500			
Layer:		1			
Material:		1			
Open Hole or Material:		STEEL			
Depth From:					
Depth To:		47.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Casing</u>					
Casing ID:		930052501			
Layer:		2			
Material:		4			
Open Hole or Material:		OPEN HOLE			
Depth From:					
Depth To:		145.0			
Casing Diameter:		6.0			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:		PUMP			
Pump Test ID:		991507887			
Pump Set At:					
Static Level:		22.0			
Final Level After Pumping:		32.0			
Recommended Pump Depth:		32.0			
Pumping Rate:		5.0			
Flowing Rate:					
Recommended Pump Rate:		5.0			
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:		1			
Water State After Test:		CLEAR			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method:		1			
Pumping Duration HR:		1			
Pumping Duration MIN:		0			
Flowing:		No			
Water Details					
Water ID:		933462172			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		145.0			
Water Found Depth UOM:		ft			
99	1 of 1	SSE/226.1	82.9 / 1.00	Baseline Rd Ottawa ON	EHS
Order No:		20120206025		Nearest Intersection:	
Status:		C		Municipality:	
Report Type:		Custom Report		Client Prov/State:	ON
Report Date:		2/17/2012		Search Radius (km):	0.25
Date Received:		2/6/2012		X:	-75.761391
Previous Site Name:				Y:	45.349436
Lot/Building Size:					
Additional Info Ordered:					
100	1 of 1	ESE/228.9	83.6 / 1.69	1980 BASELINE RD OTTAWA ON	WWIS
Well ID:		7261828		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	04/25/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z222220		Contractor:	7241
Tag:		A164296		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7261828.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		04/05/2016			
Year Completed:		2016			
Depth (m):		6.096			
Latitude:		45.350534167229			
Longitude:		-75.7594479127529			
X:		-75.7594477516817			
Y:		45.35053416011767			
Path:		726\7261828.pdf			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Bore Hole Information</u>					
Bore Hole ID:	1005937087			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440510.00
Code OB Desc:				North83:	5022172.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	04/05/2016			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006040658				
Layer:	1				
Color:	8				
General Color:	BLACK				
Material 1:	27				
Material 1 Desc:	OTHER				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	0.0				
Formation End Depth:	0.3100000023841858				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006040659				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	01				
Material 1 Desc:	FILL				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	2.437999963760376				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1006040661				
Layer:	4				
Color:	2				
General Color:	GREY				
Material 1:	06				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1 Desc:		SILT			
Material 2:		34			
Material 2 Desc:		TILL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		3.0480000972747803			
Formation End Depth:		6.0960001945495605			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006040660			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		2.437999963760376			
Formation End Depth:		3.0480000972747803			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006040670			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006040669			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006040671			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		6.0960001945495605			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006040668			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1006040657			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006040664			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0480000972747803			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006040665			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0480000972747803			
Screen End Depth:		6.0960001945495605			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1006040663			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006040662			
Diameter:		15.229999542236328			
Depth From:		0.0			
Depth To:		6.0960001945495605			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
101	1 of 1	S/230.6	82.9 / 1.00	45.349334, -75.762025 OTTAWA ON	SPL
Ref No:	1-29LOOS			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	11/21/2022 10:58:03 AM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	11/21/2022 10:58:03 AM			Impact to Health:	0 No Impact
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:	Desktop Response				
Site County/District:					
Site Geo Ref Meth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 45.349334, -75.762025 Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Sewer (Private or Municipal) Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Incident Summary: Spill: 120 L sanitary sewage to ground - LRT Project - Ottawa Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 120 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: SEWAGE, RAW UNCHLORINATED Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: OTHER HEAVY AND CIVIL ENGINEERING CONSTRUCTION SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003889180"],"wkts":["POINT (-75.7620250000 45.3493340000)","creation_date":"2022-11-21"} Time Reported: System Facility Address:					

102	1 of 72	ENE/231.0	82.9 / 1.00	UNKNOWN 1980 BASELINE ROAD NEPEAN CITY ON K2C 0C6	SPL
Ref No: 100139 Year: Incident Dt: 5/21/1994 Dt MOE Arvl on Scn: MOE Reported Dt: 5/21/1994 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: NEPEAN CITY Site Lot: Site Conc:					
				Municipality No: 20104 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved: FD,WORKS	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: WASTEWATER DISCHARGE TO WATERCOURSE Incident Preceding Spill: Incident Reason: EQUIPMENT FAILURE Incident Summary: UNKNOWN SOURCE-DIESEL TO CREEK BEHIND SHOPPERS CITY WEST SHOPPING CENTER Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Water course or lake Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					

102	2 of 72	ENE/231.0	82.9 / 1.00	LANDAWN SHOPPING CENTRE LTD. 1980 BASELINE ROAD NEPEAN ON	NPCB
Company Code: F1527 Industry: Site Status: Transaction Date: 1/29/1996 Inspection Date:					
--Details--					
Label:					
Serial No.:					
PCB Type/Code: Unknown concentration					
Location:					
Item/State:					
No. of Items:					
Manufacturer:					
Status: Stored for Disposal					
Contents: 41.00 KG					
Label:					
Serial No.:					
PCB Type/Code: Askarel					
Location:					
Item/State:					
No. of Items:					
Manufacturer:					
Status: Stored for Disposal					
Contents: 139.00 KG					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Label: Serial No.: PCB Type/Code: High > 10,000 ppm Location: Item/State: No. of Items: Manufacturer: Status: Stored for Disposal Contents: 2475.00 KG					
Label: Serial No.: PCB Type/Code: Low 50 - 10,000 ppm Location: Item/State: No. of Items: Manufacturer: Status: Stored for Disposal Contents: 3150.00 KG					
Label: Serial No.: PCB Type/Code: Askarel Location: Item/State: No. of Items: Manufacturer: Status: Stored for Disposal Contents: 3840.00 KG					
Label: Serial No.: PCB Type/Code: High > 10,000 ppm Location: Item/State: No. of Items: Manufacturer: Status: Stored for Disposal Contents: 4400.00 KG					
Label: Serial No.: PCB Type/Code: Unknown concentration Location: Item/State: No. of Items: Manufacturer: Status: Stored for Disposal Contents: 4567.00 KG					
102	3 of 72	ENE/231.0	82.9 / 1.00	TOP VALU GAS BAR BOB MITCHELL 1980 BASELINE RD OTTAWA ON K2C3Z4	PRT
Location ID: Type: Expiry Date: Capacity (L): Licence #:		28778 retail 1995-08-31 0 0076427863			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
102	4 of 72	ENE/231.0	82.9 / 1.00	C CORP (ONTARIO) INC ATTN ACCOUNTS PAYABLE 1980 BASELINE RD NEPEAN ON K2C3Z4	PRT
Location ID: Type: Expiry Date: Capacity (L): Licence #:		9579 retail 1996-02-28 0 0053325001			
102	5 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS SUPERMARKETS LIMITED 1980 BASELINE ROAD OTTAWA ON K2C 0C6	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Vendor	Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:		
102	6 of 72	ENE/231.0	82.9 / 1.00	TOWERS DEPARTMENT STORE STORE #54 1980 BASE LINE ROAD NEPEAN ON K1C 2K3	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Vendor	Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:		
102	7 of 72	ENE/231.0	82.9 / 1.00	PIONEER PETROLEUMS 1980 BASE LINE RD OTTAWA ON K2C0C6	RST

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
102	9 of 72	ENE/231.0	82.9 / 1.00	Loblaw Properties Limited 1980 Baseline Road Ottawa Ontario Ottawa ON	EBR
EBR Registry No: IA02E0796 Ministry Ref No: 5433-5C3JW5 Notice Type: Instrument Decision Notice Stage: Notice Date: October 24, 2002 Proposal Date: July 17, 2002 Year: 2002 Instrument Type: (EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air) Off Instrument Name: Posted By: Company Name: Loblaw Properties Limited Site Address: Location Other: Proponent Name: Proponent Address: 22 St. Clair Avenue, Toronto Ontario, M4T 2S5 Comment Period: URL: Summary: Site Location Details: 1980 Baseline Road Ottawa Ontario Ottawa					
102	10 of 72	ENE/231.0	82.9 / 1.00	1980 Baseline Rd. Nepean ON K2C 0C6	EHS
Order No: 20011030003 Status: C Report Type: Custom Report Report Date: 11/5/01 Date Received: 10/30/01 Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: At Woodroffe SE corner Municipality: Ottawa Carleton Client Prov/State: ON Search Radius (km): 0.25 X: -75.762032 Y: 45.351791					
102	11 of 72	ENE/231.0	82.9 / 1.00	LANDAWN SHOPPING CENTRE LTD. 1980 BASELINE ROAD NEPEAN ON K2C 0C6	OPCB
Year: 1998 Site Number: 40294A016 Name Owner: Additional Site Information:					
102	12 of 72	ENE/231.0	82.9 / 1.00	LANDAWN SHOPPING CENTRE LTD. 1980 BASELINE ROAD NEPEAN ON K2C 0C6	OPCB
Year: 1999 Site Number: 40294A016 Name Owner: Additional Site Information:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
102	13 of 72	ENE/231.0	82.9 / 1.00	LANDAWN SHOPPING CENTRE LTD. 1980 BASELINE ROAD NEPEAN ON K2C 0C6	OPCB
Year:		2000			
Site Number:		40294A016			
Name Owner:					
Additional Site Information:					
102	14 of 72	ENE/231.0	82.9 / 1.00	LANDAWN SHOPPING CENTRE LTD. 1980 BASELINE ROAD NEPEAN ON K2C 0C6	OPCB
Year:		2003			
Site Number:		40294A016			
Name Owner:					
Additional Site Information:					
102	15 of 72	ENE/231.0	82.9 / 1.00	LANDAWN SHOPPING CENTRE LTD. 1980 BASELINE ROAD NEPEAN ON K2C 0C6	OPCB
Year:		1995			
Site Number:		40294A016			
Name Owner:					
Additional Site Information:					
--Details--					
Quantity:		360.00			
Address Site:					
Description:		Weight of Bulk Liquid with Low Level PCBs (< 1000 ppm) kg			
102	16 of 72	ENE/231.0	82.9 / 1.00	ZELLERS STORE #26 1980 BASE LINE ROAD NEPEAN ON K2C0C6	PES
Detail Licence No:		23-01-07788-0	Operator Box:		
Licence No:		07788	Operator Class:		
Status:			Operator No:		
Approval Date:			Operator Type:		
Report Source:		Legacy Licenses (Excluding TS)	Oper Area Code:		613
Licence Type:		Limited Vendor	Oper Phone No:		2263260
Licence Type Code:		23	Operator Ext:		
Licence Class:		01	Operator Lot:		
Licence Control:		0	Oper Concession:		
Latitude:			Operator Region:		4
Longitude:			Operator District:		2
Lot:			Operator County:		15
Concession:			Op Municipality:		
Region:		4	Post Office Box:		
District:		2	MOE District:		
County:		15	SWP Area Name:		
Trade Name:					
PDF URL:					
102	17 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS SUPERMARKETS LIMITED 1980 BASELINE ROAD OTTAWA ON K2C0C6	PES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:	23-01-08616-0 08616 Legacy Licenses (Excluding TS) Limited Vendor 23 01 0 4 2 15 			Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: Oper Phone No: Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:	 613 7233200 4 2 15

102	18 of 72	ENE/231.0	82.9 / 1.00	HARZENA HOLDINGS LIMITED COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	GEN

Generator Info

Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON1124501 01,02,03,04 GROCERY FOOD STORES	Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	 6011

Waste Detail(s)

Waste Class: Waste Class Name:	145 PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: Waste Class Name:	241 HALOGENATED SOLVENTS

102	19 of 72	ENE/231.0	82.9 / 1.00	PHOTO QUICK 1980 BASELINE ROAD SHOPPERS CITY WEST NEPEAN ON K2C 0C6	GEN

Generator Info

Generator No: Approval Years: Status: PO Box No: Country: Co Admin:	ON1591901 94,95,96,97,98 	Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	 6571

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin: SIC Description: CAMERA/PHOTO. SUPPLY					
Waste Detail(s)					
Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
102	20 of 72	ENE/231.0	82.9 / 1.00	1980 Baseline Road Ottawa ON K2C 0C6	EHS
Order No: 20050720008 Status: C Report Type: Complete Report Report Date: 7/21/2005 Date Received: 7/20/2005 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.35 X: -75.761272 Y: 45.352073					
102	21 of 72	ENE/231.0	82.9 / 1.00	LANDAWN SHOPPING CENTRE LTD. 1980 BASELINE ROAD NEPEAN ON K2C 0C6	OPCB
Year: 2004 Site Number: 40294A016 Name Owner: Additional Site Information:					
102	22 of 72	ENE/231.0	82.9 / 1.00	LEIKIN GROUP INC. COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	GEN
Generator Info					
Generator No: ON1124501 Approval Years: 05,06,07,08 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s)					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
Waste Detail(s)					
Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES					
Waste Detail(s)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
102	23 of 72	ENE/231.0	82.9 / 1.00	1980 BASELINE RD NEPEAN ON	WWIS
Well ID:		1535160		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Not Used		Data Entry Status:	
Use 2nd:				Data Src: 1	
Final Well Status:		Observation Wells		Date Received: 11/25/2004	
Water Type:				Selected Flag: TRUE	
Casing Material:				Abandonment Rec:	
Audit No:		Z05447		Contractor: 6032	
Tag:		A005119		Form Version: 3	
Constructn Method:				Owner:	
Elevation (m):				County: OTTAWA-CARLETON	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
<u>Bore Hole Information</u>					
Bore Hole ID:		11172912		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC: 9	
Date Completed:		08/19/2004		UTMRC Desc: unknown UTM	
Remarks:				Location Method: na	
Location Method Desc:		Not Applicable i.e. no UTM			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		932969135			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		0.07000000029802322			
Formation End Depth:		3.049999952316284			
Formation End Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932969134			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.07000000029802322			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		932969136			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.049999952316284			
Formation End Depth:		7.619999885559082			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933253312			
Layer:		2			
Plug From:		1.0			
Plug To:		1.7999999523162842			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		933253311			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		961535160			
Method Construction Code:		6			
Method Construction:		Boring			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		11181431			
Casing No:		1			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		930843256			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.30000001192092896			
Depth To:		3.0			
Casing Diameter:		5.0			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		933409122			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0			
Screen End Depth:		7.599999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		5.0			
<u>Hole Diameter</u>					
Hole ID:		11306112			
Diameter:		20.0			
Depth From:		0.0			
Depth To:		7.599999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>102</u>	24 of 72	ENE/231.0	82.9 / 1.00	Loblaw Properties Limited 1980 Baseline Road Ottawa Ontario Ottawa ON	EBR
EBR Registry No:	IA04E1283			Decision Posted:	
Ministry Ref No:	1320-648QTW			Exception Posted:	
Notice Type:	Instrument Decision			Section:	
Notice Stage:				Act 1:	
Notice Date:	November 16, 2004			Act 2:	
Proposal Date:	September 02, 2004			Site Location Map:	
Year:	2004				
Instrument Type:	(EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)				
Off Instrument Name:					
Posted By:					
Company Name:	Loblaw Properties Limited				
Site Address:					
Location Other:					
Proponent Name:					
Proponent Address:	22 St. Clair Avenue, Toronto Ontario, M4T 2S5				
Comment Period:					
URL:					
Summary:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Location Details:					
1980 Baseline Road Ottawa Ontario Ottawa					
102	25 of 72	ENE/231.0	82.9 / 1.00	Loblaws Supermarkets Limited 1980 Baseline Road Ottawa ON K2C 0C6	SPL
Ref No:	0371-5PWQ45			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	7/29/2003			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	Gases/Particulate
MOE Reported Dt:	7/29/2003			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa				
Nearest Watercourse:					
Site Name:	1980 BASELINE ROAD				
Site Address:					
Site Region:	Eastern				
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:	NA				
Easting:	NA				
Entity Operating Name:					
Client Name:	Loblaws Supermarkets Limited				
Client Type:					
Source Type:					
Incident Cause:	Valve / Fitting Leak Or Failure				
Incident Preceding Spill:					
Incident Reason:	Other - Reason not otherwise defined				
Incident Summary:	Loblaws - 486pds. of R 507				
Environment Impact:	Possible				
Health Env Consequence:					
Nature of Impact:	Air Pollution				
Contaminant Qty:	220.909090909091 Kg				
Contaminant Qty 1:	220.909090909091				
Contaminant Unit:	Kg				
Contaminant Code:	38				
Contaminant Name:	REFRIGERANT GAS, N.O.S.				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:	Air				
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:	Other				
SAC Action Class:	Spill to Air				
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
102	26 of 72	ENE/231.0	82.9 / 1.00	1980 Baseline Rd Ottawa ON K2C 0C6	SPL
Ref No: 6523-6DPR23 Year: Incident Dt: 6/25/2005 Dt MOE Arvl on Scn: MOE Reported Dt: 6/25/2005 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: Baseline Rd at Woodroffe<UNOFFICIAL> Site Address: Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Ottawa: spill of treated ground water Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Soil Contamination Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Spills to Land Call Report Locatn Geodata: Time Reported: System Facility Address: Municipality No: Nature of Damage: Discharger Report: 0 Material Group: Miscellaneous Impact to Health: Agency Involved:					
102	27 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS SUPERMARKET LTD, STORE #1050 1980 BASELINE RD OTTAWA ON K2C 0C6	PES
Detail Licence No: Licence No: Status: Approval Date: Report Source: Licence Type: Operator Box: Operator Class: Operator No: Operator Type: Vendor Oper Area Code: Oper Phone No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Licence Type Code: Licence Class: Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
102	28 of 72	ENE/231.0	82.9 / 1.00	LANDWAN SHOPPING CENRTE LTD. 1980 BASELINE ROAD NEPEAN ON	NPCB
Company Code: Industry: Site Status: Transaction Date: Inspection Date:		F1364 UNDEFINED			
102	29 of 72	ENE/231.0	82.9 / 1.00	Loblaw Properties Limited 1980 Baseline Road Ottawa ON K2C 0C6	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		2914-66JL7Z 2004 11/9/2004 Air Approved			
102	30 of 72	ENE/231.0	82.9 / 1.00	Loblaw Properties Limited 1980 Baseline Road Ottawa ON K2C 0C6	CA
Certificate #: Application Year: Issue Date: Approval Type: Status: Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:		8136-5F2HUJ 2002 10/19/2002 Air Approved			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
102	31 of 72	ENE/231.0	82.9 / 1.00	PIONEER ENERGY MANAGEMENT INC. 1980 BASELINE RD OTTAWA ON K2C 0C6	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	10298797	Expired Date:	9/1/1995
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:		Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:			
Original Source:	EXP		
Record Date:	Up to May 2013		

102	32 of 72	ENE/231.0	82.9 / 1.00	TOP VALU GAS BAR BOB MITCHELL 1980 BASELINE RD OTTAWA ON	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	10102201	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	12015	Facility Location:	
Instance Type:	FS Facility	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
TSSA Max Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:		FS Propane Cylr Handling Facility			
Original Source:		EXP			
Record Date:		Up to Mar 2012			

Delisted Expired Fuel Safety Facilities

102	34 of 72	ENE/231.0	82.9 / 1.00	PIONEER ENERGY MANAGEMENT INC. 1980 BASELINE RD OTTAWA ON	DTNK

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: Original Source: Record Date:		Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:			
		FS Piping EXP Up to Mar 2012			

102	35 of 72	ENE/231.0	82.9 / 1.00	PIONEER ENERGY MANAGEMENT INC. 1980 BASELINE RD OTTAWA ON	DTNK

**Delisted Expired Fuel Safety
Facilities**

Instance No: Status: Instance ID: Instance Type: Instance Creation Dt: Instance Install Dt: Item Description: Manufacturer: Model: Serial No: ULC Standard: Quantity: Unit of Measure: Overfill Prot Type: Creation Date: Next Periodic Str DT: TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: Original Source: Record Date:		11607596 EXPIRED 93720 FS Piping	Expired Date: Max Hazard Rank: Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related: Panam Venue Nm: External Identifier: Item: Piping Steel: Piping Galvanized: Tank Single Wall St: Piping Underground: Tank Underground: Source:
		FS Piping EXP Up to Mar 2012	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
102	36 of 72	ENE/231.0	82.9 / 1.00	PIONEER ENERGY MANAGEMENT INC. 1980 BASELINE RD OTTAWA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11607584	Expired Date:
Status:	EXPIRED	Max Hazard Rank:
Instance ID:	93721	Facility Location:
Instance Type:	FS Piping	Facility Type:
Instance Creation Dt:		Fuel Type 2:
Instance Install Dt:		Fuel Type 3:
Item Description:		Panam Related:
Manufacturer:		Panam Venue Nm:
Model:		External Identifier:
Serial No:		Item:
ULC Standard:		Piping Steel:
Quantity:		Piping Galvanized:
Unit of Measure:		Tank Single Wall St:
Overfill Prot Type:		Piping Underground:
Creation Date:		Tank Underground:
Next Periodic Str DT:		Source:
TSSA Base Sched Cycle 2:		
TSSAMax Hazard Rank 1:		
TSSA Risk Based Periodic Yn:		
TSSA Volume of Directives:		
TSSA Periodic Exempt:		
TSSA Statutory Interval:		
TSSA Recd Insp Interva:		
TSSA Recd Tolerance:		
TSSA Program Area:		
TSSA Program Area 2:		
Description:	FS Piping	
Original Source:	EXP	
Record Date:	Up to Mar 2012	

102	37 of 72	ENE/231.0	82.9 / 1.00	PIONEER ENERGY MANAGEMENT INC. 1980 BASELINE RD OTTAWA ON	DTNK

Delisted Expired Fuel Safety Facilities

Instance No:	11607565	Expired Date:
Status:	EXPIRED	Max Hazard Rank:
Instance ID:	93835	Facility Location:
Instance Type:	FS Piping	Facility Type:
Instance Creation Dt:		Fuel Type 2:
Instance Install Dt:		Fuel Type 3:
Item Description:		Panam Related:
Manufacturer:		Panam Venue Nm:
Model:		External Identifier:
Serial No:		Item:
ULC Standard:		Piping Steel:
Quantity:		Piping Galvanized:
Unit of Measure:		Tank Single Wall St:
Overfill Prot Type:		Piping Underground:
Creation Date:		Tank Underground:
Next Periodic Str DT:		Source:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
TSSA Base Sched Cycle 2: TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: FS Piping Original Source: EXP Record Date: Up to Mar 2012					
102	38 of 72	ENE/231.0	82.9 / 1.00	College Square Properties Inc. COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	GEN
Generator Info					
Generator No:	ON1124501			Choice of Contact:	
Approval Years:	2009			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	453999
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	All Other Miscellaneous Store Retailers (except Beer and Wine-Making Supplies Stores)				
Waste Detail(s)					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
Waste Detail(s)					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
102	39 of 72	ENE/231.0	82.9 / 1.00	Loblaws, Store 1050 1980 Baseline Rd Ottawa ON K2C 0C6	GEN
Generator Info					
Generator No:	ON7249443			Choice of Contact:	
Approval Years:	2009			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	445110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Supermarkets and Other Grocery (except Convenience) Stores				
Waste Detail(s)					
Waste Class:	212				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ALIPHATIC SOLVENTS			
102	40 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS SUPERMARKTET LTD, STORE #1050 1980 BASELINE RD OTTAWA ON K2C 0C6	PES
Detail Licence No:		Operator Box:			
Licence No:		Operator Class:			
Status:		Operator No:			
Approval Date:		Operator Type:			
Report Source:		Oper Area Code:			
Licence Type:		Oper Phone No:			
Licence Type Code:		Operator Ext:			
Licence Class:		Operator Lot:			
Licence Control:		Oper Concession:			
Latitude:		Operator Region:			
Longitude:		Operator District:			
Lot:		Operator County:			
Concession:		Op Municipality:			
Region:		Post Office Box:			
District:		MOE District:			
County:		SWP Area Name:			
Trade Name:					
PDF URL:					
102	41 of 72	ENE/231.0	82.9 / 1.00	College Square Properties Inc. COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	GEN
<u>Generator Info</u>					
Generator No:		ON1124501	Choice of Contact:		
Approval Years:		2010	Contaminated Fac:		
Status:			MHSW Facility:		
PO Box No:			SIC Code: 453999		
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		All Other Miscellaneous Store Retailers (except Beer and Wine-Making Supplies Stores)			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
102	42 of 72	ENE/231.0	82.9 / 1.00	College Square Properties Inc. COLLEGE SQUARE, 1980 BASELINE ROAD	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	
<u>Generator Info</u>					
Generator No:	ON1124501			Choice of Contact:	
Approval Years:	2011			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	453999
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	All Other Miscellaneous Store Retailers (except Beer and Wine-Making Supplies Stores)				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
102	43 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS INC. #1050 1980 BASELINE RD OTTAWA ON K2COC6	PES
Detail Licence No:				Operator Box:	
Licence No:	16235			Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:	Legacy Licenses (Excluding TS)			Oper Area Code:	613
Licence Type:	Limited Vendor			Oper Phone No:	7233200
Licence Type Code:	23			Operator Ext:	
Licence Class:	01			Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					
102	44 of 72	ENE/231.0	82.9 / 1.00	College Square Properties Inc. COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON1124501			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	453999
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	All Other Miscellaneous Store Retailers (except Beer and Wine-Making Supplies Stores)				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
102	45 of 72	ENE/231.0	82.9 / 1.00	College Square Properties Inc. COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON	GEN
<u>Generator Info</u>					
Generator No:	ON1124501			Choice of Contact:	
Approval Years:	2013			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	453999
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	ALL OTHER MISCELLANEOUS STORE RETAILERS (EXCEPT BEER AND WINE-MAKING SUPPLIES STORES)				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
102	46 of 72	ENE/231.0	82.9 / 1.00	Loblaw Properties Limited / Proprietes Loblaw Limitee 1980 Baseline Road Ottawa CITY OF OTTAWA ON	EBR
EBR Registry No: 012-6293 Ministry Ref No: 0866-A3HL5D Notice Type: Instrument Decision Notice Stage: Notice Date: June 28, 2016 Proposal Date: January 05, 2016 Year: 2016 Instrument Type: (EPA Part II.1-air) - Environmental Compliance Approval (project type: air) Off Instrument Name: Posted By: Company Name: Loblaw Properties Limited / Proprietes Loblaw Limitee Site Address: Location Other: Proponent Name: Proponent Address: 1 President's Choice Circle, Brampton Ontario, Canada L6Y 5S5 Comment Period: URL: Summary: Site Location Details: 1980 Baseline Road Ottawa CITY OF OTTAWA					
102	47 of 72	ENE/231.0	82.9 / 1.00	Loblaw Properties Limited / Proprietes Loblaw Limitee 1980 Baseline Rd Ottawa ON L6Y 5S5	ECA
Approval No: 3878-AB7LHZ Approval Date: 2016-06-23 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Approval Type: ECA-AIR Project Type: AIR Business Name: Loblaw Properties Limited / Proprietes Loblaw Limitee Address: 1980 Baseline Rd Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/0866-A3HL5D-14.pdf PDF Site Location:					
102	48 of 72	ENE/231.0	82.9 / 1.00	1980 BASELINE RD, OTTAWA ON	INC
Incident No: 1987118 Incident ID: Instance No: Status Code: Incident Status: Incident Severity: Task No: 6459119 Attribute Category: FS-Perform L1 Incident Insp Context: Date of Occurrence: 2016/12/02 00:00:00 Time of Occurrence: 08:37:00 Any Health Impact: No Any Enviro Impact: No Service Intrap: Yes Was Prop Damaged: Yes Reside App. Type: Commer App. Type: Indus App. Type: Institut App. Type: Depth Ground Cover: Operation Pressure: Equipment Type:					

102	49 of 72	ENE/231.0	82.9 / 1.00	Loblaw Properties Limited 1980 Baseline Rd Ottawa ON M4T 2S5	ECA
Approval No:	2914-66JL7Z	MOE District:			
Approval Date:	2004-11-09	City:			
Status:	Revoked and/or Replaced	Longitude:			
Record Type:	ECA	Latitude:			
Link Source:	IDS	Geometry X:			
SWP Area Name:		Geometry Y:			
Approval Type:	ECA-AIR				
Project Type:	AIR				
Business Name:	Loblaw Properties Limited				
Address:	1980 Baseline Rd				
Full Address:					
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/1320-648QTW-14.pdf				
PDF Site Location:					

322	erisinfo.com Environmental Risk Information Services	Order No: 25072400010

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Link Source: SWP Area Name: Approval Type: Project Type: Business Name: Address: Full Address: Full PDF Link: PDF Site Location:	IDS			Geometry X: Geometry Y:	
		ECA-AIR AIR Loblaw Properties Limited 1980 Baseline Rd			
		https://www.accessenvironment.ene.gov.on.ca/instruments/5433-5C3JW5-14.pdf			

102	51 of 72	ENE/231.0	82.9 / 1.00	Loblaw Companies Inc 1980 Baseline Rd. Nepean ON K2C 0C6	GEN

Generator Info

Generator No:	ON6091068	Choice of Contact:	CO_OFFICIAL
Approval Years:	2016	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	445110
Country:	Canada		
Co Admin:	Craig Hudak		
Phone No Admin:	9055957544 Ext.		
SIC Description:	SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	261
Waste Class Name:	PHARMACEUTICALS

Waste Detail(s)

Waste Class:	148
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	122
Waste Class Name:	ALKALINE WASTES - OTHER METALS

Waste Detail(s)

Waste Class:	331
Waste Class Name:	WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		242			
Waste Class Name:		HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		269			
Waste Class Name:		NON-HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			

102	52 of 72	ENE/231.0	82.9 / 1.00	Loblaw Companies Inc 1980 Baseline Rd. Nepean ON K2C 0C6	GEN

Generator Info

Generator No:	ON6091068	Choice of Contact:	CO_OFFICIAL
Approval Years:	2015	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	445110
Country:	Canada		
Co Admin:	James Williams		
Phone No Admin:	6472883298 Ext.		
SIC Description:	SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES		

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
102	53 of 72	ENE/231.0	82.9 / 1.00	College Square Properties Inc. COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	GEN
<u>Generator Info</u>					
Generator No:	ON1124501			Choice of Contact:	CO_ADMIN
Approval Years:	2015			Contaminated Fac:	Yes
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	453999
Country:	Canada				
Co Admin:	Shirley Logan				
Phone No Admin:	(613) 727-5073 Ext.				
SIC Description:	ALL OTHER MISCELLANEOUS STORE RETAILERS (EXCEPT BEER AND WINE-MAKING SUPPLIES STORES)				
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			

102

54 of 72

ENE/231.0

82.9 / 1.00

College Square Properties Inc.
COLLEGE SQUARE, 1980 BASELINE ROAD
FORMERLY SHOPPERS' CITY WEST
OTTAWA ON K2C 0C6

GEN

Generator Info

Generator No:

ON1124501

Approval Years:

2016

Status:

PO Box No:

Country:

Canada

Co Admin:

Shirley Logan

Phone No Admin:

(613) 727-5073 Ext.

SIC Description:

ALL OTHER MISCELLANEOUS STORE RETAILERS (EXCEPT BEER AND WINE-MAKING SUPPLIES STORES)

Choice of Contact:

CO_ADMIN

Contaminated Fac:

Yes

MHSW Facility:

No

SIC Code:

453999

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS Waste Detail(s) Waste Class: 221 Waste Class Name: LIGHT FUELS Waste Detail(s) Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
102	55 of 72	ENE/231.0	82.9 / 1.00	College Square Properties Inc. COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS' CITY WEST OTTAWA ON K2C 0C6	GEN
Generator Info Generator No: ON1124501 Approval Years: 2014 Status: PO Box No: Country: Canada Co Admin: Shirley Logan Phone No Admin: (613) 727-5073 Ext. SIC Description: ALL OTHER MISCELLANEOUS STORE RETAILERS (EXCEPT BEER AND WINE-MAKING SUPPLIES STORES) Choice of Contact: CO_ADMIN Contaminated Fac: Yes MHSW Facility: No SIC Code: 453999					
Waste Detail(s) Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES Waste Detail(s) Waste Class: 221 Waste Class Name: LIGHT FUELS Waste Detail(s) Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
102	56 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS INC. 1980 Baseline Rd. Nepean ON K2C 0C6	GEN
Generator Info Generator No: ON6091068 Approval Years: As of Dec 2018 Status: Registered PO Box No: Country: Canada Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Phone No Admin: SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		242 L			
Waste Class Name:		Halogenated pesticides and herbicides			
<u>Waste Detail(s)</u>					
Waste Class:		242 T			
Waste Class Name:		Halogenated pesticides and herbicides			
<u>Waste Detail(s)</u>					
Waste Class:		262 L			
Waste Class Name:		Detergents and soaps			
<u>Waste Detail(s)</u>					
Waste Class:		261 L			
Waste Class Name:		Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class:		263 C			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		262 C			
Waste Class Name:		Detergents and soaps			
<u>Waste Detail(s)</u>					
Waste Class:		269 L			
Waste Class Name:		Organic non-halogenated pesticide and herbicide wastes			
<u>Waste Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		263 A Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		263 L Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		269 T Organic non-halogenated pesticide and herbicide wastes			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		312 P Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		148 I Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		212 I Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		261 A Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		212 L Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		261 B Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		261 I Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		331 I Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		331 L			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			

102	57 of 72	ENE/231.0	82.9 / 1.00	College Square Properties Inc. COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS CITY WEST OTTAWA ON K2C 0C6	GEN

Generator Info

Generator No:	ON1124501	Choice of Contact:
Approval Years:	As of Dec 2018	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	221 L
Waste Class Name:	Light fuels

Waste Detail(s)

Waste Class:	241 T
Waste Class Name:	Halogenated solvents and residues

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	Waste oils/sludges (petroleum based)

Waste Detail(s)

Waste Class:	241 L

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Halogenated solvents and residues			
102	58 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS INC. #1050 1980 BASELINE RD OTTAWA ON K2C0C6	PES
Detail Licence No: Licence No: 18620 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 613 Oper Phone No: 7233200 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
102	59 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS INC. #1050 1980 BASELINE RD OTTAWA ON K2C0C6	PES
Detail Licence No: 23-01-12353-0 Licence No: 12353 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: 0 Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 613 Oper Phone No: 7233200 Operator Ext: Operator Lot: Oper Concession: Operator Region: 3 Operator District: Operator County: 62 Op Municipality: Post Office Box: MOE District: SWP Area Name:			
102	60 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS SUPERMARKETS LIMITED 1980 BASELINE ROAD OTTAWA ON K2C0C6	PES
Detail Licence No: Licence No: 08616 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Retail Vendor Class 03 Licence Type Code: 21 Licence Class: 03 Licence Control:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 613 Oper Phone No: 7233200 Operator Ext: Operator Lot: Oper Concession:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
102	61 of 72	ENE/231.0	82.9 / 1.00	ZELLERS STORE #26 1980 BASE LINE ROAD NEPEAN ON K2C0C6	PES
Detail Licence No: Licence No: 07788 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Retail Vendor Class 03 Licence Type Code: 21 Licence Class: 03 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:					
Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 613 Oper Phone No: 2263260 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:					
102	62 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS INC. 1980 Baseline Rd. Nepean ON K2C 0C6	GEN
<u>Generator Info</u>					
Generator No: ON6091068 Approval Years: As of Jul 2020 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 263 A Waste Class Name: Misc. waste organic chemicals					
<u>Waste Detail(s)</u>					
Waste Class: 261 L Waste Class Name: Pharmaceuticals					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:			263 C		
Waste Class Name:			Misc. waste organic chemicals		
<u>Waste Detail(s)</u>					
Waste Class:			148 A		
Waste Class Name:			Misc. wastes and inorganic chemicals		
<u>Waste Detail(s)</u>					
Waste Class:			252 L		
Waste Class Name:			Waste crankcase oils and lubricants		
<u>Waste Detail(s)</u>					
Waste Class:			112 C		
Waste Class Name:			Acid solutions - containing heavy metals		
<u>Waste Detail(s)</u>					
Waste Class:			261 B		
Waste Class Name:			Pharmaceuticals		
<u>Waste Detail(s)</u>					
Waste Class:			122 C		
Waste Class Name:			Alkaline slutions - containing other metals and non-metals (not cyanide)		
<u>Waste Detail(s)</u>					
Waste Class:			269 L		
Waste Class Name:			Organic non-halogenated pesticide and herbicide wastes		
<u>Waste Detail(s)</u>					
Waste Class:			262 C		
Waste Class Name:			Detergents and soaps		
<u>Waste Detail(s)</u>					
Waste Class:			331 I		
Waste Class Name:			Waste compressed gases including cylinders		
<u>Waste Detail(s)</u>					
Waste Class:			331 L		
Waste Class Name:			Waste compressed gases including cylinders		
<u>Waste Detail(s)</u>					
Waste Class:			145 L		
Waste Class Name:			Wastes from the use of pigments, coatings and paints		
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		261 A Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		146 T Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		269 T Organic non-halogenated pesticide and herbicide wastes			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		312 P Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		148 I Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		242 L Halogenated pesticides and herbicides			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		263 L Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		145 I Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		242 T Halogenated pesticides and herbicides			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		212 L Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		261 I Pharmaceuticals			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		262 L			
Waste Class Name:		Detergents and soaps			

102	63 of 72	ENE/231.0	82.9 / 1.00	College Square Properties Inc. COLLEGE SQUARE, 1980 BASELINE ROAD FORMERLY SHOPPERS CITY WEST OTTAWA ON K2C 0C6	GEN

Generator Info

Generator No:	ON1124501	Choice of Contact:
Approval Years:	As of Jul 2020	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	241 L
Waste Class Name:	Halogenated solvents and residues

Waste Detail(s)

Waste Class:	221 L
Waste Class Name:	Light fuels

Waste Detail(s)

Waste Class:	241 T
Waste Class Name:	Halogenated solvents and residues

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	Waste oils/sludges (petroleum based)

102	64 of 72	ENE/231.0	82.9 / 1.00	LOBLAWS INC. 1980 Baseline Rd. Nepean ON K2C 0C6	GEN

Generator Info

Generator No:	ON6091068	Choice of Contact:
Approval Years:	As of Nov 2021	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
<u>Waste Detail(s)</u>					
Waste Class:		331 L			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class:		261 I			
Waste Class Name:		Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class:		263 C			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		261 L			
Waste Class Name:		Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class:		269 L			
Waste Class Name:		Organic non-halogenated pesticide and herbicide wastes			
<u>Waste Detail(s)</u>					
Waste Class:		242 L			
Waste Class Name:		Halogenated pesticides and herbicides			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class:		242 T			
Waste Class Name:		Halogenated pesticides and herbicides			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		261 B			
Waste Class Name:		Pharmaceuticals			
<u>Waste Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		269 T			
Waste Class Name:		Organic non-halogenated pesticide and herbicide wastes			
<u>Waste Detail(s)</u>					
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		262 C			
Waste Class Name:		Detergents and soaps			
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		262 L			
Waste Class Name:		Detergents and soaps			
<u>Waste Detail(s)</u>					
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		148 I			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			

[102](#)

65 of 72

ENE/231.0

82.9 / 1.00

College Square Properties Inc.
COLLEGE SQUARE, 1980 BASELINE ROAD
FORMERLY SHOPPERS CITY WEST
OTTAWA ON K2C 0C6

GEN

Generator Info

Generator No: ON1124501
Approval Years: As of Nov 2021
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 241 L
Waste Class Name: Halogenated solvents and residues

Waste Detail(s)

Waste Class: 251 L
Waste Class Name: Waste oils/sludges (petroleum based)

Waste Detail(s)

Waste Class: 221 L
Waste Class Name: Light fuels

Waste Detail(s)

Waste Class: 241 T
Waste Class Name: Halogenated solvents and residues

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
102	66 of 72	ENE/231.0	82.9 / 1.00	LEIKIN GROUP INC. on behalf of COLLEGE SQUARE, FORMERLY SHOPPERSâ€™ CITY WEST COLLEGE SQUARE, 1980 BASELINE ROAD, FORMERLY SHOPPERS' CITY WEST OTTAWA ON	GEN

Generator Info

Generator No:	ON1124501	Choice of Contact:	
Approval Years:	As of Oct 2022	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class: 251 L
Waste Class Name: OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class: 241 T
Waste Class Name: HALOGENATED SOLVENTS

Waste Detail(s)

Waste Class: 241 L
Waste Class Name: HALOGENATED SOLVENTS

Waste Detail(s)

Waste Class: 221 L
Waste Class Name: LIGHT FUELS

Generator Info as of Dec 2024

Generator No:	ON1124501
Generator Company Name:	LEIKIN GROUP INC. on behalf of COLLEGE SQUARE, FORMERLY SHOPPERSâ€™ CITY WEST
Street:	COLLEGE SQUARE, 1980 BASELINE ROAD, FORMERLY SHOPPERS' CITY WEST
City:	OTTAWA
Province State:	Ontario
Country:	Canada
Postal Code:	K2C0C6
Waste Class:	241 L,241 T,251 L,221 L

Waste Class Decoded:

241 - HALOGENATED SOLVENTS; 241 - HALOGENATED SOLVENTS; 251 - OIL SKIMMINGS & SLUDGES; 221 - LIGHT FUELS

2017 Generator Info

Gen No:	ON1124501	Choice of Contact:	CO_ADMIN
ID:	6045	Phone No Official:	(613) 727-5073 Ext.
Contaminated Fac:	Y	Phone No Admin:	(613) 727-5073 Ext.

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility: NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2: Site City: Province Out: Site Postal Code: Site Country: Co Official: Co Admin:	N 453999			County Ont: County Out: District: College Square Properties Inc. College Square COLLEGE SQUARE, 1980 BASELINE ROAD ONTARIO FORMERLY SHOPPERS' CITY WEST OTTAWA K2C 0C6 Canada Barbara Farber Shirley Logan	OTTAWA CARLTON (RM) 402
<u>2017 Generator Manifest</u>					
ID: Generator No: Receiver Type: Waste Char: Waste Code:	21821 ON1124501 035 L 221			Sum Received Qty: Waste Class Name: Count Manifests: District:	1435.0 LIGHT FUELS 1 402
<u>2017 Generator Manifest</u>					
ID: Generator No: Receiver Type: Waste Char: Waste Code:	21822 ON1124501 035 T 241			Sum Received Qty: Waste Class Name: Count Manifests: District:	205.0 HALOGENATED SOLVENTS 1 402
<u>2017 Generator Manifest</u>					
ID: Generator No: Receiver Type: Waste Char: Waste Code:	21823 ON1124501 035 L 251			Sum Received Qty: Waste Class Name: Count Manifests: District:	824.0 OIL SKIMMINGS & SLUDGES 1 402
<u>2018 Generator Info</u>					
Gen No: ID: Contaminated Fac: MHSW Facility: NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2:	ON1124501 5900 Y N 453999 College Square Properties Inc. College Square COLLEGE SQUARE, 1980 BASELINE ROAD ONTARIO FORMERLY SHOPPERS' CITY WEST			Choice of Contact: Phone No Official: Phone No Admin: County Ont: County Out: District:	CO_ADMIN (613) 727-5073 Ext. (613) 727-5073 Ext. OTTAWA CARLTON (RM) 402

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K2C 0C6			
Site Country:		Canada			
Co Official:		Barbara Farber			
Co Admin:		Shirley Logan			
<u>2018 Generator Manifest</u>					
ID:	21479			Sum Received Qty:	46855.0
Generator No:	ON1124501			Waste Class Name:	LIGHT FUELS
Receiver Type:	035			Count Manifests:	9
Waste Char:	L			District:	402
Waste Code:	221				
<u>2019 Generator Info</u>					
Gen No:	ON1124501			Choice of Contact:	CO_ADMIN
ID:	5741			Phone No Official:	(613) 727-5073 Ext.
Contaminated Fac:	Y			Phone No Admin:	(613) 727-5073 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	453999			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	College Square Properties Inc.				
Gen Div:					
Gen Op Name:	College Square				
Gen Op Div:					
Site Adrs1:	COLLEGE SQUARE, 1980 BASELINE ROAD				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:	FORMERLY SHOPPERS' CITY WEST				
Site City:	OTTAWA				
Province Out:					
Site Postal Code:	K2C 0C6				
Site Country:	Canada				
Co Official:	Barbara Farber				
Co Admin:	Shirley Logan				
<u>2019 Generator Manifest</u>					
ID:	21228			Sum Received Qty:	1025.0
Generator No:	ON1124501			Waste Class Name:	LIGHT FUELS
Receiver Type:	035			Count Manifests:	2
Waste Char:	L			District:	402
Waste Code:	221				
<u>2020 Generator Info</u>					
Gen No:	ON1124501			Choice of Contact:	CO_ADMIN
ID:	5558			Phone No Official:	(613) 727-5073 Ext.
Contaminated Fac:	Y			Phone No Admin:	(613) 727-5073 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	453999			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	College Square Properties Inc.				
Gen Div:					
Gen Op Name:	College Square				
Gen Op Div:					
Site Adrs1:	COLLEGE SQUARE, 1980 BASELINE ROAD				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Bldg: Site Pobox: Province In:ONTARIO Site Adrs2:FORMERLY SHOPPERS' CITY WEST Site City:OTTAWA Province Out: Site Postal Code:K2C 0C6 Site Country:Canada Co Official:Barbara Farber Co Admin:Shirley Logan					
2020 Generator Manifest					
ID:	18860			Sum Received Qty:	1200.0
Generator No:	ON1124501			Waste Class Name:	LIGHT FUELS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	221				
2021 Generator Info					
Gen No:	ON1124501			Choice of Contact:	CO_ADMIN
ID:	5436			Phone No Official:	(613) 727-5073 Ext.
Contaminated Fac:	Y			Phone No Admin:	(613) 727-5073 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	453999			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	College Square Properties Inc.				
Gen Div:					
Gen Op Name:	College Square				
Gen Op Div:					
Site Adrs1:	COLLEGE SQUARE, 1980 BASELINE ROAD				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:	FORMERLY SHOPPERS' CITY WEST				
Site City:	OTTAWA				
Province Out:					
Site Postal Code:	K2C 0C6				
Site Country:	Canada				
Co Official:	Barbara Farber				
Co Admin:	Shirley Logan				
2021 Generator Manifest					
ID:	19275			Sum Received Qty:	205.0
Generator No:	ON1124501			Waste Class Name:	HALOGENATED SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	T			District:	402
Waste Code:	241				
102	67 of 72	ENE/231.0	82.9 / 1.00	PIONEER ENERGY MANAGEMENT INC 1980 BASELINE RD OTTAWA ON	EXP
Inventory No:	11607508			Tank Material:	Fiberglass (FRP)
Inventory Status:	EXPIRED			Corrosion Protect:	Fiberglass
Installation Year:	1986			Overfill Protection:	
Capacity:	36300			Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Manufacturer: Model: Description: Previous Fuel Type: Gasoline					
102	68 of 72	ENE/231.0	82.9 / 1.00	PIONEER ENERGY MANAGEMENT INC 1980 BASELINE RD OTTAWA ON	EXP
Inventory No: 11607536 Inventory Status: EXPIRED Installation Year: 1986 Capacity: 22700 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
102	69 of 72	ENE/231.0	82.9 / 1.00	PIONEER ENERGY MANAGEMENT INC 1980 BASELINE RD OTTAWA ON	EXP
Inventory No: 11607548 Inventory Status: EXPIRED Installation Year: 1986 Capacity: 22700 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Diesel					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
102	70 of 72	ENE/231.0	82.9 / 1.00	PIONEER ENERGY MANAGEMENT INC 1980 BASELINE RD OTTAWA ON	EXP
Inventory No: 11607521 Inventory Status: EXPIRED Installation Year: 1988 Capacity: 36300 Capacity Unit: Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					
102	71 of 72	ENE/231.0	82.9 / 1.00	PIONEER ENERGY MANAGEMENT INC 1980 BASELINE RD OTTAWA ON	EXP
Inventory No: 11607491 Inventory Status: EXPIRED Installation Year: 1986 Capacity: 45500 Capacity Unit:					
Tank Material: Fiberglass (FRP) Corrosion Protect: Fiberglass Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Tank Type: Manufacturer: Model: Description: Previous Fuel Type: Gasoline					
102	72 of 72	ENE/231.0	82.9 / 1.00	LOBLAW PROPERTIES LIMITED/PROPRIETES LOBLAW LIMITEE Loblaws, 1980 Baseline Rd., Ottawa OTTAWA ON	SPL
Ref No: 1-3GK91C Year: Incident Dt: 5/13/2023 11:00:46 AM Dt MOE Arvl on Scn: MOE Reported Dt: 5/13/2023 2:17:46 PM Dt Document Closed: 5/15/2023 6:15:18 AM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: Loblaws, 1980 Baseline Rd., Ottawa Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: LOBLAW PROPERTIES LIMITED/PROPRIETES LOBLAW LIMITEE Client Type: Private Business Source Type: Valve/Fitting/Piping Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Equipment failure/malfunction Incident Summary: TSSA BPV: 100kg R449-A Refrigerant to atm, Parson Refrigeration - Loblaws Ottawa Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 100 kilogram (kg) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: REFRIGERANT GASES (N.O.S.) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Air Activity Preceding Spill: Normal operations Property 2nd Watershed: Lower Ottawa Property Tertiary Watershed: 02KE - Lower Madawaska Sector Type: SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003865291"],"wks":["POINT (-75.7600862793 45.3521816110)"],"creation_date":"2023-05-13"} Time Reported: System Facility Address:					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
104	1 of 1	NE/233.3	81.9 / 0.00	45.353276, -75.760728 OTTAWA ON	SPL
Ref No: 1-28F0U7 Year: Incident Dt: 10/27/2022 7:00:00 AM Dt MOE Arvl on Scn: MOE Reported Dt: 10/27/2022 8:06:01 AM Dt Document Closed: 10/27/2022 11:59:16 AM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 45.353276, -75.760728 Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Motor Vehicle Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: OLRT - 1.5L hydraulic oil to ground, cleaned Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 1.5 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: 02K Central Ottawa River Property Tertiary Watershed: 02KF Mississippi River - Central Ottawa River Sector Type: CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003852812"],"wks":["POINT (-75.7607280000 45.3532760000)","creation_date":"2022-10-27"} Time Reported: System Facility Address: Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:					
105	1 of 1	ENE/233.6	82.9 / 1.00	1980 BASELINE OTTAWA ON	WWIS
Well ID: 7328581 Construction Date: Use 1st: Test Hole Use 2nd: Monitoring Flowing (Y/N): Flow Rate: Data Entry Status: Data Src:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Final Well Status:	Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z229619			Contractor:	7241
Tag:	A254641			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328581.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	08/30/2018				
Year Completed:	2018				
Depth (m):	12.1				
Latitude:	45.3525227008807				
Longitude:	-75.7595638744598				
X:	-75.7595637122997				
Y:	45.35252269422887				
Path:	732\7328581.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1007379268			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	440503.00
Code OB Desc:				North83:	5022393.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	08/30/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007637929				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	2.740000009536743				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007637930			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		34			
Material 1 Desc:		TILL			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		4.570000171661377			
Formation End Depth:		12.100000381469727			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007637928			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		2.740000009536743			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637938			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637939			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		8.800000190734863			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007637940			
Layer:		3			
Plug From:		8.800000190734863			
Plug To:		12.100000381469727			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007637937			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007637927			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007637933			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		9.100000381469727			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007637934			
Layer:		1			
Slot:		10			
Screen Top Depth:		9.100000381469727			
Screen End Depth:		12.100000381469727			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1007637932			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1007637931			
Diameter:		15.319999694824219			
Depth From:		0.0			
Depth To:		12.100000381469727			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
106	1 of 1	ENE/238.6	82.9 / 1.00	1980 BASELINE RD OTTAWA ON	WWIS
Well ID:7261829 Construction Date: Use 1st:Monitoring and Test Hole Use 2nd:0 Final Well Status:Monitoring and Test Hole Water Type: Casing Material: Audit No:Z222216 Tag:A164295 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality:NEPEAN TOWNSHIP Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received:04/25/2016 Selected Flag:TRUE Abandonment Rec: Contractor:7241 Form Version:7 Owner: County:OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/726\7261829.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		04/04/2016			
Year Completed:		2016			
Depth (m):		8.23			
Latitude:		45.352550042177			
Longitude:		-75.7595131744638			
X:		-75.75951301229786			
Y:		45.35255003514788			
Path:		726\7261829.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1005937090		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				440507.00	
Cluster Kind:				North83:	
Date Completed:		04/04/2016		5022396.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1006040695			
Layer:		1			
Color:		8			
General Color:		BLACK			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006040697			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		4.570000171661377			
Formation End Depth:		6.090000152587891			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006040696			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1006040698			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		6.090000152587891			
Formation End Depth:		8.229999542236328			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1006040708			
Layer:		3			
Plug From:		4.880000114440918			
Plug To:		8.229999542236328			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006040707			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1006040706			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1006040705			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1006040694			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1006040701			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.179999828338623			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1006040702			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.179999828338623			
Screen End Depth:		8.229999542236328			
Screen Material:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1006040700			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1006040699			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.229999542236328			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

<u>107</u>	1 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa 1300 Woodroffe Ave. Ottawa ON K2C 3X4	GEN

Generator Info

Generator No:	ON6740475	Choice of Contact:	
Approval Years:	07,08	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	484221
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Bulk Liquids Trucking Local		

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

<u>107</u>	2 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa 1300 Woodroffe Ave. Ottawa ON K2C 3X4	GEN

Generator Info

Generator No:	ON6740475	Choice of Contact:	
Approval Years:	2009	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	484221
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Bulk Liquids Trucking Local		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
107	3 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa 1300 Woodroffe Ave. Ottawa ON K2C 3X4	GEN
<u>Generator Info</u>					
Generator No:		ON6740475		Choice of Contact:	
Approval Years:		2010		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	484221
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Bulk Liquids Trucking Local			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
107	4 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa 1300 Woodroffe Ave. Ottawa ON K2C 3X4	GEN
<u>Generator Info</u>					
Generator No:		ON6740475		Choice of Contact:	
Approval Years:		2012		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	484221
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Bulk Liquids Trucking Local			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
107	5 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa 1300 Woodroffe Ave. Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:		ON6740475		Choice of Contact:	
Approval Years:		2013		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	484221
Country:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Phone No Admin: SIC Description: BULK LIQUIDS TRUCKING, LOCAL					
Waste Detail(s)					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
107	6 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa 1300 Woodroffe Ave Carleton Ottawa ON K1P 1J1	ECA
Approval No: 0460-74UMJR Approval Date: 2007-07-09 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-AIR Project Type: AIR Business Name: City of Ottawa Address: 1300 Woodroffe Ave Carleton Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/1687-6Z8L5E-14.pdf PDF Site Location:					
MOE District: Ottawa City: Longitude: -75.76702 Latitude: 45.353516 Geometry X: Geometry Y:					
107	7 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa 1300 Woodroffe Ave. Ottawa ON K2C 3X4	GEN
Generator Info					
Generator No: ON6740475 Approval Years: 2016 Status: PO Box No: Country: Canada Co Admin: Darin McGuinty Phone No Admin: 613 580-2424 Ext.21181 SIC Description: BULK LIQUIDS TRUCKING, LOCAL					
Choice of Contact: CO_OFFICIAL Contaminated Fac: No MHSW Facility: No SIC Code: 484221					
Waste Detail(s)					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
107	8 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa 1300 Woodroffe Ave. Ottawa ON K2C 3X4	GEN
Generator Info					
Generator No: ON6740475 Approval Years: 2015 Status: PO Box No:					
Choice of Contact: CO_OFFICIAL Contaminated Fac: No MHSW Facility: No SIC Code: 484221					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Canada Co Admin: Darin McGuinty Phone No Admin: 613 580-2424 Ext.21181 SIC Description: BULK LIQUIDS TRUCKING, LOCAL					
<u>Waste Detail(s)</u>					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
107	9 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa 1300 Woodroffe Ave. Ottawa ON K2C 3X4	GEN
<u>Generator Info</u>					
Generator No: ON6740475 Approval Years: 2014 Status: PO Box No: Country: Canada Co Admin: Jim Lethbridge Phone No Admin: 613 580-2424 Ext.21119 SIC Description: BULK LIQUIDS TRUCKING, LOCAL					
Choice of Contact: CO_OFFICIAL Contaminated Fac: No MHSW Facility: No SIC Code: 484221					
<u>Waste Detail(s)</u>					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
107	10 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa Public Works 1300 Woodroffe Ave. Ottawa ON K2C 3X4	GEN
<u>Generator Info</u>					
Generator No: ON6740475 Approval Years: As of Dec 2018 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 251 L Waste Class Name: Waste oils/sludges (petroleum based)					
107	11 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa Public Works 1300 Woodroffe Ave. Ottawa ON K2C 3X4	GEN
<u>Generator Info</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON6740475 Approval Years: As of Jul 2020 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 251 L Waste Class Name: Waste oils/sludges (petroleum based)					
107	12 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa Public Works 1300 Woodroffe Ave. Ottawa ON K2C 3X4	GEN
<u>Generator Info</u>					
Generator No: ON6740475 Approval Years: As of Nov 2021 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 251 L Waste Class Name: Waste oils/sludges (petroleum based)					
107	13 of 13	WNW/245.0	79.9 / -2.00	City of Ottawa Facility Operations Service 1300 Woodroffe Avenue Ottawa ON	GEN
<u>Generator Info</u>					
Generator No: ON6740475 Approval Years: As of Oct 2022 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 251 L Waste Class Name: OIL SKIMMINGS & SLUDGES					
<u>Generator Info as of Dec 2024</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:		ON6740475			
Generator Company Name:		City of Ottawa Facility Operations Service			
Street:		1300 Woodroffe Avenue			
City:		Ottawa			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2C 3X4			
Waste Class:		251 L			
 Waste Class Decoded:					
251 - OIL SKIMMINGS & SLUDGES					
 <u>2017 Generator Info</u>					
Gen No:	ON6740475			Choice of Contact:	CO_OFFICIAL
ID:	26505			Phone No Official:	613 828-3118 Ext.0
Contaminated Fac:	N			Phone No Admin:	613 580-2424 Ext.21181
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	484221			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		City of Ottawa			
Gen Div:		Public Works			
Gen Op Name:		City of Ottawa			
Gen Op Div:		Public Works			
Site Adrs1:		1300 Woodroffe Ave.			
Site Bldg:		Fire Station 21			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 3X4			
Site Country:		Canada			
Co Official:		Glen J McDonald			
Co Admin:		Darin McGuinty			
 <u>2018 Generator Info</u>					
Gen No:	ON6740475			Choice of Contact:	CO_OFFICIAL
ID:	26877			Phone No Official:	613 828-3118 Ext.0
Contaminated Fac:	N			Phone No Admin:	613 580-2424 Ext.22755
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	484221			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		City of Ottawa			
Gen Div:		Public Works			
Gen Op Name:		City of Ottawa			
Gen Op Div:		Public Works			
Site Adrs1:		1300 Woodroffe Ave.			
Site Bldg:		Fire Station 21			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 3X4			
Site Country:		Canada			
Co Official:		Glen J McDonald			
Co Admin:		Bill Jackson			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2019 Generator Info</u>					
Gen No:	ON6740475			Choice of Contact:	CO_OFFICIAL
ID:	27106			Phone No Official:	613 828-3118 Ext.0
Contaminated Fac:	N			Phone No Admin:	613 580-2424 Ext.22755
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	484221			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	City of Ottawa				
Gen Div:	Public Works				
Gen Op Name:	City of Ottawa				
Gen Op Div:	Public Works				
Site Adrs1:	1300 Woodroffe Ave.				
Site Bldg:	Fire Station 21				
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 3X4				
Site Country:	Canada				
Co Official:	Glen J McDonald				
Co Admin:	Bill Jackson				
<u>2019 Generator Manifest</u>					
ID:	52288			Sum Received Qty:	4250.0
Generator No:	ON6740475			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	251				
<u>2020 Generator Info</u>					
Gen No:	ON6740475			Choice of Contact:	CO_OFFICIAL
ID:	26833			Phone No Official:	613 828-3118 Ext.0
Contaminated Fac:	N			Phone No Admin:	613 580-2424 Ext.22755
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	484221			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	City of Ottawa				
Gen Div:	Public Works				
Gen Op Name:	City of Ottawa				
Gen Op Div:	Public Works				
Site Adrs1:	1300 Woodroffe Ave.				
Site Bldg:	Fire Station 21				
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 3X4				
Site Country:	Canada				
Co Official:	Glen J McDonald				
Co Admin:	Bill Jackson				
<u>2020 Generator Manifest</u>					
ID:	48814			Sum Received Qty:	2000.0
Generator No:	ON6740475			Waste Class Name:	OIL SKIMMINGS & SLUDGES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiver Type: Waste Char: Waste Code:	035 L 251			Count Manifests: District:	1 402
<u>2021 Generator Info</u>					
Gen No: ID: Contaminated Fac: MHSW Facility: NAICS Code1: NAICS Code2: NAICS Code3: Gen Name: Gen Div: Gen Op Name: Gen Op Div: Site Adrs1: Site Bldg: Site Pobox: Province In: Site Adrs2: Site City: Province Out: Site Postal Code: Site Country: Co Official: Co Admin:	ON6740475 27312 N N 484221 City of Ottawa Public Works City of Ottawa Public Works 1300 Woodroffe Ave. Fire Station 21 ONTARIO Ottawa K2C 3X4 Canada Glen J McDonald Bill Jackson			Choice of Contact: Phone No Official: Phone No Admin: County Ont: County Out: District:	CO_OFFICIAL 613 828-3118 Ext.0 613 580-2424 Ext.22755 OTTAWA CARLTON (RM) 402
<u>2021 Generator Manifest</u>					
ID: Generator No: Receiver Type: Waste Char: Waste Code:	50703 ON6740475 035 L 251			Sum Received Qty: Waste Class Name: Count Manifests: District:	5750.0 OIL SKIMMINGS & SLUDGES 1 402
108	1 of 11	E/245.9	83.9 / 2.00	LAUNDRY LAND 24-960 1363 WOODROFFE AVENUE NEPEAN ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON0550901 92,93,94,95,96,97,98 POWER LAUND./CLEANER			Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	 9721
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:	241 HALOGENATED SOLVENTS				
108	2 of 11	E/245.9	83.9 / 2.00	CLENNAWAY LTD. 1363 WOODROFFE NEPEAN ON K2G 1V7	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON1341400			Choice of Contact:	
Approval Years:	90			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9721
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		POWER LAUND./CLEANER			
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
108	3 of 11	E/245.9	83.9 / 2.00	LAUNDRY LINE 08-737 1363 WOODROFFE NEPEAN ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No:	ON1341400			Choice of Contact:	
Approval Years:	92,93,94,95,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9721
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		POWER LAUND./CLEANER			
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
108	4 of 11	E/245.9	83.9 / 2.00	LAUNDRY LINE 1363 WOODROFFE NEPEAN ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No:	ON1341400			Choice of Contact:	
Approval Years:	99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9721
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		POWER LAUND./CLEANERS			
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
108	5 of 11	E/245.9	83.9 / 2.00	Rexall Pharmacy Group Ltd. 1363B Woodroffe Avenue Nepean ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No:	ON7377997			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	446110
Country:	Canada				
Co Admin:	Erik Botines				
Phone No Admin:	905-502-5965 Ext.				
SIC Description:	446110				
<u>Waste Detail(s)</u>					
Waste Class:	261				
Waste Class Name:	PHARMACEUTICALS				
<u>Waste Detail(s)</u>					
Waste Class:	312				
Waste Class Name:	PATHOLOGICAL WASTES				
108	6 of 11	E/245.9	83.9 / 2.00	Pharma Plus Drugmarts Ltd 1363B Woodroffe Avenue Nepean ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No:	ON7377997			Choice of Contact:	CO_ADMIN
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	446110
Country:	Canada				
Co Admin:	Erik Botines				
Phone No Admin:	905-502-5965 Ext.				
SIC Description:	446110				
<u>Waste Detail(s)</u>					
Waste Class:	312				
Waste Class Name:	PATHOLOGICAL WASTES				
108	7 of 11	E/245.9	83.9 / 2.00	Pharma Plus Drugmarts Ltd 1363B Woodroffe Avenue Nepean ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No:	ON7377997			Choice of Contact:	CO_ADMIN
Approval Years:	2014			Contaminated Fac:	No
Status:				MHSW Facility:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No:				SIC Code:	446110
Country:		Canada			
Co Admin:		Aaron Schrama			
Phone No Admin:		905-502-5965 Ext.			
SIC Description:		446110			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
108	8 of 11	E/245.9	83.9 / 2.00	Rexall Pharmacy Group Ltd. 1363B Woodroffe Avenue Nepean ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No:		ON7377997		Choice of Contact:	
Approval Years:		As of Dec 2018		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
108	9 of 11	E/245.9	83.9 / 2.00	Rexall Pharmacy Group Ltd. 1363B Woodroffe Avenue Nepean ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No:		ON7377997		Choice of Contact:	
Approval Years:		As of Jul 2020		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
108	10 of 11	E/245.9	83.9 / 2.00	Rexall Pharmacy Group Ltd. 1363B Woodroffe Avenue Nepean ON K2G 1V7	GEN
<u>Generator Info</u>					
Generator No:		ON7377997		Choice of Contact:	
Approval Years:		As of Nov 2021		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		Pharmaceuticals			
108	11 of 11	E/245.9	83.9 / 2.00	Rexall Pharmacy Group Ltd 1363B Woodroffe Avenue Nepean ON	GEN
<u>Generator Info</u>					
Generator No:		ON7377997		Choice of Contact:	
Approval Years:		As of Oct 2022		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		261 A			
Waste Class Name:		PHARMACEUTICALS			
Generator Info as of Dec 2024					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:		ON7377997			
Generator Company Name:		Rexall Pharmacy Group Ltd			
Street:		1363B Woodroffe Avenue			
City:		Nepean			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2G1V7			
Waste Class:		312 P,261 A			
 Waste Class Decoded:					
312 - PATHOLOGICAL WASTES; 261 - PHARMACEUTICALS					
 <u>2017 Generator Info</u>					
Gen No:	ON7377997			Choice of Contact:	CO_ADMIN
ID:	28892			Phone No Official:	9055017800 Ext.
Contaminated Fac:	N			Phone No Admin:	9055017800 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	446110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Rexall Pharmacy Group Ltd.			
Gen Div:					
Gen Op Name:		Rexall Pharma Plus #1149			
Gen Op Div:					
Site Adrs1:		1363B Woodroffe Avenue			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Nepean			
Province Out:					
Site Postal Code:		K2G 1V7			
Site Country:		Canada			
Co Official:		Mona Sabharwal			
Co Admin:		Lisa O'Keefe			
 <u>2018 Generator Info</u>					
Gen No:	ON7377997			Choice of Contact:	CO_ADMIN
ID:	29371			Phone No Official:	9055017800 Ext.
Contaminated Fac:	N			Phone No Admin:	9055017800 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	446110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Rexall Pharmacy Group Ltd.			
Gen Div:					
Gen Op Name:		Rexall Pharma Plus #1149			
Gen Op Div:					
Site Adrs1:		1363B Woodroffe Avenue			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Nepean			
Province Out:					
Site Postal Code:		K2G 1V7			
Site Country:		Canada			
Co Official:		Mona Sabharwal			
Co Admin:		Lisa O'Keefe			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2018 Generator Manifest</u>					
ID:	55607			Sum Received Qty:	12.2
Generator No:	ON7377997			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2019 Generator Info</u>					
Gen No:	ON7377997			Choice of Contact:	CO_ADMIN
ID:	29685			Phone No Official:	9055017800 Ext.
Contaminated Fac:	N			Phone No Admin:	9055017800 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	446110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Rexall Pharmacy Group Ltd.			
Gen Div:					
Gen Op Name:		Rexall Pharma Plus #1149			
Gen Op Div:					
Site Adrs1:		1363B Woodroffe Avenue			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Nepean			
Province Out:					
Site Postal Code:		K2G 1V7			
Site Country:		Canada			
Co Official:		Mona Sabharwal			
Co Admin:		Christy Raposo			
<u>2019 Generator Manifest</u>					
ID:	55712			Sum Received Qty:	33.0
Generator No:	ON7377997			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	2
Waste Char:	P			District:	402
Waste Code:	312				
<u>2020 Generator Info</u>					
Gen No:	ON7377997			Choice of Contact:	CO_ADMIN
ID:	29378			Phone No Official:	9055017800 Ext.
Contaminated Fac:	N			Phone No Admin:	9055017800 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	446110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Rexall Pharmacy Group Ltd.			
Gen Div:					
Gen Op Name:		Rexall Pharma Plus #1149			
Gen Op Div:					
Site Adrs1:		1363B Woodroffe Avenue			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Nepean			
Province Out:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB		
Site Postal Code:		K2G 1V7					
Site Country:		Canada					
Co Official:		Mona Sabharwal					
Co Admin:		Christy Raposo					
<u>2020 Generator Manifest</u>							
ID:	52047			Sum Received Qty:	15.56		
Generator No:	ON7377997			Waste Class Name:	PATHOLOGICAL WASTES		
Receiver Type:	030			Count Manifests:	1		
Waste Char:	P			District:	402		
Waste Code:	312						
<u>2021 Generator Info</u>							
Gen No:	ON7377997			Choice of Contact:	CO_ADMIN		
ID:	29984			Phone No Official:	9055017800 Ext.		
Contaminated Fac:	N			Phone No Admin:	9055017800 Ext.		
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)		
NAICS Code1:	446110			County Out:			
NAICS Code2:				District:	402		
NAICS Code3:							
Gen Name:	Rexall Pharmacy Group Ltd.						
Gen Div:							
Gen Op Name:	Rexall Pharma Plus #1149						
Gen Op Div:							
Site Adrs1:	1363B Woodroffe Avenue						
Site Bldg:							
Site Pobox:							
Province In:	ONTARIO						
Site Adrs2:							
Site City:	Nepean						
Province Out:							
Site Postal Code:	K2G 1V7						
Site Country:	Canada						
Co Official:	Mona Sabharwal						
Co Admin:	Christy Raposo						
109	1 of 17	NW/245.9	80.2 / -1.69	ONTARIO HYDRO 1307 WOODROOFE AVENUE TRANSFORMER OTTAWA CITY ON	SPL		
Ref No:	118368			Municipality No:	20101		
Year:				Nature of Damage:			
Incident Dt:	9/11/1995			Discharger Report:			
Dt MOE Arvl on Scn:				Material Group:			
MOE Reported Dt:	9/11/1995			Impact to Health:			
Dt Document Closed:				Agency Involved:	WORKS		
Site No:							
MOE Response:							
Site County/District:							
Site Geo Ref Meth:							
Site District Office:							
Nearest Watercourse:							
Site Name:							
Site Address:							
Site Region:							
Site Municipality:	OTTAWA CITY						
Site Lot:							
Site Conc:							
Site Geo Ref Accu:							
Site Map Datum:							
Northin							

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: COOLING SYSTEM LEAK Incident Preceding Spill: Incident Reason: EQUIPMENT FAILURE Incident Summary: ONTARIO HYDRO: 743 L OF MINERAL OIL (2 PPM PCB) TO GRAVEL AT STATION Environment Impact: CONFIRMED Health Env Consequence: Nature of Impact: Soil contamination Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
109	2 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc. 1307 Woodroffe Avenue Ottawa CITY OF OTTAWA ON	EBR
EBR Registry No: 010-3620 Ministry Ref No: 0733-7EKRL4 Notice Type: Instrument Decision Notice Stage: Notice Date: December 10, 2008 Proposal Date: May 27, 2008 Year: 2008 Instrument Type: (EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air) Off Instrument Name: Posted By: Company Name: Hydro One Networks Inc. Site Address: Location Other: Proponent Name: Proponent Address: 483 Bay Street, Toronto Ontario, Canada M5G 2P5 Comment Period: URL: Summary: Site Location Details: 1307 Woodroffe Avenue Ottawa CITY OF OTTAWA					
109	3 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc. 1307 Woodroffe Ave Ottawa ON	CA

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Certificate #: 1330-7LLQET Application Year: 2008 Issue Date: 12/1/2008 Approval Type: Air Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
109	4 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc. 1307 Woodroffe Ave Ottawa ON	CA
Certificate #: 2019-7TBM4X Application Year: 2009 Issue Date: 6/30/2009 Approval Type: Industrial Sewage Works Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
109	5 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	GEN
<u>Generator Info</u>					
Generator No: ON3115128 Approval Years: 2009 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Electric Power Distribution Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 221122					
<u>Waste Detail(s)</u>					
Waste Class: 251 Waste Class Name: OIL SKIMMINGS & SLUDGES					
109	6 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON3115128			Choice of Contact:	
Approval Years:	2010			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	221122
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Electric Power Distribution			
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
109	7 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON3115128			Choice of Contact:	
Approval Years:	2011			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	221122
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Electric Power Distribution			
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
109	8 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON3115128			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	221122
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Electric Power Distribution			
<u>Waste Detail(s)</u>					
Waste Class:	251				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
109	9 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON3115128			Choice of Contact:	
Approval Years:	2013			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	221122
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	ELECTRIC POWER DISTRIBUTION				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
109	10 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc. 1307 Woodroffe Ave Ottawa ON M5G 2P5	ECA
Approval No:	1330-7LLQET			MOE District:	Ottawa
Approval Date:	2008-12-01			City:	
Status:	Approved			Longitude:	-75.76304
Record Type:	ECA			Latitude:	45.35378
Link Source:	IDS			Geometry X:	
SWP Area Name:	Rideau Valley			Geometry Y:	
Approval Type:	ECA-AIR				
Project Type:	AIR				
Business Name:	Hydro One Networks Inc.				
Address:	1307 Woodroffe Ave				
Full Address:					
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/0733-7EKRL4-14.pdf				
PDF Site Location:					
109	11 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc. 1307 Woodroffe Ave Ottawa ON M5G 2P5	ECA
Approval No:	2019-7TBM4X			MOE District:	Ottawa
Approval Date:	2009-06-30			City:	
Status:	Approved			Longitude:	-75.76304
Record Type:	ECA			Latitude:	45.35378
Link Source:	IDS			Geometry X:	
SWP Area Name:	Rideau Valley			Geometry Y:	
Approval Type:	ECA-INDUSTRIAL SEWAGE WORKS				
Project Type:	INDUSTRIAL SEWAGE WORKS				
Business Name:	Hydro One Networks Inc.				
Address:	1307 Woodroffe Ave				
Full Address:					
Full PDF Link:	https://www.accessenvironment.ene.gov.on.ca/instruments/6454-7T6L2T-14.pdf				
PDF Site Location:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
109	12 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	GEN
<u>Generator Info</u>					
Generator No:	ON3115128			Choice of Contact:	CO_ADMIN
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	221122
Country:	Canada				
Co Admin:	Mike Harvey				
Phone No Admin:	866-782-4489 Ext.				
SIC Description:	ELECTRIC POWER DISTRIBUTION				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
109	13 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	GEN
<u>Generator Info</u>					
Generator No:	ON3115128			Choice of Contact:	CO_ADMIN
Approval Years:	2014			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	221122
Country:	Canada				
Co Admin:	Mike Harvey				
Phone No Admin:	866-782-4489 Ext.				
SIC Description:	ELECTRIC POWER DISTRIBUTION				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
109	14 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc. Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	GEN
<u>Generator Info</u>					
Generator No:	ON4594309			Choice of Contact:	
Approval Years:	As of Dec 2018			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class:		146 L			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
109	15 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc. Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	GEN
<u>Generator Info</u>					
Generator No:	ON4594309			Choice of Contact:	
Approval Years:	As of Jul 2020			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class:		146 L			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
109	16 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc. Woodroffe Transformer Station 1307 Woodroffe Avenue Ottawa ON K2C 2T7	GEN
<u>Generator Info</u>					
Generator No:	ON4594309			Choice of Contact:	
Approval Years:	As of Nov 2021			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		146 L			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			

109	17 of 17	NW/245.9	80.2 / -1.69	Hydro One Networks Inc. Woodroffe Transformer Station, 1307 Woodroffe Avenue Ottawa ON	GEN

Generator Info

Generator No:	ON4594309	Choice of Contact:
Approval Years:	As of Oct 2022	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class:	146 L
Waste Class Name:	OTHER SPECIFIED INORGANICS

Generator Info as of Dec 2024

Generator No:	ON4594309
Generator Company Name:	Hydro One Networks Inc.
Street:	Woodroffe Transformer Station, 1307 Woodroffe Avenue
City:	Ottawa
Province State:	Ontario
Country:	Canada
Postal Code:	K2C2T7
Waste Class:	251 L,146 L

Waste Class Decoded:

251 - OIL SKIMMINGS & SLUDGES; 146 - OTHER SPECIFIED INORGANICS

2017 Generator Info

Gen No:	ON4594309	Choice of Contact:	CO_ADMIN
ID:	18278	Phone No Official:	866-782-4489 Ext.
Contaminated Fac:	N	Phone No Admin:	866-782-4489 Ext.
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	221122	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Name:		Hydro One Networks Inc.			
Gen Div:					
Gen Op Name:		Hydro One Networks Inc.			
Gen Op Div:					
Site Adrs1:		Woodroffe Transformer Station			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		1307 Woodroffe Avenue			
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 2T7			
Site Country:		Canada			
Co Official:		Ryan Wood			
Co Admin:		Mike Harvey			
<u>2018 Generator Info</u>					
Gen No:	ON4594309			Choice of Contact:	CO_ADMIN
ID:	18323			Phone No Official:	866-782-4489 Ext.
Contaminated Fac:	N			Phone No Admin:	866-782-4489 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	221122			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Hydro One Networks Inc.			
Gen Div:					
Gen Op Name:		Hydro One Networks Inc.			
Gen Op Div:					
Site Adrs1:		Woodroffe Transformer Station			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		1307 Woodroffe Avenue			
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 2T7			
Site Country:		Canada			
Co Official:		Ryan Wood			
Co Admin:		Mike Harvey			
<u>2018 Generator Manifest</u>					
ID:	41790			Sum Received Qty:	48420.0
Generator No:	ON4594309			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	6
Waste Char:	L			District:	402
Waste Code:	146				
<u>2019 Generator Info</u>					
Gen No:	ON4594309			Choice of Contact:	CO_ADMIN
ID:	18271			Phone No Official:	866-782-4489 Ext.
Contaminated Fac:	N			Phone No Admin:	866-782-4489 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	221122			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Hydro One Networks Inc.			
Gen Div:					
Gen Op Name:		Hydro One Networks Inc.			
Gen Op Div:					
Site Adrs1:		Woodroffe Transformer Station			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: 1307 Woodroffe Avenue Site City: Ottawa Province Out: Site Postal Code: K2C 2T7 Site Country: Canada Co Official: Ryan Wood Co Admin: Mike Harvey					
2020 Generator Info					
Gen No:	ON4594309			Choice of Contact:	CO_ADMIN
ID:	17976			Phone No Official:	866-782-4489 Ext.
Contaminated Fac:	N			Phone No Admin:	866-782-4489 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	221122			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Hydro One Networks Inc.				
Gen Div:					
Gen Op Name:	Hydro One Networks Inc.				
Gen Op Div:					
Site Adrs1:	Woodroffe Transformer Station				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:	1307 Woodroffe Avenue				
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 2T7				
Site Country:	Canada				
Co Official:	Ryan Wood				
Co Admin:	Mike Harvey				
2021 Generator Info					
Gen No:	ON4594309			Choice of Contact:	CO_ADMIN
ID:	18076			Phone No Official:	866-782-4489 Ext.
Contaminated Fac:	N			Phone No Admin:	866-782-4489 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	221122			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Hydro One Networks Inc.				
Gen Div:					
Gen Op Name:	Hydro One Networks Inc.				
Gen Op Div:					
Site Adrs1:	Woodroffe Transformer Station				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:	1307 Woodroffe Avenue				
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 2T7				
Site Country:	Canada				
Co Official:	Ryan Wood				
Co Admin:	Mike Harvey				
110	1 of 1	NNW/248.1	80.9 / -1.00	Hydro Ottawa 1299 Woodroffe Ave	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ottawa ON K2C 2T7					
<u>Generator Info</u>					
Generator No:	ON6743783			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	221122
Country:	Canada				
Co Admin:	Anthony Patafio				
Phone No Admin:	9058738561 Ext.				
SIC Description:	ELECTRIC POWER DISTRIBUTION				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
111	1 of 2	NE/248.6	82.9 / 1.00	Echo Dental Lab Ltd. 1915 Baseline Rd Unit 1 Ottawa ON K2C 0C7	SCT
Established:	1979				
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:	Medical Equipment and Supplies Manufacturing				
SIC/NAICS Code:	339110				
111	2 of 2	NE/248.6	82.9 / 1.00	2-1915 Baseline Road, Ottawa ON	INC
Incident No:	938284			Any Health Impact:	No
Incident ID:	3096420			Any Enviro Impact:	No
Instance No:				Service Intrap:	Yes
Status Code:	Causal Analysis Complete			Was Prop Damaged:	No
Incident Status:				Reside App. Type:	
Incident Severity:				Commer App. Type:	Water heater
Task No:	4167381			Indus App. Type:	
Attribute Category:	FS-Perform L1 Incident Insp			Institut App. Type:	
Context:				Depth Ground Cover:	
Date of Occurrence:	2012/11/08 00:00:00			Operation Pressure:	
Time of Occurrence:	NULL			Equipment Type:	
Occr Insp Start Dt:	2012/11/09 00:00:00			Equipment Model:	Ti100
Incident Creat On:				Serial No:	49295
Instance Creat Dt:				Cylinder Capacity:	
Instance Install Dt:				Cylinder Cap Units:	
Approx Quant Rel:				Cylinder Mat Type:	
Tank Capacity:				Pump Flow Rate Cap:	
Fuels Occur Type:	CO Release			Contam. Migrated:	
Occur Type Rpt:				Near Body of Water:	
Occur Category:				Drainage System:	
Fuel Type Involved:	Natural Gas			Sub Surface Contam:	
Fuel Type Reported:				Tank Material Type:	
Enforcement Policy:	NULL			Tank Storage Type:	
Prc Escalation Req:	NULL			Tank Location Type:	
Item:					
Item Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Device Installed Location:					
Venting Type:		Direct Vent			
Vent Conn Mater:		Plastic - PVC			
Vent Chimney Mater:					
Pipeline Type:					
Pipeline Involved:					
Pipe Material:					
Regulator Location:					
Regulator Type:					
Liquid Prop Make:					
Liquid Prop Model:					
Liquid Prop Serial No:					
Liquid Prop Notes:					
Inventory Address:		2-1915 Baseline Road, Ottawa - CO Release			
Invent Postal Code:					
Notes:					
Contact Natural Env:					
Aff Prop Use Water:					
Occurence Narrative:		CO Release, Missing Vent Gasket As Required			
Operation Type Involved:		Commercial (e.g. restaurant, business unit, etc)			

Unplottable Summary

Total: **41** Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	Navaho Drive Ext.	Navaho Drive	Ottawa ON	
CA	2871220 CANADA LIMITED	BASELINE RD., HOME DEPOT	NEPEAN CITY ON	
CA	2871220 CANADA LIMITED	BASELINE RD.,HOME DEPOT (SWM)	NEPEAN CITY ON	
CA	2871220 CANADA LIMITED	BASELINE RD., HOME DEPOT STORE	OTTAWA CITY ON	
CA	R.M. OF OTTAWA-CARLETON	BASELINE ROAD EXTENSION (SWM)	OTTAWA CITY ON	
CA	Hydro Ottawa Limited		Ottawa ON	
CA	City of Ottawa	Woodroffe Avenue	Ottawa ON	
CA	Enviro-Grind Ltd. operating as Colautti Construction Ltd.	Mobile Jaw Crusher	Ottawa ON	
CA	BELL-NORTHERN RESEARCH LIMITED	BASELINE ROAD	NEPEAN CITY ON	
CA	R.M. OF OTTAWA-CARLETON	WOODROFFE AVE. S.W.M. FACILITY	NEPEAN CITY ON	
CA	Enviro-Grind Ltd. operating as Colautti Construction Ltd.	Mobile Facility	Ottawa ON	
CA	RON ENGINEERING & CONSTRUCTION LTD.	BASELINE RD.	OTTAWA CITY ON	
CONV	ONTARIO HYDRO		TORONTO ON	
CONV	Colautti Construction Ltd		Ottawa ON	
CONV	Loblaws Companies Limited		Ottawa ON	
EBR	Enviro-Grind Ltd. operating as Colautti Construction Ltd.	Mobile Jaw Crusher Ottawa K1T 3V7 CITY OF OTTAWA	ON	
ECA	City of Ottawa	Woodroffe Avenue (from Highway 417 to 170m north of Baseline Road	Ottawa ON	K1P 1J1
ECA	City of Ottawa	Navaho Dr	Ottawa ON	K2G 6J8

ECA	Enviro-Grind Ltd. operating as Colautti Construction Ltd.	Mobile Facility	Ottawa ON	K1T 3V7
EHS		Baseline Rd	Ottawa ON	
GEN	Robert B Somerville Company LTD	Transitway	Ottawa ON	K2C1C4
SPL	TRANSPORT TRUCK	HWY 16 MOTOR VEHICLE (OPERATING FLUID)	OTTAWA CITY ON	
SPL	LOBLAWS		OTTAWA CITY ON	
SPL	HEATING OIL TANK	FARM OFF HWY 16 PETROLEUM SECTOR _ONLY_	OTTAWA-CARLETON R. M. ON	
SPL	City of Ottawa	near Woodroffe Ave & Baseline Rd	Ottawa ON	
SPL	Loblaw Properties Limited	Loblaws	Ottawa ON	
SPL	City of Ottawa	Transitway	Ottawa ON	
WWIS		con 2	ON	
WWIS		con 2	ON	
WWIS		con 1	ON	
WWIS		con 2	ON	
WWIS		con 2	ON	
WWIS		con 2	ON	
WWIS		con 2	ON	
WWIS		con 2	ON	
WWIS		con 1	ON	
WWIS		con 1	ON	
WWIS		lot 25	ON	
WWIS		con 1	ON	
WWIS		lot 35 con 2	ON	
WWIS		lot 25	ON	
WWIS		lot 25	ON	

Unplottable Report

Site: Navaho Drive Ext.
Navaho Drive Ottawa ON

Database:
CA

Certificate #: 5098-5BARLS
Application Year: 02
Issue Date: 6/21/02
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: City of Ottawa
Client Address: 110 Laurier Avenue West
Client City: Ottawa
Client Postal Code: K1P 1J1
Project Description: Approval is sought for the construction of storm sewers on Navaho Drive.
Contaminants:
Emission Control:

Site: 2871220 CANADA LIMITED
BASELINE RD., HOME DEPOT NEPEAN CITY ON

Database:
CA

Certificate #: 3-1307-96-
Application Year: 96
Issue Date: 1/8/1997
Approval Type: Municipal sewage
Status: Underwent 1st revision in 97
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: 2871220 CANADA LIMITED
BASELINE RD.,HOME DEPOT (SWM) NEPEAN CITY ON

Database:
CA

Certificate #: 3-1307-96-
Application Year: 96
Issue Date: 11/25/1996
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: 2871220 CANADA LIMITED
BASELINE RD., HOME DEPOT STORE OTTAWA CITY ON

Database:
CA

Certificate #: 3-1082-96-
Application Year: 96

Issue Date: 10/21/1996
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **R.M. OF OTTAWA-CARLETON**
BASELINE ROAD EXTENSION (SWM) OTTAWA CITY ON

Database:
CA

Certificate #: 3-0701-96-
Application Year: 96
Issue Date: 9/4/1996
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Hydro Ottawa Limited**
Ottawa ON

Database:
CA

Certificate #: 9824-89HKHQ
Application Year: 2010
Issue Date: 10/14/2010
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **City of Ottawa**
Woodroffe Avenue Ottawa ON

Database:
CA

Certificate #: 9466-74ZR66
Application Year: 2007
Issue Date: 8/13/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Enviro-Grind Ltd. operating as Colautti Construction Ltd.
Mobile Jaw Crusher Ottawa ON

Database:
CA

Certificate #: 5388-7QPQL2
Application Year: 2009
Issue Date: 4/30/2009
Approval Type: Air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: BELL-NORTHERN RESEARCH LIMITED
BASELINE ROAD NEPEAN CITY ON

Database:
CA

Certificate #: 8-4088-88-
Application Year: 88
Issue Date: 8/17/1989
Approval Type: Industrial air
Status: Underwent 1st revision in 1989
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description: FUME HOOD
Contaminants:
Emission Control: No Controls

Site: R.M. OF OTTAWA-CARLETON
WOODROFFE AVE. S.W.M. FACILITY NEPEAN CITY ON

Database:
CA

Certificate #: 3-0514-93-
Application Year: 93
Issue Date: 6/15/1993
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Enviro-Grind Ltd. operating as Colautti Construction Ltd.
Mobile Facility Ottawa ON

Database:
CA

Certificate #: 2617-7QQKQB
Application Year: 2009
Issue Date: 4/30/2009
Approval Type: Air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:

Contaminants:
Emission Control:

Site: RON ENGINEERING & CONSTRUCTION LTD.
BASELINE RD. OTTAWA CITY ON

Database:
CA

Certificate #: 8-4052-87-
Application Year: 87
Issue Date: 6/19/1987
Approval Type: Industrial air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description: FUMEHOOD
Contaminants:
Emission Control:

Site: ONTARIO HYDRO
TORONTO ON

Database:
CONV

File No:
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: DISCHARGING MATERIAL LIKELY TO IMPAIR WATER QUALITY
Background:
URL:

Location:
Region: SOUTH EAST REGION
Ministry District:

Additional Details

Publication Date:
Count: 1
Act: OWRA
Regulation:
Section: 16(1)
Act/Regulation/Section: OWRA- -16(1)
Date of Offence:
Date of Conviction:
Date Charged: 92/01/07
Charge Disposition:
Fine: 20000
Synopsis:

Site: Colautti Construction Ltd
Ottawa ON

Database:
CONV

File No: 108583
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:

Location:
Region:
Ministry District:

Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description:

The City of Ottawa and its contractor were fined \$120,000 for failing to comply with a permit to take water and discharging sediment into Stillwater Creek, a tributary of the Ottawa River. 'Polluters should be aware that the ministry's Investigations and Enforcement Branch will vigorously pursue charges when our environmental laws are broken', said Environment Minister Jim Bradley. In 2010, the city awarded a contract for a water main installation along several streets in Ottawa to Colautti Construction Ltd. ' a local company that specializes in the construction of sewer and water lines. For dewatering required by construction, a permit to take water was issued to the City that required a number of conditions including turbidity testing. Following reports in August 2010 of possible impairments to Stillwater Creek as a result of drilling work, a ministry investigation found the company was responsible for a discharge of sediment into Stillwater Creek. Although there was no evidence of any actual impact to fish in Stillwater Creek as a result of the sediment discharge on that day, sediment discharges can adversely affect fish and benthic organisms. The City was also found to have not been conducting the required turbidity testing. The City of Ottawa and Colautti Construction Ltd. were fined a total of \$120,000 plus victim fine surcharges of \$30,000 and were given sixty days to pay the fines.

Background:
URL:

Additional Details

Publication Date:
Count:
Act:
Regulation:
Section:
Act/Regulation/Section:
Date of Offence:
Date of Conviction:
Date Charged: May 31, 2013
Charge Disposition: fine, victim fine surcharge
Fine: \$120,000
Synopsis:

Additional Details

Publication Date:
Count:
Act: Pesticides Act
Regulation:
Section:
Act/Regulation/Section: Pesticides Act
Date of Offence:
Date of Conviction:
Date Charged: March 10, 2014
Charge Disposition: fine, victim fine surcharge
Fine: \$5,000
Synopsis:

Site: Loblaw Companies Limited
Ottawa ON

Database:
CONV

File No: 097267

Location:
Region:
Ministry District:

Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description:

On April 19, 2011, Loblaw Companies Limited/Les Compagnies Loblaw Limitee pleaded guilty to one violation under the Environmental Protection Act for causing the discharge of a refrigerant into the air within a building or into the natural environment. The Court heard that the company owns and operates a property in Ottawa. The

company uses a refrigeration contractor to install, maintain and service the equipment at this location. During such work, a release of refrigerant was reported to the ministry. The release was inside a building that was vented via exhaust fans to the natural environment. The refrigerant contains hydrochlorofluorocarbon and is considered an ozone depleting substance. The company was charged following an investigation by the ministry's Investigations and Enforcement Branch. The company was fined \$30,000 plus a victim fine surcharge and was given 30 days to pay the fine.

Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation:
Section:
Act/Regulation/Section: EPA
Date of Offence:
Date of Conviction:
Date Charged: April 19, 2011
Charge Disposition: fine, victim fine surcharge
Fine: \$30,000
Synopsis:

Site: *Enviro-Grind Ltd. operating as Colautti Construction Ltd.
Mobile Jaw Crusher Ottawa K1T 3V7 CITY OF OTTAWA ON*

Database:
EBR

EBR Registry No: 012-5817
Ministry Ref No: 7932-A22HN3
Notice Type: Instrument Decision
Notice Stage:
Notice Date: June 01, 2018
Proposal Date: January 31, 2018
Year: 2018
Instrument Type: Environmental Compliance Approval (project type: air) - EPA Part II.1-air
Off Instrument Name:
Posted By:
Company Name: Enviro-Grind Ltd. operating as Colautti Construction Ltd.
Site Address:
Location Other:
Proponent Name:
Proponent Address: 2562 Delzotto avenue Ottawa Ontario Canada K2J 6K7
Comment Period:
URL:
Summary:

Decision Posted:
Exception Posted:
Section:
Act 1:
Act 2:
Site Location Map:

Site Location Details:

Mobile Jaw Crusher Ottawa K1T 3V7 CITY OF OTTAWA

Site: *City of Ottawa
Woodroffe Avenue (from Highway 417 to 170m north of Baseline Road Ottawa ON K1P 1J1*

Database:
ECA

Approval No: 6142-8TXCLK
Approval Date: 2012-05-04
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Woodroffe Avenue (from Highway 417 to 170m north of Baseline Road
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/5917-8TJQJC-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: City of Ottawa
Navaho Dr Ottawa ON K2G 6J8

Database:
ECA

Approval No: 3694-A9NNKG
Approval Date: 2016-05-07
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Navaho Dr
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/6498-A9DK8N-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: Enviro-Grind Ltd. operating as Colautti Construction Ltd.
Mobile Facility Ottawa ON K1T 3V7

Database:
ECA

Approval No: 2617-7QKQB
Approval Date: 2009-04-30
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-AIR
Project Type: AIR
Business Name: Enviro-Grind Ltd. operating as Colautti Construction Ltd.
Address: Mobile Facility
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/4433-7AXS7Q-14.pdf>
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: Baseline Rd Ottawa ON

Database:
EHS

Order No: 20051017031
Status: C
Report Type: Site Report
Report Date: 10/18/2005
Date Received: 10/17/2005
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: QC
Search Radius (km): 0.25
X:
Y:

Site: Robert B Somerville Company LTD
Transitway Ottawa ON K2C1C4

Database:
GEN

2020 Generator Info

Gen No: ON4575313
ID: 17884
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 237130
NAICS Code2:
NAICS Code3:
Gen Name: Robert B Somerville Company LTD
Gen Div:
Gen Op Name: Robert B Somerville Company LTD

Choice of Contact: CO_OFFICIAL
Phone No Official: 647-202-4772 Ext.
Phone No Admin: 416-346-7061 Ext.
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

Gen Op Div:
Site Adrs1: Transitway
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K2C1C4
Site Country: Canada
Co Official: Ryan Murphy
Co Admin: Brynn Nugent

2020 Generator Manifest

ID:	37981	Sum Received Qty:	1810.0
Generator No:	ON4575313	Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035	Count Manifests:	1
Waste Char:	L	District:	402
Waste Code:	252		

Site: **TRANSPORT TRUCK** **Database:**
HWY 16 MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON **SPL**

Ref No:	76308	Municipality No:	20101
Year:		Nature of Damage:	
Incident Dt:	9/15/1992	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	9/15/1992	Impact to Health:	
Dt Document Closed:		Agency Involved:	PD,FD,MTO.
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	OTHER CONTAINER LEAK		
Incident Preceding Spill:			
Incident Reason:	ERROR		
Incident Summary:	TRANSPORT TRUCK-450 L DIESEL FUEL TO HWY 16 CONTAINED,FD,PD,MTO.		
Environment Impact:	POSSIBLE		
Health Env Consequence:			
Nature of Impact:	Soil contamination		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND		
Activity Preceding Spill:			
Property 2nd Watershed:			

Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: LOBLAWS
OTTAWA CITY ON

Database:
[SPL](#)

Ref No:	49925	Municipality No:	20101
Year:		Nature of Damage:	
Incident Dt:	5/1/1991	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	5/1/1991	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	PIPE/HOSE LEAK		
Incident Preceding Spill:			
Incident Reason:	OVERSTRESS/OVERPRESSURE		
Incident Summary:	LOBLAWS - HYDRAULIC OIL TO GROUND AND CATCHBASIN FROM BROKEN HOSE		
Environment Impact:	POSSIBLE		
Health Env Consequence:			
Nature of Impact:	Water course or lake		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			

Site: HEATING OIL TANK
FARM OFF HWY 16 PETROLEUM SECTOR_ONLY_ OTTAWA-CARLETON R.M. ON

Database:
[SPL](#)

Ref No:	30436	Municipality No:	20000
Year:		Nature of Damage:	
Incident Dt:	1/31/1990	Discharger Report:	

Dt MOE Arvl on Scn:
MOE Reported Dt: 1/31/1990
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA-CARLETON R.M.
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: ABOVE-GROUND TANK LEAK
Incident Preceding Spill:
Incident Reason: CORROSION
Incident Summary: STOVE OIL TANK-900 L STOVE OIL TO GROUND.
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Material Group:
Impact to Health:
Agency Involved:

Site: City of Ottawa
 near Woodroffe Ave & Baseline Rd Ottawa ON

Database:
 SPL

Ref No: 7264-BEYNK5
Year:
Incident Dt: 8/12/2019
Dt MOE Arvl on Scn:
MOE Reported Dt: 8/12/2019
Dt Document Closed:
Site No: NA
MOE Response: No
Site County/District:
Site Geo Ref Meth:
Site District Office: Ottawa
Nearest Watercourse:
Site Name: construction site<UNOFFICIAL>
Site Address: near Woodroffe Ave & Baseline Rd
Site Region: Eastern
Site Municipality: Ottawa
Site Lot:

Municipality No:
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health: 0 - No Impact
Agency Involved:

Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing: 5022003.3
Easting: 440324.14
Entity Operating Name:
Client Name: City of Ottawa
Client Type: Municipal Government
Source Type: Valve/Fitting/Piping
Incident Cause:
Incident Preceding Spill: Leak/Break
Incident Reason: Equipment Failure
Incident Summary: OLRT ~ 200mL to grnd; cntnd & clnd
Environment Impact:
Health Env Consequence:
Nature of Impact:
Contaminant Qty: 250 mL
Contaminant Qty 1: 250
Contaminant Unit: mL
Contaminant Code: 15
Contaminant Name: HYDRAULIC OIL
Contaminant Limit 1: 0
Contam Limit Freq 1: none
Contaminant UN No 1: n/a
Receiving Medium: Land
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Miscellaneous Industrial
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: Loblaw Properties Limited
 Loblaws Ottawa ON

Database:
 SPL

Ref No:	2287-7FNKE6	Municipality No:	
Year:		Nature of Damage:	
Incident Dt:		Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	6/16/2008	Impact to Health:	
Dt Document Closed:	9/8/2008	Agency Involved:	
Site No:			
MOE Response:	No Field Response		
Site County/District:			
Site Geo Ref Meth:			
Site District Office:	Ottawa		
Nearest Watercourse:			
Site Name:	Loblaws		
Site Address:			
Site Region:			
Site Municipality:	Ottawa		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:	NA		
Easting:	NA		
Entity Operating Name:			
Client Name:	Loblaw Properties Limited		
Client Type:			
Source Type:			
Incident Cause:	Discharge or Emission to Air		
Incident Preceding Spill:			
Incident Reason:	Equipment Failure - Malfunction of system components		
Incident Summary:	Loblaws, 625 lb of R22 released to atmosphere.		
Environment Impact:	Not Anticipated		

Health Env Consequence:
Nature of Impact: Air Pollution
Contaminant Qty: 625 lb
Contaminant Qty 1: 625
Contaminant Unit: lb
Contaminant Code: 38
Contaminant Name: FREON R-22 (CFC)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Other
SAC Action Class: Air Spills - Gases and Vapours
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: City of Ottawa
 Transitway Ottawa ON

Database:
 SPL

Ref No:	7101-5LY5CZ	Municipality No:	
Year:		Nature of Damage:	
Incident Dt:	4/25/2003	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	Chemical
MOE Reported Dt:	4/25/2003	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:	Ottawa		
Nearest Watercourse:			
Site Name:	TUNNEY'S PASTURE STATION<UNOFFICIAL>		
Site Address:			
Site Region:	Eastern		
Site Municipality:	Ottawa		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:	City of Ottawa		
Client Type:			
Source Type:			
Incident Cause:			
Incident Preceding Spill:			
Incident Reason:			
Incident Summary:	Transit Bus - 5 L antifreeze to san.sewer. cleaned		
Environment Impact:			
Health Env Consequence:			
Nature of Impact:			
Contaminant Qty:	5 L		
Contaminant Qty 1:			
Contaminant Unit:	L		
Contaminant Code:	24		
Contaminant Name:	ETHYLENE GLYCOL (ANTIFREEZE)		
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	Water		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			

Sector Type: Other
SAC Action Class: Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site:
con 2 ON

Database:
WWIS

Well ID: 1529332
Construction Date:
Use 1st: Commerical
Use 2nd:
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: 169509
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 02/14/1997
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6844
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot:
Concession: 02
Concession Name: OF
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10050868
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 12/18/1996
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock
Materials Interval

Formation ID: 931072417
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 91
Material 2 Desc: WATER-BEARING
Material 3:
Material 3 Desc:
Formation Top Depth: 2.0
Formation End Depth: 15.0
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931072416
Layer: 1
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 02
Material 2 Desc: TOPSOIL
Material 3: 01
Material 3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 2.0
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933114306
Layer: 1
Plug From: 0.0
Plug To: 3.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933114307
Layer: 2
Plug From: 3.0
Plug To: 15.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961529332
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe Information

Pipe ID: 10599438
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930088797
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 15.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326680

Layer: 1
Slot: 010
Screen Top Depth: 5.0
Screen End Depth: 15.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.0

Water Details

Water ID: 933489271
Layer: 1
Kind Code: 5
Kind: Not stated
Water Found Depth: 10.0
Water Found Depth UOM: ft

Site:
con 2 ON

Database:
[WWIS](#)

Well ID: 1529331
Construction Date:
Use 1st: Commerical
Use 2nd:
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: 169510
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 02/14/1997
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6844
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot:
Concession: 02
Concession Name: OF
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10050867
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 12/18/1996
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock Materials Interval

Formation ID: 931072415
Layer: 2
Color: 2

General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 91
Material 2 Desc: WATER-BEARING
Material 3:
Material 3 Desc:
Formation Top Depth: 2.0
Formation End Depth: 19.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931072414
Layer: 1
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 02
Material 2 Desc: TOPSOIL
Material 3: 01
Material 3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 2.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933114305
Layer: 2
Plug From: 5.0
Plug To: 19.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933114304
Layer: 1
Plug From: 0.0
Plug To: 5.0
Plug Depth UOM: ft

Method of Construction & Well
Use

Method Construction ID: 961529331
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe Information

Pipe ID: 10599437
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930088796
Layer: 1

Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 19.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326679
Layer: 1
Slot: 010
Screen Top Depth: 9.0
Screen End Depth: 19.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.0

Water Details

Water ID: 933489270
Layer: 1
Kind Code: 5
Kind: Not stated
Water Found Depth: 9.0
Water Found Depth UOM: ft

Site:
con 1 ON

Database:
[WWIS](#)

Well ID: 1528250
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: 151799
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/24/1994
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6844
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot:
Concession: 01
Concession Name: RF
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10049789
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 10/11/1994
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Overburden and Bedrock
Materials Interval

Formation ID: 931069086
Layer: 2
Color: 6
General Color: BROWN
Material 1: 08
Material 1 Desc: FINE SAND
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 5.0
Formation End Depth: 10.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931069085
Layer: 1
Color: 6
General Color: BROWN
Material 1: 01
Material 1 Desc: FILL
Material 2: 11
Material 2 Desc: GRAVEL
Material 3: 78
Material 3 Desc: MEDIUM-GRAINED
Formation Top Depth: 0.0
Formation End Depth: 5.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933113110
Layer: 3
Plug From: 5.0
Plug To: 10.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933113108
Layer: 1
Plug From: 1.0
Plug To: 4.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933113109
Layer: 2
Plug From: 4.0
Plug To: 5.0
Plug Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 961528250
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe Information

Pipe ID: 10598359
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930087025
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 10.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326510
Layer: 1
Slot: 100
Screen Top Depth: 5.0
Screen End Depth: 10.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.0

Water Details

Water ID: 933487871
Layer: 1
Kind Code: 5
Kind: Not stated
Water Found Depth: 7.0
Water Found Depth UOM: ft

Site:

con 2 ON

Database:
WWIS

Well ID: 1529333
Construction Date:
Use 1st: Commerical
Use 2nd:
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: 169508
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 02/14/1997
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6844
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot:
Concession: 02
Concession Name: OF

Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID:	10050869	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	12/18/1996	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Location Method Desc:	Not Applicable i.e. no UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock
Materials Interval

Formation ID:	931072419
Layer:	2
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	91
Material 2 Desc:	WATER-BEARING
Material 3:	
Material 3 Desc:	
Formation Top Depth:	5.0
Formation End Depth:	18.0
Formation End Depth UOM:	ft

Overburden and Bedrock
Materials Interval

Formation ID:	931072418
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	28
Material 1 Desc:	SAND
Material 2:	11
Material 2 Desc:	GRAVEL
Material 3:	01
Material 3 Desc:	FILL
Formation Top Depth:	0.0
Formation End Depth:	5.0
Formation End Depth UOM:	ft

Annular Space/Abandonment
Sealing Record

Plug ID:	933114308
Layer:	1
Plug From:	0.0

Plug To: 5.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933114309
Layer: 2
Plug From: 5.0
Plug To: 7.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933114310
Layer: 3
Plug From: 7.0
Plug To: 18.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961529333
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe Information

Pipe ID: 10599439
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930088798
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 18.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326681
Layer: 1
Slot: 010
Screen Top Depth: 8.0
Screen End Depth: 18.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.0

Water Details

Water ID: 933489272
Layer: 1

Kind Code: 5
Kind: Not stated
Water Found Depth: 15.0
Water Found Depth UOM: ft

Site:
con 2 ON

Database:
[WWIS](#)

Well ID: 1529560
Construction Date:
Use 1st: Commerical
Use 2nd:
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: 169523
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 08/12/1997
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6844
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot:
Concession: 02
Concession Name: OF
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10051095
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 03/06/1997
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock
Materials Interval

Formation ID: 931073138
Layer: 1
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 81
Material 2 Desc: SANDY
Material 3: 01
Material 3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 5.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931073139
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 12
Material 2 Desc: STONES
Material 3:
Material 3 Desc:
Formation Top Depth: 5.0
Formation End Depth: 12.0
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933114573
Layer: 2
Plug From: 3.0
Plug To: 5.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933114572
Layer: 1
Plug From: 0.0
Plug To: 3.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933114574
Layer: 3
Plug From: 5.0
Plug To: 12.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961529560
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe Information

Pipe ID: 10599665
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930089190
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 12.0

Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326719
Layer: 1
Slot: 010
Screen Top Depth: 8.0
Screen End Depth: 13.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.0

Water Details

Water ID: 933489562
Layer: 1
Kind Code: 5
Kind: Not stated
Water Found Depth: 8.0
Water Found Depth UOM: ft

Site:

con 2 ON

Database:
[WWIS](#)

Well ID: 1529561
Construction Date:
Use 1st: Commerical
Use 2nd: Municipal
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: 169526
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 08/12/1997
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6844
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot:
Concession: 02
Concession Name: OF
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10051096
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 02/05/1997
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock
Materials Interval

Formation ID: 931073141
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 12
Material 2 Desc: STONES
Material 3:
Material 3 Desc:
Formation Top Depth: 5.0
Formation End Depth: 15.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931073140
Layer: 1
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 81
Material 2 Desc: SANDY
Material 3: 01
Material 3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 5.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933114575
Layer: 1
Plug From: 0.0
Plug To: 2.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933114577
Layer: 3
Plug From: 4.0
Plug To: 15.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933114576
Layer: 2
Plug From: 2.0
Plug To: 4.0
Plug Depth UOM: ft

Method of Construction & Well
Use

Method Construction ID: 961529561
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe Information

Pipe ID: 10599666
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930089191
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 15.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326720
Layer: 1
Slot: 010
Screen Top Depth: 5.0
Screen End Depth: 15.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 2.0

Water Details

Water ID: 933489563
Layer: 1
Kind Code: 5
Kind: Not stated
Water Found Depth: 8.0
Water Found Depth UOM: ft

Site:
con 2 ON

Database:
[WWIS](#)

Well ID: 1529562
Construction Date:
Use 1st: Commerical
Use 2nd:
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: 169530
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 08/12/1997
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6844
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot:
Concession: 02
Concession Name: OF
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Municipality: NEPEAN TOWNSHIP
Site Info:

Bore Hole Information

Bore Hole ID:	10051097	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	02/04/1997	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Location Method Desc:	Not Applicable i.e. no UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	931073143
Layer:	2
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	12
Material 2 Desc:	STONES
Material 3:	
Material 3 Desc:	
Formation Top Depth:	5.0
Formation End Depth:	10.0
Formation End Depth UOM:	ft

Overburden and Bedrock

Materials Interval

Formation ID:	931073142
Layer:	1
Color:	6
General Color:	BROWN
Material 1:	34
Material 1 Desc:	TILL
Material 2:	81
Material 2 Desc:	SANDY
Material 3:	11
Material 3 Desc:	GRAVEL
Formation Top Depth:	0.0
Formation End Depth:	5.0
Formation End Depth UOM:	ft

Annular Space/Abandonment

Sealing Record

Plug ID:	933114580
Layer:	3
Plug From:	3.0
Plug To:	10.0
Plug Depth UOM:	ft

Annular Space/Abandonment

Sealing Record

Plug ID: 933114578
Layer: 1
Plug From: 0.0
Plug To: 1.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933114579
Layer: 2
Plug From: 1.0
Plug To: 3.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961529562
Method Construction Code: 6
Method Construction: Boring
Other Method Construction:

Pipe Information

Pipe ID: 10599667
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930089192
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 10.0
Casing Diameter: 1.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326721
Layer: 1
Slot: 010
Screen Top Depth: 5.0
Screen End Depth: 10.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.0

Water Details

Water ID: 933489564
Layer: 1
Kind Code: 5
Kind: Not stated
Water Found Depth: 8.0
Water Found Depth UOM: ft

Site: con 1 ON **Database:**
WWIS

Well ID:	1532635	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Domestic	Data Entry Status:	
Use 2nd:		Data Src:	1
Final Well Status:	Abandoned-Quality	Date Received:	01/17/2002
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	235219	Contractor:	4006
Tag:		Form Version:	1
Constructn Method:		Owner:	
Elevation (m):		County:	OTTAWA-CARLETON
Elevatn Reliability:		Lot:	
Depth to Bedrock:		Concession:	01
Well Depth:		Concession Name:	OF
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP		
Site Info:			

Bore Hole Information

Bore Hole ID:	10523764	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	12/05/2001	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Location Method Desc:	Not Applicable i.e. no UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Method of Construction & Well Use

Method Construction ID:	961532635
Method Construction Code:	B
Method Construction:	Other Method
Other Method Construction:	

Pipe Information

Pipe ID:	11072334
Casing No:	1
Comment:	
Alt Name:	

Site: con 1 ON **Database:**
WWIS

Well ID:	1534064	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Not Used	Data Entry Status:	
Use 2nd:		Data Src:	1
Final Well Status:	Abandoned-Other	Date Received:	09/09/2003

Water Type:
Casing Material:
Audit No: 248010
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Selected Flag: TRUE
Abandonment Rec:
Contractor: 1119
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot:
Concession: 01
Concession Name: RF
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10543179
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/12/2003
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Method of Construction & Well Use

Method Construction ID: 961534064
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 11091749
Casing No: 1
Comment:
Alt Name:

Site:
lot 25 ON

Database:
[WWIS](#)

Well ID: 1528551
Construction Date:
Use 1st: Domestic
Use 2nd:
Final Well Status: Water Supply
Water Type:
Casing Material:
Audit No: 137549
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 07/17/1995
Selected Flag: TRUE
Abandonment Rec:
Contractor: 3644
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 025
Concession:
Concession Name:

Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID:	10050087	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	06/20/1995	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Location Method Desc:	Not Applicable i.e. no UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock
Materials Interval

Formation ID:	931070012
Layer:	1
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	02
Material 2 Desc:	TOPSOIL
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	71.0
Formation End Depth UOM:	ft

Overburden and Bedrock
Materials Interval

Formation ID:	931070013
Layer:	2
Color:	2
General Color:	GREY
Material 1:	15
Material 1 Desc:	LIMESTONE
Material 2:	71
Material 2 Desc:	FRACTURED
Material 3:	
Material 3 Desc:	
Formation Top Depth:	71.0
Formation End Depth:	83.0
Formation End Depth UOM:	ft

Method of Construction & Well
Use

Method Construction ID:	961528551
Method Construction Code:	5
Method Construction:	Air Percussion

Other Method Construction:

Pipe Information

Pipe ID: 10598657
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930087550
Layer: 2
Material: 4
Open Hole or Material: OPEN HOLE
Depth From:
Depth To: 83.0
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930087549
Layer: 1
Material: 1
Open Hole or Material: STEEL
Depth From:
Depth To: 74.0
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pumping Test Method Desc: PUMP
Pump Test ID: 991528551
Pump Set At:
Static Level: 48.0
Final Level After Pumping: 70.0
Recommended Pump Depth: 70.0
Pumping Rate: 15.0
Flowing Rate:
Recommended Pump Rate: 12.0
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 2
Water State After Test: CLOUDY
Pumping Test Method: 1
Pumping Duration HR: 1
Pumping Duration MIN: 0
Flowing: No

Draw Down & Recovery

Pump Test Detail ID: 934906465
Test Type: Recovery
Test Duration: 60
Test Level: 48.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934104721
Test Type: Recovery

Test Duration: 15
Test Level: 51.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934388346
Test Type: Recovery
Test Duration: 30
Test Level: 48.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934648862
Test Type: Recovery
Test Duration: 45
Test Level: 48.0
Test Level UOM: ft

Water Details

Water ID: 933488281
Layer: 1
Kind Code: 5
Kind: Not stated
Water Found Depth: 76.0
Water Found Depth UOM: ft

Site:
con 1 ON

Database:
[WWIS](#)

Well ID: 1528855
Construction Date:
Use 1st: Domestic
Use 2nd:
Final Well Status: Water Supply
Water Type:
Casing Material:
Audit No: 135092
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 02/21/1996
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6629
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot:
Concession: 01
Concession Name: RF
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10050391
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 06/27/1995
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Overburden and Bedrock
Materials Interval

Formation ID: 931071018
Layer: 1
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 81
Material 2 Desc: SANDY
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 0.0
Formation End Depth: 25.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931071021
Layer: 4
Color: 2
General Color: GREY
Material 1: 18
Material 1 Desc: SANDSTONE
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 94.0
Formation End Depth: 103.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931071019
Layer: 2
Color: 3
General Color: BLUE
Material 1: 05
Material 1 Desc: CLAY
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 25.0
Formation End Depth: 55.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931071020
Layer: 3
Color: 2
General Color: GREY
Material 1: 15
Material 1 Desc: LIMESTONE

Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 55.0
Formation End Depth: 94.0
Formation End Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 961528855
Method Construction Code: 4
Method Construction: Rotary (Air)
Other Method Construction:

Pipe Information

Pipe ID: 10598961
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930088072
Layer: 1
Material: 1
Open Hole or Material: STEEL
Depth From:
Depth To: 58.0
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pumping Test Method Desc:
Pump Test ID: 991528855
Pump Set At:
Static Level: 30.0
Final Level After Pumping: 65.0
Recommended Pump Depth: 90.0
Pumping Rate: 10.0
Flowing Rate:
Recommended Pump Rate: 8.0
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 2
Water State After Test: CLOUDY
Pumping Test Method:
Pumping Duration HR: 1
Pumping Duration MIN: 15
Flowing: No

Draw Down & Recovery

Pump Test Detail ID: 934907069
Test Type: Draw Down
Test Duration: 60
Test Level: 65.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934389369
Test Type: Draw Down
Test Duration: 30
Test Level: 65.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934105744
Test Type: Draw Down
Test Duration: 15
Test Level: 60.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934658544
Test Type: Draw Down
Test Duration: 45
Test Level: 65.0
Test Level UOM: ft

Water Details

Water ID: 933488724
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 85.0
Water Found Depth UOM: ft

Water Details

Water ID: 933488725
Layer: 2
Kind Code: 1
Kind: FRESH
Water Found Depth: 97.0
Water Found Depth UOM: ft

Water Details

Water ID: 933488726
Layer: 3
Kind Code: 1
Kind: FRESH
Water Found Depth: 103.0
Water Found Depth UOM: ft

Site: lot 35 con 2 ON

Database:
WWIS

Well ID: 1522287
Construction Date:
Use 1st: Irrigation
Use 2nd:
Final Well Status: Water Supply
Water Type:
Casing Material:
Audit No: 25065
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 05/13/1988
Selected Flag: TRUE
Abandonment Rec:
Contractor: 1558
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 035
Concession: 02

Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Concession Name: CON
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10044100
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 03/24/1988
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock
Materials Interval

Formation ID: 931050827
Layer: 6
Color: 2
General Color: GREY
Material 1: 18
Material 1 Desc: SANDSTONE
Material 2: 74
Material 2 Desc: LAYERED
Material 3:
Material 3 Desc:
Formation Top Depth: 215.0
Formation End Depth: 340.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931050823
Layer: 2
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 8.0
Formation End Depth: 15.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931050825
Layer: 4

Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 81
Material 2 Desc: SANDY
Material 3: 13
Material 3 Desc: BOULDERS
Formation Top Depth: 38.0
Formation End Depth: 49.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931050822
Layer: 1
Color: 6
General Color: BROWN
Material 1: 05
Material 1 Desc: CLAY
Material 2: 79
Material 2 Desc: PACKED
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 8.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931050826
Layer: 5
Color: 2
General Color: GREY
Material 1: 15
Material 1 Desc: LIMESTONE
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 49.0
Formation End Depth: 215.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931050828
Layer: 7
Color: 2
General Color: GREY
Material 1: 15
Material 1 Desc: LIMESTONE
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 340.0
Formation End Depth: 439.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931050824
Layer: 3
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 15.0
Formation End Depth: 38.0
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931050829
Layer: 8
Color: 2
General Color: GREY
Material 1: 21
Material 1 Desc: GRANITE
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 439.0
Formation End Depth: 450.0
Formation End Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961522287
Method Construction Code: 1
Method Construction: Cable Tool
Other Method Construction:

Pipe Information

Pipe ID: 10592670
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930077127
Layer: 1
Material: 1
Open Hole or Material: STEEL
Depth From:
Depth To: 55.0
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930077128
Layer: 2
Material: 4
Open Hole or Material: OPEN HOLE
Depth From:
Depth To: 300.0

Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930077129
Layer: 3
Material: 4
Open Hole or Material: OPEN HOLE
Depth From:
Depth To: 450.0
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pumping Test Method Desc: PUMP
Pump Test ID: 991522287
Pump Set At:
Static Level: 23.0
Final Level After Pumping: 157.0
Recommended Pump Depth: 250.0
Pumping Rate: 50.0
Flowing Rate:
Recommended Pump Rate: 5.0
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 1
Water State After Test: CLEAR
Pumping Test Method: 1
Pumping Duration HR: 6
Pumping Duration MIN: 0
Flowing: No

Draw Down & Recovery

Pump Test Detail ID: 934385798
Test Type: Draw Down
Test Duration: 30
Test Level: 28.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934655047
Test Type: Draw Down
Test Duration: 45
Test Level: 28.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934903462
Test Type: Draw Down
Test Duration: 60
Test Level: 28.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934109815
Test Type: Draw Down
Test Duration: 15

Test Level: 28.0
Test Level UOM: ft

Water Details

Water ID: 933480120
Layer: 2
Kind Code: 1
Kind: FRESH
Water Found Depth: 419.0
Water Found Depth UOM: ft

Water Details

Water ID: 933480119
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 240.0
Water Found Depth UOM: ft

Site:
lot 25 ON

Database:
[WWIS](#)

Well ID: 1523747
Construction Date:
Use 1st: Industrial
Use 2nd:
Final Well Status: Water Supply
Water Type:
Casing Material:
Audit No: 49862
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 08/04/1989
Selected Flag: TRUE
Abandonment Rec:
Contractor: 3644
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 025
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10045521
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 06/12/1989
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock Materials Interval

Formation ID: 931055592
Layer: 1
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 32.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931055593
Layer: 2
Color: 2
General Color: GREY
Material 1: 15
Material 1 Desc: LIMESTONE
Material 2: 82
Material 2 Desc: SHALY
Material 3:
Material 3 Desc:
Formation Top Depth: 32.0
Formation End Depth: 250.0
Formation End Depth UOM: ft

Method of Construction & Well
Use

Method Construction ID: 961523747
Method Construction Code: 5
Method Construction: Air Percussion
Other Method Construction:

Pipe Information

Pipe ID: 10594091
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930079668
Layer: 2
Material: 4
Open Hole or Material: OPEN HOLE
Depth From:
Depth To: 250.0
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930079667
Layer: 1
Material: 1
Open Hole or Material: STEEL
Depth From:

Depth To: 36.0
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pumping Test Method Desc: PUMP
Pump Test ID: 991523747
Pump Set At:
Static Level: 19.0
Final Level After Pumping: 100.0
Recommended Pump Depth: 100.0
Pumping Rate: 14.0
Flowing Rate:
Recommended Pump Rate: 14.0
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 2
Water State After Test: CLOUDY
Pumping Test Method: 1
Pumping Duration HR: 1
Pumping Duration MIN: 0
Flowing: No

Draw Down & Recovery

Pump Test Detail ID: 934651310
Test Type:
Test Duration: 45
Test Level: 100.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934106105
Test Type:
Test Duration: 15
Test Level: 100.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934390332
Test Type:
Test Duration: 30
Test Level: 100.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934908516
Test Type:
Test Duration: 60
Test Level: 100.0
Test Level UOM: ft

Water Details

Water ID: 933482123
Layer: 2
Kind Code: 1
Kind: FRESH
Water Found Depth: 225.0
Water Found Depth UOM: ft

Water Details

Water ID: 933482122
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 60.0
Water Found Depth UOM: ft

Site:

lot 25 ON

Database:

[WWIS](#)

Well ID: 1525383
Construction Date:
Use 1st: Domestic
Use 2nd:
Final Well Status: Water Supply
Water Type:
Casing Material:
Audit No: 100018
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: NEPEAN TOWNSHIP
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 05/29/1991
Selected Flag: TRUE
Abandonment Rec:
Contractor: 1558
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 025
Concession:
Concession Name: RF
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10047121
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 03/11/1991
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock

Materials Interval

Formation ID: 931060969
Layer: 3
Color: 2
General Color: GREY
Material 1: 28
Material 1 Desc: SAND
Material 2: 91
Material 2 Desc: WATER-BEARING
Material 3:
Material 3 Desc:
Formation Top Depth: 43.0

Formation End Depth: 52.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931060968
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 86
Material 2 Desc: STICKY
Material 3:
Material 3 Desc:
Formation Top Depth: 8.0
Formation End Depth: 43.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931060970
Layer: 4
Color: 2
General Color: GREY
Material 1: 15
Material 1 Desc: LIMESTONE
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 52.0
Formation End Depth: 120.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931060967
Layer: 1
Color: 6
General Color: BROWN
Material 1: 28
Material 1 Desc: SAND
Material 2: 68
Material 2 Desc: DRY
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 8.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931060971
Layer: 5
Color: 2
General Color: GREY
Material 1: 18
Material 1 Desc: SANDSTONE
Material 2:
Material 2 Desc:
Material 3:

Material 3 Desc:
Formation Top Depth: 120.0
Formation End Depth: 175.0
Formation End Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 961525383
Method Construction Code: 5
Method Construction: Air Percussion
Other Method Construction:

Pipe Information

Pipe ID: 10595691
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930082495
Layer: 2
Material: 4
Open Hole or Material: OPEN HOLE
Depth From:
Depth To: 175.0
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930082494
Layer: 1
Material: 1
Open Hole or Material: STEEL
Depth From:
Depth To: 54.0
Casing Diameter: 6.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Results of Well Yield Testing

Pumping Test Method Desc: PUMP
Pump Test ID: 991525383
Pump Set At:
Static Level: 20.0
Final Level After Pumping: 60.0
Recommended Pump Depth: 75.0
Pumping Rate: 6.0
Flowing Rate:
Recommended Pump Rate: 5.0
Levels UOM: ft
Rate UOM: GPM
Water State After Test Code: 1
Water State After Test: CLEAR
Pumping Test Method: 1
Pumping Duration HR: 1
Pumping Duration MIN: 0
Flowing: No

Draw Down & Recovery

Pump Test Detail ID: 934387617
Test Type: Draw Down
Test Duration: 30
Test Level: 60.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934648157
Test Type: Draw Down
Test Duration: 45
Test Level: 60.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934112212
Test Type: Draw Down
Test Duration: 15
Test Level: 60.0
Test Level UOM: ft

Draw Down & Recovery

Pump Test Detail ID: 934905756
Test Type: Draw Down
Test Duration: 60
Test Level: 60.0
Test Level UOM: ft

Water Details

Water ID: 933484357
Layer: 1
Kind Code: 5
Kind: Not stated
Water Found Depth: 165.0
Water Found Depth UOM: ft

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial

[AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial

[AGR](#)

This database of licensed and permitted pits and quarries is maintained by the Ontario Ministry of Natural Resources and Forestry (MNRF), as regulated under the Aggregate Resources Act, R.S.O. 1990. Aggregate site data has been divided into active and inactive sites. Active sites may be further subdivided into partial surrenders. In partial surrenders, defined areas of a site are inactive while the rest of the site remains active.

Government Publication Date: Up to Nov 2024

Abandoned Mine Information System:

Provincial

[AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Apr 2024

Anderson's Waste Disposal Sites:

Private

[ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial

[AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private

[AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Apr 30, 2025

Borehole:

Provincial

[BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2023

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-Apr 30, 2025

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -Apr 2025

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Apr 2025

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Jun 30, 2025

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database (ODHD) is offered by the Province of Ontario's Ministry of Mines. The dataset contains information for over 164,000 percussion, overburden, sonic and diamond-drill holes. The presence of assay results with cutoff values for gold, silver, copper, zinc, lead, nickel and platinum group elements is noted. Drill hole data are compiled from assessment files that have been submitted to the ministry in accordance with the Ontario Mining Act (OMA). Source assessment file numbers are captured for cross reference with the Ontario Assessment File Database (OAFD). Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Aug 2024

Delisted Fuel Tanks:

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Oct 2023

Environmental Activity and Sector Registry:

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011 - Jun 30, 2025

Environmental Registry:

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Jun 30, 2025

Environmental Compliance Approval:

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011 - Jun 30, 2025

Environmental Effects Monitoring:

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Aug 31, 2024

Environmental Issues Inventory System:

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment, Conservation and Parks (MECP). These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2024

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Jan 2025

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: Oct 31, 2021

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. As of January 1, 2023, businesses and institutions subject to the amended Reg. 347: General – Waste Management are required to report their activities and pay fees through Resource Productivity & Recovery Authority (RPRA) online Hazardous Waste Program Registry (HWPR) rather than the Hazardous Waste Information Network (HWIN) system previously operated by the Ministry of the Environment, Conservation and Parks (MECP). Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Dec 31, 2024

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Apr 2024

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing in a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: 31 Oct, 2023

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 31, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2025

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment Conservation and Parks (MECP) provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act. MECP publicly releases the Environmental Compliance Report (ECR) on the Ontario Data Catalogue. In Ontario, all facilities with regulated wastewater discharges or air emissions under the Ontario Water Resources Act and the Environmental Protection Act must monitor and report any cases where approved operating limits have been exceeded.

Government Publication Date: Dec 31, 2023

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Nov 2023

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-May 31, 2025

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

[NEES](#)

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

[NPCB](#)

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

[NPR2](#)

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of pollutant releases (to air, water and land), disposals, and transfers for recycling. The inventory, managed by Environment and Climate Change Canada, tracks over 300 substances. Under the authority of the Canadian Environmental Protection Act (CEPA), owners or operators of facilities that meet published reporting requirements are required to report to the NPRI.

Government Publication Date: Feb 2024**National Pollutant Release Inventory - Historic:**

Federal

[NPRI](#)

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances. This data holds historic records; current records are found in NPR2.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

[OGWE](#)

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-Feb 28, 2025**Ontario Oil and Gas Wells:**

Provincial

[OOGW](#)

In 1998, the Ministry of Natural Resources (MNR) handed over to the Ontario Oil, Gas and Salt Resources (OGSR) Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database includes well owner/operator, location, permit issue date, and well cap date, license number, status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provided for each well record.

Government Publication Date: 1800-Aug 2024**Inventory of PCB Storage Sites:**

Provincial

[OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

[ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Jun 30, 2025

Canadian Pulp and Paper:

Private

PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014

Parks Canada Fuel Storage Tanks:

Federal

PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial

PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011 - Jun 30, 2025

Ontario PFAS Spills:

Provincial

PFAS

This specific list of spills includes those incidents where one or more of the listed contaminants are identified in the PFAS Structure List and/or PFAS Chemicals Without Explicit Structure List made available by the United States Environmental Protection Agency (US EPA), is originally sourced from the Ministry of the Environment, Conservation and Parks spills related data. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024; Aug 2024; Oct-Nov 2024

NPRI Reporters - PFAS Substances:

Federal

PFCH

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This listing of PFAS substance reporters includes those NPRI facilities that reported substances that are found in either: a) the Comprehensive Global Database of PFASs compiled by the Organisation for Economic Co-operation and Development (OECD), b) the US Environmental Protection Agency (US EPA) Master List of PFAS Substances, c) the US EPA list of PFAS chemicals without explicit structures, or d) the US EPA list of PFAS structures (encompassing the largest set of structures having sufficient levels of fluorination to potentially impart PFAS-type properties).

Government Publication Date: Feb 2024

Potential PFAS Handlers from NPRI:

Federal

PFHA

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This list of potential PFAS handlers includes those NPRI facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used, or released by the facility - these are facilities that potentially handle PFAS based on their industrial profile.

Government Publication Date: Feb 2024

Pipeline Incidents:

Provincial

PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Potential PFAS Handlers from EASR:

Provincial

PPHA

The Ontario Environmental Activity and Sector Registry (EASR), described in Ontario Regulation 245/11, allows businesses with less complex operations - and hence not requiring an Environmental Compliance Approval - to register their activities with the Ontario Ministry of the Environment, Conservation and Parks (MECP). This list of potential PFAS handlers includes those EASR facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used.

Government Publication Date: Jun 30, 2024

Private and Retail Fuel Storage Tanks:

Provincial

PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial

PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Jun 30, 2025

Ontario Regulation 347 Waste Receivers Summary:

Provincial

REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2021

Record of Site Condition:

Provincial

RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up. RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09). The Government of Ontario states that it is not responsible for the accuracy of the information in this Registry.

Government Publication Date: 1997-Sept 2001, Oct 2004-May 2025

Retail Fuel Storage Tanks:

Private

RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-Apr 30, 2025

Scott's Manufacturing Directory:

Private

SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial

SPL

List of spills and incidents made available by the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024; Aug; Oct-Apr 2025

Wastewater Discharger Registration Database:

Provincial

SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2021

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2024

Variances for Abandonment of Underground Storage Tanks:

Provincial

VAR

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

WDS

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011 - Jun 30, 2025

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

WDSH

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

WWIS

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Dec 31 2023

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX 3

QUALIFICATIONS OF ASSESSORS



PATERSON GROUP

solution oriented engineering



Kuldeep Panchal Junior Environmental Scientist

Kuldeep Panchal is a Junior Environmental Scientist with Paterson Group in Ottawa, Ontario. Kuldeep received his Bachelor of Civil Engineering in 2017, Charotar University of Sciences & Technology. In 2019 He earned his Master's in Environmental Engineering, from the University of Ottawa. In his time at Paterson with Environmental Division, Kuldeep has been involved in primarily residential and commercial development projects predominantly within the National Capital Region, where he conducted Phase I Environmental Site Assessments (ESAs) to MECP and CSA standards and conducted environmental and geotechnical subsurface investigations. His current scope of work consists of environmental investigation, reporting, field inspections, soil and groundwater sampling, supervising the remediation of contaminated sites, and ensuring compliance with applicable regulatory standards.

EDUCATION

Master's Environmental Engineering, 2019
University of Ottawa, Ottawa, ON

Bachelor of Civil Engineering, 2017
Charotar University of Sciences & Technology,
Gujarat, India

LICENCE/PROFFESIONAL AFFILIATIONS

E.I.T. (Engineer in Training) with PEO
CCIL (Canadian Council of Independent Laboratories)
– Type QF
TDG (Transportation of Dangerous Goods) – Type A
Packages

YEARS OF EXPERIENCE

With Paterson: 3

Other Firms: 1.5

OFFICE LOCATION

9 Auriga Drive
Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS

- CSA Phase I Environmental Site Assessments (ESAs) – Various Sites, Ottawa, ON
- Mattamy Homes – Fairwinds Phase 8 – Environmental subsurface investigation – Ottawa, ON
- Soil and Groundwater sampling – Various Sites, Ottawa, ON
- CECCE – 205 Scholastic – Micro Piling – Ottawa, ON
- Minto – Quinn's Pointe – Stage 4 – Site Servicing and Soil Inspections – Ottawa, ON
- W.H. MacSweyn – Prepared Compaction Plan and Road Works – Ottawa, ON
- Minto – Brookline – Site Servicing – Ottawa, ON
- Various High Rise and Commercial Projects – Material Testing – Ottawa, ON
- Proposal Preparation for Material Testing – Various Projects

PROFESSIONAL EXPERIENCE

March 2024 to present – **Junior Environmental Scientist, Environmental Division, Paterson Group, Ottawa, Ontario**

- Conduct Phase I – Environmental Site Assessments (ESAs) to CSA and O.Reg. 153/04 Standards.
- Responsible for the application of environmental, hydrological, and/or geotechnical principles and practices in the identification and delineation of soil and groundwater contamination plumes while ensuring compliance with federal, provincial, and/or municipal legal and regulatory requirements.
- Presenting analytical test results, interpretations, assessments, recommendations and/or conclusions in a final technical report.
- Field experience in the supervision of drilling and excavation contractors, inspection of aboveground and underground fuel storage tanks, soil and rock classification, and soil and groundwater field sampling.
- Coordination of contractors while directly reporting to intermediate and senior management to ensure completion of project on schedule and within budget.

July 2023 to February 2024 – **Project Coordinator, Materials Testing, Paterson Group, Ottawa, Ontario**

- Prepares technical reports for existing clients, such as geotechnical summaries, and foundation assessments.
- Compiles proposals for various private and government-based tenders.
- Aids with project-related procurements.
- Prepares and reviews training and Standard Operating Procedures (SOP's) documents for the Materials Testing Department.
- Works closely with Director or Project Managers within the Materials Testing Department to ensure reports are completed on time.
- Actively takes part in extra training and the training of field staff.
- Assists the Director or Project Manager and field staff with various site inspections.

May 2021 to July 2023 – **Field Technologist, Materials Testing – Paterson Group, Ottawa, ON**

- Geotechnical investigations include test pitting programs for various types of subsurface soils investigations.
- Prepares geotechnical investigation reports and slope stability analysis with accompanying recommendations.
- Field inspections and material testing include but not limited to compaction, proof rolling, concrete testing, mortar/grout testing, subgrade reviews, bearing medium evaluations, bearing surface inspections, rebar inspections, both footings and walls, and asphalt sampling.
- Specialty testing such as, cover meter inspections, Piling and Micro Piling, excavation reviews, thermocouple installation and readings, Schmidt hammer testing, granular sampling, light weight fill, and crack monitoring.

June 2017 to June 2018 – **Site Engineer, Sheth Enterprise – Surat, Gujarat, India**

- Used theoretical knowledge of construction work in practical scenarios.
- Was responsible for handling multiple residential construction sites in Surat area.
- Performed duties such as site inspections, supervision of workers and the coordination between contractors and design engineers.
- Trained civil engineering graduates during their internships on the construction sites.

February 2017 to April 2017 – **Environmental Laboratory Trainee – Detox Corporation Pvt. Ltd. – Surat, Gujarat, India**

- Performed analysis of environmental samples which were collected on a regular basis adhering to the safety regulations.
- Understood the design plans of water and wastewater treatment plants.
- Implemented various regulations and limits of parameters in water and wastewater discharge.
- Performed analysis of samples using apparatus such as a Bomb Calorimeter and a Spectrophotometer.
- Conducted a variety of tests on water and wastewater using methods such as Biochemical Oxygen Demand (BOD) and Chemical Oxygen Demand (COD) tests.
- Learned how to formulate environmental impact assessment reports.
- Authored professional reports listing the characteristics of tested waste and hazardous waste.
- Gathered and prepared reports on Quality Assurance (QA) of environmental waste.



PATERSON GROUP

solution oriented engineering



Jesse Andrechek, P.Eng., QPesa Project Manager - Environmental

Jesse joined Paterson Group in 2019 as part of the Environmental and Geotechnical Division. Jesse has received his Advanced Diploma in Civil Engineering Technology from St. Lawrence College in 2016, as well as his Bachelor of Applied Science in Civil Engineering from Queen's University in 2019. In his time with Paterson, Jesse has been involved primarily in residential and commercial developments across Ontario, where he conducted Phase I and II Environmental Site Assessments (ESAs) to MECP and CSA standards, assisted in the filing of records of site condition (RSCs), managed excess soils investigations, supervised environmental remediation programs to CSA, CCME, and MECP standards, and conducted environmental and geotechnical subsurface investigations. His scope of work consists of environmental investigation, reporting, and recommendations, field inspections, soil and groundwater sampling, supervising the remediation of contaminated sites, and ensuring compliance to applicable regulatory standards.

EDUCATION

Bachelor of Applied Science, Civil Engineering
2019
Queen's University
Kingston, Ontario

Civil Engineering Technology, Advanced Diploma
2016
St. Lawrence College
Kingston, Ontario

LICENCE/ PROFESSIONAL AFFILIATIONS

Professional Engineers of Ontario

YEARS OF EXPERIENCE

With Paterson: 5

OFFICE LOCATION

9 Auriga Drive, Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS

- 930 Carling Avenue – Former Sir John Carling Building (Ottawa Hospital New Civic Campus) - Supplemental Phase II ESA, Site Remediation, and RSC (in progress)
- 1040 Somerset Street West, Ottawa, ON – Phase I ESA, Phase II ESA, Site Remediation, and RSC
- Tunney's Pasture – Various Parcels, Ottawa, ON – Phase I ESA, Phase II ESA, RSC (in progress)
- 200 Baribeau Street, Ottawa, ON - Phase I ESA, Phase II ESA, Site Remediation, and RSC
- 52 Scarsdale Road, Toronto, ON – Supplemental Phase II ESA and Site Remediation
- 6371 Perth St, Richmond – Phase I ESA, Supplemental Phase II ESA, Site Remediation, and RSC
- 667 Bank Street, Ottawa, ON – Phase I and II ESA
- 359 Kent Street, 436 and 444 McLaren Street, Ottawa, ON – Phase I and II ESA
- Gardiners Road, Kingston, ON – Phase I ESA, Phase II ESA and Remediation Supervision
- 668 Regional Road 17, Clarington, ON – Geotechnical Investigation
- Soil, Water, and Sediment Sampling – Various Sites
- Slope Stability Surveys and Seismic Shear-Wave Velocity Surveys – Various Sites, Ottawa

PROFESSIONAL EXPERIENCE

2019 to present, **Project Manager - Environmental, Paterson Group, Ottawa, Ontario**

- Carry out Phase I - Environmental Site Assessments (ESAs) to CSA, CCME, and O.Reg. 153/04 Standards.
- Carry out Phase II - Environmental Site Assessments (ESAs) and supplemental Phase II ESAs to CSA, CCME, and O.Reg. 153/04 Standards;
- Preparation and submission of Records of Site Condition to O.Reg. 153/04 Standards;
- Assist with the preparation of Due Diligence Risk Assessments (DDRA);
- Assist with the preparation of Tier II and Tier III Risk Assessments to O.Reg. 153/04 Standards;
- Supervise and manage Soil and Groundwater Remediation Programs to CSA, CCME, and O.Reg. 153/04 Standards;
- Conduct Excess Soil Investigations, and prepare related reporting, documentation, and recommendations for soil transport to meet O.Reg. 406/19 Standards and for due diligence purposes.
- Carry out Reuse Site Assessments and provide recommendations for the beneficial importation of excess soil to O.Reg. 406/19 Standards;
- Preparation of Proposals and Fee Estimates for various environmental services;
- Manage contractors and field personnel to ensure soil and groundwater quality control;
- Present analytical test results, interpretations, assessments, recommendation and/or conclusions in technical reporting and verbal and written communication with clients;
- Oversee geotechnical and environmental field investigations for borehole drilling and test pit excavation;
- Conduct settlement surcharge surveys, settlement plate installations, slope stability surveys, seismic shear-wave velocity surveys, topographic surveys, and geotechnical subsurface investigations, including sensitive clay deposits;