

Phase I Environmental Site Assessment

1867 Alta Vista Drive
Ottawa, Ontario

Prepared for: TCU Development Corporation

Report: PE6971-1
Date: June 23, 2025



TABLE OF CONTENTS

EXECUTIVE SUMMARY	ii
1.0 INTRODUCTION	1
2.0 PHASE I PROPERTY INFORMATION	2
3.0 SCOPE OF INVESTIGATION	3
4.0 RECORDS REVIEW	4
4.1 General	4
4.2 Environmental Source Information	6
4.3 Physical Setting Sources	13
5.0 INTERVIEWS	16
6.0 SITE RECONNAISSANCE	16
6.1 General Requirements	16
6.2 Specific Observations at the Phase I Property	16
7.0 REVIEW AND EVALUATION OF INFORMATION	19
7.1 Current and Past Uses	19
7.2 Conceptual Site Model	20
8.0 CONCLUSIONS	25
8.1 Assessment	25
8.2 Recommendations	25
9.0 STATEMENT OF LIMITATIONS	26
10.0 REFERENCES	27

List of Figures

Figure 1 - Key Plan

Figure 2 - Topographic Map

Drawing PE6971-1 - Site Plan

Drawing PE6971-2 - Surrounding Land Use Plan

List of Appendices

Appendix 1 Plan of Survey
Aerial Photographs
Site Photographs

Appendix 2 MECP Freedom of Information
MECP Well Records
TSSA Correspondence
City of Ottawa HLUI
ERIS Report

Appendix 3 Qualifications of Assessors

EXECUTIVE SUMMARY

Assessment

Paterson Group was retained by TCU Development Corporation, to carry out a Phase I-Environmental Site Assessment (ESA) for 1867 Alta Vista Drive, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and 250m Phase I Study Area, and to identify any environmental concerns with the potential to have impacted the Phase I Property.

Based on the available historical information, the Phase I Property was initially developed with a commercial building in the 1970s, which was used as office space. The building was demolished in 2016, and the property has since remained vacant, with parking lot surfaces still present. No environmental concerns were identified in relation to the historical use of the property.

A previous subsurface investigation conducted by another consultant identified the presence of fill material on the Phase I Property. The presence of fill material of unknown quality is considered a Potentially Contaminating Activity (PCA) and results in an Area of Potential Environmental Concern (APEC) on the Phase I property.

Based on the available historical information, adjacent and surrounding properties within the Phase I Study Area have been developed primarily for commercial and residential purposes. The historical PCAs identified in the Phase I Study Area are not considered to represent APECs on the Phase I Property due to their separation distance and/or the down/cross-gradient orientation with respect to the Phase I Property.

Following the historical research, a site visit was conducted. The Phase I Property is currently vacant land featuring two asphaltic concrete parking areas, which are remnants of a former commercial office building. No environmental concerns were identified in relation to the current use of the property.

Land use within the Phase I Study consists of properties used commercial (mainly office space), institutional and residential purposes with some vacant land. No previously unidentified PCAs were observed during the review of the current use of surrounding properties.

Recommendations

Based on the findings of the Phase I ESA, it is **our opinion that a Phase II-Environmental Site Assessment is required for the Phase I Property.**

1.0 INTRODUCTION

At the request of Westrich Management Ltd., Paterson Group (Paterson) carried out a Phase I-Environmental Site Assessment (Phase I-ESA) for 1867 Alta Vista Drive, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and properties within the Phase I Study Area to identify any potentially contaminating activities (PCAs) that would result in areas of potential environmental concern (APECs) on the subject land.

Paterson was engaged to conduct this Phase I-ESA by Mr. Evan Johnson with TCU Development Corporation. Mr. Evan Johnson can be reached by mail at 1207-150 Isabella Street, Ottawa, ON, K1S 5H3.

This report has been prepared specifically and solely for the above noted project which is described herein. It contains all our findings and results of the environmental conditions at this site.

This Phase I-ESA report has been prepared in general accordance with Ontario Regulation (O.Reg.) 153/04, as amended, under the Environmental Protection Act, and CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I-ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

2.0 PHASE I PROPERTY INFORMATION

Address:	1867 Alta Vista Drive, Ottawa, Ontario.
Legal Description:	Part of Lot 15, Concession Junction Gore, As IN N561626, Ottawa/Gloucester.
Property Identification Number (PIN):	04258-0404.
Location:	The Phase I Property is located on the east side of Alta Vista Drive, approximately 65m north of the intersection of Alta Vista Drive and Smyth Road, in the City of Ottawa, Ontario. The site boundary excludes the 30m buffer zone along the unnamed creek located to the east side of the site, since this will not be subject to development. Refer to Figure 1 - Key Plan in the Figures section following the text.
Latitude and Longitude:	45° 23' 60" N, 75° 39' 41" W
Site Description:	
Configuration:	Irregular
Area:	0.76 ha (approximate)
Zoning:	IP12 F (1.5) & IP12[2424] F (1.2) – Business Park Industrial Zone
Current Use:	The Phase I Property is currently vacant land featuring two asphaltic concrete parking areas, which are remnants of a former commercial office building and landscaped areas.
Services:	The Phase I Property is located in a municipally serviced area.

3.0 SCOPE OF INVESTIGATION

The scope of work for this Phase I – Environmental Site Assessment was as follows:

- ☐ Determine the historical activities on the Phase I property and Study Area by conducting a review of readily available records, reports, photographs, plans, mapping, databases, and regulatory agencies;
- ☐ Investigate the existing conditions present at the Phase I property and Study Area by conducting site reconnaissance;
- ☐ Conduct interviews with persons knowledgeable of current and historic operations on the subject properties, and if warranted, neighbouring properties;
- ☐ Present the results of our findings in a comprehensive report in general accordance with the requirements of O.Reg. 153/04, as amended, under the Environmental Protection Act, and CSA Z768-01 (reaffirmed 2022);
- ☐ Provide a preliminary environmental site evaluation based on our findings;
- ☐ Provide preliminary remediation recommendations and further investigative work if contamination is suspected or encountered.

4.0 RECORDS REVIEW

4.1 General

Phase I-ESA Study Area Determination

A radius of approximately 250m was determined to be appropriate as a Phase I Study Area for this assignment. Properties outside the 250m radius are not considered to have impacted the subject land, based on their significant distance from the site.

First Developed Use Determination

Based on a review of available historical information, the Phase I Property was first developed for commercial use in 1970s.

Fire Insurance Plans (FIPs)

Fire Insurance Plans (FIPs) are not available for the area of the Phase I Property and surrounding properties.

City of Ottawa Street Directories

City directories for the Phase I Property and neighbouring properties in the Phase I Study Area were reviewed in approximate ten-year intervals, between 1956 and 2011. The Phase I Property was first listed in the city directories in 1971 as the Canadian Medical Association and remained under this listing until 1986. Between 1986 and 2011, the property was occupied by various commercial office tenants, including but not limited to Lancet Insurance Agency Ltd., M D Management Ltd., Canadian Journal of Surgery, and the Academy of Medicine, alongside the Canadian Medical Association. No listings were found for the property prior to 1971. Based on the review of city directories, no environmental concerns were identified in relation to the historical uses of the Phase I Property.

Surrounding properties in the Phase I Study Area were historically listed for residential, institutional and commercial uses. Based on the review of city directories, no environmental concerns were identified in relation to the historical uses of the surrounding properties in the Phase I Study Area.

Chain of Title

Given the available information, it was determined that the results of a chain of title search would not contribute to the environmental assessment for the Phase I

Property. Therefore, a chain of title search was not completed as part of this assessment.

Plan of Survey

A plan of survey for the Phase I Property, prepared by Annis, O'Sullivan Vollebekk Ltd. was reviewed as part of the Phase I ESA. The plan shows the Phase I Property in its current configuration. A copy of the plan of survey is provided in Appendix 1.

Previous Environmental Reports

The following environmental reports were reviewed as part of this Phase I-ESA:

- ❑ "Phase I Environmental Site Assessment, 1867 Alta Vista Drive, Ottawa, Ontario" prepared by Fisher Engineering Ltd., dated December 5, 2022.

A Phase I ESA was completed in 2022 by Fisher Environmental Ltd. (Fisher) for the subject site. According to historical records, the site was first developed with a commercial office building between 1967 and 1969. No environmental concerns were identified in relation to the historical use of the property. As part of the ESA, an Environmental Risk Information Services (ERIS) report identified a gasoline tank spill reported in 1988 near the intersection of Alta Vista Drive and Smyth Road. Although the exact location of the spill was unknown, it was identified as a Potentially Contaminating Activity (PCA). Based on the distance and cross-gradient orientation with respect to the subject site, the identified PCA was not considered to represent an Area of Potential Environmental Concern (APEC) on the subject site.

A surplus soil characterization was conducted by Fisher Environmental Ltd. in conjunction with geotechnical investigations prior to the completion of the Phase I ESA. Fill material was reported across the site, extending to depths of approximately 3.11 to 5.03m below ground surface (mbgs), and was identified as a PCA. Fill material identified onsite was found to be compliant with the selected MECP Table 3 ICC standards for all parameters. However, soils recovered from the eastern portion of the site within 30m of the unnamed creek were reported to exceed the applicable MECP Table 9 Standards for Selenium. Fisher identified that remediation of the impacted soils, likely in conjunction with redevelopment excavations, and confirmatory sampling would be required to ensure soils on the eastern 30m of the site meet the applicable MECP Table 9 Standards. The identified fill material was not considered an APEC on the subject site.

- ❑ “Hydrogeological Investigation, 1867 Alta Vista Drive, Ottawa, K1G 5W8 Ontario” prepared by Fisher Engineering Ltd., dated December 5, 2022.

Fisher Environmental carried out a hydrogeological investigation for the property addressed 1867 Alta Vista Drive for the purposes of evaluating the hydrogeological conditions with respect to redeveloping the site. The investigation involved drilling eight boreholes to approximate depths of 4.60 - 6.20m bgs. Four boreholes were instrumented with groundwater monitoring wells.

Fill material was encountered in all eight boreholes advanced on the subject site, extending to depths ranging from approximately 3.51m to 5.03m bgs. Bedrock was encountered at 3.51m bgs in Borehole BH2, while inferred bedrock depths in the remaining boreholes ranged between 4.60m to 6.20m bgs. Groundwater levels measured on October 7, 2022, ranged from approximately 1.83m to 2.64m bgs.

One groundwater sample was collected from monitoring well BH8 and submitted for laboratory analysis in accordance with the parameters outlined in the Ontario Ottawa Sanitary and Storm Sewer By-Law No. 2003-514 (2003). The analytical results indicated compliance with the by-law standards for all parameters except total suspended solids and manganese.

The results were compared to the MECP Table 3 Non-Potable Groundwater Standards and were found to be in compliance for all tested parameters.

- ❑ “Soil Investigation, 1867 Alta Vista Drive, Ottawa, Ontario” prepared by Fisher Engineering Ltd., dated March 7, 2025.

A total of seven test pits were advanced by Fisher Engineering Ltd. on the subject site on February 28, 2025. Fill material was encountered in all test pits to depths of approximately 3 metres. The fill primarily consisted of mixed soils, including silty sand with some gravel and clay, as well as occasional cobbles. Soil samples recovered from the test pits were submitted for laboratory analysis for metals, PHCs, BTEX, and EC/SAR.

According to the results, all analysed soil samples met the MECP Table 3 Standards, with the exception of the EC/SAR parameters.

In their March 2025 report, Fisher Engineering Ltd. Stated: *“Elevated levels of Selenium, previously reported within the 2022 drilling investigations were not identified in the current works. It is expected that the previous findings of Selenium related to analytical interferences attributable to the presence of crushed rock*

within the soil matrix, and are not representative of actual soil conditions across the Site”.

Accordingly, the previously reported selenium exceedances are not considered to be representative of actual soil conditions and therefore, these selenium results are not contaminants of concern on the Phase I Property.

It should be noted that boreholes BH1, BH2, and BH3 from the December 2022 hydrogeological investigation, as well as test pits TP201, TP205, and TP207 from the March 2025 soil investigation, were completed within the 30m buffer zone adjacent to the creek on the east side, which falls outside the current Phase I Property boundary.

4.2 Environmental Source Information

Environment Canada

A search of the National Pollutant Release Inventory (NPRI) was conducted electronically on June 16, 2025. No records were found in the NPRI database for properties within the Phase I Study Area.

PCB Inventory

A search of provincial PCB waste storage sites was conducted. No PCB waste storage sites were identified within the Phase I Study Area.

Areas of Natural Significance

A search for areas of natural significance and features within the Phase I Study Area was conducted on the website of the Ontario Ministry of Natural Resources (MNR) on June 16, 2025. The search did not reveal any areas of natural significance within the Phase I Study Area.

Ministry of the Environment, Conservation and Parks Freedom of Information Request

A request was submitted to the MECP FOI office for information with respect to reports related to environmental conditions for the Phase I Property. A response was received on January 10, 2025, and contained no related records of reports related to environmental conditions. A copy of the received response is appended to this report.

MECP Instruments

A request was submitted to the MECP Freedom of Information (FOI) office for information with respect to certificates of approval, permits to take water, certificates of property use or any other similar MECP issued instruments for the site. A response was received on January 10, 2025, and contained no instrument records. A copy of the received response is appended to this report.

MECP Incident Reports

A request was submitted to the MECP FOI office for information with respect to records concerning environmental incidents, orders, offences, spills, discharges of contaminants, inspections maintained by the MECP for the Phase I Property or neighbouring properties. A response was received on January 10, 2025, which included one incident report and two occurrence reports.

The first occurrence report, dated 1990, involved coloured liquid observed in the unnamed creek situated to the east of the Phase I Property, originating from a storm sewer outfall located north of Smyth Road and east of Alta Vista Drive. No further information was available. As the creek is not located on the Phase I Property, this occurrence is not considered to pose a risk to the site.

The second occurrence report, dated 1999, pertains to the issuance of an emergency generator number for waste class 251, in connection with a hydraulic oil spill caused by a broken elevator hose in a former building on the Phase I Property. As the spill occurred within the building structure, it is unlikely to have impacted the underlying soil or groundwater conditions. Therefore, this occurrence is not considered to represent an environmental concern.

The incident report, dated 2007, referred to polluted water in the unnamed creek situated to the east of the Phase I Property. The report indicated that no environmental impact was anticipated. Based on the information provided, this incident is not considered to pose an environmental concern to the Phase I Property. A copy of the received response is appended to this report.

MECP Waste Management Records

A request was submitted to the MECP FOI office for information with respect to waste management records. A response was received on January 10, 2025, which included three waste generator records. One of the waste generator records was associated with a historical spill resulting from a broken elevator hose. The remaining two records pertained to waste generated during the demolition of the former on-site building, all of which were disposed of off site.

Based on the available information, the identified waste records are not considered to represent a potential environmental concern for the Phase I Property. A copy of the response is appended to this report.

MECP Brownfields Environmental Site Registry

A search of the MECP Brownfields Environmental Site Registry (ESR) was conducted as part of this assessment for the site, neighbouring properties and the general area of the site. No record of site condition (RSC) was identified for the Phase I Property or surrounding properties within the Phase I Study Area.

MECP Waste Disposal Site Inventory

The Ontario Ministry of Environment document titled "Waste Disposal Site Inventory in Ontario, 1991" was reviewed as part of the historical research. This document includes all recorded active and closed waste disposal sites, industrial manufactured gas plants and coal tar distillation plants in the Province of Ontario. No such sites were listed in the database for the Phase I Property or properties within the Phase I Study Area.

MECP Coal Gasification Plant Inventory

The Ontario Ministry of Environment document titled "Municipal Coal Gasification Plant Site Inventory, 1991" was reviewed to reference the locations of former plants with respect to the site. No Municipal Coal Gasification Plant Sites are located within the Phase I Study Area.

Technical Standards and Safety Authority (TSSA)

The TSSA, Fuels Safety Branch in Toronto, was contacted electronically on December 10, 2024, to inquire about current and former underground/aboveground storage tanks for the subject and neighbouring properties. The following properties were included in the search request: 1745, 1758, 1785, 1800, 1815, 1867, 1870, and 1891 Alta Vista Drive, as well as 255 Smyth Road and 2 Valour Drive.

Two records were returned in response to this inquiry and pertain to one active and one expired FS non licenced facility at 2 Valour Drive, approximately 30m to the east of the Phase I Property. It is worth noting that the Phase I Property and the developed portion of 2 Valour Drive are separated by an unnamed creek. As a result of this natural barrier, the activities associated with these fuel records are not considered to pose an environmental concern for the Phase I Property. No related records were identified by the TSSA for the Phase I Property.

A copy of the TSSA correspondence is included in Appendix 2.

City of Ottawa Historical Land Use Inventory (HLUI)

A request for a search of the City of Ottawa's Historical Land Use Inventory (HLUI) database was submitted to the City of Ottawa. A response was received on January 30, 2025. A copy of the HLUI response letter and HLUI Map are included in Appendix 2.

The City's Historical Land Use Inventory (HLUI) database identified 12 activities associated with properties located within a 250m radius of the Phase I Property. No records were identified for the Phase I Property. No PCAs were identified with the review of the obtained records for the surrounding properties.

The database noted the presence of a railway line approximately 230m west of the site, and a former landfill located approximately 360m to the west. The landfill, known as the Riverside Drive Landfill (Landfill ID #Ur-10), was situated between Billings Bridge and Hurdman Bridge and was operated by the City of Ottawa from 1948 to 1963. Based on the separation distance and down-gradient orientation with respect to the Phase I Property, the identified railway line and landfill are not considered an APEC to the Phase I Property.

City of Ottawa Old Landfill Sites

The document prepared by Golder Associates entitled, "*Old Landfill Management Strategy, Phase I - Identification of Sites, City of Ottawa*", was reviewed as part of this assessment. No former landfill sites were identified on the Phase I Property, or within a 250m radius of the Phase I Property.

City of Ottawa Former Industrial Sites

The document prepared by Intera Technologies Limited entitled, "*Mapping and Assessment of Former Industrial Sites, City of Ottawa*", was also reviewed as part of this assessment. No former industrial sites were identified on the Phase I Property, or within a 250m radius of the Phase I Property.

Environmental Risk Information Service (ERIS) Report

An Environmental Risk Information Services (ERIS) report, dated June 16, 2025, was acquired for the Phase I Property and reviewed as part of this assessment. It should be noted that the ERIS report includes information that would normally be obtained through the MECP FOI, MECP well records search as well as several other records (i.e., incident reports, waste generators, etc.). The complete ERIS report has been included in Appendix 2.

❑ *On-Site Records:*

A total of five records were identified for the Phase I Property (2 of which are previous ERIS searches). The ERIS report identified three Waste Generator records associated with the Phase I Property. The first, dated 2015, was for Regional Elevator and listed the waste class as oil skimmings and sludges. The second, dated 2017, was for Demolition Plus and included waste classes such as waste oils/sludges, petroleum distillates, asphaltic solvents and residues, and wastes from the use of pigments, coatings, and paints. The third, also dated 2017, was for Broccolini and listed the waste class as inert organic wastes.

As noted in the MECP FOI request section above, the first record is associated with a historical spill caused by a broken elevator hose. The remaining two records relate to waste generated during the demolition of a former on-site building, all of which was disposed of off site. Based on the available information, these waste records are not considered to represent a potential environmental concern for the Phase I Property.

❑ *Off-Site Records:*

A total of 86 records from various databases were identified for properties within a 250m radius of the Phase I Property (7 of which are previous ERIS searches).

The ERIS report identified 10 Scott's Manufacturing Directory records for surrounding properties within the Phase I Study Area. One record was for 1815 Alta Vista Drive, located adjacent to the north of the Phase I Property, and listed the Canadian Dental Association, which is associated with office use. This record is not considered a PCA. Second record was for 1800 Alta Vista Drive, located approximately 30m west of the Phase I Property, and listed Canadian Blood Services, a blood bank laboratory. This use is not considered manufacturing and is interpreted as laboratory or office space; therefore, it is not considered a PCA. The remaining eight records were associated with 1785 Alta Vista Drive, located approximately 80m north of the Phase I Property. These records pertain to various pharmaceutical companies and associations, as well as one computer software distributor. Aerial photographs indicate that this property has consistently been occupied by an office building since development. These records are interpreted as office uses and are not considered PCAs.

The ERIS report identified two Ontario Spill records for properties within the Phase I Study Area. The first record, dated 1988, was associated with the National Defence. While no specific address was provided, the spill was reported along Alta Vista Drive near Smyth Road and was attributed to a leak from an underground

storage tank. No additional details were available. This spill is considered a PCA. Based on its approximate 70m separation distance and cross-gradient orientation relative to the Phase I Property, it is not considered to represent an APEC. The second spill record, dated 2006, pertains to 1800 Alta Vista Drive, located approximately 30m west of the Phase I Property. The record is related to a spill of 22.5 litres of ethylene glycol (antifreeze) into a catch basin. Based on the small quantity released, the separation distance, and the down-gradient orientation with respect to the Phase I Property, this record is not considered to pose an environmental concern to the Phase I Property.

The ERIS report identified one National Defence and Canadian Forces fuel tank record and four spill records for the property located at 1745 Alta Vista Drive, approximately 30m east of the Phase I Property. The tank record pertains to a 1,360-litre aboveground, shop-fabricated diesel tank installed in 1997, used for building heating or as an emergency power generator. The nearest building on the 1745 Alta Vista Drive property is located approximately 265m east of the Phase I Property. The four spill records involved small quantities of hydraulic oil (0.5, 20, and 40 litres) and antifreeze (2 litres), all of which were reported as contained and cleaned up. Based on the separation distance and the limited volume of the spills, both the fuel tank and spill records are not considered to pose an environmental concern to the Phase I Property.

The ERIS report identified 51 Waste Generator records for surrounding properties within the Phase I Study Area. Two records were identified for 1815 Alta Vista Drive, located adjacent to the north of the Phase I Property, and listed the Canadian Dental Association. One record was identified for 1870 Alta Vista Drive, approximately 30m west of the Phase I Property, for MD Financial Management. This record listed a waste class of paint, pigment, and coating residues with an approval year of 2016. Seven records were identified for 1785 Alta Vista Drive, located approximately 80m north of the Phase I Property, associated with the Canadian Pharmaceutical Association and 57 North Prosthodontics. These properties have consistently operated as an office building, and these records are not considered to pose an environmental concern to the Phase I Property.

Sixteen records were identified for 1800 Alta Vista Drive, located approximately 30m west of the Phase I Property, for Canadian Blood Services and the Canadian Red Cross Society. These records are related to the operation of a blood bank laboratory and are not considered PCAs. The remaining 25 records pertain to the property at 1745 Alta Vista Drive, approximately 30 metres east of the Phase I Property, with the nearest building located approximately 265 metres east. These records are associated with the Department of National Defence or 1 Dental Unit

Detachment Ottawa. The listed waste classes include, but are not limited to, pathological waste, PCBs, waste oil and lubricants, waste compressed gases, and acid waste containing heavy metals, with approval years ranging from 1992 to 2021. Based on the separation distance of the building for the Phase I Property, these identified records and operations of the property are not considered to represent an environmental concern to the Phase I Property.

The ERIS report identified nine well records and two borehole records for surrounding properties within the Phase I Study Area, which are further discussed in the water well records section of this report.

The remaining records identified in the ERIS report contain minimal or non-pertinent information and/or include details that are not considered indicative of a potential environmental concern to the Phase I Property. The complete ERIS report has been included in Appendix 1.

4.3 Physical Setting Sources

Aerial Photographs

Historical air photos from the National Air Photo Library, GeoOttawa Website and Google Earth were reviewed in approximate ten (10) year intervals. Based on the review, the following observations have been made:

1933	The Phase I Property appears to consist of vacant, undeveloped land. A creek is present to the east of the Phase I Property. The surrounding area primarily consists of vacant and agricultural land. A railway line is observed further west of the Phase I Property, running in a north–south direction.
1945	No significant changes are apparent with regard to the Phase I Property. Alta Vista Drive appears to be constructed immediately west of the Phase I Property, and Smyth Road is located to the south. The surrounding area is predominantly vacant or agricultural land, with a few residential dwellings situated further east of the Phase I Property.
1958	(GeoOttawa) No significant changes are apparent with regard to the Phase I Property. The surrounding properties to the south across Smyth Road are developed with residential dwellings. The property further to the east appears to be under construction. Further north along Alta Vista Drive, a residential or commercial building has been constructed.

- 1965 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property. The property further to the east, which was previously under construction, has since been developed with a commercial building, and access is now provided via Valour Drive.
- 1976 (GeoOttawa) The Phase I Property appears to be developed with a commercial building and associated parking areas. Adjacent property to the north is developed with commercial building.
- 1985 No significant changes are apparent with regard to the Phase I Property. Adjacent property to the south is developed with commercial building, while properties to the west of the Phase I Property remain vacant.
- 1991 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property. A commercial building has been developed to the northwest of the Phase I Property, across Alta Vista Drive.
- 2002 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property. A commercial building has been developed to the southwest of the Phase I Property, across Alta Vista Drive.
- 2011 (GeoOttawa) No significant changes are apparent with regard to the Phase I Property or surrounding properties.
- 2022 (GeoOttawa) The commercial building on the Phase I Property appears to have been demolished, with only the parking area remaining. No significant changes are apparent with regard to the surrounding properties.

The former railway line, located approximately 230m west of the Phase I Property, is identified as a PCA within the Phase I Study Area. As discussed previously, based on the separation distance and down-gradient orientation, the identified PCA is not considered an APEC on the Phase I Property.

Copies of selected aerial photographs reviewed are included in Appendix 1.

Physiographic Maps

A Physiographic Map was reviewed from the Natural Resources Canada – The Atlas of Canada website. According to this physiographic map, the site is located in the St. Lawrence Lowlands. According to the mapping description provided: “The lowlands are plain-like areas that were all affected by the Pleistocene glaciations and are therefore covered by surficial deposits and other features

associated with the ice sheets.” The Phase I Property is located in the Central St. Lawrence Lowland, which is generally less than 150 m above sea level.

Topographic Maps

Topographic maps were obtained from Natural Resources Canada – The Atlas of Canada website and from the City of Ottawa website. The topographic maps indicate that the elevation of the Phase I Property is approximately 75m above sea level. The regional topography in the general area of the Phase I Property slopes downward to the west/northwest, in the direct of the Rideau River. An illustration of the referenced topographic map is presented on Figure 2 – Topographic Map, appended to this report.

Geological Maps

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on the information from NRCAN, bedrock in the area of the site consists of shale of the Carlsbad Formation. Based on the maps, the surficial geology consists of offshore marine sediments with an overburden thickness ranging from 2 to 3m.

Previous subsurface investigations conducted by Fisher Engineering Ltd. at the Phase I Property indicate that the underlying bedrock is shale. The overburden consists of a fill layer of silty sand underlain by glacial till (described as compact silty sand with gravel, cobbles, and boulders). Fill material was encountered on the Phase I Property, extending to depths between approximately 3.11m and 4.97m bgs. Inferred bedrock depths in the boreholes ranged from 4.60m to 6.20m bgs.

Water Well Records

A search of the MECPs website was conducted on April 24, 2025, for all drilled well records within a 250m radius of the Phase I Property. Two (2) monitoring wells were identified on the Phase I Property, installed as part of the previously discussed 2022 hydrogeological investigation.

A total of nine well records were identified within a 250m radius of the Phase I Property. Two of these records are associated with monitoring wells installed within the 30m buffer zone to the east along the creek, as part of the previously noted 2022 hydrogeological investigation. Three records pertain to monitoring wells installed between 2011 and 2015, while the remaining four records relate to well abandonments. The nearest monitoring well is located within the 30m buffer zone to the east of the Phase I Property. The remaining monitoring wells are situated approximately 170m southeast of the property and appear to have been installed

for geotechnical or environmental investigation purposes. A copy of the well record has been included in Appendix 2.

Based on the available well records, the geological stratigraphy in the area generally consists of topsoil or sand/gravel fill overlying native brown sand. Bedrock was encountered at a depth of 1.5m bgs in one record but was not encountered in the others.

5.0 INTERVIEWS

Property Owner Representatives

Mr. Stephen Creighton, Executive Vice President for Dymon Group, was available via phone on January 6th, 2025, to respond to inquiries regarding the Phase I Property. Mr. Creighton has been a part of the Dymon Group for approximately 19 years and Dymon Group was the current property owner at the time of interviewing. According to Mr. Creighton the land was originally developed in 1970 as the headquarters for the Canadian Medical Association. This remained the only use for the building until it was demolished in 2016. The property has remained vacant since that time with the exception of the preexisting asphalt parking lots which were not demolished. Mr. Creighton stated that the Dymon Group purchased the property in 2022. Mr. Creighton was not aware of any potential fuel storage on the Phase I Property. He was also unaware of any other potential environmental concerns associated with the Phase I Property or the immediately adjacent lands.

The information obtained through the interview with Mr. Creighton is considered to be consistent with site information obtained from other sources (aerial photos, ERIS Database Report and site observations) and is considered to be valid.

6.0 SITE RECONNAISSANCE

6.1 General Requirements

A site visit was conducted on November 22, 2024, by Mr. Mark Bujaki with the Environmental Department of Paterson Group. Weather conditions at the time of the site inspection were rainy with a temperature of approximately 5°C. In addition to the site, the uses of neighbouring properties within the Phase I Study Area were assessed at the time of the site visit from publicly accessible areas.

6.2 Specific Observations at the Phase I Property

Buildings and Structures

No buildings or structures are currently present on the Phase I Property.

Subsurface Structures and Utilities

The Phase I Property was serviced by a municipal connection for water and sewer. Multiple underground utilities were identified on the Phase I Property, including electrical, natural gas, water, sewer, storm and telecommunication lines. No private wells or septic systems are present on the Phase I Property or within 250m of the Phase I Property. No other subsurface structures were identified at the time of the site inspection.

Site Features

The Phase I Property is currently vacant land featuring two asphaltic concrete parking areas, which are remnants of a former commercial office building. The remainder of the site consists of grassed and low-lying vegetated areas.

The site is situated at a slightly higher elevation than Alta Vista Drive and slopes downward to the east, toward the unnamed creek, approximately 30m east of the property. The regional topography in the general area of the Phase I Property slopes down in the west/northwest direction towards Rideau River.

Water drainage on the Phase I Property occurs via sheet drainage to catch basin located in the southern parking lot and via infiltration in vegetated areas. No ponded water, stressed vegetation, surficial staining, or any other indications of potential sub-surface contamination were observed on the subject site at time of the site inspection.

No drains, pits or sumps were observed on the exterior of the Phase I Property at the time of the site inspection. No evidence of current or former railway lines or spur lines on the Phase I Property was observed at the time of the site inspection.

Site features are presented on Drawing PE6971-1 – Site Plan, provided in the Figures section following the text.

Potential Environmental Concerns

☐ **Groundwater Monitoring Wells**

Three monitoring wells were identified on the Phase I Property during the site assessment. Two of the wells (BH6 and BH8) were installed as part of a 2022 hydrogeological investigation conducted by Fisher Engineering Ltd., while the third well (MW1) appears to be associated with a previous geotechnical and/or environmental investigation, although its exact origin could not be confirmed.

☐ **Fuels and Chemical Storage**

No above ground fuel storage tanks (ASTs), or signs of USTs were observed on the exterior of the Phase I Property at the time of the site inspection. No chemicals were found to be stored on the exterior of the Phase I Property.

☐ **Waste Management**

No waste is currently being generated on the Phase I Property, as the site is vacant.

☐ **Polychlorinated Biphenyls (PCBs) and Transformer Oil**

No transformers were observed on the Phase I property.

☐ **Fill Material**

Fill material was identified in previous subsurface investigations. Additionally, several small piles of fill material were observed on the east side of the site, overgrown with vegetation. As a result, fill material of unknown quality is considered a PCA that represents APEC on the entire Phase I Property.

Neighbouring Properties

An inspection of the neighbouring properties was conducted from publicly accessible areas at the time of the site visit. Land use adjacent to the Phase I Property was as follows:

- ☐ North - Commercial office buildings, followed by Alta Vista Drive;
- ☐ South - Commercial office building (Nova Networks Headquarters), followed by Smyth Road;
- ☐ East - An unnamed creek, followed by vacant land and Residential (Oakpark Retirement Community), followed by Valour Drive;
- ☐ West - Alta Vista Drive followed by commercial office buildings.

Land use within the Phase I Study consists of properties used commercial (mainly office space), institutional and residential purposes with some vacant land. A railway line, oriented in a north-south direction, is located approximately 230m west of the Phase I Property. This railway line is considered a PCA. As discussed previously, based on the separation distance and down-gradient orientation with

respect to the Phase I Property, the identified PCA is not considered an APEC to the Phase I Property.

No other concerns were identified with the current use of the surrounding lands or other properties in the Phase I Study Area. Current land use and PCAs identified in the Phase I Study Area are presented on Drawing PE6971-2 – Surrounding Land Use Plan.

7.0 REVIEW AND EVALUATION OF INFORMATION

7.1 Current and Past Uses

Table 1 - Land Use History			
Year	Description of Property Use	Property Use	Other Observations from Aerial Photos, FIPs, etc.
Prior to 1968	Undeveloped	Vacant, Agricultural	None
1970s to 2016	Canadian Medical Association (Offices)	Commercial	Based on a review of aerial photographs and information obtained through interviews, the commercial office building was constructed in the 1970s, used exclusively as office space, and was demolished in 2016.
2016 to Present	Vacant with Parking Areas	Vacant	Based on aerial photographs and observations from the site visit, the parking areas remain intact following the demolition of the building.

Potentially Contaminating Activities (PCAs) and Areas of Potential Environmental Concern (APECs)

Based on the findings of the Phase I ESA, the following on-site PCAs (as listed in Column A, Table 2 of O.Reg.153/04) were considered to result in two APECs on the Phase I Property:

- ☐ PCA 30 – Importation of Fill Material of Unknown Quality – this PCA is associated with the potential presence of fill material of unknown quality on the Phase I Property (APEC 1)
- ☐ PCA N/A – Application of Road Salt – this PCA is associated with application of de-icing agents used for the purpose of vehicular safety on the parking area of the Phase I Property (APEC 2)

The off-site PCAs (existing or historical) identified within the Phase I Study Area are not considered to result in APECs on the Phase I Property due to their separation distance and/or their down/cross-gradient orientation with respect to the Phase I Property.

All APECs are outlined on Drawing PE6971-1 – Site Plan, while all PCAs identified within the Phase I Study Area are presented on PE6971-2 – Surrounding Land Use Plan in the Figures section of this report, following the text.

Contaminants of Potential Concern (CPCs)

The contaminants of potential concern for the soil and/or groundwater on the Phase I Property include the following:

- ☐ Petroleum Hydrocarbons, fractions 1 – 4 (PHCs F₁-F₄);
- ☐ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ☐ Volatile Organic Compounds (VOCs) (Soil and/or Groundwater);
- ☐ Polycyclic Aromatic Hydrocarbons (PAHs);
- ☐ Metals (including arsenic (As), antimony (Sb) and selenium (Se));
- ☐ Electrical Conductivity (EC);
- ☐ Sodium Adsorption Ratio (SAR).

These CPCs have the potential to be present in the soil matrix and/or groundwater situated beneath the Phase I Property, with the exception of EC and SAR, which are considered to be situated in the soil matrix only.

7.2 Conceptual Site Model

Geological and Hydrogeological Setting

The Geological Survey of Canada website on the Urban Geology of the National Capital Area was consulted as part of this assessment. Based on the information from NRCAN, bedrock in the area of the site consists of shale of the Carlsbad Formation. Based on the maps, the surficial geology consists of offshore marine sediments with an overburden thickness ranging from 2 to 3m.

Previous subsurface investigations conducted by Fisher Engineering Ltd. at the Phase I Property indicate that the underlying bedrock is shale. The overburden consists of a fill layer of silty sand underlain by glacial till (described as compact

silty sand with gravel, cobbles, and boulders). Fill material was encountered on the Phase I Property, extending to depths between approximately 3.11m and 4.97m bgs. Inferred bedrock depths in the boreholes ranged from 4.60m to 6.20m bgs. Groundwater data collected during the hydrogeological investigation indicates that groundwater on the Phase I Property flows eastward toward the unnamed creek, approximately 30m east of the Phase I Property. Groundwater levels measured on October 7, 2022, ranged from approximately 1.83m to 2.64m bgs.

The topographic maps indicate that the elevation of the Phase I Property is approximately 75m above sea level. The regional topography in the general area of the Phase I Property slopes down in the west/northwest direction towards Rideau River.

Fill Placement

Fill material was identified in previous subsurface investigations. Additionally, several small piles of fill material were observed on the east side of the site, overgrown with vegetation. As a result, fill material of unknown quality is considered a PCA that represents APEC on the entire Phase I Property.

Water Bodies and Areas of Natural Significance

A search for areas of natural significance and features within the Phase I Study Area was conducted on the website of the Ontario Ministry of Natural Resources (MNR) on June 16, 2025. The search did not reveal any areas of natural significance within the Phase I Study Area.

No water bodies are present on the Phase I Property. An unnamed creek is located approximately 30m to the east of the Phase I Property. The Rideau River is situated approximately 520m west of the Phase I Property.

Potable Water Wells

A search of the MECPs website was conducted on April 24, 2025, for all drilled well records within a 250 m radius of the Phase I Property. No potable water well records were identified for the Phase I Property or surrounding properties in the Phase I Study Area.

Monitoring Wells

Two (2) monitoring wells were identified on the Phase I Property, installed as part of the 2022 hydrogeological investigation.

A total of nine well records were identified within a 250m radius of the Phase I Property. Two of these records are associated with monitoring wells installed within the 30m buffer zone to the east along the creek, as part of the previously noted 2022 hydrogeological investigation. Three records pertain to monitoring wells installed between 2011 and 2015, while the remaining four records relate to well abandonments. The nearest monitoring well is located within the 30m buffer zone to the east of the Phase I Property. The remaining monitoring wells are situated approximately 170m southeast of the property and appear to have been installed for geotechnical or environmental investigation purposes.

Based on the available well records, the geological stratigraphy in the area generally consists of topsoil or sand/gravel fill overlying native brown sand. Bedrock was encountered at a depth of 1.5m bgs in one record but was not encountered in the others.

Existing Buildings and Structures

No buildings or structures are currently present on the Phase I Property.

Subsurface Structures and Utilities

The Phase I Property was serviced by a municipal connection for water and sewer. Multiple underground utilities were identified on the Phase I Property associated with former commercial office building, including electrical, natural gas, water, sewer, storm and telecommunication lines. No private wells or septic systems are present on the Phase I Property or considered to be present within 250m of the Phase I Property. No other subsurface structures were identified at the time of the site inspection.

Neighbouring Land Use

Land use within the Phase I Study consists of properties used commercial (mainly office space), institutional and residential purposes with some vacant land. No previously unidentified PCAs were observed during the review of the current use of surrounding properties.

Current land use and PCAs identified in the Phase I Study Area are presented on Drawing PE6971-2 – Surrounding Land Use Plan.

Potentially Contaminating Activities and Areas of Potential Environmental Concern

As previously discussed in Section 7.1, two on-site PCAs are considered to result in two APECs on the Phase I Property. The PCAs, APECs and associated CPCs are summarized in Table 2.

Table 2 - Areas of Potential Environmental Concern					
Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern with respect to Phase I-ESA Property	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 1 Fill Material of Unknown Quality	Across the Phase I Property	<i>"Item 30: Importation of Fill Material of Unknown Quality"</i>	On-site	Metals (including As, Sb, Se), BTEX, PHCs, VOCs, PAHs	Soil and/or Groundwater
APEC 2 ¹ Application of Road Salt	Throughout parking areas on the Phase I Property	<i>"Item NA: Application of road salt for the safety of vehicular or pedestrian traffic under conditions of snow or ice"</i>	On-site	Electrical Conductivity (EC) Sodium Adsorption Ratio (SAR)	Soil
1 – In accordance with Section 49.1 of O. Reg 153/04 standards are deemed to be met if an applicable site condition standard is exceeded at a property solely because the qualified person has determined that a substance has been applied to surfaces for the safety of vehicular or pedestrian traffic under conditions of snow or ice or both. The exception outlined in Section 49.1 is being relied up with respect to the Phase I Property.					

The off-site PCAs (existing or historical) identified within the Phase I Study Area are not considered to result in APECs on the Phase I Property due to their separation distance and/or their down/cross-gradient orientation with respect to the Phase I Property.

As previously discussed in Section 7.1, all APECs are outlined on Drawing PE6971-1 – Site Plan, while all PCAs identified within the Phase I Study Area are presented on PE6971-2 – Surrounding Land Use Plan in the Figures section of this report, following the text.

Contaminants of Potential Concern

As per section 7.1 of this report and Table 2, CPCs in the soil and/or groundwater beneath the Phase I Property include the following:

- ☐ Petroleum Hydrocarbons, fractions 1 – 4 (PHCs F₁-F₄);
- ☐ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ☐ Volatile Organic Compounds (VOCs);
- ☐ Polycyclic Aromatic Hydrocarbons (PAHs);
- ☐ Metals (including arsenic (As), antimony (Sb) and selenium (Se));
- ☐ Electrical Conductivity (EC);
- ☐ Sodium Adsorption Ratio (SAR).

These CPCs have the potential to be present in the soil matrix and/or groundwater situated beneath the Phase I Property, with the exception of EC and SAR, which are considered to be situated in the soil matrix only.

Assessment of Uncertainty and/or Absence of Information

The information available for review as part of the preparation of this Phase I- ESA is considered to be sufficient to conclude that there are on-site PCAs that have resulted in APECs on the Phase I Property. Additional off-site PCAs identified within the Phase I Study Area are not considered to represent APECs on the Phase I Property based on their separation distance and/or down/cross-gradient orientation with respect to the Phase I Property.

A variety of independent sources were consulted as part of this assessment, and as such, the conclusions of this report are not affected by uncertainty which may be present with respect to the individual sources.

8.0 CONCLUSIONS

8.1 Assessment

Paterson Group was retained by TCU Development Corporation, to carry out a Phase I-Environmental Site Assessment (ESA) for 1867 Alta Vista Drive, in the City of Ottawa, Ontario. The purpose of this Phase I-ESA was to research the past and current use of the Phase I Property and 250m Phase I Study Area, and to identify any environmental concerns with the potential to have impacted the Phase I Property.

Based on the available historical information, the Phase I Property was initially developed with a commercial building in the 1970s, which was used as office space. The building was demolished in 2016, and the property has since remained vacant, with parking lot surfaces still present. No environmental concerns were identified in relation to the historical use of the property.

A previous subsurface investigation conducted by another consultant identified the presence of fill material on the Phase I Property. The presence of fill material of unknown quality is considered a Potentially Contaminating Activity (PCA) and results in an Area of Potential Environmental Concern (APEC) on the Phase I property.

Based on the available historical information, adjacent and surrounding properties within the Phase I Study Area have been developed primarily for commercial and residential purposes. The historical PCAs identified in the Phase I Study Area are not considered to represent APECs on the Phase I Property due to their separation distance and/or the down/cross-gradient orientation with respect to the Phase I Property.

Following the historical research, a site visit was conducted. The Phase I Property is currently vacant land featuring two asphaltic concrete parking areas, which are remnants of a former commercial office building. No environmental concerns were identified in relation to the current use of the property.

Land use within the Phase I Study consists of properties used commercial (mainly office space), institutional and residential purposes with some vacant land. No previously unidentified PCAs were observed during the review of the current use of surrounding properties.

8.2 Recommendations

Based on the findings of the Phase I ESA, it is **our opinion that a Phase II-Environmental Site Assessment is required for the Phase I Property.**

9.0 STATEMENT OF LIMITATIONS

This Phase I - Environmental Site Assessment report has been prepared in general accordance with O.Reg. 153/04, as amended, and meets the requirements of CSA Z768-01 (reaffirmed 2022). The conclusions presented herein are based on information gathered from a limited historical review and field inspection program. The findings of the Phase I - ESA are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as, local, provincial and federal agencies and was limited within the scope-of-work, time and budget of the project herein.

Should any conditions be encountered at the Phase I property and/or historical information that differ from our findings, we request that we be notified immediately in order to allow for a reassessment.

This report was prepared for the sole use of TCU Development Corporation. Permission and notification from TCU Development Corporation and Paterson will be required to release this report to any other party.

Paterson Group Inc.



Kuldeep Panchal, M.Eng.



Mark D'Arcy, P.Eng, Q.P.ESA



Report Distribution:

- ☐ TCU Development Corporation
- ☐ Paterson Group

10.0 REFERENCES

Federal Records

Air photos at the Energy Mines and Resources Air Photo Library.
National Archives.
Maps and photographs (Geological Survey of Canada surficial and subsurface mapping).
Natural Resources Canada – The Atlas of Canada.
Environment Canada, National Pollutant Release Inventory.
PCB Waste Storage Site Inventory.

Provincial Records

MECP Municipal Coal Gasification Plant Site Inventory, 1991.
MECP document titled “Waste Disposal Site Inventory in Ontario”.
MECP Brownfields Environmental Site Registry.
MNR Areas of Natural Significance.
MECP Water Well Record Inventory.
Maps and photographs (Geological Survey of Ontario surficial and subsurface mapping).
Chapman, L.J., and Putnam, D.F., 1984: ‘The Physiography of Southern Ontario, Third Edition’, Ontario Geological Survey Special Volume 2.

Municipal Records

geoOttawa: City of Ottawa electronic mapping website.
City of Ottawa Historical Land Use Inventory (HLUI) Database.

Local Information Sources

Personal Interviews
Previous Engineering Reports
Environmental Risk Information Services (ERIS) Report, June 16, 2025

Public Information Sources

Google Earth.
Google Maps/Street View.

FIGURES

FIGURE 1 – KEY PLAN

FIGURE 2 – TOPOGRAPHIC MAP

DRAWING PE6971-1 – SITE PLAN

DRAWING PE6971-2 – SURROUNDING LAND USE PLAN


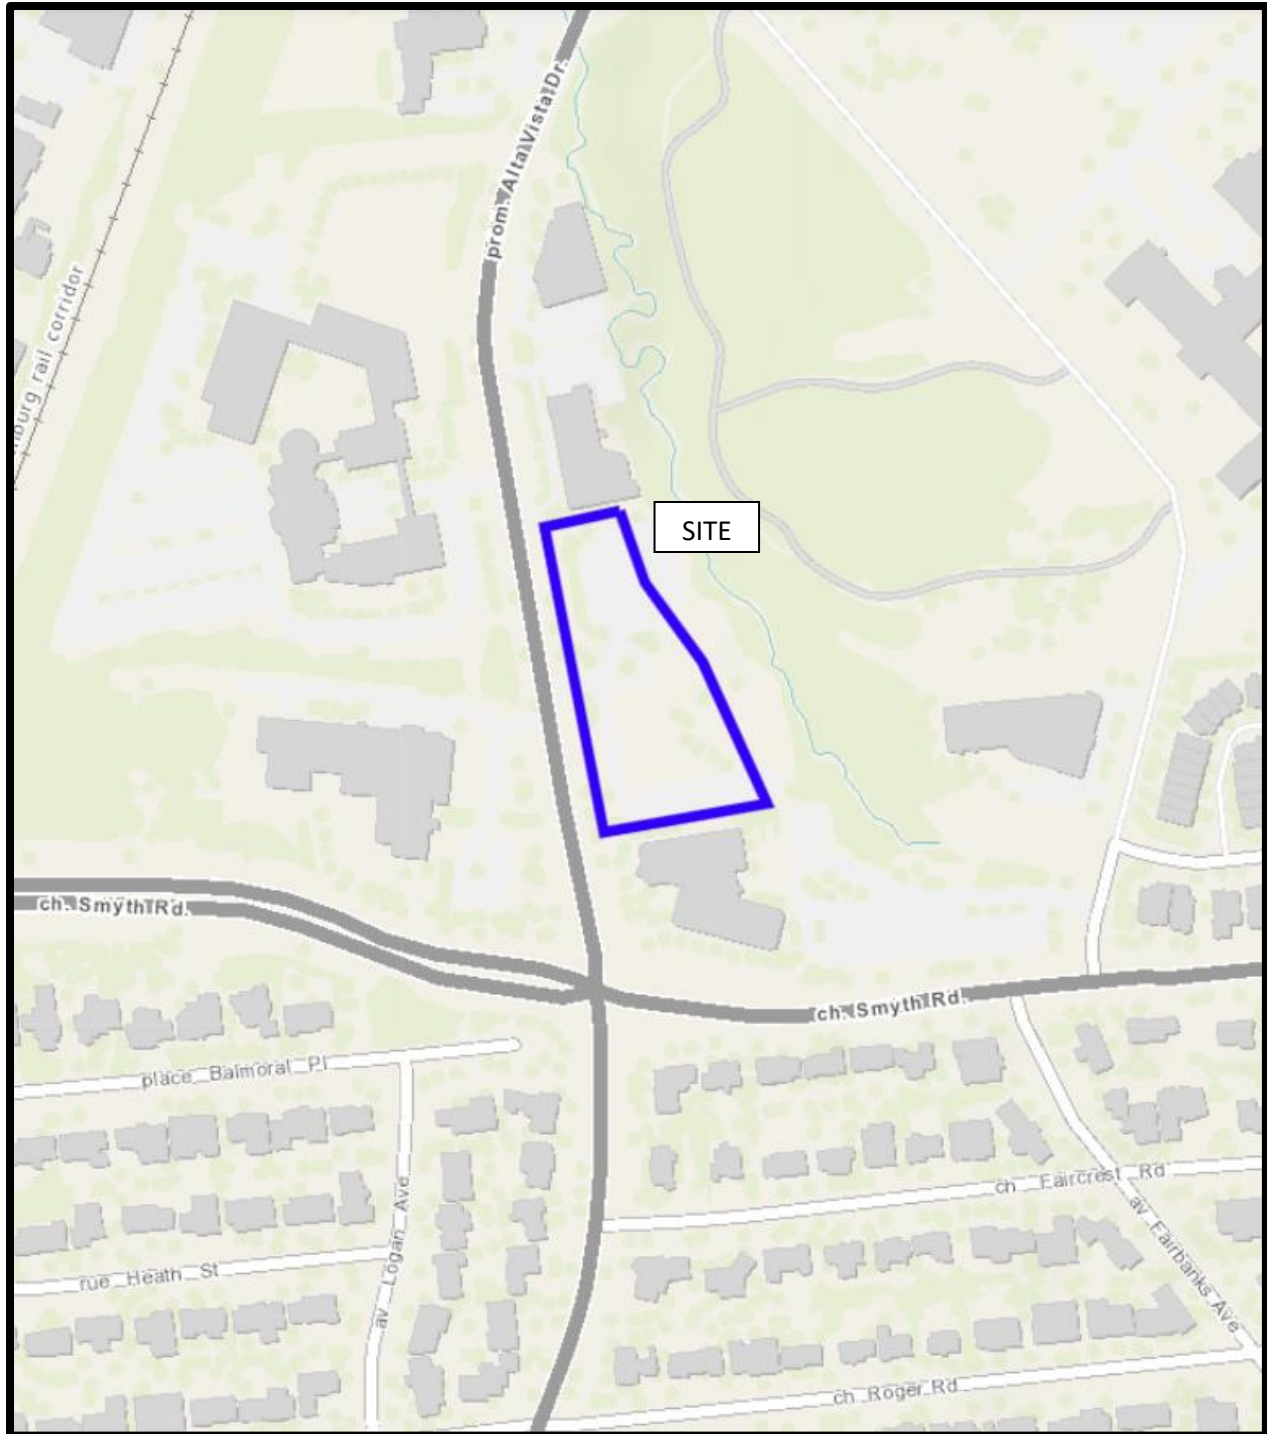


FIGURE 1
KEY PLAN

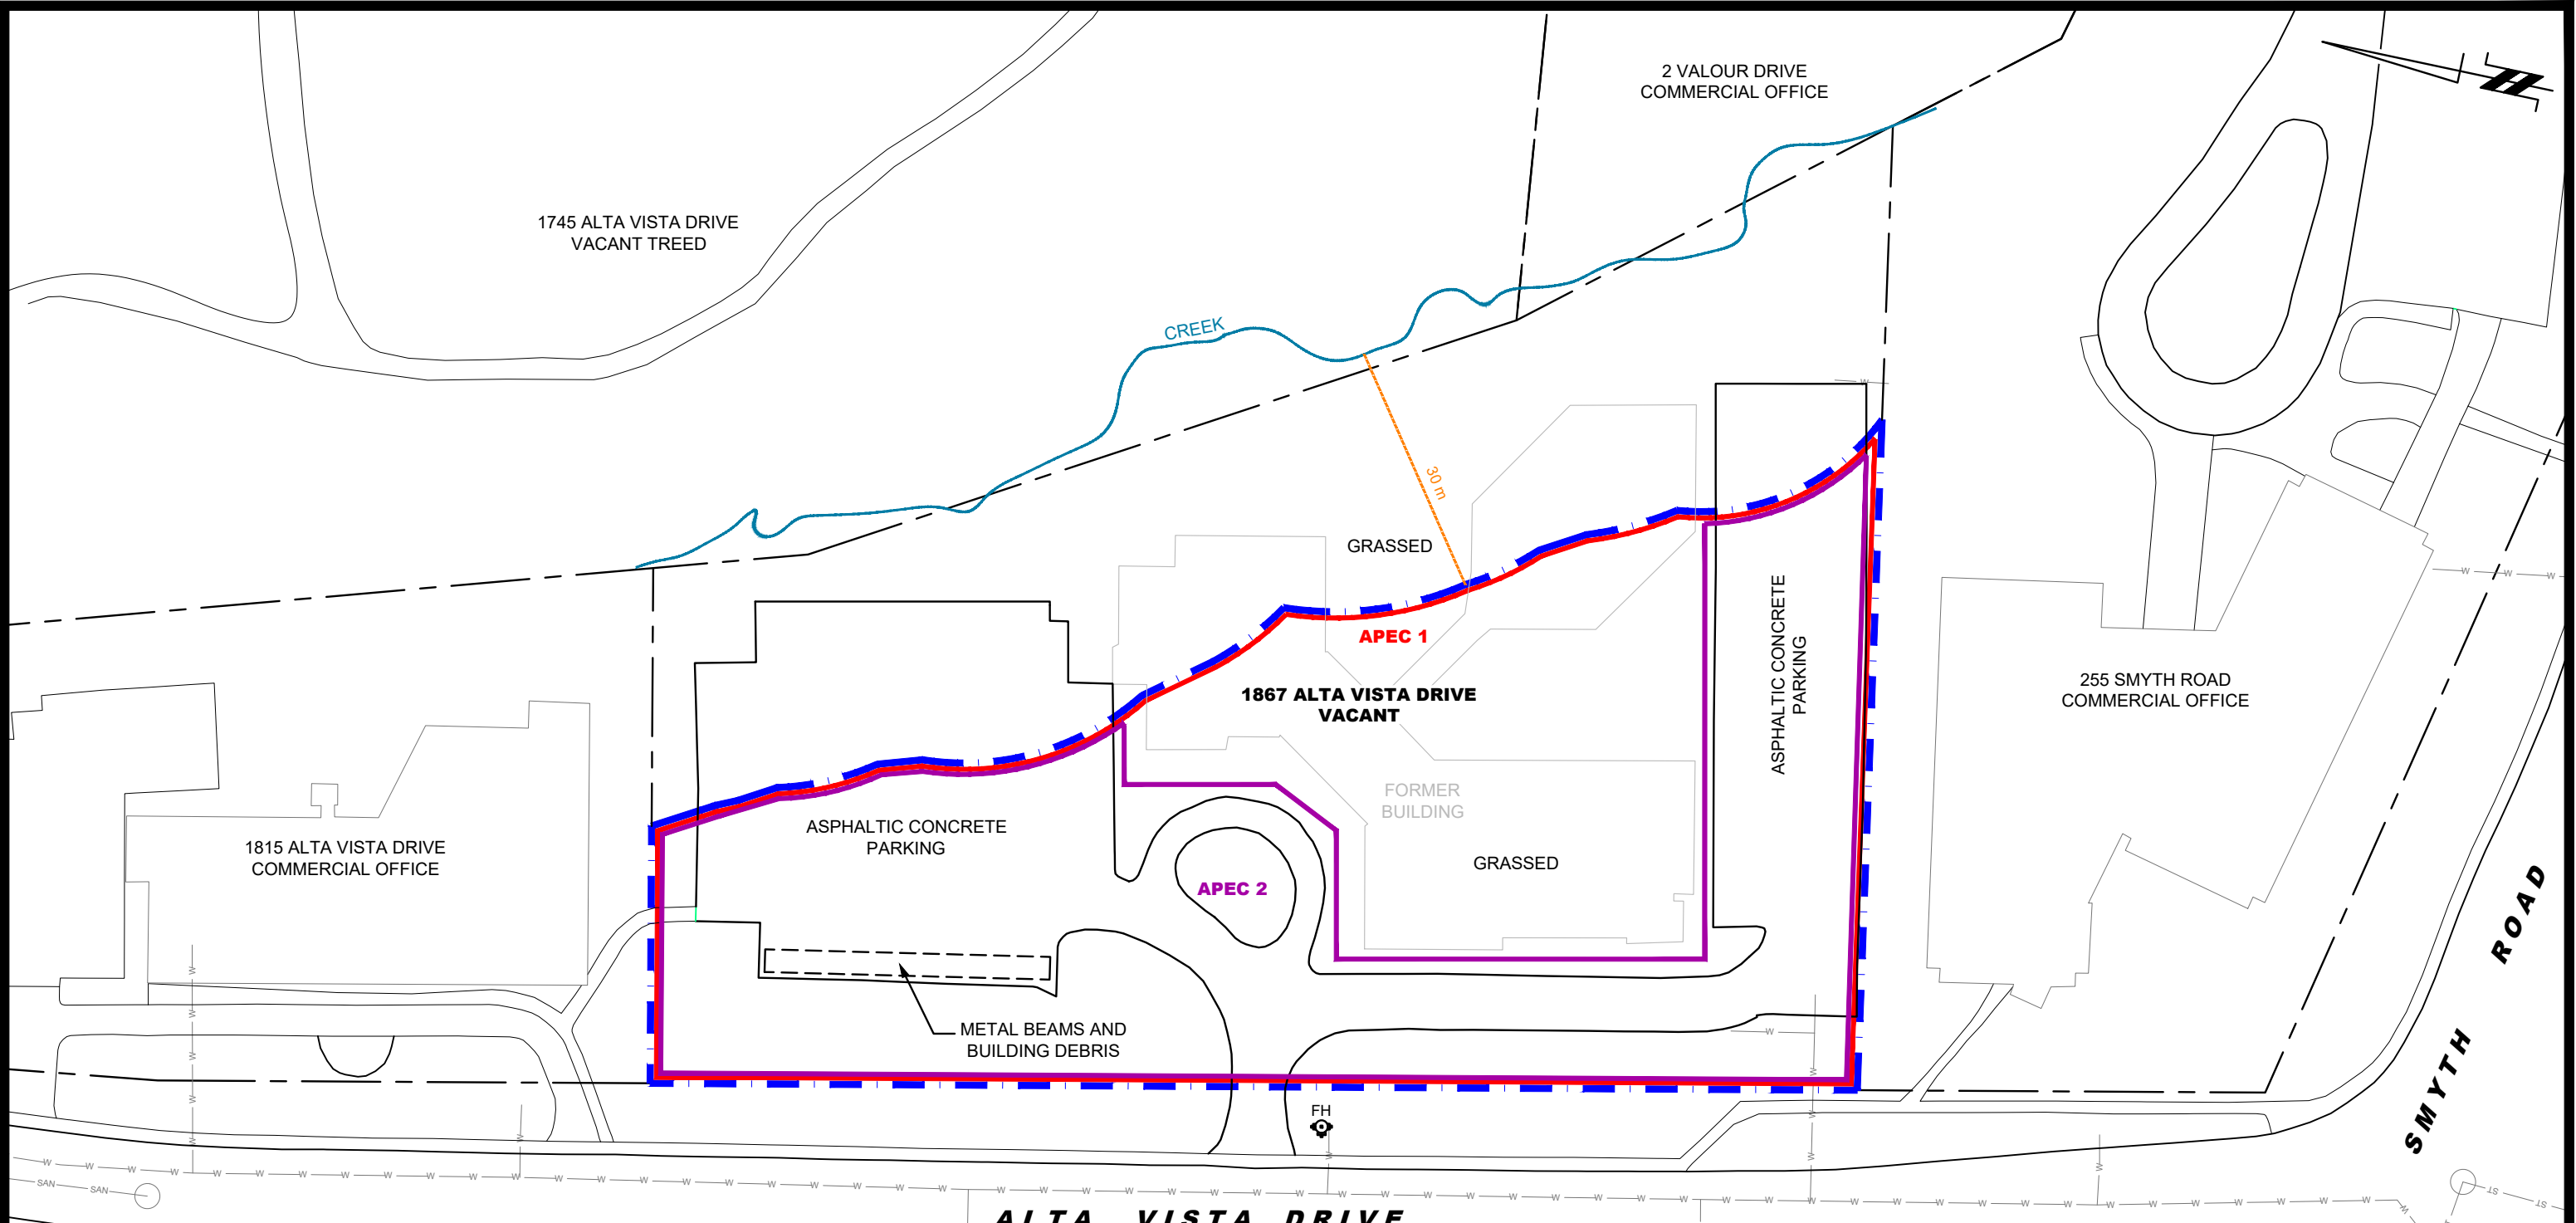

AREAS OF POTENTIAL ENVIRONMENTAL CONCERN :

ID #	PCA ID	DESCRIPTION
1	30	FILL MATERIAL OF UNKNOWN QUALITY
2	n/a	APPLICATION OF ROAD SALT

LEGEND:

— — — — — PHASE I, II PROPERTY BOUNDARY

SCALE: 1:750

PATERSON GROUP

9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL

TCU DEVELOPMENT CORPORATION


PHASE I - ENVIRONMENTAL SITE ASSESSMENT

1867 ALTA VISTA DRIVE

OTTAWA, ONTARIO

Title: **SITE PLAN**

Scale:	1:750	Date:	04/2025
Drawn by:	GK	Report No.:	PE6971-1
Checked by:	KMP	Dwg. No.:	PE6971-1
Approved by:	MSD	Revision No.:	

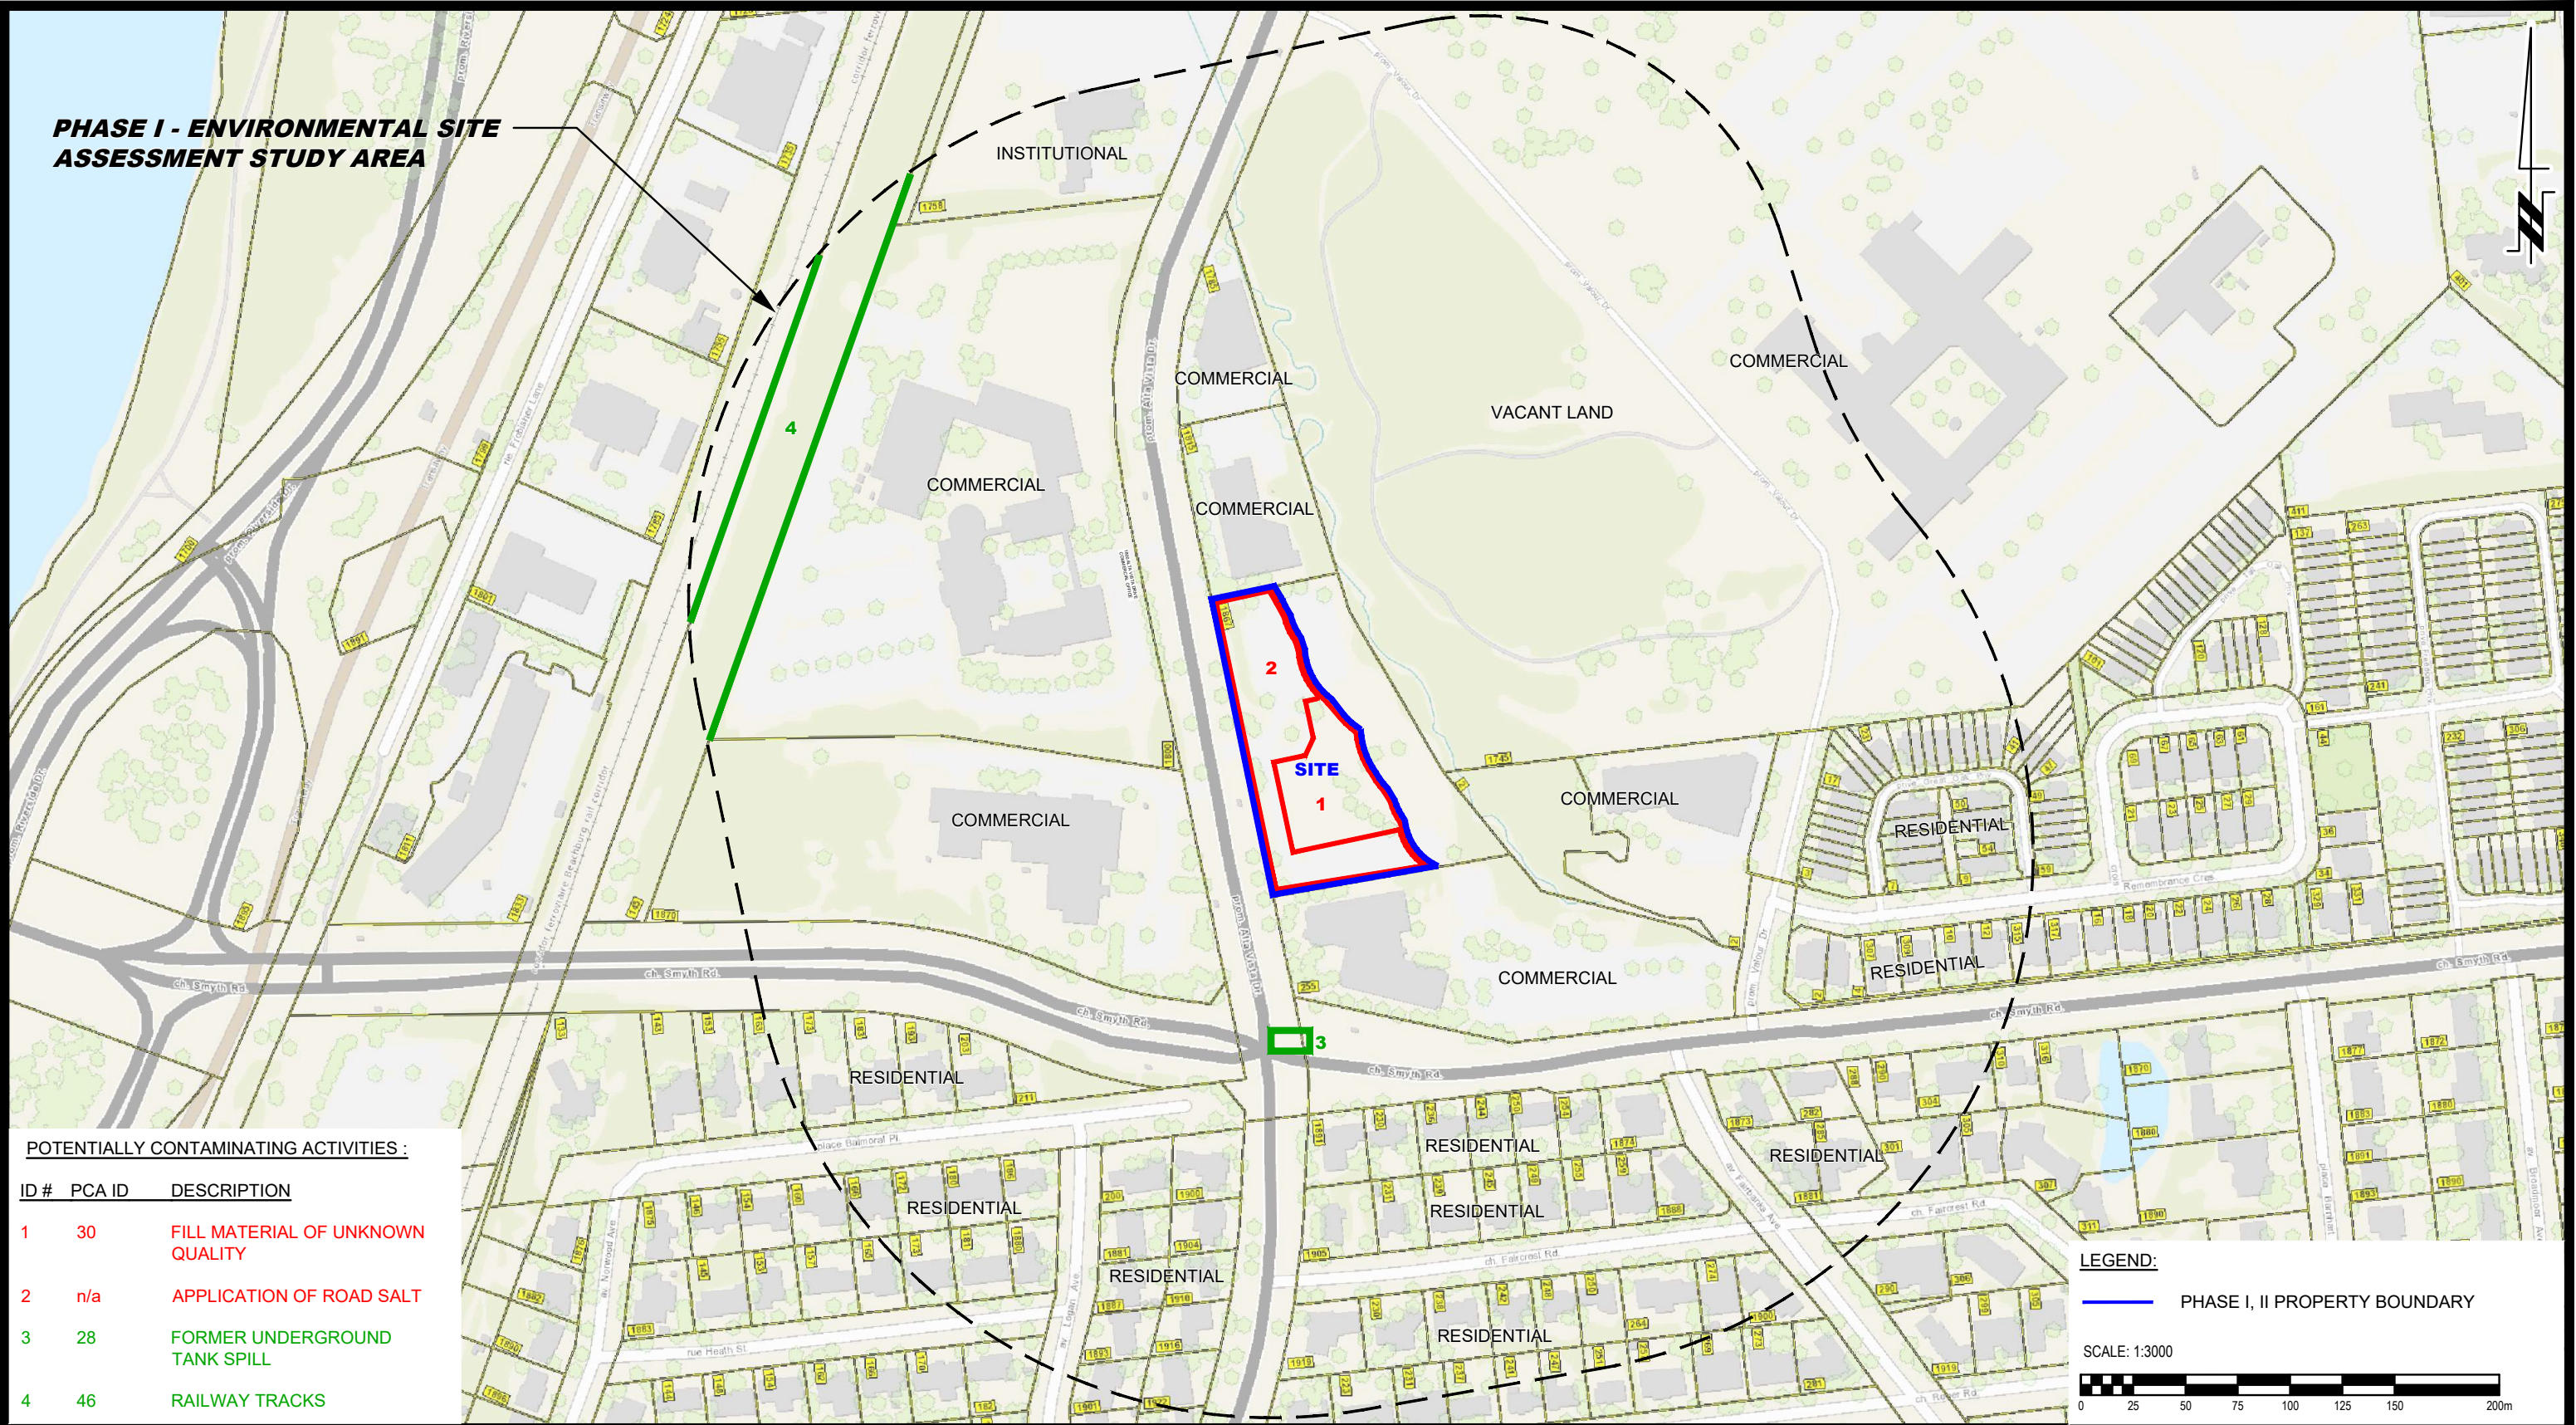

PHASE I - ENVIRONMENTAL SITE ASSESSMENT STUDY AREA

POTENTIALLY CONTAMINATING ACTIVITIES :

ID #	PCA ID	DESCRIPTION
1	30	FILL MATERIAL OF UNKNOWN QUALITY
2	n/a	APPLICATION OF ROAD SALT
3	28	FORMER UNDERGROUND TANK SPILL
4	46	RAILWAY TRACKS

LEGEND:

— PHASE I, II PROPERTY BOUNDARY

SCALE: 1:3000

0 25 50 75 100 125 150 200m



PATERSON GROUP

9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL

TCU DEVELOPMENT CORPORATION

PHASE I - ENVIRONMENTAL SITE ASSESSMENT

1867 ALTA VISTA DRIVE

OTTAWA, ONTARIO

Title: **SURROUNDING LAND USE PLAN**

Scale:	1:3000	Date:	04/2025
Drawn by:	GK	Report No.:	PE6971-1
Checked by:	KMP	Dwg. No.:	PE6971-2
Approved by:	MSD	Revision No.:	

APPENDIX 1

PLAN OF SURVEY

AERIAL PHOTOGRAPHS

SITE PHOTOGRAPHS

ELEVATION NOTES

1. Elevations shown are geodetic and are referred to the CGVD28 geodetic datum derived from City of Ottawa benchmark No. 3641 having an elevation of 68.78 metres.
2. It is the responsibility of the user of this information to verify that the job benchmark has not been altered or disturbed and that it's relative elevation and description agrees with the information shown on this drawing.

- ### Utility Notes
1. This drawing cannot be accepted as acknowledging all of the utilities and it will be the responsibility of the user to contact the respective utility authorities for confirmation.
 2. Only visible surface utilities were located.
 3. Underground utility data derived from City of Ottawa utility sheet reference : Drawings: H-16-05, H-16-11 and Plan No. 3069 (Sheets 3 & 4 of 13)
 4. A field location of underground plant by the pertinent utility authority is mandatory before any work involving breaking ground, probing, excavating etc.

1. This drawing cannot be accepted as acknowledging all of the utilities and it will be the responsibility of the user to contact the respective utility authorities for confirmation.
2. Only visible surface utilities were located.
3. Underground utility data derived from City of Ottawa utility sheet reference: Drawings: H-16-05, H-16-66, H-16-11 and Plan No. 3069 (Sheets 3 & 4 of 13)
4. A field location of underground plant by the pertinent utility authority is mandatory before any work involving breaking ground, probing, excavating etc.

107

JUN 6

90

A diagram showing a horizontal line with a hatched area below it. A point on the line is labeled 'x' and '10-11'. To the right of the line, there is a label 'Building' and a small 'x'.

2 800 000 000

5 5

6 5

7 5

8 5

9 5

10 5

11 5

12 5

13 5

14 5

15 5

16 5

17 5

18 5

19 5

20 5

21 5

22 5

23 5

24 5

25 5

26 5

27 5

28 5

29 5

30 5

31 5

32 5

33 5

34 5

35 5

36 5

37 5

38 5

39 5

40 5

41 5

42 5

43 5

44 5

45 5

46 5

47 5

48 5

49 5

50 5

51 5

52 5

53 5

54 5

55 5

56 5

57 5

58 5

59 5

60 5

61 5

62 5

63 5

64 5

65 5

66 5

67 5

68 5

69 5

70 5

71 5

72 5

73 5

74 5

75 5

76 5

77 5

78 5

79 5

80 5

81 5

82 5

83 5

84 5

85 5

86 5

87 5

88 5

89 5

90 5

91 5

92 5

93 5

94 5

95 5

96 5

97 5

98 5

99 5

100 5

101 5

102 5

103 5

104 5

105 5

106 5

107 5

108 5

109 5

110 5

111 5

112 5

113 5

114 5

115 5

116 5

117 5

118 5

119 5

120 5

121 5

122 5

123 5

124 5

125 5

126 5

127 5

128 5

129 5

130 5

131 5

132 5

133 5

134 5

135 5

136 5

137 5

138 5

139 5

140 5

141 5

142 5

143 5

144 5

145 5

146 5

147 5

148 5

149 5

150 5

151 5

152 5

153 5

154 5

155 5

156 5

157 5

158 5

159 5

160 5

161 5

162 5

163 5

164 5

165 5

166 5

167 5

168 5

169 5

170 5

171 5

172 5

173 5

174 5

175 5

176 5

177 5

178 5

179 5

180 5

181 5

182 5

183 5

184 5

185 5

186 5

187 5

188 5

189 5

190 5

191 5

192 5

193 5

194 5

195 5

196 5

197 5

198 5

199 5

200 5

201 5

202 5

203 5

204 5

205 5

206 5

207 5

208 5

209 5

210 5

211 5

212 5

213 5

214 5

215 5

216 5

217 5

218 5

219 5

220 5

221 5

222 5

223 5

224 5

225 5

226 5

227 5

228 5

229 5

230 5

231 5

232 5

233 5

234 5

235 5

236 5

237 5

238 5

239 5

240 5

241 5

242 5

243 5

244 5

245 5

246 5

247 5

248 5

249 5

250 5

251 5

252 5

253 5

254 5

255 5

256 5

257 5

258 5

259 5

260 5

261 5

262 5

263 5

264 5

265 5

266 5

267 5

268 5

269 5

270 5

271 5

272 5

273 5

274 5

275 5

276 5

277 5

278 5

279 5

280 5

281 5

282 5

283 5

284 5

285 5

286 5

287 5

288 5

289 5

290 5

291 5

292 5

293 5

294 5

295 5

296 5

297 5

298 5

299 5

300 5

301 5

302 5

303 5

304 5

305 5

306 5

307 5

308 5

309 5

310 5

311 5

312 5

313 5

314 5

315 5

316 5

317 5

318 5

319 5

320 5

321 5

322 5

323 5

324 5

325 5

326 5

327 5

328 5

329 5

330 5

331 5

332 5

333 5

334 5

335 5

336 5

337 5

338 5

339 5

340 5

341 5

342 5

343 5

344 5

345 5

346 5

347 5

348 5

349 5

350 5

351 5

352 5

353 5

354 5

355 5

356 5

357 5

358 5

359 5

360 5

361 5

362 5

363 5

364 5

365 5

366 5

367 5

368 5

369 5

370 5

371 5

372 5

373 5

374 5

375 5

376 5

377 5

378 5

379 5

380 5

381 5

382 5

383 5

384 5

385 5

386 5

387 5

388 5

389 5

390 5

391 5

392 5

393 5

394 5

395 5

396 5

397 5

398 5

399 5

400 5

401 5

402 5

403 5

404 5

405 5

406 5

407 5

408 5

409 5

410 5

411 5

412 5

413 5

414 5

415 5

416 5

417 5

418 5

419 5

420 5

421 5

422 5</


12.16
12.16
12.16


 44-5
 175-70.5
 175-70.5
 175-70.5

20.6

referred to the COVID-19 pandemic status derived from the information provided by the local health department. The information is provided for informational purposes only and is not intended to be used for any other purpose. The information is provided as a service to the public and is not intended to be used for any other purpose. The information is provided as a service to the public and is not intended to be used for any other purpose.

© Annis, O'Sullivan, Vollebek & Lts. 2011. THIS PLAN IS PROTECTED BY COPYRIGHT

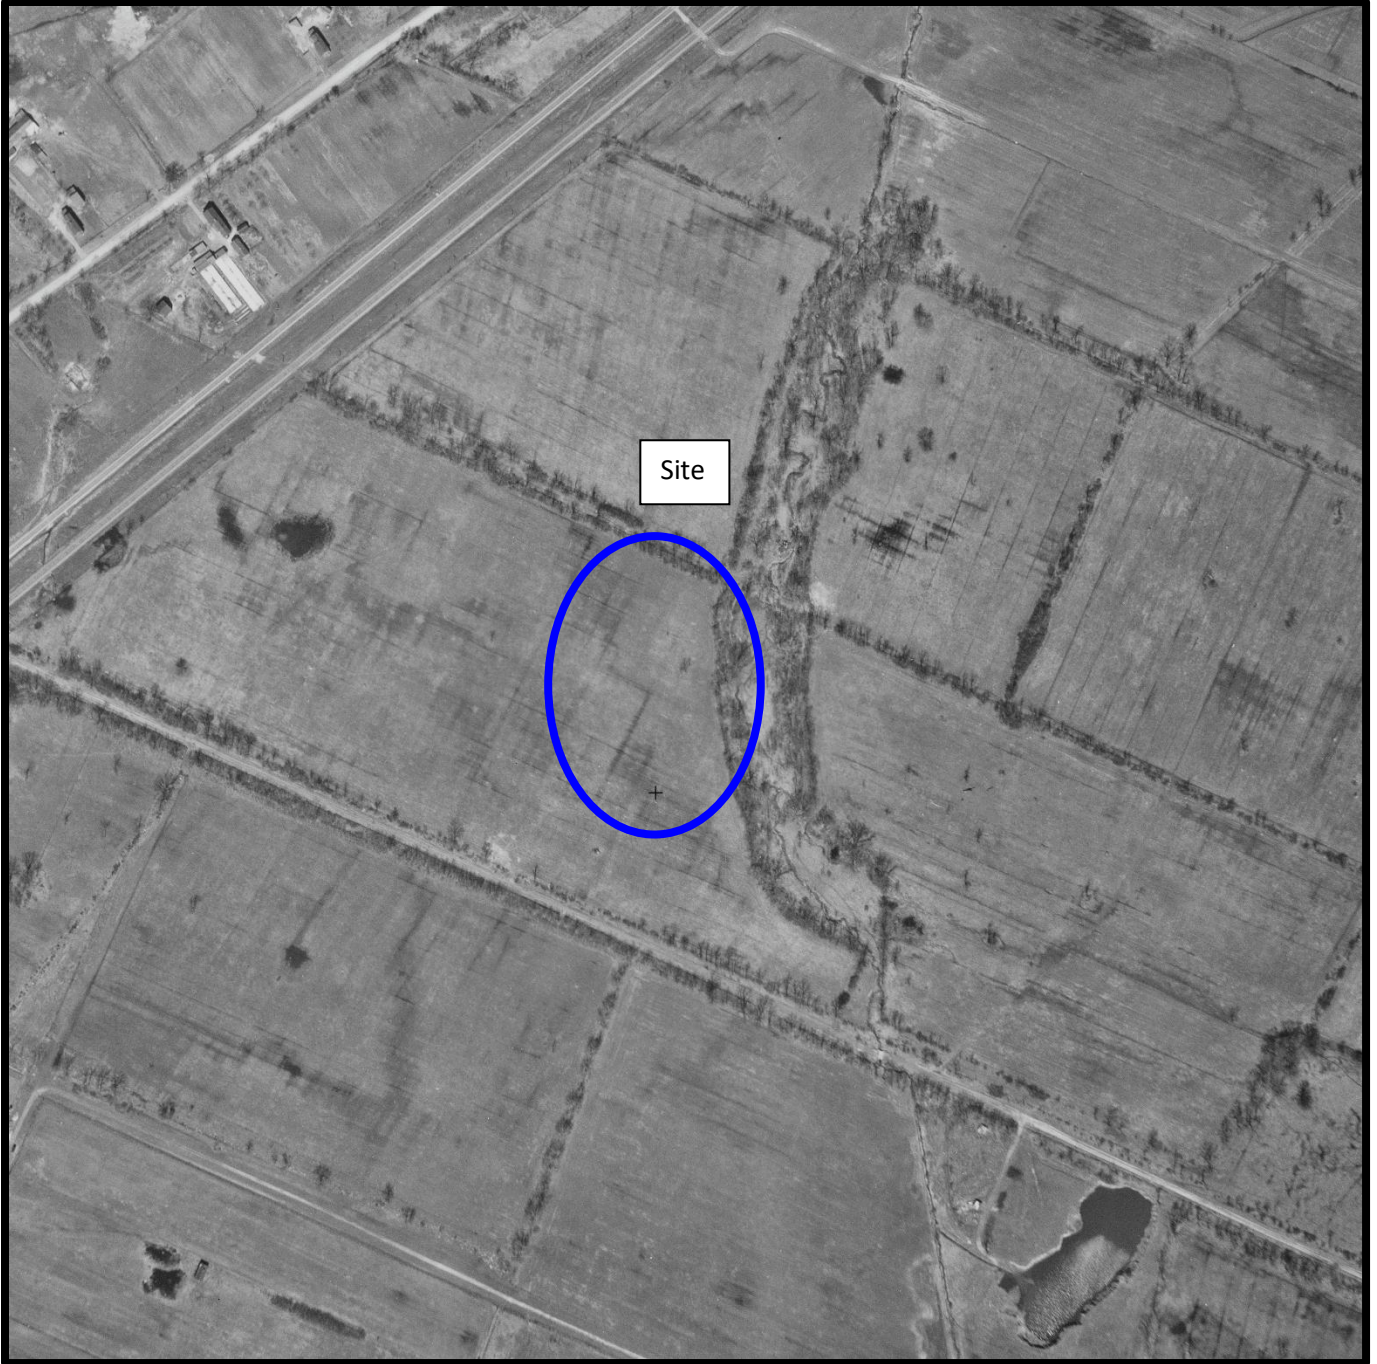

AERIAL PHOTOGRAPH
1933




AERIAL PHOTOGRAPH
1945




AERIAL PHOTOGRAPH
1958




AERIAL PHOTOGRAPH
1965

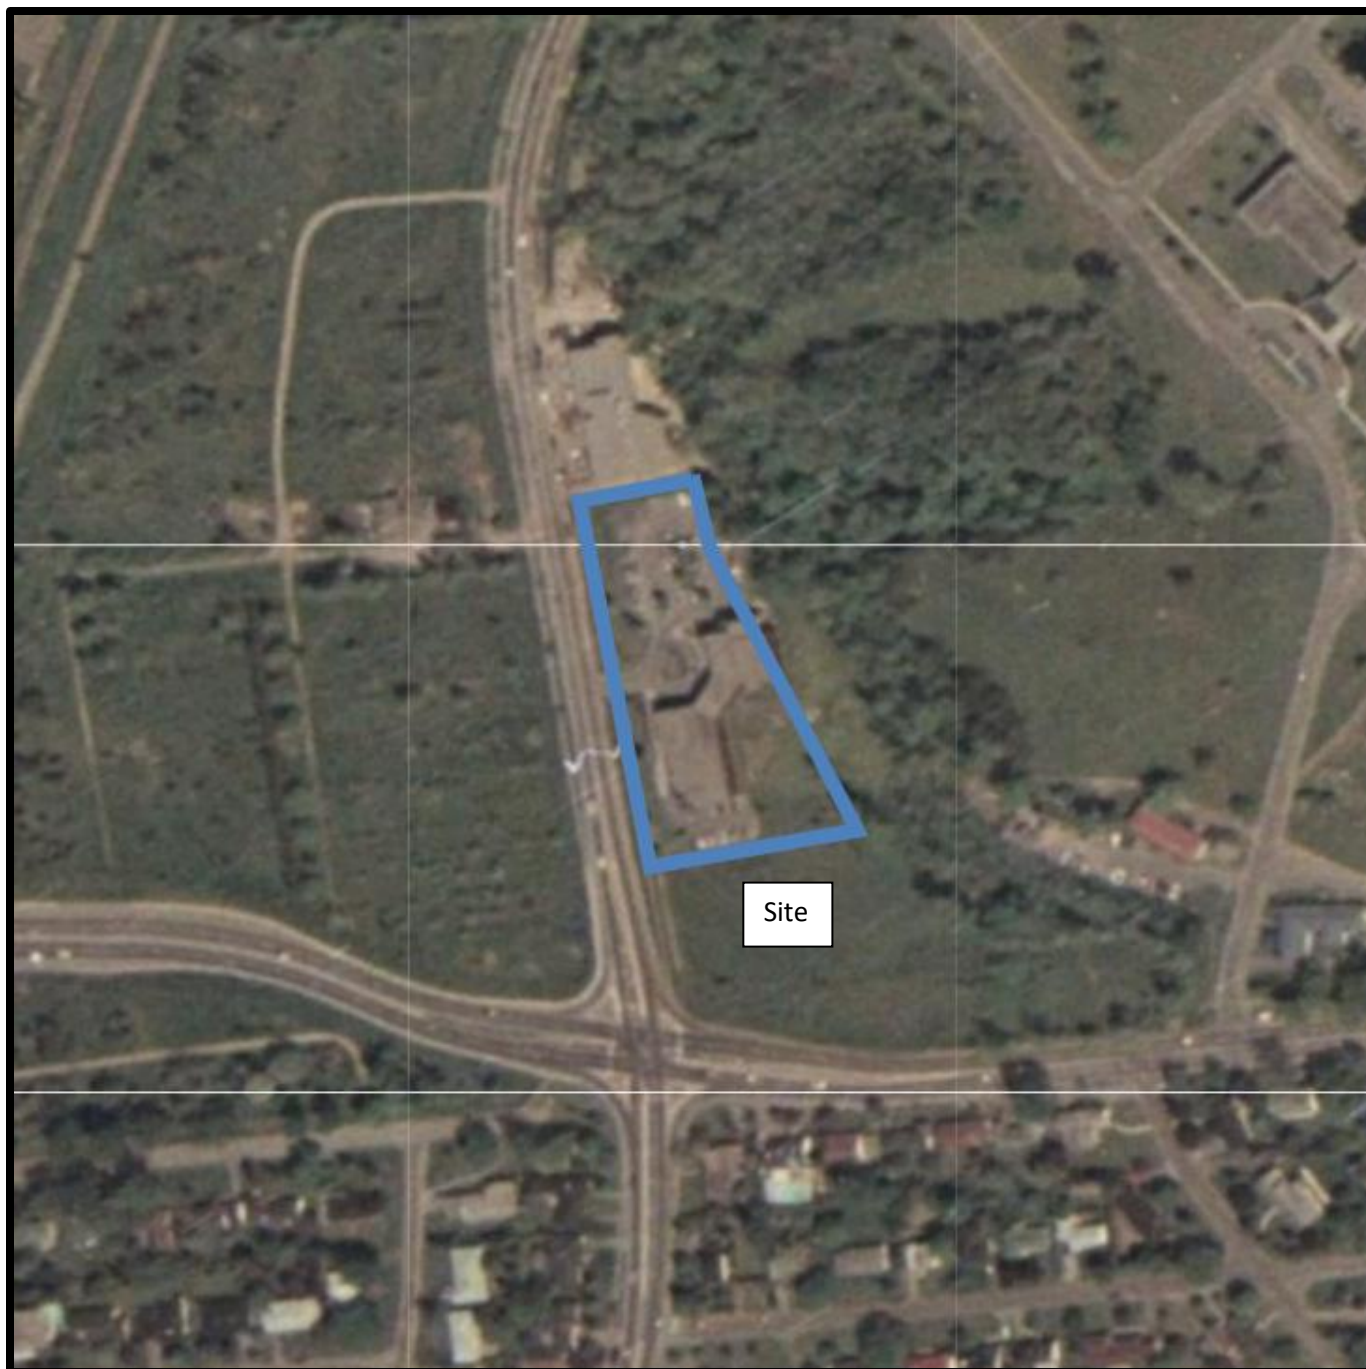

AERIAL PHOTOGRAPH
1976

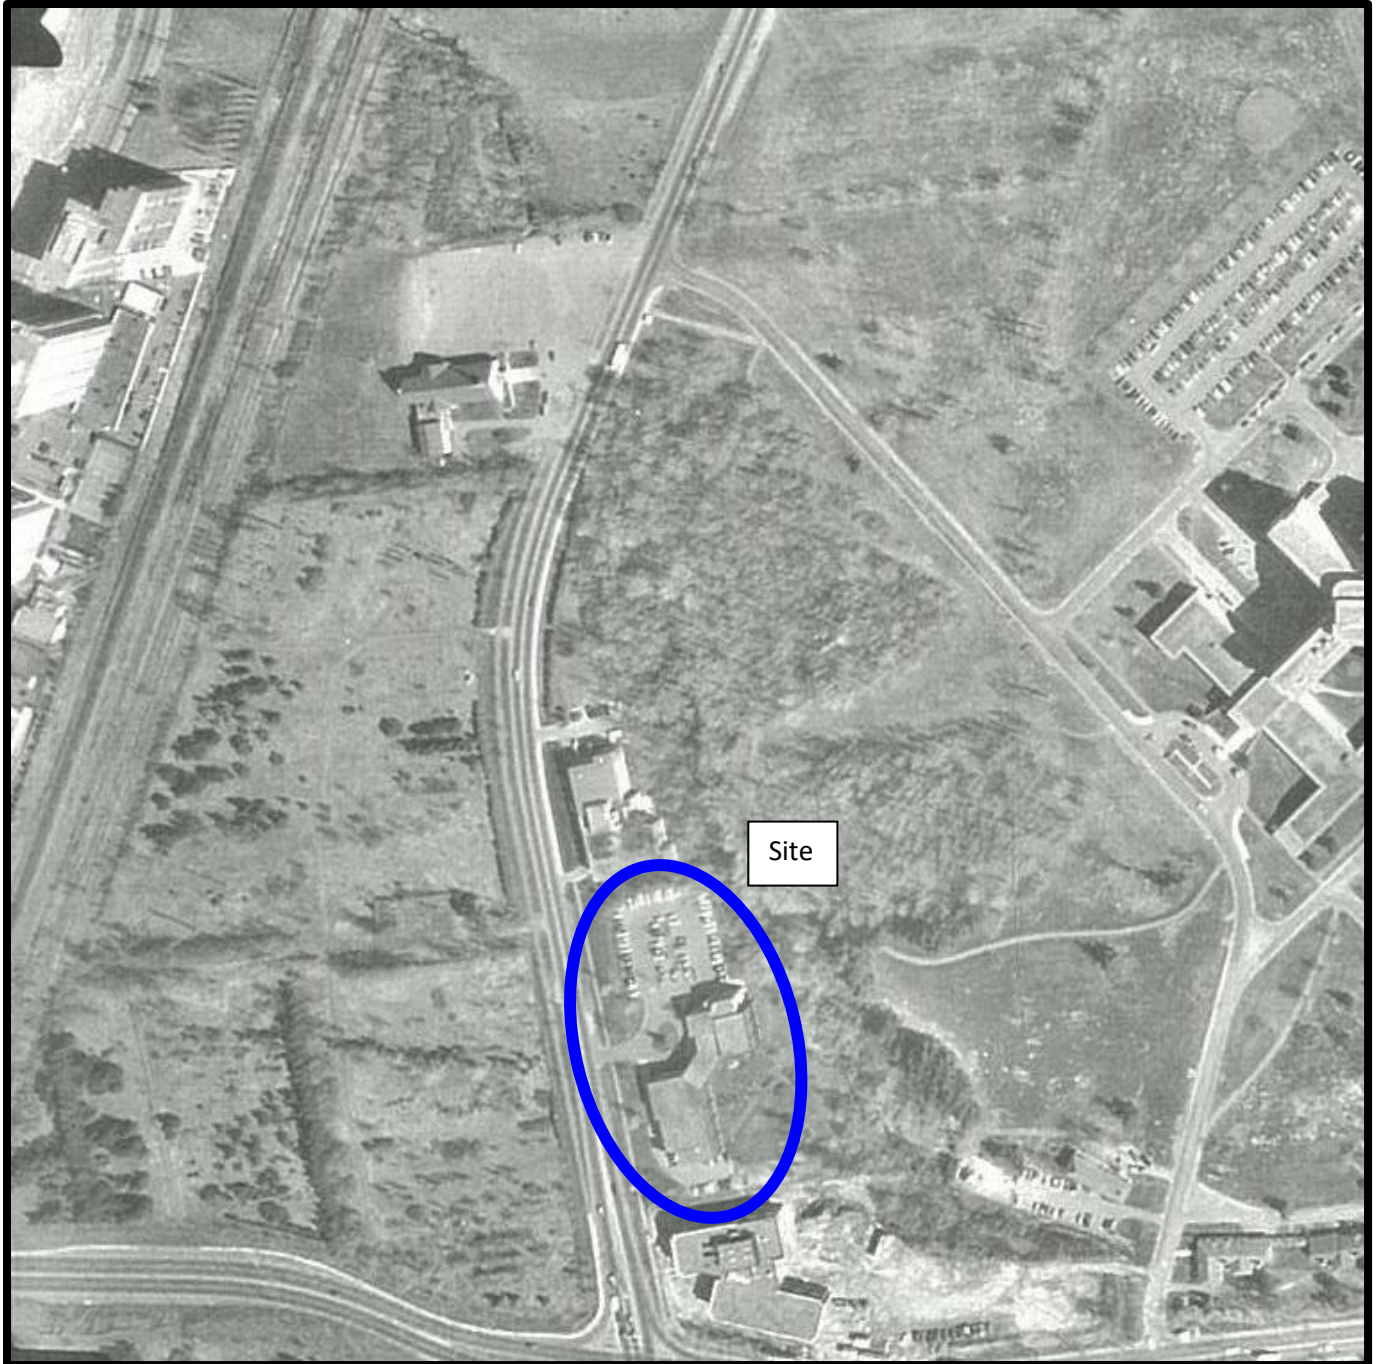

AERIAL PHOTOGRAPH
1985

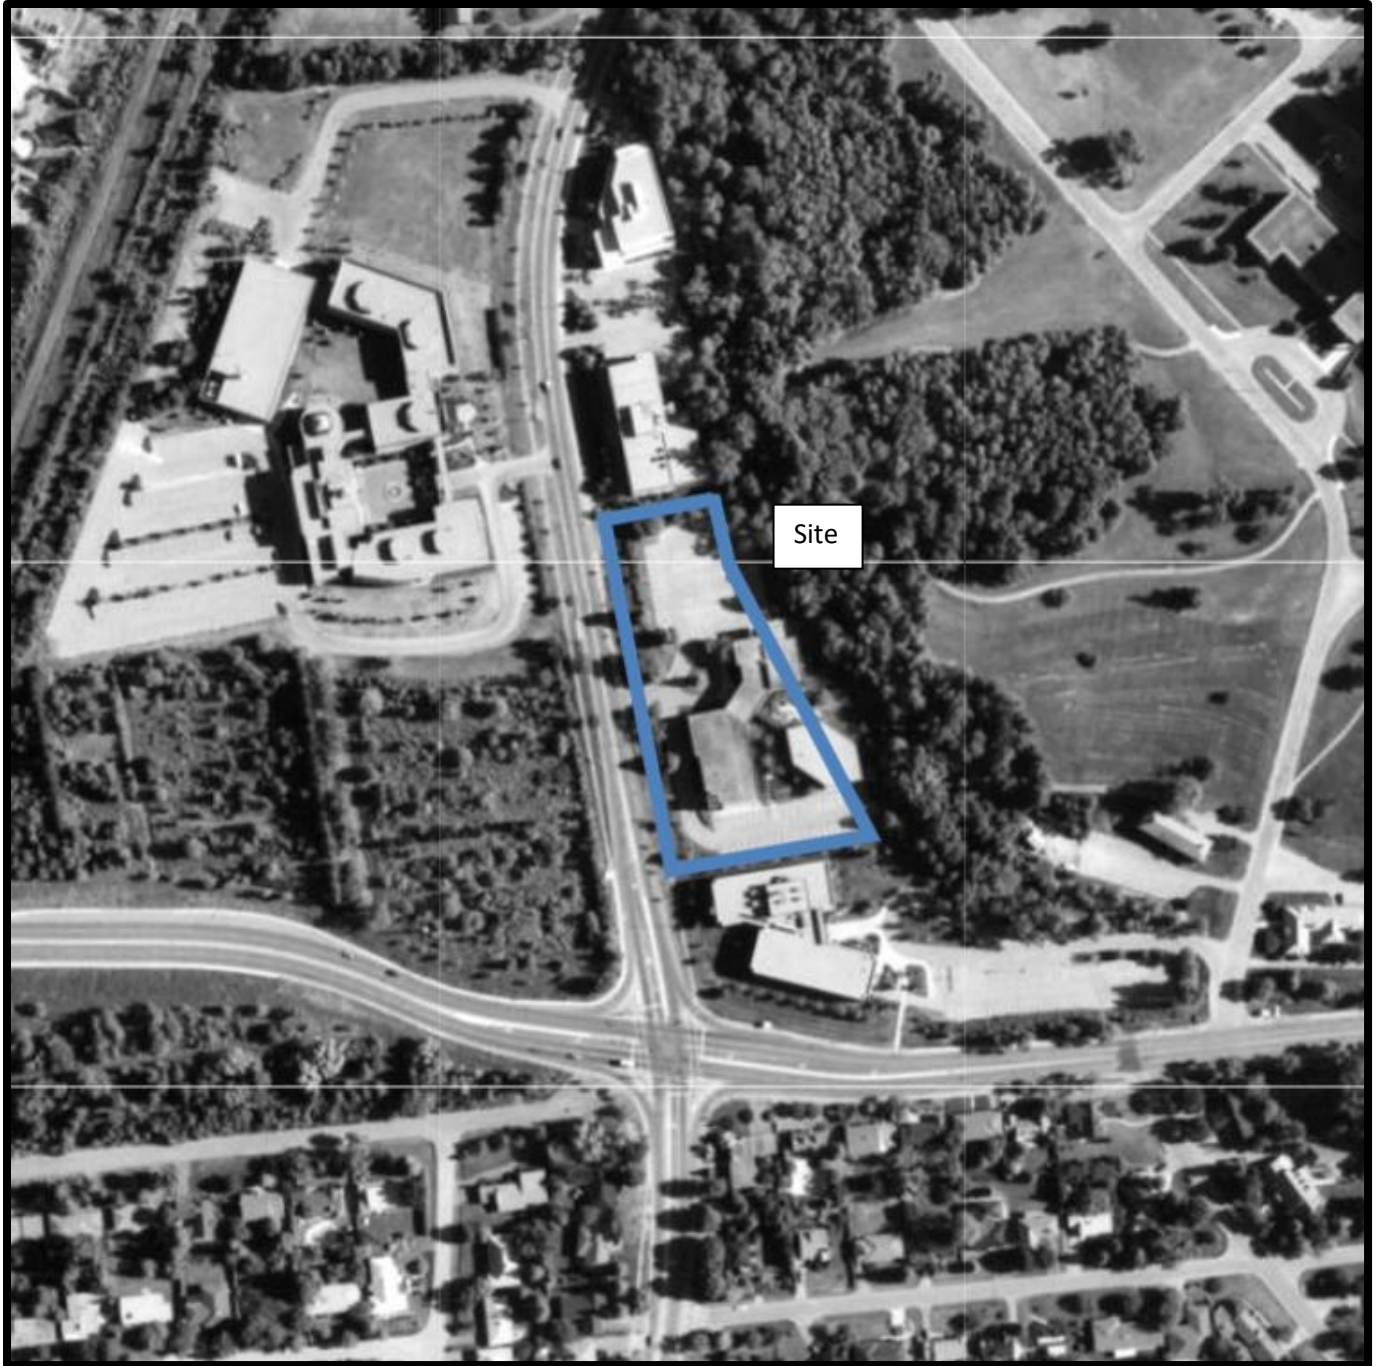


AERIAL PHOTOGRAPH
1991



AERIAL PHOTOGRAPH
2002



AERIAL PHOTOGRAPH
2011

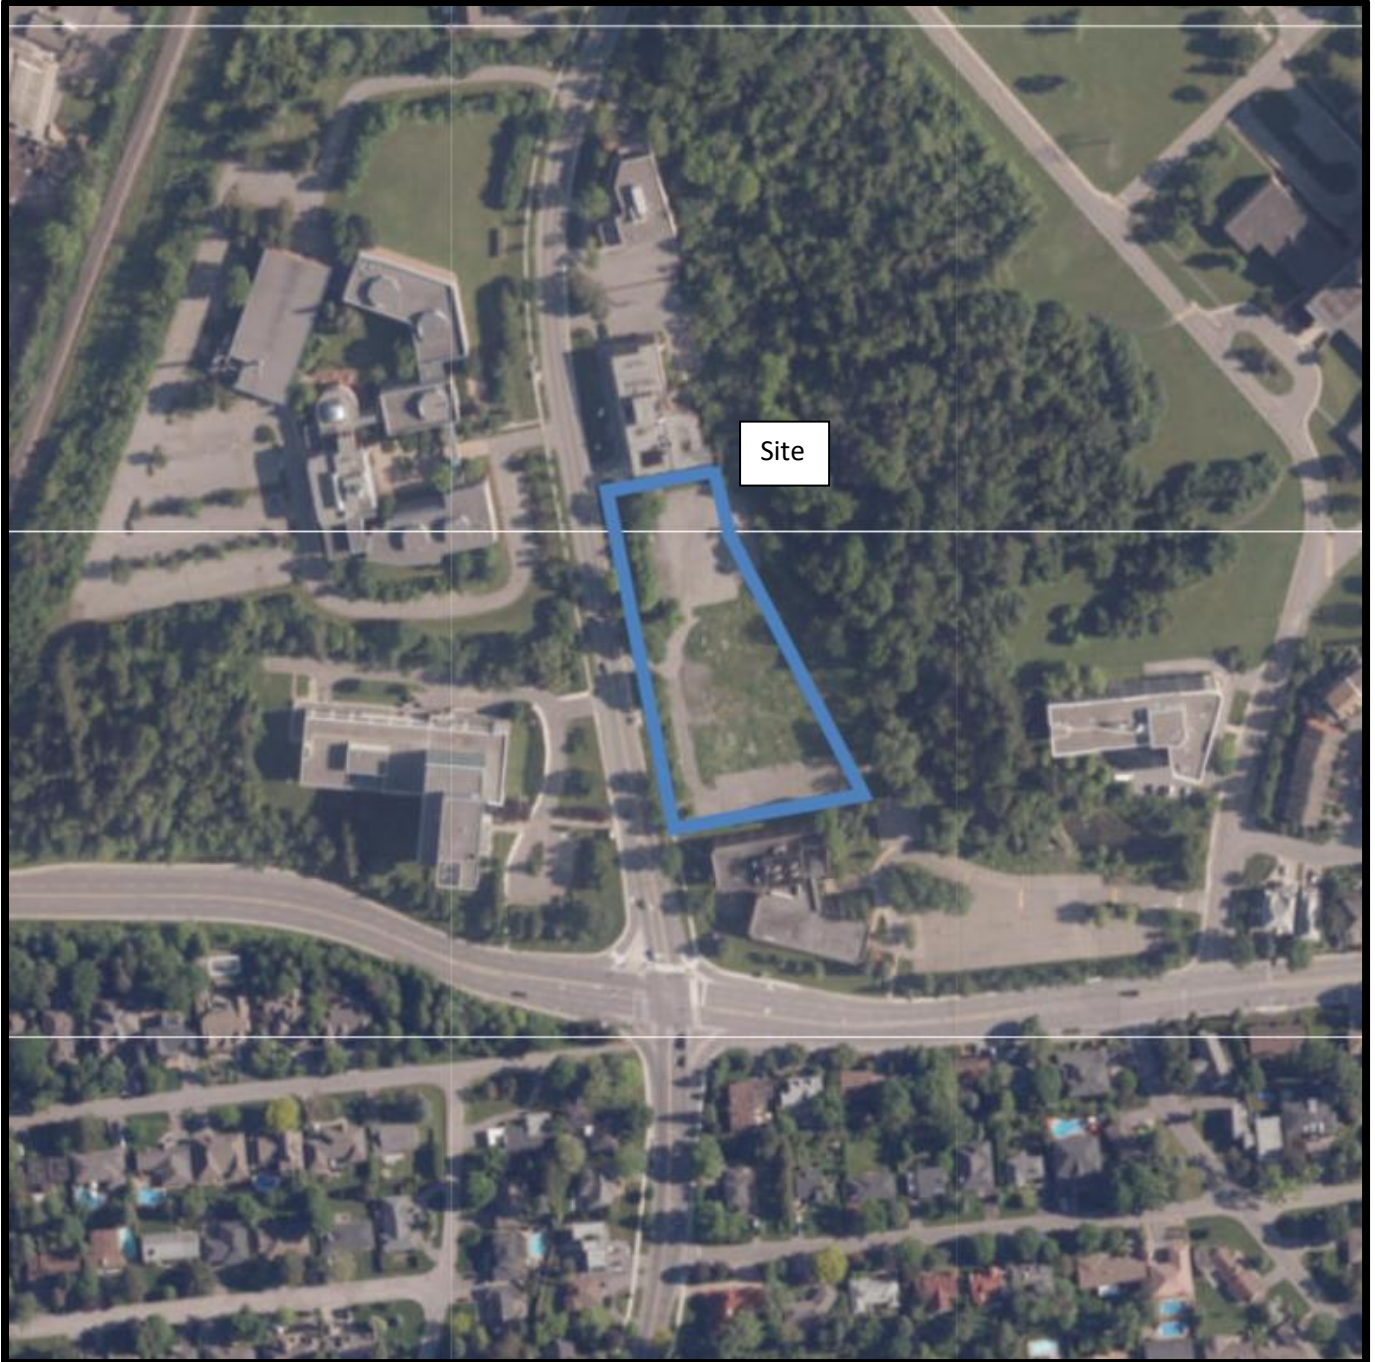

AERIAL PHOTOGRAPH
2022

Site Photographs

PE6971

1867 Alta Vista Drive, Ottawa ON

November 22, 2025



Photograph 1: View of the southern portion of the Phase I Property, facing east.



Photograph 2: View of the central portion of the Phase I Property, facing north.

Site Photographs

PE6971

1867 Alta Vista Drive, Ottawa ON

November 22, 2025



Photograph 3: View of the northern portion of the Phase I Property, facing north.



Photograph 4: View of central portion of the Phase I Property, facing west.

APPENDIX 2

MECP FREEDOM OF INFORMATION

MECP WELL RECORDS

TSSA CORRESPONDENCE

CITY OF OTTAWA HLUI

ERIS REPORT



January 10, 2025

Mr. Mark Bujaki
Paterson Group
9 Auriga Drive
Ottawa, Ontario K2E 7T9
mbujaki@patersongroup.ca

Dear Mark Bujaki:

RE: MECP FOI A-2024-08026, Your Reference #: PE6830 – Record Release Letter

This letter is further to your request made pursuant to the Freedom of Information and Protection of Privacy Act (the Act) relating to:

1867 Alta Vista Drive, Ottawa
Timeframe: January 1st, 1900 to December 10th, 2024

Your final fee payment was received by this office. If payment was not in Canadian dollars, please contact our office immediately.

Attached is a copy of the records.

You may request a review of my decision within 30 days from the date of this letter by contacting the Information and Privacy Commissioner/Ontario at <http://www.ipc.on.ca>. Please note there may be a fee associated with submitting the appeal.

If you have any questions, please contact Roxanne Chambers at 807-456-3035 or roxanne.chambers@ontario.ca.

Yours truly,

Roxanne Chambers

for

Josephine DeSouza
Manager, Access and Privacy Office

Attachment

Hazardous Waste Information

These are historical waste records from the Hazardous Waste Information Network (HWIN) and System (HWIS), operated by the Ministry of the Environment, Conservation, and Parks. As of January 1, 2023, Resource Productivity and Recovery Authority's (RPPRA) Hazardous Waste Program Registry has replaced HWIN.

Generator Details (HWIN)

Registration/Notification Number

ON3502892

Legal Company Name

Primary Name:Regional Elevator

Division Name:N/A

Company Operating Name

Primary Name:Regional Elevator

Division Name:CMA

Mailing Address

Division Building:N/A

Address Line 1:1519 Star Top Road

Town/City:Ottawa

County (if in ON):OTTAWA CARLTON (RM)

County (if outside ON):N/A

P.O. Box:N/A

Address Line 2:N/A

Postal/Zip Code:K1B 3W5

Province/State (if in CAN/US):ONTARIO

Province/State (if outside CAN/US):N/A

Site Location

Division Building:CMA

Address Line 1:1867 Alta Vista Drive

Town/City:Ottawa

County (if in ON):OTTAWA CARLTON (RM)

County (if outside ON):N/A

P.O. Box:N/A

Address Line 2:N/A

Postal/Zip Code:K1G 5W2

Province/State (if in CAN/US):ONTARIO

Province/State (if outside CAN/US):N/A

Inactive Waste Classes (ON3502892)

No inactive waste listings.

Active Waste Classes (ON3502892)

Active Off-Site Waste Classes

Waste Class	Hazardous Waste Number (per waste stream)	Reg.347 Schedules	Disposal Method	Part 2B required	Part 2B complete	Physical State	Off-Site	Status
251 - L	N/A					Liquid	Off-Site	Active

Generator Details (HWIN)

Registration/Notification Number
ON7154600

Legal Company Name

Primary Name: Demolition Plus Division Name: N/A

Company Operating Name

Primary Name: Demolition Plus Division Name: N/A

Mailing Address

Division Building: N/A P.O. Box: N/A
Address Line 1: 810 Second St. W. Address Line 2: N/A
Town/City: Cornwall Postal/Zip Code: K6J1H6
County (if in ON): STORMONT DUNDAS GLENGARRY Province/State (if in CAN/US): ONTARIO
County (if outside ON): N/A Province/State (if outside CAN/US): N/A

Site Location

Division Building: N/A P.O. Box: N/A
Address Line 1: 1867 Alta Vista Dr. Address Line 2: N/A
Town/City: Ottawa Postal/Zip Code: K1E5W8
County (if in ON): OTTAWA CARLTON (RM) Province/State (if in CAN/US): ONTARIO
County (if outside ON): N/A Province/State (if outside CAN/US): N/A

Inactive Waste Classes (ON7154600)

No inactive waste listings.

Active Waste Classes (ON7154600)

Active Off-Site Waste Classes

Waste Class	Hazardous Waste Number (per waste stream)	Reg.347 Schedules	Disposal Method	Part 2B required	Part 2B complete	Physical State	Off-Site	Status
145 - I	D001	5, 13	Land Disposal	Y	Y	Liquid	Off-Site	Active
212 - L	N/A					Liquid	Off-Site	Active
213 - I	D001	5, 13		Y	Y	Liquid	Off-Site	Active
251 - L	N/A					Liquid	Off-Site	Active

Generator Details (HWIN)

Registration/Notification Number
ON9965839

Legal Company Name

Primary Name:Broccolini

Division Name:N/A

Company Operating Name

Primary Name:Broccolini

Division Name:N/A

Mailing Address

Division Building:N/A

Address Line 1:130 Slater Str

Town/City:Ottawa

County (if in ON):OTTAWA CARLTON (RM)

County (if outside ON):N/A

P.O. Box:N/A

Address Line 2:

Postal/Zip Code:K1P 6E2

Province/State (if in CAN/US):ONTARIO

Province/State (if outside CAN/US):N/A

Site Location

Division Building:N/A

Address Line 1:1867 Alta Vista Dr

Town/City:Ottawa

County (if in ON):OTTAWA CARLTON (RM)

County (if outside ON):N/A

P.O. Box:N/A

Address Line 2:

Postal/Zip Code:K1G 5W8

Province/State (if in CAN/US):ONTARIO

Province/State (if outside CAN/US):N/A

Inactive Waste Classes (ON9965839)

No inactive waste listings.

Active Waste Classes (ON9965839)

Active Off-Site Waste Classes

Waste Class	Hazardous Waste Number (per waste stream)	Reg.347 Schedules	Disposal Method	Part 2B required	Part 2B complete	Physical State	Off-Site	Status
150 - L	N/A					Liquid	Off-Site	Active



INCIDENT REPORT

Reference Number:	1275-734RWL	File Storage Number:	SI OC OT AL 100
Module:	Incident Reporting	Module Type:	Pollution Incident Report (PIR)
Cross Reference:	(doc link)	Task Link:	0376-734RYJ
Originating Document:		Created by:	Christine Villeneuve
Incident Report Reference Number:		1275-734RWL	
Date Created:	2007/05/11	Date Completed:	2007/06/07
Bring Forward Date:		Bring Forward Reason:	
Status:	Closed		
Program	Water - Ground & Surface	Activity:	Pollution Incident Reports

Is this an **air emission** (measured or modelled) or **wastewater** (sewage) **discharge exceedance** that will become part of the Environmental Compliance Report?

(legislation, certificate of approval, order, or guideline)

☐ Yes ☒ No ☐ To be determined

[Click here for Guidance](#)

Caller or PO Information

Reported By:	Name of Company:		
First Name	Last Name	Canadian Medical Association	
Contact Mailing Address			
Civic Address:	Unit Identifier:		
1867 Alta Vista Drive			
Delivery Designator:	Delivery Identifier:		
Municipality:	Postal Station:	Province/State:	Postal Code:
Ottawa		Ontario	
Telephone Number:	Extension:	Other Number:	Email Address:

Reported By:

MOE Information

Date & Time Reported to MOE:	2007/05/11 16:17		
Office Receiving Incident Report:	Ottawa District Office		
Incident Info Received By:	Christine Villeneuve		
MOE Response:	No Field Response	Site Region:	Eastern
Date & Time of MOE Arrival at Scene:	2007/05/24 13:50		
Master Incident Report Number:			
SAC Action Class:			

Non-Standard Procedure: No

ERP Call-out Initiated:

Client(s)

Client Details

Site(s)

Site Details

1867 Alta Vista Drive<UNOFFICIAL>
Address: Lot: , Part: , Ottawa, City,
District Office: Ottawa

Incident Information

Incident Summary:

Turbid & dark water in stream
cannot be longer than 60 characters

Incident Description:

The caller reports that a stream located behind the Canadian Medical Association building gets murky and dark on occasion since construction has started on the property behind theirs. indicated that there is a pond next to the construction site - this would be the source of the turbid waters. does not know who is carrying out the construction activity or what is being built (commercial or residential construction?). are concerned of negative environmental impacts on the pond and stream. believes the construction activity is on Promenade Valours, but uncertain. I told someone from the Ottawa district office would follow-up and get back to

Wednesday, May 16, 2007, 09:35, to Caller: the construction activity is to the right of Valour Drive and is not located on CMA (Canadian Medical Association's) property.

Thursday, May 24, 2007, 13:50, at the Site A site visit to the stream indicated that a minor amount of hydrocarbons was present on the surface of the water in the creek (gathered behind obstructions in the creek flow). The material appeared to be motor oil. A site visit to the construction site indicated that no surface waters could flow from the excavation to the creek (as the excavation is well below the surface level of the creek). Staff from the construction company also placed siltation curtains across the construction site within its proximity.

The source of water in the creek behind the construction site (the one affected) is storm water from municipal storm drains that enters the creek near the intersection of Smyth Road and Fairbanks Avenue. The source of the hydrocarbons on the surface of the water is likely from motor oil that was washed into the municipal storm drains.

The undersigned officer observed a worker using a water hose to cool the engine of a truck; this was done near a storm sewer. The undersigned provincial officer presented officer's designation and spoke to the site construction supervisor who confirmed that trucks are maintained at their respective depots and no trucks are washed down or maintained at this Site (he indicated this instance was an anomaly).

Thursday, May 24, 2007, 15:15, to City of Ottawa, Sewer Use Program, Tricia Trainor, requested if municipal personnel conduct or arrange clean-ups of the creek. Mr. Trainor replied that no such clean-ups are undertaken and municipal personnel will not hire a clean-up company to remove the oily water from the creek.

The amount of oily water on the surface of the creek will be attenuated by the next rain-fall.

Caller was contacted on May 29, 2007, at 15:30 and discussed the Ministry's actions. Caller was satisfied with actions taken and will contact the Ministry if there are further concerns.

No further action required. Document and file.

Attachments, Links &

Comments:

Date & Time of Incident

Incident Date Confirmation? Actual
2007/05/11

Source Type:

Sector Type:

Nearest Watercourse:

Watershed Category
Code:

Environmental Impact:

Not Anticipated

Nature of Impact:

Incident Cause:

Incident Reason:

Damaged Party:

No

Contaminants Table

Contaminant Name	Code	UN#	Limit	Quantity	[units]	[freq]
Oily Water						

Controller of Material:

Owner of Material:

Estimated Clean Up Cost:

Who Cleaned Up:

% Clean Up:

%

Agencies Involved:

Voluntary / Mandatory Abatement

Is there Voluntary Abatement Activity?

☐ Yes

☒ No

☐ To be determined

Voluntary / Mandatory Compliance Items

Type Parent RefNo Work Summary (may be truncated)

Date

AttainList

Offence(s)

Suspected Violation(s)/Offence(s):

Act - Regulation - Section,
Description
{General Offence}

Provincial Officer:

Name:

Tor Rustad

Badge No:

392

Work Unit:

District/Area Office:

Date:

Ottawa District Office
2007/06/05

Signature:



Area Supervisor:

Name:

Paul Kehoe

Work Unit:


District/Area Office:

Ottawa District Office

Date:

2007/06/07

Signature:

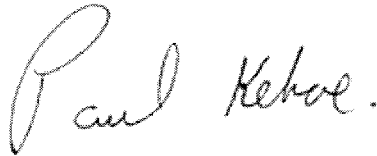



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:
OTTAWA CITY
1867 ALTA VISTA DRIVE, OTTAWA

Reg: 4 Dist: OT Municipality: 20101

Entered: 1999/10/08 09:50
ORIS No. 9940001932

Received By:
TRUDY HERFKENS

Occurrence Type: N
Subtype: 04

Work Plan: WH

Reported By:
SEWER ROOTER O/A ROTO-ROOTER

Telephone No. 613-247-1911 x
Alternate No. x

Address:
635 INDUSTRIAL AVENUE, OTTAWA
ONTARIO

Postal Code: K1G 0Z1

Syn: ISSUED EMERGENCY GENERATOR NUMBER

Brief Summary:

ISSUED EMERGENCY GENERATOR NUMBER FOR MANIFEST #AA56141-2 FOR WASTE CLASS 251 HYDROLIC OIL SPILL FROM BROKEN ELEVATOR HOSE.

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X Abatement IEB Other

BF Date:

File Closed: Y Abatement: IEB Other

Suspected Violation:

Report Prepared By: TRUDY HERFKENS
Date: 10/08/99

Approving Officer: GEORGE CLARKE
Date: 10/08/99

Specify number(s) for routing Original [] [] [] [] []

Specify number(s) for copy distribution [] [] [] [] [] []

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

Continued [] Yes

7. Other _____

SAC Action Class: 1: 2:

Source:
CANADIAN MEDICAL ASSOCIATION

Sector: SI **Source:** WS **SIC:**

UTM:

N: [5026000] **E:** [447000] **Zone:** [18]

Abstracts: 0
Diaries: 0

Batch: 3284
I. E. B. No.

Occurrence Date: 1999/09/27

Occurrence Time:

Report to MOE : 1999/09/27 00:00

MOE at Scene:

Assigned To: GREG MONTCALM

ERP Contacted:

Callout: []

ERP Name:

NSP: []

Material 1: N/A

Amount:

Material 2:

Amount:

Material 3:

Amount:

Cause: :

Code :

UN No.:

Code :

UN No.:

Code :

UN No.:

Code. . :

Reason. :	Code. . . :
Person in Control:	Waste GenNum :
Owner :	Waste GenNum :
Agencies Involved. . . . :	
Clean up and Restoration Carried out by:	
☒ Controller ☒ Owner ☐ Other	
% Cleaned up:	Estimated Cost:
Were Directions or Approval Given Under	
EPA Part X ☒ Regulation 362 ☒ Manifest No.	
Waste Class :	Code . . . :
Hauler :	Code . . . :
Disposal Site :	Code . . . :
Environmental Impact: Nature of Impact:	Code . . . :
People/Business Damaged	
(Other than to Owner/Controller) :	
Nature of Damage:	Code . . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:
OTTAWA CITY

Reg: 4 Dist: OT Municipality: 20101

Entered: ORIS No.
9040200972

Received By:
UNNEMARIE COTE

Occurrence Type: Subtype:
N 01

Work Plan:

Reported By:
CANADIAN DENTAL ASSOCIATION

Telephone No. **Alternate No.**
- - X

Address:
1867 ALTA VISTA
OTTAWA, ONT
Postal Code:

Syn: CREEK TURNED GREEN

Brief Summary:

I TELEPHONED COMPLAINANT AT 03:05 SAID SMALL CREEK WAS A FLUORESCENT GREEN.
15:15 - IN PHONED "MIKE" AT CITY AND HE SAID INVESTIGATOR WOULD NOT GET THERE UNTIL 04:00 P.M.
15:30 - I PHONED LUC DUGAL, CITY SEWER BRANCH WHO WILL SEND SOMEONE A.S.A.P 15:45 I ARRIVED AT SITE. SAW GREEN
COLOURED LIQUID WAS COMING FROM STORM SEWER OUTFALL LOCATED NORTH OF SMYTH ROAD AND EAST OF ALTA VISTA.
THE LIQUID IS SIMILAR TO FLOURISCENE DYE. I PHONED CITY AT AND PERSON SAID INVESTIGATOR IS AT CANADIAN
DENTAL ASSOCIATION WAITING FOR ME. ..CONT'D ABSTRACT.. FILE CODE OTTAWA - O.05.14

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X Abatement IEB Other
BF Date:

File Closed: X Abatement: IEB Other
Suspected Violation:

Report Prepared By: **Date:**
DAVE FUMERTON 12/05/90

Approving Officer **Date:**
GEORGE CLARKE 12/11/91

Specify number(s) for routing Original [] [] [] [] []
Specify number(s) for copy distribution [] [] [] [] [] []

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

7. Other _____

SAC Action Class: 1: 2:

Source:
CITY OF OTTAWA
STORM SEWER
Sector: UK **Source:** UK **SIC:**
UTM:
N: [] **E:** [] **Zone:** []

Abstracts:

Diaries:

Batch:
0

I. E. B. No.

Occurrence Date: 1990/11/26

Occurrence Time: 14:50

Report to MOE : 1990/11/26 14:54

MOE at Scene: 90/11/26 15:45

Assigned To: DAVE FUMERTON

ERP Contacted:

Callout: []

ERP Name:

NSP: []

Material 1: UNKNOWN
Amount:
Material 2:
Amount:

Code : 98
UN No.:
Code :
UN No.:


Material 3:		Code :
Amount :		UN No.:
Cause. :		Code. . :
Reason. :		Code. . :
Person in Control:		Waste GenNum :
Owner :		Waste GenNum :
Agencies Involved. :		
Clean up and Restoration Carried out by:		
☐ Controller	☐ Owner	☐ Other
% Cleaned up:		Estimated Cost:
Were Directions or Approval Given Under		
EPA Part X ☐	Regulation 362 ☐	Manifest No.
Waste Class :		Code . . :
Hauler :		Code . . :
Disposal Site :		Code . . :
Environmental Impact:	Nature of Impact:	
		Code . . :
People/Business Damaged		
(Other than to Owner/Controller) :		
Nature of Damage:		Code . . :

ontario  (<https://www.ontario.ca/page/government-ontario>)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7432326

Well Audit Number: Z396076

Well Tag Number: A362862

This table contains information from the original well record and any subsequent updates.

Well Location


Address of Well Location	
Township	GLOUCESTER TOWNSHIP

ontario  (<https://www.ontario.ca/page/government-ontario>)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7432327

Well Audit Number: Z396084

Well Tag Number: A362863

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	GLOUCESTER TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 448244.00 Northing: 5027650.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 6946

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z396084

Date Well Completed: September 20, 2022

Date Well Record Received by MOE: October 21, 2022

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024
Published: March 20, 2014

ontario  (<https://www.ontario.ca/page/government-ontario>)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7432328

Well Audit Number: Z396077

Well Tag Number: A359323

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	GLOUCESTER TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 448212.00 Northing: 5027651.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 6946

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z396077

Date Well Completed: September 20, 2022

Date Well Record Received by MOE: October 21, 2022

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024
Published: March 20, 2014

ontario  (<https://www.ontario.ca/page/government-ontario>)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7432329

Well Audit Number: Z396083

Well Tag Number: A362864

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 448295.00 Northing: 5027549.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 6946

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z396083

Date Well Completed: September 20, 2022

Date Well Record Received by MOE: December 01, 2022

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024
Published: March 20, 2014

ontario  (<https://www.ontario.ca/page/government-ontario>)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7159344

Well Audit Number: Z123985

Well Tag Number: A097268

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	1881 FAIRBANKS AVE
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 448475.00 Northing: 5027376.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
BRWN	SAND	CLAY	SOFT	0 m	1.52 m

GREY	LMSN		HARD	1.52 m	4.88 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	1.52 m	BENSEAL		
1.52 m	4.88 m	FILTER SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Air Percussion		
	Monitoring and Test Hole	

Status of Well

Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	
3.45 cm	PLASTIC	0 m	1.83 m	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	
4.21 cm	PLASTIC	1.83 m	4.88 m	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		

Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	

5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	
0 m	1.52 m	8.25 cm	
1.52 m	4.8 m	5.71 cm	

Audit Number: Z123985

Date Well Completed: January 11, 2011

Date Well Record Received by MOE: February 17, 2011

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)


Updated: January 10, 2024
Published: March 20, 2014

ontario  (<https://www.ontario.ca/page/government-ontario>)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7159345

Well Audit Number: Z123987

Well Tag Number: A097269

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	1881 FAIRBANKS AVE
Township	OTTAWA CITY

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	Ottawa
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 448480.00 Northing: 5027383.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To
BRWN	SAND	CLAY	SOFT	0 m	1.52 m

GREY	LMSN		HARD	1.52 m	4.88 m

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	
0 m	1.52 m	BENSEAL		
1.52 m	4.88 m	FILTER SAND		

Method of Construction & Well Use

Method of Construction	Well Use	
Air Percussion		
	Monitoring and Test Hole	

Status of Well

Test Hole

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To
3.45 cm	PLASTIC	0 m	1.83 m

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To
4.21 cm	PLASTIC	1.83 m	4.88 m

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 7241

Results of Well Yield Testing

After test of well yield, water was	
If pumping discontinued, give reason	
Pump intake set at	
Pumping Rate	

Duration of Pumping	
Final water level	
If flowing give rate	
Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	

5		5	
10		10	
15		15	
20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	
0 m	1.52 m	8.25 cm	
1.52 m	4.88 m	5.71 cm	

Audit Number: Z123987

Date Well Completed: January 11, 2011

Date Well Record Received by MOE: February 17, 2011

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024
Published: March 20, 2014

Address of Well Location (Street Number/Name) 1881 Fairbanks Ave		Township	Lot	Concession
County/District/Municipality		City/Town/Village Oshawa	Province Ontario	Postal Code
UTM Coordinates NAD 83	Zone 18	Easting 4484875	Northing 027386	Municipal Plan and Sublot Number
			Other	

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	sand	clay	soft	0	1.52
GRY	limestone		hard	1.52	4.88

Annular Space		
Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)
0	1.52	bunseal
1.52	4.88	fitter sand

Method of Construction	Well Use
☐ Cable Tool	☐ Diamond
☐ Rotary (Conventional)	☐ Jetting
☐ Rotary (Reverse)	☐ Driving
☐ Boring	☐ Digging
☒ Air percussion	☐ Livestock
☐ Other, specify	☐ Industrial
	☐ Other, specify
	☐ Public
	☐ Commercial
	☐ Not used
	☐ Domestic
	☐ Municipal
	☒ Test Hole
	☒ Monitoring
	☐ Irrigation
	☐ Cooling & Air Conditioning

Construction Record - Casing			Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	To
3.45	PVC	.356	0	1.83

Construction Record - Screen			Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	To
4.21	PVC	10	1.83	4.88

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From	Diameter (cm/in)
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	0	1.52
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	1.52	4.88

Business Name of Well Contractor strata soil sampling inc.		Well Contractor's Licence No. 7241
Business Address (Street Number/Name) #2-147 West Beaver Creek Rd.		Municipality Richmond Hill
Province ON	Postal Code L4B 1C6	Business E-mail Address wrecords@strata-soil.com
Bus. Telephone No. (inc. area code) (905) 704-9304	Name of Well Technician (Last Name, First Name) Murray Stacy	
Well Technician's Licence No. 3618	Signature of Technician and/or Contractor	Date Submitted 2011/01/31

Results of Well Yield Testing			
After test of well yield, water was:		Draw Down	
☐ Clear and sand free		Time (min)	Water Level (m/ft)
☐ Other, specify		Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Static Level	
Pump intake set at (m/ft)		1	1
Pumping rate (l/min / GPM)		2	2
Duration of pumping hrs + min		3	3
Final water level end of pumping (m/ft)		4	4
If flowing give rate (l/min / GPM)		5	5
Recommended pump depth (m/ft)		10	10
Recommended pump rate (l/min / GPM)		15	15
Well production (l/min / GPM)		20	20
Disinfected?		25	25
☐ Yes ☐ No		30	30
		40	40
		50	50
		60	60

Map of Well Location	
Please provide a map below following instructions on the back.	
See Map	
mw#3.	
Comments:	
Well owner's information package delivered ☐ Yes ☐ No	Date Package Delivered Y Y Y Y M M D D 2011/01/31
Date Work Completed 2011/01/31	Ministry Use Only Audit No. z123988 Received FEB 17 2011


8181



Figure 1 Site Layout

-  Approximate Proposed Boreholes with Monitoring Well
-  Approximate Proposed Boreholes
-  Subject Property (Parts 3 and 4)
-  Parts 1 and 2
-  Property Boundary

→ Start by doing the 3 BH along Property line
 → then shovel two to be completed as well.
 → one sample collected in the Soil Pile



Projection: UTM NAD 83 Zone 18N
 Source: LIO, Google 2010

PROJECT No. P10-236

PROJECT

1881 Fairbanks Avenue

DESIGN: NMP
 CAD/GIS: NMP
 CHECK: ACW
 REV: 0

DATE: 21/12/2010



EE2 1-200

C-7241

2123985 2123987 2123988 2123989 2123990 2123991 2123992 2123993 2123994 2123995 2123996 2123997 2123998 2123999

A097270

Measurements recorded in: ☒ Metric ☐ Imperial

Address of Well Location (Street Number/Name) 1881 Fairbank Ave		Township	Lot	Concession
County/District/Municipality		City/Town/Village Stouffville	Province Ontario	Postal Code
UTM Coordinates	Zone	Easting	North	Municipal Plan and Sublot Number
NAD 83	18	448487	5027386	

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	Sand	clay	soft	0	1.52
GRY	limestone		hard	1.52	4.88
	Well was also cleaned			0	4.88

Annular Space				Results of Well Yield Testing				
Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used (Material and Type)	Volume Placed (m ³ /ft ³)	After test of well yield, water was:	Draw Down	Recovery		
				☐ Clear and sand free ☐ Other, specify	Time (min)	Water Level (m/ft)	Time (min)	Water Level (m/ft)
0	1.52	Best seal						
1.52	4.88	filter sand						
				If pumping discontinued, give reason:	Static Level			
				Pump intake set at (m/ft)	1		1	
				Pumping rate (l/min / GPM)	2		2	
				Duration of pumping hrs + min	3		3	
				Final water level end of pumping (m/ft)	4		4	
				If flowing give rate (l/min / GPM)	5		5	
				Recommended pump depth (m/ft)	10		10	
				Recommended pump rate (l/min / GPM)	15		15	
				Well production (l/min / GPM)	20		20	
				Disinfected?	25		25	
				☐ Yes ☐ No	30		30	
					40		40	
					50		50	
					60		60	

Construction Record - Casing				Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To	
3.45	PVC	.356	0	1.83	☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☒ Abandoned, other, specify ☐ Other, specify

Construction Record - Screen				
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To
4.21	PVC	10	1.83	4.88

Water Details				Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested	Depth (m/ft) From	Depth (m/ft) To	Diameter (cm/in)	
	☐ Gas ☐ Other, specify	0	1.52	8.25	
	☐ Gas ☐ Other, specify	1.52	4.88	5.71	

Well Contractor and Well Technician Information			
Business Name of Well Contractor	Well Contractor's Licence No.	Business Address (Street Number/Name)	Municipality
Province	Postal Code	Business E-mail Address	
Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)	Well Technician's Licence No.	Signature of Technician and/or Contractor
			Date Submitted

Ministry Use Only	
Audit No.	Received
z116799	AUG 05 2011

Measurements recorded in: ☒ Metric ☐ Imperial

Address of Well Location (Street Number/Name) 1881 Fairbanks Ave.		Township	Lot	Concession
County/District/Municipality		City/Town/Village Ottawa	Province Ontario	Postal Code K1H 6M4
UTM Coordinates	Zone	Easting	North	Municipal Plan and Sublot Number
NAD 83	18	448475	5027326	

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	Depth (m/ft) To
BRN	Sand	clay	Soft	0	1.52
GRY	Limestone		hard	1.52	4.88
				0	4.88
well was abandoned					

Depth Set at (m/ft) From	Depth Set at (m/ft) To	Type of Sealant Used (Material and Type)	Volume Placed (m³/ft³)
0	1.52	best seal	
1.52	4.88	filter sand	

☐ Cable Tool	☐ Diamond	☐ Public	☐ Commercial	☐ Not used
☐ Rotary (Conventional)	☐ Jetting	☐ Domestic	☐ Municipal	☐ Dewatering
☐ Rotary (Reverse)	☐ Driving	☐ Livestock	☐ Test Hole	☒ Monitoring
☐ Boring	☐ Digging	☐ Irrigation	☐ Cooling & Air Conditioning	
☒ Air percussion		☐ Industrial		
☐ Other, specify		☐ Other, specify		

Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	Depth (m/ft) To	Status of Well
3.45	PVC	.356	0	1.83	☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☒ Abandoned, other, specify ☐ Other, specify

Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	Depth (m/ft) To	Status of Well
4.21	PVC	10	1.83	4.88	☐ Water Supply ☐ Replacement Well ☐ Test Hole ☐ Recharge Well ☐ Dewatering Well ☐ Observation and/or Monitoring Hole ☐ Alteration (Construction) ☐ Abandoned, Insufficient Supply ☐ Abandoned, Poor Water Quality ☒ Abandoned, other, specify ☐ Other, specify

Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested	Hole Diameter Depth (m/ft) From	Hole Diameter Depth (m/ft) To	Diameter (cm/in)
	☐ Gas ☐ Other, specify	0	1.52	8.26
	☐ Gas ☐ Other, specify	1.52	4.88	5.71

Business Name of Well Contractor	Well Contractor's Licence No.
Business Address (Street Number/Name)	Municipality
Province	Postal Code
Business E-mail Address	

Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)	Well owner's information package delivered	Date Package Delivered	Ministry Use Only Audit No. z116798 Received AUG 05 2011
Well Technician's Licence No.	Signature of Technician and/or Contractor	Date Submitted	Date Work Completed	

A097269

Measurements recorded in: ☒ Metric ☐ Imperial

Address of Well Location (Street Number/Name) 1831 Fairbank Ave		Township	Lot	Concession
County/District/Municipality		City/Town/Village OTTAWA	Province Ontario	Postal Code
UTM Coordinates NAD 83	Zone 18	Easting 448480	Northings 5027383	Municipal Plan and Sublot Number
				Other

Overburden and Bedrock Materials/Abandonment Sealing Record (see instructions on the back of this form)

General Colour	Most Common Material	Other Materials	General Description	Depth (m/ft) From	To
BRW	Snd	clay	Soft	0	1.52
GRY	limestone		hard	1.52	4.83
well was abandoned				0	4.83

Annular Space		
Depth Set at (m/ft) From	To	Type of Sealant Used (Material and Type)
0	1.52	Bm Seal
1.52	4.83	Sand Filter

Method of Construction	Well Use
☐ Cable Tool ☐ Rotary (Conventional) ☐ Rotary (Reverse) ☐ Boring ☒ Air percussion ☐ Other, specify	☐ Public ☐ Domestic ☐ Livestock ☐ Irrigation ☐ Industrial ☐ Other, specify

Construction Record - Casing			Status of Well	
Inside Diameter (cm/in)	Open Hole OR Material (Galvanized, Fibreglass, Concrete, Plastic, Steel)	Wall Thickness (cm/in)	Depth (m/ft) From	To
3.45	PVC	.356	0	1.83

Construction Record - Screen			Status of Well	
Outside Diameter (cm/in)	Material (Plastic, Galvanized, Steel)	Slot No.	Depth (m/ft) From	To
4.21	PVC	10	1.83	4.83

Water Details		Hole Diameter	
Water found at Depth (m/ft)	Kind of Water: ☐ Fresh ☐ Untested ☐ Gas ☐ Other, specify	Depth (m/ft) From	To
0		1.52	2.25
1.52		4.83	5.71

Business Name of Well Contractor		Well Contractor's Licence No.	
Business Address (Street Number/Name)		Municipality	
Province	Postal Code	Business E-mail Address	
Bus. Telephone No. (inc. area code)	Name of Well Technician (Last Name, First Name)		
Well Technician's Licence No.	Signature of Technician and/or Contractor		Date Submitted

Results of Well Yield Testing			
After test of well yield, water was:		Draw Down	
☐ Clear and sand free ☐ Other, specify		Time (min)	Water Level (m/ft)
If pumping discontinued, give reason:		Static Level	
Pump intake set at (m/ft)		1	1
Pumping rate (l/min / GPM)		2	2
Duration of pumping hrs + min		3	3
Final water level end of pumping (m/ft)		4	4
If flowing give rate (l/min / GPM)		5	5
Recommended pump depth (m/ft)		10	10
Recommended pump rate (l/min / GPM)		15	15
Well production (l/min / GPM)		20	20
Disinfected?		25	25
☐ Yes ☐ No		30	30
		40	40
		50	50
		60	60


Map of Well Location						
Please provide a map below following instructions on the back.						
						
Comments: tag was not recovered						
<table border="1"> <tr> <th>Well owner's information package delivered</th> <th>Date Package Delivered</th> </tr> <tr> <td>☐ Yes ☐ No</td> <td>Y Y Y Y M M D D</td> </tr> <tr> <th>Date Work Completed</th> <td>Y Y Y Y M M D D</td> </tr> </table>	Well owner's information package delivered	Date Package Delivered	☐ Yes ☐ No	Y Y Y Y M M D D	Date Work Completed	Y Y Y Y M M D D
Well owner's information package delivered	Date Package Delivered					
☐ Yes ☐ No	Y Y Y Y M M D D					
Date Work Completed	Y Y Y Y M M D D					
<table border="1"> <tr> <th colspan="2">Ministry Use Only</th></tr> <tr> <td>Audit No.</td><td>z116800</td></tr> <tr> <td>Received</td><td>AUG 15 2011</td></tr> </table>	Ministry Use Only		Audit No.	z116800	Received	AUG 15 2011
Ministry Use Only						
Audit No.	z116800					
Received	AUG 15 2011					

ontario  (<https://www.ontario.ca/page/government-ontario>)

Map: Well records

This map allows you to search and view well record information from reported wells in Ontario.

Full dataset is available in the Open Data catalogue (<https://data.ontario.ca/dataset/well-records>) .



[Go Back to Map](#)

Well ID

Well ID Number: 7237921

Well Audit Number: Z180824

Well Tag Number: A140449

This table contains information from the original well record and any subsequent updates.

Well Location

Address of Well Location	ALTA VISTA
Township	GLOUCESTER TOWNSHIP

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	OTTAWA
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 448024.00 Northing: 5027807.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	
	Monitoring	

Status of Well

Abandoned-Other

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 6894

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	
14 ft	Fresh	

Hole Diameter

Depth From	Depth To	Diameter	

0 ft	275 ft	2 inch

Audit Number: Z180824

Date Well Completed: February 06, 2015

Date Well Record Received by MOE: February 27, 2015

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024
Published: March 20, 2014

Lot	
Concession	
County/District/Municipality	OTTAWA-CARLETON
City/Town/Village	
Province	ON
Postal Code	n/a
UTM Coordinates	NAD83 — Zone 18 Easting: 448223.00 Northing: 5027534.00
Municipal Plan and Sublot Number	
Other	

Overburden and Bedrock Materials Interval

General Colour	Most Common Material	Other Materials	General Description	Depth From	Depth To

Annular Space/Abandonment Sealing Record

Depth From	Depth To	Type of Sealant Used (Material and Type)	Volume Placed	

Method of Construction & Well Use

Method of Construction	Well Use	

Status of Well

Construction Record - Casing

Inside Diameter	Open Hole or material	Depth From	Depth To	

Construction Record - Screen

Outside Diameter	Material	Depth From	Depth To	

Well Contractor and Well Technician Information

Well Contractor's Licence Number: 6946

Results of Well Yield Testing

After test of well yield, water was		
If pumping discontinued, give reason		
Pump intake set at		
Pumping Rate		
Duration of Pumping		
Final water level		
If flowing give rate		

Recommended pump depth	
Recommended pump rate	
Well Production	
Disinfected?	

Draw Down & Recovery

Draw Down Time(min)	Draw Down Water level	Recovery Time(min)	Recovery Water level
SWL			
1		1	
2		2	
3		3	
4		4	
5		5	
10		10	
15		15	

20		20	
25		25	
30		30	
40		40	
45		45	
50		50	
60		60	

Water Details

Water Found at Depth	Kind	

Hole Diameter

Depth From	Depth To	Diameter	

Audit Number: Z396076

Date Well Completed: September 20, 2022

Date Well Record Received by MOE: October 21, 2022

Related

How to use a Ministry of the Environment map (<https://www.ontario.ca/page/how-use-ministry-environment-map#wells>)

Technical documentation: Metadata record (<https://data.ontario.ca/dataset/well-records/resource/3031344e-e3f2-48d5-888c-c1deadfd2f77>)

Updated: January 10, 2024

Published: March 20, 2014

Mark Bujaki

From: Public Information Services <publicinformationsservices@tssa.org>
Sent: December 10, 2024 12:57 PM
To: Mark Bujaki
Subject: RE: PE6830 - Records Search Request

External Email: Do not click on links or open attachments unless you trust the sender.

Hello ,

RECORD FOUND IN CURRENT DATABASE:

- We confirm that there are **fuels records** in our database at the subject address(es).

Inventory Number	Address	City	Province	Postal Code	Status	Reason Code	Asset Class / Inventory Context	Asset Type / Inventory Item
64660036	2 VALOUR DR	OTTAWA	ON	K1G 3T5	EXPIRED	EXPIRED	FS Non Licensed Facility	FS NON LICENSED FACILITY
64676568	2 VALOUR DR	OTTAWA	ON	K1G 3T5	Active	Active	FS Non Licensed Facility	FS NON LICENSED FACILITY

***NO OTHER FUELS RECORDS FOUND IN CURRENT DATABASE FOR THIS REQUEST**

For a further search in our archives, please go to the [TSSA Client Portal](#) to complete an Application for Release of Public Information. Please refer to [Training \(tssa.org\)](#) for instructions on how to use the portal. Please refer to [How to Submit a Public Information Request \(tssa.org\)](#) for instructions.

The associated fee must be paid via credit card (Visa or MasterCard).

Once all steps have been successfully completed you will receive your payment receipt via email.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

If you have any questions or concerns, please do not hesitate to contact our Public Information Release team at publicinformationsservices@tssa.org.

Kind regards,



Melanie Fowler | Public Information Releases Agent

Legal

345 Carlingview Drive

Toronto, Ontario M9W 6N9

Tel: +1 416-734-3593 | Fax: +1 416-231-4903 | E-Mail: mfowler@tssa.org

www.tssa.org



Winner of 2023 5-Star Safety Cultures Award

From: Mark Bujaki <mbujaki@Patersongroup.ca>
Sent: Tuesday, December 10, 2024 11:16 AM
To: Public Information Services <publicinformationservices@tssa.org>
Subject: PE6830 - Records Search Request

[CAUTION]: This email originated outside the organisation.

Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

Hello,

Could you please complete a search of your records for underground/aboveground storage tanks, historical spills, or other incidents/infractions for the following addresses located in Ottawa , Ontario.

2 Valour Drive

1745 Alta Vista Drive
1758 Alta Vista Drive
1785 Alta Vista Drive
1800 Alta Vista Drive
1815 Alta Vista Drive
1867 Alta Vista Drive
1870 Alta Vista Drive
1891 Alta Vista Drive

255 Smyth Road

Thank you



Mark Bujaki, B.Sc., MBA

Junior Environmental Scientist
Environmental Division

TEL: (613) 226-7381 ext. 335

DIRECT: (613) 299-4209

9 AURIGA DRIVE
OTTAWA ON K2E 7T9

patersongroup.ca

TEMPORARY SHORING DESIGN SERVICES ARE NOW AVAILABLE, PLEASE CONTACT US TO SEE HOW WE CAN HELP!
NEW OFFICE OPEN IN THE GREATER TORONTO AREA WITH OUR EXPANSIVE LIST OF SERVICES NOW AVAILABLE!

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.



File Number: D06-03-24-0165

D06-03-24-0165

January 30, 2025

Mark Bujaki
Paterson Group

Sent via email <mailto:mbujaki@Patersongroup.ca>

Dear Mark Bujaki

**Re: Information Request
1867 Alta Vista Drive Ottawa, Ontario ("Subject Property")**

Internal Department Circulation:

The Planning, Infrastructure and Economic Development Department has the following information in response to your request for information regarding the Subject Property:

- **Environmental Remediation Unit:** The City's Environmental Remediation Unit (ERU) has a Phase One Environmental Site Assessment (Fisher Environmental, 2022) for this property. Please contact ERU-UAE@ottawa.ca to obtain a copy of the report if required
- **Ottawa Public Health - Environmental Health:** all public inspection results are publicly available on the Ottawa Public Health website:
<https://www.ottawapublichealth.ca/en/public-health-services/public-health-inspections.aspx>
- **Sewer Use Program:** No records found for this property
- **Solid Waste Services:** No records found for this property

Documents Provided:

HLUI Summary Report and HLUI Map

The HLUI Summary Report Excel spreadsheet identifies HLUI area, point and line features within 250 metres of the Subject Property, as shown on the provided HLUI Map PDF. Within 500 metres of the Subject Property, landfills and Environmental Risk Management Area (ERMA) are also identified if applicable. 1867 Alta Vista Drive1867 Alta Vista Drive1867 Alta Vista Drive

For more information on how to interpret the HLUI data identified in the attached excel sheet ('ADDRESS – HLUI Summary report.xlsx'), please refer to the [Overview and User Guide](#)."

Additional information may be obtained by contacting:

Ontario's Environmental Registry

The Environmental Registry found at <https://ero.ontario.ca/> contains "public notices" about environmental matters being proposed by all government ministries covered by the Environmental Bill of Rights. The public notices may contain information about proposed new laws, regulations, policies and programs or about proposals to change or eliminate existing ones. By using key words i.e. name of proponent/owner and the address one can ascertain if there is any information on the proponent and address under the following categories: Ministry, keywords, notice types, Notice Status, Acts, Instruments and published date (all years).

The Ontario Land Registry Office

Registration of real property is recorded in the Ontario Land Registry Office through the Land Titles Act or the Registry Act. Documents relating to title and other agreements that may affect your property are available to the public for a fee. It is recommended that a property search at the Land Registry Office be included in any investigation as to the historic use of your property. The City of Ottawa cannot comment on any documents to which it is not a party.

Court House
161 Elgin Street 4th Floor
Ottawa ON K2P 2K1
Tel: (613) 239-1230
Fax: (613) 239-1422

Ottawa Public Health

Ottawa Public Health inspects many different types of establishments. To view inspection results, please visit the Ottawa Public Health website: [Public Health Inspections - Ottawa Public Health](#)

Please note that Ottawa Public Health is not the lead agency on land use contamination in the City of Ottawa – contact the Ministry of Environment Conservation and Parks (MECP) for further information.

Please note, as per the HLUI Disclaimer, that the information contained in the HLUI database has been compiled from publicly available records and other sources of information. The HLUI may contain erroneous information given that the records used as sources of information may be flawed. For instance, changes in municipal addresses over time may introduce error. Accordingly, all information from the

HLUI database is provided on an “as is” basis with no representation or warranty by the City with respect to the information’s accuracy or exhaustiveness in responding to the request.

Furthermore, the HLUI database and the results of this search in no way confirm the presence or absence of contamination or pollution of any kind. This information is provided on the assumption that it will not be relied upon by any person for any purpose whatsoever. The City of Ottawa denies all liability to any persons attempting to rely on any information provided from the HLUI database.

Please note that in responding to your request, the City of Ottawa does not guarantee or comment on the environmental condition of the Subject Property. You may wish to contact the Ontario Ministry of Environment and Climate Change for additional information.

If you have any further questions or comments, please contact HLUI@ottawa.ca.

Sincerely,

Harnav Toor

Student Planner

Development Review


Planning, Development and Building Services Department

Enclosures: (2)

1. HLUI Map
2. HLUI Summary Report

cc: File no. D06-03-24-0165

HISTORIC LAND USE INVENTORY (HLUI) - REPORT REFERENCE MAP

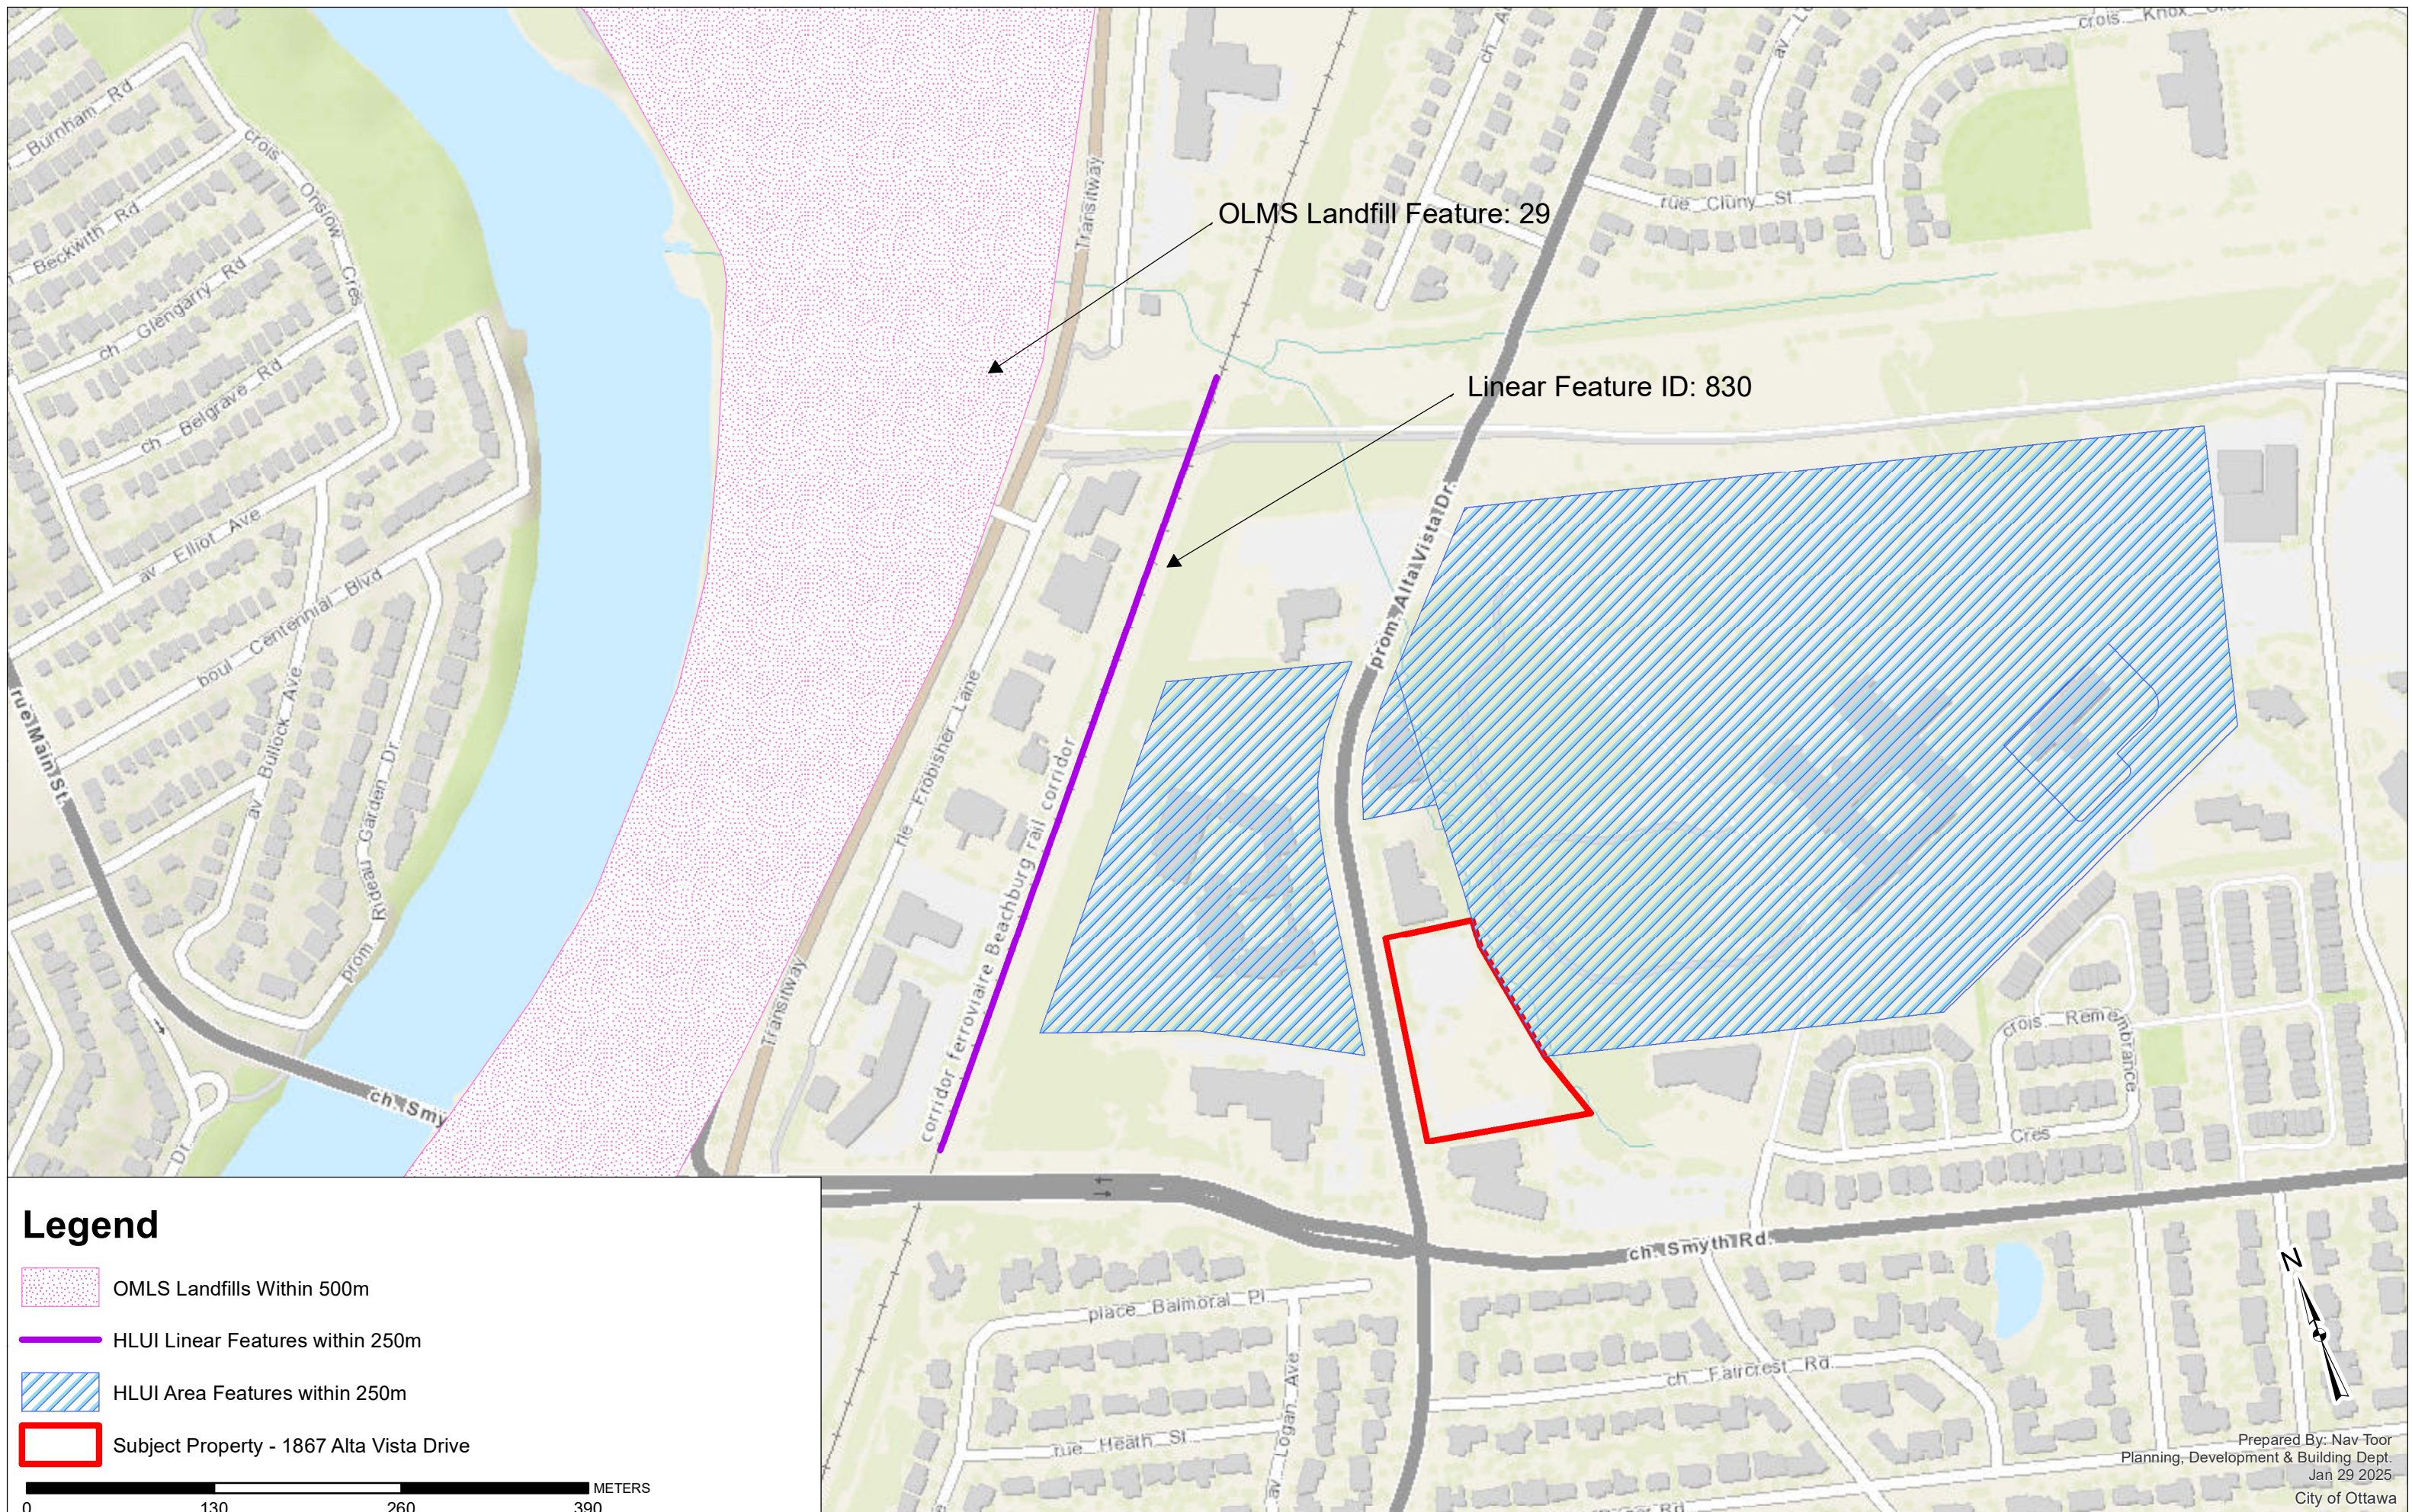



DATABASE REPORT

Project Property:	<i>PE6971 - Phase I ESA 1867 Alta Vista Drive Ottawa ON K1G 5W8 63336</i>
Project No:	
Report Type:	<i>Quote - Custom-Build Your Own Report</i>
Order No:	<i>25061200751</i>
Requested by:	<i>Paterson Group Inc.</i>
Date Completed:	<i>June 16, 2025</i>

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	7
Executive Summary: Site Report Summary - Surrounding Properties.....	8
Executive Summary: Summary By Data Source.....	15
Map.....	25
Aerial.....	26
Topographic Map.....	27
Detail Report.....	28
Unplottable Summary.....	144
Unplottable Report.....	146
Appendix: Database Descriptions.....	195
Definitions.....	205

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: PE6971 - Phase I ESA
1867 Alta Vista Drive Ottawa ON K1G 5W8

Project No: 63336

Order Information:

Order No: 25061200751
Date Requested: June 12, 2025
Requested by: Paterson Group Inc.
Report Type: Quote - Custom-Build Your Own Report

Historical/Products:

ERIS Xplorer [ERIS Xplorer](#)

Executive Summary: Report Summary

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.25km</i>	<i>Total</i>
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	2	2
CA	Certificates of Approval	Y	0	0	0
CDRY	Dry Cleaning Facilities	Y	0	0	0
CFOT	Commercial Fuel Oil Tanks	Y	0	0	0
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	0	0	0
EASR	Environmental Activity and Sector Registry	Y	0	0	0
EBR	Environmental Registry	Y	0	0	0
ECA	Environmental Compliance Approval	Y	0	0	0
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	2	7	9
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	0	0	0
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	0	0
FSTH	Fuel Storage Tank - Historic	Y	0	0	0
GEN	Ontario Regulation 347 Waste Generators Summary	Y	3	51	54
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	0	0

Database	Name	Searched	Project Property	Boundary to 0.25km	Total
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0
INC	Fuel Oil Spills and Leaks	Y	0	0	0
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	1	1
NDSP	National Defense & Canadian Forces Spills	Y	0	4	4
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	0	0	0
NPR2	National Pollutant Release Inventory	Y	0	0	0
NPRI	National Pollutant Release Inventory - Historic	Y	0	0	0
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	0	0	0
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	0	0
PFAS	Ontario PFAS Spills	Y	0	0	0
PFCH	NPRI Reporters - PFAS Substances	Y	0	0	0
PFHA	Potential PFAS Handlers from NPRI	Y	0	0	0
PINC	Pipeline Incidents	Y	0	0	0
PPHA	Potential PFAS Handlers from EASR	Y	0	0	0
PRT	Private and Retail Fuel Storage Tanks	Y	0	0	0
PTTW	Permit to Take Water	Y	0	0	0
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	0	0
RST	Retail Fuel Storage Tanks	Y	0	0	0
SCT	Scott's Manufacturing Directory	Y	0	10	10
SPL	Ontario Spills	Y	0	2	2
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.25km</i>	<i>Total</i>
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	0	9	9
Total:			5	86	91

Executive Summary: Site Report Summary - Project Property

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>1</u>	GEN	Regional Elevator	1867 Alta Vista Drive Ottawa ON K1G 5W2	E/0.0	0.00	<u>28</u>
<u>1</u>	GEN	Demolition Plus	1867 Alta Vista Dr. Ottawa ON K1E5W8	E/0.0	0.00	<u>28</u>
<u>1</u>	GEN	Broccolini	1867 Alta Vista Dr Ottawa ON K1G 5W8	E/0.0	0.00	<u>30</u>
<u>1</u>	EHS		1867 Alta Vista Drive, Ottawa Ottawa ON K1G 5W8	E/0.0	0.00	<u>30</u>
<u>2</u>	EHS		1867 Alta Vista Ottawa ON	NE/0.0	0.00	<u>31</u>

Executive Summary: Site Report Summary - Surrounding Properties

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
3	GEN	CANADIAN DENTAL ASSOCIATION	1815 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	NNW/38.2	-2.63	31
3	SCT	Canadian Dental Association	1815 Alta Vista Dr Ottawa ON K1G 3Y6	NNW/38.2	-2.63	31
3	GEN	CANADIAN DENTAL ASSOCIATION	1815 ALTA VISTA DRIVE OTTAWA ON	NNW/38.2	-2.63	31
4	EHS		255 Smyth Rd Ottawa ON K1H 8M7	SE/48.7	3.39	32
5	GEN	MD FINANCIAL MANAGEMENT	1870 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	WSW/65.8	0.64	32
6	BORE		ON	WSW/65.9	1.59	32
7	SPL	NATIONAL DEFENCE	ALTA VISTA DRIVE NEAR SMYTH RD. MEDICAL BUILDING ALTA VISTA DRIVE OTTAWA CITY ON	SSW/67.6	3.74	34
8	WWIS		In Front of 2019 Bank Street, Northbound Lane Ottawa ON Well ID: 7353977	NE/99.4	-3.36	35
9	SCT	CANADIAN PHARMACISTS ASSOC	1785 ALTA VISTA DR OTTAWA ON K1G 3Y6	NNW/106.0	-3.30	37
9	SCT	ARTHROPHARM PHARMACEUTICALS	1785 Alta Vista Rd Unit 100 Ottawa ON K1G 3Y6	NNW/106.0	-3.30	38
9	SCT	Canadian Pharmacists Association	1785 Alta Vista Dr Ottawa ON K1G 3Y6	NNW/106.0	-3.30	38
9	SCT	Canadian Pharmaceutical Journal	1785 Alta Vista Dr Suite 105 Ottawa ON K1G 3Y6	NNW/106.0	-3.30	38

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>9</u>	SCT	Arthroparm Pharmaceuticals Inc.	1785 Alta Vista Dr Unit 100 Ottawa ON K1G 3Y6	NNW/106.0	-3.30	<u>38</u>
<u>9</u>	GEN	CANADIAN PHARMACEUTICAL ASSOC.	1785 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	NNW/106.0	-3.30	<u>39</u>
<u>9</u>	GEN	CANADIAN PHARMACEUTICAL ASSOC. 08-551	1785 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	NNW/106.0	-3.30	<u>39</u>
<u>9</u>	GEN	CANADIAN PHARMACEUTICAL ASSOCIATION	1785 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	NNW/106.0	-3.30	<u>39</u>
<u>9</u>	SCT	The DATA Group of Companies	1785 Alta Vista Dr Suite 105 Ottawa ON K1G 3Y6	NNW/106.0	-3.30	<u>40</u>
<u>9</u>	SCT	Canadian Pharmacists Journal	1785 Alta Vista Dr Ottawa ON K1G 3Y6	NNW/106.0	-3.30	<u>40</u>
<u>9</u>	SCT	Cdn Pharmacists Assn	1785 Alta Vista Dr Ottawa ON K1G 3Y6	NNW/106.0	-3.30	<u>40</u>
<u>9</u>	GEN	57 North Prosthodontics	1785 Alta Vista Drive Unit 106 Ottawa ON K1G3Y6	NNW/106.0	-3.30	<u>41</u>
<u>9</u>	GEN	57 North Prosthodontics	1785 Alta Vista Drive Unit 106 Ottawa ON K1G3Y6	NNW/106.0	-3.30	<u>41</u>
<u>9</u>	GEN	57 North Prosthodontics	1785 Alta Vista Drive Unit 106 Ottawa ON K1G3Y6	NNW/106.0	-3.30	<u>41</u>
<u>9</u>	GEN	57 North Prosthodontics	1785 Alta Vista Drive, Unit 106 Ottawa ON	NNW/106.0	-3.30	<u>42</u>
<u>10</u>	EHS		1800 Alta Vista Drive OTTAWA ON K1G 4J5	WNW/123.4	-3.02	<u>44</u>
<u>10</u>	GEN	CANADIAN RED CROSS SOCIETY	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	<u>45</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
10	GEN	CANADIAN RED CROSS SOCIETY	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	45
10	GEN	CANADIAN RED CROSS SOCIETY 08-352	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	46
10	GEN	CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	46
10	SCT	Canadian Blood Services	1800 Alta Vista Dr Ottawa ON K1G 4J5	WNW/123.4	-3.02	48
10	EHS		1800 Alta Vista Dr Ottawa ON K1G 4J5	WNW/123.4	-3.02	48
10	SPL	Canadian Blood Services<UNOFFICIAL>	1800 Altavista Dr. Ottawa ON	WNW/123.4	-3.02	48
10	GEN	CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	49
10	GEN	CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	51
10	GEN	CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	52
10	GEN	CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	53
10	GEN	CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON	WNW/123.4	-3.02	55
10	GEN	CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	56
10	GEN	CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	58

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>10</u>	GEN	CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	<u>59</u>
<u>10</u>	GEN	CANADIAN BLOOD SERVICES Head Office	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	<u>61</u>
<u>10</u>	GEN	CANADIAN BLOOD SERVICES Head Office	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	<u>63</u>
<u>10</u>	GEN	CANADIAN BLOOD SERVICES Head Office	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	WNW/123.4	-3.02	<u>65</u>
<u>10</u>	GEN	CANADIAN BLOOD SERVICES	1800 Alta Vista Drive Ottawa ON	WNW/123.4	-3.02	<u>67</u>
<u>11</u>	EHS		1870 Alta Vista Dr Ottawa ON K1G 6R7	W/148.2	-0.66	<u>76</u>
<u>12</u>	BORE		ON	WSW/160.8	-0.36	<u>77</u>
<u>13</u>	WWIS		ALTA VISTA OTTAWA ON Well ID: 7237921	NW/223.5	-5.36	<u>78</u>
<u>14</u>	WWIS		1881 FAIRBANKS AVE Ottawa ON Well ID: 7159345	ESE/226.1	5.00	<u>80</u>
<u>14</u>	WWIS		1881 FAUBANK AVE Ottawa ON Well ID: 7166800	ESE/226.1	5.00	<u>82</u>
<u>15</u>	WWIS		1881 FAIRBANKS AVE Ottawa ON Well ID: 7159344	ESE/227.3	5.86	<u>85</u>
<u>15</u>	WWIS		1881 FAUBANKS AVE Ottawa ON Well ID: 7166799	ESE/227.3	5.86	<u>88</u>
<u>16</u>	WWIS		1881 FAIRBANKS AVE Ottawa ON	ESE/229.5	5.00	<u>91</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7159346			
16	WWIS		188 FAUBROOK AVE Ottawa ON Well ID: 7166798	ESE/229.5	5.00	94
17	EHS		1881 Fairbanks Avenue Ottawa ON K1H 5X6	ESE/229.6	5.86	96
18	GEN	DEPARTMENT OF NATIONAL DEFENCE	HEALTH CARE CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	97
18	GEN	GVT. OF CAN. - NATIONAL DEFENCE 18-093	MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	98
18	GEN	DEPT. OF NATIONAL DEFENCE	HEALTH CARE CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	100
18	GEN	DEPT. OF NATIONAL DEFENCE	1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	101
18	GEN	DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	102
18	GEN	GVT. OF CAN. - PUBLIC WORKS CANADA	CHP NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1M 0M3	ENE/246.0	-0.56	105
18	GEN	GVT. OF CAN. - PUBLIC WORKS CANADA17-347	CHP NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1M 0M3	ENE/246.0	-0.56	105
18	GEN	PUBLIC WORKS CANADA	CHP NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON	ENE/246.0	-0.56	106
18	NDFT		1745 ALTA VISTA DRIVE, OTTAWA ON K1A 0K6	ENE/246.0	-0.56	107
18	NDSP		ON K1A 0K6	ENE/246.0	-0.56	107

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
18	NDSP		ON K1A 0K6	ENE/246.0	-0.56	108
18	NDSP		ON K1A 0K6	ENE/246.0	-0.56	108
18	NDSP		ON K1A 0K6	ENE/246.0	-0.56	109
18	WWIS		1745 ALTA VISTA DR Ottawa ON Well ID: 7134618	ENE/246.0	-0.56	110
18	EHS		1745 Alta Vista Drive Ottawa ON K1A 0K6	ENE/246.0	-0.56	113
18	GEN	DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	114
18	GEN	DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	115
18	GEN	DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	117
18	GEN	DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	118
18	GEN	DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON	ENE/246.0	-0.56	120
18	GEN	1 Dental Unit Detachment Ottawa	1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	ENE/246.0	-0.56	122
18	GEN	DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	122
18	GEN	DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	124

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>18</u>	GEN	1 Dental Unit Detachment Ottawa	1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	ENE/246.0	-0.56	<u>125</u>
<u>18</u>	GEN	1 Dental Unit Detachment Ottawa	1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	ENE/246.0	-0.56	<u>126</u>
<u>18</u>	GEN	DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	ENE/246.0	-0.56	<u>126</u>
<u>18</u>	GEN	Department of National Defence RP Ops	1745 ALTA VISTA DR OTTAWA ON K1A 0K6	ENE/246.0	-0.56	<u>128</u>
<u>18</u>	GEN	1 Dental Unit Detachment Ottawa HCC	1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	ENE/246.0	-0.56	<u>130</u>
<u>18</u>	EHS		1745 Alta Vista Dr Ottawa ON K1G0G7	ENE/246.0	-0.56	<u>130</u>
<u>18</u>	GEN	Department of National Defence RP Ops	1745 ALTA VISTA DR OTTAWA ON K1A 0K6	ENE/246.0	-0.56	<u>130</u>
<u>18</u>	GEN	1 Dental Unit Detachment Ottawa	1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	ENE/246.0	-0.56	<u>132</u>
<u>18</u>	GEN	Department of National Defence RP Ops	1745 ALTA VISTA DR OTTAWA ON K1A 0K6	ENE/246.0	-0.56	<u>134</u>
<u>18</u>	GEN	DND	1745 Alta Vista Drive Ottawa ON	ENE/246.0	-0.56	<u>135</u>

Executive Summary: Summary By Data Source

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 2 BORE site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	65.9	<u>6</u>
	ON	160.8	<u>12</u>

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Aug 31, 2024 has found that there are 9 EHS site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1867 Alta Vista Drive, Ottawa Ottawa ON K1G 5W8	0.0	<u>1</u>
	1867 Alta Vista Ottawa ON	0.0	<u>2</u>
	255 Smyth Rd Ottawa ON K1H 8M7	48.7	<u>4</u>
	1800 Alta Vista Drive OTTAWA ON K1G 4J5	123.4	<u>10</u>
	1800 Alta Vista Dr Ottawa ON K1G 4J5	123.4	<u>10</u>
	1870 Alta Vista Dr Ottawa ON K1G 6R7	148.2	<u>11</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1881 Fairbanks Avenue Ottawa ON K1H 5X6	229.6	<u>17</u>
	1745 Alta Vista Dr Ottawa ON K1G0G7	246.0	<u>18</u>
	1745 Alta Vista Drive Ottawa ON K1A 0K6	246.0	<u>18</u>

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Dec 31, 2024 has found that there are 54 GEN site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Regional Elevator	1867 Alta Vista Drive Ottawa ON K1G 5W2	0.0	<u>1</u>
Demolition Plus	1867 Alta Vista Dr. Ottawa ON K1E5W8	0.0	<u>1</u>
Broccolini	1867 Alta Vista Dr Ottawa ON K1G 5W8	0.0	<u>1</u>
CANADIAN DENTAL ASSOCIATION	1815 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	38.2	<u>3</u>
CANADIAN DENTAL ASSOCIATION	1815 ALTA VISTA DRIVE OTTAWA ON	38.2	<u>3</u>
MD FINANCIAL MANAGEMENT	1870 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	65.8	<u>5</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CANADIAN PHARMACEUTICAL ASSOC.	1785 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	106.0	<u>9</u>
CANADIAN PHARMACEUTICAL ASSOC. 08-551	1785 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	106.0	<u>9</u>
CANADIAN PHARMACEUTICAL ASSOCIATION	1785 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	106.0	<u>9</u>
57 North Prosthodontics	1785 Alta Vista Drive Unit 106 Ottawa ON K1G3Y6	106.0	<u>9</u>
57 North Prosthodontics	1785 Alta Vista Drive Unit 106 Ottawa ON K1G3Y6	106.0	<u>9</u>
57 North Prosthodontics	1785 Alta Vista Drive Unit 106 Ottawa ON K1G3Y6	106.0	<u>9</u>
57 North Prosthodontics	1785 Alta Vista Drive, Unit 106 Ottawa ON	106.0	<u>9</u>
CANADIAN RED CROSS SOCIETY	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN RED CROSS SOCIETY	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN RED CROSS SOCIETY 08-352	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON	123.4	<u>10</u>
CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES Head Office	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES Head Office	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES Head Office	1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	123.4	<u>10</u>
CANADIAN BLOOD SERVICES	1800 Alta Vista Drive Ottawa ON	123.4	<u>10</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
DEPARTMENT OF NATIONAL DEFENCE	HEALTH CARE CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
GVT. OF CAN. - NATIONAL DEFENCE 18-093	MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
DEPT. OF NATIONAL DEFENCE	HEALTH CARE CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
DEPT. OF NATIONAL DEFENCE	1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
GVT. OF CAN. - PUBLIC WORKS CANADA	CHP NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1M 0M3	246.0	<u>18</u>
GVT. OF CAN. - PUBLIC WORKS CANADA17-347	CHP NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1M 0M3	246.0	<u>18</u>
PUBLIC WORKS CANADA	CHP NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON	246.0	<u>18</u>
DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON	246.0	<u>18</u>
1 Dental Unit Detachment Ottawa	1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	246.0	<u>18</u>
DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
1 Dental Unit Detachment Ottawa	1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	246.0	<u>18</u>
1 Dental Unit Detachment Ottawa	1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	246.0	<u>18</u>
DEPT. OF NATIONAL DEFENCE	NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	246.0	<u>18</u>
Department of National Defence RP Ops	1745 ALTA VISTA DR OTTAWA ON K1A 0K6	246.0	<u>18</u>
1 Dental Unit Detachment Ottawa HCC	1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	246.0	<u>18</u>
Department of National Defence RP Ops	1745 ALTA VISTA DR OTTAWA ON K1A 0K6	246.0	<u>18</u>
1 Dental Unit Detachment Ottawa	1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	246.0	<u>18</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Department of National Defence RP Ops	1745 ALTA VISTA DR OTTAWA ON K1A 0K6	246.0	<u>18</u>
DND	1745 Alta Vista Drive Ottawa ON	246.0	<u>18</u>

NDFT - National Defense & Canadian Forces Fuel Tanks

A search of the NDFT database, dated Up to May 2001* has found that there are 1 NDFT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1745 ALTA VISTA DRIVE, OTTAWA ON K1A 0K6	246.0	<u>18</u>

NDSP - National Defense & Canadian Forces Spills

A search of the NDSP database, dated Mar 1999-Nov 2023 has found that there are 4 NDSP site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON K1A 0K6	246.0	<u>18</u>
	ON K1A 0K6	246.0	<u>18</u>
	ON K1A 0K6	246.0	<u>18</u>
	ON K1A 0K6	246.0	<u>18</u>

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 10 SCT site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Canadian Dental Association	1815 Alta Vista Dr Ottawa ON K1G 3Y6	38.2	<u>3</u>
Canadian Pharmacists Association	1785 Alta Vista Dr Ottawa ON K1G 3Y6	106.0	<u>9</u>
Canadian Pharmaceutical Journal	1785 Alta Vista Dr Suite 105 Ottawa ON K1G 3Y6	106.0	<u>9</u>
Arthroparm Pharmaceuticals Inc.	1785 Alta Vista Dr Unit 100 Ottawa ON K1G 3Y6	106.0	<u>9</u>
The DATA Group of Companies	1785 Alta Vista Dr Suite 105 Ottawa ON K1G 3Y6	106.0	<u>9</u>
CANADIAN PHARMACISTS ASSOC	1785 ALTA VISTA DR OTTAWA ON K1G 3Y6	106.0	<u>9</u>
Cdn Pharmacists Assn	1785 Alta Vista Dr Ottawa ON K1G 3Y6	106.0	<u>9</u>
ARTHROPHARM PHARMACEUTICALS	1785 Alta Vista Rd Unit 100 Ottawa ON K1G 3Y6	106.0	<u>9</u>
Canadian Pharmacists Journal	1785 Alta Vista Dr Ottawa ON K1G 3Y6	106.0	<u>9</u>
Canadian Blood Services	1800 Alta Vista Dr Ottawa ON K1G 4J5	123.4	<u>10</u>

SPL - Ontario Spills

A search of the SPL database, dated 1988-Jun 2024; Aug-Feb 2025 has found that there are 2 SPL site(s) within approximately 0.25 kilometers of the project property.


<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
NATIONAL DEFENCE	ALTA VISTA DRIVE NEAR SMYTH RD. MEDICAL BUILDING ALTA VISTA DRIVE OTTAWA CITY ON	67.6	<u>7</u>
Canadian Blood Services<UNOFFICIAL>	1800 Altavista Dr. Ottawa ON	123.4	<u>10</u>

WWIS - Water Well Information System

A search of the WWIS database, dated Dec 31 2023 has found that there are 9 WWIS site(s) within approximately 0.25 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	In Front of 2019 Bank Street, Northbound Lane Ottawa ON <i>Well ID: 7353977</i>	99.4	<u>8</u>
	ALTA VISTA OTTAWA ON <i>Well ID: 7237921</i>	223.5	<u>13</u>
	1881 FAUBANK AVE Ottawa ON <i>Well ID: 7166800</i>	226.1	<u>14</u>
	1881 FAIRBANKS AVE Ottawa ON <i>Well ID: 7159345</i>	226.1	<u>14</u>
	1881 FAUBANKS AVE Ottawa ON <i>Well ID: 7166799</i>	227.3	<u>15</u>
	1881 FAIRBANKS AVE Ottawa ON <i>Well ID: 7159344</i>	227.3	<u>15</u>
	1881 FAIRBANKS AVE Ottawa ON <i>Well ID: 7159346</i>	229.5	<u>16</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	188 FAUBROOK AVE Ottawa ON <i>Well ID:</i> 7166798	229.5	<u>16</u>
	1745 ALTA VISTA DR Ottawa ON <i>Well ID:</i> 7134618	246.0	<u>18</u>

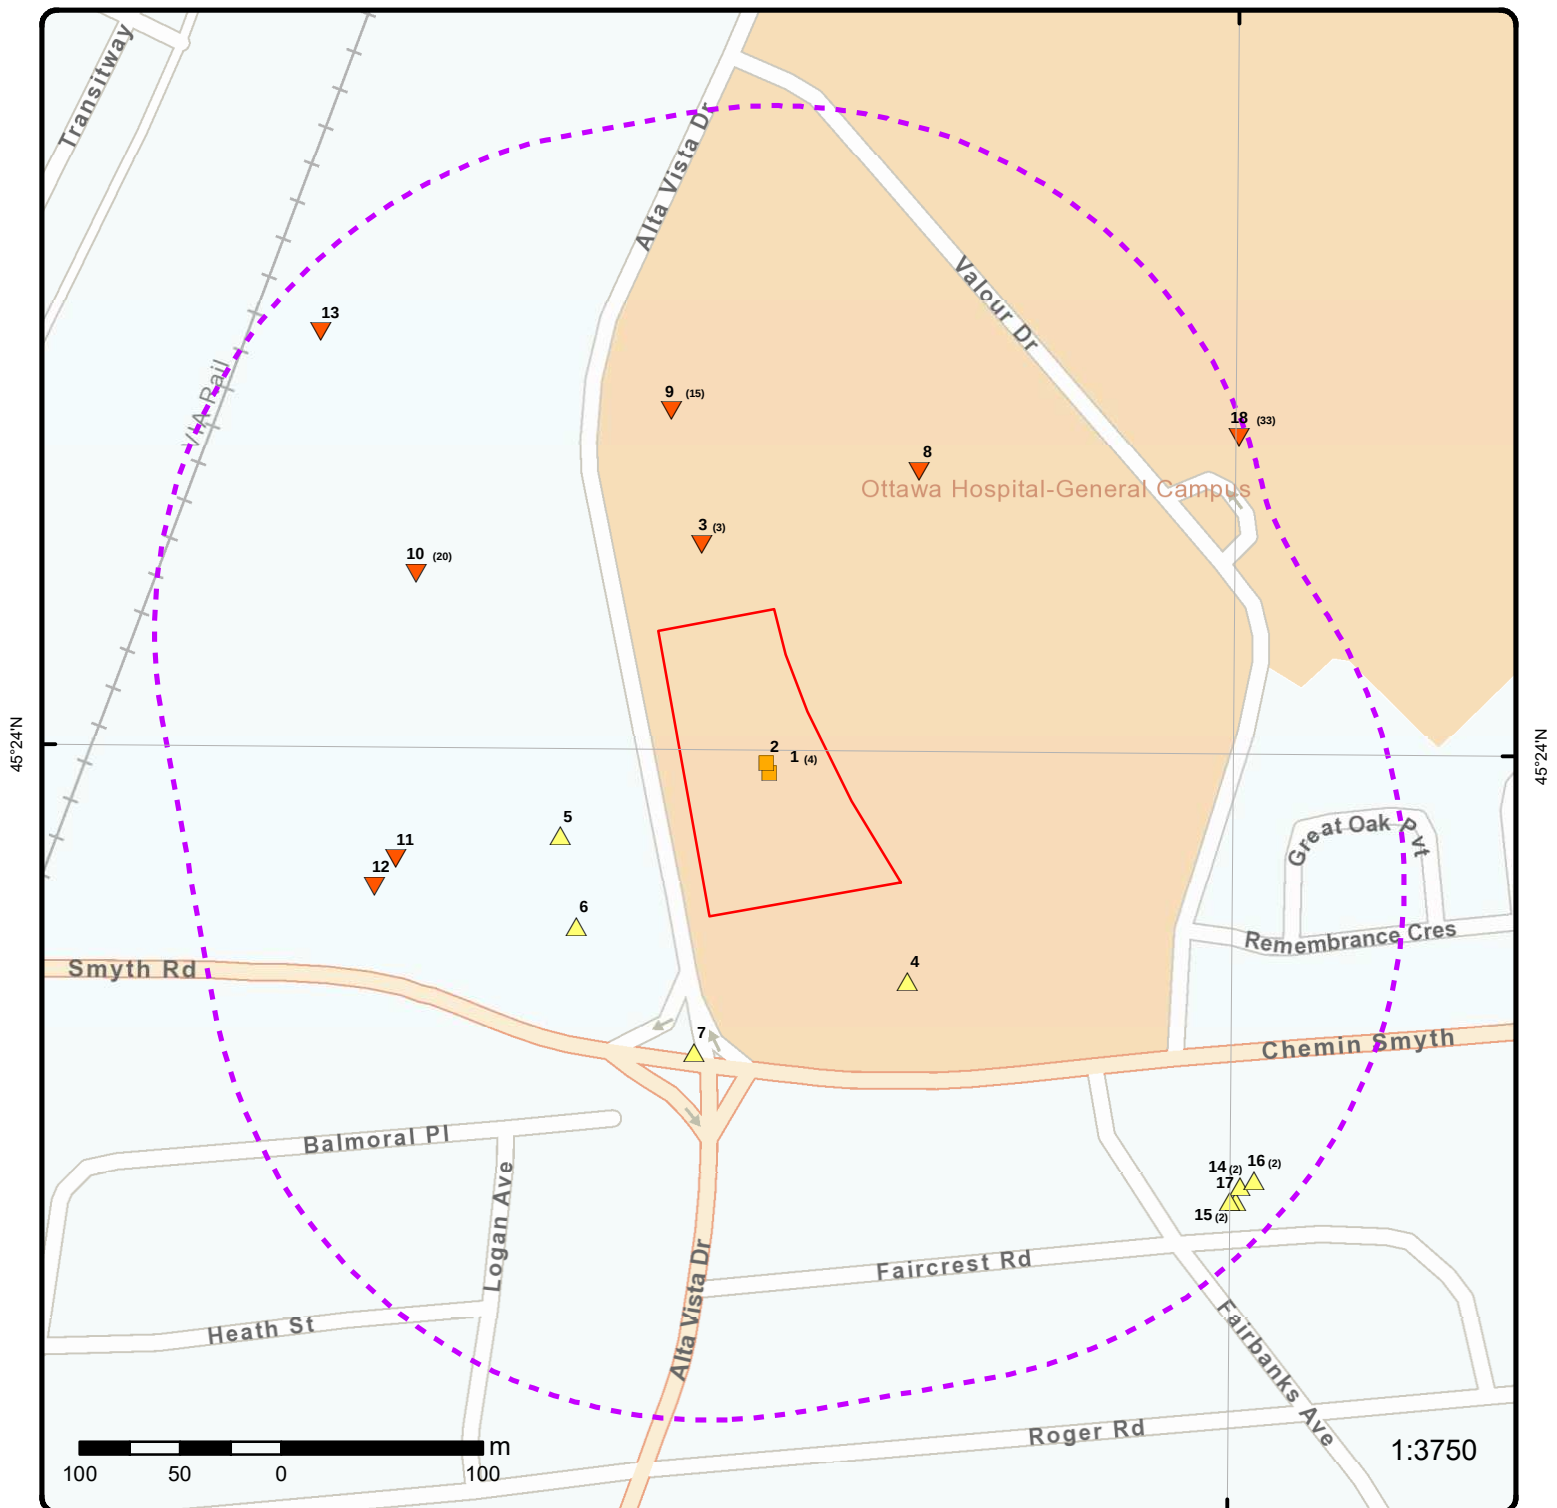


Map: 0.25 Kilometer Radius

Order Number: 25061200751

Address: 1867 Alta Vista Drive, Ottawa, ON



Project Property	Freeways; Highways	Beach	Shopping & Sports Area
Buffer Outline	Traffic Circle; Ramp	Airport	University/College
Eris Sites with Higher Elevation	Major Arterial; Minor Arterial	Industrial Area	Cemetery; Golf Course
Eris Sites with Same Elevation	Local Road	Military Base	Parkt (National)
Eris Sites with Lower Elevation	Service Road; Traffic Circle; Ramp	Aircraft Roads	Park (City/County)
Eris Sites with Unknown Elevation	Rail	Native Reservation	
		Hospital	

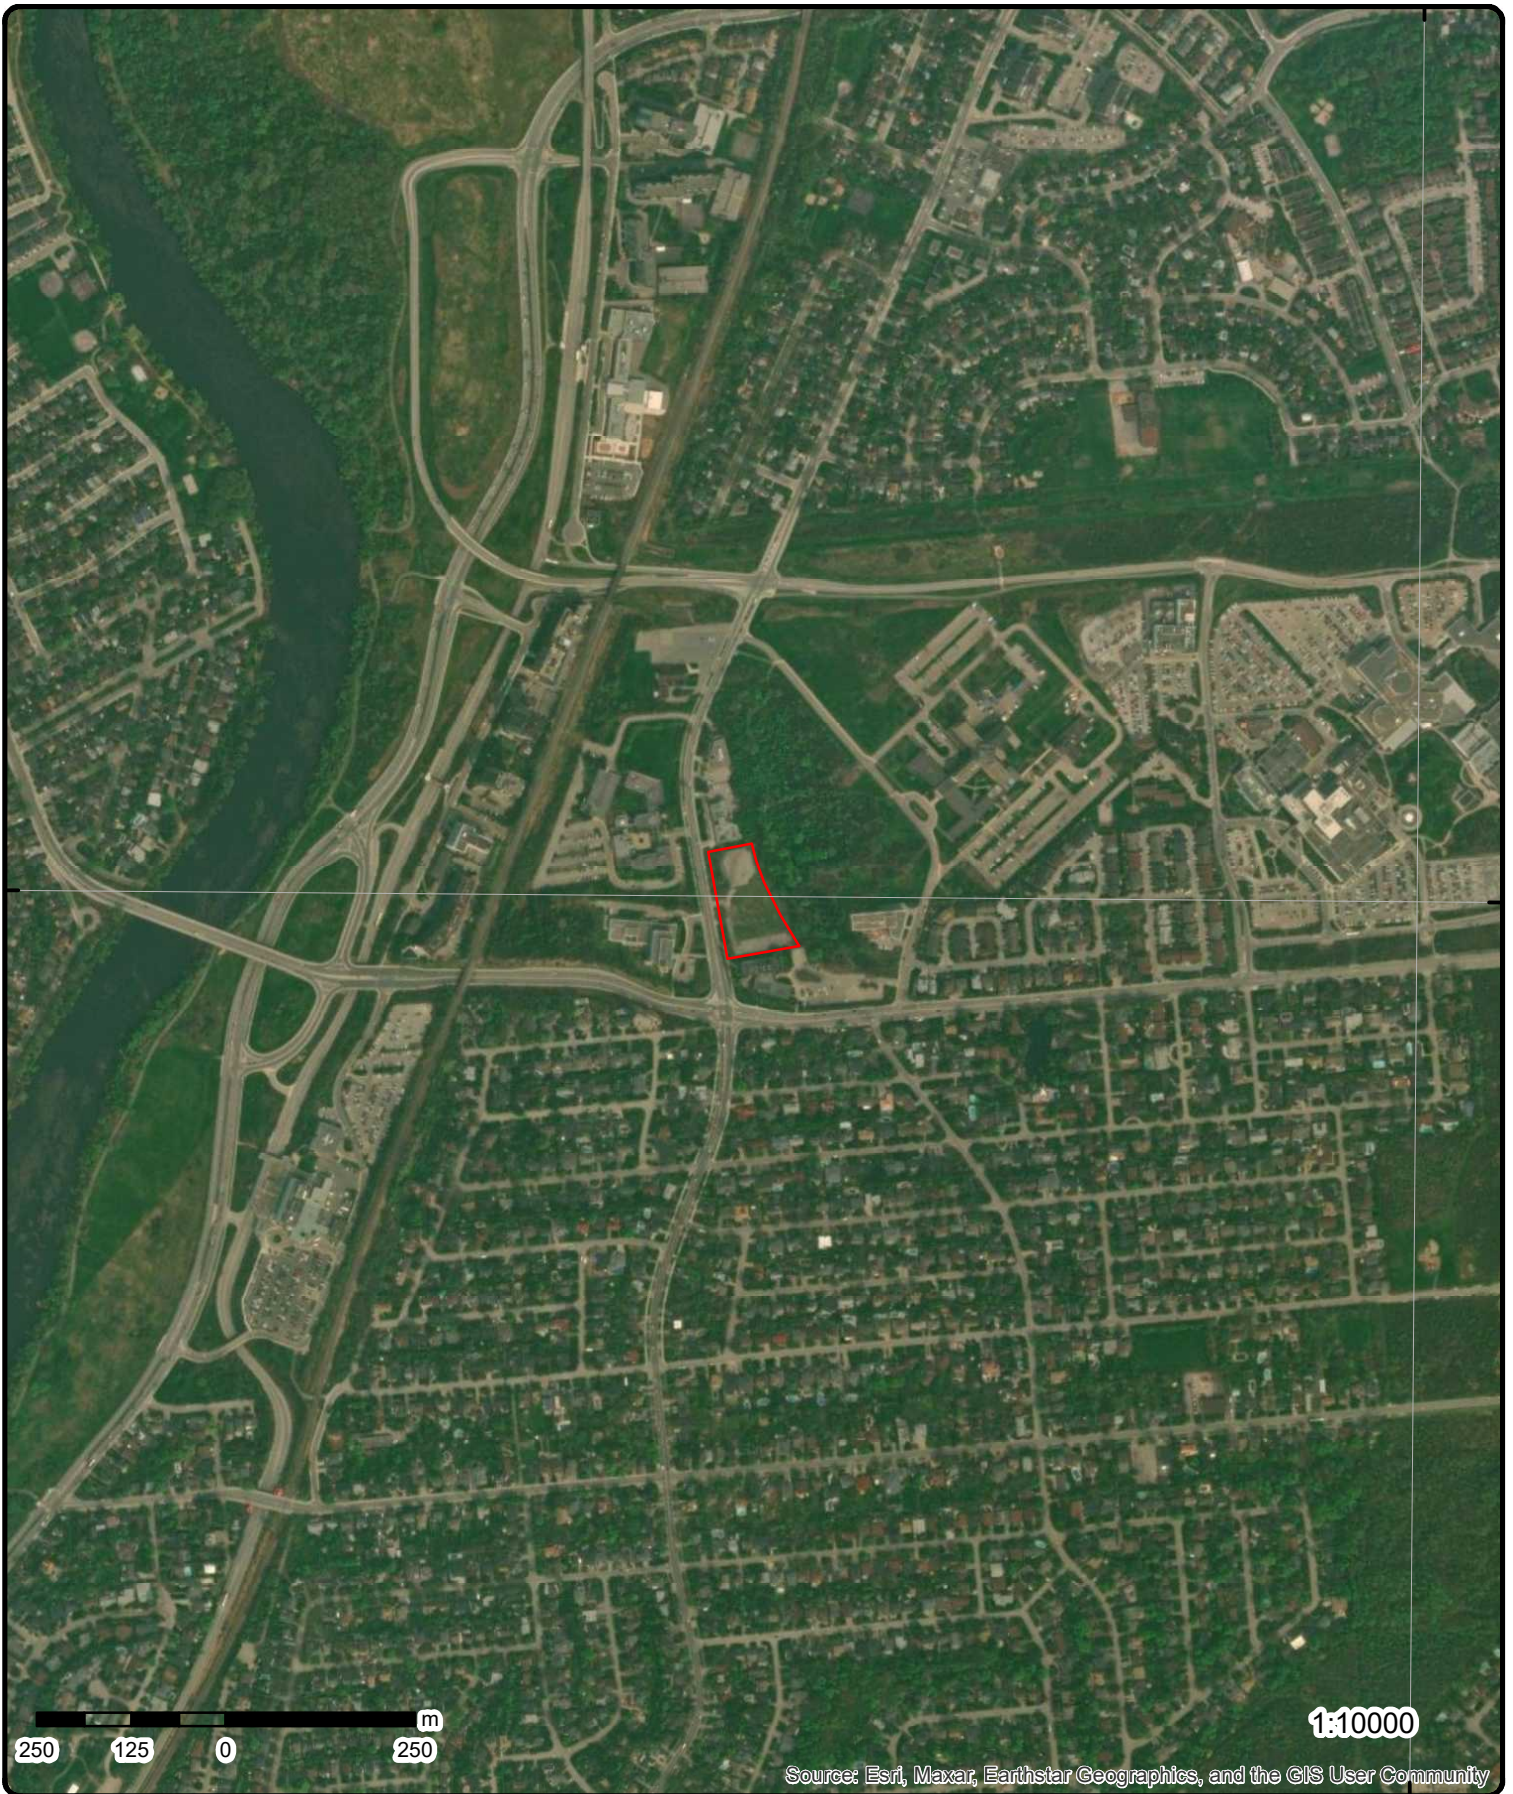

Aerial

Year: 2023


Order Number: 25061200751

Address: 1867 Alta Vista Drive, Ottawa, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

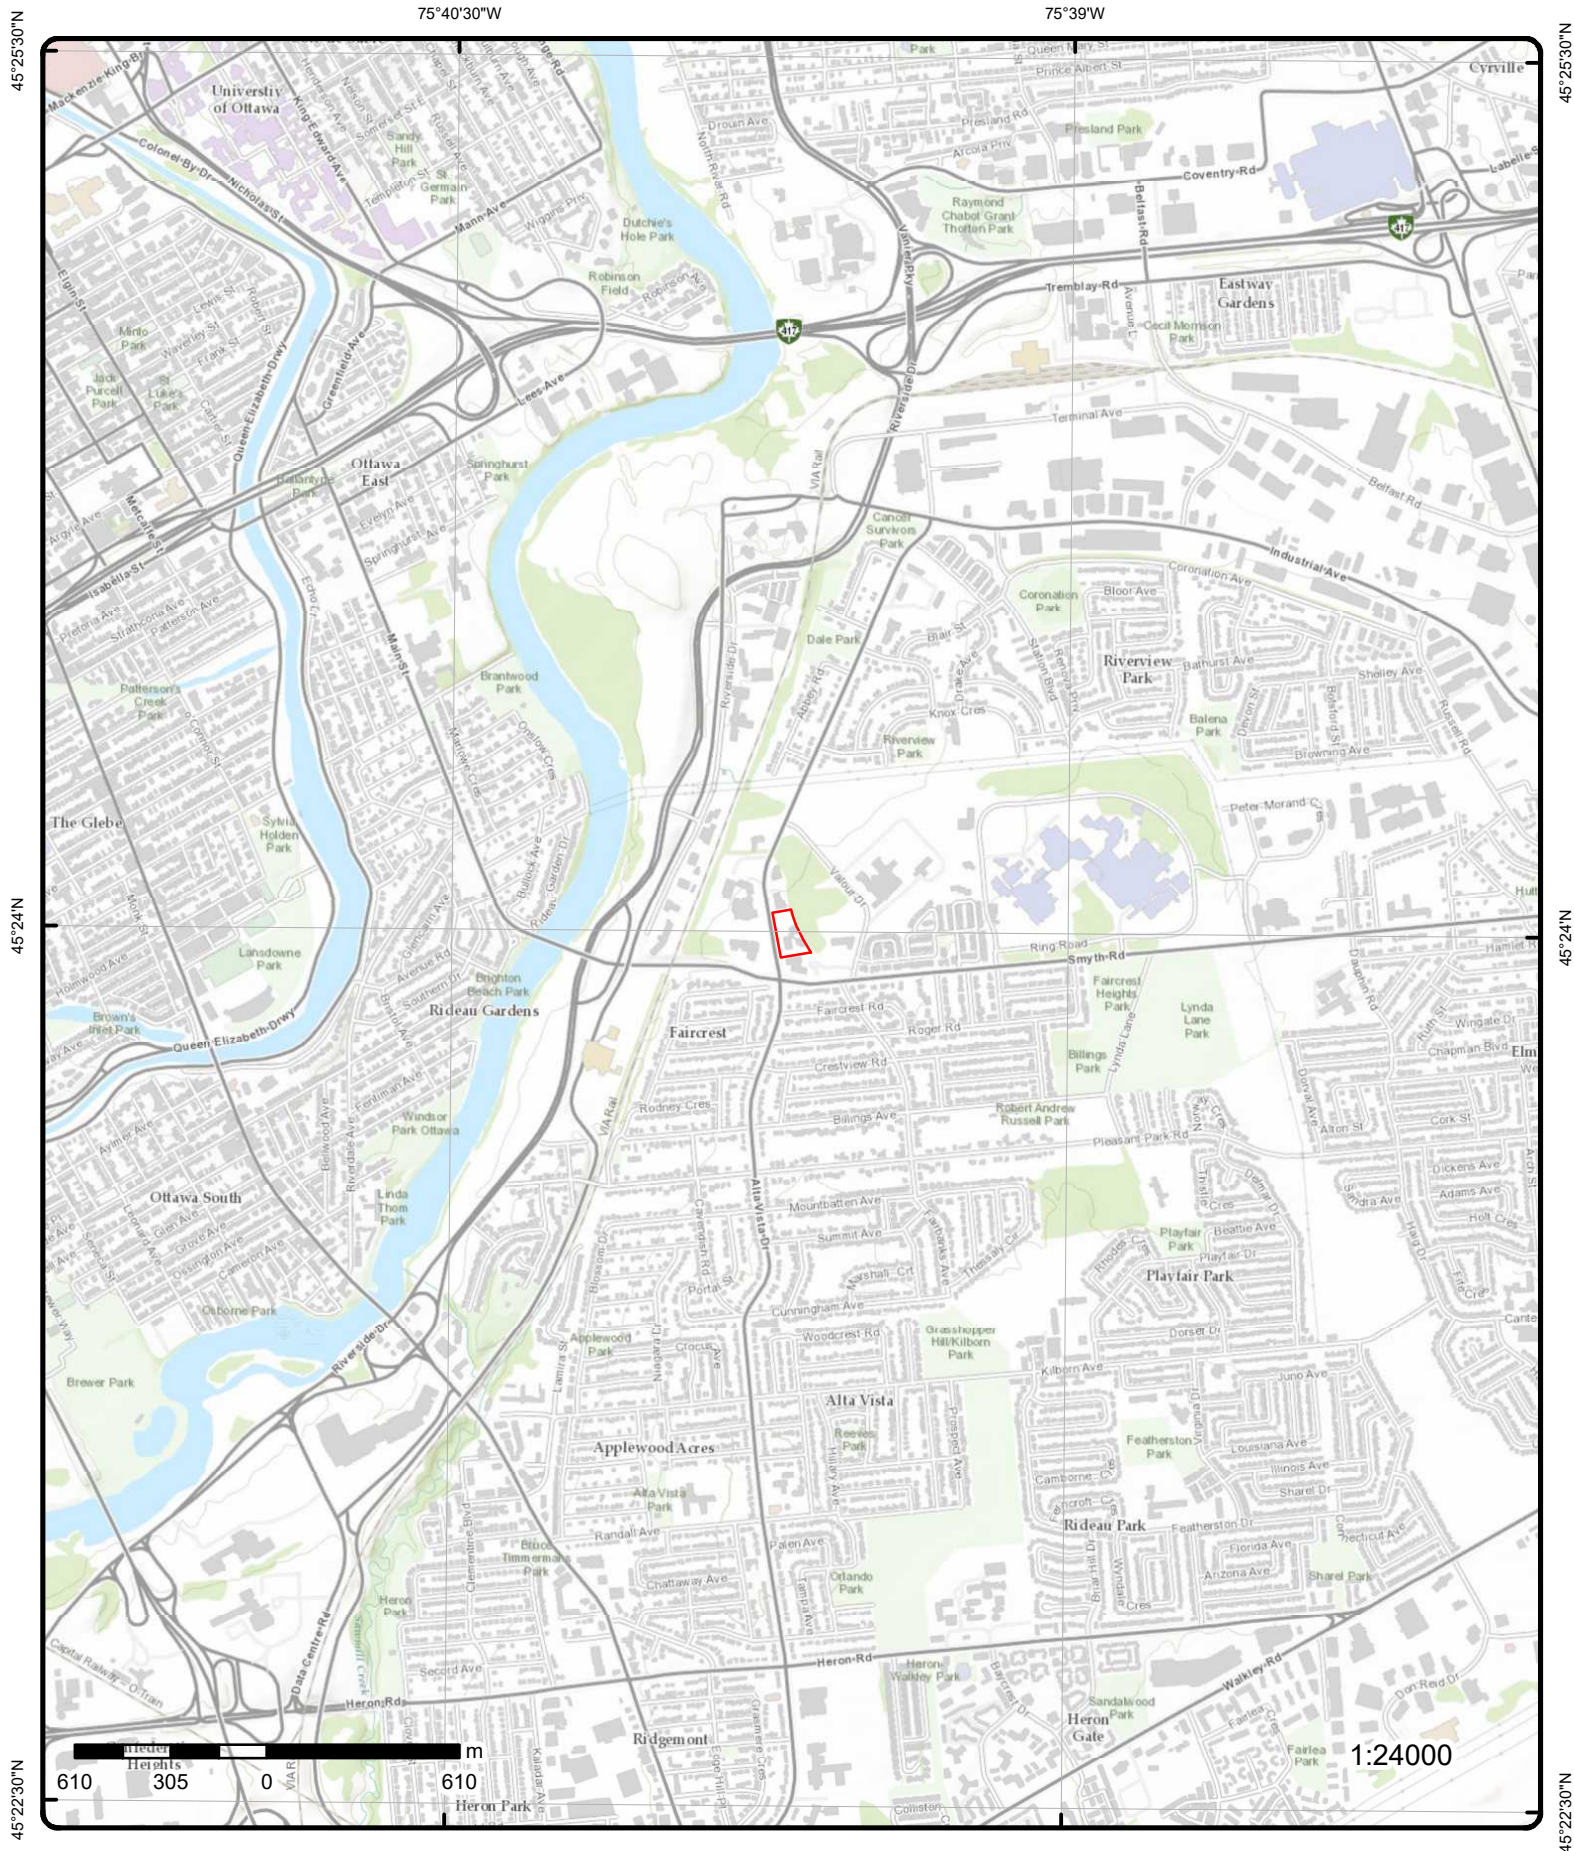

Topographic Map

Address: 1867 Alta Vista Drive, ON

Source: ESRI World Topographic Map

Order Number: 25061200751



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 4	E/0.0	73.2 / 0.00	Regional Elevator 1867 Alta Vista Drive Ottawa ON K1G 5W2	GEN

Generator Info

Generator No:	ON3502892	Choice of Contact:	CO_ADMIN
Approval Years:	2015	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	238291
Country:	Canada		
Co Admin:	Jim Smith		
Phone No Admin:	6137452444 Ext.241		
SIC Description:	ELEVATOR AND ESCALATOR INSTALLATION CONTRACTORS		

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

1	2 of 4	E/0.0	73.2 / 0.00	Demolition Plus 1867 Alta Vista Dr. Ottawa ON K1E5W8	GEN

Generator Info

Generator No:	ON7154600	Choice of Contact:	
Approval Years:	As of Dec 2017	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	145 I
Waste Class Name:	Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class:	251 L
Waste Class Name:	Waste oils/sludges (petroleum based)

Waste Detail(s)

Waste Class:	213 I

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Petroleum distillates			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
<u>2017 Generator Info</u>					
Gen No:	ON7154600		Choice of Contact:	CO_ADMIN	
ID:	28075		Phone No Official:	613-938-9881 Ext.	
Contaminated Fac:	N		Phone No Admin:	613-822-2700 Ext.232	
MHSW Facility:	N		County Ont:	OTTAWA CARLTON (RM)	
NAICS Code1:	811310		County Out:		
NAICS Code2:			District:	402	
NAICS Code3:					
Gen Name:	Demolition Plus				
Gen Div:					
Gen Op Name:	Demolition Plus				
Gen Op Div:					
Site Adrs1:	1867 Alta Vista Dr.				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K1E5W8				
Site Country:	Canada				
Co Official:	Shane Arbuthnot				
Co Admin:	Matt Wiens				
<u>2017 Generator Manifest</u>					
ID:	54532		Sum Received Qty:	25.0	
Generator No:	ON7154600		Waste Class Name:	PETROLEUM DISTILLATES	
Receiver Type:	035		Count Manifests:	1	
Waste Char:	I		District:	402	
Waste Code:	213				
<u>2017 Generator Manifest</u>					
ID:	54533		Sum Received Qty:	3290.0	
Generator No:	ON7154600		Waste Class Name:	OIL SKIMMINGS & SLUDGES	
Receiver Type:	035		Count Manifests:	4	
Waste Char:	L		District:	402	
Waste Code:	251				
<u>2017 Generator Manifest</u>					
ID:	54530		Sum Received Qty:	300.0	
Generator No:	ON7154600		Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES	
Receiver Type:	035		Count Manifests:	1	
Waste Char:	I		District:	402	
Waste Code:	145				
<u>2017 Generator Manifest</u>					
ID:	54531		Sum Received Qty:	150.0	
Generator No:	ON7154600		Waste Class Name:	ALIPHATIC SOLVENTS	
Receiver Type:	035		Count Manifests:	1	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Char: Waste Code:	L 212			District: 402	

1	3 of 4	E/0.0	73.2 / 0.00	Broccolini 1867 Alta Vista Dr Ottawa ON K1G 5W8	GEN

Generator Info

Generator No: ON9965839
Approval Years: As of Dec 2017
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 150 L
Waste Class Name: Inert organic wastes

2017 Generator Info

Gen No: ON9965839
ID: 38895
Contaminated Fac: N
MHSW Facility: N
NAICS Code1: 236210
NAICS Code2:
NAICS Code3:
Gen Name: Broccolini
Gen Div:
Gen Op Name: Broccolini
Gen Op Div:
Site Adrs1: 1867 Alta Vista Dr
Site Bldg:
Site Pobox:
Province In: ONTARIO
Site Adrs2:
Site City: Ottawa
Province Out:
Site Postal Code: K1G 5W8
Site Country: Canada
Co Official: Akshay George
Co Admin:

Choice of Contact: CO_OFFICIAL
Phone No Official: 613-818-8706 Ext.
Phone No Admin:
County Ont: OTTAWA CARLTON (RM)
County Out:
District: 402

2017 Generator Manifest

ID: 67972	Sum Received Qty: 1710.0
Generator No: ON9965839	Waste Class Name: INERT INORGANIC WASTES
Receiver Type: 035	Count Manifests: 1
Waste Char: L	District: 402
Waste Code: 150	

1	4 of 4	E/0.0	73.2 / 0.00	1867 Alta Vista Drive, Ottawa Ottawa ON K1G 5W8	EHS

Order No: 22091501205
 Nearest Intersection:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: C Report Type: RSC Report (Urban) Report Date: 20-SEP-22 Date Received: 15-SEP-22 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory					
Municipality: Client Prov/State: ON Search Radius (km): .3 X: -75.66125837 Y: 45.39989999					
<u>2</u>	1 of 1	NE/0.0	73.2 / 0.00	1867 Alta Vista Ottawa ON	EHS
Order No: 20160401021 Status: C Report Type: Standard Report Report Date: 07-APR-16 Date Received: 01-APR-16 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.661277 Y: 45.399942					
<u>3</u>	1 of 3	NNW/38.2	70.6 / -2.63	CANADIAN DENTAL ASSOCIATION 1815 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	GEN
Generator Info					
Generator No: ON1489532 Approval Years: 04 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Business Associations					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 813910					
<u>3</u>	2 of 3	NNW/38.2	70.6 / -2.63	Canadian Dental Association 1815 Alta Vista Dr Ottawa ON K1G 3Y6	SCT
Established: 01-DEC-02 Plant Size (ft²): Employment:					
--Details-- Description: Professional Organizations SIC/NAICS Code: 813920					
<u>3</u>	3 of 3	NNW/38.2	70.6 / -2.63	CANADIAN DENTAL ASSOCIATION 1815 ALTA VISTA DRIVE OTTAWA ON	GEN
Generator Info					
Generator No: ON2886935 Approval Years: 2013					
Choice of Contact: Contaminated Fac:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:				MHSW Facility: SIC Code: 621210	
OFFICES OF DENTISTS					
Waste Detail(s)					
Waste Class: Waste Class Name:		251 OIL SKIMMINGS & SLUDGES			
4	1 of 1	SE/48.7	76.6 / 3.39	255 Smyth Rd Ottawa ON K1H 8M7	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:		20200720010 C Standard Report 23-JUL-20 20-JUL-20 Fire Insur. Maps and/or Site Plans	Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y: ON .25 -75.6603766 45.3989739		
5	1 of 1	WSW/65.8	73.9 / 0.64	MD FINANCIAL MANAGEMENT 1870 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	GEN
Generator Info					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:		ON5498840 2016 Canada 522111	Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: CO_OFFICIAL No No 522111		
Waste Detail(s)					
Waste Class: Waste Class Name:		145 PAINT/PIGMENT/COATING RESIDUES			
6	1 of 1	WSW/65.9	74.8 / 1.59	ON	BORE
Borehole ID: OGF ID: Status: Type: Use: Completion Date: Static Water Level: Primary Water Use: Sec. Water Use: Total Depth m: Depth Ref: Depth Elev:		613072 215514376 Borehole JUN-1958 -999 Ground Surface	Inclin FLG: SP Status: Surv Elev: Piezometer: Primary Name: Municipality: Lot: Township: Latitude DD: Longitude DD: UTM Zone: Easting: No Initial Entry No No 45.399207 -75.662475 18 448151		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Drill Method:				Northing:	5027512
Orig Ground Elev m:	77.3			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	74.8				
Concession:					
Location D:					
Survey D:					
Comments:					
<u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218393568			Mat Consistency:	Soft
Top Depth:	0			Material Moisture:	
Bottom Depth:	1.5			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Silt			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:	Clay			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SILT. SOFT.				
Geology Stratum ID:	218393569			Mat Consistency:	Compact
Top Depth:	1.5			Material Moisture:	
Bottom Depth:	2.6			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	SAND,CLAY. COMPACT.				
Geology Stratum ID:	218393570			Mat Consistency:	
Top Depth:	2.6			Material Moisture:	
Bottom Depth:	2.7			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. BROKEN.				
Geology Stratum ID:	218393571			Mat Consistency:	Dense
Top Depth:	2.7			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. DENSE. BEDROCK. BEDROCK. 00000 015 00025 015 00040 018 00100 016 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
<u>Source</u>					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:				Horizontal:	NAD27
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:	Urban Geology Automated Information System (UGAIS)				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Details: Confiden 1:		File: OTTAWA2.txt RecordID: 055800 NTS_Sheet: 31G05G			
Source List					
Source Identifier:	1			Horizontal Datum:	NAD27
Source Type:	Data Survey			Vertical Datum:	Mean Average Sea Level
Source Date:	1956-1972			Projection Name:	Universal Transverse Mercator
Scale or Resolution:	Varies				
Source Name:	Urban Geology Automated Information System (UGAIS)				
Source Originators:	Geological Survey of Canada				
7	1 of 1	SSW/67.6	77.0 / 3.74	NATIONAL DEFENCE ALTA VISTA DRIVE NEAR SMYTH RD. MEDICAL BUILDING ALTA VISTA DRIVE OTTAWA CITY ON	SPL
Ref No:	11401			Municipality No:	20101
Year:				Nature of Damage:	
Incident Dt:	11/8/1988			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	11/8/1988			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:	OTTAWA CITY				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:	UNDERGROUND TANK LEAK				
Incident Preceding Spill:					
Incident Reason:	UNKNOWN				
Incident Summary:	NATIONAL DEFENCE- OIL SPILLED FROM LEAKING TANKS.				
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:					
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:	WATER				
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:					
SAC Action Class:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Call Report Locatn Geodata: Time Reported: System Facility Address:					
<u>8</u>	1 of 1	NE/99.4	69.9 / -3.36	In Front of 2019 Bank Street, Northbound Lane Ottawa ON	WWIS
Well ID: 7353977 Construction Date: Use 1st: Use 2nd: Final Well Status: Observation Wells Water Type: Casing Material: Audit No: Z231068 Tag: A278946 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 02/24/2020 Selected Flag: TRUE Abandonment Rec: Contractor: 1844 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008171841 Depth M: 5.08 Year Completed: 2019 Well Completed Dt: 11/04/2019 Audit No: Z231068 Path: Tag No: A278946 Contractor: 1844 Latitude: 45.4012517186236 Longitude: -75.6603228535544 Y: 45.40125171202871 X: -75.66032269242154					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008171841 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 11/04/2019 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 448321.00 North83: 5027738.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: 1008217029 Layer: 1					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:					
General Color:					
Material 1:		01			
Material 1 Desc:		FILL			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.2200000286102295			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008217030			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		1.2200000286102295			
Formation End Depth:		5.079999923706055			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1008217730			
Layer:		1			
Plug From:		0.30000001192092896			
Plug To:		0.8999999761581421			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1008218326			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		HSA			
<u>Pipe Information</u>					
Pipe ID:		1008215679			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008219004			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.15000000596046448			
Depth To:		3.049999952316284			
Casing Diameter:		5.079999923706055			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1008219349			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.049999952316284			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		5.880000114440918			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008219954			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1008219571			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:					
Water Found Depth UOM:					
<u>Hole Diameter</u>					
Hole ID:		1008218205			
Diameter:		20.299999237060547			
Depth From:		0.0			
Depth To:		5.079999923706055			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>9</u>	1 of 15	NNW/106.0	69.9 / -3.30	CANADIAN PHARMACISTS ASSOC 1785 ALTA VISTA DR OTTAWA ON K1G 3Y6	SCT
Established:		1907			
Plant Size (ft²):		0			
Employment:		50			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details--					
Description:		PERIODICALS: PUBLISHING, OR PUBLISHING AND PRINTING			
SIC/NAICS Code:		2721			
Description:		BOOKS: PUBLISHING, OR PUBLISHING AND PRINTING			
SIC/NAICS Code:		2731			
Description:		MISCELLANEOUS PUBLISHING			
SIC/NAICS Code:		2741			
Description:		Periodical Publishers			
SIC/NAICS Code:		511120			
Description:		Book Publishers			
SIC/NAICS Code:		511130			
Description:		Other Publishers			
SIC/NAICS Code:		511190			
9	2 of 15	NNW/106.0	69.9 / -3.30	ARTHROPHARM PHARMACEUTICALS 1785 Alta Vista Rd Unit 100 Ottawa ON K1G 3Y6	SCT
Established:		0000			
Plant Size (ft²):		0			
Employment:		0			
--Details--					
Description:		Pharmaceutical and Medicine Manufacturing			
SIC/NAICS Code:		325410			
9	3 of 15	NNW/106.0	69.9 / -3.30	Canadian Pharmacists Association 1785 Alta Vista Dr Ottawa ON K1G 3Y6	SCT
Established:		1907			
Plant Size (ft²):					
Employment:		50			
9	4 of 15	NNW/106.0	69.9 / -3.30	Canadian Pharmaceutical Journal 1785 Alta Vista Dr Suite 105 Ottawa ON K1G 3Y6	SCT
Established:					
Plant Size (ft²):		3			
Employment:					
9	5 of 15	NNW/106.0	69.9 / -3.30	Arthropharm Pharmaceuticals Inc. 1785 Alta Vista Dr Unit 100 Ottawa ON K1G 3Y6	SCT
Established:		1994			
Plant Size (ft²):					
Employment:		2			
--Details--					
Description:		Pharmaceuticals and Pharmacy Supplies Wholesaler-Distributors			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC/NAICS Code:		414510			
9	6 of 15	NNW/106.0	69.9 / -3.30	CANADIAN PHARMACEUTICAL ASSOC. 1785 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	GEN
<u>Generator Info</u>					
Generator No:	ON1209000			Choice of Contact:	
Approval Years:	89			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	3741
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	PHARM./MEDICAL IND.				
<u>Waste Detail(s)</u>					
Waste Class:	135				
Waste Class Name:	REACTIVE ANION WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
9	7 of 15	NNW/106.0	69.9 / -3.30	CANADIAN PHARMACEUTICAL ASSOC. 08-551 1785 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	GEN
<u>Generator Info</u>					
Generator No:	ON1209000			Choice of Contact:	
Approval Years:	92,93,94,95,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	3741
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	PHARM./MEDICAL IND.				
<u>Waste Detail(s)</u>					
Waste Class:	135				
Waste Class Name:	REACTIVE ANION WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
9	8 of 15	NNW/106.0	69.9 / -3.30	CANADIAN PHARMACEUTICAL ASSOCIATION 1785 ALTA VISTA DRIVE OTTAWA ON K1G 3Y6	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON1209000			Choice of Contact:	
Approval Years:	99,00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	3741
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	PHARM./MEDICAL IND.				
<u>Waste Detail(s)</u>					
Waste Class:	135				
Waste Class Name:	REACTIVE ANION WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
<u>9</u>	9 of 15	NNW/106.0	69.9 / -3.30	The DATA Group of Companies 1785 Alta Vista Dr Suite 105 Ottawa ON K1G 3Y6	SCT
Established:	1959				
Plant Size (ft²):					
Employment:	3				
<u>--Details--</u>					
Description:	Computer, Computer Peripheral and Pre-Packaged Software Wholesaler-Distributors				
SIC/NAICS Code:	417310				
Description:	Stationery and Office Supplies Wholesaler-Distributors				
SIC/NAICS Code:	418210				
<u>9</u>	10 of 15	NNW/106.0	69.9 / -3.30	Canadian Pharmacists Journal 1785 Alta Vista Dr Ottawa ON K1G 3Y6	SCT
Established:	01-JUL-68				
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:	Periodical Publishers				
SIC/NAICS Code:	511120				
<u>9</u>	11 of 15	NNW/106.0	69.9 / -3.30	Cdn Pharmacists Assn 1785 Alta Vista Dr Ottawa ON K1G 3Y6	SCT
Established:	01-DEC-07				
Plant Size (ft²):					
Employment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details-- Description: SIC/NAICS Code: Professional Organizations 813920					
9	12 of 15	NNW/106.0	69.9 / -3.30	57 North Prosthodontics 1785 Alta Vista Drive Unit 106 Ottawa ON K1G3Y6	GEN
Generator Info Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: ON7473763 As of Dec 2018 Registered Canada Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: Waste Class Name: 312 P Pathological wastes					
9	13 of 15	NNW/106.0	69.9 / -3.30	57 North Prosthodontics 1785 Alta Vista Drive Unit 106 Ottawa ON K1G3Y6	GEN
Generator Info Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: ON7473763 As of Jul 2020 Registered Canada Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: Waste Class Name: 312 P Pathological wastes					
9	14 of 15	NNW/106.0	69.9 / -3.30	57 North Prosthodontics 1785 Alta Vista Drive Unit 106 Ottawa ON K1G3Y6	GEN
Generator Info Generator No: Approval Years: Status: ON7473763 As of Nov 2021 Registered Choice of Contact: Contaminated Fac: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description:					
SIC Code:					
<u>Waste Detail(s)</u>					
Waste Class: 312 P Waste Class Name: Pathological wastes					

9	15 of 15	NNW/106.0	69.9 / -3.30	57 North Prosthodontics 1785 Alta Vista Drive, Unit 106 Ottawa ON	GEN

Generator Info

Generator No:	ON7473763	Choice of Contact:
Approval Years:	As of Oct 2022	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	PATHOLOGICAL WASTES

Generator Info as of Dec 2024

Generator No:	ON7473763
Generator Company Name:	57 North Prosthodontics
Street:	1785 Alta Vista Drive, Unit 106
City:	Ottawa
Province State:	Ontario
Country:	Canada
Postal Code:	K1G3Y6
Waste Class:	312 P

Waste Class Decoded:

312 - PATHOLOGICAL WASTES

2018 Generator Info

Gen No:	ON7473763	Choice of Contact:	CO_OFFICIAL
ID:	29779	Phone No Official:	6136950070 Ext.
Contaminated Fac:	N	Phone No Admin:	6136950070 Ext.
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621210	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	57 North Prosthodontics		
Gen Div:			
Gen Op Name:	57 North Prosthodontics		
Gen Op Div:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Adrs1:		1785 Alta Vista Drive			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		Unit 106			
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K1G3Y6			
Site Country:		Canada			
Co Official:		Maged Mishriky			
Co Admin:		Dima Sweidan			

2018 Generator Manifest

ID:	56071	Sum Received Qty:	4.0
Generator No:	ON7473763	Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035	Count Manifests:	1
Waste Char:	P	District:	306
Waste Code:	312		

2019 Generator Info

Gen No:	ON7473763	Choice of Contact:	CO_OFFICIAL
ID:	30100	Phone No Official:	6136950070 Ext.
Contaminated Fac:	N	Phone No Admin:	6136950070 Ext.
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621210	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	57 North Prosthodontics		
Gen Div:			
Gen Op Name:	57 North Prosthodontics		
Gen Op Div:			
Site Adrs1:	1785 Alta Vista Drive		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:	Unit 106		
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K1G3Y6		
Site Country:	Canada		
Co Official:	Maged Mishriky		
Co Admin:	Dima Sweidan		

2019 Generator Manifest

ID:	56177	Sum Received Qty:	16.0
Generator No:	ON7473763	Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035	Count Manifests:	3
Waste Char:	P	District:	306
Waste Code:	312		

2020 Generator Info

Gen No:	ON7473763	Choice of Contact:	CO_OFFICIAL
ID:	29798	Phone No Official:	6136950070 Ext.
Contaminated Fac:	N	Phone No Admin:	6136950070 Ext.
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621210	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Name: 57 North Prosthodontics Gen Div: Gen Op Name: 57 North Prosthodontics Gen Op Div: Site Adrs1: 1785 Alta Vista Drive Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Unit 106 Site City: Ottawa Province Out: Site Postal Code: K1G3Y6 Site Country: Canada Co Official: Maged Mishriky Co Admin: Dima Sweidan					
<u>2020 Generator Manifest</u>					
ID:	52515			Sum Received Qty:	7.0
Generator No:	ON7473763			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	1
Waste Char:	P			District:	306
Waste Code:	312				
<u>2021 Generator Info</u>					
Gen No:	ON7473763			Choice of Contact:	CO_OFFICIAL
ID:	30413			Phone No Official:	6136950070 Ext.
Contaminated Fac:	N			Phone No Admin:	6136950070 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621210			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	57 North Prosthodontics				
Gen Div:					
Gen Op Name:	57 North Prosthodontics				
Gen Op Div:					
Site Adrs1:	1785 Alta Vista Drive				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:	Unit 106				
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K1G3Y6				
Site Country:	Canada				
Co Official:	Maged Mishriky				
Co Admin:	Dima Sweidan				
<u>2021 Generator Manifest</u>					
ID:	54682			Sum Received Qty:	15.0
Generator No:	ON7473763			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	2
Waste Char:	P			District:	306
Waste Code:	312				
10	1 of 20	WNW/123.4	70.2 / -3.02	1800 Alta Vista Drive OTTAWA ON K1G 4J5	EHS
Order No:	20030918029w			Nearest Intersection:	
Status:	C			Municipality:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type:	Online Mapless			Client Prov/State:	ON
Report Date:	9/18/03			Search Radius (km):	0.25
Date Received:	9/18/03			X:	0
Previous Site Name:				Y:	0
Lot/Building Size:					
Additional Info Ordered:					

[10](#)

2 of 20

WNW/123.4

70.2 / -3.02

CANADIAN RED CROSS SOCIETY
1800 ALTA VISTA DRIVE
OTTAWA ON K1G 4J5

GEN

Generator Info

Generator No:	ON0269106	Choice of Contact:	
Approval Years:	86,87,88,89,90	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	8685
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	BLOOD BANK LAB.		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	148
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	263
Waste Class Name:	ORGANIC LABORATORY CHEMICALS

[10](#)

3 of 20

WNW/123.4

70.2 / -3.02

CANADIAN RED CROSS SOCIETY
1800 ALTA VISTA DRIVE
OTTAWA ON K1G 4J5

GEN

Generator Info

Generator No:	ON0269106	Choice of Contact:	
Approval Years:	92,93,97,98	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	8685
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	BLOOD BANK LAB.		

Waste Detail(s)

Waste Class:	148
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
10	4 of 20	WNW/123.4	70.2 / -3.02	CANADIAN RED CROSS SOCIETY 08-352 1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	GEN
<u>Generator Info</u>					
Generator No:		ON0269106		Choice of Contact:	
Approval Years:		94,95,96		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				8685	
Co Admin:					
Phone No Admin:					
SIC Description:		BLOOD BANK LAB.			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
10	5 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES 1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	GEN
<u>Generator Info</u>					
Generator No:		ON0269106		Choice of Contact:	
Approval Years:		99,00,01,02,03,04,05,06,07,08		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				8685	
Co Admin:					
Phone No Admin:					
SIC Description:		BLOOD BANK LAB.			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:			122		
Waste Class Name:			ALKALINE WASTES - OTHER METALS		
<u>Waste Detail(s)</u>					
Waste Class:			113		
Waste Class Name:			ACID WASTE - OTHER METALS		
<u>Waste Detail(s)</u>					
Waste Class:			263		
Waste Class Name:			ORGANIC LABORATORY CHEMICALS		
<u>Waste Detail(s)</u>					
Waste Class:			312		
Waste Class Name:			PATHOLOGICAL WASTES		
<u>Waste Detail(s)</u>					
Waste Class:			145		
Waste Class Name:			PAINT/PIGMENT/COATING RESIDUES		
<u>Waste Detail(s)</u>					
Waste Class:			146		
Waste Class Name:			OTHER SPECIFIED INORGANICS		
<u>Waste Detail(s)</u>					
Waste Class:			121		
Waste Class Name:			ALKALINE WASTES - HEAVY METALS		
<u>Waste Detail(s)</u>					
Waste Class:			121		
Waste Class Name:			ALKALINE WASTES - HEAVY METALS		
<u>Waste Detail(s)</u>					
Waste Class:			261		
Waste Class Name:			PHARMACEUTICALS		
<u>Waste Detail(s)</u>					
Waste Class:			112		
Waste Class Name:			ACID WASTE - HEAVY METALS		
<u>Waste Detail(s)</u>					
Waste Class:			121		
Waste Class Name:			ALKALINE WASTES - HEAVY METALS		
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>10</u>	6 of 20	WNW/123.4	70.2 / -3.02	Canadian Blood Services 1800 Alta Vista Dr Ottawa ON K1G 4J5	SCT
Established:					
Plant Size (ft²):					
Employment:					
<u>--Details--</u>					
Description:		Book Publishers			
SIC/NAICS Code:		511130			
Description:		Medical and Diagnostic Laboratories			
SIC/NAICS Code:		621510			
<u>10</u>	7 of 20	WNW/123.4	70.2 / -3.02	1800 Alta Vista Dr Ottawa ON K1G 4J5	EHS
Order No:	20060915013			Nearest Intersection:	Smyth rd
Status:	C			Municipality:	Ottawa
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	9/26/2006			Search Radius (km):	0.25
Date Received:	9/15/2006			X:	-75.663191
Previous Site Name:				Y:	45.401128
Lot/Building Size:					
Additional Info Ordered:		Unplotted Water Wells			
<u>10</u>	8 of 20	WNW/123.4	70.2 / -3.02	Canadian Blood Services<UNOFFICIAL> 1800 Altavista Dr. Ottawa ON	SPL
Ref No:	8135-6W9P7Z			Municipality No:	
Year:				Nature of Damage:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Dt: 12/7/2006 Dt MOE Arvl on Scn: MOE Reported Dt: 12/7/2006 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: Canadian Blood Services<UNOFFICIAL> Site Address: 1800 Altavista Dr. Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Other Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Canadian Blood Services: Glycol to CB, cln Environment Impact: Confirmed Health Env Consequence: Nature of Impact: Contaminant Qty: 22.5 L Contaminant Qty 1: 22.5 Contaminant Unit: L Contaminant Code: 24 Contaminant Name: ETHYLENE GLYCOL (ANTIFREEZE) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
Discharger Report: Material Group: Impact to Health: Agency Involved:					

[10](#)

9 of 20

WNW/123.4

70.2 / -3.02

CANADIAN BLOOD SERVICES
1800 ALTA VISTA DRIVE
OTTAWA ON K1G 4J5

GEN

Generator Info

Generator No: ON0269106
Approval Years: 2009
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 551114

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		Head Offices			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:	121				
Waste Class Name:	ALKALINE WASTES - HEAVY METALS				
10	10 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES 1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	GEN
<u>Generator Info</u>					
Generator No:	ON0269106			Choice of Contact:	
Approval Years:	2010			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	551114
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Head Offices				
<u>Waste Detail(s)</u>					
Waste Class:	145				
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES				
<u>Waste Detail(s)</u>					
Waste Class:	331				
Waste Class Name:	WASTE COMPRESSED GASES				
<u>Waste Detail(s)</u>					
Waste Class:	212				
Waste Class Name:	ALIPHATIC SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	121				
Waste Class Name:	ALKALINE WASTES - HEAVY METALS				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
<u>Waste Detail(s)</u>					
Waste Class:	263				
Waste Class Name:	ORGANIC LABORATORY CHEMICALS				
<u>Waste Detail(s)</u>					
Waste Class:	312				
Waste Class Name:	PATHOLOGICAL WASTES				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
10	11 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES 1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	GEN
<u>Generator Info</u>					
Generator No:	ON0269106			Choice of Contact:	
Approval Years:	2011			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	551114
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Head Offices			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
10	12 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES 1800 ALTA VISTA DRIVE	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OTTAWA ON K1G 4J5					
<u>Generator Info</u>					
Generator No:	ON0269106			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	551114
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Head Offices			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
10	13 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES 1800 ALTA VISTA DRIVE OTTAWA ON	GEN
<u>Generator Info</u>					
Generator No:		ON0269106		Choice of Contact:	
Approval Years:		2013		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 551114	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
10	14 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES 1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	GEN

Generator Info

Generator No:	ON0269106	Choice of Contact:	CO_OFFICIAL
Approval Years:	2016	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	551114

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country:		Canada			
Co Admin:		Melinda JM O'Riordan			
Phone No Admin:		613-739-2140 Ext.			
SIC Description:		551114			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			

10	15 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES 1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	GEN

Generator Info

Generator No:	ON0269106	Choice of Contact:	CO_OFFICIAL
Approval Years:	2015	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	551114
Country:	Canada		
Co Admin:	Melinda Deroche		
Phone No Admin:	613-739-2140 Ext.		
SIC Description:	551114		

Waste Detail(s)

Waste Class:	122
Waste Class Name:	ALKALINE WASTES - OTHER METALS

Waste Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class:	331
Waste Class Name:	WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class:	145
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			

[10](#)

16 of 20

WNW/123.4

70.2 / -3.02

CANADIAN BLOOD SERVICES
1800 ALTA VISTA DRIVE
OTTAWA ON K1G 4J5

GEN

Generator Info

Generator No:	ON0269106	Choice of Contact:	CO_OFFICIAL
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	551114
Country:	Canada		
Co Admin:	Melinda Deroche		
Phone No Admin:	613-739-2140 Ext.		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		551114			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
10	17 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES Head Office 1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	GEN
<u>Generator Info</u>					
Generator No:	ON0269106			Choice of Contact:	
Approval Years:	As of Dec 2018			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		148 L			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		148 I			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		211 I			
Waste Class Name:		Aromatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:			212 L		
Waste Class Name:			Aliphatic solvents and residues		
<u>Waste Detail(s)</u>					
Waste Class:			221 I		
Waste Class Name:			Light fuels		
<u>Waste Detail(s)</u>					
Waste Class:			251 L		
Waste Class Name:			Waste oils/sludges (petroleum based)		
<u>Waste Detail(s)</u>					
Waste Class:			252 L		
Waste Class Name:			Waste crankcase oils and lubricants		
<u>Waste Detail(s)</u>					
Waste Class:			263 I		
Waste Class Name:			Misc. waste organic chemicals		
<u>Waste Detail(s)</u>					
Waste Class:			331 I		
Waste Class Name:			Waste compressed gases including cylinders		
<u>Waste Detail(s)</u>					
Waste Class:			113 C		
Waste Class Name:			Acid solutions - containing other metals and non-metals		
<u>Waste Detail(s)</u>					
Waste Class:			263 L		
Waste Class Name:			Misc. waste organic chemicals		
<u>Waste Detail(s)</u>					
Waste Class:			312 P		
Waste Class Name:			Pathological wastes		
<u>Waste Detail(s)</u>					
Waste Class:			112 C		
Waste Class Name:			Acid solutions - containing heavy metals		
<u>Waste Detail(s)</u>					
Waste Class:			121 C		
Waste Class Name:			Alkaline slutions - containing heavy metals		
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
 <u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
 <u>Waste Detail(s)</u>					
Waste Class:		146 R			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			

<u>10</u>	18 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES Head Office 1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	GEN

Generator Info

Generator No:	ON0269106	Choice of Contact:
Approval Years:	As of Jul 2020	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	263 I
Waste Class Name:	Misc. waste organic chemicals

Waste Detail(s)

Waste Class:	148 L
Waste Class Name:	Misc. wastes and inorganic chemicals

Waste Detail(s)

Waste Class:	212 I
Waste Class Name:	Aliphatic solvents and residues

Waste Detail(s)

Waste Class:	145 I
Waste Class Name:	Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class:	148 I
Waste Class Name:	Misc. wastes and inorganic chemicals

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		331 I Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		113 C Acid solutions - containing other metals and non-metals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		221 I Light fuels			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		112 C Acid solutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		251 L Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		212 L Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		148 C Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		122 C Alkaline slutions - containing other metals and non-metals (not cyanide)			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		263 L Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		211 I Aromatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		252 L Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		146 R			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
10	19 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES Head Office 1800 ALTA VISTA DRIVE OTTAWA ON K1G 4J5	GEN
<u>Generator Info</u>					
Generator No:		ON0269106		Choice of Contact:	
Approval Years:		As of Nov 2021		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		113 C			
Waste Class Name:		Acid solutions - containing other metals and non-metals			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		211 I			
Waste Class Name:		Aromatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		221 I			
Waste Class Name:		Light fuels			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
<u>Waste Detail(s)</u>					
Waste Class:		146 R			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class:		148 L			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		148 I			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
10	20 of 20	WNW/123.4	70.2 / -3.02	CANADIAN BLOOD SERVICES 1800 Alta Vista Drive Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON0269106			Choice of Contact:	
Approval Years:	As of Oct 2022			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		146 R			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		112 C ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		121 C ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		211 I AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		263 L ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		146 T OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		148 I INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		148 L INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		148 C INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		212 L ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		263 I ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		312 P PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		252 L			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		221 I			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		113 C			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Generator Info as of Dec 2024</u>					
Generator No:		ON0269106			
Generator Company Name:		CANADIAN BLOOD SERVICES			
Street:		1800 Alta Vista Drive			
City:		Ottawa			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K1G 4J5			
Waste Class:		212 L,146 T,113 C,122 C,145 I,331 I,212 I,221 I,121 C,148 C,263 L,148 I,263 I,112 C,211 I,146 R,148 L,312 P,251 L,252 L			
Waste Class Decoded:					
212 - ALIPHATIC SOLVENTS; 146 - OTHER SPECIFIED INORGANICS; 113 - ACID WASTE - OTHER METALS; 122 - ALKALINE WASTES - OTHER METALS; 145 - PAINT/PIGMENT/COATING RESIDUES; 331 - WASTE COMPRESSED GASES; 212 - ALIPHATIC SOLVENTS; 221 - LIGHT FUELS; 121 - ALKALINE WASTES - HEAVY METALS; 148 - INORGANIC LABORATORY CHEMICALS; 263 - ORGANIC LABORATORY CHEMICALS; 148 - INORGANIC LABORATORY CHEMICALS; 263 - ORGANIC LABORATORY CHEMICALS; 112 - ACID WASTE - HEAVY METALS; 211 - AROMATIC SOLVENTS; 146 - OTHER SPECIFIED INORGANICS; 148 - INORGANIC LABORATORY CHEMICALS; 312 - PATHOLOGICAL WASTES; 251 - OIL SKIMMINGS & SLUDGES; 252 - WASTE OILS & LUBRICANTS					
<u>2017 Generator Info</u>					
Gen No:		ON0269106	Choice of Contact:		CO_OFFICIAL
ID:		2717	Phone No Official:		6137392140 Ext.
Contaminated Fac:		N	Phone No Admin:		613-739-2140 Ext.
MHSW Facility:		N	County Ont:		OTTAWA CARLTON (RM)
NAICS Code1:		551114	County Out:		
NAICS Code2:			District:		402
NAICS Code3:					
Gen Name:		CANADIAN BLOOD SERVICES			
Gen Div:		Head Office			
Gen Op Name:		CANADIAN BLOOD SERVICES			
Gen Op Div:		Head Office			
Site Adrs1:		1800 ALTA VISTA DRIVE			
Site Bldg:		Warehouse			
Site Pobox:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1G 4J5			
Site Country:		Canada			
Co Official:		Melinda O'Riordan			
Co Admin:		Melinda JM O'Riordan			
<u>2017 Generator Manifest</u>					
ID:	12632			Sum Received Qty:	480.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	5
Waste Char:	L			District:	805
Waste Code:	263				
<u>2017 Generator Manifest</u>					
ID:	12628			Sum Received Qty:	3462.96
Generator No:	ON0269106			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	152
Waste Char:	P			District:	402
Waste Code:	312				
<u>2017 Generator Manifest</u>					
ID:	12631			Sum Received Qty:	85.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	2
Waste Char:	I			District:	805
Waste Code:	263				
<u>2017 Generator Manifest</u>					
ID:	12627			Sum Received Qty:	65.6
Generator No:	ON0269106			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	4
Waste Char:	P			District:	305
Waste Code:	312				
<u>2017 Generator Manifest</u>					
ID:	12629			Sum Received Qty:	15.0
Generator No:	ON0269106			Waste Class Name:	ACID WASTE - HEAVY METALS
Receiver Type:	040			Count Manifests:	2
Waste Char:	C			District:	805
Waste Code:	112				
<u>2017 Generator Manifest</u>					
ID:	12630			Sum Received Qty:	26.0
Generator No:	ON0269106			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	3
Waste Char:	C			District:	805
Waste Code:	148				
<u>2018 Generator Info</u>					
Gen No:	ON0269106			Choice of Contact:	CO_OFFICIAL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ID:	2657			Phone No Official:	6137392383 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	551114			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		CANADIAN BLOOD SERVICES			
Gen Div:		Head Office			
Gen Op Name:		CANADIAN BLOOD SERVICES			
Gen Op Div:		Head Office			
Site Adrs1:		1800 ALTA VISTA DRIVE			
Site Bldg:		Warehouse			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1G 4J5			
Site Country:		Canada			
Co Official:		Denis Sicard			
Co Admin:					
<u>2018 Generator Manifest</u>					
ID:	12481			Sum Received Qty:	3225.72
Generator No:	ON0269106			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	139
Waste Char:	P			District:	402
Waste Code:	312				
<u>2018 Generator Manifest</u>					
ID:	12482			Sum Received Qty:	232.0
Generator No:	ON0269106			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	1
Waste Char:	T			District:	402
Waste Code:	146				
<u>2018 Generator Manifest</u>					
ID:	12486			Sum Received Qty:	240.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	3
Waste Char:	L			District:	805
Waste Code:	263				
<u>2018 Generator Manifest</u>					
ID:	12483			Sum Received Qty:	35.0
Generator No:	ON0269106			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	252				
<u>2018 Generator Manifest</u>					
ID:	12484			Sum Received Qty:	8.0
Generator No:	ON0269106			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	2
Waste Char:	C			District:	805
Waste Code:	148				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2018 Generator Manifest</u>					
ID:	12485			Sum Received Qty:	240.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	3
Waste Char:	I			District:	805
Waste Code:	263				
<u>2019 Generator Info</u>					
Gen No:	ON0269106			Choice of Contact:	CO_OFFICIAL
ID:	2587			Phone No Official:	6137392383 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	551114			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		CANADIAN BLOOD SERVICES			
Gen Div:		Head Office			
Gen Op Name:		CANADIAN BLOOD SERVICES			
Gen Op Div:		Head Office			
Site Adrs1:		1800 ALTA VISTA DRIVE			
Site Bldg:		Warehouse			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1G 4J5			
Site Country:		Canada			
Co Official:		Denis Sicard			
Co Admin:					
<u>2019 Generator Manifest</u>					
ID:	12113			Sum Received Qty:	51.0
Generator No:	ON0269106			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	3
Waste Char:	P			District:	305
Waste Code:	312				
<u>2019 Generator Manifest</u>					
ID:	12114			Sum Received Qty:	2785.0
Generator No:	ON0269106			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	148
Waste Char:	P			District:	402
Waste Code:	312				
<u>2019 Generator Manifest</u>					
ID:	12119			Sum Received Qty:	140.0
Generator No:	ON0269106			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	040			Count Manifests:	2
Waste Char:	I			District:	805
Waste Code:	212				
<u>2019 Generator Manifest</u>					
ID:	12120			Sum Received Qty:	320.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiver Type:	040			Count Manifests:	4
Waste Char:	I			District:	805
Waste Code:	263				
<u>2019 Generator Manifest</u>					
ID:	12121			Sum Received Qty:	120.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	4
Waste Char:	L			District:	805
Waste Code:	263				
<u>2019 Generator Manifest</u>					
ID:	12117			Sum Received Qty:	63.0
Generator No:	ON0269106			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	4
Waste Char:	C			District:	805
Waste Code:	148				
<u>2019 Generator Manifest</u>					
ID:	12115			Sum Received Qty:	5.0
Generator No:	ON0269106			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	040			Count Manifests:	1
Waste Char:	R			District:	805
Waste Code:	146				
<u>2019 Generator Manifest</u>					
ID:	12116			Sum Received Qty:	3.0
Generator No:	ON0269106			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	040			Count Manifests:	1
Waste Char:	T			District:	805
Waste Code:	146				
<u>2019 Generator Manifest</u>					
ID:	12118			Sum Received Qty:	5.0
Generator No:	ON0269106			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	1
Waste Char:	I			District:	805
Waste Code:	148				
<u>2020 Generator Info</u>					
Gen No:	ON0269106			Choice of Contact:	CO_OFFICIAL
ID:	2500			Phone No Official:	6137392383 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	551114			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	CANADIAN BLOOD SERVICES				
Gen Div:	Head Office				
Gen Op Name:	CANADIAN BLOOD SERVICES				
Gen Op Div:	Head Office				
Site Adrs1:	1800 ALTA VISTA DRIVE				
Site Bldg:	Warehouse				
Site Pobox:					
Province In:	ONTARIO				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1G 4J5			
Site Country:		Canada			
Co Official:		Denis Sicard			
Co Admin:					
<u>2020 Generator Manifest</u>					
ID:	10966			Sum Received Qty:	100.0
Generator No:	ON0269106			Waste Class Name:	ALKALINE WASTES - OTHER METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	402
Waste Code:	122				
<u>2020 Generator Manifest</u>					
ID:	10969			Sum Received Qty:	151.0
Generator No:	ON0269106			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	2
Waste Char:	L			District:	402
Waste Code:	252				
<u>2020 Generator Manifest</u>					
ID:	10971			Sum Received Qty:	5.0
Generator No:	ON0269106			Waste Class Name:	ALKALINE WASTES - HEAVY METALS
Receiver Type:	040			Count Manifests:	1
Waste Char:	C			District:	805
Waste Code:	121				
<u>2020 Generator Manifest</u>					
ID:	10972			Sum Received Qty:	30.0
Generator No:	ON0269106			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	2
Waste Char:	C			District:	805
Waste Code:	148				
<u>2020 Generator Manifest</u>					
ID:	10975			Sum Received Qty:	700.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	9
Waste Char:	I			District:	805
Waste Code:	263				
<u>2020 Generator Manifest</u>					
ID:	10974			Sum Received Qty:	5.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	1
Waste Char:	C			District:	805
Waste Code:	263				
<u>2020 Generator Manifest</u>					
ID:	10964			Sum Received Qty:	411.6
Generator No:	ON0269106			Waste Class Name:	PATHOLOGICAL WASTES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiver Type:	035			Count Manifests:	16
Waste Char:	P			District:	305
Waste Code:	312				
<u>2020 Generator Manifest</u>					
ID:	10965			Sum Received Qty:	3440.77
Generator No:	ON0269106			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	137
Waste Char:	P			District:	402
Waste Code:	312				
<u>2020 Generator Manifest</u>					
ID:	10967			Sum Received Qty:	200.0
Generator No:	ON0269106			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	145				
<u>2020 Generator Manifest</u>					
ID:	10973			Sum Received Qty:	1.0
Generator No:	ON0269106			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	1
Waste Char:	I			District:	805
Waste Code:	148				
<u>2020 Generator Manifest</u>					
ID:	10970			Sum Received Qty:	10.0
Generator No:	ON0269106			Waste Class Name:	ACID WASTE - HEAVY METALS
Receiver Type:	040			Count Manifests:	1
Waste Char:	C			District:	805
Waste Code:	112				
<u>2020 Generator Manifest</u>					
ID:	10968			Sum Received Qty:	173.0
Generator No:	ON0269106			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	2
Waste Char:	T			District:	402
Waste Code:	146				
<u>2020 Generator Manifest</u>					
ID:	10976			Sum Received Qty:	10.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	1
Waste Char:	L			District:	805
Waste Code:	263				
<u>2021 Generator Info</u>					
Gen No:	ON0269106			Choice of Contact:	CO_OFFICIAL
ID:	2453			Phone No Official:	6137392383 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	551114			County Out:	
NAICS Code2:				District:	402

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code3:					
Gen Name:		CANADIAN BLOOD SERVICES			
Gen Div:		Head Office			
Gen Op Name:		CANADIAN BLOOD SERVICES			
Gen Op Div:		Head Office			
Site Adrs1:		1800 ALTA VISTA DRIVE			
Site Bldg:		Warehouse			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1G 4J5			
Site Country:		Canada			
Co Official:		Denis Sicard			
Co Admin:					
<u>2021 Generator Manifest</u>					
ID:	11049			Sum Received Qty:	3773.69
Generator No:	ON0269106			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	152
Waste Char:	P			District:	402
Waste Code:	312				
<u>2021 Generator Manifest</u>					
ID:	11050			Sum Received Qty:	20.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	1
Waste Char:	A			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11047			Sum Received Qty:	135.26
Generator No:	ON0269106			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	8
Waste Char:	P			District:	305
Waste Code:	312				
<u>2021 Generator Manifest</u>					
ID:	11048			Sum Received Qty:	600.0
Generator No:	ON0269106			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	306
Waste Code:	212				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					
ID:	11051			Sum Received Qty:	465.0
Generator No:	ON0269106			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	040			Count Manifests:	6
Waste Char:	I			District:	805
Waste Code:	263				
<u>2021 Generator Manifest</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	07-DEC-20			Search Radius (km):	.25
Date Received:	02-DEC-20			X:	-75.66362494
Previous Site Name:				Y:	45.3995026
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans				

12	1 of 1	WSW/160.8	72.9 / -0.36	ON	BORE
Borehole ID:	613077			Inclin FLG:	No
OGF ID:	215514381			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	JUN-1958			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.399379
Total Depth m:	-999			Longitude DD:	-75.663755
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	448051
Drill Method:				Northing:	5027532
Orig Ground Elev m:	71.5			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	72				
Concession:					
Location D:					
Survey D:					
Comments:					

Borehole Geology Stratum

Geology Stratum ID:	218393586			Mat Consistency:	
Top Depth:	2			Material Moisture:	
Bottom Depth:				Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Bedrock			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	BEDROCK. NSE. BEDROCK. BEDROCK. 00000 018 00029 015 00065 014 25 015 00 **Note: Many records provided by the department have a truncated [Stratum Description] field.				
Geology Stratum ID:	218393585			Mat Consistency:	Compact
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Shale			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:	CLAY. COMPACT.				
Geology Stratum ID:	218393584			Mat Consistency:	Loose
Top Depth:	0			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3: Material 4: Gsc Material Description: Stratum Description:				Geologic Period: Depositional Gen:	
		SAND. LOOSE.			
Source					
Source Type:		Data Survey		Source Appl:	
Source Orig:		Geological Survey of Canada		Source Iden:	
Source Date:		1956-1972		Scale or Res:	
Confidence:				Horizontal:	
Observatio:				Verticalda:	
Source Name:		Urban Geology Automated Information System (UGAIS)		Spatial/Tabular	
Source Details:		File: OTTAWA2.txt RecordID: 055850 NTS_Sheet: 31G05G		1	
Confiden 1:				Varies	
Source List					
Source Identifier:		1		Horizontal Datum:	
Source Type:		Data Survey		Vertical Datum:	
Source Date:		1956-1972		Projection Name:	
Scale or Resolution:		Varies		NAD27	
Source Name:		Urban Geology Automated Information System (UGAIS)		Mean Average Sea Level	
Source Originators:		Geological Survey of Canada		Universal Transverse Mercator	
13	1 of 1	NW/223.5	67.9 / -5.36	ALTA VISTA OTTAWA ON	WWIS
Well ID:		7237921		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring		Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	
Water Type:				Selected Flag:	
Casing Material:				Abandonment Rec:	
Audit No:		Z180824		Contractor:	
Tag:		A140449		Form Version:	
Constructn Method:				Owner:	
Elevation (m):				County:	
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		GLOUCESTER TOWNSHIP			
Site Info:					
Additional Detail(s) (Map)					
Bore Hole ID:		1005309983		Tag No:	
Depth M:				Contractor:	
Year Completed:		2015		Latitude:	
Well Completed Dt:		02/06/2015		Longitude:	
Audit No:		Z180824		Y:	
Path:				X:	
Bore Hole Information					
Bore Hole ID:		1005309983		Elevation:	
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	448024.00
Code OB Desc:				North83:	5027807.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		02/06/2015	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1005560263					
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005560256			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005560260			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005560261			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1005560259			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		14.0			
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:	1005560258				
Diameter:	2.0				
Depth From:	0.0				
Depth To:	275.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
<u>14</u>	1 of 2	ESE/226.1	78.2 / 5.00	1881 FAIRBANKS AVE Ottawa ON	WWIS
Well ID:	7159345			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	02/17/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z123987			Contractor:	7241
Tag:	A097269			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1003476758			Tag No:	A097269
Depth M:	4.88			Contractor:	7241
Year Completed:	2011			Latitude:	45.3980681966718
Well Completed Dt:	01/11/2011			Longitude:	-75.6582542788534
Audit No:	Z123987			Y:	45.398068190374
Path:				X:	-75.65825411672125
<u>Bore Hole Information</u>					
Bore Hole ID:	1003476758			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	448480.00
Code OB Desc:				North83:	5027383.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	01/11/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003778789			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003778788			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003778799			
Layer:		1			
Plug From:		0.0			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003778800			
Layer:		2			
Plug From:		1.5199999809265137			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003778797			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID:		1003778787			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003778793			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003778794			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		4.880000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
 <u>Water Details</u>					
Water ID:		1003778792			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1003778790			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1003778791			
Diameter:		5.710000038146973			
Depth From:		1.5199999809265137			
Depth To:		4.880000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
14	2 of 2	ESE/226.1	78.2 / 5.00	1881 FAUBANK AVE Ottawa ON	WWIS
Well ID:	7166800			Flowing (Y/N):	
Construction Date:				Flow Rate:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	08/05/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z116800			Contractor:	9999
Tag:	A097269			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7166800.pdf				
Additional Detail(s) (Map)					
Well Completed Date:					
Year Completed:					
Depth (m):	4.88				
Latitude:	45.3980681966718				
Longitude:	-75.6582542788534				
X:	-75.65825411672125				
Y:	45.398068190374				
Path:	716\7166800.pdf				
Bore Hole Information					
Bore Hole ID:	1003546101			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	448480.00
Code OB Desc:				North83:	5027383.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:				UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
Overburden and Bedrock					
Materials Interval					
Formation ID:	1003897379				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:	73				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003897378			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003897388			
Layer:		1			
Plug From:		0.0			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003897389			
Layer:		2			
Plug From:		1.5199999809265137			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1003897387			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003897377			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003897383			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003897384			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		4.880000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.25			
 <u>Water Details</u>					
Water ID:		1003897382			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1003897381			
Diameter:		5.710000038146973			
Depth From:		1.5199999809265137			
Depth To:		4.880000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
 <u>Hole Diameter</u>					
Hole ID:		1003897380			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
15	1 of 2	ESE/227.3	79.1 / 5.86	1881 FAIRBANKS AVE Ottawa ON	WWIS
Well ID:	7159344			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	02/17/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z123985			Contractor:	7241
Tag:	A097268			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
OTTAWA CITY					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1003476756			Tag No:	A097268
Depth M:	4.88			Contractor:	7241
Year Completed:	2011			Latitude:	45.398004823596
Well Completed Dt:	01/11/2011			Longitude:	-75.6583174263414
Audit No:	Z123985			Y:	45.39800481688946
Path:				X:	-75.65831726377856
<u>Bore Hole Information</u>					
Bore Hole ID:	1003476756			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	448475.00
Code OB Desc:				North83:	5027376.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	01/11/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003778753				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	1.5199999809265137				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003778754				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003778764			
Layer:		1			
Plug From:		0.0			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003778765			
Layer:		2			
Plug From:		1.5199999809265137			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003778762			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003778752			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003778758			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003778759			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		4.880000114440918			
Screen Material:		5			
Screen Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1003778757			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003778756			
Diameter:		5.710000038146973			
Depth From:		1.5199999809265137			
Depth To:		4.800000190734863			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1003778755			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
15	2 of 2	ESE/227.3	79.1 / 5.86	1881 FAUBANKS AVE Ottawa ON	WWIS
Well ID:		7166799		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	08/05/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:		Z116798		Contractor:	9999
Tag:		A097268		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/7167166799.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:					
Year Completed:					
Depth (m):		4.88			
Latitude:		45.398004823596			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Longitude:		-75.6583174263414			
X:		-75.65831726377856			
Y:		45.39800481688946			
Path:		716\7166799.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1003546099			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	448475.00
Code OB Desc:				North83:	5027376.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:				UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003897326				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	05				
Material 2 Desc:	CLAY				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	1.5199999809265137				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003897327				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	15				
Material 1 Desc:	LIMESTONE				
Material 2:					
Material 2 Desc:					
Material 3:	73				
Material 3 Desc:	HARD				
Formation Top Depth:	1.5199999809265137				
Formation End Depth:	4.880000114440918				
Formation End Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1003897337				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		2			
Plug From:		1.5199999809265137			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003897336			
Layer:		1			
Plug From:		0.0			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003897335			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003897325			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003897331			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003897332			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		4.880000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
 <u>Water Details</u>					
Water ID:		1003897330			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1003897328			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1003897329			
Diameter:		5.710000038146973			
Depth From:		1.5199999809265137			
Depth To:		4.329999923706055			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>16</u>	1 of 2	ESE/229.5	78.2 / 5.00	1881 FAIRBANKS AVE Ottawa ON	WWIS
Well ID:	7159346			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	02/17/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z123988			Contractor:	7241
Tag:	A097270			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159346.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	01/11/2011				
Year Completed:	2011				
Depth (m):	4.88				
Latitude:	45.3980957141452				
Longitude:	-75.6581651615553				
X:	-75.65816500027901				
Y:	45.39809570734342				
Path:	715\7159346.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003477010			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	448487.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	5027386.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		01/11/2011		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003778820			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003778821			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003778832			
Layer:		2			
Plug From:		1.5199999809265137			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003778831			
Layer:		1			
Plug From:		0.0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003778829			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003778819			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003778825			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003778826			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		4.880000114440918			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1003778824			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003778823			
Diameter:		5.710000038146973			
Depth From:		1.5199999809265137			
Depth To:		4.880000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1003778822			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
16	2 of 2	ESE/229.5	78.2 / 5.00	188 FAUBROOK AVE Ottawa ON	WWIS
Well ID:	7166798			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	08/05/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z116799			Contractor:	9999
Tag:	A097270			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/716\7166798.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:					
Year Completed:					
Depth (m):	4.88				
Latitude:	45.3980957141452				
Longitude:	-75.6581651615553				
X:	-75.65816500027901				
Y:	45.39809570734342				
Path:	716\7166798.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003546097			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	448487.00
Code OB Desc:				North83:	5027386.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:				UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003897203			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		1.5199999809265137			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003897202			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.5199999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003897213			
Layer:		2			
Plug From:		1.5199999809265137			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003897212			
Layer:		1			
Plug From:		0.0			
Plug To:		1.5199999809265137			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003897211			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Pipe Information</u>					
Pipe ID:		1003897201			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003897207			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Casing Diameter:		3.450000047683716			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003897208			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.8300000429153442			
Screen End Depth:		4.329999923706055			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.210000038146973			
<u>Water Details</u>					
Water ID:		1003897206			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003897205			
Diameter:		5.710000038146973			
Depth From:		1.5199999809265137			
Depth To:		4.880000114440918			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1003897204			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
17	1 of 1	ESE/229.6	79.1 / 5.86	1881 Fairbanks Avenue Ottawa ON K1H 5X6	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 20101130053 Status: C Report Type: Standard Report Report Date: 12/8/2010 Date Received: 11/30/2010 11:39:39 AM Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.658282 Y: 45.398001					
18	1 of 33	ENE/246.0	72.7 / -0.56	DEPARTMENT OF NATIONAL DEFENCE HEALTH CARE CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN
<u>Generator Info</u>					
Generator No: ON0046505 Approval Years: 92,93,97 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: DEFENCE SERVICES					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 8111					
<u>Waste Detail(s)</u>					
Waste Class: 312 Waste Class Name: PATHOLOGICAL WASTES					
<u>Waste Detail(s)</u>					
Waste Class: 243 Waste Class Name: PCB'S					
<u>Waste Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
<u>Waste Detail(s)</u>					
Waste Class: 269 Waste Class Name: NON-HALOGENATED PESTICIDES					
<u>Waste Detail(s)</u>					
Waste Class: 331 Waste Class Name: WASTE COMPRESSED GASES					
<u>Waste Detail(s)</u>					
Waste Class: 112 Waste Class Name: ACID WASTE - HEAVY METALS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			

<u>18</u>	2 of 33	ENE/246.0	72.7 / -0.56	GVT. OF CAN. - NATIONAL DEFENCE 18-093 MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN

Generator Info

Generator No:	ON0046505	Choice of Contact:	
Approval Years:	94,95,96	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	8111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	DEFENCE SERVICES		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:			243 PCB'S		
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:			252 WASTE OILS & LUBRICANTS		
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:			263 ORGANIC LABORATORY CHEMICALS		
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:			331 WASTE COMPRESSED GASES		
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:			269 NON-HALOGENATED PESTICIDES		
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:			145 PAINT/PIGMENT/COATING RESIDUES		
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:			112 ACID WASTE - HEAVY METALS		
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:			121 ALKALINE WASTES - HEAVY METALS		
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:			213 PETROLEUM DISTILLATES		
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:			148 INORGANIC LABORATORY CHEMICALS		
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:			211 AROMATIC SOLVENTS		
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			

18	3 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE HEALTH CARE CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN

Generator Info

Generator No:	ON0046505	Choice of Contact:	
Approval Years:	98	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	8111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	DEFENCE SERVICES		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	145
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class:	243
Waste Class Name:	PCB'S

Waste Detail(s)

Waste Class:	112
Waste Class Name:	ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class:	148
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			

<u>18</u>	4 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN

Generator Info

Generator No:	ON0046505	Choice of Contact:	
Approval Years:	99,00	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	8111
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	DEFENCE SERVICES		

Waste Detail(s)

Waste Class:	331
Waste Class Name:	WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class:	262
Waste Class Name:	DETERGENTS/SOAPS

Waste Detail(s)

Waste Class:	263
Waste Class Name:	ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	264
Waste Class Name:	PHOTOPROCESSING WASTES

Waste Detail(s)

Waste Class:	148

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		232			
Waste Class Name:		POLYMERIC RESINS			
<u>Waste Detail(s)</u>					
Waste Class:		242			
Waste Class Name:		HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCB'S			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
18	5 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON0046505			Choice of Contact:	
Approval Years:	01,02,03,04,05,06,07,08			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	8111
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		DEFENCE SERVICES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		232			
Waste Class Name:		POLYMERIC RESINS			
<u>Waste Detail(s)</u>					
Waste Class:		242			
Waste Class Name:		HALOGENATED PESTICIDES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:			243		
Waste Class Name:			PCB'S		
<u>Waste Detail(s)</u>					
Waste Class:			252		
Waste Class Name:			WASTE OILS & LUBRICANTS		
<u>Waste Detail(s)</u>					
Waste Class:			261		
Waste Class Name:			PHARMACEUTICALS		
<u>Waste Detail(s)</u>					
Waste Class:			262		
Waste Class Name:			DETERGENTS/SOAPS		
<u>Waste Detail(s)</u>					
Waste Class:			312		
Waste Class Name:			PATHOLOGICAL WASTES		
<u>Waste Detail(s)</u>					
Waste Class:			263		
Waste Class Name:			ORGANIC LABORATORY CHEMICALS		
<u>Waste Detail(s)</u>					
Waste Class:			331		
Waste Class Name:			WASTE COMPRESSED GASES		
<u>Waste Detail(s)</u>					
Waste Class:			264		
Waste Class Name:			PHOTOPROCESSING WASTES		
<u>Waste Detail(s)</u>					
Waste Class:			269		
Waste Class Name:			NON-HALOGENATED PESTICIDES		
<u>Waste Detail(s)</u>					
Waste Class:			113		
Waste Class Name:			ACID WASTE - OTHER METALS		
<u>Waste Detail(s)</u>					
Waste Class:			251		
Waste Class Name:			OIL SKIMMINGS & SLUDGES		
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		112 ACID WASTE - HEAVY METALS			

18	6 of 33	ENE/246.0	72.7 / -0.56	GVT. OF CAN. - PUBLIC WORKS CANADA CHP NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1M 0M3	GEN

Generator Info

Generator No:	ON0144762	Choice of Contact:	
Approval Years:	90,92,93,97	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	8159
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER GEN. ADMIN.		

Waste Detail(s)

Waste Class:	146
Waste Class Name:	OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class:	221
Waste Class Name:	LIGHT FUELS

Waste Detail(s)

Waste Class:	222
Waste Class Name:	HEAVY FUELS

Waste Detail(s)

Waste Class:	241
Waste Class Name:	HALOGENATED SOLVENTS

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

18	7 of 33	ENE/246.0	72.7 / -0.56	GVT. OF CAN. - PUBLIC WORKS CANADA17-347 CHP NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1M 0M3	GEN

Generator Info

Generator No:	ON0144762	Choice of Contact:	
Approval Years:	94,95,96	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	8159

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Co Admin: Phone No Admin: SIC Description:					
		OTHER GEN. ADMIN.			
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
<u>Waste Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
<u>Waste Detail(s)</u>					
Waste Class: 221 Waste Class Name: LIGHT FUELS					
<u>Waste Detail(s)</u>					
Waste Class: 222 Waste Class Name: HEAVY FUELS					
<u>Waste Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
18	8 of 33	ENE/246.0	72.7 / -0.56	PUBLIC WORKS CANADA CHP NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON	GEN
<u>Generator Info</u>					
Generator No: ON0144762 Approval Years: 98,99,00,01 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
		OTHER GEN. ADMIN.		Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 8159	
<u>Waste Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
<u>Waste Detail(s)</u>					
Waste Class: 221 Waste Class Name: LIGHT FUELS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		222			
Waste Class Name:		HEAVY FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>18</u>	9 of 33	ENE/246.0	72.7 / -0.56	1745 ALTA VISTA DRIVE, OTTAWA ON K1A 0K6	NDFT
Property Id:		K13660			
Base Name:		DG REALTY POLICY AND PLANS			
Status:		Tank currently active			
Status As Of:		May 25, 2001			
Tank Class:		Operating tank for heating or emergency power generator			
Install Year:		1997			
Tank Type:		Aboveground Shop-fabricated			
Last Year Used:		1700			
Tank Contents:		Diesel			
Capacity (L):		1360			
<u>18</u>	10 of 33	ENE/246.0	72.7 / -0.56	ON K1A 0K6	NDSP
Notification:					
Notif Date:					
Description:					
Desc of Functional Loca:					
Spill Location:		1745 Alta Vista (NDMC) - Loading Dock			
<u>Historical Details</u>					
Occurrence Date:	11/18/2005 8:00:00 AM			Dist from Wtr Well:	
Cleaned Date:	11/18/2005 11:00			Depth to Grndwtr:	
Spill Type:	POL			Dist from Drain:	
Material Spilled:	Hydraulic Oil (All types)			Dist from Surf Wtr:	
TDG Category:	Flammable Liquids			Dist from Property:	
Quantity Spilled:	20 L			Notification Type:	
Quantity Spl Unit:				Coding:	
Quantity Recovered:	20 L			Coding Code Txt:	
Spilled by:				Planner Group:	
Rain:	0			Priority Type:	
Snow:	0			Priority:	
Wind Speed:				Created on:	
Wind Direction:				Reported by:	
Direction of Drift:				Req Start:	
Temperature:				Required End:	
Base/Facility:	CFSU OTTAWA			Completn Date:	
Command Code:	ADM (FIN CS)			Main Work Ctr:	
Command:	Assistant Deputy Minister of Finance & Corporate Services			Latitude:	
Sub-Command:				Longitude:	
PRIN:				Altitude:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Notif Date:					
Description:					
Desc of Functional Loca:					
Spill Location:		NDMC Loading dock, 1745 Alta Vista, Ottawa, ON			
<u>Historical Details</u>					
Occurrence Date:		9/18/2007 12:00:00 PM		Dist from Wtr Well:	
Cleaned Date:		9/18/2007 17:12		Depth to Grndwtr:	
Spill Type:		Hazmat		Dist from Drain:	
Material Spilled:		Antifreeze (Ethylene/Propylene Glycol)		Dist from Surf Wtr:	
TDG Category:		Flammable Liquids		Dist from Property:	
Quantity Spilled:		2 L		Notification Type:	
Quantity Spl Unit:				Coding:	
Quantity Recovered:		2 L		Coding Code Txt:	
Spilled by:				Planner Group:	
Rain:		0		Priority Type:	
Snow:		0		Priority:	
Wind Speed:				Created on:	
Wind Direction:				Reported by:	
Direction of Drift:				Req Start:	
Temperature:				Required End:	
Base/Facility:		CFSU OTTAWA		Completn Date:	
Command Code:		ADM (FIN CS)		Main Work Ctr:	
Command:		Assistant Deputy Minister of Finance & Corporate Services		Latitude:	
Sub-Command:				Longitude:	
PRIN:				Altitude:	
Grid:				Priority Desc:	
Code Group:					
Code Group Text:					
Comments:					
Agencies Notified:		PWGSC RPT4 Environment Team			
Gen Notif Comm:					
Releasing Auth:					
Spill Source:		Truck mounted crane			
Spill Cause:		unknown			
Potential Env Impacts:		contamination of storm sewer			
Potential Human Impacts:		N/A			
Actions Taken:		Spill was cleaned with absorbent. Contaminated material was bagged and is awaiting proper disposal.			

18

13 of 33

ENE/246.0

72.7 / -0.56

ON K1A 0K6

NDSP

Notification:**Notif Date:****Description:****Desc of Functional Loca:****Spill Location:** ambulance entrance/old emergency entrance, 1745 Alta Vista (NDMC)**Historical Details**

Occurrence Date: 9/19/2007 2:30:00 PM
Cleaned Date: 9/20/2007 12:00
Spill Type: POL
Material Spilled: Hydraulic Oil (All types)
TDG Category: Flammable Liquids
Quantity Spilled: 0.5 L
Quantity Spl Unit:
Quantity Recovered: 0.5 L
Spilled by:
Rain: 0
Snow: 0

Dist from Wtr Well:
Depth to Grndwtr:
Dist from Drain:
Dist from Surf Wtr:
Dist from Property:
Notification Type:
Coding:
Coding Code Txt:
Planner Group:
Priority Type:
Priority:

18	14 of 33	ENE/246.0	72.7 / -0.56	1745 ALTA VISTA DR Ottawa ON	WWIS
Well ID:	7134618			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	11/24/2009
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	M04500			Contractor:	1844
Tag:				Form Version:	5
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7134618.pdf				

Additional Detail(s) (Map)

Well Completed Date: 07/14/2009
Year Completed: 2009
Depth (m):
Latitude: 45.4016256485956
Longitude: -75.6563534122101
X: -75.65635325046796
Y: 45.40162564205724
Path: 713\7134618.pdf

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/7137134618.pdf

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/14/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.4018047295173			
Longitude:		-75.6533783228171			
X:		-75.653378161474			
Y:		45.40180472286767			
Path:		713\7134618.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7134618.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/14/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.4016889471658			
Longitude:		-75.6563030351737			
X:		-75.65630287295818			
Y:		45.40168894020808			
Path:		713\7134618.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002842419			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	448865.00
Code OB Desc:				North83:	5027795.00
Open Hole:	No			Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/14/2009			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003262516				
Layer:	1				
Plug From:	0.0				
Plug To:	0.10000000149011612				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003262518				
Layer:	3				
Plug From:	0.8999999761581421				
Plug To:	6.199999809265137				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1003262517			
Layer:		2			
Plug From:		0.10000000149011612			
Plug To:		0.8999999761581421			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003262520			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Hole Diameter</u>					
Hole ID:		1003262515			
Diameter:		10.0			
Depth From:		0.0			
Depth To:		6.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003262510			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	448632.00
Code OB Desc:				North83:	5027777.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	07/14/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003262514			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003262513			
Method Construction Code:					
Method Construction:					
Other Method Construction:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1003262512			
Diameter:					
Depth From:					
Depth To:		7.199999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:					
<u>Bore Hole Information</u>					
Bore Hole ID:	1003262505			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	448636.00
Code OB Desc:				North83:	5027784.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	07/14/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003262509			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003262508			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Hole Diameter</u>					
Hole ID:		1003262507			
Diameter:					
Depth From:					
Depth To:		7.900000095367432			
Hole Depth UOM:		m			
Hole Diameter UOM:					
<u>18</u>	15 of 33	ENE/246.0	72.7 / -0.56	1745 Alta Vista Drive Ottawa ON K1A 0K6	EHS
Order No:	20110610019			Nearest Intersection:	Smyth Road and Alta Vista Drive
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	6/21/2011			Search Radius (km):	0.25
Date Received:	6/10/2011 3:38:18 PM			X:	-75.65795

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Previous Site Name: Lot/Building Size: Additional Info Ordered:				Y: 45.403322	

18	16 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN

Generator Info

Generator No:	ON0046505	Choice of Contact:	
Approval Years:	2009	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	911110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Defence Services		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	331
Waste Class Name:	WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class:	113
Waste Class Name:	ACID WASTE - OTHER METALS

Waste Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class:	146
Waste Class Name:	OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class:	148
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		269			
Waste Class Name:		NON-HALOGENATED PESTICIDES			

<u>18</u>	17 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN

Generator Info

Generator No:	ON0046505	Choice of Contact:	
Approval Years:	2010	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	911110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Defence Services		

Waste Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:			146		
Waste Class Name:			OTHER SPECIFIED INORGANICS		
<u>Waste Detail(s)</u>					
Waste Class:			312		
Waste Class Name:			PATHOLOGICAL WASTES		
<u>Waste Detail(s)</u>					
Waste Class:			269		
Waste Class Name:			NON-HALOGENATED PESTICIDES		
<u>Waste Detail(s)</u>					
Waste Class:			221		
Waste Class Name:			LIGHT FUELS		
<u>Waste Detail(s)</u>					
Waste Class:			213		
Waste Class Name:			PETROLEUM DISTILLATES		
<u>Waste Detail(s)</u>					
Waste Class:			261		
Waste Class Name:			PHARMACEUTICALS		
<u>Waste Detail(s)</u>					
Waste Class:			113		
Waste Class Name:			ACID WASTE - OTHER METALS		
<u>Waste Detail(s)</u>					
Waste Class:			331		
Waste Class Name:			WASTE COMPRESSED GASES		
<u>Waste Detail(s)</u>					
Waste Class:			263		
Waste Class Name:			ORGANIC LABORATORY CHEMICALS		
<u>Waste Detail(s)</u>					
Waste Class:			252		
Waste Class Name:			WASTE OILS & LUBRICANTS		
<u>Waste Detail(s)</u>					
Waste Class:			243		
Waste Class Name:			PCBS		
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>18</u>	18 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN
<u>Generator Info</u>					
Generator No:	ON0046505			Choice of Contact:	
Approval Years:	2011			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	911110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Defence Services			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		269			
Waste Class Name:		NON-HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
18	19 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:	ON0046505			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	911110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Defence Services			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		269			
Waste Class Name:		NON-HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		221			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			

<u>18</u>	20 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON	GEN

Generator Info

Generator No:	ON0046505	Choice of Contact:	
Approval Years:	2013	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	911110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class:	263
Waste Class Name:	ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	312

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		269			
Waste Class Name:		NON-HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
18	21 of 33	ENE/246.0	72.7 / -0.56	1 Dental Unit Detachment Ottawa 1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	GEN
<u>Generator Info</u>					
Generator No:		ON2792643		Choice of Contact:	CO_ADMIN
Approval Years:		2016		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	621210
Country:		Canada			
Co Admin:		Sylvie Morin			
Phone No Admin:		613-992-7651 Ext.			
SIC Description:		OFFICES OF DENTISTS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
18	22 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN
<u>Generator Info</u>					
Generator No:		ON0046505		Choice of Contact:	CO_ADMIN
Approval Years:		2016		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	911110
Country:		Canada			
Co Admin:		Paul Haight			
Phone No Admin:		(819)775-4506 Ext.			
SIC Description:		911110			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		269			
Waste Class Name:		NON-HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
18	23 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN
<u>Generator Info</u>					
Generator No:	ON0046505			Choice of Contact:	CO_ADMIN
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	911110
Country:	Canada				
Co Admin:	Karin Frederking				
Phone No Admin:	(819)775-7413 Ext.				
SIC Description:	911110				
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		269			
Waste Class Name:		NON-HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>18</u>	24 of 33	ENE/246.0	72.7 / -0.56	1 Dental Unit Detachment Ottawa 1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	GEN

Generator Info

Generator No:	ON2792643	Choice of Contact:	CO_ADMIN
Approval Years:	2015	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	621210
Country:	Canada		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin:		Sylvie Morin			
Phone No Admin:		613-992-7651 Ext.			
SIC Description:		OFFICES OF DENTISTS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			

<u>18</u>	25 of 33	ENE/246.0	72.7 / -0.56	1 Dental Unit Detachment Ottawa 1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	GEN

Generator Info

Generator No:	ON2792643	Choice of Contact:	CO_OFFICIAL
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	621210
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:	OFFICES OF DENTISTS		

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	148
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

<u>18</u>	26 of 33	ENE/246.0	72.7 / -0.56	DEPT. OF NATIONAL DEFENCE NATIONAL DEFENCE MEDICAL CENTRE 1745 ALTA VISTA DRIVE OTTAWA ON K1A 0K6	GEN

Generator Info

Generator No:	ON0046505	Choice of Contact:	CO_ADMIN
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	911110
Country:	Canada		
Co Admin:	Karin Frederking		
Phone No Admin:	(819)775-7413 Ext.		
SIC Description:	911110		

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		261 PHARMACEUTICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		221 LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		243 PCBS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		331 WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		148 INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		121 ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		264 PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		146 OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		113 ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		269			
Waste Class Name:		NON-HALOGENATED PESTICIDES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			

<u>18</u>	27 of 33	ENE/246.0	72.7 / -0.56	Department of National Defence RP Ops 1745 ALTA VISTA DR OTTAWA ON K1A 0K6	GEN

Generator Info

Generator No:	ON0046505	Choice of Contact:
Approval Years:	As of Dec 2018	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	264 L
Waste Class Name:	Photoprocessing wastes

Waste Detail(s)

Waste Class:	148 C
Waste Class Name:	Misc. wastes and inorganic chemicals

Waste Detail(s)

Waste Class:	269 A
Waste Class Name:	Organic non-halogenated pesticide and herbicide wastes

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

Waste Detail(s)

Waste Class:	331 I

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		146 R			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		148 B			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
<u>Waste Detail(s)</u>					
Waste Class:		243 D			
Waste Class Name:		PCB			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		264 C			
Waste Class Name:		Photoprocessing wastes			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
18	28 of 33	ENE/246.0	72.7 / -0.56	1 Dental Unit Detachment Ottawa HCC 1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	GEN

Generator Info

Generator No:	ON2792643	Choice of Contact:
Approval Years:	As of Dec 2018	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	148 C
Waste Class Name:	Misc. wastes and inorganic chemicals

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

18	29 of 33	ENE/246.0	72.7 / -0.56	1745 Alta Vista Dr Ottawa ON K1G0G7	EHS
Order No:	20171026124	Nearest Intersection:			
Status:	C	Municipality:			
Report Type:	Standard Report	Client Prov/State:	ON		
Report Date:	02-NOV-17	Search Radius (km):	.25		
Date Received:	26-OCT-17	X:	-75.654869		
Previous Site Name:		Y:	45.402805		
Lot/Building Size:					
Additional Info Ordered:	City Directory; Aerial Photos				

18	30 of 33	ENE/246.0	72.7 / -0.56	Department of National Defence RP Ops 1745 ALTA VISTA DR OTTAWA ON K1A 0K6	GEN

Generator Info

Generator No:	ON0046505	Choice of Contact:
Approval Years:	As of Jul 2020	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	121 C
Waste Class Name:	Alkaline slutions - containing heavy metals

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:			148 B		
Waste Class Name:			Misc. wastes and inorganic chemicals		
<u>Waste Detail(s)</u>					
Waste Class:			269 A		
Waste Class Name:			Organic non-halogenated pesticide and herbicide wastes		
<u>Waste Detail(s)</u>					
Waste Class:			146 T		
Waste Class Name:			Other specified inorganic sludges, slurries or solids		
<u>Waste Detail(s)</u>					
Waste Class:			112 C		
Waste Class Name:			Acid solutions - containing heavy metals		
<u>Waste Detail(s)</u>					
Waste Class:			264 L		
Waste Class Name:			Photoprocessing wastes		
<u>Waste Detail(s)</u>					
Waste Class:			148 C		
Waste Class Name:			Misc. wastes and inorganic chemicals		
<u>Waste Detail(s)</u>					
Waste Class:			213 I		
Waste Class Name:			Petroleum distillates		
<u>Waste Detail(s)</u>					
Waste Class:			252 L		
Waste Class Name:			Waste crankcase oils and lubricants		
<u>Waste Detail(s)</u>					
Waste Class:			264 C		
Waste Class Name:			Photoprocessing wastes		
<u>Waste Detail(s)</u>					
Waste Class:			146 R		
Waste Class Name:			Other specified inorganic sludges, slurries or solids		
<u>Waste Detail(s)</u>					
Waste Class:			312 P		
Waste Class Name:			Pathological wastes		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		263 I			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		243 D			
Waste Class Name:		PCB			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			

18	31 of 33	ENE/246.0	72.7 / -0.56	1 Dental Unit Detachment Ottawa 1745 Alta Vista Drive Main Floor Ottawa ON K1A 0K6	GEN

Generator Info

Generator No:	ON2792643	Choice of Contact:
Approval Years:	As of Oct 2019	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	148 C
Waste Class Name:	Misc. wastes and inorganic chemicals

Waste Detail(s)

Waste Class:	312 P
Waste Class Name:	Pathological wastes

2017 Generator Info

Gen No:	ON2792643	Choice of Contact:	CO_ADMIN
ID:	11364	Phone No Official:	6139921846 Ext.
Contaminated Fac:	N	Phone No Admin:	613-992-7651 Ext.
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621210	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	1 Dental Unit Detachment Ottawa		
Gen Div:	HCC		
Gen Op Name:	1 Dental Unit Detachment Ottawa		
Gen Op Div:	HCC		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Adrs1:		1745 Alta Vista Drive			
Site Bldg:		1 dental Unit det Ottawa Canadian forces health se			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		Main Floor			
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K1A 0K6			
Site Country:		Canada			
Co Official:		Manon Mailhot			
Co Admin:		Caroline Lejeune			
<u>2017 Generator Manifest</u>					
ID:	33050			Sum Received Qty:	7.3
Generator No:	ON2792643			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2018 Generator Info</u>					
Gen No:	ON2792643			Choice of Contact:	CO_ADMIN
ID:	11113			Phone No Official:	6139921846 Ext.
Contaminated Fac:	N			Phone No Admin:	613-992-7651 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621210			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		1 Dental Unit Detachment Ottawa			
Gen Div:		HCC			
Gen Op Name:		1 Dental Unit Detachment Ottawa			
Gen Op Div:		HCC			
Site Adrs1:		1745 Alta Vista Drive			
Site Bldg:		1 dental Unit det Ottawa Canadian forces health se			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		Main Floor			
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K1A 0K6			
Site Country:		Canada			
Co Official:		Manon Mailhot			
Co Admin:		Caroline Lejeune			
<u>2019 Generator Info</u>					
Gen No:	ON2792643			Choice of Contact:	CO_ADMIN
ID:	10826			Phone No Official:	6139921846 Ext.
Contaminated Fac:	N			Phone No Admin:	613-992-7651 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	621210			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		1 Dental Unit Detachment Ottawa			
Gen Div:		HCC			
Gen Op Name:		1 Dental Unit Detachment Ottawa			
Gen Op Div:		HCC			
Site Adrs1:		1745 Alta Vista Drive			
Site Bldg:		1 dental Unit det Ottawa Canadian forces health se			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		Main Floor			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K1A 0K6			
Site Country:		Canada			
Co Official:		Manon Mailhot			
Co Admin:		Caroline Lejeune			
2019 Generator Manifest					
ID:	32057			Sum Received Qty:	9.0
Generator No:	ON2792643			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
18	32 of 33	ENE/246.0	72.7 / -0.56	Department of National Defence RP Ops 1745 ALTA VISTA DR OTTAWA ON K1A 0K6	GEN
Generator Info					
Generator No:	ON0046505			Choice of Contact:	
Approval Years:	As of Nov 2021			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
Waste Detail(s)					
Waste Class:	263 I				
Waste Class Name:	Misc. waste organic chemicals				
Waste Detail(s)					
Waste Class:	148 C				
Waste Class Name:	Misc. wastes and inorganic chemicals				
Waste Detail(s)					
Waste Class:	121 C				
Waste Class Name:	Alkaline slutions - containing heavy metals				
Waste Detail(s)					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
Waste Detail(s)					
Waste Class:	146 R				
Waste Class Name:	Other specified inorganic sludges, slurries or solids				
Waste Detail(s)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		243 D			
Waste Class Name:		PCB			
<u>Waste Detail(s)</u>					
Waste Class:		269 A			
Waste Class Name:		Organic non-halogenated pesticide and herbicide wastes			
<u>Waste Detail(s)</u>					
Waste Class:		112 C			
Waste Class Name:		Acid solutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		264 C			
Waste Class Name:		Photoprocessing wastes			
<u>Waste Detail(s)</u>					
Waste Class:		264 L			
Waste Class Name:		Photoprocessing wastes			
<u>Waste Detail(s)</u>					
Waste Class:		148 B			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>18</u>	33 of 33	ENE/246.0	72.7 / -0.56	DND 1745 Alta Vista Drive Ottawa ON	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON0046505			Choice of Contact:	
Approval Years:	As of Oct 2022			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	213 I				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					
Waste Class:	148 B				
Waste Class Name:	INORGANIC LABORATORY CHEMICALS				
<u>Waste Detail(s)</u>					
Waste Class:	252 L				
Waste Class Name:	WASTE OILS & LUBRICANTS				
<u>Waste Detail(s)</u>					
Waste Class:	264 L				
Waste Class Name:	PHOTOPROCESSING WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	148 C				
Waste Class Name:	INORGANIC LABORATORY CHEMICALS				
<u>Waste Detail(s)</u>					
Waste Class:	264 C				
Waste Class Name:	PHOTOPROCESSING WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	PATHOLOGICAL WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	331 I				
Waste Class Name:	WASTE COMPRESSED GASES				
<u>Waste Detail(s)</u>					
Waste Class:	146 R				
Waste Class Name:	OTHER SPECIFIED INORGANICS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Waste Detail(s)

Waste Class: 269 A
Waste Class Name: NON-HALOGENATED PESTICIDES

Waste Detail(s)

Waste Class: 146 T
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 243 D
Waste Class Name: PCBS

Waste Detail(s)

Waste Class: 112 C
Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 121 C
Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 263 I
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 212 L
Waste Class Name: ALIPHATIC SOLVENTS

Generator Info as of Dec 2024

Generator No: ON0046505
Generator Company Name: DND
Street: 1745 Alta Vista Drive
City: Ottawa
Province State: Ontario
Country: Canada
Postal Code: K1A 0K2
Waste Class: 243 D,253 T,221 I,112 C,146 R,213 I,252 L,264 C,331 I,312 P,212 L,121 C,146 T,263 I,269 A,148 B,264 L,148 C,331 L

Waste Class Decoded:

243 - PCBS; 253 - EMULSIFIED OILS; 221 - LIGHT FUELS; 112 - ACID WASTE - HEAVY METALS; 146 - OTHER SPECIFIED INORGANICS; 213 - PETROLEUM DISTILLATES; 252 - WASTE OILS & LUBRICANTS; 264 - PHOTOPROCESSING WASTES; 331 - WASTE COMPRESSED GASES; 312 - PATHOLOGICAL WASTES; 212 - ALIPHATIC SOLVENTS; 121 - ALKALINE WASTES - HEAVY METALS; 146 - OTHER SPECIFIED INORGANICS; 263 - ORGANIC LABORATORY CHEMICALS; 269 - NON-HALOGENATED PESTICIDES; 148 - INORGANIC LABORATORY CHEMICALS; 264 - PHOTOPROCESSING WASTES; 148 - INORGANIC LABORATORY CHEMICALS; 331 - WASTE COMPRESSED GASES

2017 Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen No:	ON0046505			Choice of Contact:	CO_OFFICIAL
ID:	979			Phone No Official:	(819)775-4506 Ext.
Contaminated Fac:	N			Phone No Admin:	6138162543 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	911110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Department of National Defence			
Gen Div:		RP Ops			
Gen Op Name:		DND			
Gen Op Div:		RP Ops			
Site Adrs1:		1745 ALTA VISTA DR			
Site Bldg:		NDMC			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1A 0K6			
Site Country:		Canada			
Co Official:		Paul Haight			
Co Admin:		Andre Latreille			
<u>2017 Generator Manifest</u>					
ID:	4566			Sum Received Qty:	240.0
Generator No:	ON0046505			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	1
Waste Char:	T			District:	203
Waste Code:	146				
<u>2017 Generator Manifest</u>					
ID:	4570			Sum Received Qty:	56.0
Generator No:	ON0046505			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	203
Waste Code:	331				
<u>2017 Generator Manifest</u>					
ID:	4568			Sum Received Qty:	75.0
Generator No:	ON0046505			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	203
Waste Code:	252				
<u>2017 Generator Manifest</u>					
ID:	4572			Sum Received Qty:	75.0
Generator No:	ON0046505			Waste Class Name:	PCBS
Receiver Type:	035			Count Manifests:	1
Waste Char:	D			District:	403
Waste Code:	243				
<u>2017 Generator Manifest</u>					
ID:	4569			Sum Received Qty:	580.0
Generator No:	ON0046505			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	035			Count Manifests:	2
Waste Char:	I			District:	203
Waste Code:	263				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2017 Generator Manifest</u>					
ID:	4567			Sum Received Qty:	550.0
Generator No:	ON0046505			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	203
Waste Code:	212				
<u>2017 Generator Manifest</u>					
ID:	4571			Sum Received Qty:	40.0
Generator No:	ON0046505			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	212				
<u>2018 Generator Info</u>					
Gen No:	ON0046505			Choice of Contact:	CO_OFFICIAL
ID:	956			Phone No Official:	(819)775-4506 Ext.
Contaminated Fac:	N			Phone No Admin:	6138162543 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	911110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Department of National Defence				
Gen Div:	RP Ops				
Gen Op Name:	DND				
Gen Op Div:	RP Ops				
Site Adrs1:	1745 ALTA VISTA DR				
Site Bldg:	NDMC				
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	OTTAWA				
Province Out:					
Site Postal Code:	K1A 0K6				
Site Country:	Canada				
Co Official:	Paul Haight				
Co Admin:	Andre Latreille				
<u>2018 Generator Manifest</u>					
ID:	4497			Sum Received Qty:	100.0
Generator No:	ON0046505			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	203
Waste Code:	252				
<u>2018 Generator Manifest</u>					
ID:	4500			Sum Received Qty:	20.0
Generator No:	ON0046505			Waste Class Name:	PCBS
Receiver Type:	035			Count Manifests:	1
Waste Char:	D			District:	403
Waste Code:	243				
<u>2018 Generator Manifest</u>					
ID:	4494			Sum Received Qty:	80.0

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:	ON0046505			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	1
Waste Char:	R			District:	203
Waste Code:	146				
<u>2018 Generator Manifest</u>					
ID:	4498			Sum Received Qty:	240.0
Generator No:	ON0046505			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	203
Waste Code:	263				
<u>2018 Generator Manifest</u>					
ID:	4495			Sum Received Qty:	260.0
Generator No:	ON0046505			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	3
Waste Char:	T			District:	203
Waste Code:	146				
<u>2018 Generator Manifest</u>					
ID:	4499			Sum Received Qty:	120.0
Generator No:	ON0046505			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	035			Count Manifests:	2
Waste Char:	I			District:	203
Waste Code:	331				
<u>2018 Generator Manifest</u>					
ID:	4492			Sum Received Qty:	20.0
Generator No:	ON0046505			Waste Class Name:	ACID WASTE - HEAVY METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	203
Waste Code:	112				
<u>2018 Generator Manifest</u>					
ID:	4493			Sum Received Qty:	340.0
Generator No:	ON0046505			Waste Class Name:	ALKALINE WASTES - HEAVY METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	203
Waste Code:	121				
<u>2018 Generator Manifest</u>					
ID:	4496			Sum Received Qty:	480.0
Generator No:	ON0046505			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	203
Waste Code:	212				
<u>2019 Generator Info</u>					
Gen No:	ON0046505			Choice of Contact:	CO_OFFICIAL
ID:	932			Phone No Official:	(819)775-4506 Ext.
Contaminated Fac:	N			Phone No Admin:	6138162543 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	911110			County Out:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Department of National Defence			
Gen Div:		RP Ops			
Gen Op Name:		DND			
Gen Op Div:		RP Ops			
Site Adrs1:		1745 ALTA VISTA DR			
Site Bldg:		NDMC			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1A 0K6			
Site Country:		Canada			
Co Official:		Paul Haight			
Co Admin:		Andre Latreille			
<u>2019 Generator Manifest</u>					
ID:	4280			Sum Received Qty:	170.0
Generator No:	ON0046505			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	3
Waste Char:	T			District:	203
Waste Code:	146				
<u>2019 Generator Manifest</u>					
ID:	4281			Sum Received Qty:	650.0
Generator No:	ON0046505			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	252				
<u>2020 Generator Info</u>					
Gen No:	ON0046505			Choice of Contact:	CO_OFFICIAL
ID:	882			Phone No Official:	(819)775-4506 Ext.
Contaminated Fac:	N			Phone No Admin:	6138162543 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	911110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Department of National Defence			
Gen Div:		RP Ops			
Gen Op Name:		DND			
Gen Op Div:		RP Ops			
Site Adrs1:		1745 ALTA VISTA DR			
Site Bldg:		NDMC			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1A 0K6			
Site Country:		Canada			
Co Official:		Paul Haight			
Co Admin:		Andre Latreille			
<u>2020 Generator Manifest</u>					
ID:	3945			Sum Received Qty:	200.0

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:	ON0046505			Waste Class Name:	ALKALINE WASTES - HEAVY METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	203
Waste Code:	121				
<u>2020 Generator Manifest</u>					
ID:	3951			Sum Received Qty:	247.7
Generator No:	ON0046505			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	2
Waste Char:	P			District:	402
Waste Code:	312				
<u>2020 Generator Manifest</u>					
ID:	3950			Sum Received Qty:	42.0
Generator No:	ON0046505			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035			Count Manifests:	1
Waste Char:	P			District:	305
Waste Code:	312				
<u>2020 Generator Manifest</u>					
ID:	3948			Sum Received Qty:	640.0
Generator No:	ON0046505			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	3
Waste Char:	L			District:	203
Waste Code:	252				
<u>2020 Generator Manifest</u>					
ID:	3949			Sum Received Qty:	20.0
Generator No:	ON0046505			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	203
Waste Code:	331				
<u>2020 Generator Manifest</u>					
ID:	3946			Sum Received Qty:	655.0
Generator No:	ON0046505			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	4
Waste Char:	T			District:	203
Waste Code:	146				
<u>2020 Generator Manifest</u>					
ID:	3947			Sum Received Qty:	1920.0
Generator No:	ON0046505			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	2
Waste Char:	L			District:	203
Waste Code:	212				
<u>2021 Generator Info</u>					
Gen No:	ON0046505			Choice of Contact:	CO_OFFICIAL
ID:	880			Phone No Official:	(819)775-4506 Ext.
Contaminated Fac:	N			Phone No Admin:	613-816-2543 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	911110			County Out:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Department of National Defense			
Gen Div:		RP Ops			
Gen Op Name:		DND			
Gen Op Div:		RP Ops			
Site Adrs1:		1745 ALTA VISTA DR			
Site Bldg:		NDMC			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K1A 0K6			
Site Country:		Canada			
Co Official:		Paul Haight			
Co Admin:		Andre Latreille			
 <u>2021 Generator Manifest</u>					
ID:	3921			Sum Received Qty:	252.0
Generator No:	ON0046505			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				

Unplottable Summary

Total: **37** Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	Claridge Homes (Clarion Hills) Inc.	Valour Dr Block 20, Plan 4M-1115	Ottawa ON	
CA	City of Ottawa	Part of Lot 15, Gore Junction	Ottawa ON	
CA	Melron Property Enterprises Inc.	Part of Lot 15 Junction Gore	Ottawa ON	
CA	OTTAWA CITY BALMORAL PLACE	BALMORAL PL. RONALD AVE.	OTTAWA CITY ON	
CA		Smyth Road	Ottawa ON	
CA		Smyth Road	Ottawa ON	
CA	PUBLIC WORKS CANADA	ALTA VISTA DR.	OTTAWA CITY ON	
CA		Smyth Road	Ottawa ON	
ECA	Claridge Homes (Clarion Hills) Inc.	Valour Dr Block 20, Plan 4M-1115	Ottawa ON	K2P 0Y6
ECA	Claridge Homes (Clarion Hills) Inc.	Valour Dr Block 20, Plan 4M-1115	Ottawa ON	K2P 0Y6
ECA	City of Ottawa	Part of Lot 15, Gore Junction	Ottawa ON	K2G 6J8
GEN	GVT. OF CAN. - R.C.M.P.	RCMP COMPLEX ALTA VISTA DRIVE	OTTAWA ON	K1A 0R2
NDFT		ALTA VISTA DRIVE, OTTAWA	ON	
NPCB	Department of National Defence		Ottawa ON	
NPCB	ROYAL CANADIAN MOUNTED POLICE	CPIC Alta Vista Dr	Ottawa ON	
NPCB	ROYAL CANADIAN MOUNTED POLICE	CPIC ALTA VISTA DR	OTTAWA ON	
NPCB	DEPARTMENT OF NATIONAL DEFENCE		OTTAWA ON	K1R 3J7

NPCB	DEPARTMENT OF NATIONAL DEFENCE		OTTAWA ON	K1R 3J7
NPCB	DEPARTMENT OF NATIONAL DEFENCE		OTTAWA ON	K1R 3J7
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	
WWIS		lot 15	ON	

Unplottable Report

Site: *Claridge Homes (Clarion Hills) Inc.*
Valour Dr Block 20, Plan 4M-1115 Ottawa ON

Database:
[CA](#)

Certificate #: 0476-74RNEX
Application Year: 2007
Issue Date: 7/6/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *City of Ottawa*
Part of Lot 15, Gore Junction Ottawa ON

Database:
[CA](#)

Certificate #: 5759-6BUQTB
Application Year: 2005
Issue Date: 5/16/2005
Approval Type: Air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Melron Property Enterprises Inc.*
Part of Lot 15 Junction Gore Ottawa ON

Database:
[CA](#)

Certificate #: 6154-5JWM4C
Application Year: 2003
Issue Date: 2/24/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *OTTAWA CITY BALMORAL PLACE*
BALMORAL PL. RONALD AVE. OTTAWA CITY ON

Database:
[CA](#)

Certificate #: 3-2112-88-

Application Year: 88
Issue Date: 11/8/1988
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Smyth Road Ottawa ON

Database:
[CA](#)

Certificate #: 2575-4TVLEP
Application Year: 01
Issue Date: 2/12/01
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Canada Lands Company CLC Limited
Client Address: Rockliffe, Project Office, Building 164, West Wing
Client City: Ottawa
Client Postal Code: K1A 0K4
Project Description: Construction of storm and sanitary sewers
Contaminants:
Emission Control:

Site: Smyth Road Ottawa ON

Database:
[CA](#)

Certificate #: 8774-4TVLJM
Application Year: 01
Issue Date: 2/12/01
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: Canada Lands Company CLC Limited
Client Address: Rockliffe, Project Office, Building 164, West Wing
Client City: Ottawa
Client Postal Code: K1A 0K4
Project Description: Construction of watermain
Contaminants:
Emission Control:

Site: PUBLIC WORKS CANADA
ALTA VISTA DR. OTTAWA CITY ON

Database:
[CA](#)

Certificate #: 8-4045-85-006
Application Year: 85
Issue Date: 10/31/85
Approval Type: Industrial air
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants: Nitrogen Oxides, Suspended Particulate Matter
Emission Control: Thermal Incineration

Site: *Smyth Road Ottawa ON* **Database:** *CA*

Certificate #: 4780-4UKSER
Application Year: 01
Issue Date: 3/7/01
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Canada Lands Company CLC Limited
Client Address: Rockliffe, Project Office, Building 164, West Wing
Client City: Ottawa
Client Postal Code: K1A 0K4
Project Description: This application is for a Certificate of Approval for a stormwater management wet pond to control off site flow levels.
Contaminants:
Emission Control:

Site: *Claridge Homes (Clarion Hills) Inc.
Valour Dr Block 20, Plan 4M-1115 Ottawa ON K2P 0Y6* **Database:** *ECA*

Approval No: 2041-74TKH5 **MOE District:**
Approval Date: 2007-07-06 **City:**
Status: Approved **Longitude:**
Record Type: ECA **Latitude:**
Link Source: IDS **Geometry X:**
SWP Area Name: **Geometry Y:**
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Business Name: Claridge Homes (Clarion Hills) Inc.
Address: Valour Dr Block 20, Plan 4M-1115
Full Address:
Full PDF Link:
PDF Site Location:

Site: *Claridge Homes (Clarion Hills) Inc.
Valour Dr Block 20, Plan 4M-1115 Ottawa ON K2P 0Y6* **Database:** *ECA*

Approval No: 0476-74RNEX **MOE District:**
Approval Date: 2007-07-06 **City:**
Status: Approved **Longitude:**
Record Type: ECA **Latitude:**
Link Source: IDS **Geometry X:**
SWP Area Name: **Geometry Y:**
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Claridge Homes (Clarion Hills) Inc.
Address: Valour Dr Block 20, Plan 4M-1115
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/8186-74KQFZ-14.pdf>
PDF Site Location:

Site: *City of Ottawa
Part of Lot 15, Gore Junction Ottawa ON K2G 6J8* **Database:** *ECA*

Approval No: 5759-6BUQTB **MOE District:**
Approval Date: 2005-05-16 **City:**
Status: Approved **Longitude:**
Record Type: ECA **Latitude:**
Link Source: IDS **Geometry X:**
SWP Area Name: **Geometry Y:**
Approval Type: ECA-AIR

Project Type: AIR
Business Name: City of Ottawa
Address: Part of Lot 15, Gore Junction
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/4860-69FSV9-14.pdf>
PDF Site Location:

Site: GVT. OF CAN. - R.C.M.P.
RCMP COMPLEX ALTA VISTA DRIVE OTTAWA ON K1A 0R2

Database:
GEN

Generator Info

Generator No: ON0283104
Approval Years: 86,87,88
Status:
PO Box No:
Country:
Co Admin:
Phone No Admin:
SIC Description: POLICE SERVICES

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code: 8123

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 264
Waste Class Name: PHOTOPROCESSING WASTES

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class: 148
Waste Class Name: INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class: 221
Waste Class Name: LIGHT FUELS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 263
Waste Class Name: ORGANIC LABORATORY CHEMICALS

Site: ALTA VISTA DRIVE, OTTAWA ON

Database:
NDFT

Property Id: K13661
Base Name: DG REALTY POLICY AND PLANS
Status: Tank currently active
Status As Of: May 25, 2001
Tank Class: Operating tank for heating or emergency power generator
Install Year: 1998
Tank Type: Aboveground Shop-fabricated
Last Year Used:
Tank Contents: Diesel
Capacity (L): 227

Site: Department of National Defence
Ottawa ON

Database:
NPCB

Company Code: O3014
Industry: National Defence
Site Status: Stored for Disposal
Transaction Date: 1/21/1994
Inspection Date: 1/21/1994

--Details--

Label:
Serial No.:
PCB Type/Code: Mineral Oil/Low
Location:
Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Label:
Serial No.:
PCB Type/Code: Mineral Oil/Ultra Low
Location:
Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Site: ROYAL CANADIAN MOUNTED POLICE
CPIC Alta Vista Dr Ottawa ON

Database:
NPCB

Company Code: O3098
Industry: RCMP
Site Status: Stored for Disposal
Transaction Date: 9/20/1996
Inspection Date: 9/14/1998

--Details--

Label:
Serial No.:
PCB Type/Code: Askarel/Unknown
Location: CONTAINER #5
Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Label:
Serial No.:
PCB Type/Code: Askarel/Unknown

Location:
Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Label:
Serial No.:
PCB Type/Code: Askarel/Askarel
Location:
Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Label:
Serial No.:
PCB Type/Code: Askarel/Askarel
Location: 131 20 litre pails of ballasts
Item/State:
No. of Items:
Manufacturer:
Status: Stored for disposal
Contents:

Label:
Serial No.:
PCB Type/Code: Askarel/Inerteen
Location: C. H. P. BUILDING
Item/State:
No. of Items:
Manufacturer:
Status: In-Use
Contents:

Label:
Serial No.:
PCB Type/Code: Askarel/Inerteen
Location: N. P. S. BUILDING
Item/State:
No. of Items:
Manufacturer:
Status: In-Use
Contents:

Site: ROYAL CANADIAN MOUNTED POLICE
CPIC ALTA VISTA DR OTTAWA ON

Database:
NPCB

Company Code: O3098
Industry: RCMP
Site Status: FEDERAL STORAGE REGION 4&5
Transaction Date: 6/16/1999
Inspection Date: 9/14/1998

--Details--

Label: OR22605
Serial No.: A31-S-0523
PCB Type/Code: ASKAREL/INERTEEN
Location:
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer:
Status: IN-USE
Contents: 1197 L

Label:	OR22606
Serial No.:	A31-S-0529
PCB Type/Code:	ASKAREL/INERTEEN
Location:	
Item/State:	TRANSFORMER/FULL
No. of Items:	1
Manufacturer:	
Status:	IN-USE
Contents:	1197 L

Label:	DO01858
Serial No.:	
PCB Type/Code:	ASKAREL/ASKAREL
Location:	
Item/State:	CAPACITOR/FULL
No. of Items:	1
Manufacturer:	
Status:	STORED FOR DISPOSAL
Contents:	20 L

Label:	DO01799
Serial No.:	
PCB Type/Code:	ASKAREL/UNKNOWN
Location:	
Item/State:	BARREL LIGHT BALLAST/FULL
No. of Items:	3
Manufacturer:	
Status:	STORED FOR DISPOSAL
Contents:	600 KG

Label:	DO01797
Serial No.:	
PCB Type/Code:	ASKAREL/UNKNOWN
Location:	
Item/State:	BARREL LIGHT BALLAST/FULL
No. of Items:	1
Manufacturer:	
Status:	STORED FOR DISPOSAL
Contents:	270 KG

Label:	DO01798
Serial No.:	
PCB Type/Code:	ASKAREL/UNKNOWN
Location:	
Item/State:	BARREL LIGHT BALLAST/FULL
No. of Items:	1
Manufacturer:	
Status:	STORED FOR DISPOSAL
Contents:	202 KG

Label:	DO02474
Serial No.:	
PCB Type/Code:	ASKAREL/ASKAREL
Location:	
Item/State:	LIGHT BALLAST/FULL
No. of Items:	3537
Manufacturer:	
Status:	STORED FOR DISPOSAL
Contents:	7074 KG

Site: DEPARTMENT OF NATIONAL DEFENCE
OTTAWA ON K1R 3J7

Database:
NPCB

Company Code: O3014
Industry: NATIONAL DEFENCE
Site Status: DELETED FEDERAL SITES

Transaction Date: 12/8/1998
Inspection Date: 1/21/1994

--Details--

Label: DO02600
Serial No.: 162825
PCB Type/Code: MINERAL OIL/ULTRA LOW
Location:
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer:
Status: STORED FOR DISPOSAL
Contents: 68 L

Label: DO02599
Serial No.: 851123
PCB Type/Code: MINERAL OIL/LOW
Location:
Item/State: TRANSFORMER/FULL
No. of Items: 1
Manufacturer:
Status: STORED FOR DISPOSAL
Contents: 91 L

Site: DEPARTMENT OF NATIONAL DEFENCE
OTTAWA ON K1R 3J7

Database:
[NPCB](#)

Company Code: O3009
Industry: NATIONAL DEFENCE
Site Status: FEDERAL FACILITIES (IN USE)
Transaction Date: 2/11/1993
Inspection Date:

Site: DEPARTMENT OF NATIONAL DEFENCE
OTTAWA ON K1R 3J7

Database:
[NPCB](#)

Company Code: O3014PH
Industry: NATIONAL DEFENCE
Site Status: DELETED FEDERAL SITES
Transaction Date: 12/6/1997
Inspection Date:

Site:
lot 15 ON

Database:
[WWIS](#)

Well ID: 1526639
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127465
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Municipality: OTTAWA CITY
Site Info:

Bore Hole Information

Bore Hole ID:	10048330	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	08/19/1992	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Location Method Desc:	Not Applicable i.e. no UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Formation ID:	931064735
Layer:	2
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	08
Material 3 Desc:	FINE SAND
Formation Top Depth:	4.0
Formation End Depth:	27.0
Formation End Depth UOM:	ft

Overburden and Bedrock

Materials Interval

Formation ID:	931064734
Layer:	1
Color:	2
General Color:	GREY
Material 1:	12
Material 1 Desc:	STONES
Material 2:	08
Material 2 Desc:	FINE SAND
Material 3:	01
Material 3 Desc:	FILL
Formation Top Depth:	0.0
Formation End Depth:	4.0
Formation End Depth UOM:	ft

Annular Space/Abandonment

Sealing Record

Plug ID:	933111842
Layer:	1
Plug From:	0.0
Plug To:	3.0
Plug Depth UOM:	ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111843
Layer: 2
Plug From: 3.0
Plug To: 27.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961526639
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596900
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084619
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 9.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930084621
Layer: 3
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 24.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930084620
Layer: 2
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 17.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326415
Layer: 1

Slot: 010
Screen Top Depth: 9.0
Screen End Depth: 12.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486015
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:

lot 15 ON

Database:
[WWIS](#)

Well ID: 1526638
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127466
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048329
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/19/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock Materials Interval

Formation ID: 931064733
Layer: 2
Color: 2

General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 4.0
Formation End Depth: 30.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064732
Layer: 1
Color: 2
General Color: GREY
Material 1: 38
Material 1 Desc: CONGLOMERATE
Material 2: 12
Material 2 Desc: STONES
Material 3: 28
Material 3 Desc: SAND
Formation Top Depth: 0.0
Formation End Depth: 4.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111841
Layer: 2
Plug From: 2.0
Plug To: 30.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111840
Layer: 1
Plug From: 0.0
Plug To: 2.0
Plug Depth UOM: ft

Method of Construction & Well
Use

Method Construction ID: 961526638
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596899
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084618

Layer: 2
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 25.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Casing

Casing ID: 930084617
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 18.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326414
Layer: 1
Slot: 010
Screen Top Depth: 18.0
Screen End Depth: 21.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486014
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:
lot 15 ON

Database:
[WWIS](#)

Well ID: 1526640
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127464
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID:	10048331	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	08/18/1992	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Location Method Desc:	Not Applicable i.e. no UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock**Materials Interval**

Formation ID:	931064737
Layer:	2
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	66
Material 3 Desc:	DENSE
Formation Top Depth:	3.0
Formation End Depth:	35.0
Formation End Depth UOM:	ft

Overburden and Bedrock**Materials Interval**

Formation ID:	931064736
Layer:	1
Color:	2
General Color:	GREY
Material 1:	12
Material 1 Desc:	STONES
Material 2:	28
Material 2 Desc:	SAND
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	3.0
Formation End Depth UOM:	ft

Annular Space/Abandonment**Sealing Record**

Plug ID:	933111845
Layer:	2
Plug From:	2.0
Plug To:	35.0
Plug Depth UOM:	ft

Annular Space/Abandonment**Sealing Record**

Plug ID: 933111844
Layer: 1
Plug From: 0.0
Plug To: 2.0
Plug Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 961526640
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596901
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084622
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 32.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326416
Layer: 1
Slot: 010
Screen Top Depth: 32.0
Screen End Depth: 35.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486016
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:

lot 15 ON

Database:
WWIS

Well ID: 1526641
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:

Audit No: 127463
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048332
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/17/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock
Materials Interval

Formation ID: 931064739
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 2.0
Formation End Depth: 32.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064738
Layer: 1
Color: 2
General Color: GREY
Material 1: 11
Material 1 Desc: GRAVEL
Material 2: 28
Material 2 Desc: SAND
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 2.0
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111846
Layer: 1
Plug From: 0.0
Plug To: 2.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111847
Layer: 2
Plug From: 2.0
Plug To: 32.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961526641
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596902
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084623
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 29.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326417
Layer: 1
Slot: 010
Screen Top Depth: 29.0
Screen End Depth: 32.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486017
Layer: 1
Kind Code: 1

Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:
lot 15 ON

Database:
[WWIS](#)

Well ID: 1526642
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127462
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048333
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/17/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock
Materials Interval

Formation ID: 931064741
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 2.0
Formation End Depth: 305.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064740
Layer: 1
Color: 2
General Color: GREY
Material 1: 12
Material 1 Desc: STONES
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 2.0
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111848
Layer: 1
Plug From: 0.0
Plug To: 3.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111849
Layer: 2
Plug From: 3.0
Plug To: 30.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961526642
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596903
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084624
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 28.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326418
Layer: 1

Slot: 010
Screen Top Depth: 28.0
Screen End Depth: 31.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486018
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:

lot 15 ON

Database:
[WWIS](#)

Well ID: 1526643
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127461
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048334
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/17/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock Materials Interval

Formation ID: 931064742
Layer: 1
Color: 2

General Color: GREY
Material 1: 12
Material 1 Desc: STONES
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064743
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 11
Material 3 Desc: GRAVEL
Formation Top Depth: 1.0
Formation End Depth: 31.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111851
Layer: 2
Plug From: 3.0
Plug To: 31.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111850
Layer: 1
Plug From: 0.0
Plug To: 3.0
Plug Depth UOM: ft

Method of Construction & Well
Use

Method Construction ID: 961526643
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596904
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084625

Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 28.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326419
Layer: 1
Slot: 010
Screen Top Depth: 28.0
Screen End Depth: 31.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486019
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:

lot 15 ON

Database:
[WWIS](#)

Well ID: 1526644
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127460
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048335
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/18/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Overburden and Bedrock
Materials Interval

Formation ID: 931064745
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 11
Material 3 Desc: GRAVEL
Formation Top Depth: 3.0
Formation End Depth: 28.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064744
Layer: 1
Color: 2
General Color: GREY
Material 1: 12
Material 1 Desc: STONES
Material 2: 10
Material 2 Desc: COARSE SAND
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 3.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111852
Layer: 1
Plug From: 0.0
Plug To: 2.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111853
Layer: 2
Plug From: 2.0
Plug To: 21.0
Plug Depth UOM: ft

Method of Construction & Well
Use

Method Construction ID: 961526644
Method Construction Code: 0
Method Construction: Not Known

Other Method Construction:

Pipe Information

Pipe ID: 10596905
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084626
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 19.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326420
Layer: 1
Slot: 010
Screen Top Depth: 15.0
Screen End Depth: 18.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486020
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 1.0
Water Found Depth UOM: ft

Site:

lot 15 ON

Database:

WWIS

Well ID: 1526645
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127459
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID:	10048336	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	08/18/1992	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Location Method Desc:	Not Applicable i.e. no UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock**Materials Interval**

Formation ID:	931064747
Layer:	2
Color:	2
General Color:	GREY
Material 1:	05
Material 1 Desc:	CLAY
Material 2:	06
Material 2 Desc:	SILT
Material 3:	11
Material 3 Desc:	GRAVEL
Formation Top Depth:	1.0
Formation End Depth:	27.0
Formation End Depth UOM:	ft

Overburden and Bedrock**Materials Interval**

Formation ID:	931064746
Layer:	1
Color:	2
General Color:	GREY
Material 1:	12
Material 1 Desc:	STONES
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	1.0
Formation End Depth UOM:	ft

Annular Space/Abandonment**Sealing Record**

Plug ID:	933111854
Layer:	1
Plug From:	0.0
Plug To:	2.0
Plug Depth UOM:	ft

Annular Space/Abandonment**Sealing Record**

Plug ID: 933111855
Layer: 2
Plug From: 2.0
Plug To: 26.0
Plug Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 961526645
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596906
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084627
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 24.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326421
Layer: 1
Slot: 010
Screen Top Depth: 24.0
Screen End Depth: 27.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486021
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site: lot 15 ON

Database:
WWIS

Well ID: 1526646
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE

Casing Material:
Audit No: 127458
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048337
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/13/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock

Materials Interval

Formation ID: 931064748
Layer: 1
Color: 2
General Color: GREY
Material 1: 00
Material 1 Desc: UNKNOWN TYPE
Material 2: 73
Material 2 Desc: HARD
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth UOM: ft

Overburden and Bedrock

Materials Interval

Formation ID: 931064749
Layer: 2
Color: 6
General Color: BROWN
Material 1: 10
Material 1 Desc: COARSE SAND
Material 2: 11
Material 2 Desc: GRAVEL
Material 3: 01
Material 3 Desc: FILL
Formation Top Depth: 1.0
Formation End Depth: 6.0

Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931064751
Layer: 4
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 11
Material 2 Desc: GRAVEL
Material 3: 77
Material 3 Desc: LOOSE
Formation Top Depth: 25.0
Formation End Depth: 31.0
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931064750
Layer: 3
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 28
Material 3 Desc: SAND
Formation Top Depth: 6.0
Formation End Depth: 25.0
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111857
Layer: 2
Plug From: 3.0
Plug To: 31.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111856
Layer: 1
Plug From: 2.0
Plug To: 3.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961526646
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596907
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084628
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 28.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326422
Layer: 1
Slot: 010
Screen Top Depth: 28.0
Screen End Depth: 31.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486022
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:

lot 15 ON

Database:
[WWIS](#)

Well ID: 1526647
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127454
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048338 Elevation:

DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	
Cluster Kind:		UTMRC:	9
Date Completed:	08/14/1992	UTMRC Desc:	unknown UTM
Remarks:		Location Method:	na
Location Method Desc:	Not Applicable i.e. no UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock
Materials Interval

Formation ID:	931064752
Layer:	1
Color:	2
General Color:	GREY
Material 1:	00
Material 1 Desc:	UNKNOWN TYPE
Material 2:	
Material 2 Desc:	
Material 3:	
Material 3 Desc:	
Formation Top Depth:	0.0
Formation End Depth:	1.0
Formation End Depth UOM:	ft

Overburden and Bedrock
Materials Interval

Formation ID:	931064753
Layer:	2
Color:	6
General Color:	BROWN
Material 1:	08
Material 1 Desc:	FINE SAND
Material 2:	01
Material 2 Desc:	FILL
Material 3:	
Material 3 Desc:	
Formation Top Depth:	1.0
Formation End Depth:	5.0
Formation End Depth UOM:	ft

Annular Space/Abandonment
Sealing Record

Plug ID:	933111859
Layer:	2
Plug From:	1.0
Plug To:	5.0
Plug Depth UOM:	ft

Annular Space/Abandonment
Sealing Record

Plug ID:	933111858
Layer:	1
Plug From:	0.0

Plug To: 1.0
Plug Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 961526647
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596908
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084629
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 3.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326423
Layer: 1
Slot: 010
Screen Top Depth: 3.0
Screen End Depth: 6.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486023
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 4.0
Water Found Depth UOM: ft

Site:
lot 15 ON

Database:
[WWIS](#)

Well ID: 1526648
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127457
Tag:
Constructn Method:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:

Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048339
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/13/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock Materials Interval

Formation ID: 931064754
Layer: 1
Color: 2
General Color: GREY
Material 1: 00
Material 1 Desc: UNKNOWN TYPE
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth UOM: ft

Overburden and Bedrock Materials Interval

Formation ID: 931064756
Layer: 3
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 08
Material 2 Desc: FINE SAND
Material 3: 06
Material 3 Desc: SILT
Formation Top Depth: 4.0
Formation End Depth: 31.0
Formation End Depth UOM: ft

Overburden and Bedrock

Materials Interval

Formation ID: 931064755
Layer: 2
Color: 2
General Color: GREY
Material 1: 12
Material 1 Desc: STONES
Material 2: 79
Material 2 Desc: PACKED
Material 3: 01
Material 3 Desc: FILL
Formation Top Depth: 1.0
Formation End Depth: 4.0
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111861
Layer: 2
Plug From: 3.0
Plug To: 31.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111860
Layer: 1
Plug From: 2.0
Plug To: 3.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961526648
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596909
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084630
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 28.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326424

Layer: 1
Slot: 010
Screen Top Depth: 28.0
Screen End Depth: 31.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486024
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:
lot 15 ON

Database:
[WWIS](#)

Well ID: 1526649
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127456
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048340
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/13/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock Materials Interval

Formation ID: 931064757
Layer: 1

Color: 2
General Color: GREY
Material 1: 00
Material 1 Desc: UNKNOWN TYPE
Material 2:
Material 2 Desc:
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064760
Layer: 4
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 8.0
Formation End Depth: 33.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064759
Layer: 3
Color: 6
General Color: BROWN
Material 1: 08
Material 1 Desc: FINE SAND
Material 2: 01
Material 2 Desc: FILL
Material 3:
Material 3 Desc:
Formation Top Depth: 4.0
Formation End Depth: 8.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064758
Layer: 2
Color: 2
General Color: GREY
Material 1: 12
Material 1 Desc: STONES
Material 2: 08
Material 2 Desc: FINE SAND
Material 3: 79
Material 3 Desc: PACKED
Formation Top Depth: 1.0
Formation End Depth: 4.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111863
Layer: 2
Plug From: 3.0
Plug To: 33.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111862
Layer: 1
Plug From: 2.0
Plug To: 3.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961526649
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596910
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084631
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 30.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326425
Layer: 1
Slot: 010
Screen Top Depth: 30.0
Screen End Depth: 33.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486025
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:

lot 15 ON

Database:
[WWIS](#)

Well ID: 1526637
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127467
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048328
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/19/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

**Overburden and Bedrock
Materials Interval**

Formation ID: 931064730
Layer: 1
Color: 2
General Color: GREY
Material 1: 12
Material 1 Desc: STONES
Material 2: 38
Material 2 Desc: CONGLOMERATE
Material 3: 28
Material 3 Desc: SAND
Formation Top Depth: 0.0
Formation End Depth: 3.0
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931064731
Layer: 2
Color: 2

General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 3.0
Formation End Depth: 23.0
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111839
Layer: 2
Plug From: 3.0
Plug To: 23.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111838
Layer: 1
Plug From: 0.0
Plug To: 3.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961526637
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596898
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084616
Layer: 1
Material:
Open Hole or Material:
Depth From:
Depth To: 18.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326413
Layer: 1
Slot: 010
Screen Top Depth: 18.0
Screen End Depth: 23.0
Screen Material:

Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486013
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:
lot 15 ON

Database:
[WWIS](#)

Well ID: 1530391
Construction Date:
Use 1st:
Use 2nd:
Final Well Status: Abandoned-Quality
Water Type:
Casing Material:
Audit No: 194596
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 12/01/1998
Selected Flag: TRUE
Abandonment Rec:
Contractor: 3749
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10051926
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 09/10/1998
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Annular Space/Abandonment Sealing Record

Plug ID: 933115535
Layer: 1
Plug From: 25.0
Plug To: 378.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933115536
Layer: 2
Plug From: 1.0
Plug To: 25.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961530391
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10600496
Casing No: 1
Comment:
Alt Name:

Site:
lot 15 ON

Database:
WWIS

Well ID: 1526653
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127468
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048344
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/19/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

**Overburden and Bedrock
Materials Interval**

Formation ID: 931064770
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 6.0
Formation End Depth: 32.0
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931064769
Layer: 1
Color: 6
General Color: BROWN
Material 1: 08
Material 1 Desc: FINE SAND
Material 2: 01
Material 2 Desc: FILL
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 6.0
Formation End Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111871
Layer: 2
Plug From: 3.0
Plug To: 32.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111870
Layer: 1
Plug From: 0.0
Plug To: 3.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961526653
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596914

Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084635
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 22.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326429
Layer: 1
Slot: 010
Screen Top Depth: 22.0
Screen End Depth: 32.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486029
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site:
lot 15 ON

Database:
[WWIS](#)

Well ID: 1526652
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127469
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048343
DP2BR:
Elevation:
Elevrc:

Spatial Status:		Zone:	18
Code OB:		East83:	
Code OB Desc:		North83:	
Open Hole:		Org CS:	9
Cluster Kind:		UTMRC:	unknown UTM
Date Completed:	08/20/1992	UTMRC Desc:	na
Remarks:		Location Method:	
Location Method Desc:	Not Applicable i.e. no UTM		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock
Materials Interval

Formation ID: 931064768
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 5.0
Formation End Depth: 30.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064767
Layer: 1
Color: 6
General Color: BROWN
Material 1: 08
Material 1 Desc: FINE SAND
Material 2: 01
Material 2 Desc: FILL
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 5.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111868
Layer: 1
Plug From: 1.0
Plug To: 3.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111869
Layer: 2
Plug From: 3.0
Plug To: 30.0

Plug Depth UOM: ft

Method of Construction & Well Use

Method Construction ID: 961526652
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596913
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084634
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 27.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326428
Layer: 1
Slot: 010
Screen Top Depth: 27.0
Screen End Depth: 30.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486028
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Site: lot 15 ON

Database:
[WWIS](#)

Well ID: 1526651
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127470
Tag:
Constructn Method:
Elevation (m):

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON

Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048342
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/20/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

Overburden and Bedrock
Materials Interval

Formation ID: 931064765
Layer: 1
Color: 6
General Color: BROWN
Material 1: 11
Material 1 Desc: GRAVEL
Material 2: 08
Material 2 Desc: FINE SAND
Material 3: 01
Material 3 Desc: FILL
Formation Top Depth: 0.0
Formation End Depth: 5.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064766
Layer: 2
Color: 2
General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 5.0
Formation End Depth: 28.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111866
Layer: 1
Plug From: 0.0
Plug To: 2.0
Plug Depth UOM: ft

**Annular Space/Abandonment
Sealing Record**

Plug ID: 933111867
Layer: 2
Plug From: 2.0
Plug To: 28.0
Plug Depth UOM: ft

**Method of Construction & Well
Use**

Method Construction ID: 961526651
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596912
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084633
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 23.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326427
Layer: 1
Slot: 010
Screen Top Depth: 23.0
Screen End Depth: 28.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486027
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 1.0
Water Found Depth UOM: ft

Site:

lot 15 ON

Database:
[WWIS](#)

Well ID: 1526650
Construction Date:
Use 1st: Not Used
Use 2nd:
Final Well Status: Test Hole
Water Type:
Casing Material:
Audit No: 127455
Tag:
Constructn Method:
Elevation (m):
Elevatn Reliability:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality: OTTAWA CITY
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src: 1
Date Received: 10/19/1992
Selected Flag: TRUE
Abandonment Rec:
Contractor: 6571
Form Version: 1
Owner:
County: OTTAWA-CARLETON
Lot: 015
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 10048341
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 08/12/1992
Remarks:
Location Method Desc: Not Applicable i.e. no UTM
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone: 18
East83:
North83:
Org CS:
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: na

**Overburden and Bedrock
Materials Interval**

Formation ID: 931064761
Layer: 1
Color: 2
General Color: GREY
Material 1: 00
Material 1 Desc: UNKNOWN TYPE
Material 2: 73
Material 2 Desc: HARD
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 1.0
Formation End Depth UOM: ft

**Overburden and Bedrock
Materials Interval**

Formation ID: 931064764
Layer: 4
Color: 2

General Color: GREY
Material 1: 05
Material 1 Desc: CLAY
Material 2: 06
Material 2 Desc: SILT
Material 3: 66
Material 3 Desc: DENSE
Formation Top Depth: 5.0
Formation End Depth: 33.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064763
Layer: 3
Color: 6
General Color: BROWN
Material 1: 28
Material 1 Desc: SAND
Material 2: 11
Material 2 Desc: GRAVEL
Material 3: 01
Material 3 Desc: FILL
Formation Top Depth: 2.0
Formation End Depth: 5.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 931064762
Layer: 2
Color: 2
General Color: GREY
Material 1: 12
Material 1 Desc: STONES
Material 2: 79
Material 2 Desc: PACKED
Material 3:
Material 3 Desc:
Formation Top Depth: 1.0
Formation End Depth: 2.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111864
Layer: 1
Plug From: 2.0
Plug To: 5.0
Plug Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 933111865
Layer: 2
Plug From: 5.0
Plug To: 33.0
Plug Depth UOM: ft

Method of Construction & Well
Use

Method Construction ID: 961526650
Method Construction Code: 0
Method Construction: Not Known
Other Method Construction:

Pipe Information

Pipe ID: 10596911
Casing No: 1
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 930084632
Layer: 1
Material: 5
Open Hole or Material: PLASTIC
Depth From:
Depth To: 30.0
Casing Diameter: 2.0
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 933326426
Layer: 1
Slot: 010
Screen Top Depth: 30.0
Screen End Depth: 33.0
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter: 1.5

Water Details

Water ID: 933486026
Layer: 1
Kind Code: 1
Kind: FRESH
Water Found Depth: 5.0
Water Found Depth UOM: ft

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial [AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial [AGR](#)

This database of licensed and permitted pits and quarries is maintained by the Ontario Ministry of Natural Resources and Forestry (MNRF), as regulated under the Aggregate Resources Act, R.S.O. 1990. Aggregate site data has been divided into active and inactive sites. Active sites may be further subdivided into partial surrenders. In partial surrenders, defined areas of a site are inactive while the rest of the site remains active.

Government Publication Date: Up to Nov 2024

Abandoned Mine Information System:

Provincial [AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-Apr 2024

Anderson's Waste Disposal Sites:

Private [ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial [AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private [AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Apr 30, 2024

Borehole:

Provincial [BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2023

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-Apr 30, 2024

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -Feb 2025

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Apr 2025

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Apr 30, 2025

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database (ODHD) is offered by the Province of Ontario's Ministry of Mines. The dataset contains information for over 164,000 percussion, overburden, sonic and diamond-drill holes. The presence of assay results with cutoff values for gold, silver, copper, zinc, lead, nickel and platinum group elements is noted. Drill hole data are compiled from assessment files that have been submitted to the ministry in accordance with the Ontario Mining Act (OMA). Source assessment file numbers are captured for cross reference with the Ontario Assessment File Database (OAFD). Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Aug 2024

Delisted Fuel Tanks:

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Oct 2023

Environmental Activity and Sector Registry:

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011 - Apr 30, 2025

Environmental Registry:

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Apr 30, 2025

Environmental Compliance Approval:

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011 - Apr 30, 2025

Environmental Effects Monitoring:

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007*

ERIS Historical Searches:

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Aug 31, 2024

Environmental Issues Inventory System:

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022

Environmental Penalty Annual Report:

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment, Conservation and Parks (MECP). These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2024

List of Expired Fuels Safety Facilities:

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Federal Convictions:

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007*

Contaminated Sites on Federal Land:

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Jan 2025

Fisheries & Oceans Fuel Tanks:

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019

Federal Identification Registry for Storage Tank Systems (FIRSTS):

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: Oct 31, 2021

Fuel Storage Tank:

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. As of January 1, 2023, businesses and institutions subject to the amended Reg. 347: General – Waste Management are required to report their activities and pay fees through Resource Productivity & Recovery Authority (RPRA) online Hazardous Waste Program Registry (HWPR) rather than the Hazardous Waste Information Network (HWIN) system previously operated by the Ministry of the Environment, Conservation and Parks (MECP). Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Dec 31, 2024

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Apr 2024

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing in a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: 31 Oct, 2023

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 31, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2025

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment Conservation and Parks (MECP) provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act. MECP publicly releases the Environmental Compliance Report (ECR) on the Ontario Data Catalogue. In Ontario, all facilities with regulated wastewater discharges or air emissions under the Ontario Water Resources Act and the Environmental Protection Act must monitor and report any cases where approved operating limits have been exceeded.

Government Publication Date: Dec 31, 2023

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Nov 2023

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-May 31, 2025

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

[NEES](#)

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

[NPCB](#)

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

[NPR2](#)

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of pollutant releases (to air, water and land), disposals, and transfers for recycling. The inventory, managed by Environment and Climate Change Canada, tracks over 300 substances. Under the authority of the Canadian Environmental Protection Act (CEPA), owners or operators of facilities that meet published reporting requirements are required to report to the NPRI.

Government Publication Date: Feb 2024**National Pollutant Release Inventory - Historic:**

Federal

[NPRI](#)

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances. This data holds historic records; current records are found in NPR2.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

[OGWE](#)

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-Feb 28, 2025**Ontario Oil and Gas Wells:**

Provincial

[OOGW](#)

In 1998, the Ministry of Natural Resources (MNR) handed over to the Ontario Oil, Gas and Salt Resources (OGSR) Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database includes well owner/operator, location, permit issue date, and well cap date, license number, status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provided for each well record.

Government Publication Date: 1800-Aug 2024**Inventory of PCB Storage Sites:**

Provincial

[OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

[ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Apr 30, 2025

Canadian Pulp and Paper:

Private

PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014

Parks Canada Fuel Storage Tanks:

Federal

PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial

PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011 - Apr 30, 2025

Ontario PFAS Spills:

Provincial

PFAS

This specific list of spills includes those incidents where one or more of the listed contaminants are identified in the PFAS Structure List and/or PFAS Chemicals Without Explicit Structure List made available by the United States Environmental Protection Agency (US EPA), is originally sourced from the Ministry of the Environment, Conservation and Parks spills related data. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024; Aug 2024; Oct-Nov 2024

NPRI Reporters - PFAS Substances:

Federal

PFCH

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This listing of PFAS substance reporters includes those NPRI facilities that reported substances that are found in either: a) the Comprehensive Global Database of PFASs compiled by the Organisation for Economic Co-operation and Development (OECD), b) the US Environmental Protection Agency (US EPA) Master List of PFAS Substances, c) the US EPA list of PFAS chemicals without explicit structures, or d) the US EPA list of PFAS structures (encompassing the largest set of structures having sufficient levels of fluorination to potentially impart PFAS-type properties).

Government Publication Date: Feb 2024

Potential PFAS Handlers from NPRI:

Federal

PFHA

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This list of potential PFAS handlers includes those NPRI facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used, or released by the facility - these are facilities that potentially handle PFAS based on their industrial profile.

Government Publication Date: Feb 2024

Pipeline Incidents:

Provincial

PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Potential PFAS Handlers from EASR:

Provincial

PPHA

The Ontario Environmental Activity and Sector Registry (EASR), described in Ontario Regulation 245/11, allows businesses with less complex operations - and hence not requiring an Environmental Compliance Approval - to register their activities with the Ontario Ministry of the Environment, Conservation and Parks (MECP). This list of potential PFAS handlers includes those EASR facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used.

Government Publication Date: Jun 30, 2024

Private and Retail Fuel Storage Tanks:

Provincial

PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial

PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Apr 30, 2025

Ontario Regulation 347 Waste Receivers Summary:

Provincial

REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2021

Record of Site Condition:

Provincial

RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up. RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09). The Government of Ontario states that it is not responsible for the accuracy of the information in this Registry.

Government Publication Date: 1997-Sept 2001, Oct 2004-May 2025

Retail Fuel Storage Tanks:

Private

RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-Apr 30, 2024

Scott's Manufacturing Directory:

Private

SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial

SPL

List of spills and incidents made available by the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024; Aug-Feb 2025

Wastewater Discharger Registration Database:

Provincial

SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2021

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2024

Variances for Abandonment of Underground Storage Tanks:

Provincial

[VAR](#)

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

[WDS](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011 - Apr 30, 2025

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

[WDSH](#)

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

[WWIS](#)

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Dec 31 2023

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.

APPENDIX 3

QUALIFICATIONS OF ASSESSORS



PATERSON GROUP

solution oriented engineering



Kuldeep Panchal Junior Environmental Scientist

Kuldeep Panchal is a Junior Environmental Scientist with Paterson Group in Ottawa, Ontario. Kuldeep received his Bachelor of Civil Engineering in 2017, Charotar University of Sciences & Technology. In 2019 He earned his Master's in Environmental Engineering, from the University of Ottawa. In his time at Paterson with Environmental Division, Kuldeep has been involved in primarily residential and commercial development projects predominantly within the National Capital Region, where he conducted Phase I Environmental Site Assessments (ESAs) to MECP and CSA standards and conducted environmental and geotechnical subsurface investigations. His current scope of work consists of environmental investigation, reporting, field inspections, soil and groundwater sampling, supervising the remediation of contaminated sites, and ensuring compliance with applicable regulatory standards.

EDUCATION

Master's Environmental Engineering, 2019
University of Ottawa, Ottawa, ON

Bachelor of Civil Engineering, 2017
Charotar University of Sciences & Technology,
Gujarat, India

LICENCE/PROFFESIONAL AFFILIATIONS

E.I.T. (Engineer in Training) with PEO
CCIL (Canadian Council of Independent Laboratories)
– Type QF
TDG (Transportation of Dangerous Goods) – Type A
Packages

YEARS OF EXPERIENCE

With Paterson: 3

Other Firms: 1.5

OFFICE LOCATION

9 Auriga Drive
Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS

- CSA Phase I Environmental Site Assessments (ESAs) – Various Sites, Ottawa, ON
- Mattamy Homes – Fairwinds Phase 8 – Environmental subsurface investigation – Ottawa, ON
- Soil and Groundwater sampling – Various Sites, Ottawa, ON
- CECCE – 205 Scholastic – Micro Piling – Ottawa, ON
- Minto – Quinn's Pointe – Stage 4 – Site Servicing and Soil Inspections – Ottawa, ON
- W.H. MacSweyn – Prepared Compaction Plan and Road Works – Ottawa, ON
- Minto – Brookline – Site Servicing – Ottawa, ON
- Various High Rise and Commercial Projects – Material Testing – Ottawa, ON
- Proposal Preparation for Material Testing – Various Projects

PROFESSIONAL EXPERIENCE

March 2024 to present – **Junior Environmental Scientist, Environmental Division, Paterson Group, Ottawa, Ontario**

- Conduct Phase I – Environmental Site Assessments (ESAs) to CSA and O.Reg. 153/04 Standards.
- Responsible for the application of environmental, hydrological, and/or geotechnical principles and practices in the identification and delineation of soil and groundwater contamination plumes while ensuring compliance with federal, provincial, and/or municipal legal and regulatory requirements.
- Presenting analytical test results, interpretations, assessments, recommendations and/or conclusions in a final technical report.
- Field experience in the supervision of drilling and excavation contractors, inspection of aboveground and underground fuel storage tanks, soil and rock classification, and soil and groundwater field sampling.
- Coordination of contractors while directly reporting to intermediate and senior management to ensure completion of project on schedule and within budget.

July 2023 to February 2024 – **Project Coordinator, Materials Testing, Paterson Group, Ottawa, Ontario**

- Prepares technical reports for existing clients, such as geotechnical summaries, and foundation assessments.
- Compiles proposals for various private and government-based tenders.
- Aids with project-related procurements.
- Prepares and reviews training and Standard Operating Procedures (SOP's) documents for the Materials Testing Department.
- Works closely with Director or Project Managers within the Materials Testing Department to ensure reports are completed on time.
- Actively takes part in extra training and the training of field staff.
- Assists the Director or Project Manager and field staff with various site inspections.

May 2021 to July 2023 – **Field Technologist, Materials Testing – Paterson Group, Ottawa, ON**

- Geotechnical investigations include test pitting programs for various types of subsurface soils investigations.
- Prepares geotechnical investigation reports and slope stability analysis with accompanying recommendations.
- Field inspections and material testing include but not limited to compaction, proof rolling, concrete testing, mortar/grout testing, subgrade reviews, bearing medium evaluations, bearing surface inspections, rebar inspections, both footings and walls, and asphalt sampling.
- Specialty testing such as, cover meter inspections, Piling and Micro Piling, excavation reviews, thermocouple installation and readings, Schmidt hammer testing, granular sampling, light weight fill, and crack monitoring.

June 2017 to June 2018 – **Site Engineer, Sheth Enterprise – Surat, Gujarat, India**

- Used theoretical knowledge of construction work in practical scenarios.
- Was responsible for handling multiple residential construction sites in Surat area.
- Performed duties such as site inspections, supervision of workers and the coordination between contractors and design engineers.
- Trained civil engineering graduates during their internships on the construction sites.

February 2017 to April 2017 – **Environmental Laboratory Trainee – Detox Corporation Pvt. Ltd. – Surat, Gujarat, India**

- Performed analysis of environmental samples which were collected on a regular basis adhering to the safety regulations.
- Understood the design plans of water and wastewater treatment plants.
- Implemented various regulations and limits of parameters in water and wastewater discharge.
- Performed analysis of samples using apparatus such as a Bomb Calorimeter and a Spectrophotometer.
- Conducted a variety of tests on water and wastewater using methods such as Biochemical Oxygen Demand (BOD) and Chemical Oxygen Demand (COD) tests.
- Learned how to formulate environmental impact assessment reports.
- Authored professional reports listing the characteristics of tested waste and hazardous waste.
- Gathered and prepared reports on Quality Assurance (QA) of environmental waste.



PATERSON GROUP

solution oriented engineering



Mark S. D'Arcy, P.Eng., QP_{ESA} **Director – Environmental Division**

After receiving his Bachelors of Applied Science from Queen's University in 1991 in Geological Engineering, Mark joined Paterson Group Inc. During the first 10 years of Mark's career, he was heavily involved in all aspects of field work, including drilling boreholes, excavating test pits, conducting phase I site inspections, environmental sampling and analysis and inspection of environmental remediations. During Mark's field experience, he gained invaluable field and office experience, which would prepare Mark to become the Environmental Division Manager. Mark's field experience ranges from Phase I Environmental Site Assessments (ESAs) to on-site soil and groundwater remediations, as well as, environmental/geotechnical borehole investigations. Mark's field experience has provided extensive knowledge of subsurface conditions, contractor relations and project management. These skills would provide Mark with the ability to understand a variety of situations, which has lead Paterson to an extremely successful Environmental Department. Mark became the Environmental Manager in 2006, which consisted of two engineers and two field technicians. Mark has been an integral part in growing the Environmental Division, which now consists of nine engineers and three field technicians. Mark is the Senior Project Manager for a wide variety of environmental projects within the Eastern Ontario area including Phase I ESAs, Phase II ESAs, remediations for filing Records of Site Condition in the Ontario Ministry of the Environment and Climate Change (MOECC) Environmental Site Registry, Brownfield Applications and Landfill Monitoring Programs. As the Senior Project Manager, Mark is responsible for directing project personnel, final report review and overall project success. Mark has proven leadership and ability to manage small to large scale projects within the allotted time and budget.

EDUCATION

B.A.Sc. 1991, Geological Engineering, Queen's University, Kingston, ON

LICENCE/PROFESSIONAL AFFILIATIONS

Professional Engineers of Ontario

ESA Qualified Person with MECP

Ontario Society of Professional Engineers

Consulting Engineers of Ontario

YEARS OF EXPERIENCE

With Paterson: 33

OFFICE LOCATION

9 Auriga Drive, Ottawa, Ontario, K2E 7T9

SELECT LIST OF PROJECTS

- 222 Beechwood Avenue, Ottawa, Ontario (Senior Project Manager for Phase I ESA, Phase II ESA, Phase III ESA, Environmental Remediation)
- 409 MacKay Street, Ottawa, Ontario (Senior Project Manager for Phase I ESA, Phase II ESA, Phase III ESA, Environmental Remediation)
- Art's Court Redevelopment, Ottawa, Ontario (Senior Project Manager for Phase I ESA, Phase II ESA, Phase III ESA, Environmental Remediation)
- Visitor Welcome Centre, Phase II and Phase III, Parliament Hill, Ottawa, Ontario (Senior Project Manager for Environmental Remediation)
- Mattawa Landfill, Mattawa, Ontario (Senior Project Manager, Annual Water Quality Monitoring report)
- Multi-Phase Redevelopment of the Ottawa Train Yards, Ottawa, Ontario (Senior Project Manager)
- Rideau Centre Expansion, Ottawa, Ontario (Senior Project Manager for Phase I ESA, Phase II ESA, Phase III ESA, Environmental Remediation)
- 26 Stanley Avenue, Ottawa, Ontario, Phase I ESA, Phase II ESA (Senior Project Manager)
- Monitoring Landfills for River Valley, Kipling and Lavigne (Senior Project Manager)
- Block D Lands – Brownfields Project - Kingston

PROFESSIONAL EXPERIENCE

2001 to present, Manager of Environmental Division, Paterson Group Inc., Ottawa, Ontario

- Manage all aspects of the environmental division (management of personnel, budgeting, invoicing, scheduling, business development, reporting, marketing, and fieldwork).
- Review day to day operations within the environmental division.
- Design, perform, and lead Phase I, II and Phase III ESAs, Remediation's, Brownfield Applications and Record of Site conditions, fieldwork surveys, excavation, monitoring, laboratory analysis, and interpretation.
- Write, present, and publish reports with methodology and laboratory analysis results, along with recommendations for environmental findings.
- Responsible for ensuring projects meet Ministry of Environment and Climate Change Standards and Guidelines.
- Building and fostering relationships with clients, stakeholders, and Ministry officials.
- Supervise and continuous training of staff in environmental methods (environmental sampling techniques, technical expertise and guidance).
- Applied due diligence in ensuring the health and safety of staff and the public in field locations.

1991 to 2001, Geotechnical and Environmental Engineer, Paterson Group Inc., Ottawa, Ontario

- Provide on-site geotechnical and environmental expertise to various clients.
- Oversee geotechnical and environmental investigations for drilling and test pitting on numerous proposed utility installations, residential and commercial developments.
- Problem solving to help advance or maintain project schedules.
- Complete environmental reports with recommendations to meet environmental standards set by MOE and CCME standards.
- Conduct site inspections, bearing medium evaluations, bearing surface inspections, concrete testing and field density testing.
- Liaising with contractors, consultants and government officials.
- Provide cost estimates for geotechnical and environmental field programs and construction costs.
- Review RFI's, submittals, monthly progress reports and other various construction related work.