



November 3, 2025
File: PE7221-LET.01

Regional Group

1737 Woodward Drive, 2nd Floor
Ottawa, Ontario
K2C 0P9

Attention: **Mr. Evan Garfinkel**

Subject: **Phase I - Environmental Site Assessment Update
1101 Baxter Road
Ottawa, Ontario**

Consulting Engineers

9 Auriga Drive
Ottawa, Ontario
K2E 7T9
Tel: (613) 226-7381

Geotechnical Engineering
Environmental Engineering
Hydrogeology
Materials Testing
Building Science
Rural Development Design
Temporary Shoring Design
Retaining Wall Design
Noise and Vibration Studies

patersongroup.ca

Dear Sir,

Further to your request, Paterson Group (Paterson) carried out a Phase I - Environmental Site Assessment (Phase I ESA) Update for the property located at 1101 Baxter Road, in the City of Ottawa (Phase I Property). The Phase I Property boundaries are defined as PIN 09356-0003 being Part of Blocks G and H, Registered Plan 383389, City of Ottawa, as shown on the attached Survey Plan by Annis, O'Sullivan Vollebekk Ltd. dated March 30, 2017.

This report is an update of a Phase I-II ESA completed by Morrison Hershfield, dated October 25, 2018 and is intended to meet the requirements of a Phase I ESA Update, as per the Ministry of the Environment, Conservation and Parks (MECP) Standard Ontario Regulation (O.Reg.) 153/04: Records of Site Condition, as amended, under the Environmental Protection Act. This report is to be read in conjunction with the previous report.

Site Information

The Phase I Property is located on the east side of Baxter Road, approximately 120m north of Iris Street, in the City of Ottawa, Ontario, which is shown on Figure 1 - Key Plan, following the body of this report.



The Phase I Property is an irregular shaped lot with an approximate footprint of 3.2ha and is situated in an urban setting consisting of commercial (retail and office space), light industrial and residential land uses. The central and north portions of the Phase I Property are currently occupied by a one to two-storey light industrial building. The remainder of the Phase I Property consists of asphaltic concrete parking and landscaped areas.

Previous Engineering Reports

The following report was reviewed prior to conducting this assessment:

- ❑ 'Phase I-II Environmental Site Assessment, 1101 Baxter Road, Ottawa, Ontario', prepared by Paterson Group, dated February 27, 2017.

According to historical research conducted as part of the 2017 Phase I-II ESA, the Phase I Property was first developed with a newspaper publishing/printing facility in 1972 and has remained as such until the present day. Former varsol USTs associated with cleaning the printing presses were removed from the Phase I Property circa 1993/1994. The south-central portion of the Phase I Property was further developed circa 1983 with an automotive service garage and a private fuel outlet with associated USTs, all of which were demolished and removed circa 1993–1994. The existing on-site newspaper printing facility, former varsol USTs, former on-site automotive service garage, former on-site private fuel outlet and associated USTs were considered to represent areas of potential environmental concern (APECs) on the Phase I Property.

Historically, properties within the Phase I Study Area were used for agricultural, residential, commercial and light industrial purposes. A former off-site dry cleaner was identified at 1129 Baxter Road (part of present day 1119 Baxter Road), adjacent to the southwest of the Phase I Property. The former off-site dry cleaner was identified as an off-site Potential Contaminating Activities (PCAs) that represents an APEC on the Phase I Property.

Following the historical research, an inspection of the Phase I Property and surrounding lands was conducted. No additional environmental concerns were identified on the Phase I Property or the surrounding lands; however, the APECs associated with the existing newspaper publishing and printing facility were more precisely defined.

A Phase II ESA was recommended to address the APECs identified as part of the Phase I ESA.



Seven boreholes (BH1 through BH7) were drilled to assess the previously identified APECs on the Phase I Property. BH6 and BH7 were drilled inside the newspaper printing facility. Four out of the seven boreholes (BH1, BH2, BH6 and BH7), located on the south and central portions of the Phase I Property were completed as groundwater monitoring wells.

Seven soil samples were submitted for laboratory analysis of volatile organic compounds (VOCs), benzene, toluene, ethylbenzene, toluene (collectively known as BTEX) and/or petroleum hydrocarbons (PHCs, F₁-F₄). Concentrations of PHCs (F₁-F₃) in soil sample BH6-SS6 (from the interior of the subject building) exceeded the MECP Table 3 Residential Parkland Institutional (RPI) Standards. Remaining parameter concentrations in the soil samples submitted for analysis comply with the selected MECP Table 3 RPI Standards.

Groundwater samples were collected from the monitoring wells installed in BH1, BH2, BH6 and BH7, as well as from one existing monitoring well installed on the Phase I Property (AEC1-5 and AEC 2-2) as part of a previous environmental investigation. The six groundwater samples were submitted for laboratory analysis of VOCs, BTEX and/or PHCs. Concentrations of chloroform in the groundwater from AEC2-2 exceeded the MECP Table 3 RPI Standards. The chloroform exceedance was suspected to be due to the use of municipal water during the drilling program. All other parameters in the groundwater samples submitted for analysis comply with the selected MECP Table 3 RPI Standards.

Impacted soil was identified beneath the paper storage area in the southeast corner of the subject building, downgradient of the former varsol USTs. Although the varsol UST nest was remediated in 1993–1994, it was still considered the source of the contamination.

It was recommended that additional investigation of soil and groundwater quality be carried out in the paper storage area and black ink storage room, and that remediation of residual impacted soil in the vicinity of the former Varsol UST nest be undertaken as part of redevelopment activities on the Phase I Property.

The findings of the 2017 Phase I-II ESA have been taken into consideration as part of this Phase I ESA Update.

- ❑ 'Phase One and Phase Two Environmental Site Assessments – 1101 Baxter Road, Ottawa, Ontario', prepared by Morrison Hershfield, dated October 25, 2018.

The findings of the Phase I ESA portion of the 2018 Phase I-II ESA were generally consistent with those identified in the 2017 Phase I-II ESA.



Several historic records pertaining to metal treatment, coating and plating were identified for the property addressed 1050-1051 Baxter Road, adjacent to the east of the Phase I Property. The former metal treatment, coating and plating associated with the 1050-1051 Baxter Road Property were identified as a potential environmental concern on the Phase I Property.

A Phase II ESA was recommended to address the APECs identified as part of the Phase I ESA.

Five boreholes (BS-1 through BS-5) were drilled to assess the previously identified APECs on the Phase I Property. BS-4 and BS-5 were drilled inside the newspaper printing facility. Two out of the five boreholes (BS-1 and BS-3), located on the southwest and east portions of the Phase I Property were completed as groundwater monitoring wells.

Seven soil samples were submitted for laboratory analysis of VOCs, PHCs (F₁-F₄), polycyclic aromatic hydrocarbons (PAHs) and/or metals. Concentrations of PHCs (F₁-F₃) and PAHs (methylnaphthalene and naphthalene) in soil sample BS-5-SA5 (from the interior of the subject building) exceeded the MECP Table 3 Residential Parkland Institutional (RPI) Standards. Remaining parameter concentrations in the soil samples submitted for analysis comply with the selected MECP Table 3 RPI Standards.

Groundwater samples were collected from the monitoring wells installed in BS-1 and BS-3, as well as from four existing monitoring wells installed on the Phase I Property (EW-2 through EW-5) as part of a previous environmental investigation. The six groundwater samples were submitted for laboratory analysis of VOCs, PHCs, PAHs, and metals. Concentrations of PHCs (F₂) in the groundwater from EW-5 exceeded the MECP Table 3 RPI Standards. All other parameters in the groundwater samples submitted for analysis comply with the selected MECP Table 3 RPI Standards.

Impacted soil and groundwater were identified beneath the paper storage area in the southeast corner of the subject building, downgradient of the former varsol USTs. Although the UST nest was remediated in 1993–1994, it was still considered the source of the contamination.

Given the subject building was to continue operating as a printing facility, remediation of the impacted material was considered impractical and further investigation and remediation were not considered warranted.

Remediation of impacted material was recommended to be conducted as part of redevelopment activities on the Phase I Property. Additional analytical groundwater testing will be required to confirm the quality of the groundwater to ensure it meets the applicable MECP Table 3 RPI Standards.



The findings of the 2018 Phase I-II ESA have been taken into consideration as part of this Phase I ESA Update.

Historical Review and Records Update

Ministry of the Environment, Conservation and Parks (MECP) Freedom of Information (FOI) Request

As part of the 2017 Phase I-II ESA conducted for the Phase I Property, an MECP FOI search was conducted.

A new request was submitted to the MECP Freedom of Information (FOI) office for information with respect to reports related to environmental conditions, environmental incidents and/or any other similar MECP documents for the Phase I Property. The response from MECP contained no new records since the time of the search conducted as part of the 2017 Phase I-II ESA. A copy of the MECP FOI response is appended to this letter.

MECP Brownfields Environmental Site Registry

A search of the MECP Brownfields Environmental Site Registry was conducted as part of this assessment for the site, neighbouring properties and the general area of the site. No Records of Site Condition (RSCs) were identified for the Phase I Property or for any properties within the Phase I Study Area.

Technical Standards and Safety Authority (TSSA)

The TSSA, Fuels Safety Branch in Toronto, was contacted electronically on August 26, 2025, to inquire about current and former underground storage tanks, spills and incidents for the site and neighbouring properties. The response from the TSSA identified two expired fuel tank records and an expired private fuel outlet record for the Phase I Property. These TSSA records were also noted in the 2018 Morrison Hershfield Phase I-II ESA and are associated with the former on-site private fuel outlet. The USTs were reportedly removed in 1993/1994. While soil analytical testing in compliance with site standards has been conducted in the area of the former private fuel outlet and associated USTs, groundwater has not historically been assessed for all Contaminants of Potential Concern (CPCs) in this area. As a result, the former private fuel outlet and USTs are considered to represent an Area of Potential Environmental Concern (APEC) on the Phase I Property, particularly with respect to groundwater.

No records were identified in the TSSA registry for the surrounding properties.



City of Ottawa Historical Land Use Inventory (HLUI)

As part of this assessment, a requisition form was submitted to the City of Ottawa to request information from the City's Historical Land Use Inventory (HLUI) database for any environmental records pertaining to the Phase I Property as well as any properties situated within the Phase I Study Area.

A response from the City of Ottawa had not been received by our firm prior to the issuance of this report. A copy of the response will be forwarded to the client should it contain any pertinent information. A copy of the submission request has been appended to this report.

Environmental Risk Information Service (ERIS) Report

An ERIS (Environmental Risk Information Service) Report was obtained for Phase I Property and surrounding lands as part of this Phase I ESA Update. It should be noted that the ERIS report includes information that can normally be obtained through the MECP FOI, MECP well records search as well as several other records (i.e., incident reports, waste generators, etc.). An ERIS report was obtained and reviewed as part of the 2018 Phase I-II ESA, as a result, only new records identified in the more recent ERIS Report were reviewed as part of this assessment. The complete ERIS report has been appended to this report.

☐ *On-Site Records:*

A total of four new records were identified for the Phase I Property. These records pertain to monitoring wells installed during the 2018 subsurface investigation. No new environmental concerns were identified based on the on-site records review of the ERIS report.

☐ *Off-Site Records:*

A total of 217 new records (20 of which are historical ERIS searches) from various databases were identified for surrounding properties within the Phase I Study Area.

The ERIS report identified 43 Ontario Spill records for properties within the Phase I Study Area. The nearest record involved an 800 L concrete washout spill to a ditch during construction activities by Kewitt north of the Phase I Property, across Highway 417, and is not considered a PCA. Another record, dated 2011, involved a 200 L diesel spill on the road and catchbasin in front of 2611 Queensview Drive, approximately 230 m northwest of the Phase I Property. This spill is considered a PCA within the Phase I Study Area; however, based on the separation distance and its down-gradient orientation relative to the Phase I Property, it is not considered to pose an environmental concern. The remaining spill records pertain to minor incidents involving less than 30 litres of various substances such as hydraulic oil, diesel, natural gas, or coolant, or relate to previously



identified PCAs, and are not considered to pose an environmental concern to the Phase I Property.

The ERIS report identified two Private and Retail Fuel Storage Tank, two Expired Fuels Safety Facilities, and 5 Fuel Storage Tanks records for 2550 Queensview Drive, approximately 150 m north of the Phase I Property. These records are related to active and expired tank records associated with OC Transpo automotive service garage. The property's use is considered a PCA within the Phase I Study Area. Based on the separation distance and down-gradient orientation with respect to the Phase I Property, the automotive service garage at 2550 Queensview Drive is not considered to represent an environmental concern to the Phase I Property.

The ERIS report identified 81 new Ontario Regulation 347 Waste Generators Summary records for properties within the Phase I Study Area. All of the newly identified records pertain to previously identified PCAs or are not considered to represent an environmental concern based on information contained in the records.

The ERIS report identified seven Certificates of Approval, one Environmental Activity and Sector Registry (EASR) record, one Environmental Registry record, and four Environmental Compliance Approval (ECA) records for surrounding properties. These records are associated with air, sewage works, and construction dewatering activities and are not considered to pose an environmental concern to the Phase I Property.

The ERIS report identified 31 new Water Well Information System records and one borehole record within Phase I Study area, which are further discussed in the MECP Water Well Records section of this report.

The remaining new records identified in the ERIS report either relate to previously identified PCAs or are not considered to pose an environmental concern to the Phase I Property.

MECP Water Well Records

An updated search of the MECPs website for all drilled well records within 250 m of the Phase I Property was conducted on August 26, 2025. Two well records were identified for the Phase I Property. The two well records pertain to monitoring wells installed in 2018 as part of the previous environmental investigation for the Phase I Property. The monitoring wells on the Phase I Property were installed to a maximum depth of 8.5m below ground surface (mbgs) and the groundwater table was intercepted at depths ranging from approximately 2.3 to 2.9 mbgs. It should be noted that groundwater levels are expected to fluctuate throughout the year with seasonal variations. Bedrock was not encountered in the boreholes drilled as part of the 2018 environmental investigation.



Twelve new well records were identified for surrounding properties since the 2018 Phase I-II ESA, eight of which pertain to monitoring wells installed in 2018 or 2021 at 1050 Baxter Road, adjacent to the east of the Phase I Property. The remaining identified well records pertain to properties located a minimum of 80 m from the Phase I Property installed between 2019 and 2023. The identified well records are not considered to be representative of a new potential environmental concern to the Phase I Property.

Aerial Photographs

The latest aerial photograph reviewed as part of the 2018 Phase I-II ESA was from 2017. A review of the 2022 aerial photograph shows no significant changes to the Phase I Property or the surrounding properties since the 2017 aerial photograph. A copy of the 2022 aerial photograph has been appended to this report.

Property Owner Representative Interview

Mr. Evan Garfinkel, with Regional Group, was interviewed as part of this Phase I ESA Update. Mr. Garfinkel stated that he is unaware of any new environmental concerns regarding the Phase I Property, since the time of the 2018 Phase I-II ESA.

Site Reconnaissance

A site visit was conducted on October 1, 2025. Mr. Jeremy Camposarcone from the Environmental Department of Paterson Group conducted the site inspections. In addition to the site, the uses of neighbouring properties within the Phase I Study Area were also assessed at the time of the site visit.

Exterior Assessment

The north and central portions of the Phase I Property are occupied by a slab-on-grade/raised slab style newspaper publishing/printing facility with a single basement level in part of the office area and two-storeys in the press room and mechanical shop/maintenance rooms. Constructed in 1972, the subject building is finished on the exterior with brick, concrete and metal siding. The majority of the subject building has a flat tar and gravel style roof, while the northeast addition has a bitumen membrane roof.

The remainder of the Phase I Property consists of paved parking areas, access lanes and landscaped areas.

Site drainage consists of infiltration and sheet flow to catch basins located in the on-site parking areas and adjacent roadways. The Phase I Property is graded throughout the parking areas for water drainage, however, in general the site and regional topography sloped down towards a valley to the northwest of the Phase I Property. The site



topography is approximately at grade with the neighbouring properties to the south and east, and above grade with respect to Baxter Road to the north and west.

A set of vent/fill pipes was observed protruding from the ground adjacent to the south-facing wall of the subject building. These pipes are suspected to be associated with a former underground storage tank (UST) that was part of the on-site private fuel outlet. The USTs were reportedly removed from the property circa 1993–1994. No signs of staining, visual, or olfactory contamination were identified in the area surrounding these vent/fill pipes.

A second set of vent/fill pipes was observed protruding from the south-facing wall of the subject building. These pipes are associated with two linked interior diesel aboveground storage tanks (ASTs). No signs of staining, visual, or olfactory contamination were identified in the area surrounding these vent/fill pipes.

A black ink access pipe was identified at the southeast corner of the subject building. This pipe is used to supply black ink to the interior permanent vats located in the black ink room. Black ink staining was observed on the exterior brick adjacent to the access pipe.

A City of Ottawa hydro-vault was identified on the south-facing wall of the subject building. The hydro-vault was not accessible at the time of the site inspection.

Domestic and recyclable waste is stored in two dumpsters on the exterior of the subject building, near the loading dock. No environmental concerns were noted with respect to waste management practices on the Phase I Property.

No underground structures, drains, pits or sumps were observed on the exterior of the Phase I Property at the time of the site visit.

Five monitoring wells were observed on the exterior of the Phase I Property during the site visit. The monitoring wells were installed as part of the previous environmental investigations on the Phase I Property. The well caps were removed to confirm their suitability for potential future groundwater sampling, and all were found to be viable. No potable wells or private sewage systems were observed on the Phase I Property, nor are any expected to be present, as the Phase I Property is located in a municipally serviced area.

No evidence of current or former railway or spur lines was observed on the Phase I Property at the time of the site visit. There were no unidentified substances observed on the exterior of the Phase I Property.

The above-noted site features are shown on Drawing PE7221-1 - Site Plan.



Interior Assessment

A general assessment of the interior of the subject building is as follows:

- ☐ The floors throughout consisted of vinyl floor tiles and carpet in the office portion of the building and poured concrete in the warehouse area;
- ☐ The walls consisted drywall, concrete block and metal siding;
- ☐ The ceilings consisted of suspended tiles or exposed steel decking;
- ☐ Lighting throughout the building was provided by fluorescent fixtures.

The subject building is heated via a natural gas fired boiler and rooftop HVAC units.

Five monitoring wells from previous environmental investigations were identified inside the subject building during the site visit. The well caps were removed to confirm their suitability for potential future groundwater sampling, and all were found to be viable.

Hazardous Building Materials

An asbestos-containing material survey and management plan report was prepared for the subject site in October, 2004. The report identifies multiple ACMs in the subject building. For further information the asbestos-containing material survey and management plan report should be referenced.

Based on the age of the subject building (1972), lead-based paint may also be present on older or original painted surfaces, along with other designated substances.

Urea formaldehyde foam insulation was not observed during the site visit. However, wall cavities were not inspected for insulation type.

Other Potential Environmental Concerns

☐ **Fuels and Chemical Storage**

Diesel fuel is stored in two (linked) aboveground storage tanks on the ground and second floors, in the mechanical/maintenance rooms portion of the subject building. The vent/fill pipes identified on the exterior, southern portion of the subject building are connected to a double steel walled tank on the ground floor with a capacity of 950 L. On the floor above, a second double steel walled tank with a capacity of 375 L is present. The secondary tank is located in a secondary containment tray and is adjacent to the back-up generator room. It is understood the generator is tested out on a monthly basis and is known to be in good working order. The tags indicated the tanks were installed circa 2007. No signs of staining, visual, or olfactory contamination were identified in the area surrounding the ASTs.



Chemicals stored at the Phase I Property consist primarily of varsol, hydraulic and lubricating oil, ink and dampening solution (or foundation solution). There are no material safety data sheets (MSDS) available for the dampening solution, however, it was noted as having a neutral pH and does not contain VOCs. Lubricating oil, ink, varsol and dampening solution are stored in dedicated containers throughout the press room floors. Varsol is utilized to wipe down and clean the equipment. Waste varsol (oily waste) is stored in a 1,000 L tote near the loading bay, southeast of the press room. Coloured ink is stored in portable steel containers and limited waste ink is stored in steel barrels. Black ink is stored in two stationary aboveground vats, to the southeast of the press room.

Ink staining on the concrete floor was observed throughout the press room and in the waste storage room and black ink rooms, to the southeast of the press room. Staining on the concrete floor was also observed beneath the vacuum pumps in the warehouse area. The concrete floor throughout the building appeared to be in good condition, however, patches and cuts were observed on the east side of the press room and expansion joints for vibration reduction are present around the footing of the presses. These joints are filled with a sealant. The floor was slick with oil, dampening solution and ink around the base of the presses and absorbent sheets, booms and spill kits were in use.

☐ **Wastewater Discharges**

Wastewater from the subject building, consisting of wash water and sewage, is discharged into the City of Ottawa sanitary sewer system. No environmental concerns were identified with respect to wastewater discharges at the Phase I Property at the time of the site inspection.

Several floor drains were located throughout the subject building, both in the basement and the main floors, no water was observed in the floor drains. A sump pit was identified in the basement of the area office on the south-central portion of the subject building and was noted to contain stagnant water with a dusty film.

☐ **Ozone Depleting Substances (ODSs)**

Potential sources of ODSs observed in the subject building include fire extinguishers and refrigerators. These appliances appeared to be in good condition at the time of the site inspection and should be regularly serviced by a license contractor.



Neighbouring Properties

An inspection of the neighbouring properties was conducted from publicly accessible roadways at the time of the site inspection. Land use adjacent to the Phase I Property was as follows:

- ☐ North – Baxter Road, followed by Highway 417;
- ☐ South – Residential dwellings and commercial (retail and restaurants) plaza;
- ☐ East – Commercial (retail, offices) plazas;
- ☐ West – Baxter Road, followed by commercial buildings (restaurants, offices, retail).

The property addressed 2550 Queensview Drive, approximately 150m north of the Phase I Property, was identified as an OC Transpo automotive service garage. Based on the separation distance and down-gradient orientation with respect to the Phase I Property, the automotive service garage at 2550 Queensview Drive is not considered to represent an environmental concern to the Phase I Property.

Phase I Conceptual Site Model

Geological and Hydrogeological Setting

Bedrock was inferred within one borehole during the 2018 Phase I-II ESA at a depth of 9.45 m below ground surface, as determined by practical refusal at the time of the drilling program.

Groundwater at the Phase I Property was encountered in the overburden at the time of the 2018 Phase I-II ESA at depths ranging from 2.08 to 3.76 m below ground surface. Although groundwater flow direction was not calculated in the 2018 assessment, it was measured as northwesterly during the 2017 Phase I-II ESA.

Existing Buildings and Structures

The north and central portions of the Phase I Property are occupied by a slab-on-grade/raised slab style newspaper publishing/printing facility with a single basement level in part of the office area and two-storeys in the press room and mechanical shop/maintenance rooms. The subject building is heated via a natural gas fired boiler and rooftop HVAC units.



Water Bodies

No creeks, rivers, streams, lakes or any other water body were identified in the Phase I Study Area. Pinecrest Creek is the closest significant water body and is present approximately 850 m east of the site.

Areas of Natural Significance

A search for areas of natural significance and features within the Phase I Study Area was conducted on the Ontario Ministry of Natural Resources (MNR) website and the search did not reveal any areas of natural significance within the Phase I Study Area.

Drinking Water Wells

There are no potable water wells on the Phase I Property, nor are any expected to be present within the Phase I Study Area.

Neighbouring Land Use

Neighbouring land use in the Phase I Study Area consists of residential, commercial and light industrial purposes. No environmental concerns with the potential to impact the Phase I Property were identified with respect to the current use of the neighbouring properties.

Potentially Contaminating Activities and Areas of Potential Environmental Concern

The PCAs considered to result in APECs on the Phase I Property have been summarized in the table below.

Areas of Potential Environmental Concern					
Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 1 – Existing On-Site Printing Facility	Central portions of Phase I Property	Item 31 – Ink Manufacturing, Processing and Bulk Storage	On-Site	Metals As, Sb, Se PHCs BTEX VOCs	Soil Groundwater
APEC 2 – Former On-Site Automotive Service Garage	Central portion of Phase I Property	Item 52 – Storage, maintenance, fuelling and repair of equipment, vehicles, and material used to maintain transportation systems	On-Site	Metals As, Sb, Se PHCs BTEX VOCs PAHs	Soil Groundwater



Areas of Potential Environmental Concern					
Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 3 – Former On-site Private Fuel Outlet and UST Nest	Central portion of Phase I Property	Item 28 – Gasoline and Associated Products Storage in Fixed Tanks	On-Site	Metals As, Sb, Se PHCs BTEX VOCs	Soil Groundwater
APEC 4 - Former On-Site Used Varsol UST Nest	Eastern portion of Phase I Property	Item 28 – Gasoline and Associated Products Storage in Fixed Tanks	On-Site	Metals As, Sb, Se PHCs BTEX VOCs	Soil Groundwater
APEC 5A – Fill Material of Unknown Quality	Central portion of Phase I Property	Item 30 - Importation of Fill Material of Unknown Quality	On-Site	Metals As, Sb, Se Hg CrVI PHCs BTEX	Soil
APEC 5B – Fill Material of Unknown Quality	Central portion of Phase I Property	Item 30 - Importation of Fill Material of Unknown Quality	On-Site	Metals As, Sb, Se Hg CrVI PHCs BTEX	Soil
APEC 5C – Fill Material of Unknown Quality	Eastern portion of Phase I Property	Item 30 - Importation of Fill Material of Unknown Quality	On-Site	Metals As, Sb, Se Hg CrVI PHCs BTEX	Soil
APEC 6 – Existing On-Site Diesel Aboveground Storage Tanks	Central portion of Phase I Property	Item 28 – Gasoline and Associated Products Storage in Fixed Tanks	On-site	Metals As, Sb, Se PHCs BTEX VOCs	Soil Groundwater
APEC 7 – Existing On-Site Hydro Vault	Central portion of Phase I Property	Item Other:	On-site	PHCs BTEX PCBs	Soil Groundwater
APEC 8 ¹ - Application of road salt for the safety of vehicular or pedestrian traffic under conditions of snow or ice	Within parking areas of the Phase I Property	Item Other: Application of road salt for the safety of vehicular or pedestrian traffic under conditions of snow or ice	On-site	Electrical Conductivity (EC) Sodium Adsorption Ratio (SAR)	Soil



Areas of Potential Environmental Concern					
Area of Potential Environmental Concern	Location of Area of Potential Environmental Concern	Potentially Contaminating Activity	Location of PCA (on-site or off-site)	Contaminants of Potential Concern	Media Potentially Impacted (Groundwater, Soil, and/or Sediment)
APEC 9 – Former Off-Site Dry-Cleaning Facility	Southwestern portion of Phase I Property	Item 37 – Operation of Dry Cleaning Equipment (where chemicals are used)	Off-Site	VOCs	Soil Groundwater
1 – In accordance with Section 49.1 of O.Reg. 153/04 standards are deemed to be met if an applicable site condition standard is exceeded at a property solely because the qualified person has determined that a substance has been applied to surfaces for the safety of vehicular or pedestrian traffic under conditions of snow or ice or both. The exemption outlined in Section 49.1 is being relied up with respect to the Phase II property.					

Additional PCAs identified within the Phase I Study Area were not considered to represent an environmental concern based on the respective separation distance and/or down/cross-gradient orientation.

Contaminants of Potential Concern (CPCs)

The following Contaminants of Potential Concern (CPCs) were identified with respect to the Phase I Property:

- ☐ Metals including Arsenic (As), Antimony (Sb) and Selenium (Se);
- ☐ Mercury (Hg);
- ☐ Hexavalent Chromium (CrVI);
- ☐ Benzene, Toluene, Ethylbenzene, and Xylenes (BTEX);
- ☐ Petroleum Hydrocarbons, fractions 1 - 4 (PHCs F₁-F₄);
- ☐ Volatile Organic Compounds (VOCs);
- ☐ Polycyclic Aromatic Hydrocarbons (PAHs);
- ☐ Polychlorinated Biphenyls (PCBs).

Given the use of Phase I Property as a parking lot, it is considered likely that road salt was applied throughout the Phase I Property for the safety of vehicular and pedestrian traffic under conditions of snow or ice. According to Section 49.1 of O.Reg. 153/04, if an applicable site condition standard is exceeded at a property solely because of the following reason, the applicable site condition standard is deemed not to be exceeded for the purpose of Part XV.1 of the Act: “The qualified person has determined, based on a phase one environmental site assessment or a phase two environmental site assessment, that a substance has been applied to surfaces for the safety of vehicular or pedestrian traffic under conditions of snow or ice or both.”



In accordance with Section 49.1 of O.Reg. 153/04, any electrical conductivity (EC) and sodium adsorption ratio (SAR) concentrations on the Phase I Property that exceed the MECP Table 3 standards for a residential land use are deemed *not to be exceeded* for the purpose of Part XV.1 of the Act.

Underground Utilities

The Phase I Property is situated in a municipally serviced area. Underground utility services on the property include natural gas, water, electrical and sewer services.

Assessment of Uncertainty and/or Absence of Information

The information available for review as part of the preparation of this Phase I-ESA Update is considered to be sufficient to conclude that there are APECs on the Phase I Property. A variety of independent sources were consulted as part of this assessment, and as such, the conclusions of this report are not affected by uncertainty which may be present with respect to the individual sources.

Conclusions

Based on the existing land use, the Phase I Property is considered to be used for industrial purposes as defined by O.Reg. 153/04 and as such, an RSC is required as there is a change in use of the Phase I Property to a more sensitive land use (mixed-use).

As a result of the additional historical research, records update and site visit undertaken as part of this assessment in order to meet the requirements of O.Reg. 153/04, as amended, **it is our opinion that a Phase II ESA Update and remediation program are required for the Phase I Property and should be completed at the time of the subsequent Site Plan Control applications.**



Statement of Limitations

This Phase I - Environmental Site Assessment Update report has been prepared in general accordance with O.Reg. 153/04, as amended. The conclusions presented herein are based on information gathered from a historical review and field inspection program.

The findings of the Phase I ESA Update are based on a review of readily available geological, historical and regulatory information and a cursory review made at the time of the field assessment. The historical research relies on information supplied by others, such as local, provincial, and federal agencies and was limited within the scope-of-work, time, and budget of the project herein.

Should any conditions be encountered at the Phase I property and/or historical information that differ from our findings, we request that we be notified immediately in order to allow for a reassessment.

This report was prepared for the sole use of Regional Group. Permission and notification from Regional Group and this firm will be required to release this report to any other party.

We trust that this submission satisfies your current requirements. Should you have any questions, please contact the undersigned.

Paterson Group Inc.

Jeremy Camposarcone, P.Eng., Q.P._{ESA}

Mark D'Arcy, P.Eng., Q.P._{ESA}

Report Distribution:

- ☐ Regional Group - Mr. Evan Garfinkel
- ☐ Paterson Group




Attachments:

- ☐ Plan of Survey of the Phase I Property
- ☐ Figure 1 - Key Plan
- ☐ Aerial Photograph (2022)
- ☐ Drawing PE7221-1 - Site Plan
- ☐ FOI Response
- ☐ TSSA Correspondence
- ☐ HLUI Request
- ☐ ERIS Report



\\00\NEW\ER\Consent\Actual\2025\2770-25_Regional_1101 Baxter Road_101 Topographic Sketch F.dwg

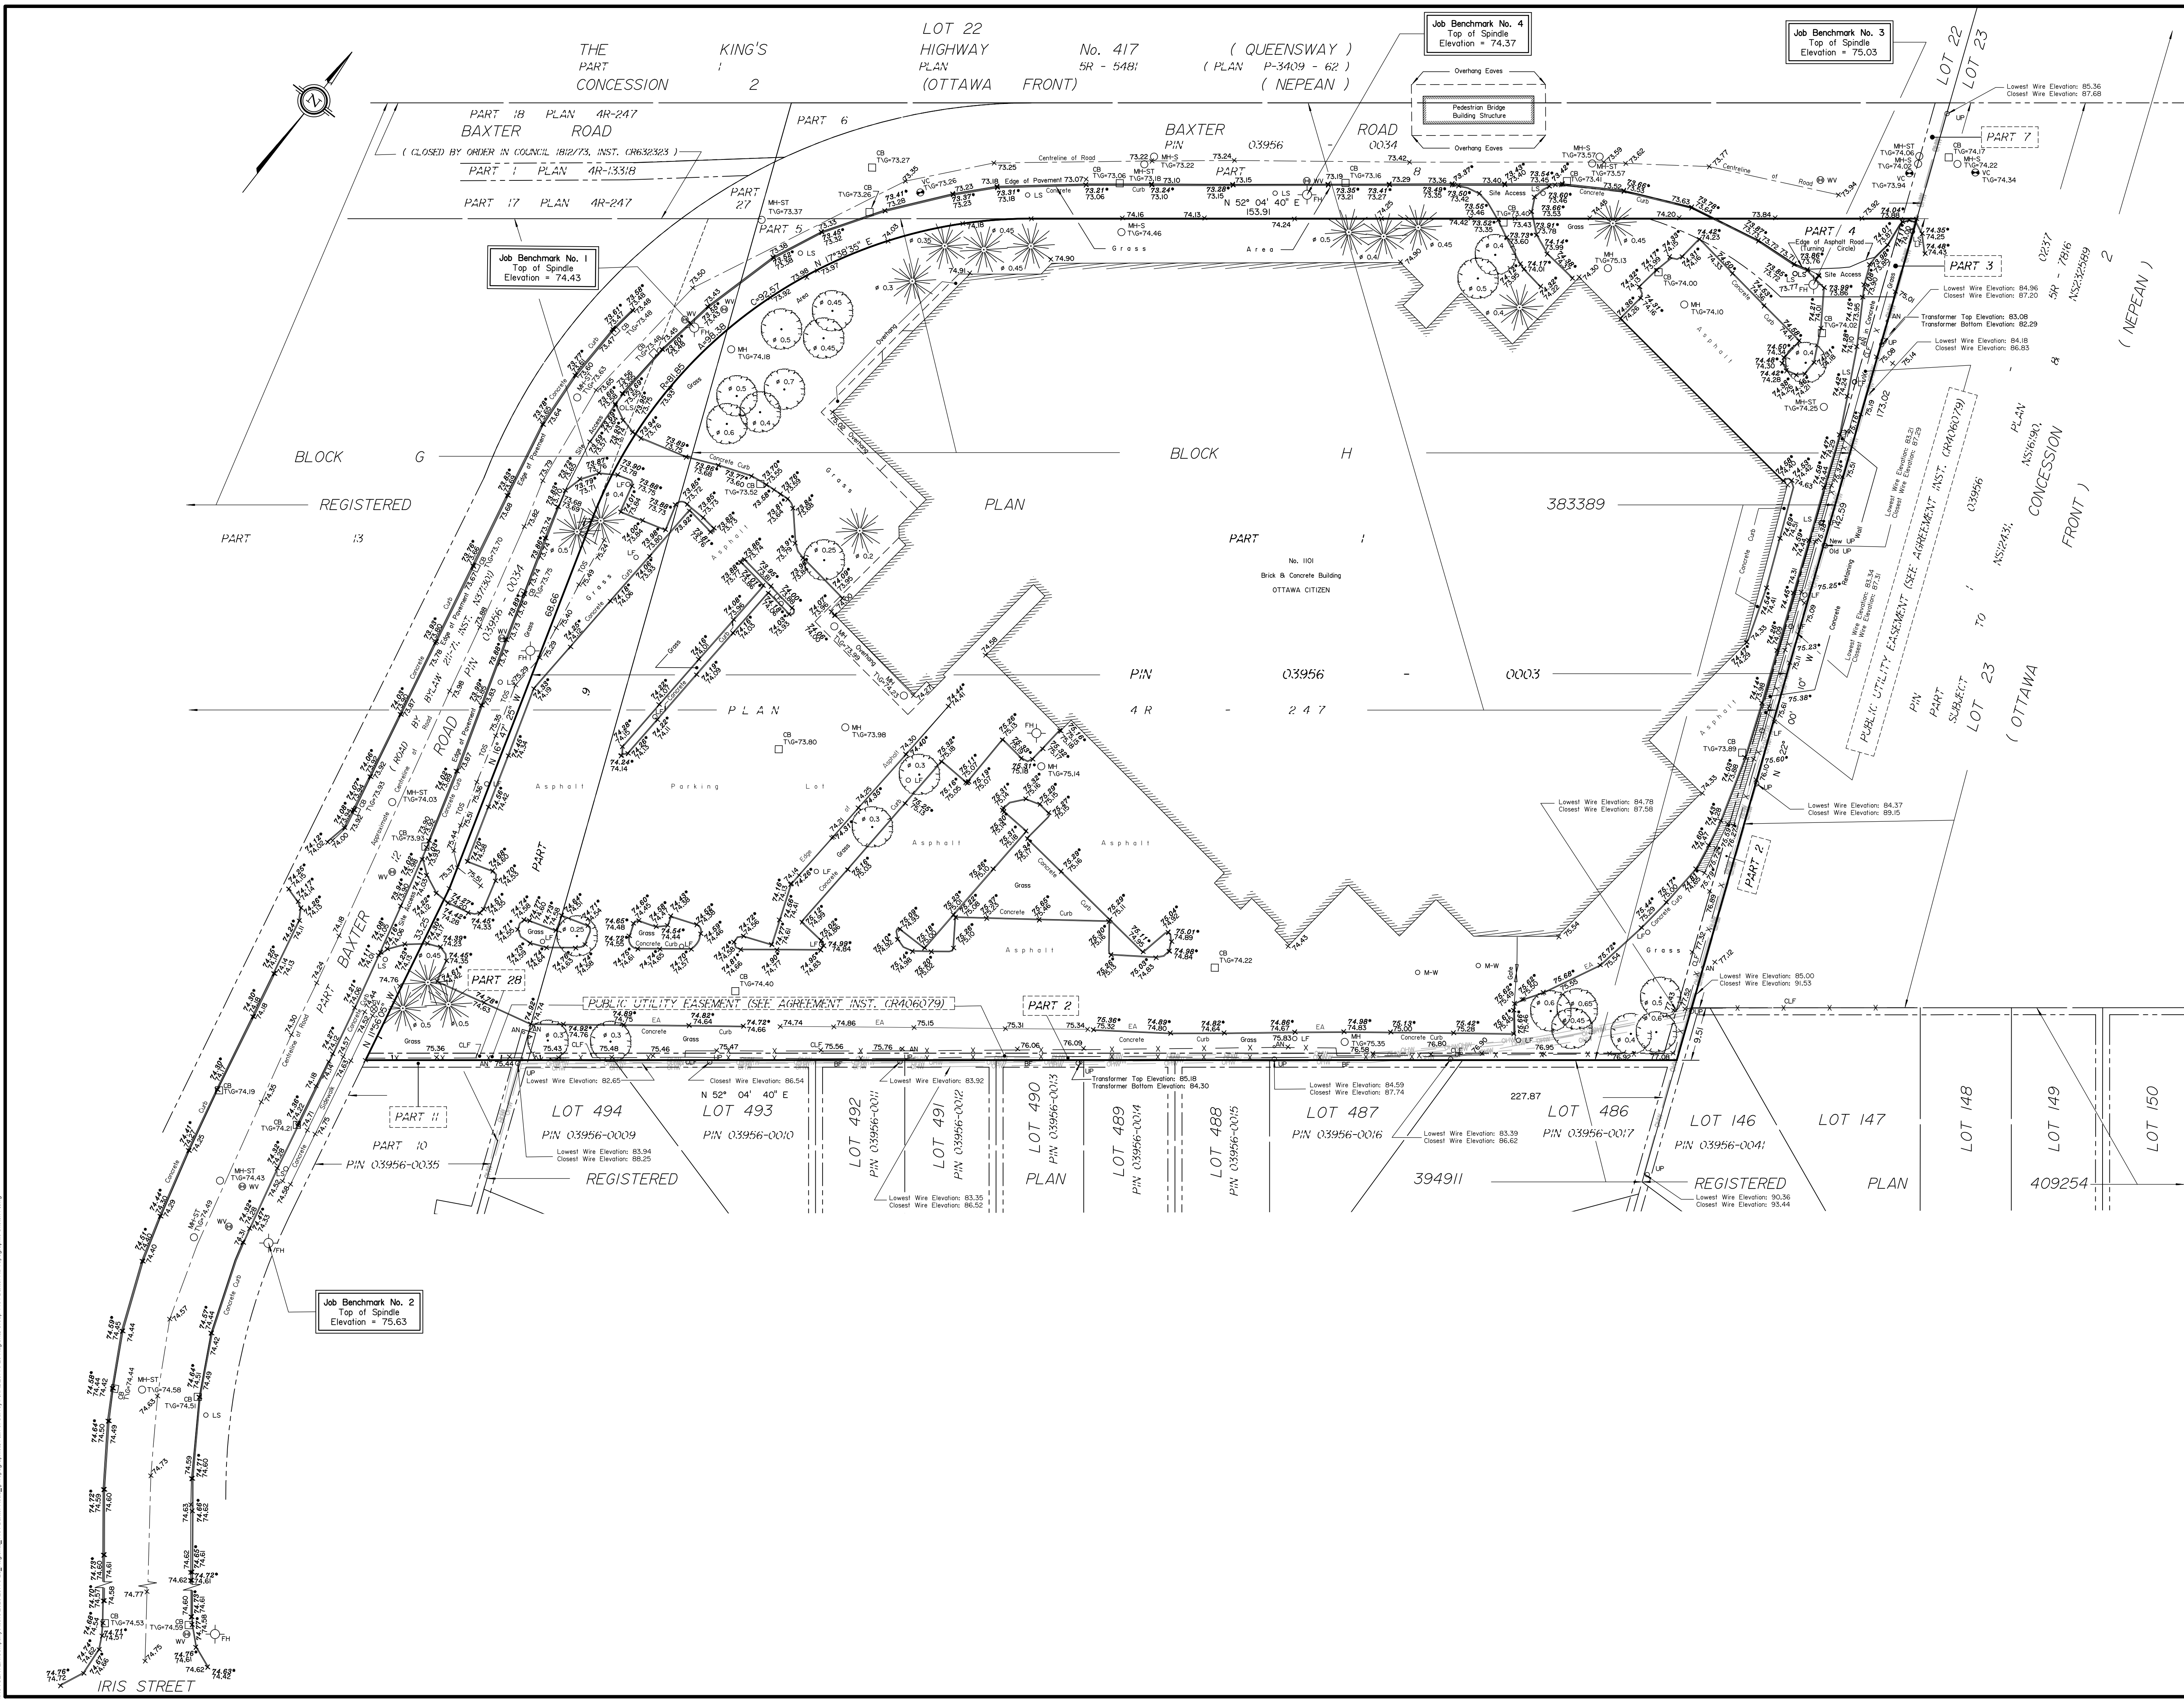

TOPOGRAPHIC SKETCH SHOWING

1101 Baxter Road, Ottawa Citizen
CITY OF OTTAWA
Prepared by Annis, O'Sullivan, Vollebekk Ltd.

Scale 1 : 500
Metric
DISTANCES SHOWN ON THIS PLAN ARE IN METRES AND
CAN BE CONVERTED TO FEET BY DIVIDING BY 0.3048

Field work completed on August 21, 2025.
LEGAL DESCRIPTION OF PROPERTY

PART OF BLOCKS G AND H
REGISTERED PLAN 383389
CITY OF OTTAWA

Notes & Legend

Denotes	
(AOG)	Annis, O'Sullivan, Vollebekk Ltd.
○ MH-ST	Maintenance Hole (Storm Sewer)
○ MH-S	Maintenance Hole (Sanitary)
○ MH	Maintenance Hole (Unidentified)
⊕ VC	Valve Chamber (Watermain)
— OHW —	Overhead Wires
○ UP	Utility Pole
○ AN	Anchor
○ LS	Light Standard
○ LF	Light Fixture
⊕ CB	Catch Basin
⊕ FH	Fire Hydrant
⊕ WV	Water Valve
T/G	Top of Grate
⊕ GV	Gas Valve
○ M-W	Monitoring Well
⊙	Deciduous Tree
⊙	Coniferous Tree
CLF	Chain Link Fence
BF	Board Fence
CRW	Concrete Retaining Wall
TOS	Top of Slope
⊕	Gate
+ 65.00"	Location of Top of Curb Elevations and Top of Retaining Wall
+ 65.00	Location of Bottom of Curb Elevations
EA	Edge of Asphalt
C/L	Centreline

Bearings are grid, derived from Can-Net 2016 Real Time Network GPS observations, MTM Zone 9 (76°30' West Longitude) NAD-83 (original).

ELEVATION NOTES

1. Elevations shown are geodetic, derived from City of Ottawa Control, Station Number 2016-0179 having a published elevation of 72.50, and are referred to the CGVD28 geodetic datum.

UTILITY NOTES

1. This drawing cannot be accepted as acknowledging all of the utilities and it will be the responsibility of the user to contact the respective utility authorities for confirmation.
2. Only visible surface utilities were located.
3. A field location of underground plant by the pertinent utility authority is mandatory before any work involving breaking ground, probing, excavating etc.

Caution

This is NOT a Plan of Survey and shall not be used except for the purpose indicated in the title block.

Boundary information compiled from a Surveyor's Real Property Report by (AOG) dated March 30, 2017 (Job No. 19430-17).

© Annis, O'Sullivan, Vollebekk Ltd. 2025. "THIS SKETCH IS PROTECTED BY COPYRIGHT"


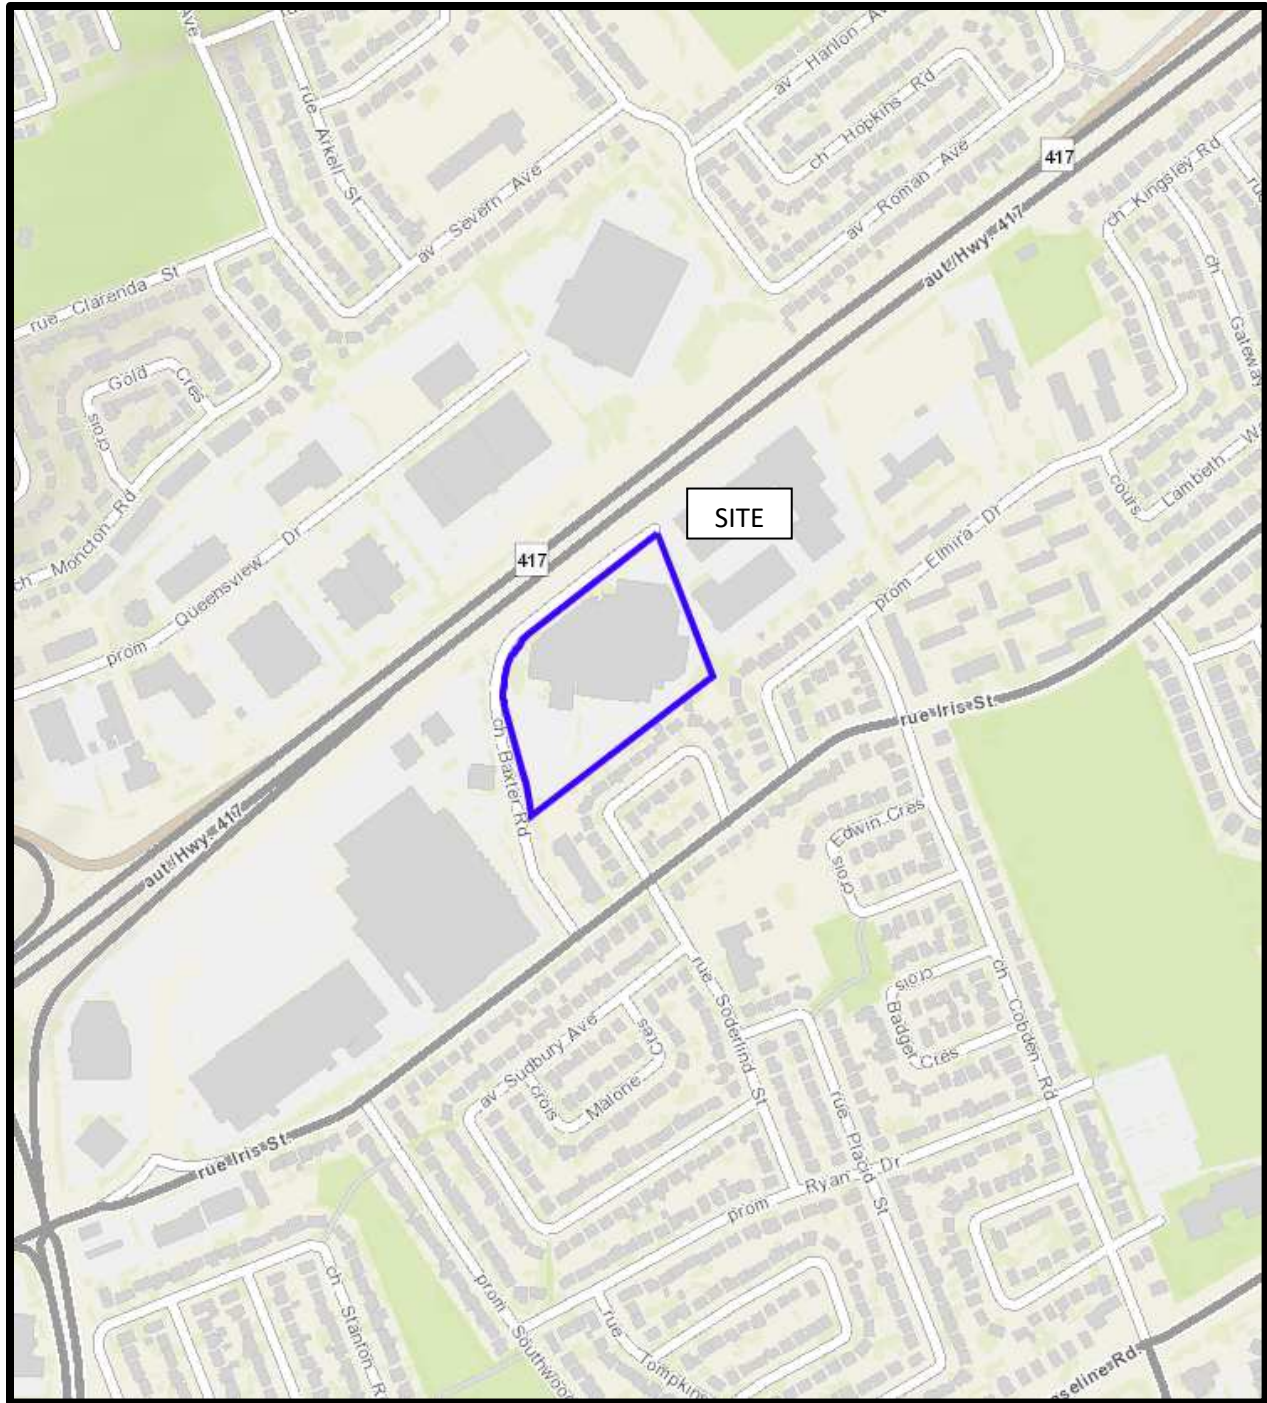


FIGURE 1
KEY PLAN



AERIAL PHOTOGRAPH
2022

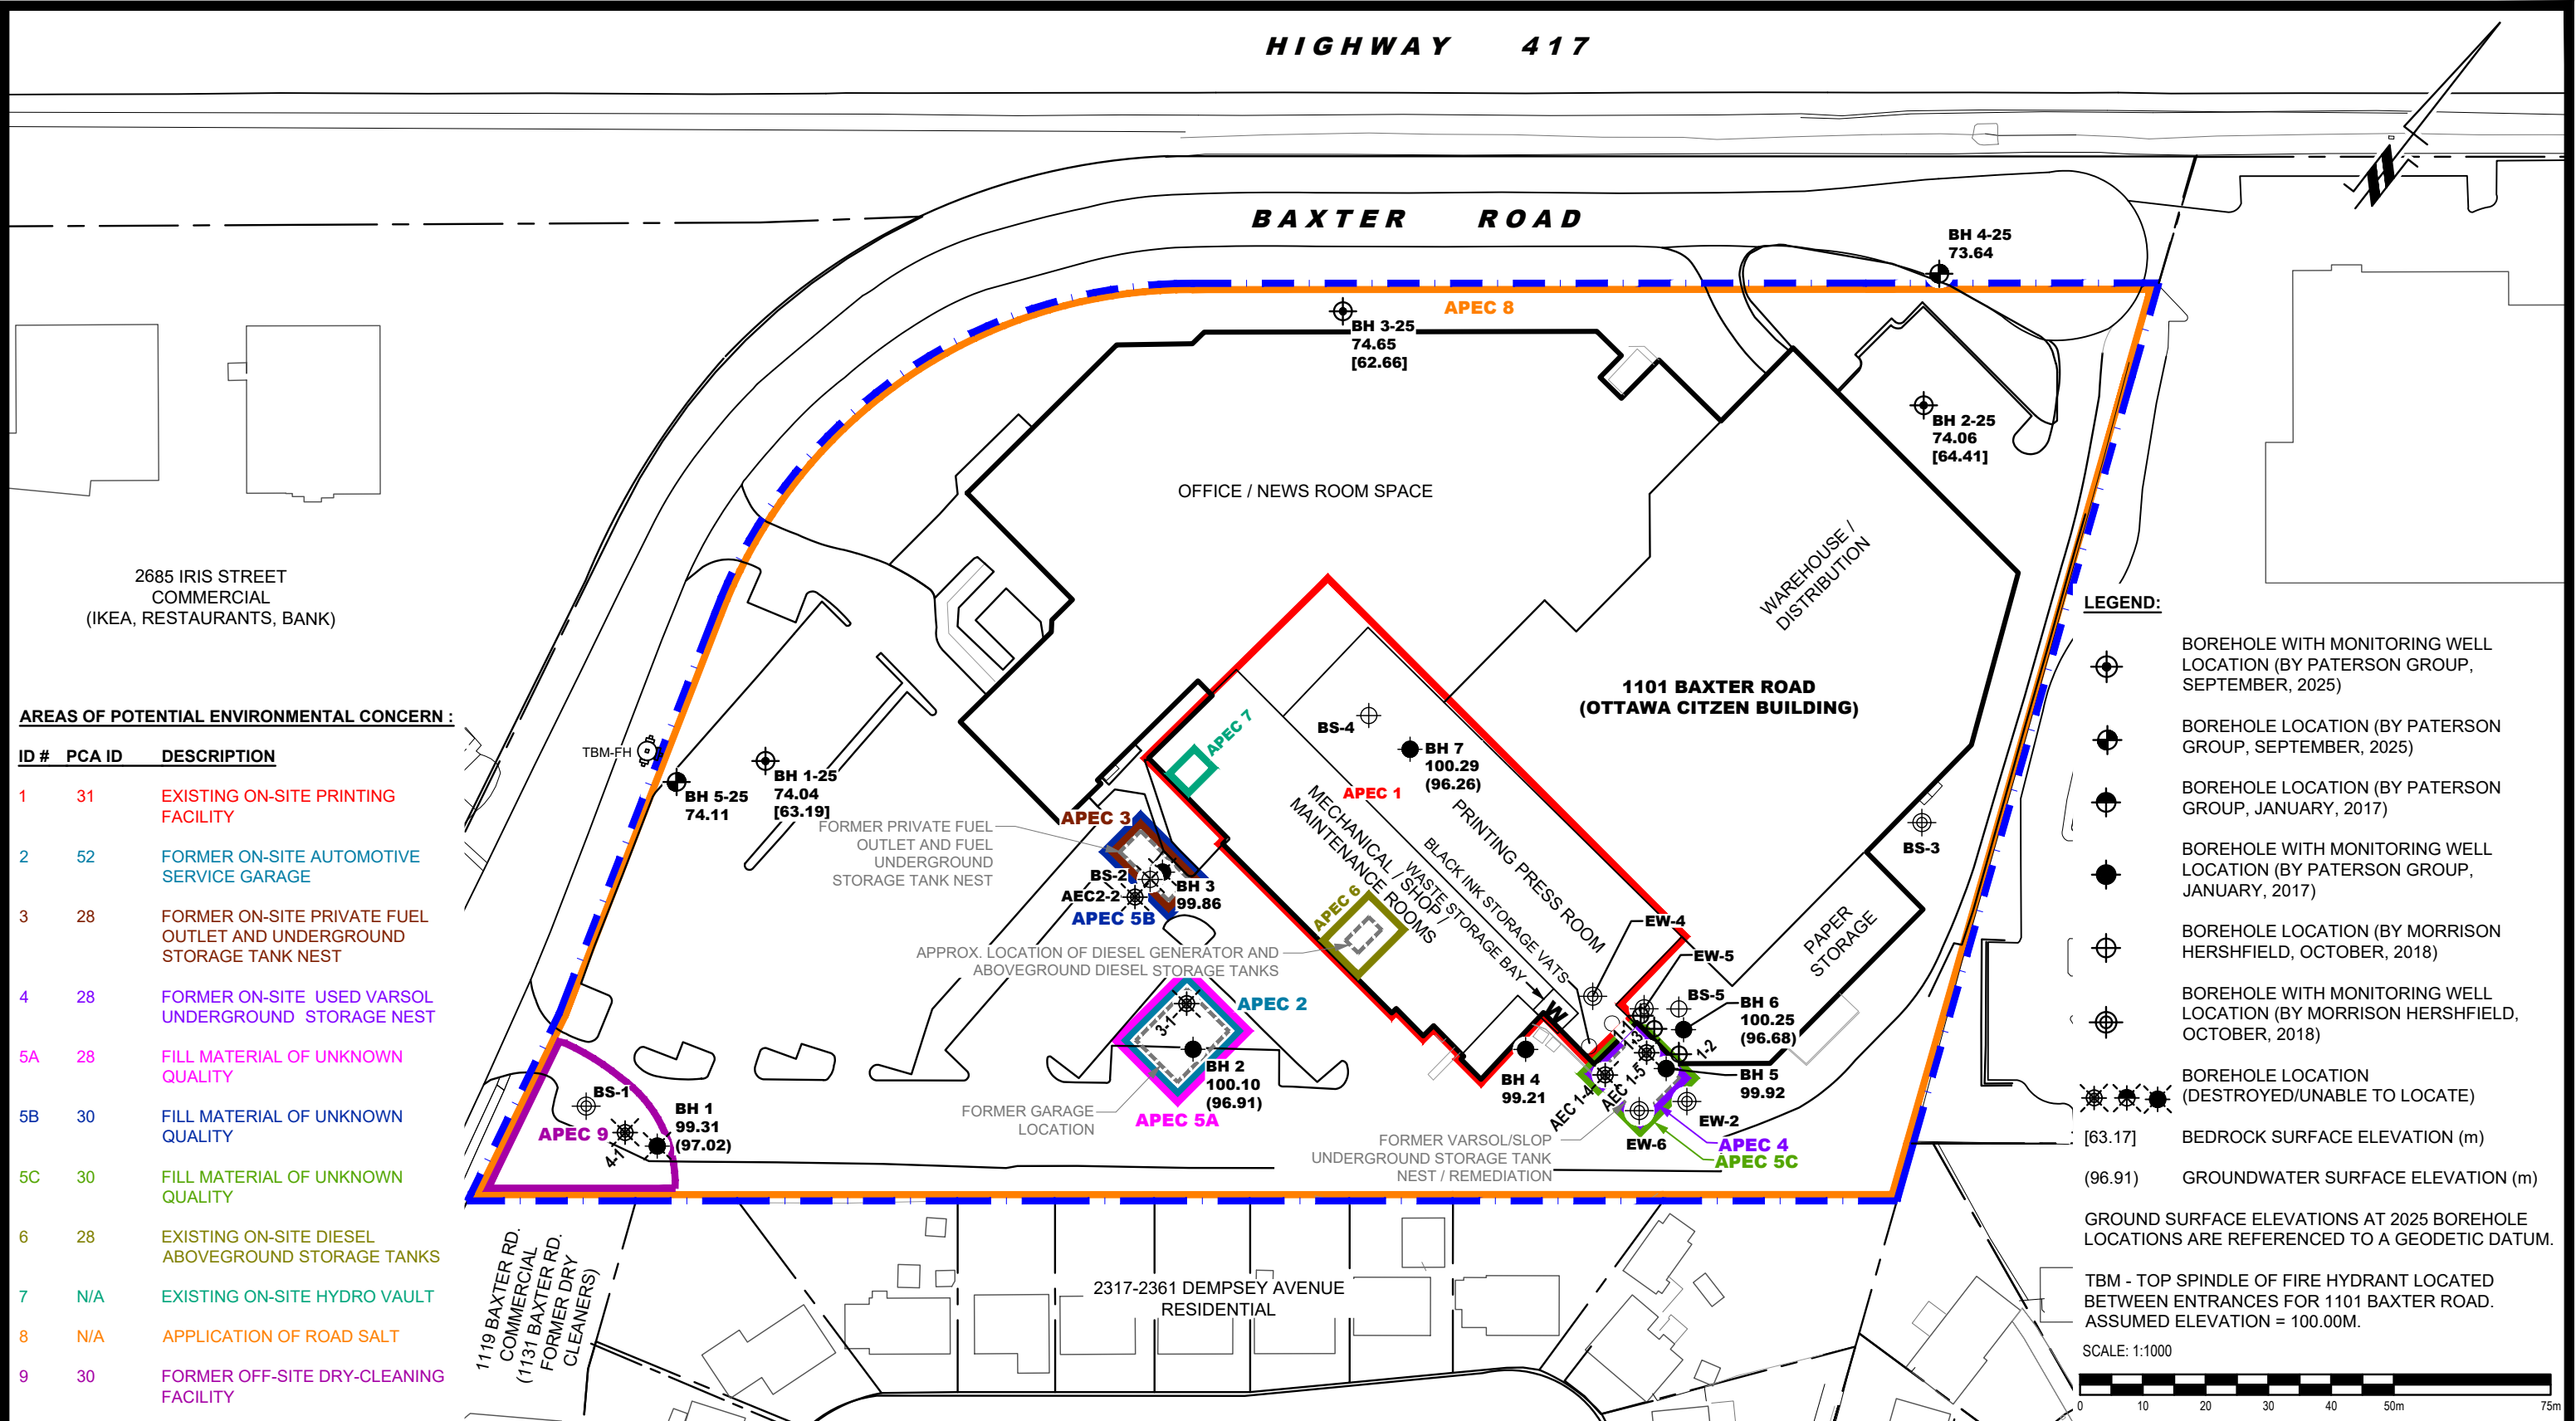

AREAS OF POTENTIAL ENVIRONMENTAL CONCERN :

ID #	PCA ID	DESCRIPTION
1	31	EXISTING ON-SITE PRINTING FACILITY
2	52	FORMER ON-SITE AUTOMOTIVE SERVICE GARAGE
3	28	FORMER ON-SITE PRIVATE FUEL OUTLET AND UNDERGROUND STORAGE TANK NEST
4	28	FORMER ON-SITE USED VARSOL UNDERGROUND STORAGE NEST
5A	28	FILL MATERIAL OF UNKNOWN QUALITY
5B	30	FILL MATERIAL OF UNKNOWN QUALITY
5C	30	FILL MATERIAL OF UNKNOWN QUALITY
6	28	EXISTING ON-SITE DIESEL ABOVEGROUND STORAGE TANKS
7	N/A	EXISTING ON-SITE HYDRO VAULT
8	N/A	APPLICATION OF ROAD SALT
9	30	FORMER OFF-SITE DRY-CLEANING FACILITY

LEGEND:

- BOREHOLE WITH MONITORING WELL LOCATION (BY PATERSON GROUP, SEPTEMBER, 2025)
- BOREHOLE LOCATION (BY PATERSON GROUP, SEPTEMBER, 2025)
- BOREHOLE LOCATION (BY PATERSON GROUP, JANUARY, 2017)
- BOREHOLE WITH MONITORING WELL LOCATION (BY PATERSON GROUP, JANUARY, 2017)
- BOREHOLE LOCATION (BY MORRISON HERSHFIELD, OCTOBER, 2018)
- BOREHOLE WITH MONITORING WELL LOCATION (BY MORRISON HERSHFIELD, OCTOBER, 2018)
- BOREHOLE LOCATION (DESTROYED/UNABLE TO LOCATE)
- [63.17] BEDROCK SURFACE ELEVATION (m)
- (96.91) GROUNDWATER SURFACE ELEVATION (m)
- GROUND SURFACE ELEVATIONS AT 2025 BOREHOLE LOCATIONS ARE REFERENCED TO A GEODETIC DATUM.
- TBM - TOP SPINDLE OF FIRE HYDRANT LOCATED BETWEEN ENTRANCES FOR 1101 BAXTER ROAD. ASSUMED ELEVATION = 100.00M.
- SCALE: 1:1000

0 10 20 30 40 50m 75m



9 AURIGA DRIVE
OTTAWA, ON
K2E 7T9
TEL: (613) 226-7381

NO.	REVISIONS	DATE	INITIAL

REGIONAL GROUP
PHASE I - ENVIRONMENTAL SITE ASSESSMENT
1101 BAXTER ROAD

OTTAWA,
Title:

ONTARIO

SITE PLAN

Scale:	1:1000	Date:	10/2025
Drawn by:	GK	Report No.:	PE7221-1
Checked by:	JC	Dwg. No.:	PE7221-1
Approved by:	MSD	Revision No.:	



Ontario

Ministry of the
Environment

Airborne Contaminant Discharge Monitoring and Reporting (O. Reg. 127/01) Inspection Report

Client:	The Ottawa Citizen Mailing Address: PO Box 5020 LCD Merivale, Nepean, Ontario, Canada, K2C 3M4 Physical Address: 1101 Baxter Road, Concession: , Plan: , Ottawa, City, Ontario, Canada Telephone: (613)829-9100, FAX: (613)596-8554 Client #: 3582-5EKTE2, Client Type: Corporation		
Inspection Site Address:	1101 Baxter Road Address: 1101 Baxter Road, Concession: , Plan: , Ottawa, City District Office: Ottawa		
Contact Name:	Dave DeRochers	Title:	Building Services Manguer
Contact Telephone:	(613)596-3573 ext	Contact Fax:	(613)596-8554
Last Inspection Date:			
Inspection Start Date:	2004/01/15	Inspection Finish Date:	2004/01/15
Region:	Eastern		

1.0 INTRODUCTION

The focus of the inspection was to assess compliance with O. Reg. 127/01, Airborne Contaminant Discharge Monitoring and Reporting.

Specifics:

Is this integrated with other air inspections (done at same time)?
No

2.0 INSPECTION OBSERVATIONS

Is the NAICS code found in Table 1 of the "Step by Step Guideline for Emission Calculation, Record Keeping and Reporting for Airborne Contaminant Discharge" (Guideline)?

Yes

Class in Table 1 of the Guideline: Class B

NAICS Code(s): 323119

MOE ID No.: 7099

NPRI ID No.:

Specifics:

2.1 ELECTRICITY GENERATION

Is the facility a defined "generation facility" having a generating capacity greater than 1 megawatt and selling 10% or greater of the electricity generated to the Independent Market Operator (IMO) Administered market?

No

Design Capacity of the Facility (MW):
Amount Generated (Annual) (MWH):
% sold to IMO-administered markets:

Specifics:

2.2 SCREENING CRITERIA - CONTAMINANTS IN TABLE 2A (CRITERIA AIR CONTAMINANTS AND GREENHOUSE GASES)

a) Does the facility meet any of the Table 2A screening criteria outlined below ?

Yes. The facility is designated as special case NAICS code sector ("NA") in Table 3 of the Guideline.

Yes. The facility has a name plate capacity > 3 million British Thermal Units per hour.

Yes. The facility uses >= 3000 kg of printing inks during the year.

b) Does the facility meet one or more of the Table 2A screening criteria , requiring that the facility calculate and report emissions ?

Yes

Specifics:

2.2.1 DISCHARGE UNIT(S) AND EMISSIONS MONITORING SYSTEM (EMS)

a) Does the facility have a discharge unit with a name plate capacity greater than 73 MW?

No

Specifics:

2.3 SCREENING CRITERIA - CONTAMINANTS IN TABLE 2B (AIR TOXICS)

a) Does the facility employ or engage persons who work together for a total of 20,000 hours or more during the year ?

Yes

b) Is the contaminant listed in Table 2B reasonably expected to be manufactured or processed or otherwise used (MPO) at the facility during the year in an amount = the defined threshold for reportable contaminant (s) in Table 2B?

Yes

c) If the facility meets both screening criteria (a & b above), has the facility calculated and reported emissions of reportable contaminants as required ?

Yes

Specifics:

2.4 CONTAMINANTS IN TABLE 2C TO THE GUIDELINE - (NATIONAL POLLUTANT RELEASE INVENTORY (NPRI))

If a facility provided to the Federal Minister of the Environment under NPRI , information on the release from a facility into the air for a contaminant listed in Table 2C of the Guideline , was this information also provided to the Director ?

Yes

Specifics:

2.5 MONITORING/CALCULATING FACILITY WIDE EMISSIONS

Has the owner/operator of a facility monitored and calculated facility wide emissions for all reportable contaminants ?

Yes

Specifics:

2.6 REPORTING

Has the owner/operator of the facility submitted an Annual /Smog Season/Quarterly/Generation Facility Report (s)?
Yes

Type of report:
Annual, Smog Season

Has the owner/operator submitted the above noted Report (s) on time?
Yes

Specifics:

2.7 NOTIFICATION OF CHANGES (IN FACILITY NAME, OWNERSHIP OR LOCATION)

Has the facility notified the Director within 15 days with written notice of a change in facility name , ownership or location ?
Not applicable

Specifics:

2.8 RECORD KEEPING

Has the owner/operator of a facility kept a copy of the report and any record prepared for the purposes of the report ?
Yes

Has the owner/operator made the report available to the public without charge by posting it on the internet or making it available during regular business hours at the facility or at the owner or operator's business office ?
Yes

Specifics:

3.0 REVIEW OF PREVIOUS NON-COMPLIANCE ISSUES

Specifics:

4.0 SUMMARY OF INSPECTION FINDINGS (HEALTH/ENVIRONMENTAL IMPACT)

Was there any indication of a potential for environmental impairment and /or an indication of a known or suspected violation of a legal requirement which triggers a Ministry program priority ?
No

Specifics:

5.0 ACTION(S) REQUIRED

Specifics:

6.0 OTHER INSPECTION FINDINGS

Specifics:

7.0 INCIDENT REPORT

Not Applicable

8.0 ATTACHMENTS

PREPARED BY: Environmental Officer:


Name: Jason Schaefer
District Office: Ottawa District Office
Date: 2004/01/15

Signature:

REVIEWED BY: District Supervisor:

Name: Paul Kehoe
District Office: Ottawa District Office
Date: 2004/01/16

Signature:

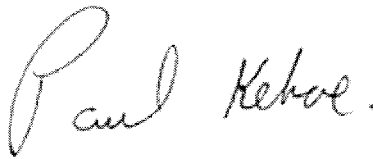A handwritten signature in black ink that reads "Paul Kehoe." The signature is written in a cursive style with a large initial "P" and a period at the end.

File Storage Number: SI OC OT BA 101

Note:

This inspection report does not in any way suggest that there is or has been compliance with applicable legislation and regulations as they may apply to this facility. It is, and remains, the responsibility of the owner and /or the operating authority to ensure compliance with all applicable legislative and regulatory requirements

Ministry of the Environment

Eastern Region
Ottawa District Office
2435 Holly Lane
Ottawa ON K1V 7P2
Fax: (613)521-5437
Telephone: (613) 521-3456 Ext. 230

Ministère de l'Environnement

Direction régionale de l'Est
Bureau du district d'Ottawa
2435 Holly Lane
Ottawa ON K1V 7P2
Télécopieur: (613)521-5437
Téléphone : (613) 521-3456 Ext. 230



January 27, 2004

Dave DeRochers, Building Services Manager
The Ottawa Citizen
P.O. Box 5020
Ottawa, Ontario, K2C 3M4

RE: Airborne Contaminant Discharge Monitoring and Reporting (O.Reg
127/01) Inspection Report

Dear Mr. DeRochers,

Thank-you for your cooperation during my January 15, 2004, Airborne Contaminant Discharge Monitoring and Reporting (O.Reg 127/01) inspection of your facility. I have enclosed a copy of the inspection report that documents my findings. The inspection did not identify any required actions.

If you have any questions please contact me at 613-521-3450 ext. 230.

Yours truly,

Jason Schaefer
Senior Environmental Officer
Ottawa District Office

File Storage Number: SI OC OT BA 101



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:

OTTAWA CITY
1101 BAXTER ROAD

Reg: 4 Dist: OT Municipality: 20101

Entered:

1993/04/27 17:01

ORIS No.

9300004163

Received By:

KATHLEEN KLINCK

Occurrence Type:

S

Subtype:

L

Work Plan:

Reported By: WILLIAM YAFALIAN
OTTAWA CITIZEN

Telephone No.

613-596-3625 x

Alternate No.

x

Address:

1101 BAXTER ROAD
OTTAWA

Postal Code: K2C 3M4

Syn: OTTAWA CITIZEN - VARSOL CONTAMINATED SOIL AROUND UNDERGROUND SLOP TANK.

Brief Summary:

CALLER REPORTS VARSOL-CONTAMINATED SOIL WAS DISCOVERED THIS AFTERNOON AROUND UNDERGROUND SLOP TANK WHILE EXCAVATING. THERE ARE TWO UNDERGROUND TANKS - ONE VARSOL TANK WHICH PASSED A VACUUM TEST & ONE SLOP TANK, WHICH DID NOT PASS THE TEST. THE EXTENT OF THE SOIL CONTAMINATION IS NOT YET KNOWN - THE VARSOL-CONTAMINATED SOIL IS LEVEL WITH THE UNDERGROUND SLOP TANK.

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X Abatement IEB Other

BF Date:

93/09/06 UPDATE - SPILL CLEANED UP. TANKS REMOVED.

File Closed: X Abatement: IEB Other

Suspected Violation:**Report Prepared By:**

BRYAN DICKMAN

Date:

08/23/93

IEB Investigator:**IEB BF Date****Approving Officer**

GEORGE CLARKE

Date:

08/26/93

Reviewing Officer:**Date**

Specify number(s) for routing Original

[] [] [] [] [] []

Continued [] **Yes**

Specify number(s) for copy distribution

[] [] [] [] [] [] [] []

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

7. Other _____

SAC Action Class: 1:25 2:

Material 1: VARSOL

Amount: UNK

Material 2:

Amount:

Material 3:

Amount:

Code: 24

UN No.: 1993

Code:

UN No.:

Code:

UN No.:

Cause. :		Code. . : 13
Reason. :		Code. . : 98
Person in Control: OTTAWA CITIZEN		Waste GenNum :
Owner : OTTAWA CITIZEN		Waste GenNum : 0170700
Agencies Involved. :		
Clean up and Restoration Carried out by:		
☒ Controller	☒ Owner	☐ Other
Y	Y	
% Cleaned up: 99	Estimated Cost:	
Were Directions or Approval Given Under		
EPA Part X ☐	Regulation 362 ☐	Manifest No.
N	N	
Waste Class :		Code . . : 000
Hauler :		Code . . :
Disposal Site :		Code . . :
Environmental Impact:	Nature of Impact:	
C	Soil contamination	Code . . : 07
People/Business Damaged		
(Other than to Owner/Controller) :		
Nature of Damage:		Code . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:

OTTAWA CITY
1101 BAXTER RD PARKING LOT

Reg: 4 Dist: OT Municipality: 20101

Entered:

1993/03/05 09:15

ORIS No.

9300001934

Received By:

BRIAN PARK

Occurrence Type:

S

Subtype:

LW

Work Plan:

10

Reported By: BRYAN DICKMAN
MINISTRY OF THE ENVIRONMENT

Telephone No.

613-521-3450 x

Alternate No.

x

Address:

2378 HOLLY LANE
OTTAWA

Postal Code: K1V 7P1

Syn: THE OTTAWA CITIZEN -UNKNOWN AMOUNT OF VARSOL& INK TO LAND & SEWER.

Brief Summary:

NOTE: THIS IS A COMPLAINT-INITIATED SPILL, SEE SAC#9300001881 FOR DETAILS. CALLER REPORTED THAT AN UNKNOWN AMOUNT OF WASTE VARSOL & INK SPILLED ONTO THE PARKING LOT AND THEN INTO A STORM SEWER AT THE OTTAWA CITIZEN BUILDING. THE STORM SEWER LEADS TO A NEARBY CREEK. THE VARSOL AND INK OVERFLOWED FROM A 2,000 GAL. INK WASH TANK. THE OTTAWA CITIZEN CONTRACTED FRANCIS WASTE TO CLEAN-UP THE WASTE AND LAIDLAW ENVIRONMENTAL TO DISPOSE OF IT.

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X Abatement IEB Other

BF Date:

FIELD REPORT REC'D ON MARCH 18/93, SEWERS WERE FLUSHED AND CLEAN UP COMPLETED, FILE CLOSED.

File Closed: X Abatement: IEB Other

Suspected Violation:**Report Prepared By:**

BRYAN DICKMAN

Date:

03/16/93

IEB Investigator:**IEB BF Date****Approving Officer**

GEORGE CLARKE

Date:

03/16/93

Reviewing Officer:**Date**

Specify number(s) for routing Original

[] [] [] [] [] []

Specify number(s) for copy distribution

[] [] [] [] [] [] [] []

Continued [] **Yes**

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

7. Other _____

SAC Action Class: 1:04 2: 25

Material 1: VARSOL

Amount: UKN

Material 2: INK

Amount: UKN

Material 3:

Code : 24

UN No.: 1993

Code : 27

UN No.: 1210

Code :

Amount :

Cause. :

Reason. :

Person in Control: OTTAWA CITIZEN, THE

Owner : OTTAWA CITIZEN, THE

Agencies Involved : WORKS

Clean up and Restoration Carried out by:

☒ Controller

Y

☒ Owner

Y

☐ Other FRANCIS WASTE

% Cleaned up: 75

Estimated Cost:

Were Directions or Approval Given Under

EPA Part X ☒

N

Regulation 362 ☒

N

Manifest No.

Waste Class :

Hauler : LAIDLAW ENVIRONMENTAL

Disposal Site :

Environmental Impact:

P

Nature of Impact:

Water course or lake

People/Business Damaged

(Other than to Owner/Controller) :

Nature of Damage:

UN No.:

Code. . : 09

Code. . : 98

Waste GenNum : 0170700

Waste GenNum : 0170700

Code . . : 145

Code . . :

Code . . :

Code . . : 06

Code . . :



OCCURENCE REPORT

Location of Occurrence:

OTTAWA CITY
1101 BAXTER RD PARKING LOT

Reg: 4 Dist: OT Municipality: 20101

Entered:

1993/03/03 :

ORIS No.

9300001881

Received By:

MICHEL CATTAN

Occurrence Type:

C

Subtype:

06

Work Plan:

Reported By: ANONYMOUS CALLER

Telephone No.

000-000-0000 x

Alternate No.

- - x

Address:**Postal Code:**

Syn: STREAM OF OIL ON PARKING LOT & GOING INTO SEWER, SOURCE UNKNOWN.

Brief Summary:

CALLER REPORTS A STREAM OF OIL OR HYDRAULIC FLUID SINCE 3-4DAYS ON THE PARKING LOT AT THE BACK OF THE OTTAWA CITIZEN BUILDING INFRONT OF THE PRESSROOM DOOR. OIL IS RUNNING INTO A STORM SEWER.

NO ACTION WAS TAKEN UP TILLNOW TO CLEANUP OR STOP THE OIL FROM GOING INTO THE SEWER. 17:29 SAC BRIEFED OTTAWA WORKS, ANDRE GERVAIS. ANDRE WILL DISPATCH SOMEONE TO CHECK OCCURRENCE & WILL UPDATE SAC. 21:45 SAC TO OTTAWA WORKS. ANDRE REPORTS PHIL O'REILLY WAS ON SITE & IS GONE HOME NOW, SAC ADVISED ANDRE TO NOTIFY PHIL TO UPDATE MOE OTTAWA TOMORROW REGARDING HIS SITE INVESTIGATION.

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X Abatement X IEB Other

BF Date:

CROSS REFERENCE SAC NO. 9300001934

File Closed: X Abatement: X IEB Other

Suspected Violation: 21

Report Prepared By:

BRYAN DICKMAN

Date:

03/04/93

IEB Investigator:

CLINT KING

IEB BF Date**Approving Officer**

GEORGE CLARKE

Date:

03/16/93

Reviewing Officer:

DAVE KERR

Date

Specify number(s) for routing Original

[] [] [] [] [] []

Specify number(s) for copy distribution

[] [] [] [] [] [] [] []

Continued [] Yes

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

7. Other _____

SAC Action Class: 1: 2:

Material 1:

Amount:

Material 2:

Code:

UN No.:

Code:

Amount :		UN No.:
Material 3:		Code :
Amount :		UN No.:
Cause. :		Code. . :
Reason. :		Code. . :
Person in Control:		Waste GenNum :
Owner :		Waste GenNum :
Agencies Involved. :		
Clean up and Restoration Carried out by:		
☐ Controller	☐ Owner	☐ Other
% Cleaned up:	Estimated Cost:	
Were Directions or Approval Given Under		
EPA Part X ☐	Regulation 362 ☐	Manifest No.
Waste Class :		Code . . :
Hauler :		Code . . :
Disposal Site :		Code . . :
Environmental Impact:	Nature of Impact:	
		Code . . :
People/Business Damaged		
(Other than to Owner/Controller) :		
Nature of Damage:		Code . . :



OCCURENCE REPORT

Location of Occurrence:

OTTAWA CITY
1101 BAXTER ROAD THE OTTAWA CITIZEN

Reg: 4 Dist: OT Municipality: 20101

Entered: 1995/11/21 21:46
ORIS No. 9500012256

Received By:

AL HAINES

Occurrence Type: S
Subtype: L

Work Plan: 06

Reported By: GREG WEATON
SEWER-MATIC ENVIRONMENTAL SERV

Telephone No. 613-746-2114 x
Alternate No. 613-791-6471 x

Address: 1100 CUMMINGS AVENUE
OTTAWA ON
Postal Code: K1J 7R8

Syn: TRANSPORT TRUCK- DIESEL TO GROUND. DIST OFFICE NOTIFIED. CLEANED.

Brief Summary:

CALLER CALLED FOR AN EMERGENCY GENERATOR # FOR THE ABOVE NOTED LOCATION. THE INCIDENT WAS A DIESEL FUEL SPILL AT THE OTTAWA CITIZEN LOADING DOCKS. THE CALLER ADVISES THAT THE INCIDENT HAS BEEN REPORTED TO THE DISTRICT OFFICE. THE CALLER ADVISES THAT THE SPILL HAS BEEN CLEANED UP. NO FURTHER DETAILS. @EMG GENERATOR AS FOLLOWS: GEN # ONS0402, EMG # E-021857, WASTE OILY WATER, QTY 5260L, CLASS 221L, HAULER A860427, RECEIVER A460716. WHAT COULD BE CLEANED UP HAS BEEN.

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X Abatement IEB Other

BF Date:

File Closed: X Abatement: IEB Other

Suspected Violation:

Report Prepared By: BRYAN DICKMAN
Date: 11/23/95

Approving Officer: GEORGE CLARKE
Date: 11/24/95

Specify number(s) for routing Original [] [] [] [] []

Specify number(s) for copy distribution [] [] [] [] [] []

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

Continued [] Yes

7. Other _____

SAC Action Class: 1:25 2:

Material 1: DIESEL FUEL

Amount:

Material 2:

Amount:

Material 3:

Code : 13

UN No.: 1202

Code :

UN No.:

Code :

Amount :

Cause. :

Reason. :

Person in Control: TRANSPORT TRUCK

Owner : TRANSPORT TRUCK

Agencies Involved. :

Clean up and Restoration Carried out by:

☒ Controller

Y

☒ Owner

Y

☐ Other

% Cleaned up: 0

Estimated Cost:

Were Directions or Approval Given Under

EPA Part X ☒

N

Regulation 362 ☒

N

Manifest No. Z131599

Waste Class :

Hauler : SEWERMATIC DRAIN SERVICE

Disposal Site : 349977 ONTARIO LTD

Environmental Impact:

P

Nature of Impact:

Multi Media Pollution

People/Business Damaged

(Other than to Owner/Controller) :

Nature of Damage:

UN No.:

Code. . : 14

Code. . : 98

Waste GenNum : ONS0402

Waste GenNum : ONS0402

Code . . : 221

Code . . : A860427

Code . . : A460716

Code . . : 09

Code . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:
OTTAWA CITY
1101 BAXTER RD., ONTARIO K2C 3M4

Reg: 4 **Dist:** OT **Municipality:** 20107

Entered: 2001/04/24 13:40
ORIS No. 9940007350

Received By:
CAROL BOOTH

Occurrence Type: O
Subtype: 99

Work Plan: WH

Reported By:
WASTE CARE SERVICES LTD.

Telephone No. 613-821-4695 x
Alternate No. x

Address:
6137 GOUEH ROAD
MANOTICK, ONTARIO
Postal Code: K4M 1P2

Syn: ISSUED EMERGENCY GENERATOR NUMBER

Brief Summary:

ISSUED EMERGENCY GENERATOR NUMBER FOR MANIFEST: MM98979-8, FOR WASTE CLASS NUMBER 148A: WASTE(MERCURY COMPOUNDS NOS "LIQUID").

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X **Abatement** **IEB** **Other**

BF Date:

File Closed: Y **Abatement:** **IEB** **Other**

Suspected Violation:

Report Prepared By: CAROL BOOTH
Date: 04/24/2001

Approving Officer: PAUL KEHOE
Date: 04/24/2001

Specify number(s) for routing Original [] [] [] [] [] []

Specify number(s) for copy distribution [] [] [] [] [] [] [] []

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

Continued [] **Yes**

7. Other _____

SAC Action Class: 1: 2:

Material 1:

Amount:

Material 2:

Amount:

Material 3:

Amount:

Cause:

Reason:

Code:

UN No.:

Code:

UN No.:

Code:

UN No.:

Code: . .

Code: . .

Person in Control:	Waste GenNum :
Owner :	Waste GenNum :
Agencies Involved :	
Clean up and Restoration Carried out by:	
☐ Controller ☐ Owner ☐ Other	
% Cleaned up:	Estimated Cost:
Were Directions or Approval Given Under	
EPA Part X ☐ Regulation 362 ☐ Manifest No.	
Waste Class :	Code . . :
Hauler :	Code . . :
Disposal Site :	Code . . :
Environmental Impact: Nature of Impact:	
	Code . . :
People/Business Damaged	
(Other than to Owner/Controller) :	
Nature of Damage:	Code . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:
OTTAWA CITY
1101 BAXTER ROAD, OTTAWA

Reg: 4 **Dist:** OT **Municipality:** 20101

Entered: 2000/02/24 10:58
ORIS No. 9940002774

Received By:
CAROL BOOTH

Occurrence Type: N
Subtype: 04

Work Plan: WH

Reported By:
WASTE CARE SERVICES LTD.

Telephone No. 613-821-4695 x
Alternate No. x

Address:
6137 GOUEH ROAD
MANOTICK, ONTARIO
Postal Code: K4M 1P2

Syn: ISSUED EMERGENCY GENERATOR NUMBER

Brief Summary:
ISSUED EMERGENCY GENERATOR NUMBER FOR MANIFEST NUMBER MM77512-0 FOR WASTE CLASS 252L WASTE OIL, 145L WASTE LATEX PAINT AND 232L WASTE POLYMOR SOLUTIONS

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X **Abatement** **IEB** **Other**
BF Date:

File Closed: Y **Abatement:** **IEB** **Other**
Suspected Violation:

Report Prepared By: CAROL BOOTH
Date: 02/24/2000

Approving Officer: PAUL KEHOE
Date: 02/24/2000

Specify number(s) for routing Original [] [] [] [] []
Specify number(s) for copy distribution [] [] [] [] [] []

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

Continued [] **Yes**

7. Other _____

SAC Action Class: 1: 2:

Material 1: N/A

Amount:

Material 2:

Amount:

Material 3:

Amount:

Cause:

Reason:

Code:

UN No.:

Code:

UN No.:

Code:

UN No.:

Code: . .

Code: . .

Person in Control:	Waste GenNum :
Owner :	Waste GenNum :
Agencies Involved :	
Clean up and Restoration Carried out by:	
☐ Controller ☐ Owner ☐ Other	
% Cleaned up:	Estimated Cost:
Were Directions or Approval Given Under	
EPA Part X ☐ Regulation 362 ☐ Manifest No.	
Waste Class :	Code . . :
Hauler :	Code . . :
Disposal Site :	Code . . :
Environmental Impact: Nature of Impact:	Code . . :
People/Business Damaged	
(Other than to Owner/Controller) :	
Nature of Damage:	Code . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:

OTTAWA CITY
1101 BAXTER ROAD

Reg: 4 Dist: OT Municipality: 20101

Entered:

2000/10/25 14:11

ORIS No.

9940005473

Received By:

CAROLLE VIAU

Occurrence Type:

N

Subtype:

04

Work Plan:

WH

Reported By:

WASTE CARE SERVICES LTD.

Telephone No.

613-821-4695 x

Alternate No.

x

Address:

6137 GOUEH ROAD
MANOTICK, ONTARIO
Postal Code: K4M 1P2

Syn: ISSUED EMERGENCY GENERATOR NUMBER

Brief Summary:

ISSUED EMERGENCY GENERATOR NUMBER FOR MANIFEST NUMBER: MM98967-1 FOR WASTE CLASS NUMBER: 145L WASTE
INK- SLUDGE

Source:

THE OTTAWA CITIZEN

Sector: Source: SIC:**UTM:**

N: [5026000] E: [447000] Zone: [18]

Abstracts:

0

Diaries:

0

Batch:

3665

I. E. B. No.**Occurrence Date:**

2000/10/25

Occurrence Time:

Report to MOE : 2000/10/25 00:00

MOE at Scene:**Assigned To:**

JASON SCHAEFER

ERP Contacted:

Callout: ☐

ERP Name:

NSP: ☐

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X Abatement IEB Other

BF Date:

File Closed: Y Abatement: IEB Other

Suspected Violation:**Report Prepared By:**

CAROLLE VIAU

Date:

10/25/2000

IEB Investigator:**IEB BF Date****Approving Officer**

PAUL KEHOE

Date:

10/25/2000

Reviewing Officer:**Date**

Specify number(s) for routing Original

[] [] [] [] [] []

Specify number(s) for copy distribution

[] [] [] [] [] [] [] []

Continued [] Yes

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

7. Other _____

SAC Action Class: 1: 2:

Material 1: N/A

Amount:

Material 2:

Amount:

Material 3:

Amount:

Cause.:

Reason.:

Code:

UN No.:

Code:

UN No.:

Code:

UN No.:

Code. .:

Code. .:

Person in Control:	Waste GenNum :
Owner :	Waste GenNum :
Agencies Involved :	
Clean up and Restoration Carried out by:	
☐ Controller ☐ Owner ☐ Other	
% Cleaned up:	Estimated Cost:
Were Directions or Approval Given Under	
EPA Part X ☐ Regulation 362 ☐ Manifest No.	
Waste Class :	Code . . :
Hauler :	Code . . :
Disposal Site :	Code . . :
Environmental Impact: Nature of Impact:	
	Code . . :
People/Business Damaged	
(Other than to Owner/Controller) :	
Nature of Damage:	Code . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:
OTTAWA CITY
1101 BAXTER ROAD, OTTAWA

Reg: 4 **Dist:** OT **Municipality:** 20101

Entered: 2000/02/24 10:50
ORIS No. 9940002773

Received By:
CAROL BOOTH

Occurrence Type: N
Subtype: 04

Work Plan: WH

Reported By:
WASTE CARE SERVICES LTD.

Telephone No. 613-821-4695 x
Alternate No. x

Address:
6137 GOUEH ROAD
MANOTICK, ONTARIO
Postal Code: K4M 1P2

Syn: ISSUED EMERGENCY GENERATOR NUMBER

Brief Summary:

ISSUED EMERGENCY GENERATOR NUMBER FOR MANIFEST NUMBER MM77513-8 FOR WASTE CLASS 262L WASTE DETERGENTS

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X **Abatement** **IEB** **Other**

BF Date:

File Closed: Y **Abatement:** **IEB** **Other**

Suspected Violation:

Report Prepared By: CAROL BOOTH
Date: 02/24/2000

Approving Officer: PAUL KEHOE
Date: 02/24/2000

Specify number(s) for routing Original [] [] [] [] [] []

Specify number(s) for copy distribution [] [] [] [] [] [] [] []

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

7. Other _____

SAC Action Class: 1: 2:

Source:
THE OTTAWA CITIZEN

Sector: **Source:** **SIC:**

UTM:

N: [5026000] **E:** [447000] **Zone:** [18]

Abstracts: 0
Diaries: 0

Batch: 3421
I. E. B. No.

Occurrence Date: 2000/02/23

Occurrence Time:

Report to MOE : 2000/02/24 00:00

MOE at Scene:

Assigned To: TOR RUSTAD

ERP Contacted:

Callout: []

ERP Name:

NSP: []

Material 1: N/A

Amount:

Material 2:

Amount:

Material 3:

Amount:

Cause:

Reason:

Code :

UN No.:

Code :

UN No.:

Code :

UN No.:

Code. . :

Code. . :

Person in Control:		Waste GenNum :
Owner :		Waste GenNum :
Agencies Involved :		
Clean up and Restoration Carried out by:		
☐ Controller	☐ Owner	☐ Other
% Cleaned up:	Estimated Cost:	
Were Directions or Approval Given Under		
EPA Part X ☐	Regulation 362 ☐	Manifest No.
Waste Class :		Code . . :
Hauler :		Code . . :
Disposal Site :		Code . . :
Environmental Impact:	Nature of Impact:	
		Code . . :
People/Business Damaged		
(Other than to Owner/Controller) :		
Nature of Damage:		Code . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:
OTTAWA CITY
1101 BAXTER ROAD, OTTAWA

Reg: 4 **Dist:** OT **Municipality:** 20107

Entered: 2001/07/26 12:56
ORIS No. 9940008415

Received By:
CAROLLE VIAU

Occurrence Type: N
Subtype: 99

Work Plan: WH

Reported By:
WASTE CARE SERVICES LTD.

Telephone No. 613-821-4695 x
Alternate No. x

Address:
6137 GOUEH ROAD
MANOTICK, ONTARIO
Postal Code: K4M 1P2

Syn: ISSUED EMERGENCY GENERATOR NUMBER

Brief Summary:
ISSUED EMERGENCY GENERATOR NUMBER FOR MANIFEST NUMBER MM98879-8 FOR WASTE CLASS 148A MERCURY COMPOUNDS LIQUID

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X **Abatement** **IEB** **Other**

BF Date:
RESOLVED WITH NEW REGISTRATION AND MANIFEST SYSTEM

File Closed: Y **Abatement:** **IEB** **Other**

Suspected Violation:

Report Prepared By: PAUL KEHOE
Date: 01/31/2002

Approving Officer: PAUL KEHOE
Date: 01/31/2002

Specify number(s) for routing Original [] [] [] [] []
Specify number(s) for copy distribution [] [] [] [] [] []

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

Continued [] **Yes**

7. Other _____

SAC Action Class: 1: 2:

Material 1: N/A

Amount:

Material 2:

Amount:

Material 3:

Amount:

Cause:

Reason:

Code: 97

UN No.:

Code:

UN No.:

Code:

UN No.:

Code: . .

Code: . .

Person in Control:		Waste GenNum :
Owner :		Waste GenNum :
Agencies Involved :		
Clean up and Restoration Carried out by:		
☐ Controller	☐ Owner	☐ Other
% Cleaned up:	Estimated Cost:	
Were Directions or Approval Given Under		
EPA Part X ☐	Regulation 362 ☐	Manifest No.
Waste Class :		Code . . :
Hauler :		Code . . :
Disposal Site :		Code . . :
Environmental Impact:	Nature of Impact:	
		Code . . :
People/Business Damaged		
(Other than to Owner/Controller) :		
Nature of Damage:		Code . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:
OTTAWA CITY
1101 BAXTER ROAD, OTTAWA

Reg: 4 **Dist:** OT **Municipality:** 20101

Entered: 2000/02/24 11:03
ORIS No. 9940002775

Received By:
CAROL BOOTH

Occurrence Type: N
Subtype: 04

Work Plan: WH

Reported By:
WASTE CARE SERVICES LTD.

Telephone No. 613-821-4695 x
Alternate No. x

Address:
6137 GOUEH ROAD
MANOTICK, ONTARIO
Postal Code: K4M 1P2

Syn: ISSUED EMERGENCY GENERATOR NUMBER

Brief Summary:

ISSUED EMERGENCY GENERATOR NUMBER FOR MANIFEST NUMBER MM77513-8 FOR WASTE CLASS 331I WASTE FLAMMABLE AEROSOLS, 269T WASTE PESTICIDES LIQUID TOXIC, AND 148A WASTE HYDRAZINE SOLUTION

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X **Abatement** **IEB** **Other**

BF Date:

File Closed: Y **Abatement:** **IEB** **Other**

Suspected Violation:

Report Prepared By: CAROL BOOTH
Date: 02/24/2000

Approving Officer: PAUL KEHOE
Date: 02/24/2000

Specify number(s) for routing Original [] [] [] [] [] []

Specify number(s) for copy distribution [] [] [] [] [] [] [] []

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

Continued [] **Yes**

7. Other _____

SAC Action Class: 1: 2:

Material 1: N/A

Amount:

Material 2:

Amount:

Material 3:

Amount:

Cause:

Reason:

Code:

UN No.:

Code:

UN No.:

Code:

UN No.:

Code: . .

Code: . .

Person in Control:	Waste GenNum :
Owner :	Waste GenNum :
Agencies Involved :	
Clean up and Restoration Carried out by:	
☐ Controller ☐ Owner ☐ Other	
% Cleaned up:	Estimated Cost:
Were Directions or Approval Given Under	
EPA Part X ☐ Regulation 362 ☐ Manifest No.	
Waste Class :	Code . . :
Hauler :	Code . . :
Disposal Site :	Code . . :
Environmental Impact: Nature of Impact:	
	Code . . :
People/Business Damaged	
(Other than to Owner/Controller) :	
Nature of Damage:	Code . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:
OTTAWA CITY
OTTAWA CITIZEN BUILDING, 1101 BAXTER RD

Reg: 4 **Dist:** OT **Municipality:** 20101

Entered: 1996/04/09 07:50
ORIS No. 9600002475

Received By:
NICK SALONIKIDIS

Occurrence Type: C
Subtype: 05

Work Plan: 18

Reported By:

Source:
TRANSPORT TRUCK
MOTOR VEHICLE (OPERATING FLUID)
Sector: TA **Source:** MV **SIC:** 4561

UTM:
N: [5026000] **E:** [447000] **Zone:** [18]

Abstracts: 0
Diaries: 1

Batch: 2174
I. E. B. No.

Occurrence Date: 1996/04/09

Occurrence Time:

Report to MOE : 1996/04/09 07:50

MOE at Scene: 96/04/10 09:00

Assigned To: BRYAN DICKMAN

ERP Contacted:
Callout: ☐
ERP Name: **NSP:** ☐

Postal Code:

Syn: TRANSPORT TRUCK: UNK AMT OF DIESEL SPILLED TO ROADAND PARKING LOT.

Brief Summary:

CALLER REPORTS THAT A TRUCK HAD A RUPTURED SADDLE TANK AND LEAKED AN UNKNOWN AMOUNT OF DIESEL FUEL TO THE ROAD AND ONTO THE PARKING LOT OF THE OTTAWA CITIZEN BUILDING, AT THE ABOVE LOCATION. THE F.D. RESPONDED AND HOSED THE FUEL DOWN. HE DID NOT SEE ANYONE FROM THE WORKS DEPT. ON THE SCENE. @08:17 SAC TO OTTAWA WORKS- INFORMED JUSTINE. SHE WILL DISPATCH SOMEONE.

If there are related reports, record initial/master ORIS No. here >>

Followup Action: Abatement IEB Other

BF Date:
ALL CLEANED UP

File Closed: X **Abatement:** IEB Other

Suspected Violation:

Report Prepared By: BRYAN DICKMAN
Date: 09/11/96

IEB Investigator: **IEB BF Date**

Approving Officer: GEORGE CLARKE
Date: 09/19/96

Reviewing Officer: **Date**

Specify number(s) for routing Original [] [] [] [] []

Continued [] **Yes**

Specify number(s) for copy distribution [] [] [] [] [] []

1. Investigator/E.O. 2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr. 5. IEB Reg. Spv

6. IEB H.O./file

7. Other _____

SAC Action Class: 1: 2:

Material 1:

Amount:

Material 2:

Amount:

Material 3:

Amount:

Code :

UN No.:

Code :

UN No.:

Code :

UN No.:

Cause. :		Code. . :
Reason. :		Code. . :
Person in Control:		Waste GenNum :
Owner. :		Waste GenNum :
Agencies Involved. :		
Clean up and Restoration Carried out by:		
☐ Controller	☐ Owner	☐ Other
% Cleaned up:		Estimated Cost:
Were Directions or Approval Given Under		
EPA Part X ☐	Regulation 362 ☐	Manifest No.
Waste Class :		Code . . :
Hauler :		Code . . :
Disposal Site :		Code . . :
Environmental Impact:	Nature of Impact:	
		Code . . :
People/Business Damaged		
(Other than to Owner/Controller) :		
Nature of Damage:		Code . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:

OTTAWA CITY
1101 BAXTER ROAD

Reg: 4 Dist: OT Municipality: 20101

Entered:

1999/11/09 10:14

ORIS No.

9940002132

Received By:

BRYAN DICKMAN

Occurrence Type:

N

Subtype:

04

Work Plan:

WH

Reported By: BRYAN DICKMAN

MINISTRY OF ENVIRONMENT & ENER

Telephone No.

613-521-3450 x

Alternate No.

x

Address:

2435 HOLLY LANE
OTTAWA, ONTARIO
Postal Code: K1V 7P2

Syn: COOMPANY SHIPPED WASTE THAT WAS NOT REGISTERED

Brief Summary:

COMPANY SHIPPED WASTE ALCOHOL FROM BAXTER ROAD SITE. CONMPANY IS NOT REGISTERED FOR THIS WASTE (212I).

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X Abatement N IEB Other

BF Date:

LETTER SENT TO COMPANY

File Closed: Y Abatement: IEB Other

Suspected Violation: 43

Report Prepared By:

BRYAN DICKMAN

Date:

01/19/2000

IEB Investigator:**IEB BF Date****Approving Officer**

GEORGE CLARKE

Date:

01/20/2000

Reviewing Officer:**Date**

Specify number(s) for routing Original

[] [] [] [] [] []

Specify number(s) for copy distribution

[] [] [] [] [] [] [] []

Continued [] **Yes**

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

7. Other _____

SAC Action Class: 1: 2:

Material 1: ALIPHATIC ALCOHOL

Amount: 2050 L

Material 2:

Amount:

Material 3:

Amount:

Cause: :

Reason: :

Code : 27

UN No.: 1993

Code :

UN No.:

Code :

UN No.:

Code. . : 99

Code. . : 99

Person in Control: OTTAWA CITIZEN

Owner :

Agencies Involved :

Clean up and Restoration Carried out by:

☒ [v] Controller

☒ [v] Owner

☐ [N] Other

% Cleaned up:

Estimated Cost:

Were Directions or Approval Given Under

EPA Part X ☒ [v]

Regulation 362 ☒ [v]

Manifest No.

Waste Class :

Hauler :

Disposal Site :

Environmental Impact:

Nature of Impact:

People/Business Damaged

(Other than to Owner/Controller) :

Nature of Damage:

Waste GenNum :

Waste GenNum :

Code . . :

Code . . :

Code . . :

Code . . :

Code . . :



OCCURENCE REPORT

Ministry of the
Environment

Location of Occurrence:

OTTAWA CITY
1101 BAXTER ROAD

Reg: 4 Dist: OT Municipality: 20101

Entered:

1999/05/12 14:27

ORIS No.

9940000608

Received By:

TRUDY HERFKENS

Occurrence Type:

N

Subtype:

01

Work Plan:

WH

Reported By:

DRAIN ALL LTD.

Telephone No.

613-739-1070 x

Alternate No.

x

Address:

2705 STEVENAGE DRIVE
GLOUCESTER, ONTARIO
Postal Code: K1G 3N2

Syn: ISSUED EMERGENCY GENERATOR NUMBER

Brief Summary:

ISSUED EMERGENCY GENERATOR NUMBER FOR WASTE CLASS 212L ETHYLENE GLYCOL

If there are related reports, record initial/master ORIS No. here >>

Followup Action: X Abatement IEB Other

BF Date:

File Closed: Y Abatement: IEB Other

Suspected Violation:**Report Prepared By:**

TRUDY HERFKENS

Date:

05/12/99

IEB Investigator:**IEB BF Date****Approving Officer**

GEORGE CLARKE

Date:

05/12/99

Reviewing Officer:**Date**

Specify number(s) for routing Original

[] [] [] [] [] []

Specify number(s) for copy distribution

[] [] [] [] [] [] [] []

Continued [] Yes

1. Investigator/E.O.

2. D. O. /File

3. SAC (initial spills)

4. Reg. Dir. / _____ Mgr.

5. IEB Reg. Spv

6. IEB H.O./file

7. Other _____

SAC Action Class: 1: 2:

Material 1: N/A

Amount:

Material 2:

Amount:

Material 3:

Amount:

Cause. :

Reason. :

Code :

UN No.:

Code :

UN No.:

Code :

UN No.:

Code. . :

Code. . :

Person in Control:

Owner :

Agencies Involved :

Clean up and Restoration Carried out by:

☒ [v] Controller

☒ [v] Owner

☐ [N] Other

% Cleaned up:

Estimated Cost:

Were Directions or Approval Given Under

EPA Part X ☒ [v]

Regulation 362 ☒ [v]

Manifest No.

Waste Class :

Hauler :

Disposal Site :

Environmental Impact:

Nature of Impact:

People/Business Damaged

(Other than to Owner/Controller) :

Nature of Damage:

Waste GenNum :

Waste GenNum :

Code . . :

Code . . :

Code . . :

Code . . :

Code . . :

Ministry of the
Environment

2435 Holly Lane
Ottawa ON K1V 7P2
Telephone: (613) 521-3450
Fax: (613) 521-5437

Ministère de
l'Environnement

2435 Holly Lane
Ottawa ON K1V 7P2
Téléphone: (613) 521-3450
Télécopieur: (613) 521-5437

July 18, 2001

Ottawa Citizen
1101 Baxter Road
P. O. Box 5020
Ottawa, Ontario
K2C 3M4

Attention: Ms. Joanne Denis

Dear Ms. Denis

RE: Closure of PCB Storage Site - Ref. # 40296A002

This is in response to your letter of July 11, 2001. With regard to the PCB site's operational status, please be advised that based on information provided by you, ie. there are only 15 ballasts on site and there has never been a spill of PCB material, this site is considered "closed". When a site is closed this office assigns a "historical" designation to the site and the your Regulatory responsibilities related to site inspections and record keeping are no longer valid. However, if you should at any time decide to store more than 20 lighting ballasts at this location; you are requested to notify this office and your operational status will be changed to "active".

If you have any questions with regard to the above, please contact Mr. Harrison Sr.
Environmental Officer @ 521-3456 ext.232.

Yours truly,
ORIGINAL SIGNED
BY STEVE BURNS

Steve Burns,
Ottawa District Manager

DSH/cb

bc: STAR 6979/QSS #83/File Code: SI OC OT BA 630



High Priority

Task#

15,006,979

Cross Reference

QSS #83

QSS #83 - Light Ballasts Containing PCBs

Created On: Jul 13, 2001

By: Burns, Steve

Ottawa District

Workplan Program/Activity: Waste - Hazard. & Liq. Ind., General (No related Specific Activity)

Location: Ottawa, City of

Received: Jul 12, 2001

Due Date: Aug 2, 2001

Completed:

Assignments

Assigned	Assigned By	Assigned To	Required Product	Due Date	Completed
Jul 13, 01	Burns, Steve	Booth, Carol	Tracking	Aug 2, 01	
Jul 13, 01	Burns, Steve	Burns, Steve	Response Required	Aug 2, 01	
Jul 13, 01	Burns, Steve	Harrison, Dan S	Review and Respond	Aug 2, 01	
Jul 13, 01	Burns, Steve	Kehoe, Paul L	Review with Dan Harrison	Aug 2, 01	

Keywords

Notes

Time


July 13, 2001 10:30 AM

1.

Carol → QSS → P. Kehoe

OTTAWA CITIZEN

JOANNE DENIS
Manager, Human Resources

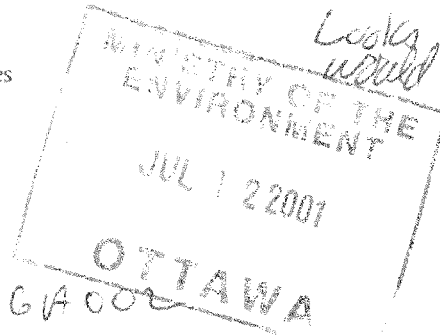

July 11, 2001

Steve Burns
Ottawa District Officer
Ministry of the Environment
2435 Holly Lane
Ottawa ON
K1V 7P2



Dear Mr. Burns:

In response to your letter date June 12, 2001, I would like to clarify that in my conversation with Ms. Lander I indicated that we did have a "few" light ballasts containing PCBs but that we had shipped a barrel late last year and didn't have a lot remaining.

I have verified that we currently have approximately 15 ballasts in the barrel at this time.

I am uncertain if this renders our site "closed" due the small quantity or if it keeps us "active". When Ms. Lander and I spoke, the impression I got was that with that small a quantity it would be considered closed. At issue however is that I do not know how many such fluorescent lights remain. Therefore, I am unable to estimate the potential quantity of PCBs we may eventually store.

You are correct in your understanding that no surfaces within the PCB storage facility have been contaminated. The ballasts are place in a barrel with a leak pan beneath it. We have never had a spill.

Regards,

Joanne Denis
Manager, Human Resources

Ministry of the
Environment

2435 Holly Lane
Ottawa ON K1V 7P2
Telephone: (613) 521-3450
Fax: (613) 521-5437

Ministère de
l'Environnement

2435 Holly Lane
Ottawa ON K1V 7P2
Téléphone: (613) 521-3450
Télécopieur: (613) 521-5437



June 12, 2001

Ms. Joanne Denis
Human Resources Manager
The Ottawa Citizen
1101 Baxter Road, Box 5020
Ottawa, ON K2C 3M4

Dear Ms. Denis:

Re: PCB Storage Site # 40296A002

This is to confirm your telephone conversation with Lesley Lander, Environmental Officer, on March 23, 2001. Based on the information that you have provided, the Ministry will change the status of this site to "closed" from its present status as an "active" site on the Provincial PCB Inventory System.

It is our understanding based on the information you provided during the above telephone conversation that:

1. The storage site does not currently contain any PCB-containing waste;
2. You no longer will be using this storage facility to store PCB-containing waste; and
3. The PCB waste formerly stored at the site consisted only of solid materials (light ballasts and/or capacitors) that were stored within drums within the storage facility.

Based on the above information, as well as information and/or inspection reports contained in our files, it is our understanding that no surfaces within the PCB storage facility have been contaminated with PCBs.

Please advise this office by June 25, 2001 if any of the above information is incorrect.

If you have any questions or require additional information, please do not hesitate to contact this office by calling Lesley Lander.

Yours truly,


ORIGINAL SIGNED
BY STEVE BURNS

Steve Burns
Ottawa District Officer


c: Wayne Herrick
Municipality
Fire Department
Health Unit
Environment Canada
Environmental Monitoring & Reporting Branch
Regional Office



51 OC OT BA 630

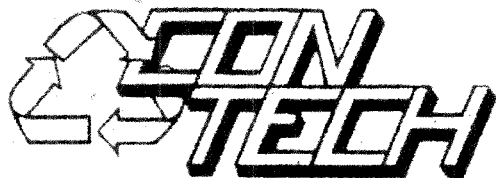

Rob Maxwell,
PCB Containment Technology Inc.



Instructions are on the reverse of this form.

PCB Inventory

SI0COTBA 630

1. PCB Site Identification

PCB site no.

4102 1916 A1002

WASTE CLASS 243 D

2. PCB Holder (includes owner, possessor or anyone who has care or control of PCB wastes)

Name of company holding PCB

THE OTTAWA CITIZEN

Contact person

Jeanne Denis

Signature

Tel. no.

(613) 596-8420

3. PCB Site Location

Street name

1101 BAXTER RD

Township/Municipality name

OTTAWA CARLETON

County/Regional Municipality

Postal code

K2C 3M4

4. Corporate Name And Address Of Holder (if different from 3. above)

Name of company

Mailing address

1101 BAXTER RD Bx5000

Postal code

K2C 3M4

5. The Generator Registration Number associated with this PCB waste storage site must be entered here.

0 N 0 1 7 0 7 0 0

6. Date Survey Completed

APRIL 24

19 98

7. Liquids

	High Level (over 10000 ppm)	Low Level (50 - 10000 ppm)
a. bulk liquid	Libres	Libres
b. transformers	No. of transformers	No. of transformers
c. total liquid in transformers	Libres	Libres

8. Solids

Capacitors	a. ballasts	No. of drums	
	b. other capacitors	No. of capacitors	
	c. total weight other capacitors / large cap. / other equipment	Kg.	
Soil/Gravel	d. soil and gravel	No. of drums	No. of drums
	e. total weight not in drums	Kg.	Kg.
Other Solids	f. clothing, tools, equipment, etc.	No. of drums	No. of drums
	g. total weight not in drums	Kg.	Kg.



MINISTRY OF THE ENVIRONMENT
PCB STORAGE SITE INSPECTION REPORT

COMPANY/MUNICIPALITY: The Ottawa Citizen

SITE ADDRESS: 1101 Baxter Road, Ottawa

CONTACT NAME: Joanne Denis **TITLE:** Manager, Human Resources

CONTACT TELEPHONE: 596-8420 **FAX:**

MOE SITE NUMBER: 40296A002

GENERATOR REGISTRATION NUMBER: ON0170700

INSPECTION DATE: March 24, 1999

DATE OF LAST INSPECTION: September 24, 1996

1.0 SITE DESCRIPTION:

- Minor site, less than 1000 litres, indoor, secured.

2.0 SITE SECURITY

- Site security is adequate

3.0 COMPATIBILITY OF MATERIALS STORED

- Two metal fluorescent light boxes are stored in the room. No other materials are in the room.

4.0 INTEGRITY OF PRIMARY CONTAINER

- No leaks, steel barrel.

5.0 INTEGRITY OF SECONDARY CONTAINER

- No leaks, drip tray

6.0 LABELLING

- The barrel is properly labelled.

7.0 ADEQUACY OF INSPECTION PROCEDURES

- Need inventory sheet in PCB storage room.

8.0 REVIEW OF OUTSTANDING ISSUES

- No outstanding issues.

9.0 SUMMARY OF INSPECTION FINDINGS

- Was there any indication of a known or anticipated human health impact during the inspection and/or review of relevant material, related to this Ministry's mandate ?

No

Specifics:

- Was there any indication of a known or anticipated environmental impact during the inspection and/or review of relevant material ?

No

Specifics:

- Was there any indication of a known or suspected violation of a legal requirement during the inspection and/or review of relevant material which could cause a human health impact or environmental impairment ?

No

Specifics:

- Was there any indication of a potential for environmental impairment during the inspection and/or the review of relevant material ?

No

Specifics:

10.0 ACTION REQUIRED

- Ensure inventory of PCB wastes are readily available.

11.0 OTHER COMMENTS AND RECOMMENDATIONS

- Company should explore disposal/destruction options.

OCCURRENCE REPORT # (If applicable.) :

PREPARED BY:

ENVIRONMENTAL OFFICER:

B. Dickman
(Print)

B. Dickman
(Signature)

Ottawa
(District/Area Office)

MARCH 29/99
(Date)

ENDORSED BY:

DISTRICT SUPERVISOR:

G. R. CLARKE
(Print)

G. R. Clarke
(Signature)

Mar. 31/99
(Date)

REPORT MAILED OUT ON:

Apr 7/99
(Date)

NOTE: "This inspection does not in any way suggest that there is or has been compliance with applicable legislation and regulations as they apply or may apply to this facility. It is, and remains, the responsibility of the owner and/or the operating authority to ensure compliance with all applicable legislative and regulatory requirements."

© 1995,1996 Queen's Printer for Ontario This material is owned by the Government of Ontario and protected by copyright law. It may not be reproduced or redistributed for commercial purposes without the prior written permission of the Queen's Printer for Ontario.

PCB Site 40296A002 Operator/Owner Information Portion

Note that there are Three (3) action buttons to change only portion of a record!

Update PCB Owner or Operator Portion of 40296A002 Record ONLY

PCB Site 40296A002 Changed:[2001-07-17 09:57:57] By User:[lindsagl@epo.gov.on.ca] Prev:07-17-20
NOTE: All dates are in mm-dd-yyyy format!

Site Number	: 40296A002	Cross Reference:	SI OC OT BA 630	Generator:	ON0170700								
Region	: 04	District:	402	County:	OTTA	Municipality:	OTTAWINTERFACE=CGI/1.1						
Site Desc.	:	Industry Sector:	:										
Major Site	: 2	Sensitive:	N	Site Stat:	H	Archived:	N	Indoor:	:	Fenced:	:	Enclosed:	:
Site Owner	:	OTTAWA CITIZEN	PCB Site Owner										
Address1	:	1101 BAXTER ROAD, BOX 5020											
Address2	:												
City	:	OTTAWA	Province:	ONT	Postal Code:	K2C 3M4							
Contact	:	JOANNE DENIS, HR MANAGER	Area Code:	613	Phone:	5968420	Extensic	:					
Approval Date	:	Approved:	:	Final Closing:	:	To be Deleted:	N						
Comment1	:												
Comment2	:												
PCB Inventory	:	CE Reg. Inv:	:	Dillon Inv:	:	Major/Minor:	:						
PCB Owner	:	OTTAWA CITIZEN	PCB Inventory Owner										
Address 1	:	1101 BAXTER ROAD											
Address 2	:												
City	:	OTTAWA	Province:	ONT	Postal Code:	K2C 3M4							
Contact	:	JOANNE DENIS	Area Code:	:	Phone:	:	Extensic	:					
Final Closing	:	Company Status :	Q	Historical:	Y								

PCB Site 40296A002 Information- Inspection/Actions Portion

Update PCB Inspection Portion of 40296A002 Record ONLY

PCB Site 40296A002 Changed:[2001-07-17 09:57:57] By User:[lindsagl@epo.gov.on.ca] (Current Us
NOTE: All dates are in mm-dd-yyyy format!

Inspected Y/N	: Y	Inspection Date:	03-24-1999	Inspector Name:	B. Dickman
Site Security	: Q	Comment 1:		Comment 2:	
Material Stored	: Q	Comment 1:		Comment 2:	
Primary Container	: Q	Comment 1:		Comment 2:	
Secondary Container:	Q	Comment 1:		Comment 2:	
Labelling	: Q	Comment 1:		Comment 2:	

PCB Site 40296A002 Changed:[05-08-2001 13:41:13] By User:[LANDERLE] Prev Date: Prev. User:
NOTE: All dates are in mm-dd-yyyy format!

Site Number :40296A002 Cross Reference:SI OC OT BA 630 Generator:ON0170700
Region :04 District:402 County:OTTA Municipality:OTTAWA-CARLETON
Site Desc. : Industry Sector:?
Major Site :? Sensitive:N Site Stat:I Archived Site:N Indoor:? Fenced:?
Site Owner :OTTAWA CITIZEN
Address1 :1101 BAXTER ROAD, BOX 5020
Address2 :
City :OTTAWA Province:ONT Postal Code:K2C 3M4
Contact :JOANNE DENIS, HR MANAGER Telephone:(613) 5968420 Extension:
Approval Date : Approved:? Final Closing: To be Deleted:N
Comment1 :
Comment2 :
PCB Inventory : CE Reg. Inv: Dillon Inv: Major/Minor:
PCB Owner :OTTAWA CITIZEN
Address 1 :1101 BAXTER ROAD
Address 2 :
City :OTTAWA Province:ONT Postal Code:K2C 3M4
Contact :JOANNE DENIS Area Code: Phone: Extension:
Final Closing : Company Status :C Historical:N
SYSTEM Created Site Owner:01-22-1996 By:ENSTM1 Updated:04-11-1996 By:ENSTM4
SYSTEM Created PCB Owner :01-22-1996 By:ENSTM1 Updated:04-11-1996 By:ENSTM4

PCB Inspection

Inspected Y/N :Y Inspection Date:03-24-1999 Inspector Name:B. Dickman
Site Security :C Comment 1: Comment 2:
Material Stored :C Comment 1: Comment 2:
Primary Container :C Comment 1: Comment 2:
Secondary Container:C Comment 1: Comment 2:
Labelling :C Comment 1: Comment 2:
Site Operator :C Comment 1: Comment 2:
Inspect Procedures :C Comment 1: Comment 2:
Spill Protect :C Comment 1: Comment 2:
Fire Protection :C Comment 1: Comment 2:
Training :C Comment 1: Comment 2:
Order Date : NON-Compliance Letr: Response: Resp. Acceptable:
SYSTEM Created:01-22-1996 By:ENSTM1 Updated:01-22-1996 By:ENSTM1

PCB Actions

1st Action : 1st Date: 1st Comment:
2nd Action : 2nd Date: 2nd Comment:
3rd Action : 3rd Date: 3rd Comment:
SYSTEM Created : By: Updated: By:
Changed : [05-08-2001 13:41:13] By User:[LANDERLE]

- site inactive since March 2000
- send letter that site will become historical
as of June 8, 2001.

PCB Site Survey

Container/Description	Hi Capacity > 10,000		Low Capacity < 10,000	
Description	Quantity	Unit	Quantity	Unit
7A. Bulk Liquid				
7C. Total Liquid in Transformers				
7B. Transformers Count				
7B. Total Weight in Transformers				
8A. Drums of Ballasts Count				
8A. Total Weight in Ballasts				
--Calc 8A. Total Weight in Ballasts		KG		
8B.C. Other Capacitors Count				
8B.C. Other Capacitors Weight				
8D. Drums - Soil\Gravel Count				
8D. Drums - Soil\Gravel Weight				
--Calc 8D. Drums - Soil\Gravel Weight		KG		KG
7E. Total Weight not in Drums				
7F. Clothing Tools Etc. Count				
7F. Clothing Tools Etc. Weight\Volume				
--Calc 7F. Clothing Tools Etc. Weight\Volume		KG		KG
7G. Total Weigth not in Drum				

Note: Calc 7A uses Factor of 200kg per unit count, Calc 7D uses Factor of 400kg per un
Unless specific weight is provided, we utilize Count TIMES Factor in calculating the s

SYSTEM Created:01-22-1996 By:ENSTM1 Updated:01-22-1996 By:ENSTM1

--- End of Detail Request ---



PCB Site Information

Inspection Information

MOE Site Number

40296A002

Company / Corporate Name

THE OTTAWA CITIZEN

Address

1101 BAXTER ROAD, OTTAWA

Postal Code

K2C 3M4

Contact Person

FRANK LICARI

Telephone No.

596-8420

PCB Site Location

SAME

Municipality

Address

SAME

Postal Code

Contact Person

SAME

Telephone No.

Reg. 309 Generator Registration Number
(Section 15, O. Reg. 309)

0 N 0 1 7 0 7 0 0

MOE District Office

OTTAWA

- ☐ Major Site (Major Site - high and low liquid totals > 1000 litres)
☒ Minor Site (Minor Site - high and low liquid totals < 1000 litres)

Sensitive
If ☐ YES, Indicate

☒ No

☐ School
☐ Hospital

☐ Daycare
☐ Food

☐ Feed
☐ Water plant

☐ Other (explain)

Indoor

☒ Yes
☐ No

Is this structure/building used solely for PCB Storage?

☐ Yes
☒ No

SWITCH PANEL

Fenced

☐ Yes
☒ No

Enclosed

☒ Yes
☐ No

Date Inspected (yy/mm/dd)

SEPT 24 / 96

Inspected By

BRYAN DICKMAN

Date of Last Inspection (yy/mm/dd)

* Compliance Assessment

Compliance (C)

Non-Compliance (N)

Marginal Compliance (M)

1. Site Security

* ☒

(a) Is site security being maintained?

☒ Yes If ☐ No, please explain

(b) Access to site is restricted to authorized personnel?

☒ Yes If ☐ No, please explain

2. Compatibility of Materials Stored

* ☐

(a) Are materials other than PCB wastes or related wastes being stored at site.

If ☐ Yes, please explain ☒ No

(b) Is askarel segregated from other PCB wastes?

☐ Yes If ☒ No, please explain

JUST BALLASTS.

* Compliance Assessment Compliance (C) Non-Compliance (N) Marginal Compliance (M)

3. Integrity of Primary Container

* ☐

(a) Any leaks?

If ☐ Yes, please explain☒ No

(b) Indicate type of container.

45 GAL. STEEL DRUM.

4. Integrity of Secondary Container

* ☒

(a) Any leaks?

If ☐ Yes, please explain☒ No

(b) Indicate type of container.

DRIP TRAY.

5. Labelling

* ☒

Are all wastes / waste containers properly labelled?

☒ YesIf ☐ No, please explain

6. Acceptability of Site Operations

* ☒

(a) Are wastes accessible for inspection?

☒ YesIf ☐ No, please explain

(b) Are multiple drums palletized, and stacked no more than two high?

☐ YesIf ☒ No, please explain

ONLY ONE DRUM

7. Adequacy of Inspection Procedures

* ☒

(a) Current inventory listing readily available?

☒ YesIf ☐ No, please explain

(b) Is the Owner's monthly inspection log readily available and up-to-date?

☒ YesIf ☐ No, please explain

Append complete inventory form (form # 1089)

8. Spill Protection

* ☒

(a) Are personnel protection and spill clean-up kits available?

☒ YesIf ☐ No, please explain

(b) Is contingency plan readily available?

☒ YesIf ☐ No, please explain

9. Fire Protection

* ☒

(a) Is the fire protection equipment maintained and operational?

YES

(b) Are ventilation and shut-off systems maintained and operational?

NO VENTILATION

(c) Fire Department advised of contingency plan?

☒ YesIf ☐ No, please explain



Inspection Information

Are staff knowledgeable?

YES.

Additional Information

PCB destruction completed / Plans for future destruction

CONTROLLED BY HEAD OFFICE

Transfers of waste since last inspection
(All movements authorized by Director's Instructions?)

NONE

Annual Report
(prepared / submitted by January 31 of each year?)

Action Information

Next site inspection

Date: _____
(yy/mm/dd)

TO BE NOTIFIED

Follow up action (explain)

Report of a Provincial Officer, Pursuant to the Environmental Protection Act, R.S.O. 1990 Section 156.

Name of Inspector

BRYAN DICKMAN

Name of P.C.B. Storage Site Supervisor

Signature of Inspector

[Signature]

Signature of P.C.B. Storage Site Supervisor

[Signature]



Instructions are on the reverse of this form.

Waste Disposal Site Information	1. PCB Site Identification	
	PCB site no. <u>4102 96 A 002</u>	WASTE CLASS 243 D
	2. PCB Holder (includes owner, possessor or anyone who has care or control of PCB wastes)	
	Name of company holding PCB <u>THE OTTAWA CITIZEN</u>	
	Contact person <u>FRANK LICARI</u>	Signature <u>[Signature]</u>
	Tel. no. <u>(613) 596-8420</u>	
	3. PCB Site Location	
	Street name <u>1101 BAXTER RD.</u>	
	Township/Municipality name <u>OTTAWA</u>	
	County/Regional Municipality <u>RMOC</u>	Postal code <u>K2C 3M4</u>
	4. Corporate Name And Address Of Holder (if different from 3. above)	
	Name of company Mailing address Postal code	

5. The Generator Registration Number associated with this PCB waste storage site must be entered here.

▶ ▶ ON 0170700

Waste Quantities And Types	6. Date Survey Completed		
	<u>Sept 24</u> 19 <u>96</u>		
	7. Liquids		
	a. bulk liquid	High Level (over 10000 ppm) Litres	Low Level (50 - 10000 ppm) Litres
	b. transformers	No. of transformers	No. of transformers
	c. total liquid in transformers	Litres	Litres
	8. Solids		
	Capacitors	a. ballasts	No. of drums
		b. other capacitors	No. of capacitors
		c. total weight other capacitors / large cap. / other equipment	Kg.
Soil/Gravel	d. soil and gravel	No. of drums	
	e. total weight not in drums	Kg.	
Other Solids	f. clothing, tools, equipment, etc.	No. of drums	
	g. total weight not in drums	Kg.	

Ministry of
Environment
and Energy

2435 Holly Lane
Ottawa ON K1V 7P2
Tel (613) 521-3450
Fax (613) 521-5437

Ministère de
l'Environnement
et de l'Énergie

2435 Holly Lane
Ottawa ON K1V 7P2
Tél (613) 521-3450
Télé (613) 521-5437



Bryan Copy
Ontario

22 January 1996

The Ottawa Citizen
1101 Baxter Road
Ottawa, Ontario
K2C 3M4

Attention: Frank Licari

Dear Mr. Licari;

RE: PCB Storage

This letter constitutes Director's Instructions under Ontario Regulation 362/90.
The storage of PCB wastes is hereby authorized at the following site:

OWNER: The Ottawa Citizen

LOCATION: 1101 Baxter Road
Ottawa, Ontario. K2C 3M4

SITE NO.: 40296A002

This authorization is based upon the details provided in your submission dated
January 17, 1996 and is subject to the following conditions:

In the event of a conflict between a provision in the submission and one of the
following provisions, the following provision shall govern.

1. The operation and maintenance of this PCB storage site shall be in strict
accordance with the standards specified in the Manual for the Management
of Wastes Containing Polychlorinated Biphenyls (PCBs), published by
Environment Canada, September 1989.
2. No materials other than PCB wastes or PCB related wastes shall be stored
at the site at any time.

...Page 2

3. Under Section 18, O.R. 347, you are required to register as a generator of PCB wastes. The enclosed generator registration report shall be submitted to the MOE within 30 days.
4. A current inventory shall be maintained of all wastes stored at the site in accordance with the form attached.
5. For those wastes for which a destruction method is commercially available, a timetable for this destruction shall be provided within six months or details justifying the continued storage shall be provided in the annual report specified in Condition 7.
6. The site shall be inspected by authorized personnel monthly and written records maintained of these inspections indicating inspection date, condition of the wastes and condition of the site. The records shall be signed by an authorized inspector and a copy maintained at the storage site.
7. An annual report is to be prepared by January 31 of each year detailing the inventory as of December 31 of the previous year and confirming inspections have been conducted and identifying any site problems and corrective action taken.
8. All movement of wastes to the storage site shall be subject to the following:
 - (i) The movement of off-site wastes into the storage facility requires additional instructions.
 - (ii) An updated, total site inventory shall be provided to the Director within 30 days of the movement as required by Section 4 (3)(b) O.R. 362/90.
 - (iii) Environment Canada shall be notified in writing of all PCB labelled equipment taken out of service and moved into storage.
 - (iv) All transfers of wastes to the storage site shall be done in a manner to minimize any hazard to the health and safety of any person or to the environment and to minimize the chance and quantity of any discharge.

9. Access to the site shall be restricted to authorized persons knowledgeable in the contingency plan specified in Condition 10.
10. A contingency plan shall be prepared within 3 months describing procedures to be followed in the event of a spill or fire. The plan is to be kept up to date and contain a list of authorized persons. A copy shall be provided to the local fire fighting authority. The plan shall be readily available to all personnel associated with the operation of the site and shall be provided to Ministry inspectors upon request.
11. The storage site shall be externally identified with appropriate signs to identify the presence of PCB waste. Appropriate labels shall be maintained on all storage containers to identify contents and concentration (where applicable).
12. The operation of this site shall be in accordance with any additional requirements imposed by the Ministry of Labour.
13. All spills and leaks of PCB wastes shall be reported forthwith to the Spills Action Centre (1-800-268-6060).
14. The site shall be available for inspection by Provincial Officers at all reasonable times and records kept off site shall also be made available to Provincial Officers at all reasonable times.
15. All transport to and from the site shall be in conformity with TDGA and regulations and the DGTA and regulations.
16. Every person engaged in the handling of PCBs or in charge of or supervising such handling covered by this instruction, shall be responsible for complying with each of these instructions.

Failure to comply with these conditions is an offence under the Environmental Protection Act.

Please file this letter, containing these 16 conditions, for discussion when our inspector next visits your waste site.

In the event your site does not comply, we request that you advise our office what action you will take to bring your site into compliance and a time frame in which you will complete this task.

...Page 4

Page 4.

Should you wish to discuss or clarify these requirements, please call the Ottawa District Office at (613) 521-3450 and ask for Bryan Dickman.

Yours truly,



G.R. Clarke, P.Eng.
Director
Ontario Regulation 362/90

c.c. Medical Officer of Health
Ministry of Labour
City of Ottawa
Regional Municipality of Ottawa Carleton
Ottawa Fire Department
Regional Police Department
Environment Canada
Wayne Herrick
Env. Monitoring & Reporting Branch - Anna Gortva



1101 BAXTER ROAD
OTTAWA ONTARIO
K2C 3M4 CANADA

PHONE: (613) 596-8420
FAX: (613) 596-8423

OFFICE OF THE
HEALTH & SAFETY MANAGER

FAX INFORMATION

To Fax Number: 521-5437

Sent to: BYRAN DICKMAN

Address: 2435 HOLLY LAKE

No. of Pages
To Follow: THREE

Date: JAN. 17/96

From: Person: FRANK LICARI

Fax Number: 613-596-8423

Remarks:

Hi Byran:
Thanks for your
help.
Awaiting your
comments.
cheers
Frank



THE OTTAWA Citizen

a division of Southam inc.

1101 Baxter Road, Box 5020
Ottawa, Ontario K2C 3M4
Telephone (613)829-9100

Revised: 093

SPILLS RESPONSE PROCEDURES

(officially Approved by the Publisher)

SPILL DEFINITION

A chemical spill emergency refers to the unplanned sudden or non-sudden release of any material, gas, vapour, fume, liquid or solid resulting from chemical decomposition, incompatibility reactions or breakdowns due to fires, explosions, spills, leaks etc., which does or may pose a hazard to employees, property, or the environment.

INITIAL RESPONSE

If you are the first person to discover a spill, whether or not you think it constitutes a chemical spill emergency, your immediate responsibility is to notify the Security Department and Health & Safety Manager, who will contact the Ministry of Environment, local office. (Spills Action Centre, 24 hour service, 1-800-268-6060, From a safe distance, convey the following information:

1. Report exact location of the spill
2. Report any injuries
3. Identify the spilled material through WHMIS labels and/or Material Safety Data Sheets (MSDS)
4. Estimate amount of spillage
5. Characterize the spill, (bubbling, vapour, etc.)
6. Note the direction of the spill, (toward a drain, etc.)

Under most circumstances, spills of less than one gallon of material (representing minimal risk) could be cleaned-up by any person provided that they are properly equipped and trained to proceed in a safe manner. However, the clean-up of a chemical spill of more than 1 gallon (higher risk situation), shall only be performed by medically certified and spill response trained personnel equipped with proper safety equipment and clean-up materials. High risk materials include those which are toxic, reactive, corrosive or flammable while minimal risk materials include all other materials. Should there be any doubt as to whether the Health & Safety Manager should be contacted, it is recommended to act cautiously and make the contact.

IDENTIFICATION

The first step in responding to a spill situation is identification. A chemical spill can be identified through a variety of sources such as, hazard labels, shipping manifests, material safety data sheets, truck placards, informed personnel and/or manufacturer. Response procedures are based on properly identifying the hazards of a chemical spill. Remember, rash responses such as pouring water on a strong acid can cause dangerous chemical reactions. If a spilled material cannot be identified, it should be treated as extremely hazardous in order to ensure that necessary precautions are taken.

ASSESSMENT

After a spill has been identified the Health & Safety Manager's duty is to assess the occurring and potential hazards of the spill. Three key assessments are: has, or does the spill have potential to cause harm to Citizen employees, the public or adversely impact the environment or damage property.

ISOLATION

Upon arriving at the site of a spill, barriers must be set up to isolate the spill from all employees. The Health & Safety Manager (supervisor if appropriate) must then set up lines of communication and co-ordinate the clean-up from a nearby position.

CONTAINMENT

A spill must be contained before it can be cleaned up. Containment limits the impact of a spill by keeping it within a smaller area. A dam of absorbent is often used to contain liquid chemical spills, however, containment procedures vary greatly depending on the nature of a spill. Toxic fumes may require an area to be evacuated, sealed, and or vented. A chemical fire may require the use of extinguishers or water hoses while diking the run-off. A ground water contaminating incident may require excavation or diking techniques.

In the case of a spill, which has the potential to find its way to a drain, it is imperative that the spill be diked away from any drain. Although drains leading to natural waterways (catch basin) must receive priority attention, spills leading to indoor drains should also be diked.

Often spills must be stabilized before they are absorbed. Depending on the hazard associated with a spill, stabilizing agents such as neutralizing compounds or specialized absorbents may be needed. For example, neutralizing powders are often used to stabilize corrosive spills while a special carbon powder is commonly utilized in stabilizing solvent spills.

ABSORPTION

After a spill is contained and stabilized, it may then be absorbed. A general chemical absorbent such as vermiculite is employed to perform this task. It should be applied liberally while mixing until the entire spill is thoroughly absorbed.

DISPOSAL

An absorbed spill must be disposed of in accordance with applicable Ontario Ministry of Environment Laws and Regulations. Containers must be labelled with a WHMIS label while in the work place and contents must have been registered as a waste stream with the Ontario Ministry of the Environment prior to disposal. Prior to their transport to a registered disposal site, containers must have a TDG identification name, hazard class and appropriate hazardous labels affixed to each container before leaving the site. Any leaky containers must be placed in salvage drums which are likewise marked.

DECONTAMINATION

Spill and personal protective equipment which are contaminated by spilled material must be decontaminated before leaving the spill site. This decontamination procedure usually involves water rinsing in a portable tub. Depending on the contaminant, water generated by this process may also be considered a waste which should be disposed of following applicable Ontario Ministry of the Environment Laws and Regulations. Once decontamination has been achieved, the co-ordinators job is completed. Materials expended in the clean-up must be immediately restocked.

If the product spilled cannot be identified and a MSDS cannot be located, the spill should be treated as extremely hazardous. This would ensure that every precaution would be taken when dealing with an unknown.

Ministry of
Environment
and Energy

2435 Holly Lane
Ottawa ON K1V 7P2
Tel (613) 521-3450
Fax (613) 521-5437

Ministère
l'Environnement
et de l'Énergie

2435 Holly Lane
Ottawa ON K1V 7P2
Tél (613) 521-3450
Téléc (613) 521-5437



SE DC OT BA 631

December 12, 1995

The Ottawa Citizen
1101 Baxter Road
Ottawa, Ontario,
K2C 3M4

Attention: Frank Licari

Dear Frank;

Re: PCB Storage Facility

Please find enclosed a copy of the section of the federal guidelines for setting up a PCB storage facility. Once you have established where the PCB's will be stored, give me a call and I will inspect the site preparatory to getting it certified.

If you have any questions, please give me a call.

Yours truly;

A handwritten signature in black ink, appearing to read "B. Dickman".

Bryan D. Dickman,
Senior Environmental Officer.



1101 BAXTER ROAD
OTTAWA ONTARIO
K2C 3M4 CANADA

PHONE: (613) 596-8420
FAX: (613) 596-8423

October 27, 1994

OFFICE OF THE
HEALTH & SAFETY MANAGER

**TO: BRYAN DICKMAN
ENVIRONMENTAL OFFICER
MINISTRY OF THE ENVIRONMENT
2435 HOLLY LANE
K1V 7P2**

**MINISTRY OF ENVIRONMENT
& ENERGY
OCT 30 1995**

**FROM: FRANK LICARI
OHS & ENVIRONMENTAL AFFAIRS MANAGER
OTTAWA CITIZEN
1101 BAXTER ROAD
OTTAWA, ONT.
K2C 3M4**

OTTAWA

Dear Bryan:

The Ottawa Citizen will be changing existing fluorescent light fixtures, on a need be basis. The ballast's in some of the fixtures contain a small quantity of PCB's.

The Citizen is applying for an additional waste storage number to store the lighting ballast's that contain PCB's, on site at 1101 Baxter Road. Our current generator registration number is ON0170700.

I request documentation allowing the Citizen to exceed the 90 day storage time frame. Our estimation is that it could take in excess of a year or two to fill a 45 gallon drum with lighting ballast's, that would be shipped to the appropriate site in Western Canada. The Citizen will take the necessary precautions in storing the lighting ballast's to remain in compliance with current legislation.

Should you require further information please contact the undersigned by telephoning 596-8420.

Thank you for your assistance.

Sincerely

Frank J. Licari
OHS, Environmental Affairs Manager

Trans-Cycle Industries, Ltd.
455 Archer Drive, PO Box 518
Kirkland Lake, Ontario
P2N 3J5
Tel (705) 567 9997
Fax (705) 567 9979

SI-00-07-BA-631
(new)



FAX TRANSMISSION

Date: April 1, 2008
Company: Ministry of the Environment
Duty Officer
From: Trans-Cycle Industries, Ltd. / Bennett Environmental Inc.
Chantal Murphy
Phone: 613-938-7575 ext 222
Fax #: 613-938-0660
Pages: 2 (including this cover page)

Subject: Proposed PCB Waste Transfer

Please be advised of the proposed PCB Waste Transfers as described on the following pages.

If you have any questions, please call our office.

*Only pre-notification is required.
No Director's Instructions are required.*


Kindest Regards,

A handwritten signature in cursive script, appearing to read 'C Murphy', is written over the printed name.

Chantal Murphy

This fax transmission is intended for the recipient listed above. If you receive this fax in error, please contact Trans-Cycle Industries, Ltd. as soon as possible and destroy the copy received. Thank you.

**Proposal for PCB Waste Transfer
Waste Class 243D**

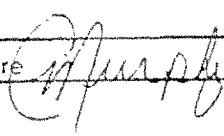PCB Owner	Ontario PCB Site Number:		Generator Registration Number: ON0170700		
	Company Name: Ottawa Citizen & Canwest Media Works Publication				
	Contact Name: Jim Halloran - Waste Care Services				
	Address: 1101 Baxter Road Ottawa, ON K2C 3M4				
	Shipping Address: As Above				
	Phone #: 613-443-7788		Fax #: 		
Carrier	Waste Management System C of A #: A821223				
	Company Name: Trans-Cycle Industries Ltd.				
	Contact Name: Don Dekker				
	Address: P.O. Box 518, Kirkland Lake ON P2N 3J5				
	Phone #: (705) 567-9997		Fax #: (705) 567-9979		
Date PCB Waste is Proposed to leave PCB Owner's Site:			April 7, 2008 - April 30, 2008		
Date PCB Waste is Proposed to arrive at the Receiving Site:			April 7, 2008 - April 30, 2008		
Receiving Site	Waste Disposal Site C of A #: A420011		Generator Registration Number:		
	Company Name: Material Resource Recovery				
	Contact Name: Chantal Murphy				
	Address: 2425 Industrial Park Drive Cornwall, ON K6H 5T5				
	Phone #: (613) 938-7575		Fax #: (613) 938-0660		
Waste Quantities & Types Being Shipped	Liquids		High Level	Low Level	Low Level
			(over 10,000 ppm)	(50-10,000 ppm)	(<50 ppm)
	a.	Bulk Liquid	Litres	Litres	Litres
		Transformers	No. of Kgs	No. of Transformers	
		Total liquid in transformers	Litres	Litres	Litres
	Solids				
	Capacitors	a. Ballasts	No. of Kgs.	120	
		b. Other capacitors	No. of Kgs.		
		c. Total weight capacitors/Residuals/	No. of Kgs.		
	Soil/Gravel	d. Soil and gravel	No. of drums	No. of drums	
		e. Total weight not in drums	Kg	Kg	Kg
	Other Solids	f. Clothing, tools, equipment,	No. of Kgs.	No. of drums	
		g. Total weight not in drums (PCB kits)	Kg	Kg	Kg
	Comments				
	Name: Chantal Murphy		Signature: 		Date: April 1, 2008

Trans-Cycle Industries, Ltd.
455 Archer Drive, PO Box 518
Kirkland Lake, Ontario
P2N 3J5
Tel (705) 567 9997
Fax (705) 567 9979



FAX TRANSMISSION

Date: April 1, 2008
Company: Ministry of the Environment
Duty Officer
From: Trans-Cycle Industries, Ltd. / Bennett Environmental Inc.
Chantal Murphy
Phone: 613-938-7575 ext 222
Fax #: 613-938-0660
Pages: ~~2~~ 1 (including this cover page)

Subject: Proposed PCB Waste Transfer

Please be advised of the proposed PCB Waste Transfers as described on the following pages.

If you have any questions, please call our office.


Kindest Regards,

A handwritten signature in cursive script, appearing to read 'C Murphy', is written above the printed name 'Chantal Murphy'.

Chantal Murphy

This fax transmission is intended for the recipient listed above. If you receive this fax in error, please contact Trans-Cycle Industries, Ltd. as soon as possible and destroy the copy received. Thank you.

**Proposal for PCB Waste Transfer
Waste Class 243D**

PCB Owner	Ontario PCB Site Number:		Generator Registration Number: ON0170700		
	Company Name: Ottawa Citizen & Canwest Media Works Publication				
	Contact Name: Jim Halloran - Waste Care Services				
	Address: 1101 Baxter Road Ottawa, ON K2C 3M4				
	Shipping Address: As Above				
	Phone #: 613-443-7788		Fax #: 		
Carrier	Waste Management System C of A #: A821223				
	Company Name: Trans-Cycle Industries Ltd.				
	Contact Name: Don Dekker				
	Address: P.O. Box 518, Kirkland Lake ON P2N 3J5				
	Phone #: (705) 567-9997		Fax #: (705) 567-9979		
Date PCB Waste is Proposed to leave PCB Owner's Site: April 7, 2008 - April 30, 2008					
Date PCB Waste is Proposed to arrive at the Receiving Site: April 7, 2008 - April 30, 2008					
Receiving Site	Waste Disposal Site C of A #: A420011		Generator Registration Number: 		
	Company Name: Material Resource Recovery				
	Contact Name: Chantal Murphy				
	Address: 2425 Industrial Park Drive Cornwall, ON K6H 5T5				
	Phone #: (613) 938-7575		Fax #: (613) 938-0660		
Waste Quantities & Types Being Shipped	Liquids		High Level	Low Level	Low Level
			(over 10,000 ppm)	(50-10,000 ppm)	(<40 ppm)
	a. Bulk Liquid		Litres	Litres	Litres
		b. Transformers	No. of Kgs	No. of Transformers	
			c. Total liquid in transformers		Litres
	Solids				
	Capacitors	a. Ballasts	No. of Kgs.	120	
		b. Other capacitors	No. of Kgs.		
		c. Total weight capacitors/Residuals/	No. of Kgs.		
	Soil/Gravel	d. Soil and gravel	No. of drums	No. of drums	
		e. Total weight not in drums	Kg	Kg	Kg
	Other Solids	f. Clothing, tools, equipment,	No. of Kgs	No. of drums	
		g. Total weight not in drums (PCB kits)	Kg	Kg	Kg
	Comments				
	Name: Chantal Murphy Signature:  Date: April 1, 2008				

SI OC OT BA.631

Ministry of
Environment
and Energy

OCCURRENCE REPORT
=====

Entered: 2001/04/24 13:40 ✓
Batch : 2001/04/24
Abstracts[00] Diaries[00]

PAGE: 1

Received By
CAROL BOOTH

ORIS No.
9940007350

I.E.B. No.

Occurrence Type: OTHER
Subtype: OTHER

Work Plan
[WH]

Occurrence: 2001/04/24

Date
Time

Reported by (Name/Organization)

Report to MOE:2001/04/24 00:00
MOE at Scene:

WASTE CARE SERVICES LTD.
Telephone No. Alternate No.
613-821-4695 X
Address:
6137 GOUER ROAD
MANOTICK, ONTARIO
Postal Code: K4M 1P2

Assigned To:
BRYAN DICKMAN

ERP Contacted:
Callout: [] NSP: []
ERP Name:

Location of Occurrence:
OTTAWA CITY
1101 BAXTER RD., ONTARIO K2C 3M4

Source:
THE OTTAWA CITIZEN

SOUTHEAST OTTAWA
Reg.[4] Dist.[OT] Municipality[20107]

Sector: [] Source: [] SIC: []
UTM:
N: [] E: [] Zone: []

Syn:ISSUED EMERGENCY GENERATOR NUMBER

Brief Summary:

ISSUED EMERGENCY GENERATOR NUMBER FOR MANIFEST: MM98979-8, FOR WASTE CLASS
NUMBER 148A: WASTE(MERCURY COMPOUNDS NOS "LIQUID").

closed
[Signature]

If there are related reports, record initial/master ORIS No. here>>

Follow-up Action: [X] Abatement [] IEB [] Other _____ |BF Date:

File Closed:
[Y] Abatement [] IEB [] OTHER Complainant Contact Date Suspected
[] Code [] [] [] [] [] Violation

Report Prepared by: CAROL BOOTH Date 2001/04/24 IEB Investigator IEB BF Date

Approving Officer PAUL KEHOE Date 2001/04/24 Reviewing Officer Date

Specify number(s) for routing original [] [] [] [] Continued [] Yes
Specify number(s) for copy distribution [] [] [] [] []
1. Investigator/E.O. 2. D.O./File 3. SAC (initial spills)
4. Reg.Dir./_____Mgr. 5. IEB Reg.Spv 6. IEB H.O./file 7. Other _____

SAC Action Class: 1:[] 2:[]



Ministry
of the
Environment

Emergency Waste Shipment Authorization

Emergency Generator Number (Use on Manifest)

0NS0402B

MOE Reference Number

9940001350

CARRIER FAX# 613-821-2406

Generator

Company Name THE OTTAWA CITIZEN		MOE Generator Number (if registered) ANO170700
Head Office Address SAME		
City	Province	Postal Code
Site Address 1101 BAXTER RD.		
City OTTAWA	Province ONT.	Postal Code K2C 3M4
Contact Name BRUCE DAW		Tel. No. (613) 596-3583

Manifest No. MM98979-8	Date of Removal 4-24-01

Carrier

Certificate of Approval No. A861099		
Company Name WASTE CARE SERVICES LTD.		
Address 6137 GOUGH RD.		Tel. No. (613) 821-4685
City MANOTICK	Province ONT.	Postal Code K4M 1B2

Receiver

Certificate of Approval No. A460722				
Company Name DRAIN ALL LTD.				
Address 2705 STEVENAGE DR.				
City GLoucester	Province ONT	Postal Code K1G 3N2		
Waste Class	Waste Description	Quantity	Units	Physical State
1.4.1.8.A	MERCURY COMPOUNDS NOS LIQUID	0.5	KG	L
Reason ☐ Soil ☒ One Time Disposal Explain Reason: MERCURY SWITCHES FOR DISPOSAL				

Signatures

Company Official (R/M) J. Halloran	Signature <i>[Signature]</i>	Date 4-23-01
MOE Authorized Official (R/M) B. DICKMAN	Signature <i>[Signature]</i>	Date Apr 24/01

0350 (01/99)

ENVIRONMENTAL MONITORING AND REPORTING BRANCH

Jeremy Camposarcone

From: Public Information Services <publicinformationsservices@tssa.org>
Sent: Tuesday, August 26, 2025 12:57 PM
To: Jeremy Camposarcone
Subject: RE: PE7221 - Records Search Request

External Email: Do not click on links or open attachments unless you trust the sender.

RECORD FOUND IN CURRENT DATABASE

Hello,

Thank you for your request for confirmation of public information. TSSA has performed a preliminary search of TSSA’s current database.

- We confirm that there are records in our current database of any fuel storage tanks at the subject address(es).

Inventory Number	Address	City	Province	Postal Code	Reason Code	Asset Type / Inventory Item
10900976	1101 BAXTER RD	OTTAWA	ON	K2C 3M4	EXPIRED	FS LIQUID FUEL TANK
10900991	1101 BAXTER RD	OTTAWA	ON	K2C 3M4	EXPIRED	FS LIQUID FUEL TANK
9235519	1101 BAXTER RD	OTTAWA	ON	K2C 3M4	EXPIRED	FS PRIVATE FUEL OUTLET - SELF SERVE

Accessing the applications

1. Click [Request a Public Record](#) - TSSA and click “need a copy of a document”
2. Select the appropriate application, download it, complete it in full and save it (Note: you will have to upload the application)
3. Proceed to page 3 of the application and click the “TSSA Service Prepayment Portal” link under payment options (the link will take you the secure site where you can pay for the request via credit card)

Accessing the Service Prepayment Portal

1. Select new or existing customer (*if you are an existing customer, you will need your account number & postal code to access your account)
2. Under “Program Area” select **Public Information** and click continue
3. Enter application form number (found on the bottom left corner of the application form) and click continue
4. Complete the primary contact information section
5. Complete the fee section
6. Upload your completed application
7. Upload supporting documents (if required) and click continue

Once all steps have been successfully completed you will receive your payment receipt via email.

TSSA does not make any representations or warranties with respect to the accuracy or completeness of any records released. The requestor assumes all risk in using or relying on the information provided.

If you have any questions or concerns, please do not hesitate to contact our Public Information Release team at publicinformationsservices@tssa.org.

Kind regards,

From: Jeremy Camposarcone <JCamposarcone@patersongroup.ca>
Sent: Tuesday, August 26, 2025 12:10 PM
To: Public Information Services <publicinformationservices@tssa.org>
Subject: PE7221 - Records Search Request

[CAUTION]: This email originated outside the organisation.
Please do not click links or open attachments unless you recognise the source of this email and know the content is safe.

Hello,

Could you please complete a search of your records for **underground/aboveground storage tanks, historical spills, or other incidents/infractions** for the following addresses in Ottawa, Ontario:

Baxter Road: 1080, 1090, 1101, 1119, 1121, 1127, 1129, 1050, 1051;
Iris Street: 2685.

Best Regards,



Jeremy Camposarcone, P.Eng.
Project Manager - Environmental

TEL: (613)-226-7381
CELL: (343)-999-7255

9 AURIGA DRIVE
OTTAWA ON K2E 7T9
patersongroup.ca

TEMPORARY SHORING DESIGN SERVICES ARE NOW AVAILABLE, PLEASE CONTACT US TO SEE HOW WE CAN HELP!

NEW OFFICE OPEN IN THE GREATER TORONTO AREA WITH OUR EXPANSIVE LIST OF SERVICES NOW AVAILABLE!

This electronic message and any attached documents are intended only for the named recipients. This communication from the Technical Standards and Safety Authority may contain information that is privileged, confidential or otherwise protected from disclosure and it must not be disclosed, copied, forwarded or distributed without authorization. If you have received this message in error, please notify the sender immediately and delete the original message.

Office Use Only

Application Number: _____	Ward Number: _____	Application Received: (dd/mm/yyyy): _____
Client Service Centre Staff: _____	Fee Received: \$	



Historic Land Use Inventory

Application Form

Notice of Public Record

All information and materials required in support of your application shall be made available to the public, as indicated by Section 1.0.1 of *The Planning Act*, R.S.O. 1990, C.P.13.

Municipal Freedom of Information and Protection Act

Personal information on this form is collected under the authority the *Planning Act*, RSO 1990, c. P. 13 and will be used to process this application. Questions about this collection may be directed by mail to Manager, Business and Technical Support Services, Planning, Development and Building Services Department, 110 Laurier Avenue West, Ottawa, K1P 1J1, or by phone at (613) 580-2424, ext. 52815.

Background Information

***Site Address or Location:**

1101 Baxter Road

** Mandatory Field*

*Applicant/Agent Information:

Company name:

Paterson Group

Contact name:

Jeremy Camposarcone

Mailing Address:

9 Auriga Drive, Ottawa, ON, K2E 7T9

Telephone:

Email Address:

jcamposarcone@patersongroup.ca

*Registered Property Owner Information:

☐ Same as above

Name:

Baxter Regional Inc.

Mailing Address:

1737 Woodward Drive, Ottawa, ON, K2C 0P9

Telephone:

Email Address:

egarfinkel@regionalgroup.com

Site Details

Legal Description
and PIN:

Part of Blocks G and H - Registered Plan 383389, City of Ottawa
PIN - 03956-0003

What is the land
currently used for?

Commercial

Lot frontage: m Lot depth: m Lot area: m²

OR Lot area: (irregular lot) 32000 m²

Does the site have Full Municipal Services: ☒ Yes ☐ No

Required Fees

Please don't hesitate to visit the [Historic Land Use Inventory website](#) more information. Fees must be paid in full at the time of application submission.

Planning Fee

\$196.00

Submittal Requirements

The following are required to be submitted with this application:

- 1. Consent to Disclose Information:** Consultants and other third parties may make requests for information on behalf of an individual or corporation. However, if the requester is not the owner of the property, **the requester must provide the City of Ottawa with a 'consent to disclose information' letter, signed by the property owner.** This will authorize the City of Ottawa to release any relevant information about the property or its owner(s) to the requester. Consent for disclosure is required in the event that personal information or proprietary company information is found concerning the property and its owner. All consents must clearly indicate the name of the property owner as well as the name of the requester, and must be signed and dated.
- 2. Disclaimer:** Requesters must read and understand the conditions included in the attached disclaimer and submit a signed disclaimer to the City of Ottawa's Planning, Development and Building Services Department. This disclaimer is related to the Historic Land Use Inventory and must be received by the City of Ottawa, signed and dated by the requestor, before the process can begin.
- 3. A site plan or key plan of the property, its location and particular features.**
- 4. Any significant dates or time frames that you would like researched.**

Disclaimer
For use with HLUI Database

CITY OF OTTAWA ("the City") is the owner of the Historical Land Use Inventory ("HLUI"), a database of information on the type and location of land uses within the geographic area of Ottawa, which had or have the potential to cause contamination in soil, groundwater or surface water.

The City, in providing information from the HLUI, to Paterson Group ("the Requester") does so only under the following conditions and understanding:

1. The HLUI may contain erroneous information given that such records and sources of information may be flawed. Changes in municipal addresses over time may have introduced error in such records and sources of information. The City is not responsible for any errors or omissions in the HLUI and reserves the right to change and update the HLUI without further notice. The City does not, however, make any commitment to update the HLUI. Accordingly, all information from the HLUI is provided on an "as is" basis with no representation or warranty by the City with respect to the information's accuracy or exhaustiveness in responding to the request.
2. City staff will perform a search of the HLUI based on the information given by the Requester. City staff will make every effort to be accurate, however, the City does not provide an assurance, guarantee, warranty, representation (express or implied), as to the availability, accuracy, completeness or currency of information which will be provided to the Requester. The HLUI in no way confirms the presence or absence of contamination or pollution of any kind. The information provided by the City to the Requester is provided on the assumption that it will not be relied upon by any person whatsoever. The City denies all liability to any such persons attempting to rely on any information provided from the HLUI database.
3. The City, its employees, servants, agents, boards, officials or contractors take no responsibility for any actions, claims, losses, liability, judgments, demands, expenses, costs, damages or harm suffered by any person whatsoever including negligence in compiling or disseminating information in the HLUI.
4. Copyright is reserved to the City.
5. Any use of the information provided from the HLUI which a third party makes, or any reliance on or decisions to be based on it, are the responsibilities of such third parties. The City, its employees, servants, agents, boards, officials or contractors accept no responsibility for any damages, if any, suffered by a third party as a result of decisions made as a result of an information search of the HLUI.
6. Any use of this service by the Requestor indicates an acknowledgement, acceptance and limits of this disclaimer.
7. All information collected under this request and all records provided in response to this request are subject to the provisions of the Municipal Freedom of Information and Protection of Privacy Act, R.S.O. 1990, c. M.56, as amended.

Signed: _____

Dated (dd/mm/yyyy): 03/10/2025

Per: Jeremy Camposarcone
(Please print name)

Title: Project Manager -

Company: Paterson Group



DATABASE REPORT

Project Property:	<i>Phase I ESA Update 1101 Baxter Road Ottawa ON K2C 1M1 P.O.63888 / PE7221</i>
Project No:	<i>P.O.63888 / PE7221</i>
Report Type:	<i>RSC Report - Quote</i>
Order No:	<i>25082500253</i>
Requested by:	<i>Paterson Group Inc.</i>
Date Completed:	<i>October 2, 2025</i>

Environmental Risk Information Services

A division of Glacier Media Inc.

1.866.517.5204 | info@erisinfo.com | erisinfo.com

Table of Contents

Table of Contents.....	2
Executive Summary.....	3
Executive Summary: Report Summary.....	4
Executive Summary: Site Report Summary - Project Property.....	7
Executive Summary: Site Report Summary - Surrounding Properties.....	13
Executive Summary: Summary By Data Source.....	36
Map.....	70
Aerial.....	71
Topographic Map.....	72
Detail Report.....	73
Unplottable Summary.....	459
Unplottable Report.....	462
Appendix: Database Descriptions.....	488
Definitions.....	498

Notice: IMPORTANT LIMITATIONS and YOUR LIABILITY

Reliance on information in Report: This report DOES NOT replace a full Phase I Environmental Site Assessment but is solely intended to be used as a database review of environmental records.

License for use of information in Report: No page of this report can be used without this cover page, this notice and the project property identifier. The information in Report(s) may not be modified or re-sold.

Your Liability for misuse: Using this Service and/or its reports in a manner contrary to this Notice or your agreement will be in breach of copyright and contract and ERIS may obtain damages for such mis-use, including damages caused to third parties, and gives ERIS the right to terminate your account, rescind your license to any previous reports and to bar you from future use of the Service.

No warranty of Accuracy or Liability for ERIS: The information contained in this report has been produced by ERIS Information Limited Partnership ("ERIS") using various sources of information, including information provided by Federal and Provincial government departments. The report applies only to the address and up to the date specified on the cover of this report, and any alterations or deviation from this description will require a new report. This report and the data contained herein does not purport to be and does not constitute a guarantee of the accuracy of the information contained herein and does not constitute a legal opinion nor medical advice. Although ERIS has endeavored to present you with information that is accurate, ERIS disclaims, any and all liability for any errors, omissions, or inaccuracies in such information and data, whether attributable to inadvertence, negligence or otherwise, and for any consequences arising therefrom. Liability on the part of ERIS is limited to the monetary value paid for this report.

Trademark and Copyright: You may not use the ERIS trademarks or attribute any work to ERIS other than as outlined above. This Service and Report (s) are protected by copyright owned by ERIS Information Limited Partnership. Copyright in data used in the Service or Report(s) (the "Data") is owned by ERIS or its licensors. The Service, Report(s) and Data may not be copied or reproduced in whole or in any substantial part without prior written consent of ERIS.

Executive Summary

Property Information:

Project Property: *Phase I ESA Update
1101 Baxter Road Ottawa ON K2C 1M1*

Project No: *P.O.63888 / PE7221*

Order Information:

Order No: *25082500253*

Date Requested: *August 25, 2025*

Requested by: *Paterson Group Inc.*

Report Type: *RSC Report - Quote*

Historical/Products:

ERIS Xplorer [*ERIS Xplorer*](#)

Executive Summary: Report Summary

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.30km</i>	<i>Total</i>
AAGR	Abandoned Aggregate Inventory	Y	0	0	0
AGR	Aggregate Inventory	Y	0	0	0
AMIS	Abandoned Mine Information System	Y	0	0	0
ANDR	Anderson's Waste Disposal Sites	Y	0	0	0
AST	Aboveground Storage Tanks	Y	0	0	0
AUWR	Automobile Wrecking & Supplies	Y	0	0	0
BORE	Borehole	Y	0	1	1
CA	Certificates of Approval	Y	2	8	10
CDRY	Dry Cleaning Facilities	Y	0	0	0
CFOT	Commercial Fuel Oil Tanks	Y	0	0	0
CHEM	Chemical Manufacturers and Distributors	Y	0	0	0
CHM	Chemical Register	Y	0	0	0
CNG	Compressed Natural Gas Stations	Y	0	0	0
COAL	Inventory of Coal Gasification Plants and Coal Tar Sites	Y	0	0	0
CONV	Compliance and Convictions	Y	0	0	0
CPU	Certificates of Property Use	Y	0	0	0
DRL	Drill Hole Database	Y	0	0	0
DTNK	Delisted Fuel Tanks	Y	3	3	6
EASR	Environmental Activity and Sector Registry	Y	0	2	2
EBR	Environmental Registry	Y	1	2	3
ECA	Environmental Compliance Approval	Y	2	5	7
EEM	Environmental Effects Monitoring	Y	0	0	0
EHS	ERIS Historical Searches	Y	4	23	27
EIIS	Environmental Issues Inventory System	Y	0	0	0
EMHE	Emergency Management Historical Event	Y	0	0	0
EPAR	Environmental Penalty Annual Report	Y	0	0	0
EXP	List of Expired Fuels Safety Facilities	Y	2	2	4
FCON	Federal Convictions	Y	0	0	0
FCS	Contaminated Sites on Federal Land	Y	0	0	0
FOFT	Fisheries & Oceans Fuel Tanks	Y	0	0	0
FRST	Federal Identification Registry for Storage Tank Systems (FIRSTS)	Y	0	0	0
FST	Fuel Storage Tank	Y	0	3	3
FSTH	Fuel Storage Tank - Historic	Y	0	2	2
GEN	Ontario Regulation 347 Waste Generators Summary	Y	16	125	141
GHG	Greenhouse Gas Emissions from Large Facilities	Y	0	0	0
HINC	TSSA Historic Incidents	Y	0	0	0

Database	Name	Searched	Project Property	Boundary to 0.30km	Total
IAFT	Indian & Northern Affairs Fuel Tanks	Y	0	0	0
INC	Fuel Oil Spills and Leaks	Y	0	1	1
LIMO	Landfill Inventory Management Ontario	Y	0	0	0
MINE	Canadian Mine Locations	Y	0	0	0
MNR	Mineral Occurrences	Y	0	0	0
NATE	National Analysis of Trends in Emergencies System (NATES)	Y	0	0	0
NCPL	Non-Compliance Reports	Y	0	0	0
NDFT	National Defense & Canadian Forces Fuel Tanks	Y	0	0	0
NDSP	National Defense & Canadian Forces Spills	Y	0	0	0
NDWD	National Defence & Canadian Forces Waste Disposal Sites	Y	0	0	0
NEBI	National Energy Board Pipeline Incidents	Y	0	0	0
NEBP	National Energy Board Wells	Y	0	0	0
NEES	National Environmental Emergencies System (NEES)	Y	0	0	0
NPCB	National PCB Inventory	Y	1	0	1
NPR2	National Pollutant Release Inventory	Y	1	0	1
NPRI	National Pollutant Release Inventory - Historic	Y	0	2	2
OGWE	Oil and Gas Wells	Y	0	0	0
OOGW	Ontario Oil and Gas Wells	Y	0	0	0
OPCB	Inventory of PCB Storage Sites	Y	5	0	5
ORD	Orders	Y	0	0	0
PAP	Canadian Pulp and Paper	Y	0	0	0
PCFT	Parks Canada Fuel Storage Tanks	Y	0	0	0
PES	Pesticide Register	Y	0	4	4
PFAS	Ontario PFAS Spills	Y	0	1	1
PFCH	NPRI Reporters - PFAS Substances	Y	0	0	0
PFHA	Potential PFAS Handlers from NPRI	Y	0	0	0
PINC	Pipeline Incidents	Y	0	1	1
PPHA	Potential PFAS Handlers from EASR	Y	0	0	0
PRT	Private and Retail Fuel Storage Tanks	Y	1	2	3
PTTW	Permit to Take Water	Y	0	0	0
REC	Ontario Regulation 347 Waste Receivers Summary	Y	0	0	0
RSC	Record of Site Condition	Y	0	0	0
RST	Retail Fuel Storage Tanks	Y	0	0	0
SCT	Scott's Manufacturing Directory	Y	5	13	18
SPL	Ontario Spills	Y	3	43	46
SRDS	Wastewater Discharger Registration Database	Y	0	0	0
TANK	Anderson's Storage Tanks	Y	0	0	0
TCFT	Transport Canada Fuel Storage Tanks	Y	0	0	0
VAR	Variances for Abandonment of Underground Storage Tanks	Y	0	0	0
WDS	Waste Disposal Sites - MOE CA Inventory	Y	0	0	0

<i>Database</i>	<i>Name</i>	<i>Searched</i>	<i>Project Property</i>	<i>Boundary to 0.30km</i>	<i>Total</i>
WDSH	Waste Disposal Sites - MOE 1991 Historical Approval Inventory	Y	0	0	0
WWIS	Water Well Information System	Y	7	44	51
Total:			53	287	340

Executive Summary: Site Report Summary - Project Property

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>1</u>	CA	Ottawa Citizen Group Inc.	1101 Baxton Road Ottawa ON	E/0.0	-0.85	<u>73</u>
<u>1</u>	CA	Ottawa Citizen Group Inc.	1101 Baxter Rd Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>73</u>
<u>1</u>	DTNK	THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON	E/0.0	-0.85	<u>73</u>
<u>1</u>	DTNK	THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON	E/0.0	-0.85	<u>74</u>
<u>1</u>	DTNK	THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON	E/0.0	-0.85	<u>74</u>
<u>1</u>	EBR	Ottawa Citizen Group Inc.	1101 Baxter Road Ottawa CITY OF OTTAWA ON	E/0.0	-0.85	<u>75</u>
<u>1</u>	ECA	Ottawa Citizen Group Inc.	1101 Baxter Rd Ottawa ON K2C 3M4	E/0.0	-0.85	<u>76</u>
<u>1</u>	ECA	Ottawa Citizen Group Inc.	1101 Baxton Road Ottawa ON	E/0.0	-0.85	<u>76</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev diff (m)</i>	<i>Page Number</i>
<u>1</u>	EHS		1101 Baxter Rd Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>76</u>
<u>1</u>	EHS		1101 Baxter Road Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>76</u>
<u>1</u>	EHS		1101 Baxter Rd Ottawa ON K2C3Z3	E/0.0	-0.85	<u>77</u>
<u>1</u>	EHS		1101 baxter road Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>77</u>
<u>1</u>	EXP	THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON	E/0.0	-0.85	<u>77</u>
<u>1</u>	EXP	THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON	E/0.0	-0.85	<u>77</u>
<u>1</u>	GEN	OTTAWA CITIZEN, THE	1101 BAXTER ROAD P.O. BOX 5020 OTTAWA ON K2C 3Z3	E/0.0	-0.85	<u>78</u>
<u>1</u>	GEN	OTTAWA CITIZEN, THE 10-062	1101 BAXTER ROAD OTTAWA ON K2C 3M4	E/0.0	-0.85	<u>78</u>
<u>1</u>	GEN	OTTAWA CITIZEN, THE	1101 BAXTER ROAD OTTAWA ON K2C 3M4	E/0.0	-0.85	<u>79</u>
<u>1</u>	GEN	OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3M4	E/0.0	-0.85	<u>81</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>1</u>	GEN	OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>82</u>
<u>1</u>	GEN	OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>83</u>
<u>1</u>	GEN	OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>85</u>
<u>1</u>	GEN	OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>86</u>
<u>1</u>	GEN	OTTAWA CITIZEN	1101 Baxter Road Ottawa ON	E/0.0	-0.85	<u>88</u>
<u>1</u>	GEN	OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3M4	E/0.0	-0.85	<u>89</u>
<u>1</u>	GEN	OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3M4	E/0.0	-0.85	<u>91</u>
<u>1</u>	GEN	OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3M4	E/0.0	-0.85	<u>92</u>
<u>1</u>	GEN	OTTAWA CITIZEN Postmedia Network Inc	1101 Baxter Road Ottawa ON K2C 3M4	E/0.0	-0.85	<u>94</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>1</u>	GEN	OTTAWA CITIZEN Postmedia Network Inc	1101 Baxter Road Ottawa ON K2C 3M4	E/0.0	-0.85	<u>95</u>
<u>1</u>	GEN	OTTAWA CITIZEN Postmedia Network Inc	1101 Baxter Road Ottawa ON K2C 3M4	E/0.0	-0.85	<u>96</u>
<u>1</u>	GEN	OTTAWA CITIZEN	Ottawa Citizen, PO Box 5020, 1101 Baxter Road Ottawa ON	E/0.0	-0.85	<u>97</u>
<u>1</u>	NPCB	OTTAWA CITIZEN	1101 BAXTER ROAD OTTAWA ON K2C 3Z3	E/0.0	-0.85	<u>103</u>
<u>1</u>	NPR2	THE OTTAWA CITIZEN	1101 BAXTER ROAD OTTAWA ON K2C3M4	E/0.0	-0.85	<u>103</u>
<u>1</u>	OPCB	OTTAWA CITIZEN	1101 BAXTER ROAD, BOX 5020 OTTAWA ON K2C 3Z3	E/0.0	-0.85	<u>127</u>
<u>1</u>	OPCB	OTTAWA CITIZEN	1101 BAXTER ROAD OTTAWA ON K2C 3Z3	E/0.0	-0.85	<u>127</u>
<u>1</u>	OPCB	OTTAWA CITIZEN	1101 BAXTER ROAD OTTAWA ON K2C 3Z3	E/0.0	-0.85	<u>127</u>
<u>1</u>	OPCB	OTTAWA CITIZEN	1101 BAXTER ROAD OTTAWA ON K2C 3Z3	E/0.0	-0.85	<u>128</u>
<u>1</u>	OPCB	OTTAWA CITIZEN	1101 BAXTER ROAD, BOX 5020 OTTAWA ON K2C 3Z3	E/0.0	-0.85	<u>128</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
<u>1</u>	PRT	THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON K2C 3Z3	E/0.0	-0.85	<u>12</u>
<u>1</u>	SCT	SOUTHAM NEWSPAPER GROUP	1101 BAXTER RD OTTAWA ON K2C 3Z3	E/0.0	-0.85	<u>12</u>
<u>1</u>	SCT	SOUTHAM NEWSPAPER GROUP	1101 BAXTER RD OTTAWA ON K2C 3Z3	E/0.0	-0.85	<u>12</u>
<u>1</u>	SCT	Southam Publications Inc. - A CanWest Company - The Ottawa Citizen	1101 Baxter Rd Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>129</u>
<u>1</u>	SCT	CanWest Publications Inc. - The Ottawa Citizen - A CanWest Company	1101 Baxter Rd Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>129</u>
<u>1</u>	SCT	Ottawa Citizen	1101 Baxter Rd Ottawa ON K2C 3Z3	E/0.0	-0.85	<u>129</u>
<u>1</u>	SPL	TRANSPORT TRUCK	1101 BAXTER ROAD THE OTTAWA CITIZEN MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON K2C 3Z3	E/0.0	-0.85	<u>12</u>
<u>1</u>	SPL	OTTAWA CITIZEN, THE	1101 BAXTER RD PARKING LOT OTTAWA PLANT 1101 BAXTER ROAD OTTAWA CITY ON K2C 3Z3	E/0.0	-0.85	<u>13</u>
<u>1</u>	SPL	OTTAWA CITIZEN, THE	1101 BAXTER ROAD OTTAWA PLANT 1101 BAXTER ROAD OTTAWA CITY ON K2C 3Z3	E/0.0	-0.85	<u>13</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev diff (m)	Page Number
2	WWIS		1011 BAXTER RD Ottawa ON <i>Well ID:</i> 7318227	E/0.0	0.16	132
3	WWIS		1011 BAXTER RD lot 22 con 2 Ottawa ON <i>Well ID:</i> 7318233	E/0.0	0.16	135
4	WWIS		1011 BAXTER RD lot 22 con 2 Ottawa ON <i>Well ID:</i> 7318228	E/0.0	0.12	139
5	WWIS		1011 BAXTER RD lot 22 con 2 Ottawa ON <i>Well ID:</i> 7318229	E/0.0	0.12	142
6	WWIS		1011 BAXTER RD lot 22 con 2 Ottawa ON <i>Well ID:</i> 7318230	E/0.0	0.12	145
7	WWIS		1101 bayter rd Ottawa ON <i>Well ID:</i> 7328635	ENE/2.0	0.21	149
8	WWIS		1101 BAXTER RD Ottawa ON <i>Well ID:</i> 7328598	SSW/0.0	0.16	152

Executive Summary: Site Report Summary - Surrounding Properties

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
9	WWIS		1051 Baxter Rd Ottawa ON Well ID: 7382664	ENE/6.9	-0.88	155
10	WWIS		1051 Baxter Rd Ottawa ON Well ID: 7382713	NE/11.3	-0.82	158
11	WWIS		1050 BAXTER RD Ottawa ON Well ID: 7231534	ENE/11.9	0.21	161
12	WWIS		1051 Baxter Rd Ottawa ON Well ID: 7382714	E/12.9	0.15	164
13	WWIS		1099 BAXTER ST Ottawa ON Well ID: 7232100	SSW/30.4	1.15	167
14	EHS		Highway 417 Ottawa ON	WNW/56.1	-1.85	171
15	EBR	exp Services Inc.	1051 Baxter Road Ottawa K2C 1H3 CITY OF OTTAWA ON	ENE/62.7	0.24	171
15	ECA	exp Services Inc.	1051 Baxter Rd Ottawa ON L6V 1V2	ENE/62.7	0.24	172
15	EHS		1051 Baxter Rd. Ottawa ON K2C 3P2	ENE/62.7	0.24	172
15	GEN	MICROMEASUREMENTS CANADA INC.	1051 BAXTER ROAD OTTAWA ON K2C 3P2	ENE/62.7	0.24	172
15	GEN	MICROMEASUREMENTS CANADA INC. 26-496	1051 BAXTER ROAD OTTAWA ON K2C 3P2	ENE/62.7	0.24	172
15	GEN	Optelian Access Networks	22A-1051 Baxter Road Ottawa ON K2C 3P2	ENE/62.7	0.24	173

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>15</u>	GEN	Optelian Access Networks	22A-1051 Baxter Road Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>174</u>
<u>15</u>	GEN	Optelian Access Networks	22A-1051 Baxter Road Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>174</u>
<u>15</u>	GEN	Optelian Access Networks	22A-1051 Baxter Road Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>174</u>
<u>15</u>	GEN	exp Services Inc.	1051 Baxter Road Unit 21A Ottawa ON	ENE/62.7	0.24	<u>175</u>
<u>15</u>	GEN	exp Services Inc.	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>175</u>
<u>15</u>	GEN	exp Services Inc.	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>176</u>
<u>15</u>	GEN	exp Services Inc.	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>176</u>
<u>15</u>	GEN	exp Services Inc. Geotechnical and Materials Testing	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>177</u>
<u>15</u>	GEN	exp Services Inc. Geotechnical and Materials Testing	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>177</u>
<u>15</u>	GEN	exp Services Inc. Geotechnical and Materials Testing	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>178</u>
<u>15</u>	GEN	exp Services Inc.	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>179</u>
<u>15</u>	GEN	HW Health & Sports Science Centre	1051 Baxter Road Ottawa ON	ENE/62.7	0.24	<u>182</u>
<u>15</u>	GEN	exp Services Inc.	1051 Baxter Road Ottawa ON	ENE/62.7	0.24	<u>182</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>15</u>	SCT	Dipix Technologies Inc.	1051 Baxter Rd Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>183</u>
<u>15</u>	SCT	PPI Systems	1051 Bagxter Rd Unit 21 Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>183</u>
<u>15</u>	SCT	PPI Systems	1051 Baxter Rd Unit 21 Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>184</u>
<u>15</u>	SCT	Optelian	1051 Baxter Rd Suite 22A Ottawa ON K2C 3P2	ENE/62.7	0.24	<u>184</u>
<u>16</u>	SPL		45.353700, -75.782646 OTTAWA ON	NW/68.3	-1.85	<u>184</u>
<u>17</u>	GEN	BAXTER CLEANER	1131 BAXTER ROAD OTTAWA ON K2C 3R4	S/70.0	1.15	<u>185</u>
<u>18</u>	WWIS		2685 IRIS STREET OTTAWA ON Well ID: 7046634	SSW/70.6	1.02	<u>185</u>
<u>19</u>	WWIS		1050 BAXTER RD Ottawa ON Well ID: 7231535	ENE/78.9	0.15	<u>189</u>
<u>20</u>	WWIS		1050 BAXTER ROAD OTTAWA ON Well ID: 7255861	ENE/83.9	0.21	<u>192</u>
<u>21</u>	GEN	JOHN EBBS ENTERPRISES LTD.	O/A PALMER CLEANERS 1129 BAXTER ROAD OTTAWA ON K2C 3R4	S/88.1	1.16	<u>194</u>
<u>21</u>	GEN	JOHN EBBS ENTERPRISES LTD.	1129 BAXTER ROAD OTTAWA ON K2C 3R4	S/88.1	1.16	<u>194</u>
<u>21</u>	GEN	JOHN EBBS ENTERPRISES LTD. 22-082	O/A PALMER CLEANERS 1129 BAXTER ROAD OTTAWA ON K2C 3R4	S/88.1	1.16	<u>194</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>21</u>	GEN	JOHN EBBS ENTERPRISES LIMITED	1129 BAXTER ROAD OTTAWA ON K2C 3R4	S/88.1	1.16	<u>195</u>
<u>21</u>	GEN	PALMER CLEANER 1067265 ONT. LTD.	1129 BAXTER ROAD OTTAWA ON K2C 3R4	S/88.1	1.16	<u>195</u>
<u>21</u>	GEN	BAXTER CLEANERS	1129 BAXTER ROAD OTTAWA ON K2C 3R4	S/88.1	1.16	<u>195</u>
<u>22</u>	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147017	SSW/88.7	1.15	<u>196</u>
<u>23</u>	WWIS		2785 IRIS ST Ottawa ON Well ID: 7159666	SSW/99.1	1.15	<u>199</u>
<u>24</u>	WWIS		2685 IRIS ST Ottawa ON Well ID: 7159667	SSW/99.3	1.15	<u>201</u>
<u>25</u>	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147018	SSW/100.1	1.15	<u>203</u>
<u>26</u>	WWIS		2685 IRIS ST Ottawa ON Well ID: 7159665	SSW/100.5	1.15	<u>206</u>
<u>27</u>	EASR	LAURENT LEBLANC LIMITED	2591 iris ST ottawa ON K2C 1E4	S/103.5	1.12	<u>208</u>
<u>28</u>	EHS		1050 Baxter Rd Ottawa ON K2C 3P1	ENE/104.5	-0.87	<u>208</u>
<u>29</u>	WWIS		2685 IRIS ST Ottawa ON Well ID: 7159664	SSW/105.2	1.15	<u>209</u>
<u>30</u>	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147019	SSW/112.6	1.15	<u>211</u>
<u>31</u>	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147021	SSW/112.7	1.15	<u>214</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>32</u>	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147020	SSW/112.9	1.15	<u>217</u>
<u>33</u>	EHS		1050 Baxter Road Ottawa ON	NE/115.6	-0.85	<u>220</u>
<u>33</u>	EHS		1050 - 1051 Baxter Rd Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>220</u>
<u>33</u>	EHS		1050 Baxter Road Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>220</u>
<u>33</u>	GEN	CARRIER CANADA LIMITED	1050 BAXTER ROAD, UNIT 8 BAXTER CENTRE OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>220</u>
<u>33</u>	GEN	CARRIER CANADA LIMITED	BAXTER CENTRE 1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>221</u>
<u>33</u>	GEN	UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>221</u>
<u>33</u>	GEN	APH (MICOT) CANAD INC.	1050 BAXTER ROAD OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>222</u>
<u>33</u>	GEN	APH (MICOT) CANAD INC. (OUT OF BUSINESS)	1050 BAXTER ROAD OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>223</u>
<u>33</u>	GEN	APH (MICOT) CANAD INC. 03-262	1050 BAXTER ROAD OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>223</u>
<u>33</u>	GEN	MINTO DEVELOPMENTS INC.	1050 BAXTER ROAD C/O 427 LAURIER AVENUE SUITE 300 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>224</u>
<u>33</u>	GEN	MINTO DEVELOPMENTS INC. 25-561	1050 BAXTER ROAD C/O 427 LAURIER AVENUE SUITE 300 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>224</u>
<u>33</u>	GEN	CLIMEC RESIDENTIAL INC.	1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>224</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>33</u>	GEN	RESET ELECTRONICS INC.	1050 BAXTER RD. OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>225</u>
<u>33</u>	GEN	HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>225</u>
<u>33</u>	GEN	UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>226</u>
<u>33</u>	GEN	RESET ELECTRONICS INC.	1050 BAXTER RD. OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>227</u>
<u>33</u>	GEN	CLIMEC RESIDENTIAL INC.	1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>227</u>
<u>33</u>	GEN	HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>227</u>
<u>33</u>	GEN	UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>228</u>
<u>33</u>	GEN	CLIMEC RESIDENTIAL INC.	1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>229</u>
<u>33</u>	GEN	HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>229</u>
<u>33</u>	GEN	DEBOER'S	1050 BAXTER ROAD OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>229</u>
<u>33</u>	GEN	UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>230</u>
<u>33</u>	GEN	UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>231</u>
<u>33</u>	GEN	HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON	NE/115.6	-0.85	<u>232</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>33</u>	GEN	UTC Canada Corporation	1050 Baxter Road Ottawa ON	NE/115.6	-0.85	<u>232</u>
<u>33</u>	GEN	HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>233</u>
<u>33</u>	GEN	UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>234</u>
<u>33</u>	GEN	UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>235</u>
<u>33</u>	GEN	HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>236</u>
<u>33</u>	GEN	CARRIER ENTERPRISE	1050 BAXTER ROAD OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>237</u>
<u>33</u>	GEN	HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>238</u>
<u>33</u>	GEN	Reliance Comfort RELIANCE	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>238</u>
<u>33</u>	GEN	Reliance Comfort RELIANCE	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>239</u>
<u>33</u>	GEN	Reliance Comfort	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	NE/115.6	-0.85	<u>239</u>
<u>33</u>	GEN	Reliance Home Comfort	1050 Baxter Road Ottawa ON	NE/115.6	-0.85	<u>241</u>
<u>33</u>	GEN	Deslaurier Custom Cabinets Inc.	1050 Baxter Road Ottawa ON	NE/115.6	-0.85	<u>242</u>
<u>33</u>	SCT	Cummings Mitchell Inc.	1050 Baxter Rd Unit 11 Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>243</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>33</u>	SPL	Roger Rossi	Unit 5 - 1050 Baxter Rd Ottawa ON K2C 3P1	NE/115.6	-0.85	<u>243</u>
<u>33</u>	SPL		45.354181, -75.781171 OTTAWA ON	NE/115.6	-0.85	<u>244</u>
<u>34</u>	WWIS		2685 IRIS ST Ottawa ON Well ID: 7159663	SSW/116.6	1.15	<u>245</u>
<u>35</u>	WWIS		1050 BAXTER RD OTTAWA ON Well ID: 7255863	SSE/117.0	2.15	<u>247</u>
<u>36</u>	WWIS		1119-1143 BAXTER RD Ottawa ON Well ID: 7233764	S/118.7	1.03	<u>249</u>
<u>37</u>	WWIS		2685 IRIS ST Ottawa ON Well ID: 7159662	SSW/119.1	1.15	<u>251</u>
<u>38</u>	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147022	SSW/120.9	1.15	<u>254</u>
<u>39</u>	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147024	SSW/121.8	1.15	<u>257</u>
<u>40</u>	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147023	SSW/122.2	1.15	<u>260</u>
<u>41</u>	WWIS		2685 IRIS ST Ottawa ON Well ID: 7159661	SSW/122.4	1.15	<u>263</u>
<u>42</u>	PINC	VINTEX INC	DEMPSEY AVE & IRISH ST,,OTTAWA, ON,K2C 1M1,CA ON	SE/123.6	1.84	<u>265</u>
<u>42</u>	SPL	Enbridge Gas Distribution Inc.	Dempsey Ave and Irish Street Ottawa ON	SE/123.6	1.84	<u>265</u>
<u>43</u>	SPL		45.354877, -75.781035 OTTAWA ON	NNE/125.1	-1.85	<u>266</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
44	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147025	SSW/125.9	1.15	267
45	WWIS		2685 IRIS ST Ottawa ON Well ID: 7159660	SSW/126.0	1.15	270
46	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147026	SSW/126.5	1.15	273
47	WWIS		2685 IRIS ST Ottawa ON Well ID: 7159659	SSW/126.8	1.15	276
48	WWIS		Ottawa ON Well ID: 7147027	SSW/127.4	1.15	278
49	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147029	SSW/129.3	1.15	281
50	SPL		45.35476, -75.78189 OTTAWA ON	N/130.2	-2.53	284
51	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7155561	SSW/132.8	1.15	285
52	WWIS		2685 IRIS STREET Ottawa ON Well ID: 7147028	SSW/133.3	1.15	288
53	WWIS		ON Well ID: 7159657	SSW/134.9	1.15	292
54	WWIS		2685 IRIS ST Ottawa ON Well ID: 7159658	SSW/135.1	1.15	294
55	WWIS		1119-1143 BAXTER RD Ottawa ON Well ID: 7233763	S/138.0	1.85	296
56	WWIS		2685 IRIS ST Ottawa ON	SSW/138.7	1.15	299

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7159656			
57	WWIS		1119-1143 BAXTER RD Ottawa ON Well ID: 7233762	S/140.9	1.85	301
58	WWIS		1129 BAXTOR ST. Ottawa ON Well ID: 7136631	S/156.2	1.46	304
59	SPL	KIEWIT EUROVIA VINCI	OTTAWA ON	W/159.7	-2.85	317
60	SPL		2620 Iris St. OTTAWA ON	S/160.9	1.46	318
61	SPL	Kiewit Eurovia Vinci	2600 Queensview Dr. Ottawa ON	NW/167.2	-2.54	319
61	SPL		2600 Queensview Drive OTTAWA ON	NW/167.2	-2.54	320
61	SPL		2600 Queensview drive Ottawa ON	NW/167.2	-2.54	320
61	SPL		2600 Queensview Dr. Ottawa ON K2B 8H6 OTTAWA ON	NW/167.2	-2.54	321
62	CA	Nuvo Network Management Inc.	2650 Queensview Drive Ottawa ON	WNW/167.5	-2.85	322
62	ECA	Nuvo Network Management Inc.	2650 Queensview Drive Ottawa ON K2B 8H6	WNW/167.5	-2.85	322
62	EHS		2650 Queensview Dr Ottawa ON K2B8H6	WNW/167.5	-2.85	323
62	GEN	INTERNATIONAL DATACAST (OUT OF BUSINESS)	2650 QUEENSVIEW DRIVE, SUITE 260 OTTAWA ON K2B 8H6	WNW/167.5	-2.85	323
62	GEN	INTERNATIONAL DATACASTING CORP. 21-546	2650 QUEENSVIEW DRIVE, SUITE 260 OTTAWA ON K2B 8H6	WNW/167.5	-2.85	323

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
62	GEN	Proslide Technology Inc.	2650 Queensview Drive Ottawa ON	WNW/167.5	-2.85	324
62	SCT	HUBER+SUHNER Canada	2650 Queensview Dr Suite 206 Ottawa ON K2B 8H6	WNW/167.5	-2.85	325
62	SCT	ProSlide Technology Inc.	2650 Queensview Dr Suite 150 Ottawa ON K2B 8H6	WNW/167.5	-2.85	325
63	SCT	Avanex Corporation	2299 Edwin Cres Ottawa ON K2C 1H8	ESE/185.9	2.15	325
64	SPL	SERVICE STATION	COBDON & IRIS (N.O.S.) OTTAWA CITY ON	E/193.5	2.02	325
65	EHS		1105 Cobden Rd Ottawa ON K2C2Z1	E/193.6	1.15	326
65	GEN	IRIS PLAZA	1105 Cobden Rd Ottawa ON K2C2Z1	E/193.6	1.15	326
66	CA	OTTAWA CITY	SODERLIND ST./SUDBURY AVE. OTTAWA CITY ON	SSE/196.0	2.15	327
67	GEN	OTTAWA HYDRO	2317 EDWIN CRESCENT OTTAWA ON K2C 1H8	ESE/199.5	2.15	328
67	GEN	OTTAWA HYDRO 29-541	2317 EDWIN CRESCENT OTTAWA ON K2C 1H8	ESE/199.5	2.15	328
68	CA	MURLEE HOLDINGS LIMITED	2600-2630 QUEENSVIEW DR. (SWM) OTTAWA CITY ON K2B 8H6	NW/206.2	-2.85	328
69	SPL	KIEWIT EUROVIA VINCI	45.355491, -75.780125 OTTAWA ON	NNE/206.3	-1.92	328
70	WWIS		2685 IRIS ST. NAPEAN ON	SSW/209.6	1.15	329

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
			Well ID: 7051219			
71	EHS		2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	332
71	EHS		2685 Iris St Ottawa ON K2C 1E5	SW/210.5	-0.85	333
71	GEN	BLACK PHOTO CORPORATION	2685 IRIS STREET, OTTAWA C/O 371 GOUGH ROAD MARKHAM ON K2C 3S4	SW/210.5	-0.85	333
71	GEN	BLACK PHOTO CORPORAT (OUT OF BUSINESS)	2685 IRIS STREET, OTTAWA C/O 371 GOUGH ROAD MARKHAM ON K2C 3S4	SW/210.5	-0.85	333
71	GEN	BLACK PHOTO CORPORATION 05-422	2685 IRIS STREET, OTTAWA C/O 371 GOUGH ROAD MARKHAM ON K2C 3S4	SW/210.5	-0.85	334
71	GEN	BLACK PHOTO CORPORAT (OUT OF BUSINESS)	2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	334
71	GEN	NATIONAL GROCERS COMPANY LTD.	2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	334
71	GEN	NATIONAL GROCERS COMPANY LTD.	LOBLAWS SUPERMARKETS LTD. 2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	335
71	GEN	PHARMA PLUS DRUGS LTD	2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	335
71	GEN	PHARMA PLUS DRUGS LTD. 31-674	2685 IRIS STREET, OTTAWA C/O 5935 AIRPORT ROAD STE. 500 MISSISSAUGA ON K2C 3S4	SW/210.5	-0.85	336
71	GEN	PHARMA PLUS DRUGS LTD (OUT OF BUSINESS)	2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	336
71	GEN	DRUGSTORE PHARMACY, THE	2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	336

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
71	GEN	IKEA Canada	2685 Iris Street Pinecrest shopping Mall Ottawa ON K2C 3S4	SW/210.5	-0.85	337
71	GEN	IKEA Canada Limited Partnership	2685 Iris Street Ottawa ON	SW/210.5	-0.85	337
71	GEN	IKEA CANADA	2685 Iris Street Ottawa ON K2C 3S4	SW/210.5	-0.85	338
71	GEN	IKEA CANADA	2685 Iris Street Ottawa ON K2C 3S4	SW/210.5	-0.85	338
71	GEN	SEARS CANADA INC	2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	339
71	GEN	IKEA CANADA	2685 Iris Street Ottawa ON K2C 3S4	SW/210.5	-0.85	339
71	GEN	AECON BUILDINGS INC.	2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	340
71	GEN	IKEA CANADA	2685 Iris Street Ottawa ON K2C 3S4	SW/210.5	-0.85	340
71	GEN	IKEA CANADA LTD PARTNERSHIP	2685 Iris Street Ottawa ON K2C 3S4	SW/210.5	-0.85	341
71	GEN	IKEA CANADA LTD PARTNERSHIP	2685 Iris Street Ottawa ON	SW/210.5	-0.85	342
71	GEN	Michaels Stores, Inc.	2685 Iris St Ottawa ON	SW/210.5	-0.85	342
71	GEN	Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	SW/210.5	-0.85	343
71	GEN	IKEA CANADA LTD PARTNERSHIP	2685 Iris Street Ottawa ON K2C3S4	SW/210.5	-0.85	344

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>71</u>	GEN	IKEA CANADA LTD PARTNERSHIP	2685 Iris Street Ottawa ON K2C3S4	SW/210.5	-0.85	<u>345</u>
<u>71</u>	GEN	Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	SW/210.5	-0.85	<u>346</u>
<u>71</u>	GEN	IKEA CANADA LTD PARTNERSHIP	2685 Iris Street Ottawa ON K2C3S4	SW/210.5	-0.85	<u>347</u>
<u>71</u>	GEN	Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	SW/210.5	-0.85	<u>348</u>
<u>71</u>	GEN	Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	SW/210.5	-0.85	<u>349</u>
<u>71</u>	GEN	IKEA CANADA LTD PARTNERSHIP OTTAWA (004)	2685 Iris Street Ottawa ON K2C3S4	SW/210.5	-0.85	<u>350</u>
<u>71</u>	GEN	Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	SW/210.5	-0.85	<u>351</u>
<u>71</u>	GEN	IKEA CANADA LTD PARTNERSHIP OTTAWA (004)	2685 Iris Street Ottawa ON K2C3S4	SW/210.5	-0.85	<u>352</u>
<u>71</u>	GEN	Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	SW/210.5	-0.85	<u>353</u>
<u>71</u>	GEN	IKEA CANADA LTD PARTNERSHIP OTTAWA (004)	2685 Iris Street Ottawa ON K2C3S4	SW/210.5	-0.85	<u>355</u>
<u>71</u>	GEN	IKEA Canada Limited Partnership	Pinecrest Shopping Centre, 2685 Iris Street Ottawa ON	SW/210.5	-0.85	<u>356</u>
<u>71</u>	GEN	Michaels Stores Inc.	2685 Iris Street Ottawa ON	SW/210.5	-0.85	<u>360</u>
<u>71</u>	PES	LOBLAWS SUPERMARKETS LTD. #153-5	2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	<u>368</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>71</u>	PES	ZELLERS INC. STORE 53	PINECREST S.C., 2685 IRIS STREET OTTAWA ON K2C 3S4	SW/210.5	-0.85	<u>368</u>
<u>71</u>	PES	LOBLAWS SUPERMARKETS LTD #1153	2685 IRIS ST OTTAWA ON K2C3S4	SW/210.5	-0.85	<u>369</u>
<u>71</u>	PES	LOBLAWS SUPERMARKETS LTD#1153	2685 IRIS ST OTTAWA ON K2C3S4	SW/210.5	-0.85	<u>369</u>
<u>71</u>	PFAS	2685 Iris Street	IKEA, 2685 Iris St, Ottawa OTTAWA ON	SW/210.5	-0.85	<u>369</u>
<u>71</u>	SPL	PRIVATE BUSINESS	2685 IRIS ST. PINECREST SHOPPING CENTRE (N.O.S.) OTTAWA CITY ON K2C 3S4	SW/210.5	-0.85	<u>370</u>
<u>71</u>	SPL	Enbridge Gas Distribution Inc.	2685 Iris Street Ottawa ON K2C 3S4	SW/210.5	-0.85	<u>371</u>
<u>71</u>	SPL	Ottawa Metro Towing and Recovery Inc.	2685 Iris St Ottawa ON	SW/210.5	-0.85	<u>372</u>
<u>71</u>	SPL		2685 Iris St (Hwy 417 and Pinecrest) Ottawa ON	SW/210.5	-0.85	<u>373</u>
<u>71</u>	SPL	KIEWIT EUROVIA VINCI OTTAWA PARTERNSHIP	2685 Iris St, Ottawa, ON K2C 3S4 OTTAWA ON	SW/210.5	-0.85	<u>374</u>
<u>71</u>	SPL	2685 Iris Street	IKEA, 2685 Iris St, Ottawa OTTAWA ON	SW/210.5	-0.85	<u>375</u>
<u>72</u>	EHS		2685 Iris St Ottawa ON K2C 3S4	SW/213.3	-0.85	<u>375</u>
<u>73</u>	CA	City of Ottawa	2550 Queensview Drive Ottawa ON	N/229.1	-2.85	<u>376</u>
<u>73</u>	DTNK	CITY OF OTTAWA (OC TRANSP0)	2550 QUEENSVIEW DR OTTAWA ON	N/229.1	-2.85	<u>376</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
73	DTNK	CITY OF OTTAWA (OC TRANSP)	2550 QUEENSVIEW DR OTTAWA ON	N/229.1	-2.85	377
73	DTNK	CITY OF OTTAWA (OC TRANSP)	2550 QUEENSVIEW DR OTTAWA ON	N/229.1	-2.85	377
73	EBR	OC Transpo	2550 Queensview Dr. Ottawa Ontario Ottawa ON	N/229.1	-2.85	378
73	ECA	City of Ottawa	2550 Queensview Drive Ottawa ON K1G 0Z8	N/229.1	-2.85	378
73	EXP	CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	N/229.1	-2.85	378
73	EXP	CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	N/229.1	-2.85	379
73	FST	CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	N/229.1	-2.85	379
73	FST	CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	N/229.1	-2.85	379
73	FST	CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	N/229.1	-2.85	379
73	FSTH	CITY OF OTTAWA (OC TRANSP)	2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	N/229.1	-2.85	380
73	FSTH	CITY OF OTTAWA (OC TRANSP)	2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	N/229.1	-2.85	380
73	GEN	OTTAWA-CARLETON REG. TRANSIT COMM.	2550 QUEENSVIEW DRIVE OTTAWA ON K2B 8H6	N/229.1	-2.85	381
73	GEN	OTTAWA-CARLETON REG. TRANSIT COMM.	2550 QUEENSVIEW DRIVE C/O 1500 ST. LAURENT BLVD. OTTAWA ON K2B 8H6	N/229.1	-2.85	382

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
73	GEN	OTTAWA-CARLETON REG. TRANSIT COMM.29-265	2550 QUEENSVIEW DRIVE C/O 1500 ST. LAURENT BLVD. OTTAWA ON K2B 8H6	N/229.1	-2.85	383
73	GEN	OTTAWA-CARLETON REG. TRANSIT COMMISSION	2550 QUEENSVIEW DRIVE OTTAWA ON K2B 8H6	N/229.1	-2.85	384
73	GEN	OC TRANSP0	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	N/229.1	-2.85	385
73	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	N/229.1	-2.85	386
73	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON	N/229.1	-2.85	387
73	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON	N/229.1	-2.85	388
73	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON	N/229.1	-2.85	389
73	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	N/229.1	-2.85	390
73	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON	N/229.1	-2.85	391
73	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	N/229.1	-2.85	392
73	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	N/229.1	-2.85	393
73	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	N/229.1	-2.85	394
73	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	N/229.1	-2.85	396

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>73</u>	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	N/229.1	-2.85	<u>397</u>
<u>73</u>	GEN	City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	N/229.1	-2.85	<u>398</u>
<u>73</u>	GEN	OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON	N/229.1	-2.85	<u>399</u>
<u>73</u>	INC	CITY OF OTTAWA OC TRANSPO	2550 QUEENSVIEW DR OTTAWA ON	N/229.1	-2.85	<u>407</u>
<u>73</u>	NPRI	OC TRANSPO	2550 Queensview Drive Ottawa ON K2B8H6	N/229.1	-2.85	<u>408</u>
<u>73</u>	NPRI	OC TRANSPO	2550 Queensview Drive Ottawa ON K2B8H6	N/229.1	-2.85	<u>410</u>
<u>73</u>	PRT	OTTAW CARLETON REGIONAL TRANSIT COMMISSION	2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	N/229.1	-2.85	<u>412</u>
<u>73</u>	PRT	OTTAWA CARLETON REGIONAL TRANSIT COMMISSION	2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	N/229.1	-2.85	<u>413</u>
<u>73</u>	SPL	OTTAWA-CARLETON	O-C TRANSIT DEPOT; 2550 QUEENSVIEW DR OC TRANSPO GARAGE OTTAWA CITY ON K2B 8H6	N/229.1	-2.85	<u>413</u>
<u>73</u>	SPL	TRANSPORT TRUCK	2550 QUEENSVIEW DR. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON K2B 8H6	N/229.1	-2.85	<u>414</u>
<u>73</u>	SPL	Veolia ES Canada Industrial Services Inc.	2550 Queensview Drive Ottawa ON K2B 8H6	N/229.1	-2.85	<u>415</u>
<u>73</u>	SPL	City of Ottawa	2550 Queensview Dr Ottawa ON	N/229.1	-2.85	<u>415</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>73</u>	SPL		2550 Queensview Dr Ottawa ON	N/229.1	-2.85	<u>416</u>
<u>73</u>	SPL	KIEWIT EUROVIA VINCI OTTAWA PARTERNSHIP	2550 Queensview Dr., Ottawa OTTAWA ON	N/229.1	-2.85	<u>417</u>
<u>74</u>	SPL		45.355038, - 75.780809, Ottawa, ON OTTAWA ON	N/230.6	-2.85	<u>418</u>
<u>75</u>	CA	HEWLETT-PACKARD (CANADA) LTD.	2670 QUEENSVIEW DRIVE (SWM) OTTAWA ON K2B 8K1	W/240.3	-2.85	<u>419</u>
<u>75</u>	EASR	KIEWIT/EUROVIA/VINCI OTTAWA PARTNERSHIP	2670 Queensview DR Ottawa ON K1G 6H5	W/240.3	-2.85	<u>419</u>
<u>75</u>	EHS		2670 Queensview Drive Ottawa ON K2B 8K1	W/240.3	-2.85	<u>420</u>
<u>75</u>	EHS		2670 Queensview Drive Ottawa ON K2B 8K1	W/240.3	-2.85	<u>420</u>
<u>75</u>	SPL	Kiewit Eurovia Vinci	2670 Queensview Dr Ottawa ON	W/240.3	-2.85	<u>420</u>
<u>75</u>	SPL		2670 Queensview Dr, Ottawa ON OTTAWA ON	W/240.3	-2.85	<u>421</u>
<u>75</u>	SPL		2670 Queensview Drive, Ottawa ON OTTAWA ON	W/240.3	-2.85	<u>422</u>
<u>75</u>	SPL		2670 Queensview Dr. OTTAWA ON	W/240.3	-2.85	<u>423</u>
<u>75</u>	SPL		behind 2670 Queensview Drive, Ottawa OTTAWA ON	W/240.3	-2.85	<u>423</u>
<u>75</u>	SPL		2670 Queensview Dr, Ottawa OTTAWA ON	W/240.3	-2.85	<u>424</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>75</u>	SPL		2670 Queensview Drive Ottawa, ON OTTAWA ON	W/240.3	-2.85	<u>425</u>
<u>76</u>	EHS		1175 Soderlind St Ottawa ON K2C 3B3	SE/245.1	3.15	<u>426</u>
<u>76</u>	GEN	Ottawa Catholic District School Board	1175 Soderlind Rd Ottawa ON	SE/245.1	3.15	<u>426</u>
<u>76</u>	GEN	Ottawa Catholic District School Board	1175 Soderlind St. Ottawa ON	SE/245.1	3.15	<u>427</u>
<u>77</u>	WWIS		1175 SODERLIND ST Ottawa ON Well ID: 7229422	SE/248.3	3.15	<u>427</u>
<u>78</u>	BORE		ON	ENE/251.5	0.15	<u>429</u>
<u>79</u>	EHS		2611 Queensview Drive Ottawa ON K2B 6B7	NW/251.6	-2.85	<u>431</u>
<u>80</u>	CA	1561761 Ontario Inc.	2611 Queensview Dr Ottawa ON	NW/251.6	-2.85	<u>431</u>
<u>80</u>	ECA	1561761 Ontario Inc.	2611 Queensview Dr Ottawa ON K2H 9C4	NW/251.6	-2.85	<u>431</u>
<u>80</u>	SPL	Munro and Scullion Contracting Inc<UNOFFICIAL>	2611 Queensview Drive Ottawa ON	NW/251.6	-2.85	<u>432</u>
<u>81</u>	EHS		2615 Queensview Drive Ottawa ON K2B	NW/252.7	-2.85	<u>432</u>
<u>82</u>	EHS		2625 Queensway Drive Ottawa ON Ottawa ON K2B 8K2	WNW/260.3	-2.85	<u>433</u>
<u>83</u>	CA	O & Y PROPERTIES INC.	2625 QUEENSVIEW DR. (SWM) OTTAWA CITY ON K2B 8K2	WNW/269.1	-2.85	<u>433</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
<u>83</u>	EHS		2625 Queensview Dr. Ottawa ON K2B 8K2	WNW/269.1	-2.85	<u>433</u>
<u>83</u>	EHS		2625 Queensview Drive Ottawa ON K2B 8K2	WNW/269.1	-2.85	<u>433</u>
<u>83</u>	EHS		2625 Queensview Drive Ottawa ON	WNW/269.1	-2.85	<u>434</u>
<u>83</u>	EHS		2625 Queensview Drive Ottawa ON K2B 8K2	WNW/269.1	-2.85	<u>434</u>
<u>84</u>	SPL	KIEWIT EUROVIA VINCI OTTAWA PARTERSHIP	Connaught Ave and Roman Ave, Ottawa, ON OTTAWA ON	NNE/270.9	-2.54	<u>434</u>
<u>84</u>	SPL	LAFARGE CANADA INC.	Roman Ave and Cannaught, Ottawa ON OTTAWA ON	NNE/270.9	-2.54	<u>435</u>
<u>85</u>	WWIS		2550 QUEENSVIEW DR Ottawa ON Well ID: 7386190	NNE/274.2	-2.85	<u>436</u>
<u>86</u>	SPL	KIEWIT EUROVIA VINCI	OTTAWA ON	W/279.5	-3.85	<u>439</u>
<u>87</u>	EHS		2591 & 2611 Queensview Drive Ottawa ON	NW/283.7	-2.85	<u>440</u>
<u>88</u>	SPL	City of Ottawa<UNOFFICIAL>	2237 Elmira Road Ottawa ON	ENE/284.2	0.46	<u>441</u>
<u>89</u>	WWIS		2655 QUEENSVIEW DRIVE BEHIND LOCATION Ottawa ON Well ID: 7339878	NNE/284.5	-2.85	<u>441</u>
<u>90</u>	SPL		Ottawa ON	NNE/285.0	-2.85	<u>446</u>
<u>91</u>	WWIS		2550 QUEENSVIEW DR Ottawa ON	NNE/286.5	-2.85	<u>447</u>

Map Key	DB	Company/Site Name	Address	Dir/Dist (m)	Elev Diff (m)	Page Number
Well ID: 7386191						
<u>92</u>	CA	Metcalfe Realty Company Limited	2680 Queensview Dr Ottawa ON	W/294.7	-3.71	<u>450</u>
<u>92</u>	ECA	Metcalfe Realty Company Limited	2680 Queensview Dr Ottawa ON K1P 5G4	W/294.7	-3.71	<u>450</u>
<u>92</u>	GEN	LEE VALLEY TOOLS LTD.	2680 QUEENSVIEW DR. OTTAWA ON K2B 8J9	W/294.7	-3.71	<u>451</u>
<u>92</u>	GEN	LEE VALLEY TOOLS LTD-OUT OF BUS	2680 QUEENSVIEW DR. OTTAWA ON K2B 8J9	W/294.7	-3.71	<u>451</u>
<u>92</u>	GEN	LEE VALLEY TOOLS LTD-OUT OF BUS 24-400	2680 QUEENSVIEW DR. OTTAWA ON K2B 8J9	W/294.7	-3.71	<u>451</u>
<u>92</u>	GEN	SiGe Semiconductor Inc.	2680 Queensview Drive Ottawa ON K2B 8J9	W/294.7	-3.71	<u>452</u>
<u>92</u>	GEN	International Datacasting Corporation	2680 Queensview Drive Ottawa ON K2B 8J9	W/294.7	-3.71	<u>452</u>
<u>92</u>	GEN	EllisDon Corporation Ottawa Buildings	2680 Queensview Drive Ottawa ON K2B8J9	W/294.7	-3.71	<u>452</u>
<u>92</u>	GEN	EllisDon Corporation	2680 Queensview Drive Ottawa ON	W/294.7	-3.71	<u>453</u>
<u>92</u>	SCT	INTERNATIONAL DATACASTING	2680 QUEENSVIEW DR OTTAWA ON K2B 8J9	W/294.7	-3.71	<u>454</u>
<u>92</u>	SCT	INTERNATIONAL DATACASTING INC.	2680 Queensview Dr Ottawa ON K2B 8J9	W/294.7	-3.71	<u>454</u>
<u>92</u>	SCT	International Datacasting Corp	2680 Queensview Dr Ottawa ON K2B 8J9	W/294.7	-3.71	<u>455</u>
<u>92</u>	SCT	SiGe Semiconductor, Inc.	2680 Queensview Dr Ottawa ON K2B 8J9	W/294.7	-3.71	<u>455</u>

<i>Map Key</i>	<i>DB</i>	<i>Company/Site Name</i>	<i>Address</i>	<i>Dir/Dist (m)</i>	<i>Elev Diff (m)</i>	<i>Page Number</i>
<u>92</u>	SCT	Integrating Solutions Inc.	2680 Queensview Dr Suite 100 Ottawa ON K2B 8J9	W/294.7	-3.71	<u>455</u>
<u>92</u>	SPL		2680 Queensview Dr. Ottawa OTTAWA ON	W/294.7	-3.71	<u>456</u>
<u>92</u>	SPL	LAFARGE CANADA INC.	2680 Queensview Dr, Ottawa OTTAWA ON	W/294.7	-3.71	<u>456</u>
<u>93</u>	EHS		2506 Roman Ave Ottawa ON K2B 7X9	NE/295.4	-1.85	<u>457</u>
<u>94</u>	SPL		45.356050 -75.780023, Ottawa OTTAWA ON	NNE/297.1	-2.85	<u>458</u>

Executive Summary: Summary By Data Source

BORE - Borehole

A search of the BORE database, dated 1875-Jul 2018 has found that there are 1 BORE site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	ON	251.5	<u>78</u>

CA - Certificates of Approval

A search of the CA database, dated 1985-Oct 30, 2011* has found that there are 10 CA site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Ottawa Citizen Group Inc.	1101 Baxter Rd Ottawa ON K2C 3Z3	0.0	<u>1</u>
Ottawa Citizen Group Inc.	1101 Baxton Road Ottawa ON	0.0	<u>1</u>
Nuvo Network Management Inc.	2650 Queensview Drive Ottawa ON	167.5	<u>62</u>
OTTAWA CITY	SODERLIND ST./SUDBURY AVE. OTTAWA CITY ON	196.0	<u>66</u>
MURLEE HOLDINGS LIMITED	2600-2630 QUEENSVIEW DR. (SWM) OTTAWA CITY ON K2B 8H6	206.2	<u>68</u>
City of Ottawa	2550 Queensview Drive Ottawa ON	229.1	<u>73</u>
HEWLETT-PACKARD (CANADA) LTD.	2670 QUEENSVIEW DRIVE (SWM) OTTAWA ON K2B 8K1	240.3	<u>75</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
1561761 Ontario Inc.	2611 Queensview Dr Ottawa ON	251.6	80
O & Y PROPERTIES INC.	2625 QUEENSVIEW DR. (SWM) OTTAWA CITY ON K2B 8K2	269.1	83
Metcalf Realty Company Limited	2680 Queensview Dr Ottawa ON	294.7	92

DTNK - Delisted Fuel Tanks

A search of the DTNK database, dated Oct 2023 has found that there are 6 DTNK site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON	0.0	1
THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON	0.0	1
THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON	0.0	1
CITY OF OTTAWA (OC TRANSP)	2550 QUEENSVIEW DR OTTAWA ON	229.1	73
CITY OF OTTAWA (OC TRANSP)	2550 QUEENSVIEW DR OTTAWA ON	229.1	73
CITY OF OTTAWA (OC TRANSP)	2550 QUEENSVIEW DR OTTAWA ON	229.1	73

EASR - Environmental Activity and Sector Registry

A search of the EASR database, dated Oct 2011 - Jul 31, 2025 has found that there are 2 EASR site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
LAURENT LEBLANC LIMITED	2591 iris ST ottawa ON K2C 1E4	103.5	<u>27</u>
KIEWIT/EUROVIA/VINCI OTTAWA PARTNERSHIP	2670 Queensview DR Ottawa ON K1G 6H5	240.3	<u>75</u>

EBR - Environmental Registry

A search of the EBR database, dated 1994 - Jul 31, 2025 has found that there are 3 EBR site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Ottawa Citizen Group Inc.	1101 Baxter Road Ottawa CITY OF OTTAWA ON	0.0	<u>1</u>
exp Services Inc.	1051 Baxter Road Ottawa K2C 1H3 CITY OF OTTAWA ON	62.7	<u>15</u>
OC Transpo	2550 Queensview Dr. Ottawa Ontario Ottawa ON	229.1	<u>73</u>

ECA - Environmental Compliance Approval

A search of the ECA database, dated Oct 2011 - Jul 31, 2025 has found that there are 7 ECA site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Ottawa Citizen Group Inc.	1101 Baxter Rd Ottawa ON K2C 3M4	0.0	<u>1</u>
Ottawa Citizen Group Inc.	1101 Baxton Road Ottawa ON	0.0	<u>1</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
exp Services Inc.	1051 Baxter Rd Ottawa ON L6V 1V2	62.7	<u>15</u>
Nuvo Network Management Inc.	2650 Queensview Drive Ottawa ON K2B 8H6	167.5	<u>62</u>
City of Ottawa	2550 Queensview Drive Ottawa ON K1G 0Z8	229.1	<u>73</u>
1561761 Ontario Inc.	2611 Queensview Dr Ottawa ON K2H 9C4	251.6	<u>80</u>
Metcalfe Realty Company Limited	2680 Queensview Dr Ottawa ON K1P 5G4	294.7	<u>92</u>

EHS - ERIS Historical Searches

A search of the EHS database, dated 1999-Apr 30, 2025 has found that there are 27 EHS site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1101 Baxter Rd Ottawa ON K2C 3Z3	0.0	<u>1</u>
	1101 Baxter Road Ottawa ON K2C 3Z3	0.0	<u>1</u>
	1101 Baxter Rd Ottawa ON K2C3Z3	0.0	<u>1</u>
	1101 baxter road Ottawa ON K2C 3Z3	0.0	<u>1</u>
	Highway 417 Ottawa ON	56.1	<u>14</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1051 Baxter Rd. Ottawa ON K2C 3P2	62.7	<u>15</u>
	1050 Baxter Rd Ottawa ON K2C 3P1	104.5	<u>28</u>
	1050 Baxter Road Ottawa ON K2C 3P1	115.6	<u>33</u>
	1050 - 1051 Baxter Rd Ottawa ON K2C 3P1	115.6	<u>33</u>
	1050 Baxter Road Ottawa ON	115.6	<u>33</u>
	2650 Queensview Dr Ottawa ON K2B8H6	167.5	<u>62</u>
	1105 Cobden Rd Ottawa ON K2C2Z1	193.6	<u>65</u>
	2685 Iris St Ottawa ON K2C 1E5	210.5	<u>71</u>
	2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>
	2685 Iris St Ottawa ON K2C 3S4	213.3	<u>72</u>
	2670 Queensview Drive Ottawa ON K2B 8K1	240.3	<u>75</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2670 Queensview Drive Ottawa ON K2B 8K1	240.3	<u>75</u>
	1175 Soderlind St Ottawa ON K2C 3B3	245.1	<u>76</u>
	2611 Queensview Drive Ottawa ON K2B 6B7	251.6	<u>79</u>
	2615 Queensview Drive Ottawa ON K2B	252.7	<u>81</u>
	2625 Queensway Drive Ottawa ON Ottawa ON K2B 8K2	260.3	<u>82</u>
	2625 Queensview Drive Ottawa ON K2B 8K2	269.1	<u>83</u>
	2625 Queensview Drive Ottawa ON	269.1	<u>83</u>
	2625 Queensview Drive Ottawa ON K2B 8K2	269.1	<u>83</u>
	2625 Queensview Dr. Ottawa ON K2B 8K2	269.1	<u>83</u>
	2591 & 2611 Queensview Drive Ottawa ON	283.7	<u>87</u>
	2506 Roman Ave Ottawa ON K2B 7X9	295.4	<u>93</u>

EXP - List of Expired Fuels Safety Facilities

A search of the EXP database, dated Oct 2023 has found that there are 4 EXP site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON	0.0	<u>1</u>
THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON	0.0	<u>1</u>
CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	229.1	<u>73</u>
CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	229.1	<u>73</u>

FST - Fuel Storage Tank

A search of the FST database, dated Oct 2023 has found that there are 3 FST site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	229.1	<u>73</u>
CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	229.1	<u>73</u>
CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	229.1	<u>73</u>

FSTH - Fuel Storage Tank - Historic

A search of the FSTH database, dated Pre-Jan 2010* has found that there are 2 FSTH site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CITY OF OTTAWA (OC TRANSP)	2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	229.1	<u>73</u>
CITY OF OTTAWA (OC TRANSP)	2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	229.1	<u>73</u>

GEN - Ontario Regulation 347 Waste Generators Summary

A search of the GEN database, dated 1986-Mar 31, 2025 has found that there are 141 GEN site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA CITIZEN, THE	1101 BAXTER ROAD P.O. BOX 5020 OTTAWA ON K2C 3Z3	0.0	<u>1</u>
OTTAWA CITIZEN, THE 10-062	1101 BAXTER ROAD OTTAWA ON K2C 3M4	0.0	<u>1</u>
OTTAWA CITIZEN, THE	1101 BAXTER ROAD OTTAWA ON K2C 3M4	0.0	<u>1</u>
OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3M4	0.0	<u>1</u>
OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3Z3	0.0	<u>1</u>
OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3Z3	0.0	<u>1</u>
OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3Z3	0.0	<u>1</u>
OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3Z3	0.0	<u>1</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA CITIZEN	1101 Baxter Road Ottawa ON	0.0	<u>1</u>
OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3M4	0.0	<u>1</u>
OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3M4	0.0	<u>1</u>
OTTAWA CITIZEN	1101 Baxter Road Ottawa ON K2C 3M4	0.0	<u>1</u>
OTTAWA CITIZEN Postmedia Network Inc	1101 Baxter Road Ottawa ON K2C 3M4	0.0	<u>1</u>
OTTAWA CITIZEN Postmedia Network Inc	1101 Baxter Road Ottawa ON K2C 3M4	0.0	<u>1</u>
OTTAWA CITIZEN Postmedia Network Inc	1101 Baxter Road Ottawa ON K2C 3M4	0.0	<u>1</u>
OTTAWA CITIZEN	Ottawa Citizen, PO Box 5020, 1101 Baxter Road Ottawa ON	0.0	<u>1</u>
MICROMEASUREMENTS CANADA INC.	1051 BAXTER ROAD OTTAWA ON K2C 3P2	62.7	<u>15</u>
MICROMEASUREMENTS CANADA INC. 26-496	1051 BAXTER ROAD OTTAWA ON K2C 3P2	62.7	<u>15</u>
Optelian Access Networks	22A-1051 Baxter Road Ottawa ON K2C 3P2	62.7	<u>15</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Optelian Access Networks	22A-1051 Baxter Road Ottawa ON K2C 3P2	62.7	<u>15</u>
Optelian Access Networks	22A-1051 Baxter Road Ottawa ON K2C 3P2	62.7	<u>15</u>
Optelian Access Networks	22A-1051 Baxter Road Ottawa ON K2C 3P2	62.7	<u>15</u>
exp Services Inc.	1051 Baxter Road Unit 21A Ottawa ON	62.7	<u>15</u>
exp Services Inc.	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	62.7	<u>15</u>
exp Services Inc.	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	62.7	<u>15</u>
exp Services Inc.	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	62.7	<u>15</u>
exp Services Inc. Geotechnical and Materials Testing	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	62.7	<u>15</u>
exp Services Inc. Geotechnical and Materials Testing	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	62.7	<u>15</u>
exp Services Inc. Geotechnical and Materials Testing	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	62.7	<u>15</u>
exp Services Inc.	1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	62.7	<u>15</u>
HW Health & Sports Science Centre	1051 Baxter Road Ottawa ON	62.7	<u>15</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
exp Services Inc.	1051 Baxter Road Ottawa ON	62.7	<u>15</u>
BAXTER CLEANER	1131 BAXTER ROAD OTTAWA ON K2C 3R4	70.0	<u>17</u>
JOHN EBBS ENTERPRISES LTD.	O/A PALMER CLEANERS 1129 BAXTER ROAD OTTAWA ON K2C 3R4	88.1	<u>21</u>
JOHN EBBS ENTERPRISES LTD.	1129 BAXTER ROAD OTTAWA ON K2C 3R4	88.1	<u>21</u>
JOHN EBBS ENTERPRISES LTD. 22- 082	O/A PALMER CLEANERS 1129 BAXTER ROAD OTTAWA ON K2C 3R4	88.1	<u>21</u>
JOHN EBBS ENTERPRISES LIMITED	1129 BAXTER ROAD OTTAWA ON K2C 3R4	88.1	<u>21</u>
PALMER CLEANER 1067265 ONT. LTD.	1129 BAXTER ROAD OTTAWA ON K2C 3R4	88.1	<u>21</u>
BAXTER CLEANERS	1129 BAXTER ROAD OTTAWA ON K2C 3R4	88.1	<u>21</u>
HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON	115.6	<u>33</u>
UTC Canada Corporation	1050 Baxter Road Ottawa ON	115.6	<u>33</u>
HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	115.6	<u>33</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	115.6	<u>33</u>
UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	115.6	<u>33</u>
HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	115.6	<u>33</u>
CARRIER ENTERPRISE	1050 BAXTER ROAD OTTAWA ON K2C 3P1	115.6	<u>33</u>
HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	115.6	<u>33</u>
Reliance Comfort RELIANCE	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	115.6	<u>33</u>
Reliance Comfort RELIANCE	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	115.6	<u>33</u>
Reliance Comfort	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	115.6	<u>33</u>
Reliance Home Comfort	1050 Baxter Road Ottawa ON	115.6	<u>33</u>
Deslaurier Custom Cabinets Inc.	1050 Baxter Road Ottawa ON	115.6	<u>33</u>
CARRIER CANADA LIMITED	1050 BAXTER ROAD, UNIT 8 BAXTER CENTRE OTTAWA ON K2C 3P1	115.6	<u>33</u>
CARRIER CANADA LIMITED	BAXTER CENTRE 1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	115.6	<u>33</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	115.6	<u>33</u>
APH (MICOT) CANAD INC.	1050 BAXTER ROAD OTTAWA ON K2C 3P1	115.6	<u>33</u>
APH (MICOT) CANAD INC. (OUT OF BUSINESS)	1050 BAXTER ROAD OTTAWA ON K2C 3P1	115.6	<u>33</u>
APH (MICOT) CANAD INC. 03-262	1050 BAXTER ROAD OTTAWA ON K2C 3P1	115.6	<u>33</u>
MINTO DEVELOPMENTS INC.	1050 BAXTER ROAD C/O 427 LAURIER AVENUE SUITE 300 OTTAWA ON K2C 3P1	115.6	<u>33</u>
MINTO DEVELOPMENTS INC. 25-561	1050 BAXTER ROAD C/O 427 LAURIER AVENUE SUITE 300 OTTAWA ON K2C 3P1	115.6	<u>33</u>
CLIMEC RESIDENTIAL INC.	1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	115.6	<u>33</u>
RESET ELECTRONICS INC.	1050 BAXTER RD. OTTAWA ON K2C 3P1	115.6	<u>33</u>
HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	115.6	<u>33</u>
UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	115.6	<u>33</u>
RESET ELECTRONICS INC.	1050 BAXTER RD. OTTAWA ON K2C 3P1	115.6	<u>33</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CLIMEC RESIDENTIAL INC.	1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	115.6	<u>33</u>
HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	115.6	<u>33</u>
UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	115.6	<u>33</u>
CLIMEC RESIDENTIAL INC.	1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	115.6	<u>33</u>
HOLMES HEATING INC	1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	115.6	<u>33</u>
DEBOER'S	1050 BAXTER ROAD OTTAWA ON K2C 3P1	115.6	<u>33</u>
UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	115.6	<u>33</u>
UTC Canada Corporation	1050 Baxter Road Ottawa ON K2C 3P1	115.6	<u>33</u>
INTERNATIONAL DATACAST (OUT OF BUSINESS)	2650 QUEENSVIEW DRIVE, SUITE 260 OTTAWA ON K2B 8H6	167.5	<u>62</u>
INTERNATIONAL DATACASTING CORP. 21-546	2650 QUEENSVIEW DRIVE, SUITE 260 OTTAWA ON K2B 8H6	167.5	<u>62</u>
Proslide Technology Inc.	2650 Queensview Drive Ottawa ON	167.5	<u>62</u>
IRIS PLAZA	1105 Cobden Rd Ottawa ON K2C2Z1	193.6	<u>65</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA HYDRO	2317 EDWIN CRESCENT OTTAWA ON K2C 1H8	199.5	<u>67</u>
OTTAWA HYDRO 29-541	2317 EDWIN CRESCENT OTTAWA ON K2C 1H8	199.5	<u>67</u>
BLACK PHOTO CORPORATION	2685 IRIS STREET, OTTAWA C/O 371 GOUGH ROAD MARKHAM ON K2C 3S4	210.5	<u>71</u>
BLACK PHOTO CORPORAT (OUT OF BUSINESS)	2685 IRIS STREET, OTTAWA C/O 371 GOUGH ROAD MARKHAM ON K2C 3S4	210.5	<u>71</u>
BLACK PHOTO CORPORATION 05- 422	2685 IRIS STREET, OTTAWA C/O 371 GOUGH ROAD MARKHAM ON K2C 3S4	210.5	<u>71</u>
BLACK PHOTO CORPORAT (OUT OF BUSINESS)	2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>
NATIONAL GROCERS COMPANY LTD.	2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>
NATIONAL GROCERS COMPANY LTD.	LOBLAWS SUPERMARKETS LTD. 2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>
PHARMA PLUS DRUGS LTD	2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>
PHARMA PLUS DRUGS LTD. 31-674	2685 IRIS STREET, OTTAWA C/O 5935 AIRPORT ROAD STE. 500 MISSISSAUGA ON K2C 3S4	210.5	<u>71</u>
PHARMA PLUS DRUGS LTD(OUT OF BUSINESS)	2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
DRUGSTORE PHARMACY, THE	2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>
IKEA Canada	2685 Iris Street Pinecrest shopping Mall Ottawa ON K2C 3S4	210.5	<u>71</u>
IKEA Canada Limited Partnership	2685 Iris Street Ottawa ON	210.5	<u>71</u>
IKEA CANADA	2685 Iris Street Ottawa ON K2C 3S4	210.5	<u>71</u>
IKEA CANADA	2685 Iris Street Ottawa ON K2C 3S4	210.5	<u>71</u>
SEARS CANADA INC	2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>
IKEA CANADA	2685 Iris Street Ottawa ON K2C 3S4	210.5	<u>71</u>
AECON BUILDINGS INC.	2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>
IKEA CANADA	2685 Iris Street Ottawa ON K2C 3S4	210.5	<u>71</u>
IKEA CANADA LTD PARTNERSHIP	2685 Iris Street Ottawa ON K2C 3S4	210.5	<u>71</u>
IKEA CANADA LTD PARTNERSHIP	2685 Iris Street Ottawa ON	210.5	<u>71</u>
Michaels Stores, Inc.	2685 Iris St Ottawa ON	210.5	<u>71</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	210.5	<u>71</u>
IKEA CANADA LTD PARTNERSHIP	2685 Iris Street Ottawa ON K2C3S4	210.5	<u>71</u>
IKEA CANADA LTD PARTNERSHIP	2685 Iris Street Ottawa ON K2C3S4	210.5	<u>71</u>
Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	210.5	<u>71</u>
IKEA CANADA LTD PARTNERSHIP	2685 Iris Street Ottawa ON K2C3S4	210.5	<u>71</u>
Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	210.5	<u>71</u>
Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	210.5	<u>71</u>
IKEA CANADA LTD PARTNERSHIP OTTAWA (004)	2685 Iris Street Ottawa ON K2C3S4	210.5	<u>71</u>
Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	210.5	<u>71</u>
IKEA CANADA LTD PARTNERSHIP OTTAWA (004)	2685 Iris Street Ottawa ON K2C3S4	210.5	<u>71</u>
Michaels Stores, Inc.	2685 Iris St Ottawa ON K2C 3S4	210.5	<u>71</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
IKEA CANADA LTD PARTNERSHIP OTTAWA (004)	2685 Iris Street Ottawa ON K2C3S4	210.5	<u>71</u>
IKEA Canada Limited Partnership	Pinecrest Shopping Centre, 2685 Iris Street Ottawa ON	210.5	<u>71</u>
Michaels Stores Inc.	2685 Iris Street Ottawa ON	210.5	<u>71</u>
OTTAWA-CARLETON REG. TRANSIT COMM.	2550 QUEENSVIEW DRIVE OTTAWA ON K2B 8H6	229.1	<u>73</u>
OTTAWA-CARLETON REG. TRANSIT COMM.	2550 QUEENSVIEW DRIVE C/O 1500 ST. LAURENT BLVD. OTTAWA ON K2B 8H6	229.1	<u>73</u>
OTTAWA-CARLETON REG. TRANSIT COMM.29-265	2550 QUEENSVIEW DRIVE C/O 1500 ST. LAURENT BLVD. OTTAWA ON K2B 8H6	229.1	<u>73</u>
OTTAWA-CARLETON REG. TRANSIT COMMISSION	2550 QUEENSVIEW DRIVE OTTAWA ON K2B 8H6	229.1	<u>73</u>
OC TRANSP0	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON	229.1	<u>73</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	229.1	<u>73</u>
City of Ottawa, OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	229.1	<u>73</u>
OC Transpo	2550 QUEENSVIEW ROAD OTTAWA ON	229.1	<u>73</u>
Ottawa Catholic District School Board	1175 Soderlind Rd Ottawa ON	245.1	<u>76</u>
Ottawa Catholic District School Board	1175 Soderlind St. Ottawa ON	245.1	<u>76</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
SiGe Semiconductor Inc.	2680 Queensview Drive Ottawa ON K2B 8J9	294.7	<u>92</u>
International Datacasting Corporation	2680 Queensview Drive Ottawa ON K2B 8J9	294.7	<u>92</u>
EllisDon Corporation Ottawa Buildings	2680 Queensview Drive Ottawa ON K2B8J9	294.7	<u>92</u>
EllisDon Corporation	2680 Queensview Drive Ottawa ON	294.7	<u>92</u>
LEE VALLEY TOOLS LTD.	2680 QUEENSVIEW DR. OTTAWA ON K2B 8J9	294.7	<u>92</u>
LEE VALLEY TOOLS LTD-OUT OF BUS	2680 QUEENSVIEW DR. OTTAWA ON K2B 8J9	294.7	<u>92</u>
LEE VALLEY TOOLS LTD-OUT OF BUS 24-400	2680 QUEENSVIEW DR. OTTAWA ON K2B 8J9	294.7	<u>92</u>

INC - Fuel Oil Spills and Leaks

A search of the INC database, dated 31 Oct, 2023 has found that there are 1 INC site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CITY OF OTTAWA OC TRANSP	2550 QUEENSVIEW DR OTTAWA ON	229.1	<u>73</u>

NPCB - National PCB Inventory

A search of the NPCB database, dated 1988-2008* has found that there are 1 NPCB site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA CITIZEN	1101 BAXTER ROAD OTTAWA ON K2C 3Z3	0.0	<u>1</u>

NPR2 - National Pollutant Release Inventory

A search of the NPR2 database, dated Feb 2024 has found that there are 1 NPR2 site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
THE OTTAWA CITIZEN	1101 BAXTER ROAD OTTAWA ON K2C3M4	0.0	<u>1</u>

NPRI - National Pollutant Release Inventory - Historic

A search of the NPRI database, dated 1993-May 2017 has found that there are 2 NPRI site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OC TRANSP	2550 Queensview Drive Ottawa ON K2B8H6	229.1	<u>73</u>
OC TRANSP	2550 Queensview Drive Ottawa ON K2B8H6	229.1	<u>73</u>

OPCB - Inventory of PCB Storage Sites

A search of the OPCB database, dated 1987-Oct 2004; 2012-Dec 2013 has found that there are 5 OPCB site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA CITIZEN	1101 BAXTER ROAD, BOX 5020 OTTAWA ON K2C 3Z3	0.0	<u>1</u>
OTTAWA CITIZEN	1101 BAXTER ROAD OTTAWA ON K2C 3Z3	0.0	<u>1</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
OTTAWA CITIZEN	1101 BAXTER ROAD, BOX 5020 OTTAWA ON K2C 3Z3	0.0	<u>1</u>
OTTAWA CITIZEN	1101 BAXTER ROAD OTTAWA ON K2C 3Z3	0.0	<u>1</u>
OTTAWA CITIZEN	1101 BAXTER ROAD OTTAWA ON K2C 3Z3	0.0	<u>1</u>

PES - Pesticide Register

A search of the PES database, dated Oct 2011 - Jul 31, 2025 has found that there are 4 PES site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
LOBLAWS SUPERMARKETS LTD. #153-5	2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>
ZELLERS INC. STORE 53	PINECREST S.C., 2685 IRIS STREET OTTAWA ON K2C 3S4	210.5	<u>71</u>
LOBLAWS SUPERMARKETS LTD #1153	2685 IRIS ST OTTAWA ON K2C3S4	210.5	<u>71</u>
LOBLAWS SUPERMARKETS LTD#1153	2685 IRIS ST OTTAWA ON K2C3S4	210.5	<u>71</u>

PFAS - Ontario PFAS Spills

A search of the PFAS database, dated 1988-Jun 2024; Aug 2024; Oct-Nov 2024 has found that there are 1 PFAS site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
2685 Iris Street	IKEA, 2685 Iris St, Ottawa OTTAWA ON	210.5	<u>71</u>

PINC - Pipeline Incidents

A search of the PINC database, dated Feb 28, 2021 has found that there are 1 PINC site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
VINTEX INC	DEMPSEY AVE & IRISH ST.,OTTAWA,ON, K2C 1M1,CA ON	123.6	<u>42</u>

PRT - Private and Retail Fuel Storage Tanks

A search of the PRT database, dated 1989-1996* has found that there are 3 PRT site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
THE OTTAWA CITIZEN	1101 BAXTER RD OTTAWA ON K2C 3Z3	0.0	<u>1</u>
OTTAWA CARLETON REGIONAL TRANSIT COMMISSION	2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	229.1	<u>73</u>
OTTAWA CARLETON REGIONAL TRANSIT COMMISSION	2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	229.1	<u>73</u>

SCT - Scott's Manufacturing Directory

A search of the SCT database, dated 1992-Mar 2011* has found that there are 18 SCT site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
SOUTHAM NEWSPAPER GROUP	1101 BAXTER RD OTTAWA ON K2C 3Z3	0.0	<u>1</u>
SOUTHAM NEWSPAPER GROUP	1101 BAXTER RD OTTAWA ON K2C 3Z3	0.0	<u>1</u>
Southam Publications Inc. - A CanWest Company - The Ottawa Citizen	1101 Baxter Rd Ottawa ON K2C 3Z3	0.0	<u>1</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
CanWest Publications Inc. - The Ottawa Citizen - A CanWest Company	1101 Baxter Rd Ottawa ON K2C 3Z3	0.0	<u>1</u>
Ottawa Citizen	1101 Baxter Rd Ottawa ON K2C 3Z3	0.0	<u>1</u>
Dipix Technologies Inc.	1051 Baxter Rd Ottawa ON K2C 3P2	62.7	<u>15</u>
PPI Systems	1051 Baqxter Rd Unit 21 Ottawa ON K2C 3P2	62.7	<u>15</u>
PPI Systems	1051 Baxter Rd Unit 21 Ottawa ON K2C 3P2	62.7	<u>15</u>
Optelian	1051 Baxter Rd Suite 22A Ottawa ON K2C 3P2	62.7	<u>15</u>
Cummings Mitchell Inc.	1050 Baxter Rd Unit 11 Ottawa ON K2C 3P1	115.6	<u>33</u>
HUBER+SUHNER Canada	2650 Queensview Dr Suite 206 Ottawa ON K2B 8H6	167.5	<u>62</u>
ProSlide Technology Inc.	2650 Queensview Dr Suite 150 Ottawa ON K2B 8H6	167.5	<u>62</u>
Avanex Corporation	2299 Edwin Cres Ottawa ON K2C 1H8	185.9	<u>63</u>
INTERNATIONAL DATACASTING	2680 QUEENSVIEW DR OTTAWA ON K2B 8J9	294.7	<u>92</u>
INTERNATIONAL DATACASTING INC.	2680 Queensview Dr Ottawa ON K2B 8J9	294.7	<u>92</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
International Datacasting Corp	2680 Queensview Dr Ottawa ON K2B 8J9	294.7	<u>92</u>
SiGe Semiconductor, Inc.	2680 Queensview Dr Ottawa ON K2B 8J9	294.7	<u>92</u>
Integrating Solutions Inc.	2680 Queensview Dr Suite 100 Ottawa ON K2B 8J9	294.7	<u>92</u>

SPL - Ontario Spills

A search of the SPL database, dated 1988-Jun 2024; Aug 2024; Oct-May 2025 has found that there are 46 SPL site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
TRANSPORT TRUCK	1101 BAXTER ROAD THE OTTAWA CITIZEN MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON K2C 3Z3	0.0	<u>1</u>
OTTAWA CITIZEN, THE	1101 BAXTER RD PARKING LOT OTTAWA PLANT 1101 BAXTER ROAD OTTAWA CITY ON K2C 3Z3	0.0	<u>1</u>
OTTAWA CITIZEN, THE	1101 BAXTER ROAD OTTAWA PLANT 1101 BAXTER ROAD OTTAWA CITY ON K2C 3Z3	0.0	<u>1</u>
	45.353700, -75.782646 OTTAWA ON	68.3	<u>16</u>
Roger Rossi	Unit 5 - 1050 Baxter Rd Ottawa ON K2C 3P1	115.6	<u>33</u>
	45.354181, -75.781171 OTTAWA ON	115.6	<u>33</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Enbridge Gas Distribution Inc.	Dempsey Ave and Irish Street Ottawa ON	123.6	<u>42</u>
	45.354877, -75.781035 OTTAWA ON	125.1	<u>43</u>
	45.35476, -75.78189 OTTAWA ON	130.2	<u>50</u>
KIEWIT EUROVIA VINCI	OTTAWA ON	159.7	<u>59</u>
	2620 Iris St. OTTAWA ON	160.9	<u>60</u>
Kiewit Eurovia Vinci	2600 Queensview Dr. Ottawa ON	167.2	<u>61</u>
	2600 Queensview Drive OTTAWA ON	167.2	<u>61</u>
	2600 Queensview drive Ottawa ON	167.2	<u>61</u>
	2600 Queensview Dr. Ottawa ON K2B 8H6 OTTAWA ON	167.2	<u>61</u>
SERVICE STATION	COBDON & IRIS (N.O.S.) OTTAWA CITY ON	193.5	<u>64</u>
KIEWIT EUROVIA VINCI	45.355491, -75.780125 OTTAWA ON	206.3	<u>69</u>
PRIVATE BUSINESS	2685 IRIS ST. PINECREST SHOPPING CENTRE (N.O.S.) OTTAWA CITY ON K2C 3S4	210.5	<u>71</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
Enbridge Gas Distribution Inc.	2685 Iris Street Ottawa ON K2C 3S4	210.5	<u>71</u>
Ottawa Metro Towing and Recovery Inc.	2685 Iris St Ottawa ON	210.5	<u>71</u>
	2685 Iris St (Hwy 417 and Pinecrest) Ottawa ON	210.5	<u>71</u>
KIEWIT EUROVIA VINCI OTTAWA PARTNERSHIP	2685 Iris St, Ottawa, ON K2C 3S4 OTTAWA ON	210.5	<u>71</u>
2685 Iris Street	IKEA, 2685 Iris St, Ottawa OTTAWA ON	210.5	<u>71</u>
OTTAWA-CARLETON	O-C TRANSIT DEPOT; 2550 QUEENSVIEW DR OC TRANSPOR GARAGE OTTAWA CITY ON K2B 8H6	229.1	<u>73</u>
TRANSPORT TRUCK	2550 QUEENSVIEW DR. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON K2B 8H6	229.1	<u>73</u>
Veolia ES Canada Industrial Services Inc.	2550 Queensview Drive Ottawa ON K2B 8H6	229.1	<u>73</u>
City of Ottawa	2550 Queensview Dr Ottawa ON	229.1	<u>73</u>
	2550 Queensview Dr Ottawa ON	229.1	<u>73</u>
KIEWIT EUROVIA VINCI OTTAWA PARTNERSHIP	2550 Queensview Dr., Ottawa OTTAWA ON	229.1	<u>73</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	45.355038, - 75.780809, Ottawa, ON OTTAWA ON	230.6	<u>74</u>
Kiewit Eurovia Vinci	2670 Queensview Dr Ottawa ON	240.3	<u>75</u>
	2670 Queensview Dr, Ottawa ON OTTAWA ON	240.3	<u>75</u>
	2670 Queensview Drive, Ottawa ON OTTAWA ON	240.3	<u>75</u>
	2670 Queensview Dr. OTTAWA ON	240.3	<u>75</u>
	behind 2670 Queensview Drive, Ottawa OTTAWA ON	240.3	<u>75</u>
	2670 Queensview Dr, Ottawa OTTAWA ON	240.3	<u>75</u>
	2670 Queensview Drive Ottawa, ON OTTAWA ON	240.3	<u>75</u>
Munro and Scullion Contracting Inc<UNOFFICIAL>	2611 Queensview Drive Ottawa ON	251.6	<u>80</u>
KIEWIT EUROVIA VINCI OTTAWA PARTERNSHIP	Connaught Ave and Roman Ave, Ottawa, ON OTTAWA ON	270.9	<u>84</u>
LAFARGE CANADA INC.	Roman Ave and Cannaught, Ottawa ON OTTAWA ON	270.9	<u>84</u>
KIEWIT EUROVIA VINCI	OTTAWA ON	279.5	<u>86</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
City of Ottawa<UNOFFICIAL>	2237 Elmira Road Ottawa ON	284.2	<u>88</u>
	Ottawa ON	285.0	<u>90</u>
	2680 Queensview Dr. Ottawa OTTAWA ON	294.7	<u>92</u>
LAFARGE CANADA INC.	2680 Queensview Dr, Ottawa OTTAWA ON	294.7	<u>92</u>
	45.356050 -75.780023, Ottawa OTTAWA ON	297.1	<u>94</u>

WWIS - Water Well Information System

A search of the WWIS database, dated Dec 31 2023 has found that there are 51 WWIS site(s) within approximately 0.30 kilometers of the project property.

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1011 BAXTER RD Ottawa ON	0.0	<u>2</u>
	Well ID: 7318227		
	1011 BAXTER RD lot 22 con 2 Ottawa ON	0.0	<u>3</u>
	Well ID: 7318233		
	1011 BAXTER RD lot 22 con 2 Ottawa ON	0.0	<u>4</u>
	Well ID: 7318228		
	1011 BAXTER RD lot 22 con 2 Ottawa ON	0.0	<u>5</u>
	Well ID: 7318229		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	1011 BAXTER RD lot 22 con 2 Ottawa ON <i>Well ID: 7318230</i>	0.0	<u>6</u>
	1101 bayter rd Ottawa ON <i>Well ID: 7328635</i>	2.0	<u>7</u>
	1101 BAXTER RD Ottawa ON <i>Well ID: 7328598</i>	0.0	<u>8</u>
	1051 Baxter Rd Ottawa ON <i>Well ID: 7382664</i>	6.9	<u>9</u>
	1051 Baxter Rd Ottawa ON <i>Well ID: 7382713</i>	11.3	<u>10</u>
	1050 BAXTER RD Ottawa ON <i>Well ID: 7231534</i>	11.9	<u>11</u>
	1051 Baxter Rd Ottawa ON <i>Well ID: 7382714</i>	12.9	<u>12</u>
	1099 BAXTER ST Ottawa ON <i>Well ID: 7232100</i>	30.4	<u>13</u>
	2685 IRIS STREET OTTAWA ON <i>Well ID: 7046634</i>	70.6	<u>18</u>
	1050 BAXTER RD Ottawa ON <i>Well ID: 7231535</i>	78.9	<u>19</u>
	1050 BAXTER ROAD OTTAWA ON <i>Well ID: 7255861</i>	83.9	<u>20</u>
	2685 IRIS STREET Ottawa ON	88.7	<u>22</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7147017		
	2785 IRIS ST Ottawa ON	99.1	<u>23</u>
	Well ID: 7159666		
	2685 IRIS ST Ottawa ON	99.3	<u>24</u>
	Well ID: 7159667		
	2685 IRIS STREET Ottawa ON	100.1	<u>25</u>
	Well ID: 7147018		
	2685 IRIS ST Ottawa ON	100.5	<u>26</u>
	Well ID: 7159665		
	2685 IRIS ST Ottawa ON	105.2	<u>29</u>
	Well ID: 7159664		
	2685 IRIS STREET Ottawa ON	112.6	<u>30</u>
	Well ID: 7147019		
	2685 IRIS STREET Ottawa ON	112.7	<u>31</u>
	Well ID: 7147021		
	2685 IRIS STREET Ottawa ON	112.9	<u>32</u>
	Well ID: 7147020		
	2685 IRIS ST Ottawa ON	116.6	<u>34</u>
	Well ID: 7159663		
	1050 BAXTER RD OTTAWA ON	117.0	<u>35</u>
	Well ID: 7255863		
	1119-1143 BAXTER RD Ottawa ON	118.7	<u>36</u>
	Well ID: 7233764		

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	2685 IRIS ST Ottawa ON <i>Well ID: 7159662</i>	119.1	<u>37</u>
	2685 IRIS STREET Ottawa ON <i>Well ID: 7147022</i>	120.9	<u>38</u>
	2685 IRIS STREET Ottawa ON <i>Well ID: 7147024</i>	121.8	<u>39</u>
	2685 IRIS STREET Ottawa ON <i>Well ID: 7147023</i>	122.2	<u>40</u>
	2685 IRIS ST Ottawa ON <i>Well ID: 7159661</i>	122.4	<u>41</u>
	2685 IRIS STREET Ottawa ON <i>Well ID: 7147025</i>	125.9	<u>44</u>
	2685 IRIS ST Ottawa ON <i>Well ID: 7159660</i>	126.0	<u>45</u>
	2685 IRIS STREET Ottawa ON <i>Well ID: 7147026</i>	126.5	<u>46</u>
	2685 IRIS ST Ottawa ON <i>Well ID: 7159659</i>	126.8	<u>47</u>
	Ottawa ON <i>Well ID: 7147027</i>	127.4	<u>48</u>
	2685 IRIS STREET Ottawa ON <i>Well ID: 7147029</i>	129.3	<u>49</u>
	2685 IRIS STREET Ottawa ON	132.8	<u>51</u>

<u>Site</u>	<u>Address</u>	<u>Distance (m)</u>	<u>Map Key</u>
	Well ID: 7155561		
	2685 IRIS STREET Ottawa ON	133.3	<u>52</u>
	Well ID: 7147028		
	ON	134.9	<u>53</u>
	Well ID: 7159657		
	2685 IRIS ST Ottawa ON	135.1	<u>54</u>
	Well ID: 7159658		
	1119-1143 BAXTER RD Ottawa ON	138.0	<u>55</u>
	Well ID: 7233763		
	2685 IRIS ST Ottawa ON	138.7	<u>56</u>
	Well ID: 7159656		
	1119-1143 BAXTER RD Ottawa ON	140.9	<u>57</u>
	Well ID: 7233762		
	1129 BAXTOR ST. Ottawa ON	156.2	<u>58</u>
	Well ID: 7136631		
	2685 IRIS ST. NAPEAN ON	209.6	<u>70</u>
	Well ID: 7051219		
	1175 SODERLIND ST Ottawa ON	248.3	<u>77</u>
	Well ID: 7229422		
	2550 QUEENSVIEW DR Ottawa ON	274.2	<u>85</u>
	Well ID: 7386190		
	2655 QUEENSVIEW DRIVE BEHIND LOCATION Ottawa ON	284.5	<u>89</u>
	Well ID: 7339878		

Site**Address**

2550 QUEENSVIEW DR
Ottawa ON

Well ID: 7386191


Distance (m)

286.5

Map Key

[91](#)

75°47'W

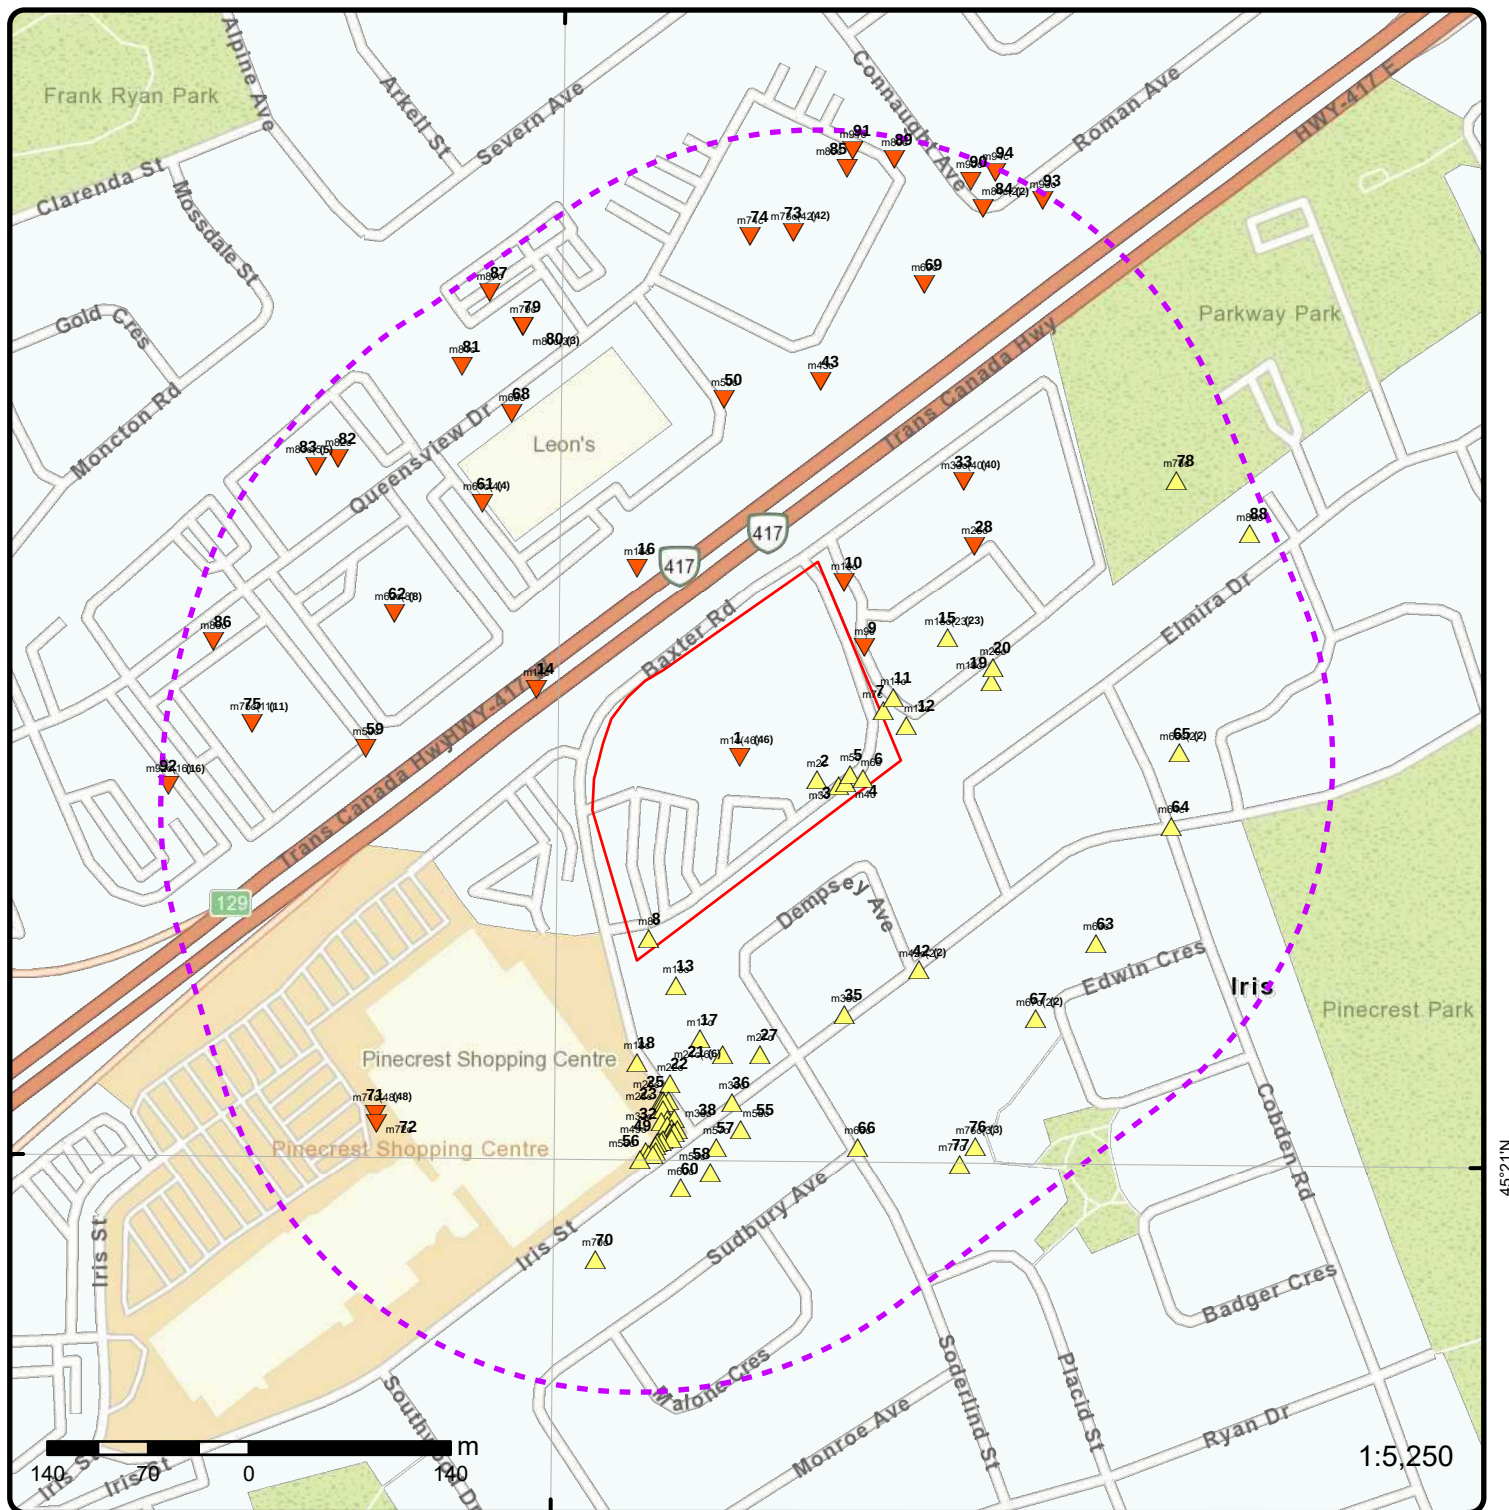

Map: 0.3 Kilometer Radius

Order Number: 25082500253

Address: 1101 Baxter Road, Ottawa, ON



 Project Property	 Freeways; Highways	 Beach	 Shopping & Sports Area
 Buffer Outline	 Traffic Circle; Ramp	 Airport	 University/College
▲ Eris Sites with Higher Elevation	 Major Arterial; Minor Arterial	 Industrial Area	 Cemetery; Golf Course
▲ Eris Sites with Same Elevation	 Local Road	 Military Base	 Parkt (National)
▲ Eris Sites with Lower Elevation	 Service Road; Traffic Circle; Ramp	 Aircraft Roads	 Park (City/County)
 Eris Sites with Unknown Elevation	 Rail	 Native Reservation	 Hospital

75°47'30"W

75°47'W


75°46'30"W

45°21'30"N

45°21'N

45°21'30"N

45°21'N

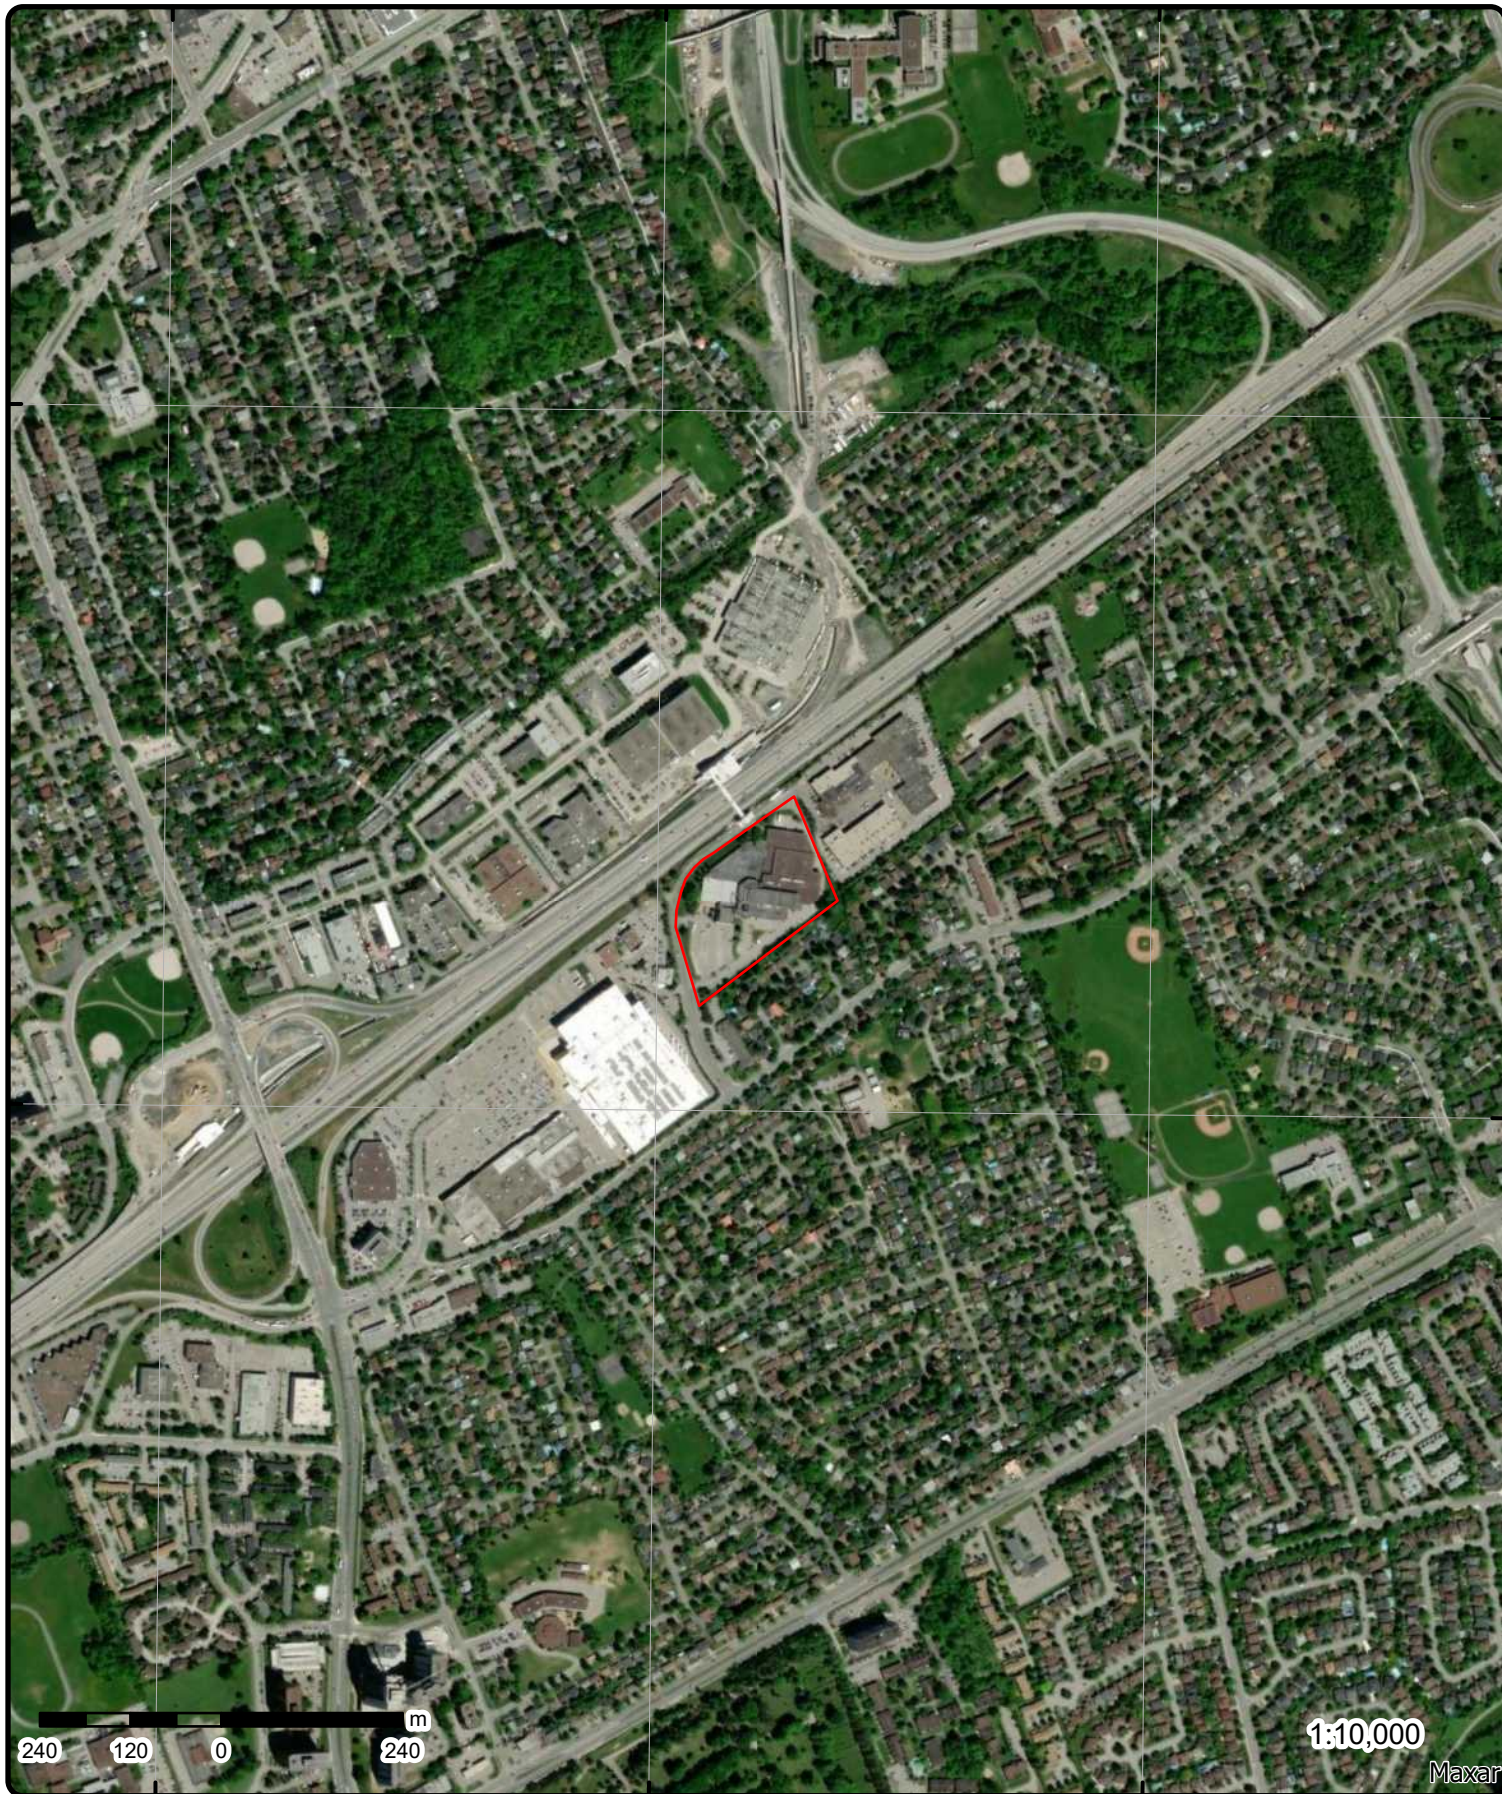

Aerial

Year: 2025


Order Number: 25082500253

Address: 1101 Baxter Road, Ottawa, ON



Source: ESRI World Imagery

© ERIS Information Limited Partnership

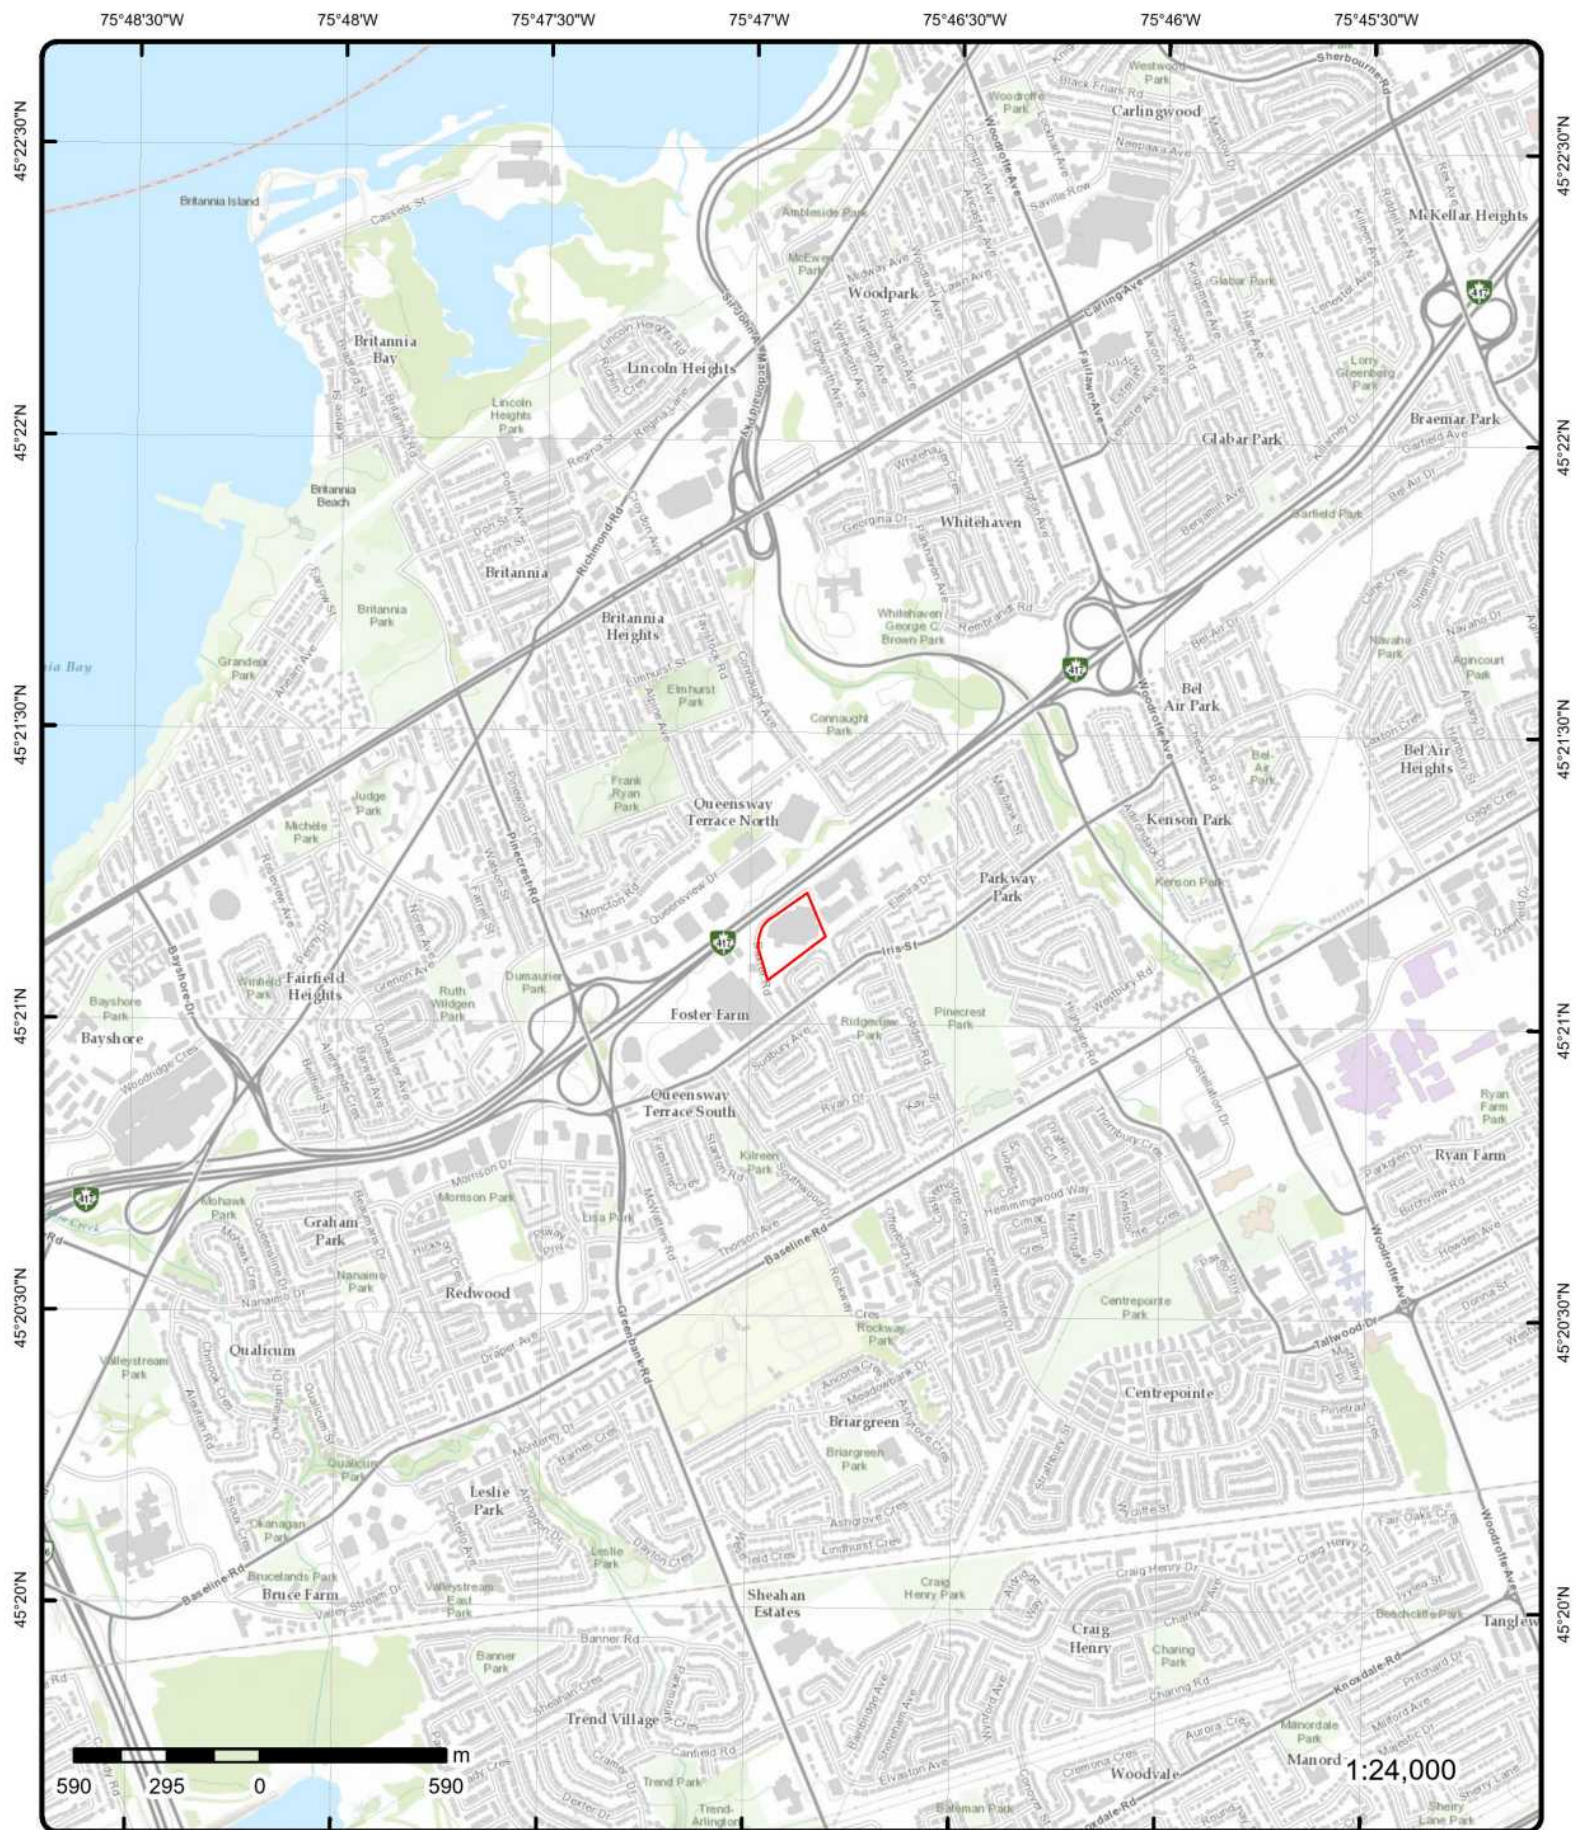

Topographic Map

Address: 1101 Baxter Road, ON

Source: ESRI World Topographic Map

Order Number: 25082500253



© ERIS Information Limited Partnership

Detail Report

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	1 of 46	E/0.0	70.9 / -0.85	Ottawa Citizen Group Inc. 1101 Baxton Road Ottawa ON	CA
Certificate #: 4309-5KKSJH Application Year: 2003 Issue Date: 3/28/2003 Approval Type: Air Status: Revoked and/or Replaced Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
1	2 of 46	E/0.0	70.9 / -0.85	Ottawa Citizen Group Inc. 1101 Baxter Rd Ottawa ON K2C 3Z3	CA
Certificate #: 8163-7VCJVG Application Year: 2009 Issue Date: 8/31/2009 Approval Type: Air Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
1	3 of 46	E/0.0	70.9 / -0.85	THE OTTAWA CITIZEN 1101 BAXTER RD OTTAWA ON	DTNK
<u>Delisted Expired Fuel Safety Facilities</u> Instance No: 9235519 Status: EXPIRED Instance ID: 382529 Instance Type: FS Facility Instance Creation Dt: Instance Install Dt: Item Description: Expired Date: Max Hazard Rank: Facility Location: Facility Type: Fuel Type 2: Fuel Type 3: Panam Related:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Manufacturer:				Panam Venue Nm:	
Model:				External Identifier:	
Serial No:				Item:	
ULC Standard:				Piping Steel:	
Quantity:				Piping Galvanized:	
Unit of Measure:				Tank Single Wall St:	
Overfill Prot Type:				Piping Underground:	
Creation Date:				Tank Underground:	
Next Periodic Str DT:				Source:	
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:		Fuels Safety Private Fuel Outlet - Self Serve			
Original Source:		EXP			
Record Date:		Up to Mar 2012			

Delisted Expired Fuel Safety Facilities

1	5 of 46	E/0.0	70.9 / -0.85	THE OTTAWA CITIZEN 1101 BAXTER RD	DTNK

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OTTAWA ON					
<u>Delisted Expired Fuel Safety Facilities</u>					
Instance No:	10900985			Expired Date:	
Status:	EXPIRED			Max Hazard Rank:	
Instance ID:	51019			Facility Location:	
Instance Type:	FS Piping			Facility Type:	
Instance Creation Dt:				Fuel Type 2:	
Instance Install Dt:				Fuel Type 3:	
Item Description:				Panam Related:	
Manufacturer:				Panam Venue Nm:	
Model:				External Identifier:	
Serial No:				Item:	
ULC Standard:				Piping Steel:	
Quantity:				Piping Galvanized:	
Unit of Measure:				Tank Single Wall St:	
Overfill Prot Type:				Piping Underground:	
Creation Date:				Tank Underground:	
Next Periodic Str DT:				Source:	
TSSA Base Sched Cycle 2:					
TSSAMax Hazard Rank 1:					
TSSA Risk Based Periodic Yn:					
TSSA Volume of Directives:					
TSSA Periodic Exempt:					
TSSA Statutory Interval:					
TSSA Recd Insp Interva:					
TSSA Recd Tolerance:					
TSSA Program Area:					
TSSA Program Area 2:					
Description:	FS Piping				
Original Source:	EXP				
Record Date:	Up to Mar 2012				
<u>1</u>	6 of 46	E/0.0	70.9 / -0.85	Ottawa Citizen Group Inc. 1101 Baxter Road Ottawa CITY OF OTTAWA ON	EBR
EBR Registry No:	010-2235			Decision Posted:	
Ministry Ref No:	4215-78YM66			Exception Posted:	
Notice Type:	Instrument Decision			Section:	
Notice Stage:				Act 1:	
Notice Date:	September 08, 2009			Act 2:	
Proposal Date:	December 03, 2007			Site Location Map:	
Year:	2007				
Instrument Type:	(EPA s. 9) - Approval for discharge into the natural environment other than water (i.e. Air)				
Off Instrument Name:					
Posted By:					
Company Name:	Ottawa Citizen Group Inc.				
Site Address:					
Location Other:					
Proponent Name:					
Proponent Address:	1101 Baxter Road, Ottawa Ontario, Canada K2C 3M4				
Comment Period:					
URL:					
Summary:					
Site Location Details:					
1101 Baxter Road Ottawa CITY OF OTTAWA					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	7 of 46	E/0.0	70.9 / -0.85	Ottawa Citizen Group Inc. 1101 Baxter Rd Ottawa ON K2C 3M4	ECA
Approval No: 8163-7VCJVG Approval Date: 2009-08-31 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-AIR Project Type: AIR Business Name: Ottawa Citizen Group Inc. Address: 1101 Baxter Rd Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/4215-78YM66-14.pdf PDF Site Location: MOE District: Ottawa City: Longitude: -75.7816 Latitude: 45.352497 Geometry X: Geometry Y:					
1	8 of 46	E/0.0	70.9 / -0.85	Ottawa Citizen Group Inc. 1101 Baxton Road Ottawa ON	ECA
Approval No: 4309-5KKSJH Approval Date: 2003-03-28 Status: Revoked and/or Replaced Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-AIR Project Type: AIR Business Name: Ottawa Citizen Group Inc. Address: 1101 Baxton Road Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/7242-5EKTDJ-14.pdf PDF Site Location: MOE District: Ottawa City: Longitude: -75.7816 Latitude: 45.352497 Geometry X: Geometry Y:					
1	9 of 46	E/0.0	70.9 / -0.85	1101 Baxter Rd Ottawa ON K2C 3Z3	EHS
Order No: 20000911023 Status: C Report Type: Complete Report Report Date: 9/28/00 Date Received: 9/11/00 Previous Site Name: Lot/Building Size: Additional Info Ordered: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.50 X: -75.782722 Y: 45.352737					
1	10 of 46	E/0.0	70.9 / -0.85	1101 Baxter Road Ottawa ON K2C 3Z3	EHS
Order No: 20091217012 Status: C Report Type: Custom Report Report Date: 12/23/2009 Date Received: 12/17/2009 Previous Site Name: Lot/Building Size: Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.78208 Y: 45.352804					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:					
<u>1</u>	11 of 46	E/0.0	70.9 / -0.85	1101 Baxter Rd Ottawa ON K2C3Z3	EHS
Order No: 20170113038 Status: C Report Type: Standard Report Report Date: 19-JAN-17 Date Received: 13-JAN-17 Previous Site Name: Lot/Building Size: 3.51 ha Additional Info Ordered:		Nearest Intersection: Municipality: Nepean Township, Ottawa Front Client Prov/State: ON Search Radius (km): .25 X: -75.781721 Y: 45.352526			
<u>1</u>	12 of 46	E/0.0	70.9 / -0.85	1101 baxter road Ottawa ON K2C 3Z3	EHS
Order No: 20180926198 Status: C Report Type: Standard Report Report Date: 03-OCT-18 Date Received: 26-SEP-18 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.781612 Y: 45.352774			
<u>1</u>	13 of 46	E/0.0	70.9 / -0.85	THE OTTAWA CITIZEN 1101 BAXTER RD OTTAWA ON	EXP
Inventory No: 10900991 Inventory Status: EXPIRED Installation Year: 1979 Capacity: 13638 Capacity Unit: Tank Type: Manufacturer: Model: Description: UNDERGROUND TANK Previous Fuel Type: ASPER E063251 Diesel		Tank Material: Steel Corrosion Protect: Impressed Current Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK			
<u>1</u>	14 of 46	E/0.0	70.9 / -0.85	THE OTTAWA CITIZEN 1101 BAXTER RD OTTAWA ON	EXP
Inventory No: 10900976 Inventory Status: EXPIRED Installation Year: 1979 Capacity: 13638 Capacity Unit: Tank Type: Manufacturer: Model: Description: UNDERGROUND TANK Previous Fuel Type: ASPER E063251 Gasoline		Tank Material: Steel Corrosion Protect: Impressed Current Overfill Protection: Inventory Context: FS Liquid Fuel Tank Inventory Item: FS LIQUID FUEL TANK			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	15 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN, THE 1101 BAXTER ROAD P.O. BOX 5020 OTTAWA ON K2C 3Z3	GEN
<u>Generator Info</u>					
Generator No:		ON0170700		Choice of Contact:	
Approval Years:		86,87,88,89,90		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 2841	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		NEWSPAPER, ETC. IND.			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
1	16 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN, THE 10-062 1101 BAXTER ROAD OTTAWA ON K2C 3M4	GEN

Generator Info

Generator No:	ON0170700	Choice of Contact:	
Approval Years:	92,93,94,95,96	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	2841
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	NEWSPAPER, ETC. IND.		

Waste Detail(s)

Waste Class:	112
Waste Class Name:	ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCB'S			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			

<u>1</u>	17 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN, THE 1101 BAXTER ROAD OTTAWA ON K2C 3M4	GEN

Generator Info

Generator No:	ON0170700	Choice of Contact:	
Approval Years:	97,98,99,00,01	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	2841
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	NEWSPAPER, ETC. IND.		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:			264		
Waste Class Name:			PHOTOPROCESSING WASTES		
<u>Waste Detail(s)</u>					
Waste Class:			112		
Waste Class Name:			ACID WASTE - HEAVY METALS		
<u>Waste Detail(s)</u>					
Waste Class:			121		
Waste Class Name:			ALKALINE WASTES - HEAVY METALS		
<u>Waste Detail(s)</u>					
Waste Class:			221		
Waste Class Name:			LIGHT FUELS		
<u>Waste Detail(s)</u>					
Waste Class:			145		
Waste Class Name:			PAINT/PIGMENT/COATING RESIDUES		
<u>Waste Detail(s)</u>					
Waste Class:			146		
Waste Class Name:			OTHER SPECIFIED INORGANICS		
<u>Waste Detail(s)</u>					
Waste Class:			213		
Waste Class Name:			PETROLEUM DISTILLATES		
<u>Waste Detail(s)</u>					
Waste Class:			241		
Waste Class Name:			HALOGENATED SOLVENTS		
<u>Waste Detail(s)</u>					
Waste Class:			243		
Waste Class Name:			PCB'S		
<u>Waste Detail(s)</u>					
Waste Class:			252		
Waste Class Name:			WASTE OILS & LUBRICANTS		
<u>Waste Detail(s)</u>					
Waste Class:			251		
Waste Class Name:			OIL SKIMMINGS & SLUDGES		
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		265 GRAPHIC ART WASTES			

<u>1</u>	18 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 Baxter Road Ottawa ON K2C 3M4	GEN

Generator Info

Generator No: ON0170700
 Approval Years: 02,03,04,05,06,07,08
 Status:
 PO Box No:
 Country:
 Co Admin:
 Phone No Admin:
 SIC Description:

Choice of Contact:
 Contaminated Fac:
 MHSW Facility:
 SIC Code:

Waste Detail(s)

Waste Class: 265
 Waste Class Name: GRAPHIC ART WASTES

Waste Detail(s)

Waste Class: 252
 Waste Class Name: WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class: 264
 Waste Class Name: PHOTOPROCESSING WASTES

Waste Detail(s)

Waste Class: 112
 Waste Class Name: ACID WASTE - HEAVY METALS

Waste Detail(s)

Waste Class: 121
 Waste Class Name: ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class: 145
 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 253
 Waste Class Name: EMULSIFIED OILS

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		243			
Waste Class Name:		PCB'S			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			

<u>1</u>	19 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 Baxter Road Ottawa ON K2C 3Z3	GEN

Generator Info

Generator No:	ON0170700	Choice of Contact:	
Approval Years:	2009	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	511110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Newspaper Publishers		

Waste Detail(s)

Waste Class:	146
Waste Class Name:	OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class:	265

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		GRAPHIC ART WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
1	20 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 Baxter Road Ottawa ON K2C 3Z3	GEN

Generator Info

Generator No: ON0170700
Approval Years: 2010

Choice of Contact:
Contaminated Fac:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status:		MHSW Facility:			
PO Box No:		SIC Code:			511110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Newspaper Publishers			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		265			
Waste Class Name:		GRAPHIC ART WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			

<u>1</u>	21 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 Baxter Road Ottawa ON K2C 3Z3	GEN

Generator Info

Generator No:	ON0170700	Choice of Contact:	
Approval Years:	2011	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	511110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Newspaper Publishers		

Waste Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class:	122
Waste Class Name:	ALKALINE WASTES - OTHER METALS

Waste Detail(s)

Waste Class:	243
Waste Class Name:	PCBS

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		265			
Waste Class Name:		GRAPHIC ART WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>1</u>	22 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 Baxter Road Ottawa ON K2C 3Z3	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:	ON0170700			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	511110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Newspaper Publishers			
 <u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
 <u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
 <u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
 <u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
 <u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
 <u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
 <u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
 <u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
 <u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
 <u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		265			
Waste Class Name:		GRAPHIC ART WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>1</u>	23 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 Baxter Road Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON0170700			Choice of Contact:	
Approval Years:	2013			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	511110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		NEWSPAPER PUBLISHERS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		251			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		243			
Waste Class Name:		PCBS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		265			
Waste Class Name:		GRAPHIC ART WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
1	24 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 Baxter Road Ottawa ON K2C 3M4	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON0170700			Choice of Contact:	CO_ADMIN
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	511110
Country:	Canada				
Co Admin:	Jessica Bebee				
Phone No Admin:	613-596-3611 Ext.				
SIC Description:	NEWSPAPER PUBLISHERS				
<u>Waste Detail(s)</u>					
Waste Class:	145				
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES				
<u>Waste Detail(s)</u>					
Waste Class:	121				
Waste Class Name:	ALKALINE WASTES - HEAVY METALS				
<u>Waste Detail(s)</u>					
Waste Class:	243				
Waste Class Name:	PCBS				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	212				
Waste Class Name:	ALIPHATIC SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
<u>Waste Detail(s)</u>					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					
Waste Class:	146				
Waste Class Name:	OTHER SPECIFIED INORGANICS				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		265			
Waste Class Name:		GRAPHIC ART WASTES			
<u>1</u>	25 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 Baxter Road Ottawa ON K2C 3M4	GEN

Generator Info

Generator No:	ON0170700	Choice of Contact:	CO_ADMIN
Approval Years:	2015	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	511110
Country:	Canada		
Co Admin:	Sue Murphy		
Phone No Admin:	613-596-3611 Ext.		
SIC Description:	NEWSPAPER PUBLISHERS		

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class:	243
Waste Class Name:	PCBS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		265			
Waste Class Name:		GRAPHIC ART WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
<u>1</u>	26 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1101 Baxter Road Ottawa ON K2C 3M4					
<u>Generator Info</u>					
Generator No:	ON0170700			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	511110
Country:	Canada				
Co Admin:	Linda Ruhl				
Phone No Admin:	613-596-3518 Ext.				
SIC Description:	NEWSPAPER PUBLISHERS				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					
Waste Class:	145				
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES				
<u>Waste Detail(s)</u>					
Waste Class:	243				
Waste Class Name:	PCBS				
<u>Waste Detail(s)</u>					
Waste Class:	265				
Waste Class Name:	GRAPHIC ART WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	122				
Waste Class Name:	ALKALINE WASTES - OTHER METALS				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	221				
Waste Class Name:	LIGHT FUELS				
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			

<u>1</u>	27 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN Postmedia Network Inc 1101 Baxter Road Ottawa ON K2C 3M4	GEN

Generator Info

Generator No:	ON0170700	Choice of Contact:
Approval Years:	As of Dec 2018	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:	5020	SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	264 C
Waste Class Name:	Photoprocessing wastes

Waste Detail(s)

Waste Class:	241 H
Waste Class Name:	Halogenated solvents and residues

Waste Detail(s)

Waste Class:	251 L

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
<u>Waste Detail(s)</u>					
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
<u>Waste Detail(s)</u>					
Waste Class:		265 L			
Waste Class Name:		Graphic arts wastes			
<u>Waste Detail(s)</u>					
Waste Class:		264 L			
Waste Class Name:		Photoprocessing wastes			
<u>Waste Detail(s)</u>					
Waste Class:		146 C			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
1	28 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN Postmedia Network Inc 1101 Baxter Road Ottawa ON K2C 3M4	GEN

Generator Info

Generator No:	ON0170700	Choice of Contact:
Approval Years:	As of Jul 2020	Contaminated Fac:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status:		Registered	MHSW Facility:		
PO Box No:		5020	SIC Code:		
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		241 H			
Waste Class Name:		Halogenated solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		146 C			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		265 L			
Waste Class Name:		Graphic arts wastes			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
1	29 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN Postmedia Network Inc 1101 Baxter Road Ottawa ON K2C 3M4	GEN

Generator Info

Generator No:	ON0170700	Choice of Contact:
Approval Years:	As of Nov 2021	Contaminated Fac:
Status:	Registered	MHSW Facility:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No: Country: Co Admin: Phone No Admin: SIC Description:		5020 Canada		SIC Code:	
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		241 H			
Waste Class Name:		Halogenated solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		146 C			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>1</u>	30 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN Ottawa Citizen, PO Box 5020, 1101 Baxter Road Ottawa ON	GEN

Generator Info

Generator No:	ON0170700	Choice of Contact:
Approval Years:	As of Oct 2022	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:	5020	SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		146 C			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		241 H			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213 I			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Generator Info (as of Dec 2024)</u>					
Generator No:		ON0170700			
Generator Company Name:		OTTAWA CITIZEN			
Street:		Ottawa Citizen, PO Box 5020, 1101 Baxter Road			
City:		Ottawa			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2C3M4			
Waste Class:		212 L,145 I,146 C,213 I,241 H,251 L,252 L			
Waste Class Decoded:					
212 - ALIPHATIC SOLVENTS; 145 - PAINT/PIGMENT/COATING RESIDUES; 146 - OTHER SPECIFIED INORGANICS; 213 - PETROLEUM DISTILLATES; 241 - HALOGENATED SOLVENTS; 251 - OIL SKIMMINGS & SLUDGES; 252 - WASTE OILS & LUBRICANTS					
<u>Generator Info (as of Apr 2025)</u>					
Generator Company Name:		OTTAWA CITIZEN			
Generator Site Address:		Ottawa Citizen, PO Box 5020, 1101 Baxter Road			
City:		Ottawa			
Province State:		Ontario			
Country:		Canada			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Postal Code:		K2C3M4			
Waste Class:		212 L, 145 I, 146 C, 213 I, 241 H, 251 L, 252 L			
Waste Class Decoded:					
212 - ALIPHATIC SOLVENTS; 145 - PAINT/PIGMENT/COATING RESIDUES; 146 - OTHER SPECIFIED INORGANICS; 213 - PETROLEUM DISTILLATES; 241 - HALOGENATED SOLVENTS; 251 - OIL SKIMMINGS & SLUDGES; 252 - WASTE OILS & LUBRICANTS					
Waste Characteristic Decoded:					
L - Liquid Industrial Waste; I - Ignitable; C - Corrosive; I - Ignitable; H - Hazardous Industrial Waste; L - Liquid Industrial Waste; L - Liquid Industrial Waste					
2017 Generator Info					
Gen No:	ON0170700	Choice of Contact:		CO_ADMIN	
ID:	1905	Phone No Official:		613-596-3798 Ext.	
Contaminated Fac:	N	Phone No Admin:		613-596-3611 Ext.	
MHSW Facility:	N	County Ont:		OTTAWA CARLTON (RM)	
NAICS Code1:	511110	County Out:			
NAICS Code2:		District:		402	
NAICS Code3:					
Gen Name:	OTTAWA CITIZEN				
Gen Div:	Postmedia Network Inc				
Gen Op Name:	OTTAWA CITIZEN				
Gen Op Div:					
Site Adrs1:	1101 Baxter Road				
Site Bldg:	Ottawa Citizen				
Site Pobox:	5020				
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 3M4				
Site Country:	Canada				
Co Official:	Linda Ruhl				
Co Admin:	Jessica Bebee				
2017 Generator Manifest					
ID:	9239	Sum Received Qty:		24075.0	
Generator No:	ON0170700	Waste Class Name:		OIL SKIMMINGS & SLUDGES	
Receiver Type:	035	Count Manifests:		13	
Waste Char:	L	District:		402	
Waste Code:	251				
2017 Generator Manifest					
ID:	9240	Sum Received Qty:		1825.0	
Generator No:	ON0170700	Waste Class Name:		PHOTOPROCESSING WASTES	
Receiver Type:	035	Count Manifests:		8	
Waste Char:	C	District:		402	
Waste Code:	264				
2018 Generator Info					
Gen No:	ON0170700	Choice of Contact:		CO_ADMIN	
ID:	1862	Phone No Official:		613-596-3798 Ext.	
Contaminated Fac:	N	Phone No Admin:		613-596-3611 Ext.	
MHSW Facility:	N	County Ont:		OTTAWA CARLTON (RM)	
NAICS Code1:	511110	Countyv Out:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		OTTAWA CITIZEN			
Gen Div:		Postmedia Network Inc			
Gen Op Name:		OTTAWA CITIZEN			
Gen Op Div:					
Site Adrs1:		1101 Baxter Road			
Site Bldg:		Ottawa Citizen			
Site Pobox:		5020			
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 3M4			
Site Country:		Canada			
Co Official:		Linda Ruhl			
Co Admin:		Cathy Lunau			
<u>2018 Generator Manifest</u>					
ID:	8987			Sum Received Qty:	405.0
Generator No:	ON0170700			Waste Class Name:	PETROLEUM DISTILLATES
Receiver Type:	035			Count Manifests:	2
Waste Char:	I			District:	402
Waste Code:	213				
<u>2018 Generator Manifest</u>					
ID:	8988			Sum Received Qty:	21305.0
Generator No:	ON0170700			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	16
Waste Char:	L			District:	402
Waste Code:	251				
<u>2018 Generator Manifest</u>					
ID:	8990			Sum Received Qty:	205.0
Generator No:	ON0170700			Waste Class Name:	GRAPHIC ART WASTES
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	265				
<u>2018 Generator Manifest</u>					
ID:	8989			Sum Received Qty:	1020.0
Generator No:	ON0170700			Waste Class Name:	PHOTOPROCESSING WASTES
Receiver Type:	035			Count Manifests:	5
Waste Char:	C			District:	402
Waste Code:	264				
<u>2019 Generator Info</u>					
Gen No:	ON0170700			Choice of Contact:	CO_ADMIN
ID:	1810			Phone No Official:	613-596-3798 Ext.
Contaminated Fac:	N			Phone No Admin:	613-596-3611 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	511110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		OTTAWA CITIZEN			
Gen Div:		Postmedia Network Inc			
Gen Op Name:		OTTAWA CITIZEN			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Op Div:					
Site Adrs1:		1101 Baxter Road			
Site Bldg:		Ottawa Citizen			
Site Pobox:		5020			
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 3M4			
Site Country:		Canada			
Co Official:		Linda Ruhl			
Co Admin:		Cathy Lunau			
<u>2019 Generator Manifest</u>					
ID:	8784			Sum Received Qty:	18455.0
Generator No:	ON0170700			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	9
Waste Char:	L			District:	402
Waste Code:	251				
<u>2019 Generator Manifest</u>					
ID:	8786			Sum Received Qty:	820.0
Generator No:	ON0170700			Waste Class Name:	PHOTOPROCESSING WASTES
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	402
Waste Code:	264				
<u>2019 Generator Manifest</u>					
ID:	8782			Sum Received Qty:	60.0
Generator No:	ON0170700			Waste Class Name:	ACID WASTE - HEAVY METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	402
Waste Code:	112				
<u>2019 Generator Manifest</u>					
ID:	8785			Sum Received Qty:	205.0
Generator No:	ON0170700			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	252				
<u>2019 Generator Manifest</u>					
ID:	8783			Sum Received Qty:	300.0
Generator No:	ON0170700			Waste Class Name:	ALKALINE WASTES - OTHER METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	402
Waste Code:	122				
<u>2020 Generator Info</u>					
Gen No:	ON0170700			Choice of Contact:	CO_ADMIN
ID:	1737			Phone No Official:	613-596-3798 Ext.
Contaminated Fac:	N			Phone No Admin:	613-596-3611 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	511110			County Out:	
NAICS Code2:				District:	402

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code3:					
Gen Name:		OTTAWA CITIZEN			
Gen Div:		Postmedia Network Inc			
Gen Op Name:		OTTAWA CITIZEN			
Gen Op Div:					
Site Adrs1:		1101 Baxter Road			
Site Bldg:		Ottawa Citizen			
Site Pobox:		5020			
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 3M4			
Site Country:		Canada			
Co Official:		Linda Ruhl			
Co Admin:		Cathy Lunau			
2020 Generator Manifest					
ID:	7870			Sum Received Qty:	205.0
Generator No:	ON0170700			Waste Class Name:	PETROLEUM DISTILLATES
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	213				
2020 Generator Manifest					
ID:	7871			Sum Received Qty:	15000.0
Generator No:	ON0170700			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	7
Waste Char:	L			District:	402
Waste Code:	251				
2020 Generator Manifest					
ID:	7872			Sum Received Qty:	820.0
Generator No:	ON0170700			Waste Class Name:	GRAPHIC ART WASTES
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	265				
2021 Generator Info					
Gen No:	ON0170700			Choice of Contact:	CO_ADMIN
ID:	1716			Phone No Official:	613-596-3583 Ext.
Contaminated Fac:	N			Phone No Admin:	613-596-3583 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	511110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		OTTAWA CITIZEN			
Gen Div:		Postmedia Network Inc			
Gen Op Name:		OTTAWA CITIZEN			
Gen Op Div:					
Site Adrs1:		1101 Baxter Road			
Site Bldg:		Ottawa Citizen			
Site Pobox:		5020			
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 3M4			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Country:		Canada			
Co Official:		Don Joly			
Co Admin:		Don Joly			
<u>2021 Generator Manifest</u>					
ID:	7811			Sum Received Qty:	1230.0
Generator No:	ON0170700			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	2
Waste Char:	L			District:	402
Waste Code:	252				
<u>2021 Generator Manifest</u>					
ID:	7809			Sum Received Qty:	2250.0
Generator No:	ON0170700			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	212				
<u>2021 Generator Manifest</u>					
ID:	7810			Sum Received Qty:	15000.0
Generator No:	ON0170700			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	5
Waste Char:	L			District:	402
Waste Code:	251				
<u>2021 Generator Manifest</u>					
ID:	7808			Sum Received Qty:	84.0
Generator No:	ON0170700			Waste Class Name:	PETROLEUM DISTILLATES
Receiver Type:	030			Count Manifests:	1
Waste Char:	L			District:	202
Waste Code:	213				
1	31 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 BAXTER ROAD OTTAWA ON K2C 3Z3	NPCB
Company Code:		F1374			
Industry:		UNDEFINED			
Site Status:					
Transaction Date:					
Inspection Date:					
1	32 of 46	E/0.0	70.9 / -0.85	THE OTTAWA CITIZEN 1101 BAXTER ROAD OTTAWA ON K2C3M4	NPR2
NPRI ID:	7388			Latitude:	45.3527
Facility ID:	354231;357108;368506;373414;376968			Longitude:	-75.7816
Facility Name:	THE OTTAWA CITIZEN				
Note:	Substances included on NPRI reports for this NPRI ID are summarized below in the NPRI ID Substances Summary section. Substances listed in the Substances Summary are included on the basis of NPRI ID only. For entities (NPRI ID) with mobile plants and/or more than one facility location, substances listed above may or may not have been reported for specific facilities/mobile locations. The list of substances additionally includes those which have been included on the NPRI report with an unknown quantity or a quantity of 0.				
For specific details about substance quantities, years, release/transfer/disposal methods, the reader is referred the					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
facility report:					
https://pollution-waste.canada.ca/national-release-inventory/?fromYear=1993&toYear=2023&name=7388					
<u>NPRI ID Substances Summary</u>					
CAS No:	NA - M16			Is PAH?:	FALSE
Is VOC?:	TRUE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	Volatile Organic Compounds (VOCs)				
Name French:	Composés organiques volatils (COV)				
Sort English:	Volatile Organic Compounds (VOCs)				
Sort French:	Composés organiques volatils (COV)				
CAS No:	11104-93-1			Is PAH?:	FALSE
Is VOC?:	FALSE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	Nitrogen oxides (expressed as nitrogen dioxide)				
Name French:	Oxydes d'azote (exprimés en dioxyde d'azote)				
Sort English:	Nitrogen oxides (expressed as nitrogen dioxide)				
Sort French:	Oxydes d'azote (exprimés en dioxyde d'azote)				
CAS No:	67-63-0			Is PAH?:	FALSE
Is VOC?:	TRUE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	Isopropyl alcohol				
Name French:	Alcool isopropylique				
Sort English:	Isopropyl alcohol				
Sort French:	Alcool iso-propylique				
CAS No:	NA - M09			Is PAH?:	FALSE
Is VOC?:	FALSE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	PM10 - Particulate Matter <= 10 Micrometers				
Name French:	PM10 - Matière particulaire <= 10 micromètres				
Sort English:	PM10 - Particulate Matter <= 10 Micrometers				
Sort French:	PM10 - Matière particulaire <= 10 micromètres				
CAS No:	123-31-9			Is PAH?:	FALSE
Is VOC?:	FALSE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	Hydroquinone (and its salts)				
Name French:	Hydroquinone (et ses sels)				
Sort English:	Hydroquinone (and its salts)				
Sort French:	Hydroquinone (et ses sels)				
CAS No:	75-09-2			Is PAH?:	FALSE
Is VOC?:	FALSE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	Dichloromethane				
Name French:	Dichlorométhane				
Sort English:	Dichloromethane				
Sort French:	Dichlorométhane				
CAS No:	108-88-3			Is PAH?:	FALSE
Is VOC?:	TRUE			NPRI:	TRUE
Is DF?:	FALSE				
Name English:	Toluene				
Name French:	Toluène				
Sort English:	Toluene				
Sort French:	Toluène				
CAS No:	107-21-1			Is PAH?:	FALSE
Is VOC?:	TRUE			NPRI:	TRUE
Is DF?:	FALSE				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Name English: Name French: Sort English: Sort French:		Ethylene glycol Éthylène glycol Ethylene glycol Éthylèneglycol			
CAS No: Is VOC?: Is DF?: Name English: Name French: Sort English: Sort French:	111-76-2 TRUE FALSE 2-Butoxyethanol 2-Butoxyéthanol Butoxyethanol:2- Butoxyéthanol:2-			Is PAH?: NPRI:	FALSE TRUE
CAS No: Is VOC?: Is DF?: Name English: Name French: Sort English: Sort French:	67-56-1 TRUE FALSE Methanol Méthanol Methanol Méthanol			Is PAH?: NPRI:	FALSE TRUE
<u>Geographic Location</u>					
Report Year: Census Subdiv ID: Ecozone ID: Water Survey ID: SOMA: ON PEMA: QC PEMA: Quebec Windsor Corr:	-1 3506008 8 2 TRUE TRUE FALSE TRUE			Forward Sort Area: DLS Description: NTS Description: Province Code: Datum: Latitude: Longitude:	K2C B-023-F/031-G-5 ON 1983.0 45.3527 -75.7816
<u>NPRI ID Facility ID</u>					
NPRI ID: Facility ID:	7388 373414				
<u>Facility</u>					
Facility ID: Portable: NAICS Primary: NAICS Secondary: NAICS Tertiary: Facility Name: Website:	373414 FALSE 323119 0 0 THE OTTAWA CITIZEN			IDM ID: AB Approval ID: GHGRP ID: ON GHGRP ID:	0 0 0 0
<u>Address</u>					
Address1: Address2: City: Postal Zip: Prov:	1101 Baxter Road OTTAWA K2C3M4				
<u>Address Geographic</u>					
Latitude: Longitude: UTM Easting: UTM Northing:	45.3527 -75.7816 0.000000 0.000000			Datum: Land Survey: Topograph: Additional Info:	0

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
UTM Zone:	0				
<u>Primary NAICS Details</u>					
NAICS Code:	323119			Start Date:	1993
Record Year:	1997			End Date:	2001
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other Printing			
NAICS Title Fr:		Autres activités d'impression			
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:	323119			Start Date:	2012
Record Year:	2012			End Date:	2016
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other printing			
NAICS Title Fr:		Autres activités d'impression			
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:	323119			Start Date:	2002
Record Year:	2002			End Date:	2006
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other Printing			
NAICS Title Fr:		Autres activités d'impression			
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:	323119			Start Date:	2017
Record Year:	2017			End Date:	2021
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other printing			
NAICS Title Fr:		Autres activités d'impression			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

NAICS Description En:

This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.

NAICS Description Fr:

Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.

NAICS Code:	323119	Start Date:	2007
Record Year:	2007	End Date:	2011
Key Indus Sector En:	Other Manufacturing		
Key Indus Sector Fr:	Autres fabrication		
NAICS Title En:	Other Printing		
NAICS Title Fr:	Autres activités d'impression		

NAICS Description En:

This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.

NAICS Description Fr:

Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.

NAICS Code:	323119	Start Date:	2022
Record Year:	2022	End Date:	2026
Key Indus Sector En:	Other Manufacturing		
Key Indus Sector Fr:	Autres fabrication		
NAICS Title En:	Other printing		
NAICS Title Fr:	Autres activités d'impression		

NAICS Description En:

This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.

NAICS Description Fr:

Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.

NPRI Report

Report ID:	262534	No of Employees:	600
Report Year:	2004	Is Compressor:	
Company ID:	143259	Is NPRI Part 4:	
SWR Report ID:	20040000007388	Is Battery:	
Repor Type ID:	1	Corres Lang ID:	0
New Reporter:	FALSE	Submit Date:	2005-05-17 00:00:00.0000000

Company

Company Name:	THE OTTAWA CITIZEN
DUNS No:	0
Trade Name En:	
Trade Name Fr:	
Website:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	0
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		d-desrochers@thecitizen.canwest.com			
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	6132259940
First Name:	David			Extension:	263
Last Name:	Cotsman			Fax:	6132257337
Company Name:					
Description En:					
Description Fr:					
Position:		Environmental Scientist			
Language:		0			
Email:		david.cotsman@trow.com			
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	6135963587
First Name:	David			Extension:	0
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		d-desrochers@thecitizen.canwest.com			
<u>NPRI ID Facility ID</u>					
NPRI ID:		7388			
Facility ID:		357108			
<u>Facility</u>					
Facility ID:	357108			IDM ID:	0
Portable:	FALSE			AB Approval ID:	0
NAICS Primary:	323119			GHGRP ID:	0
NAICS Secondary:	0			ON GHGRP ID:	0
NAICS Tertiary:	0				
Facility Name:		OTTAWA CITIZEN			
Website:		www.ottawacitizen.com			
<u>Address</u>					
Address1:		1101 Baxter Road			
Address2:					
City:		OTTAWA			
Postal Zip:		K2C3M4			
Prov:					
<u>Address Geographic</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:	45.3527			Datum:	0
Longitude:	-75.7816			Land Survey:	
UTM Easting:	0.000000			Topograph:	
UTM Northing:	0.000000			Additional Info:	
UTM Zone:	0				
Primary NAICS Details					
NAICS Code:	323119			Start Date:	2007
Record Year:	2007			End Date:	2011
Key Indus Sector En:	Other Manufacturing				
Key Indus Sector Fr:	Autres fabrication				
NAICS Title En:	Other Printing				
NAICS Title Fr:	Autres activités d'impression				
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:	323119			Start Date:	2022
Record Year:	2022			End Date:	2026
Key Indus Sector En:	Other Manufacturing				
Key Indus Sector Fr:	Autres fabrication				
NAICS Title En:	Other printing				
NAICS Title Fr:	Autres activités d'impression				
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:	323119			Start Date:	1993
Record Year:	1997			End Date:	2001
Key Indus Sector En:	Other Manufacturing				
Key Indus Sector Fr:	Autres fabrication				
NAICS Title En:	Other Printing				
NAICS Title Fr:	Autres activités d'impression				
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:	323119			Start Date:	2012
Record Year:	2012			End Date:	2016
Key Indus Sector En:	Other Manufacturing				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other printing			
NAICS Title Fr:		Autres activités d'impression			
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:		323119	Start Date:		2002
Record Year:		2002	End Date:		2006
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other Printing			
NAICS Title Fr:		Autres activités d'impression			
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:		323119	Start Date:		2017
Record Year:		2017	End Date:		2021
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other printing			
NAICS Title Fr:		Autres activités d'impression			
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NPRI Report					
Report ID:		135151	No of Employees:		700
Report Year:		2009	Is Compressor:		
Company ID:		132198	Is NPRI Part 4:		
SWR Report ID:		20090000007388	Is Battery:		
Repor Type ID:		1	Corres Lang ID:		0
New Reporter:		FALSE	Submit Date:		2010-05-10 00:00:00.0000000
Company					
Company Name:		OTTAWA CITIZEN GROUP INC., A CANWEST COMPANY			
DUNS No:		0			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Trade Name En: Trade Name Fr: Website: www.ottawacitizen.com					
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@thecitizen.canwest.com			
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	4162294647
First Name:	Jeff			Extension:	2325
Last Name:	McKerrall			Fax:	4162294692
Company Name:					
Description En:					
Description Fr:					
Position:		Mechanical Engineer			
Language:		0			
Email:		jmckerrall@dillon.ca			
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@thecitizen.canwest.com			
<u>NPRI Report</u>					
Report ID:	123088			No of Employees:	700
Report Year:	2008			Is Compressor:	
Company ID:	132198			Is NPRI Part 4:	
SWR Report ID:	20080000007388			Is Battery:	
Repor Type ID:	1			Corres Lang ID:	0
New Reporter:	FALSE			Submit Date:	2009-04-13 00:00:00.0000000
<u>Company</u>					
Company Name:		OTTAWA CITIZEN GROUP INC., A CANWEST COMPANY			
DUNS No:		0			
Trade Name En:					
Trade Name Fr:					
Website:		www.ottawacitizen.com			
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	4162294647
First Name:	Jeff			Extension:	2325

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Last Name:	McKerrall			Fax:	4162294692
Company Name:					
Description En:					
Description Fr:					
Position:		Mechanical Engineer			
Language:		0			
Email:		jmckerrall@dillon.ca			
 <u>NPRI Report Contact</u>					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@thecitizen.canwest.com			
 <u>NPRI Report Contact</u>					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@thecitizen.canwest.com			
 <u>NPRI Report</u>					
Report ID:	132632			No of Employees:	700
Report Year:	2007			Is Compressor:	
Company ID:	132198			Is NPRI Part 4:	
SWR Report ID:	20070000007388			Is Battery:	
Repor Type ID:	1			Corres Lang ID:	0
New Reporter:	FALSE			Submit Date:	2008-05-20 00:00:00.0000000
 <u>Company</u>					
Company Name:		OTTAWA CITIZEN GROUP INC., A CANWEST COMPANY			
DUNS No:		0			
Trade Name En:					
Trade Name Fr:					
Website:		www.ottawacitizen.com			
 <u>NPRI Report Contact</u>					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@thecitizen.canwest.com			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		d-desrochers@thecitizen.canwest.com			
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	9059012912
First Name:	Jeff			Extension:	
Last Name:	McKerrall			Fax:	9059012918
Company Name:					
Description En:					
Description Fr:					
Position:		Mechanical Engineer			
Language:		0			
Email:		jmckerrall@dillon.ca			
<u>NPRI Report</u>					
Report ID:	152301			No of Employees:	700
Report Year:	2006			Is Compressor:	
Company ID:	132198			Is NPRI Part 4:	
SWR Report ID:	20060000007388			Is Battery:	
Repor Type ID:	1			Corres Lang ID:	0
New Reporter:	FALSE			Submit Date:	2007-05-30 00:00:00.0000000
<u>Company</u>					
Company Name:		OTTAWA CITIZEN GROUP INC., A CANWEST COMPANY			
DUNS No:		0			
Trade Name En:					
Trade Name Fr:					
Website:		www.ottawacitizen.com			
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	9056816215
First Name:	Jeff			Extension:	
Last Name:	McKerrall			Fax:	9056328330
Company Name:					
Description En:					
Description Fr:					
Position:		Mechanical EIT			
Language:		0			
Email:		jmckerrall@dillon.ca			
<u>NPRI Report Contact</u>					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Language:		0			
Email:		ddesrochers@thecitizen.canwest.com			
NPRI Report Contact					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:	Building Services Manager				
Language:	0				
Email:	ddesrochers@thecitizen.canwest.com				
NPRI Report					
Report ID:	160055			No of Employees:	700
Report Year:	2005			Is Compressor:	
Company ID:	132198			Is NPRI Part 4:	
SWR Report ID:	20050000007388			Is Battery:	
Repor Type ID:	1			Corres Lang ID:	0
New Reporter:	FALSE			Submit Date:	2006-10-30 00:00:00.0000000
Company					
Company Name:	OTTAWA CITIZEN GROUP INC., A CANWEST COMPANY				
DUNS No:	0				
Trade Name En:					
Trade Name Fr:					
Website:	www.ottawacitizen.com				
NPRI Report Comment					
Description En:	NPRI report update comment				
Description Fr:	Commentaire sur la mise à jour du rapport de l'INRP				
Comment:	To include speciated VOCs				
Note:					
NPRI Report Contact					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	0
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:	Building Services Manager				
Language:	0				
Email:	ddesrochers@thecitizen.canwest.com				
NPRI Report Contact					
Contact Type:				Phone:	6137452213
First Name:	B. R.			Extension:	105
Last Name:	Ravishankar			Fax:	6137453491
Company Name:					
Description En:					
Description Fr:					
Position:	Environmental Engineer				
Language:	0				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Email:		ravi@dillon.ca			
NPRI Report Contact					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	0
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@thecitizen.canwest.com			
NPRI ID Facility ID					
NPRI ID:		7388			
Facility ID:		376968			
Facility					
Facility ID:	376968			IDM ID:	0
Portable:	FALSE			AB Approval ID:	0
NAICS Primary:	511110			GHGRP ID:	0
NAICS Secondary:	0			ON GHGRP ID:	0
NAICS Tertiary:	0				
Facility Name:					
Website:					
Address					
Address1:		1101 Baxter Road			
Address2:					
City:		OTTAWA			
Postal Zip:		K2C3M4			
Prov:					
Primary NAICS Details					
NAICS Code:	511110			Start Date:	1993
Record Year:	1997			End Date:	2001
Key Indus Sector En:		Other (Except Manufacturing)			
Key Indus Sector Fr:		Autres (sauf fabrication)			
NAICS Title En:		Newspaper Publishers			
NAICS Title Fr:		Éditeurs de journaux			
NAICS Description En:					
This Canadian industry comprises establishments, known as newspaper publishers, primarily engaged in carrying out operations necessary for producing and distributing newspapers, including gathering news, writing news columns, feature stories and editorials, and selling and preparing advertisements. These establishments may publish newspapers in print or electronic form.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements, appelés éditeurs de journaux, dont l'activité principale consiste à exécuter les opérations nécessaires à la production et à la distribution de journaux, notamment la collecte des nouvelles, la rédaction des chroniques, des articles de fond et des éditoriaux, la vente et la préparation des annonces. Ces établissements peuvent publier les journaux sous forme imprimée ou électronique.					
NAICS Code:	511110			Start Date:	2002
Record Year:	2002			End Date:	2006

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Key Indus Sector En:		Other (Except Manufacturing)			
Key Indus Sector Fr:		Autres (sauf fabrication)			
NAICS Title En:		Newspaper Publishers			
NAICS Title Fr:		Éditeurs de journaux			
NAICS Description En:					
This Canadian industry comprises establishments, known as newspaper publishers, primarily engaged in carrying out operations necessary for producing and distributing newspapers, including gathering news; writing news columns, feature stories and editorials; and selling and preparing advertisements. These establishments may publish newspapers in print or electronic form.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements, appelés éditeurs de journaux, dont l'activité principale consiste à exécuter les opérations nécessaires à la production et à la distribution de journaux, notamment la collecte des nouvelles, la rédaction des chroniques, des articles de fond et des éditoriaux, la vente et la préparation des annonces. Ces établissements peuvent publier les journaux sous forme imprimée ou électronique.					
NAICS Code:	511110			Start Date:	2007
Record Year:	2007			End Date:	2011
Key Indus Sector En:		Other (Except Manufacturing)			
Key Indus Sector Fr:		Autres (sauf fabrication)			
NAICS Title En:		Newspaper Publishers			
NAICS Title Fr:		Éditeurs de journaux			
NAICS Description En:					
This Canadian industry comprises establishments, known as newspaper publishers, primarily engaged in carrying out operations necessary for producing and distributing newspapers, including gathering news; writing news columns, feature stories and editorials; and selling and preparing advertisements. These establishments may publish newspapers in print or electronic form.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements, appelés éditeurs de journaux, dont l'activité principale consiste à exécuter les opérations nécessaires à la production et à la distribution de journaux, notamment la collecte des nouvelles, la rédaction des chroniques, des articles de fond et des éditoriaux, la vente et la préparation des annonces. Ces établissements peuvent publier les journaux sous forme imprimée ou électronique.					
NAICS Code:	511110			Start Date:	2012
Record Year:	2012			End Date:	2016
Key Indus Sector En:		Other (Except Manufacturing)			
Key Indus Sector Fr:		Autres (sauf fabrication)			
NAICS Title En:		Newspaper publishers			
NAICS Title Fr:		Éditeurs de journaux			
NAICS Description En:					
This Canadian industry comprises establishments primarily engaged in carrying out operations necessary for producing and distributing newspapers, including gathering news; writing news columns, feature stories and editorials; and selling and preparing advertisements. These establishments may publish newspapers in print or electronic form.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements dont l'activité principale consiste à exécuter les opérations nécessaires à la production et à la distribution de journaux, notamment la collecte des nouvelles, la rédaction des chroniques, des articles de fond et des éditoriaux, la vente et la préparation des annonces. Ces établissements peuvent publier les journaux sous forme imprimée ou électronique.					
NAICS Code:	511110			Start Date:	2017
Record Year:	2017			End Date:	2021
Key Indus Sector En:		Other (Except Manufacturing)			
Key Indus Sector Fr:		Autres (sauf fabrication)			
NAICS Title En:		Newspaper publishers			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Title Fr:		Éditeurs de journaux			
NAICS Description En:					
This Canadian industry comprises establishments primarily engaged in carrying out operations necessary for producing and distributing newspapers. These establishments may publish newspapers in print, electronic form or online.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements dont l'activité principale consiste à exécuter les opérations nécessaires à la production et à la distribution de journaux. Ces établissements peuvent publier les journaux sous forme imprimée, électronique ou en ligne.					
NPRI Report					
Report ID:	202607			No of Employees:	600
Report Year:	2002			Is Compressor:	
Company ID:	140242			Is NPRI Part 4:	
SWR Report ID:	20020000007388			Is Battery:	
Repor Type ID:	1			Corres Lang ID:	0
New Reporter:	FALSE			Submit Date:	2003-06-02 00:00:00.0000000
Company					
Company Name:	THE OTTAWA CITIZEN				
DUNS No:	0				
Trade Name En:					
Trade Name Fr:					
Website:					
NPRI Report Contact					
Contact Type:				Phone:	6132259940
First Name:	David			Extension:	236
Last Name:	Cotsman			Fax:	6132257337
Company Name:					
Description En:					
Description Fr:					
Position:	Engineer-in-Training				
Language:	0				
Email:	david.cotsman@trow.com				
NPRI Report Contact					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	0
Last Name:	DesRochers			Fax:	6135968554
Company Name:					
Description En:					
Description Fr:					
Position:	Building Services Manager				
Language:	0				
Email:	ddesrochers@thecitizen.southam.ca				
NPRI Report Contact					
Contact Type:	NPRI			Phone:	6135963573
First Name:	David			Extension:	0
Last Name:	DesRochers			Fax:	6135968554
Company Name:					
Description En:	Public Contact				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Description Fr:		Responsable des renseignements au public			
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@thecitizen.southam.ca			
NPRI Report Contact					
Contact Type:				Phone:	6135963573
First Name:		David	Extension:		0
Last Name:		DesRochers	Fax:		6135968554
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@thecitizen.southam.ca			
NPRI ID Facility ID					
NPRI ID:		7388			
Facility ID:		368506			
Facility					
Facility ID:		368506	IDM ID:		0
Portable:		FALSE	AB Approval ID:		0
NAICS Primary:		511110	GHGRP ID:		0
NAICS Secondary:		0	ON GHGRP ID:		0
NAICS Tertiary:		0			
Facility Name:					
Website:					
Address					
Address1:		1101 Baxter Road			
Address2:					
City:		OTTAWA			
Postal Zip:		K2C3M4			
Prov:					
Address Geographic					
Latitude:		45.3527	Datum:		0
Longitude:		-75.7816	Land Survey:		
UTM Easting:		0.000000	Topograph:		
UTM Northing:		0.000000	Additional Info:		
UTM Zone:		0			
Primary NAICS Details					
NAICS Code:		511110	Start Date:		1993
Record Year:		1997	End Date:		2001
Key Indus Sector En:		Other (Except Manufacturing)			
Key Indus Sector Fr:		Autres (sauf fabrication)			
NAICS Title En:		Newspaper Publishers			
NAICS Title Fr:		Éditeurs de journaux			

NAICS Description En:

This Canadian industry comprises establishments, known as newspaper publishers, primarily engaged in carrying out operations necessary for producing and distributing newspapers, including gathering news, writing news columns, feature stories and editorials, and selling and preparing

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

advertisements. These establishments may publish newspapers in print or electronic form.

NAICS Description Fr:

Cette classe canadienne comprend les établissements, appelés éditeurs de journaux, dont l'activité principale consiste à exécuter les opérations nécessaires à la production et à la distribution de journaux, notamment la collecte des nouvelles, la rédaction des chroniques, des articles de fond et des éditoriaux, la vente et la préparation des annonces. Ces établissements peuvent publier les journaux sous forme imprimée ou électronique.

NAICS Code:	511110	Start Date:	2002
Record Year:	2002	End Date:	2006
Key Indus Sector En:	Other (Except Manufacturing)		
Key Indus Sector Fr:	Autres (sauf fabrication)		
NAICS Title En:	Newspaper Publishers		
NAICS Title Fr:	Éditeurs de journaux		

NAICS Description En:

This Canadian industry comprises establishments, known as newspaper publishers, primarily engaged in carrying out operations necessary for producing and distributing newspapers, including gathering news; writing news columns, feature stories and editorials; and selling and preparing advertisements. These establishments may publish newspapers in print or electronic form.

NAICS Description Fr:

Cette classe canadienne comprend les établissements, appelés éditeurs de journaux, dont l'activité principale consiste à exécuter les opérations nécessaires à la production et à la distribution de journaux, notamment la collecte des nouvelles, la rédaction des chroniques, des articles de fond et des éditoriaux, la vente et la préparation des annonces. Ces établissements peuvent publier les journaux sous forme imprimée ou électronique.

NAICS Code:	511110	Start Date:	2007
Record Year:	2007	End Date:	2011
Key Indus Sector En:	Other (Except Manufacturing)		
Key Indus Sector Fr:	Autres (sauf fabrication)		
NAICS Title En:	Newspaper Publishers		
NAICS Title Fr:	Éditeurs de journaux		

NAICS Description En:

This Canadian industry comprises establishments, known as newspaper publishers, primarily engaged in carrying out operations necessary for producing and distributing newspapers, including gathering news; writing news columns, feature stories and editorials; and selling and preparing advertisements. These establishments may publish newspapers in print or electronic form.

NAICS Description Fr:

Cette classe canadienne comprend les établissements, appelés éditeurs de journaux, dont l'activité principale consiste à exécuter les opérations nécessaires à la production et à la distribution de journaux, notamment la collecte des nouvelles, la rédaction des chroniques, des articles de fond et des éditoriaux, la vente et la préparation des annonces. Ces établissements peuvent publier les journaux sous forme imprimée ou électronique.

NAICS Code:	511110	Start Date:	2012
Record Year:	2012	End Date:	2016
Key Indus Sector En:	Other (Except Manufacturing)		
Key Indus Sector Fr:	Autres (sauf fabrication)		
NAICS Title En:	Newspaper publishers		
NAICS Title Fr:	Éditeurs de journaux		

NAICS Description En:

This Canadian industry comprises establishments primarily engaged in carrying out operations necessary for producing and distributing newspapers, including gathering news; writing news columns, feature stories and editorials; and selling and preparing advertisements. These establishments may publish newspapers in print or electronic form.

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

NAICS Description Fr:

Cette classe canadienne comprend les établissements dont l'activité principale consiste à exécuter les opérations nécessaires à la production et à la distribution de journaux, notamment la collecte des nouvelles, la rédaction des chroniques, des articles de fond et des éditoriaux, la vente et la préparation des annonces. Ces établissements peuvent publier les journaux sous forme imprimée ou électronique.

NAICS Code:	511110	Start Date:	2017
Record Year:	2017	End Date:	2021
Key Indus Sector En:	Other (Except Manufacturing)		
Key Indus Sector Fr:	Autres (sauf fabrication)		
NAICS Title En:	Newspaper publishers		
NAICS Title Fr:	Éditeurs de journaux		

NAICS Description En:

This Canadian industry comprises establishments primarily engaged in carrying out operations necessary for producing and distributing newspapers. These establishments may publish newspapers in print, electronic form or online.

NAICS Description Fr:

Cette classe canadienne comprend les établissements dont l'activité principale consiste à exécuter les opérations nécessaires à la production et à la distribution de journaux. Ces établissements peuvent publier les journaux sous forme imprimée, électronique ou en ligne.

NPRI Report

Report ID:	272172	No of Employees:	600
Report Year:	2003	Is Compressor:	
Company ID:	143259	Is NPRI Part 4:	
SWR Report ID:	20030000007388	Is Battery:	
Repor Type ID:	1	Corres Lang ID:	0
New Reporter:	FALSE	Submit Date:	2004-06-01 00:00:00.0000000

Company

Company Name:	THE OTTAWA CITIZEN
DUNS No:	0
Trade Name En:	
Trade Name Fr:	
Website:	

NPRI Report Contact

Contact Type:	NPRI	Phone:	6135963573
First Name:	David	Extension:	0
Last Name:	DesRochers	Fax:	6135968554
Company Name:			
Description En:	Public Contact		
Description Fr:	Responsable des renseignements au public		
Position:	Building Services Manager		
Language:	0		
Email:	d-desrochers@thecitizen.southam.ca		

NPRI Report Contact

Contact Type:		Phone:	6132259940
First Name:	David	Extension:	263
Last Name:	Cotsman	Fax:	6132257337
Company Name:			
Description En:			
Description Fr:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Position:		Engineer-in-Training			
Language:		0			
Email:		david.cotsman@trow.com			
NPRI Report Contact					
Contact Type:			Phone:	6135963573	
First Name:		David	Extension:	0	
Last Name:		DesRochers	Fax:	6135968554	
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@thecitizen.southam.ca			
NPRI Report Contact					
Contact Type:			Phone:	6135963573	
First Name:		David	Extension:	0	
Last Name:		DesRochers	Fax:	6135968554	
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@thecitizen.southam.ca			
NPRI ID Facility ID					
NPRI ID:		7388			
Facility ID:		354231			
Facility					
Facility ID:		354231	IDM ID:	10496	
Portable:		FALSE	AB Approval ID:	0	
NAICS Primary:		323119	GHGRP ID:	0	
NAICS Secondary:		0	ON GHGRP ID:	0	
NAICS Tertiary:		0			
Facility Name:		OTTAWA CITIZEN			
Website:					
Address					
Address1:		1101 Baxter Road			
Address2:					
City:		OTTAWA			
Postal Zip:		K2C3M4			
Prov:					
Address Geographic					
Latitude:		45.3527	Datum:	0	
Longitude:		-75.7816	Land Survey:		
UTM Easting:		0.000000	Topograph:		
UTM Northing:		0.000000	Additional Info:		
UTM Zone:		0			
Primary NAICS Details					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
NAICS Code:	323119			Start Date:	1993
Record Year:	1997			End Date:	2001
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other Printing			
NAICS Title Fr:		Autres activités d'impression			
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:	323119			Start Date:	2022
Record Year:	2022			End Date:	2026
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other printing			
NAICS Title Fr:		Autres activités d'impression			
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:	323119			Start Date:	2012
Record Year:	2012			End Date:	2016
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other printing			
NAICS Title Fr:		Autres activités d'impression			
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					
NAICS Description Fr:					
Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.					
NAICS Code:	323119			Start Date:	2002
Record Year:	2002			End Date:	2006
Key Indus Sector En:		Other Manufacturing			
Key Indus Sector Fr:		Autres fabrication			
NAICS Title En:		Other Printing			
NAICS Title Fr:		Autres activités d'impression			
NAICS Description En:					
This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

NAICS Description Fr:

Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.

NAICS Code:	323119	Start Date:	2017
Record Year:	2017	End Date:	2021
Key Indus Sector En:	Other Manufacturing		
Key Indus Sector Fr:	Autres fabrication		
NAICS Title En:	Other printing		
NAICS Title Fr:	Autres activités d'impression		

NAICS Description En:

This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.

NAICS Description Fr:

Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.

NAICS Code:	323119	Start Date:	2007
Record Year:	2007	End Date:	2011
Key Indus Sector En:	Other Manufacturing		
Key Indus Sector Fr:	Autres fabrication		
NAICS Title En:	Other Printing		
NAICS Title Fr:	Autres activités d'impression		

NAICS Description En:

This Canadian industry comprises establishments, not classified to any other Canadian industry, primarily engaged in printing.

NAICS Description Fr:

Cette classe canadienne comprend les établissements qui ne figurent dans aucune autre classe canadienne et dont l'activité principale consiste à fournir des services d'impression.

NPRI Report

Report ID:	138189	No of Employees:	700
Report Year:	2010	Is Compressor:	
Company ID:	128741	Is NPRI Part 4:	
SWR Report ID:	20100000007388	Is Battery:	
Repor Type ID:	1	Corres Lang ID:	0
New Reporter:	TRUE	Submit Date:	2011-05-10 00:00:00.0000000

Company

Company Name:	OTTAWA CITIZEN GROUP INC., A DIVISION OF POSTMEDIA NETWORK I
DUNS No:	0
Trade Name En:	
Trade Name Fr:	
Website:	

NPRI Report Contact

Contact Type:		Phone:	6135963573
First Name:	David	Extension:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@ottawacitizen.com			
 <u>NPRI Report Contact</u>					
Contact Type:				Phone:	6135963573
First Name:	David			Extension:	
Last Name:	DesRochers			Fax:	6137265954
Company Name:					
Description En:					
Description Fr:					
Position:		Building Services Manager			
Language:		0			
Email:		ddesrochers@ottawacitizen.com			
 <u>NPRI Report Contact</u>					
Contact Type:				Phone:	9059012912
First Name:	Alex			Extension:	3409
Last Name:	Ballez			Fax:	9059012918
Company Name:					
Description En:					
Description Fr:					
Position:		Chemical Engineer			
Language:		0			
Email:		aballez@dillon.ca			
 <u>Alternative Location Info</u>					
Facility ID:		368506			
Facility Name:					
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
 <u>Alternative Location Info</u>					
Facility ID:		357108			
Facility Name:		THE OTTAWA CITIZEN			
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
 <u>Alternative Location Info</u>					
Facility ID:		354231			
Facility Name:					
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:		45.3527			
Longitude:		-75.7816			
<u>Alternative Location Info</u>					
Facility ID:		368506			
Facility Name:		OTTAWA CITIZEN			
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
<u>Alternative Location Info</u>					
Facility ID:		373414			
Facility Name:		OTTAWA CITIZEN			
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
<u>Alternative Location Info</u>					
Facility ID:		357108			
Facility Name:		OTTAWA CITIZEN			
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
<u>Alternative Location Info</u>					
Facility ID:		357108			
Facility Name:		1101 BAXTER ROAD			
Address1:		OTTAWA			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
<u>Alternative Location Info</u>					
Facility ID:		373414			
Facility Name:		1101 BAXTER ROAD			
Address1:		OTTAWA			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
<u>Alternative Location Info</u>					
Facility ID:		368506			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Facility Name:		THE OTTAWA CITIZEN			
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
 <u>Alternative Location Info</u>					
Facility ID:		354231			
Facility Name:		THE OTTAWA CITIZEN			
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
 <u>Alternative Location Info</u>					
Facility ID:		373414			
Facility Name:		THE OTTAWA CITIZEN			
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
 <u>Alternative Location Info</u>					
Facility ID:		376968			
Facility Name:		OTTAWA CITIZEN			
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
 <u>Alternative Location Info</u>					
Facility ID:		376968			
Facility Name:					
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			
 <u>Alternative Location Info</u>					
Facility ID:		354231			
Facility Name:		OTTAWA CITIZEN			
Address1:		1101 BAXTER ROAD			
City:		OTTAWA			
Postal ZIP:		K2C3M4			
Province EN:		ON			
Latitude:		45.3527			
Longitude:		-75.7816			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Alternative Location Info</u>					
Facility ID:	376968				
Facility Name:	THE OTTAWA CITIZEN				
Address1:	1101 BAXTER ROAD				
City:	OTTAWA				
Postal ZIP:	K2C3M4				
Province EN:	ON				
Latitude:	45.3527				
Longitude:	-75.7816				
<u>1</u>	33 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 BAXTER ROAD, BOX 5020 OTTAWA ON K2C 3Z3	OPCB
Year:	2003				
Site Number:	40296A002				
Name Owner:					
Additional Site Information:					
<u>1</u>	34 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 BAXTER ROAD OTTAWA ON K2C 3Z3	OPCB
Year:	1998				
Site Number:	40296A002				
Name Owner:					
Additional Site Information:					
--Details--					
Quantity:	1.00				
Address Site:					
Description:	Number of Drums of Ballasts with High Level PCBs (>1000 ppm)				
Quantity:	200.00				
Address Site:					
Description:	Calculated Weight (Kg) of Drums of Ballasts with High Level PCBs (>1000 ppm)				
<u>1</u>	35 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 BAXTER ROAD OTTAWA ON K2C 3Z3	OPCB
Year:	1999				
Site Number:	40296A002				
Name Owner:					
Additional Site Information:					
--Details--					
Quantity:	1.00				
Address Site:					
Description:	Number of Drums of Ballasts with High Level PCBs (>1000 ppm)				
Quantity:	200.00				
Address Site:					
Description:	Calculated Weight (Kg) of Drums of Ballasts with High Level PCBs (>1000 ppm)				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
1	36 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 BAXTER ROAD OTTAWA ON K2C 3Z3	OPCB
Year: 2000 Site Number: 40296A002 Name Owner: Additional Site Information:					
--Details-- Quantity: 1.00 Address Site: Description: Number of Drums of Ballasts with High Level PCBs (>1000 ppm) Quantity: 200.00 Address Site: Description: Calculated Weight (Kg) of Drums of Ballasts with High Level PCBs (>1000 ppm)					
1	37 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN 1101 BAXTER ROAD, BOX 5020 OTTAWA ON K2C 3Z3	OPCB
Year: 2004 Site Number: 40296A002 Name Owner: Additional Site Information:					
1	38 of 46	E/0.0	70.9 / -0.85	THE OTTAWA CITIZEN 1101 BAXTER RD OTTAWA ON K2C 3Z3	PRT
Location ID: 10866 Type: private Expiry Date: Capacity (L): 27276.00 Licence #: 0001008292					
1	39 of 46	E/0.0	70.9 / -0.85	SOUTHAM NEWSPAPER GROUP 1101 BAXTER RD OTTAWA ON K2C 3Z3	SCT
Established: 1945 Plant Size (ft²): 0 Employment: 599 --Details-- Description: Newspaper Publishers SIC/NAICS Code: 511110					
1	40 of 46	E/0.0	70.9 / -0.85	SOUTHAM NEWSPAPER GROUP 1101 BAXTER RD OTTAWA ON K2C 3Z3	SCT
Established: 1945 Plant Size (ft²): 0 Employment: 599					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
--Details--					
Description:		NEWSPAPERS: PUBLISHING, OR PUBLISHING AND PRINTING			
SIC/NAICS Code:		2711			
1	41 of 46	E/0.0	70.9 / -0.85	Southam Publications Inc. - A CanWest Company - The Ottawa Citizen 1101 Baxter Rd Ottawa ON K2C 3Z3	SCT
Established:		1845			
Plant Size (ft²):		10000			
Employment:		800			
--Details--					
1	42 of 46	E/0.0	70.9 / -0.85	CanWest Publications Inc. - The Ottawa Citizen - A CanWest Company 1101 Baxter Rd Ottawa ON K2C 3Z3	SCT
Established:		1845			
Plant Size (ft²):		10000			
Employment:		800			
--Details--					
Description:		Newspaper Publishers			
SIC/NAICS Code:		511110			
1	43 of 46	E/0.0	70.9 / -0.85	Ottawa Citizen 1101 Baxter Rd Ottawa ON K2C 3Z3	SCT
Established:		01-AUG-45			
Plant Size (ft²):		10000			
Employment:					
--Details--					
Description:		Newspaper Publishers			
SIC/NAICS Code:		511110			
1	44 of 46	E/0.0	70.9 / -0.85	TRANSPORT TRUCK 1101 BAXTER ROAD THE OTTAWA CITIZEN MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON K2C 3Z3	SPL
Ref No:		121077		Municipality No: 20101	
Year:				Nature of Damage:	
Incident Dt:		11/21/1995		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		11/21/1995		Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: OTHER CONTAINER LEAK Incident Preceding Spill: Incident Reason: UNKNOWN Incident Summary: TRANSPORT TRUCK- DIESEL TO GROUND. DIST OFFICE NOTIFIED. CLEANED. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Multi Media Pollution Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					

<u>1</u>	45 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN, THE 1101 BAXTER RD PARKING LOT OTTAWA PLANT 1101 BAXTER ROAD OTTAWA CITY ON K2C 3Z3	SPL
Ref No: 82404 Year: Incident Dt: // Dt MOE Arvl on Scn: MOE Reported Dt: 3/3/1993 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing:					
Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved: WORKS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: CONTAINER OVERFLOW Incident Preceding Spill: Incident Reason: UNKNOWN Incident Summary: THE OTTAWA CITIZEN -UNKNOWN AMOUNT OF VARSOL& INK TO LAND & SEWER. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Water course or lake Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND / WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
<u>1</u>	46 of 46	E/0.0	70.9 / -0.85	OTTAWA CITIZEN, THE 1101 BAXTER ROAD OTTAWA PLANT 1101 BAXTER ROAD OTTAWA CITY ON K2C 3Z3	SPL
Ref No: 84659 Year: Incident Dt: 4/27/1993 Dt MOE Arvl on Scn: MOE Reported Dt: 4/27/1993 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: UNDERGROUND TANK LEAK Incident Preceding Spill: Incident Reason: UNKNOWN					
Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

2	1 of 1	E/0.0	71.9 / 0.16	1011 BAXTER RD Ottawa ON	WWIS
Well ID:	7318227			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	08/31/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z290655			Contractor:	7241
Tag:	A251727			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7318227.pdf				

Additional Detail(s) (Map)

Well Completed Date: 07/04/2018
Year Completed: 2018
Depth (m): 4.8768
Latitude: 45.3523868913733
Longitude: -75.7810351440269
X: -75.78103498199897
Y: 45.352386884231834
Path: 731\7318227.pdf

Bore Hole Information

Bore Hole ID: 1007282595 **Elevation:**

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DP2BR:			Elevrc:		
Spatial Status:			Zone: 18		
Code OB:			East83: 438821.00		
Code OB Desc:			North83: 5022394.00		
Open Hole:			Org CS: UTM83		
Cluster Kind:			UTMRC: 5		
Date Completed: 07/04/2018			UTMRC Desc: margin of error : 100 m - 300 m		
Remarks:			Location Method: digit		
Location Method Desc:					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007457108			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		12.0			
Formation End Depth:		16.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007457106			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		1.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007457105			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007457107			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007457117			
Layer:		2			
Plug From:		1.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007457118			
Layer:		3			
Plug From:		5.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007457116			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007457115			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007457104			
Casing No:		0			
Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007457111			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		6.0			
Casing Diameter:		1.6100000143051147			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007457112			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.0			
Screen End Depth:		16.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.899999976158142			
<u>Water Details</u>					
Water ID:		1007457110			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1007457109			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		16.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

<u>3</u>	1 of 1	E/0.0	71.9 / 0.16	1011 BAXTER RD lot 22 con 2 Ottawa ON	WWIS
Well ID:	7318233			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	08/31/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z290652			Contractor:	7241
Tag:	A251714			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	022
Depth to Bedrock:				Concession:	02
Well Depth:				Concession Name:	OF

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			NEPEAN TOWNSHIP	Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7318233.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/04/2018			
Year Completed:		2018			
Depth (m):		4.8768			
Latitude:		45.3523521984898			
Longitude:		-75.7808431709101			
X:		-75.78084300939433			
Y:		45.352352191263876			
Path:		731\7318233.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007282613		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438836.00
Code OB Desc:				North83:	5022390.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		07/04/2018		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007457212			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		1.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007457211			
Layer:		1			
Color:		8			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BLACK			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		30			
Material 2 Desc:		MEDIUM GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007457213			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007457214			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		12.0			
Formation End Depth:		16.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007457223			
Layer:		2			
Plug From:		1.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007457222			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007457224			
Layer:		3			
Plug From:		5.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007457221			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007457210			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007457217			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		6.0			
Casing Diameter:		1.6100000143051147			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007457218			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.0			
Screen End Depth:		16.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.899999976158142			
<u>Water Details</u>					
Water ID:		1007457216			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: 1007457215 Diameter: 3.25 Depth From: 0.0 Depth To: 16.0 Hole Depth UOM: ft Hole Diameter UOM: inch					
4	1 of 1	E/0.0	71.8 / 0.12	1011 BAXTER RD lot 22 con 2 Ottawa ON	WWIS
Well ID: 7318228 Construction Date: Use 1st: Test Hole Use 2nd: Monitoring Final Well Status: Test Hole Water Type: Casing Material: Audit No: Z290654 Tag: A257730 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: NEPEAN TOWNSHIP Site Info: PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7318228.pdf					
Additional Detail(s) (Map)					
Well Completed Date: 07/04/2018 Year Completed: 2018 Depth (m): 4.8768 Latitude: 45.3523706358973 Longitude: -75.780779592474 X: -75.78077943025127 Y: 45.35237062923745 Path: 731\7318228.pdf					
Bore Hole Information					
Bore Hole ID: 1007282598 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 07/04/2018 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 438841.00 North83: 5022392.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007457122			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007457123			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		12.0			
Formation End Depth:		16.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007457121			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		06			
Material 3 Desc:		SILT			
Formation Top Depth:		1.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007457120			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		09			
Material 2 Desc:		MEDIUM SAND			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007457133			
Layer:		3			
Plug From:		5.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007457132			
Layer:		2			
Plug From:		1.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007457131			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1007457130			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1007457119			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1007457126			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		6.0			
Casing Diameter:		1.6100000143051147			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1007457127			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.0			
Screen End Depth:		16.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.899999976158142			
<u>Water Details</u>					
Water ID:		1007457125			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1007457124			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		16.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

5	1 of 1	E/0.0	71.8 / 0.12	1011 BAXTER RD lot 22 con 2 Ottawa ON	WWIS
Well ID:	7318229			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	08/31/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z290651			Contractor:	7241
Tag:	A251728			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	022
Depth to Bedrock:				Concession:	02
Well Depth:				Concession Name:	OF
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7318229.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	07/04/2018				
Year Completed:	2018				
Depth (m):	4.8768				
Latitude:	45.3524249008797				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Longitude:		-75.7807420394392			
X:		-75.78074187708698			
Y:		45.352424894563434			
Path:		731\7318229.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1007282601			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438844.00
Code OB Desc:				North83:	5022398.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/04/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007457136				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	09				
Material 1 Desc:	MEDIUM SAND				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	06				
Material 3 Desc:	SILT				
Formation Top Depth:	1.0				
Formation End Depth:	4.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007457135				
Layer:	1				
Color:	8				
General Color:	BLACK				
Material 1:	27				
Material 1 Desc:	OTHER				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	09				
Material 3 Desc:	MEDIUM SAND				
Formation Top Depth:	0.0				
Formation End Depth:	1.0				
Formation End Depth UOM:	ft				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1007457138				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		12.0			
Formation End Depth:		16.0			
Formation End Depth UOM:		ft			
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007457137			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007457146			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007457147			
Layer:		2			
Plug From:		1.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007457148			
Layer:		3			
Plug From:		5.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1007457145			
Method Construction Code:		D			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1007457134				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1007457141				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0.0				
Depth To:	6.0				
Casing Diameter:	1.6100000143051147				
Casing Diameter UOM:	inch				
Casing Depth UOM:	ft				
<u>Construction Record - Screen</u>					
Screen ID:	1007457142				
Layer:	1				
Slot:	10				
Screen Top Depth:	6.0				
Screen End Depth:	16.0				
Screen Material:	5				
Screen Depth UOM:	ft				
Screen Diameter UOM:	inch				
Screen Diameter:	1.899999976158142				
<u>Water Details</u>					
Water ID:	1007457140				
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	ft				
<u>Hole Diameter</u>					
Hole ID:	1007457139				
Diameter:	3.25				
Depth From:	0.0				
Depth To:	16.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				
6	1 of 1	E/0.0	71.8 / 0.12	1011 BAXTER RD lot 22 con 2 Ottawa ON	WWIS
Well ID:	7318230			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Test Hole			Data Entry Status:	
Use 2nd:	Monitoring			Data Src:	
Final Well Status:	Test Hole			Date Received:	08/31/2018
Water Type:				Selected Flag:	TRUE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Material:					
Audit No:	Z290653			Abandonment Rec:	
Tag:	A251644			Contractor:	7241
Constructn Method:				Form Version:	7
Elevation (m):				Owner:	
Elevatn Reliabilty:				County:	OTTAWA-CARLETON
Depth to Bedrock:				Lot:	022
Well Depth:				Concession:	02
Overburden/Bedrock:				Concession Name:	OF
Pump Rate:				Easting NAD83:	
Static Water Level:				Northing NAD83:	
Clear/Cloudy:				Zone:	
Municipality:		NEPEAN TOWNSHIP		UTM Reliability:	
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/731\7318230.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/04/2018			
Year Completed:		2018			
Depth (m):		4.8768			
Latitude:		45.3523986845734			
Longitude:		-75.7806267813227			
X:		-75.78062661968315			
Y:		45.35239867852827			
Path:		731\7318230.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1007282604		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438853.00
Code OB Desc:				North83:	5022395.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:		07/04/2018		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007457159			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		09			
Material 2 Desc:		MEDIUM SAND			
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007457161			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.0			
Formation End Depth:		12.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007457162			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		12.0			
Formation End Depth:		16.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1007457160			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		06			
Material 3 Desc:		SILT			
Formation Top Depth:		1.0			
Formation End Depth:		4.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007457170			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1007457171			
Layer:		2			
Plug From:		1.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1007457172			
Layer:		3			
Plug From:		5.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1007457169			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007457158			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007457165			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		6.0			
Casing Diameter:		1.6100000143051147			
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1007457166			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.0			
Screen End Depth:		16.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		1.899999976158142			
<u>Water Details</u>					
Water ID:		1007457164			
Layer:					
Kind Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind:					
Water Found Depth:					
Water Found Depth UOM:	ft				
<u>Hole Diameter</u>					
Hole ID:	1007457163				
Diameter:	3.25				
Depth From:	0.0				
Depth To:	16.0				
Hole Depth UOM:	ft				
Hole Diameter UOM:	inch				

7	1 of 1	ENE/2.0	71.9 / 0.21	1101 bayter rd Ottawa ON	WWIS
Well ID:	7328635			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z294996			Contractor:	7241
Tag:	A182704			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					

Additional Detail(s) (Map)

Bore Hole ID:	1007380312	Tag No:	A182704
Depth M:	5.49	Contractor:	7241
Year Completed:	2018	Latitude:	45.3528229309353
Well Completed Dt:	10/15/2018	Longitude:	-75.7804538830394
Audit No:	Z294996	Y:	45.352822924340806
Path:		X:	-75.78045372096166

Bore Hole Information

Bore Hole ID:	1007380312	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	438867.00
Code OB Desc:		North83:	5022442.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	10/15/2018	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702075			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		81			
Material 2 Desc:		SANDY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		5.489999771118164			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702074			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702295			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.130000114440918			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702296			
Layer:		3			
Plug From:		2.130000114440918			
Plug To:		5.489999771118164			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702294			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007702570			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007701885			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007702679			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		2.440000057220459			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007702730			
Layer:		1			
Slot:		10			
Screen Top Depth:		2.440000057220459			
Screen End Depth:		5.489999771118164			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007702792			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1007702486			
Diameter:		15.319999694824219			
Depth From:		0.0			
Depth To:		5.489999771118164			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>8</u>	1 of 1	SSW/0.0	71.9 / 0.16	1101 BAXTER RD Ottawa ON	WWIS
Well ID:	7328598			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	11/19/2018
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z294997			Contractor:	7241
Tag:	A182593			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/732\7328598.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	10/15/2018				
Year Completed:	2018				
Depth (m):	8.5				
Latitude:	45.3513866100322				
Longitude:	-75.7825150277234				
X:	-75.78251486619283				
Y:	45.35138660353996				
Path:	732\7328598.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1007379566			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438704.00
Code OB Desc:				North83:	5022284.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	10/15/2018			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702123			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		81			
Material 2 Desc:		SANDY			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		8.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1007702122			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702350			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702352			
Layer:		3			
Plug From:		4.869999885559082			
Plug To:		8.5			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1007702351			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.869999885559082			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1007702586			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1007701905			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1007702660			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		4.880000114440918			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1007702711			
Layer:		1			
Slot:		10			
Screen Top Depth:		4.880000114440918			
Screen End Depth:		8.5			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1007702788			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole ID: 1007702503 Diameter: 15.319999694824219 Depth From: 0.0 Depth To: 8.5 Hole Depth UOM: m Hole Diameter UOM: cm					
9	1 of 1	ENE/6.9	70.8 / -0.88	1051 Baxter Rd Ottawa ON	WWIS
Well ID: 7382664 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z343081 Tag: A302976 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 03/18/2021 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008638989 Depth M: Year Completed: 2021 Well Completed Dt: 01/20/2021 Audit No: Z343081 Path:					
Tag No: A302976 Contractor: 7241 Latitude: 45.3532178202195 Longitude: -75.7806252766524 Y: 45.353217813262006 X: -75.78062511583433					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008638989 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 01/20/2021 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
Elevation: Elevrc: Zone: 18 East83: 438854.00 North83: 5022486.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					
<u>Overburden and Bedrock</u> <u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1009823149			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.8200000524520874			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009823147			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009823148			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.8200000524520874			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824325			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.2200000286102295			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824326			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		3			
Plug From:		1.2200000286102295			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824324			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1009825962			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		Direct Push			
 <u>Pipe Information</u>					
Pipe ID:		1009718255			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1009826387			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1009826806			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5199999809265137			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1009827213			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: m Rate UOM: LPM Water State After Test Code: Water State After Test: Pumping Test Method: 0 Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1009825515 Diameter: 8.25 Depth From: 0.0 Depth To: 4.570000171661377 Hole Depth UOM: m Hole Diameter UOM: cm					
10	1 of 1	NE/11.3	70.9 / -0.82	1051 Baxter Rd Ottawa ON	WWIS
Well ID: 7382713 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z343082 Tag: A302977 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 03/18/2021 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID: 1008639127 Depth M: Year Completed: 2021 Well Completed Dt: 01/20/2021 Audit No: Z343082 Path:					
Tag No: A302977 Contractor: 7241 Latitude: 45.353621622464 Longitude: -75.7808095619356 Y: 45.353621615516985 X: -75.78080940062794					
<u>Bore Hole Information</u>					
Bore Hole ID: 1008639127 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole:					
Elevation: Elevrc: Zone: 18 East83: 438840.00 North83: 5022531.00 Org CS: UTM83					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:				UTMRC:	4
Date Completed:	01/20/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1009823258				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	2.130000114440918				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1009823257				
Layer:	1				
Color:	8				
General Color:	BLACK				
Material 1:	27				
Material 1 Desc:	OTHER				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	0.0				
Formation End Depth:	0.3100000023841858				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1009823259				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	06				
Material 1 Desc:	SILT				
Material 2:	28				
Material 2 Desc:	SAND				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	2.130000114440918				
Formation End Depth:	4.570000171661377				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824442			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.2200000286102295			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824441			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824443			
Layer:		3			
Plug From:		1.2200000286102295			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1009826000			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1009718295			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1009826428			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1009826843			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5199999809265137			
Screen End Depth:		4.570000171661377			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1009827253			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1009825559			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		4.570000171661377			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

<u>11</u>	1 of 1	ENE/11.9	71.9 / 0.21	1050 BAXTER RD Ottawa ON	WWIS
Well ID:	7231534			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/12/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z198304			Contractor:	7241
Tag:	A173786			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7231534.pdf				

Additional Detail(s) (Map)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		10/15/2014			
Year Completed:		2014			
Depth (m):		4.27			
Latitude:		45.3529045462967			
Longitude:		-75.7803656392542			
X:		-75.78036547767695			
Y:		45.35290453945004			
Path:		723\7231534.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1005215779			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438874.00
Code OB Desc:				North83:	5022451.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	10/15/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005291926				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	08				
Material 1 Desc:	FINE SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.6100000143051147				
Formation End Depth:	2.440000057220459				
Formation End Depth UOM:	m				
 <u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005291925				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	08				
Material 1 Desc:	FINE SAND				
Material 2:	01				
Material 2 Desc:	FILL				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	0.6100000143051147				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005291927			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		2.440000057220459			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005291935			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005291937			
Layer:		3			
Plug From:		0.9100000262260437			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005291936			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		0.9100000262260437			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005291934			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005291924			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing ID: 1005291930					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 1.2200000286102295					
Casing Diameter: 5.199999809265137					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1005291931					
Layer: 1					
Slot: 10					
Screen Top Depth: 1.2200000286102295					
Screen End Depth: 4.269999980926514					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 6.03000020980835					
<u>Water Details</u>					
Water ID: 1005291929					
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1005291928					
Diameter: 20.31999969482422					
Depth From: 0.0					
Depth To: 4.269999980926514					
Hole Depth UOM: m					
Hole Diameter UOM: cm					
<u>12</u>	1 of 1	E/12.9	71.9 / 0.15	1051 Baxter Rd Ottawa ON	WWIS
Well ID: 7382714					
Construction Date:					
Use 1st: Monitoring and Test Hole					
Use 2nd:					
Final Well Status: Monitoring and Test Hole					
Water Type:					
Casing Material:					
Audit No: Z343076					
Tag: A302975					
Constructn Method:					
Elevation (m):					
Elevatn Reliabilty:					
Depth to Bedrock:					
Well Depth:					
Overburden/Bedrock:					
Pump Rate:					
Static Water Level:					
Clear/Cloudy:					
Municipality: OTTAWA CITY					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status:					
Data Src:					
Date Received: 03/18/2021					
Selected Flag: TRUE					
Abandonment Rec:					
Contractor: 7241					
Form Version: 7					
Owner:					
County: OTTAWA-CARLETON					
Lot:					
Concession:					
Concession Name:					
Easting NAD83:					
Northing NAD83:					
Zone:					
UTM Reliability:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Info:					
<u>Additional Detail(s) (Map)</u>					
Bore Hole ID:	1008639130			Tag No:	A302975
Depth M:				Contractor:	7241
Year Completed:	2021			Latitude:	45.3527343210957
Well Completed Dt:	01/20/2021			Longitude:	-75.7802484013947
Audit No:	Z343076			Y:	45.35273431449674
Path:				X:	-75.78024823950082
<u>Bore Hole Information</u>					
Bore Hole ID:	1008639130			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438883.00
Code OB Desc:				North83:	5022432.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/20/2021			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1009823260				
Layer:	1				
Color:	8				
General Color:	BLACK				
Material 1:	27				
Material 1 Desc:	OTHER				
Material 2:	11				
Material 2 Desc:	GRAVEL				
Material 3:	66				
Material 3 Desc:	DENSE				
Formation Top Depth:	0.0				
Formation End Depth:	0.3100000023841858				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1009823261				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.3100000023841858				
Formation End Depth:	2.130000114440918				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009823262			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		2.130000114440918			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824444			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824445			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.2200000286102295			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009824446			
Layer:		3			
Plug From:		1.2200000286102295			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1009826001			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1009718296			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1009826429			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5199999809265137			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1009826844			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5199999809265137			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1009827254			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1009825560			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		4.570000171661377			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

<u>13</u>	1 of 1	SSW/30.4	72.9 / 1.15	1099 BAXTER ST Ottawa ON	WWIS
Well ID:	7232100			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	11/21/2014
Water Type:				Selected Flag:	TRUE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Material:			Abandonment Rec:		
Audit No:	Z186911			Contractor:	7241
Tag:	A173805			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7232100.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	10/17/2014				
Year Completed:	2014				
Depth (m):	14.02				
Latitude:	45.3510912539526				
Longitude:	-75.7822684013598				
X:	-75.78226823922822				
Y:	45.351091247263				
Path:	723\7232100.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1005229288			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438723.00
Code OB Desc:				North83:	5022251.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	10/17/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005430227				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	10				
Material 1 Desc:	COARSE SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	3.0999999046325684				
Formation End Depth:	10.670000076293945				
Formation End Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005430225			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:					
Material 1 Desc:					
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005430226			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005430228			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		15			
Material 1 Desc:		LIMESTONE			
Material 2:					
Material 2 Desc:					
Material 3:		74			
Material 3 Desc:		LAYERED			
Formation Top Depth:		10.670000076293945			
Formation End Depth:		14.020000457763672			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005430238			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		12.1899995803833			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1005430237			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005430239			
Layer:		3			
Plug From:		12.1899995803833			
Plug To:		14.020000457763672			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005430236			
Method Construction Code:		5			
Method Construction:		Air Percussion			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005430224			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005430232			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		12.5			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005430233			
Layer:		1			
Slot:		10			
Screen Top Depth:		12.5			
Screen End Depth:		14.020000457763672			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1005430231			
Layer:					
Kind Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
<u>Hole Diameter</u>					
Hole ID:	1005430229				
Diameter:	11.430000305175781				
Depth From:	0.0				
Depth To:	11.579999923706055				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Hole Diameter</u>					
Hole ID:	1005430230				
Diameter:	7.619999885559082				
Depth From:	11.579999923706055				
Depth To:	14.020000457763672				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>14</u>	1 of 1	WNW/56.1	69.9 / -1.85	Highway 417 Ottawa ON	EHS
Order No:	20160223140			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	17-JUN-16			Search Radius (km):	.25
Date Received:	23-FEB-16			X:	-75.78353
Previous Site Name:				Y:	45.352939
Lot/Building Size:					
Additional Info Ordered:					
<u>15</u>	1 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. 1051 Baxter Road Ottawa K2C 1H3 CITY OF OTTAWA ON	EBR
EBR Registry No:	012-1184			Decision Posted:	
Ministry Ref No:	2772-9FNKVA			Exception Posted:	
Notice Type:	Instrument Decision			Section:	
Notice Stage:				Act 1:	
Notice Date:	October 05, 2016			Act 2:	
Proposal Date:	February 28, 2014			Site Location Map:	
Year:	2014				
Instrument Type:	(EPA Part II.1-air) - Environmental Compliance Approval (project type: air)				
Off Instrument Name:					
Posted By:					
Company Name:	exp Services Inc.				
Site Address:					
Location Other:					
Proponent Name:					
Proponent Address:	56 Queen Street East , 301, Brampton Ontario, Canada L6V 1V2				
Comment Period:					
URL:					
Summary:					
Site Location Details:					
1051 Baxter Road Ottawa K2C 1H3 CITY OF OTTAWA					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
15	2 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. 1051 Baxter Rd Ottawa ON L6V 1V2	ECA
Approval No:		3815-ADMQDQ	MOE District:		
Approval Date:		2016-09-27	City:		
Status:		Approved	Longitude:		
Record Type:		ECA	Latitude:		
Link Source:		IDS	Geometry X:		
SWP Area Name:			Geometry Y:		
Approval Type:		ECA-AIR			
Project Type:		AIR			
Business Name:		exp Services Inc.			
Address:		1051 Baxter Rd			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/2772-9FNKVA-14.pdf			
PDF Site Location:					
15	3 of 23	ENE/62.7	72.0 / 0.24	1051 Baxter Rd. Ottawa ON K2C 3P2	EHS
Order No:		20010926010	Nearest Intersection:		
Status:		C	Municipality:		
Report Type:		Basic Report	Client Prov/State:		ON
Report Date:		10/2/01	Search Radius (km):		0.25
Date Received:		9/26/01	X:		-75.780036
Previous Site Name:			Y:		45.354237
Lot/Building Size:					
Additional Info Ordered:					
15	4 of 23	ENE/62.7	72.0 / 0.24	MICROMEASUREMENTS CANADA INC. 1051 BAXTER ROAD OTTAWA ON K2C 3P2	GEN
<u>Generator Info</u>					
Generator No:		ON1401200	Choice of Contact:		
Approval Years:		90	Contaminated Fac:		
Status:			MHSW Facility:		
PO Box No:			SIC Code:		0000
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		*** NOT DEFINED ***			
15	5 of 23	ENE/62.7	72.0 / 0.24	MICROMEASUREMENTS CANADA INC. 26-496 1051 BAXTER ROAD OTTAWA ON K2C 3P2	GEN
<u>Generator Info</u>					
Generator No:		ON1401200	Choice of Contact:		
Approval Years:		92,93,94,95,96,97,98	Contaminated Fac:		
Status:			MHSW Facility:		
PO Box No:			SIC Code:		3912

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER INSTRUMENTS			
<u>Waste Detail(s)</u>					
Waste Class:		123			
Waste Class Name:		ALKALINE PHOSPHATES			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>15</u>	6 of 23	ENE/62.7	72.0 / 0.24	Optelian Access Networks 22A-1051 Baxter Road Ottawa ON K2C 3P2	GEN

Generator Info

Generator No:	ON5596320	Choice of Contact:	
Approval Years:	07,08	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	517910
Country:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin: Phone No Admin: SIC Description: Other Telecommunications					
<u>Waste Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
15	7 of 23	ENE/62.7	72.0 / 0.24	Optelian Access Networks 22A-1051 Baxter Road Ottawa ON K2C 3P2	GEN
<u>Generator Info</u>					
Generator No: ON5596320 Approval Years: 2009 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Other Telecommunications					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 517910					
<u>Waste Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
15	8 of 23	ENE/62.7	72.0 / 0.24	Optelian Access Networks 22A-1051 Baxter Road Ottawa ON K2C 3P2	GEN
<u>Generator Info</u>					
Generator No: ON5596320 Approval Years: 2010 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Other Telecommunications					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 517910					
<u>Waste Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
15	9 of 23	ENE/62.7	72.0 / 0.24	Optelian Access Networks 22A-1051 Baxter Road Ottawa ON K2C 3P2	GEN
<u>Generator Info</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON5596320 Approval Years: 2011 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Other Telecommunications Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 517910					
<u>Waste Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
15	10 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. 1051 Baxter Road Unit 21A Ottawa ON	GEN
<u>Generator Info</u>					
Generator No: ON4464599 Approval Years: 2013 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: ENVIRONMENTAL CONSULTING SERVICES Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 541620					
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
<u>Waste Detail(s)</u>					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES					
15	11 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. 1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	GEN
<u>Generator Info</u>					
Generator No: ON4464599 Approval Years: 2016 Status: PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: ENVIRONMENTAL CONSULTING SERVICES Choice of Contact: CO_OFFICIAL Contaminated Fac: No MHSW Facility: No SIC Code: 541620					
<u>Waste Detail(s)</u>					
Waste Class: 148					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Detail(s)					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Detail(s)					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
15	12 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. 1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	GEN
Generator Info					
Generator No:		ON4464599		Choice of Contact:	CO_OFFICIAL
Approval Years:		2015		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	541620
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:		ENVIRONMENTAL CONSULTING SERVICES			
Waste Detail(s)					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
Waste Detail(s)					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
Waste Detail(s)					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			

<u>15</u>	13 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. 1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	GEN
<u>Generator Info</u>					
Generator No:		ON4464599		Choice of Contact:	CO_OFFICIAL
Approval Years:		2014		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	541620
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:		ENVIRONMENTAL CONSULTING SERVICES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
15	14 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. Geotechnical and Materials Testing 1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	GEN
<u>Generator Info</u>					
Generator No:	ON4464599			Choice of Contact:	
Approval Years:	As of Dec 2018			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	241 H				
Waste Class Name:	Halogenated solvents and residues				
<u>Waste Detail(s)</u>					
Waste Class:	241 L				
Waste Class Name:	Halogenated solvents and residues				
<u>Waste Detail(s)</u>					
Waste Class:	148 C				
Waste Class Name:	Misc. wastes and inorganic chemicals				
<u>Waste Detail(s)</u>					
Waste Class:	213 I				
Waste Class Name:	Petroleum distillates				
15	15 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. Geotechnical and Materials Testing 1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	GEN
<u>Generator Info</u>					
Generator No:	ON4464599			Choice of Contact:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Years:		As of Jul 2020		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		241 L			
Waste Class Name:		Halogenated solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		148 C			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		241 H			
Waste Class Name:		Halogenated solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			

<u>15</u>	16 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. Geotechnical and Materials Testing 1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	GEN

Generator Info

Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:		ON4464599 As of Nov 2021 Registered Canada		Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	

Waste Detail(s)

Waste Class:		213 I
Waste Class Name:		Petroleum distillates

Waste Detail(s)

Waste Class:		241 L
Waste Class Name:		Halogenated solvents and residues

Waste Detail(s)

Waste Class:		148 C

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		241 H			
Waste Class Name:		Halogenated solvents and residues			

15	17 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. 1051 Baxter Road Unit 21A Ottawa ON K2C 3P2	GEN

Generator Info

Generator No:	ON4464599	Choice of Contact:	
Approval Years:	As of Oct 2022	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	148 C
Waste Class Name:	INORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	241 L
Waste Class Name:	HALOGENATED SOLVENTS

Waste Detail(s)

Waste Class:	213 I
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	241 H
Waste Class Name:	HALOGENATED SOLVENTS

2017 Generator Info

Gen No:	ON4464599	Choice of Contact:	CO_OFFICIAL
ID:	17764	Phone No Official:	613-688-1891 Ext.3242
Contaminated Fac:	N	Phone No Admin:	
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	541620	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	exp Services Inc.		
Gen Div:	Geotechnical and Materials Testing		
Gen Op Name:	exp Services Inc.		
Gen Op Div:			
Site Adrs1:	1051 Baxter Road Unit 21A		
Site Bldg:			
Site Pobox:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 3P2			
Site Country:		Canada			
Co Official:		Ismail Taki			
Co Admin:					
<u>2018 Generator Info</u>					
Gen No:	ON4464599			Choice of Contact:	CO_OFFICIAL
ID:	17804			Phone No Official:	613-688-1891 Ext.3242
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	541620			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	exp Services Inc.				
Gen Div:	Geotechnical and Materials Testing				
Gen Op Name:	exp Services Inc.				
Gen Op Div:					
Site Adrs1:	1051 Baxter Road Unit 21A				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 3P2				
Site Country:	Canada				
Co Official:	Ismail Taki				
Co Admin:					
<u>2018 Generator Manifest</u>					
ID:	41172			Sum Received Qty:	100.0
Generator No:	ON4464599			Waste Class Name:	HALOGENATED SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	H			District:	203
Waste Code:	241				
<u>2019 Generator Info</u>					
Gen No:	ON4464599			Choice of Contact:	CO_OFFICIAL
ID:	17717			Phone No Official:	613-688-1891 Ext.3242
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	541620			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	exp Services Inc.				
Gen Div:	Geotechnical and Materials Testing				
Gen Op Name:	exp Services Inc.				
Gen Op Div:					
Site Adrs1:	1051 Baxter Road Unit 21A				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 3P2				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Country:		Canada			
Co Official:		Ismail Taki			
Co Admin:					
<u>2020 Generator Info</u>					
Gen No:	ON4464599			Choice of Contact:	CO_OFFICIAL
ID:	17415			Phone No Official:	613-688-1891 Ext.3242
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	541620			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	exp Services Inc.				
Gen Div:	Geotechnical and Materials Testing				
Gen Op Name:	exp Services Inc.				
Gen Op Div:					
Site Adrs1:	1051 Baxter Road Unit 21A				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 3P2				
Site Country:	Canada				
Co Official:	Ismail Taki				
Co Admin:					
<u>2021 Generator Info</u>					
Gen No:	ON4464599			Choice of Contact:	CO_OFFICIAL
ID:	17497			Phone No Official:	613-688-1891 Ext.3242
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	541620			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	exp Services Inc.				
Gen Div:	Geotechnical and Materials Testing				
Gen Op Name:	exp Services Inc.				
Gen Op Div:					
Site Adrs1:	1051 Baxter Road Unit 21A				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 3P2				
Site Country:	Canada				
Co Official:	Ismail Taki				
Co Admin:					
<u>2021 Generator Manifest</u>					
ID:	38579			Sum Received Qty:	100.0
Generator No:	ON4464599			Waste Class Name:	PETROLEUM DISTILLATES
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	213				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2021 Generator Manifest</u>					
ID:	38578			Sum Received Qty:	200.0
Generator No:	ON4464599			Waste Class Name:	HALOGENATED SOLVENTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	H			District:	203
Waste Code:	241				

<u>15</u>	18 of 23	ENE/62.7	72.0 / 0.24	HW Health & Sports Science Centre 1051 Baxter Road Ottawa ON	GEN

Generator Info (as of Dec 2024)

Generator No: ON001056617
Generator Company Name: HW Health & Sports Science Centre
Street: 1051 Baxter Road
City: Ottawa
Province State: Ontario
Country: Canada
Postal Code: K2C 3P1
Waste Class: 312 P

Waste Class Decoded:
 312 - PATHOLOGICAL WASTES

Generator Info (as of Apr 2025)

Generator Company Name: HW Health & Sports Science Centre
Generator Site Address: 1051 Baxter Road
City: Ottawa
Province State: Ontario
Country: Canada
Postal Code: K2C 3P1
Waste Class: 312 P

Waste Class Decoded:
 312 - PATHOLOGICAL WASTES

Waste Characteristic Decoded:
 P - Pathological

<u>15</u>	19 of 23	ENE/62.7	72.0 / 0.24	exp Services Inc. 1051 Baxter Road Ottawa ON	GEN

Generator Info (as of Dec 2024)

Generator No: ON001069509
Generator Company Name: exp Services Inc.
Street: 1051 Baxter Road
City: Ottawa
Province State: Ontario
Country: Canada

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Postal Code:		K2C 3P1			
Waste Class:		241 H			
Waste Class Decoded:					
241 - HALOGENATED SOLVENTS					
 <u>Generator Info (as of Apr 2025)</u>					
Generator Company Name:		exp Services Inc.			
Generator Site Address:		1051 Baxter Road			
City:		Ottawa			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2C 3P1			
Waste Class:		241 H			
Waste Class Decoded:					
241 - HALOGENATED SOLVENTS					
 Waste Characteristic Decoded:					
H - Hazardous Industrial Waste					
<u>15</u>	20 of 23	ENE/62.7	72.0 / 0.24	Dipix Technologies Inc. 1051 Baxter Rd Ottawa ON K2C 3P2	SCT
 Established:					
1987					
Plant Size (ft²):					
15000					
Employment:					
 --Details--					
Description:					
Commercial and Service Industry Machinery Manufacturing					
SIC/NAICS Code:					
333310					
Description:					
Material Handling Equipment Manufacturing					
SIC/NAICS Code:					
333920					
Description:					
Computer and Peripheral Equipment Manufacturing					
SIC/NAICS Code:					
334110					
<u>15</u>	21 of 23	ENE/62.7	72.0 / 0.24	PPI Systems 1051 Baqster Rd Unit 21 Ottawa ON K2C 3P2	SCT
 Established:					
8/1/2002					
Plant Size (ft²):					
Employment:					
 --Details--					
Description:					
Coating, Engraving, Heat Treating and Allied Activities					
SIC/NAICS Code:					
332810					
Description:					
Other Metalworking Machinery Manufacturing					
SIC/NAICS Code:					
333519					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
15	22 of 23	ENE/62.7	72.0 / 0.24	PPI Systems 1051 Baxter Rd Unit 21 Ottawa ON K2C 3P2	SCT
Established:		01-JUN-02			
Plant Size (ft²):					
Employment:					
--Details--					
Description:		Coating, Engraving, Heat Treating and Allied Activities			
SIC/NAICS Code:		332810			
Description:		Other Metalworking Machinery Manufacturing			
SIC/NAICS Code:		333519			
15	23 of 23	ENE/62.7	72.0 / 0.24	Optelian 1051 Baxter Rd Suite 22A Ottawa ON K2C 3P2	SCT
Established:					
Plant Size (ft²):					
Employment:					
--Details--					
Description:		Computer Systems Design and Related Services			
SIC/NAICS Code:		541510			
Description:		Computer and Peripheral Equipment Manufacturing			
SIC/NAICS Code:		334110			
16	1 of 1	NW/68.3	69.9 / -1.85	45.353700, -75.782646 OTTAWA ON	SPL
Ref No:		1-28KU7L	Municipality No:		
Year:			Nature of Damage:		
Incident Dt:		10/31/2022 2:00:00 PM	Discharger Report:		
Dt MOE Arvl on Scn:			Material Group:		
MOE Reported Dt:		11/1/2022 7:54:11 AM	Impact to Health:		0 No Impact
Dt Document Closed:		1/13/2023 12:09:50 PM	Agency Involved:		
Site No:					
MOE Response:		Desktop Response			
Site County/District:					
Site Geo Ref Meth:					
Site District Office:		Ottawa District Office			
Nearest Watercourse:					
Site Name:					
Site Address:		45.353700, -75.782646			
Site Region:					
Site Municipality:		OTTAWA			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:		Container/Drum/Tote			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary:Kewitt - 800L of concrete washout to ditch, contained, not cleaned Environment Impact:1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty:800 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name:CONCRETE ADMIXTURE (DE-WATERING) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium:Surface Water Activity Preceding Spill: Property 2nd Watershed:Central Ottawa Property Tertiary Watershed:02KF-Central Ottawa - Mississippi Sector Type:CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING SAC Action Class: Call Report Locatn Geodata:{"integration_ids":["PR00004318271"],"wks":["POINT (-75.7826460000 45.3537000000)"],"creation_date":"2022-11-01"} Time Reported: System Facility Address:					
17	1 of 1	S/70.0	72.9 / 1.15	BAXTER CLEANER 1131 BAXTER ROAD OTTAWA ON K2C 3R4	GEN
Generator Info Generator No:ON2077000 Approval Years:99,00,01,02,03,04 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:SOAP/CLEANING COMP. Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:3761					
Waste Detail(s) Waste Class:241 Waste Class Name:HALOGENATED SOLVENTS					
18	1 of 1	SSW/70.6	72.7 / 1.02	2685 IRIS STREET OTTAWA ON	WWIS
Well ID:7046634 Construction Date: Use 1st: Use 2nd: Final Well Status:Observation Wells Water Type: Casing Material: Audit No:Z74022 Tag:A050256 Constructn Method: Elevation (m): Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received:07/17/2007 Selected Flag:TRUE Abandonment Rec: Contractor:7241 Form Version:3 Owner: County:OTTAWA-CARLETON					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:			OTTAWA CITY	Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/704\7046634.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		06/15/2007			
Year Completed:		2007			
Depth (m):		8.53			
Latitude:		45.3506118647079			
Longitude:		-75.7826064791832			
X:		-75.78260631741918			
Y:		45.35061185846862			
Path:		704\7046634.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		23046634		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438696.00
Code OB Desc:				North83:	5022198.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		06/15/2007		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		30146634			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		0.6100000143051147			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		30446634			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.880000114440918			
Formation End Depth:		8.529999732971191			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		30346634			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		2.440000057220459			
Formation End Depth:		4.880000114440918			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		30246634			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.6100000143051147			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		44001296			
Layer:		3			
Plug From:		4.880000114440918			
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		44001294			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		44001295			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		25946634			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		29046634			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		42146634			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.489999771118164			
Casing Diameter:		3.809999942779541			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		43146634			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.489999771118164			
Screen End Depth:		8.529999732971191			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		3.6700000762939453			
 <u>Hole Diameter</u>					
Hole ID:		46000801			
Diameter:		8.890000343322754			
Depth From:		0.0			
Depth To:		8.529999732971191			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
19	1 of 1	ENE/78.9	71.9 / 0.15	1050 BAXTER RD Ottawa ON	WWIS
Well ID:		7231535	Flowing (Y/N):		
Construction Date:			Flow Rate:		
Use 1st:		Monitoring and Test Hole	Data Entry Status:		
Use 2nd:		0	Data Src:		
Final Well Status:		Test Hole	Date Received:		11/12/2014
Water Type:			Selected Flag:		TRUE
Casing Material:			Abandonment Rec:		
Audit No:		Z198303	Contractor:		7241
Tag:		A173787	Form Version:		7
Constructn Method:			Owner:		
Elevation (m):			County:		OTTAWA-CARLETON
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7231535.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/15/2014			
Year Completed:		2014			
Depth (m):		4.27			
Latitude:		45.3530094798078			
Longitude:		-75.7794989566494			
X:		-75.77949879504709			
Y:		45.35300947322779			
Path:		723\7231535.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1005215782	Elevation:		
DP2BR:			Elevrc:		
Spatial Status:			Zone:		18
Code OB:			East83:		438942.00
Code OB Desc:			North83:		5022462.00
Open Hole:			Org CS:		UTM83
Cluster Kind:			UTMRC:		4
Date Completed:		10/15/2014	UTMRC Desc:		margin of error : 30 m - 100 m
Remarks:			Location Method:		wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1005291948			
Layer:		1			
Color:		6			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BROWN			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.9100000262260437			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1005291950			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		2.440000057220459			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1005291949			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.9100000262260437			
Formation End Depth:		2.440000057220459			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1005291960			
Layer:		3			
Plug From:		0.9100000262260437			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1005291958			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005291959			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		0.9100000262260437			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005291957			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005291947			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005291953			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.2200000286102295			
Casing Diameter:		5.199999809265137			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005291954			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.2200000286102295			
Screen End Depth:		4.269999980926514			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		6.03000020980835			
<u>Water Details</u>					
Water ID:		1005291952			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005926075			
Layer:		1			
Plug From:		0.0			
Plug To:		14.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005926074			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005926068			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005926072			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005926073			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1005926071			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		8.0			
Water Found Depth UOM:		ft			
<u>Hole Diameter</u>					
Hole ID:		1005926070			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Diameter:		2.0			
Depth From:		0.0			
Depth To:		14.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			

21	1 of 6	S/88.1	72.9 / 1.16	JOHN EBBS ENTERPRISES LTD. O/A PALMER CLEANERS 1129 BAXTER ROAD OTTAWA ON K2C 3R4	GEN

Generator Info

Generator No:	ON0441301	Choice of Contact:	
Approval Years:	86,87,88,89,90	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	9721
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	POWER LAUND./CLEANERS		

Waste Detail(s)

Waste Class:	241
Waste Class Name:	HALOGENATED SOLVENTS

21	2 of 6	S/88.1	72.9 / 1.16	JOHN EBBS ENTERPRISES LTD. 1129 BAXTER ROAD OTTAWA ON K2C 3R4	GEN

Generator Info

Generator No:	ON0441301	Choice of Contact:	
Approval Years:	92,93,97,98	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	9721
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	POWER LAUND./CLEANER		

Waste Detail(s)

Waste Class:	241
Waste Class Name:	HALOGENATED SOLVENTS

21	3 of 6	S/88.1	72.9 / 1.16	JOHN EBBS ENTERPRISES LTD. 22-082 O/A PALMER CLEANERS 1129 BAXTER ROAD OTTAWA ON K2C 3R4	GEN

Generator Info

Generator No:	ON0441301	Choice of Contact:	
Approval Years:	94,95,96	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	9721

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Country: Co Admin: Phone No Admin: SIC Description:					
		POWER LAUND./CLEANER			
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
21	4 of 6	S/88.1	72.9 / 1.16	JOHN EBBS ENTERPRISES LIMITED 1129 BAXTER ROAD OTTAWA ON K2C 3R4	GEN
<u>Generator Info</u>					
Generator No: ON0441301 Approval Years: 99,00,01 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
		POWER LAUND./CLEANERS		Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 9721	
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
21	5 of 6	S/88.1	72.9 / 1.16	PALMER CLEANER 1067265 ONT. LTD. 1129 BAXTER ROAD OTTAWA ON K2C 3R4	GEN
<u>Generator Info</u>					
Generator No: ON2077000 Approval Years: 95,96,97 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:					
		SOAP/CLEANING COMP.		Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 3761	
<u>Waste Detail(s)</u>					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
21	6 of 6	S/88.1	72.9 / 1.16	BAXTER CLEANERS 1129 BAXTER ROAD OTTAWA ON K2C 3R4	GEN
<u>Generator Info</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON2077000 Approval Years: 98 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: SOAP/CLEANING COMP.					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 3761					
Waste Detail(s)					
Waste Class: 241 Waste Class Name: HALOGENATED SOLVENTS					
22	1 of 1	SSW/88.7	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID: 7147017 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z111657 Tag: A094026 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06/17/2010 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147017.pdf					
Additional Detail(s) (Map)					
Well Completed Date: 05/20/2010 Year Completed: 2010 Depth (m): 8.53 Latitude: 45.3504788680865 Longitude: -75.7823110288348 X: -75.78231086702128 Y: 45.350478861123314 Path: 714\7147017.pdf					
Bore Hole Information					
Bore Hole ID: 1003044245 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 05/20/2010					
Elevation: Elevrc: Zone: 18 East83: 438719.00 North83: 5022183.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB	
Remarks:		Location Method Desc:		on Water Well Record	Location Method:	WWF
Elevrc Desc:						
Location Source Date:						
Improvement Location Source:						
Improvement Location Method:						
Source Revision Comment:						
Supplier Comment:						
<u>Overburden and Bedrock</u>						
<u>Materials Interval</u>						
Formation ID:		1003190841				
Layer:		2				
Color:		2				
General Color:		GREY				
Material 1:		08				
Material 1 Desc:		FINE SAND				
Material 2:		06				
Material 2 Desc:		SILT				
Material 3:		85				
Material 3 Desc:		SOFT				
Formation Top Depth:		4.269999980926514				
Formation End Depth:		8.529999732971191				
Formation End Depth UOM:		m				
<u>Overburden and Bedrock</u>						
<u>Materials Interval</u>						
Formation ID:		1003190840				
Layer:		1				
Color:		6				
General Color:		BROWN				
Material 1:		09				
Material 1 Desc:		MEDIUM SAND				
Material 2:		85				
Material 2 Desc:		SOFT				
Material 3:		68				
Material 3 Desc:		DRY				
Formation Top Depth:		0.0				
Formation End Depth:		4.269999980926514				
Formation End Depth UOM:		m				
<u>Annular Space/Abandonment</u>						
<u>Sealing Record</u>						
Plug ID:		1003190844				
Layer:		2				
Plug From:		0.3100000023841858				
Plug To:		4.269999980926514				
Plug Depth UOM:		m				
<u>Annular Space/Abandonment</u>						
<u>Sealing Record</u>						
Plug ID:		1003190845				
Layer:		3				
Plug From:		4.269999980926514				
Plug To:		5.179999828338623				
Plug Depth UOM:		m				
<u>Annular Space/Abandonment</u>						

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Sealing Record</u>					
Plug ID:		1003190846			
Layer:		4			
Plug From:		5.179999828338623			
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190843			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003190852			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003190839			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003190848			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.489999771118164			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003190849			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.489999771118164			
Screen End Depth:		8.529999732971191			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
<u>Water Details</u>					
Water ID:		1003190847			
Layer:					
Kind Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind: Water Found Depth: Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1003190842 Diameter: 20.31999969482422 Depth From: 0.0 Depth To: 8.529999732971191 Hole Depth UOM: m Hole Diameter UOM: cm					
23	1 of 1	SSW/99.1	72.9 / 1.15	2785 IRIS ST Ottawa ON	WWIS
Well ID: 7159666 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: Z126331 Tag: A094026 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 02/25/2011 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159666.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 02/02/2011 Year Completed: 2011 Depth (m): Latitude: 45.3503703370782 Longitude: -75.7823861292965 X: -75.78238596706169 Y: 45.350370330475386 Path: 715\7159666.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1003479521 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 02/02/2011 Remarks: Location Method Desc: on Water Well Record					
Elevation: Elevrc: Zone: 18 East83: 438713.00 North83: 5022171.00 Org CS: UTM83 UTMRC: 3 UTMRC Desc: margin of error : 10 - 30 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806635			
Layer:		1			
Plug From:		0.0			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806636			
Layer:		2			
Plug From:		1.8300000429153442			
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003806633			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		EXCAVATED			
<u>Pipe Information</u>					
Pipe ID:		1003806625			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003806629			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003806630			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter UOM:		cm			
Screen Diameter:		8.890000343322754			
<u>Water Details</u>					
Water ID:		1003806628			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003806627			
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
24	1 of 1	SSW/99.3	72.9 / 1.15	2685 IRIS ST Ottawa ON	WWIS
Well ID:		7159667		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	02/25/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:		Z126330		Contractor:	7241
Tag:		A094027		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159667.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		02/02/2011			
Year Completed:		2011			
Depth (m):					
Latitude:		45.3503704245192			
Longitude:		-75.7823733645534			
X:		-75.78237320380235			
Y:		45.35037041822669			
Path:		715\7159667.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003479523		Elevation:	
DP2BR:				Elevrc:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Spatial Status:				Zone:	18
Code OB:				East83:	438714.00
Code OB Desc:				North83:	5022171.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	02/02/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806653			
Layer:		1			
Plug From:		0.0			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806654			
Layer:		2			
Plug From:		1.8300000429153442			
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003806651			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		EXCAVATED			
<u>Pipe Information</u>					
Pipe ID:		1003806643			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003806647			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID: 1003806648 Layer: 1 Slot: 10 Screen Top Depth: Screen End Depth: Screen Material: 5 Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter: 8.890000343322754					
<u>Water Details</u>					
Water ID: 1003806646 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1003806645 Diameter: Depth From: Depth To: Hole Depth UOM: m Hole Diameter UOM: cm					
25	1 of 1	SSW/100.1	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID: 7147018 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z111658 Tag: A094027 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06/17/2010 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147018.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 05/20/2010 Year Completed: 2010 Depth (m): 8.53 Latitude: 45.3503707742687 Longitude: -75.7823223055804					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
X:		-75.78232214447678			
Y:		45.35037076733808			
Path:		714\7147018.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003044247			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438718.00
Code OB Desc:				North83:	5022171.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05/20/2010			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003190869				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	09				
Material 1 Desc:	MEDIUM SAND				
Material 2:	85				
Material 2 Desc:	SOFT				
Material 3:	68				
Material 3 Desc:	DRY				
Formation Top Depth:	0.0				
Formation End Depth:	4.269999980926514				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1003190870				
Layer:	2				
Color:	2				
General Color:	GREY				
Material 1:	08				
Material 1 Desc:	FINE SAND				
Material 2:	06				
Material 2 Desc:	SILT				
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	4.269999980926514				
Formation End Depth:	8.529999732971191				
Formation End Depth UOM:	m				
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1003190874				
Layer:	3				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		4.269999980926514			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190872			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190873			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190875			
Layer:		4			
Plug From:		5.179999828338623			
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003190881			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003190868			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003190877			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.489999771118164			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID:		1003190878			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.489999771118164			
Screen End Depth:		8.529999732971191			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
<u>Water Details</u>					
Water ID:		1003190876			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003190871			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.529999732971191			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
26	1 of 1	SSW/100.5	72.9 / 1.15	2685 IRIS ST Ottawa ON	WWIS
Well ID:	7159665			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	02/25/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z126329			Contractor:	7241
Tag:	A094029			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159665.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	02/02/2011				
Year Completed:	2011				
Depth (m):					
Latitude:	45.3503615114267				
Longitude:	-75.7823604758027				
X:	-75.78236031477968				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Y:		45.35036150415061			
Path:		715\7159665.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003479519			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438715.00
Code OB Desc:				North83:	5022170.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	02/02/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003806575				
Layer:	1				
Plug From:	0.0				
Plug To:	183.0				
Plug Depth UOM:	m				
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003806576				
Layer:	2				
Plug From:	1.8300000429153442				
Plug To:					
Plug Depth UOM:	m				
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1003806573				
Method Construction Code:	B				
Method Construction:	Other Method				
Other Method Construction:	EXCAVATED				
<u>Pipe Information</u>					
Pipe ID:	1003806565				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1003806569				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From: Depth To: Casing Diameter: 7.619999885559082 Casing Diameter UOM: cm Casing Depth UOM: m					
Construction Record - Screen					
Screen ID: 1003806570 Layer: 1 Slot: 10 Screen Top Depth: Screen End Depth: Screen Material: 5 Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter: 8.890000343322754					
Water Details					
Water ID: 1003806568 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
Hole Diameter					
Hole ID: 1003806567 Diameter: Depth From: Depth To: Hole Depth UOM: m Hole Diameter UOM: cm					
27	1 of 1	S/103.5	72.8 / 1.12	LAURENT LEBLANC LIMITED 2591 iris ST ottawa ON K2C 1E4	EASR
Approval No: R-009-1014602427 Status: REGISTERED Date: 2021-10-14 Record Type: EASR Link Source: MOFA Project Type: Water Taking - Construction Dewatering Full Address: Approval Type: EASR-Water Taking - Construction Dewatering SWP Area Name: Rideau Valley PDF NAICS Code: PDF URL: http://www.accessenvironment.ene.gov.on.ca/AEWeb/ae/ViewDocument.action?documentRefID=2498496 PDF Site Location: 2591 iris Street ottawa ON K2C 1E4					
MOE District: Ottawa Municipality: ottawa Latitude: 45.35055556 Longitude: -75.78138889 Geometry X: -8435945.6227000002 Geometry Y: 5676879.1515000006					
28	1 of 1	ENE/104.5	70.8 / -0.87	1050 Baxter Rd Ottawa ON K2C 3P1	EHS
Order No: 20312000091 Status: C Report Type: Custom Report Report Date: 25-NOV-20					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .15					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Received:	20-NOV-20			X:	-75.77965692
Previous Site Name:				Y:	45.35385527
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans			

29	1 of 1	SSW/105.2	72.9 / 1.15	2685 IRIS ST Ottawa ON	WWIS
Well ID:	7159664			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	02/25/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z126328			Contractor:	7241
Tag:	A094028			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159664.pdf				

Additional Detail(s) (Map)

Well Completed Date: 02/02/2011
 Year Completed: 2011
 Depth (m):
 Latitude: 45.3503164213272
 Longitude: -75.782372620497
 X: -75.78237245820549
 Y: 45.35031641418506
 Path: 715\7159664.pdf

Bore Hole Information

Bore Hole ID:	1003479517	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	438714.00
Code OB Desc:		North83:	5022165.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	02/02/2011	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806468			
Layer:		1			
Plug From:		0.0			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806469			
Layer:		2			
Plug From:		1.8300000429153442			
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003806466			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		EXCAVATION			
<u>Pipe Information</u>					
Pipe ID:		1003806458			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003806462			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003806463			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.890000343322754			
<u>Water Details</u>					
Water ID:		1003806461			
Layer:					

211 erisinfo.com | Environmental Risk Information Services Order No: 25082500253

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003190927			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003190928			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.269999980926514			
Formation End Depth:		8.529999732971191			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003190930			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003190931			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1003190932			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190933			
Layer:		4			
Plug From:		5.179999828338623			
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003190939			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003190926			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003190935			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.489999771118164			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003190936			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.489999771118164			
Screen End Depth:		8.529999732971191			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
<u>Water Details</u>					
Water ID:		1003190934			
Layer:					
Kind Code:					
Kind:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth:					
Water Found Depth UOM:		m			
Hole Diameter					
Hole ID:		1003190929			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.529999732971191			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
31	1 of 1	SSW/112.7	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID:		7147021		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	
Water Type:				06/17/2010	
Casing Material:				Selected Flag:	
Audit No:		Z111654		TRUE	
Tag:		A094030		Abandonment Rec:	
Constructn Method:				Contractor:	
Elevation (m):				7241	
Elevatn Reliabilty:				Form Version:	
Depth to Bedrock:				7	
Well Depth:				Owner:	
Overburden/Bedrock:				County:	
Pump Rate:				OTTAWA-CARLETON	
Static Water Level:				Lot:	
Clear/Cloudy:				Concession:	
Municipality:		OTTAWA CITY		Concession Name:	
Site Info:				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147021.pdf			
Additional Detail(s) (Map)					
Well Completed Date:		05/19/2010			
Year Completed:		2010			
Depth (m):		8.53			
Latitude:		45.3502631176083			
Longitude:		-75.78226975869			
X:		-75.78226959755078			
Y:		45.350263111472614			
Path:		714\7147021.pdf			
Bore Hole Information					
Bore Hole ID:		1003044303		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				438722.00	
Cluster Kind:				North83:	
Date Completed:		05/19/2010		5022159.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
				4	
				UTMRC Desc:	
				margin of error : 30 m - 100 m	
				Location Method:	
				wwr	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003190957			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003190958			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.269999980926514			
Formation End Depth:		8.529999732971191			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003190962			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003190961			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003190963			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		4			
Plug From:		5.179999828338623			
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190960			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003190969			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003190956			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003190965			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.489999771118164			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003190966			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.489999771118164			
Screen End Depth:		8.529999732971191			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
 <u>Water Details</u>					
Water ID:		1003190964			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1003190959			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.529999732971191			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
32	1 of 1	SSW/112.9	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID:	7147020			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06/17/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z111655			Contractor:	7241
Tag:	A094029			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Relabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147020.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	05/20/2010				
Year Completed:	2010				
Depth (m):	8.53				
Latitude:	45.3502443296299				
Longitude:	-75.7823843931399				
X:	-75.78238423152781				
Y:	45.35024432306897				
Path:	714\7147020.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003044251			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438713.00
Code OB Desc:				North83:	5022157.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05/20/2010			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003190942			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003190943			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.269999980926514			
Formation End Depth:		8.529999732971191			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190946			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190947			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190948			
Layer:		4			
Plug From:		5.179999828338623			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190945			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003190954			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003190941			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003190950			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.489999771118164			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003190951			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.489999771118164			
Screen End Depth:		8.529999732971191			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:					
 <u>Water Details</u>					
Water ID:		1003190949			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1003190944			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.529999732971191			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
33	1 of 40	NE/115.6	70.9 / -0.85	1050 Baxter Road Ottawa ON	EHS
Order No:	20140728050			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	ON
Report Date:	01-AUG-14			Search Radius (km):	.25
Date Received:	28-JUL-14			X:	-75.779745
Previous Site Name:				Y:	45.354181
Lot/Building Size:	10.4 acres				
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; Topographic Maps; City Directory				
33	2 of 40	NE/115.6	70.9 / -0.85	1050 - 1051 Baxter Rd Ottawa ON K2C 3P1	EHS
Order No:	20180822206			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	30-AUG-18			Search Radius (km):	.25
Date Received:	22-AUG-18			X:	-75.779666
Previous Site Name:				Y:	45.353878
Lot/Building Size:					
Additional Info Ordered:	Fire Insur. Maps and/or Site Plans; Topographic Maps; City Directory; Aerial Photos				
33	3 of 40	NE/115.6	70.9 / -0.85	1050 Baxter Road Ottawa ON K2C 3P1	EHS
Order No:	24121100220			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Standard Report			Client Prov/State:	CO
Report Date:	13-DEC-24			Search Radius (km):	.25
Date Received:	11-DEC-24			X:	-75.7797581
Previous Site Name:				Y:	45.3542614
Lot/Building Size:					
Additional Info Ordered:					
33	4 of 40	NE/115.6	70.9 / -0.85	CARRIER CANADA LIMITED 1050 BAXTER ROAD, UNIT 8 BAXTER CENTRE OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:	ON0051306			Choice of Contact:	
Approval Years:	95,96,97			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	9959
Country:					
Co Admin:					
Phone No Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		OTHER SERV. TO BLDG.			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
33	5 of 40	NE/115.6	70.9 / -0.85	CARRIER CANADA LIMITED BAXTER CENTRE 1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:		ON0051306		Choice of Contact:	
Approval Years:		98,99,00,01		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 9959	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		OTHER SERV. TO BLDG.			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
33	6 of 40	NE/115.6	70.9 / -0.85	UTC Canada Corporation 1050 Baxter Road Ottawa ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:		ON0051306		Choice of Contact:	
Approval Years:		02,03,04,05,06,07,08		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 561799	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		All Other Services to Buildings & Dwellings			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
			122		
			Waste Class:	ALKALINE WASTES - OTHER METALS	
			Waste Class Name:		
<u>Waste Detail(s)</u>					
			213		
			Waste Class:	PETROLEUM DISTILLATES	
			Waste Class Name:		
<u>Waste Detail(s)</u>					
			254		
			Waste Class:	TRANSFER STATION OILS WASTES	
			Waste Class Name:		
<u>Waste Detail(s)</u>					
			148		
			Waste Class:	INORGANIC LABORATORY CHEMICALS	
			Waste Class Name:		
<u>Waste Detail(s)</u>					
			148		
			Waste Class:	INORGANIC LABORATORY CHEMICALS	
			Waste Class Name:		
<u>Waste Detail(s)</u>					
			252		
			Waste Class:	WASTE OILS & LUBRICANTS	
			Waste Class Name:		
<u>Waste Detail(s)</u>					
			145		
			Waste Class:	PAINT/PIGMENT/COATING RESIDUES	
			Waste Class Name:		
<u>Waste Detail(s)</u>					
			998		
			Waste Class:	NONHAZARDOUS WASTE	
			Waste Class Name:		
<u>Waste Detail(s)</u>					
			212		
			Waste Class:	ALIPHATIC SOLVENTS	
			Waste Class Name:		
<u>Waste Detail(s)</u>					
			331		
			Waste Class:	WASTE COMPRESSED GASES	
			Waste Class Name:		
33	7 of 40	NE/115.6	70.9 / -0.85	APH (MICOT) CANAD INC. 1050 BAXTER ROAD OTTAWA ON K2C 3P1	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON0855900			Choice of Contact:	
Approval Years:	86,87,88,89,90			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2821
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		PLATEMAKING, ETC.			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
33	8 of 40	NE/115.6	70.9 / -0.85	APH (MICOT) CANAD INC. (OUT OF BUSINESS) 1050 BAXTER ROAD OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:	ON0855900			Choice of Contact:	
Approval Years:	92,93,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2821
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		PLATEMAKING, ETC.			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
33	9 of 40	NE/115.6	70.9 / -0.85	APH (MICOT) CANAD INC. 03-262 1050 BAXTER ROAD OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:	ON0855900			Choice of Contact:	
Approval Years:	94,95			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	2821
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		PLATEMAKING, ETC.			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
33	10 of 40	NE/115.6	70.9 / -0.85	MINTO DEVELOPMENTS INC. 1050 BAXTER ROAD C/O 427 LAURIER AVENUE SUITE 300 OTTAWA ON K2C 3P1	GEN

Generator Info

Generator No:	ON1154400	Choice of Contact:	
Approval Years:	89	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	4129
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER HEAVY CONSTR.		

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

33	11 of 40	NE/115.6	70.9 / -0.85	MINTO DEVELOPMENTS INC. 25-561 1050 BAXTER ROAD C/O 427 LAURIER AVENUE SUITE 300 OTTAWA ON K2C 3P1	GEN

Generator Info

Generator No:	ON1154400	Choice of Contact:	
Approval Years:	92,93,94,95,96,97,98	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	4129
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	OTHER HEAVY CONSTR.		

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

33	12 of 40	NE/115.6	70.9 / -0.85	CLIMEC RESIDENTIAL INC. 1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON5592842			Choice of Contact:	
Approval Years:	02,03,04,05,06,07,08			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				
33	13 of 40	NE/115.6	70.9 / -0.85	RESET ELECTRONICS INC. 1050 BAXTER RD. OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:	ON5125644			Choice of Contact:	
Approval Years:	07,08			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	417320
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Electronic Components Navigational and Communications Equipment and Supplies Wholesaler-Distributors				
<u>Waste Detail(s)</u>					
Waste Class:	212				
Waste Class Name:	ALIPHATIC SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	241				
Waste Class Name:	HALOGENATED SOLVENTS				
33	14 of 40	NE/115.6	70.9 / -0.85	HOLMES HEATING INC 1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:	ON9970783			Choice of Contact:	
Approval Years:	07,08			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	238220
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Plumbing Heating and Air-Conditioning Contractors				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
33	15 of 40	NE/115.6	70.9 / -0.85	UTC Canada Corporation 1050 Baxter Road Ottawa ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:		ON0051306		Choice of Contact:	
Approval Years:		2009		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				561799	
Co Admin:					
Phone No Admin:					
SIC Description:		All Other Services to Buildings and Dwellings			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
33	16 of 40	NE/115.6	70.9 / -0.85	RESET ELECTRONICS INC. 1050 BAXTER RD. OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:		ON5125644		Choice of Contact:	
Approval Years:		2009		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 417320	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Electronic Components Navigational and Communications Equipment and Supplies Wholesaler-Distributors			
<u>Waste Detail(s)</u>					
Waste Class:		241			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
33	17 of 40	NE/115.6	70.9 / -0.85	CLIMEC RESIDENTIAL INC. 1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:		ON5592842		Choice of Contact:	
Approval Years:		2009		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 232520	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
33	18 of 40	NE/115.6	70.9 / -0.85	HOLMES HEATING INC 1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON9970783 Approval Years: 2009 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: Plumbing Heating and Air-Conditioning Contractors Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 238220					
<u>Waste Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
33	19 of 40	NE/115.6	70.9 / -0.85	UTC Canada Corporation 1050 Baxter Road Ottawa ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No: ON0051306 Approval Years: 2010 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: All Other Services to Buildings and Dwellings Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 561799					
<u>Waste Detail(s)</u>					
Waste Class: 212 Waste Class Name: ALIPHATIC SOLVENTS					
<u>Waste Detail(s)</u>					
Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
<u>Waste Detail(s)</u>					
Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 213 Waste Class Name: PETROLEUM DISTILLATES					
<u>Waste Detail(s)</u>					
Waste Class: 113 Waste Class Name: ACID WASTE - OTHER METALS					
<u>Waste Detail(s)</u>					
Waste Class: 331					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
33	20 of 40	NE/115.6	70.9 / -0.85	CLIMEC RESIDENTIAL INC. 1050 BAXTER ROAD, UNIT 8 OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:		ON5592842		Choice of Contact:	
Approval Years:		2010		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				232520	
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
33	21 of 40	NE/115.6	70.9 / -0.85	HOLMES HEATING INC 1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:		ON9970783		Choice of Contact:	
Approval Years:		2011		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				238220	
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
33	22 of 40	NE/115.6	70.9 / -0.85	DEBOER'S 1050 BAXTER ROAD OTTAWA ON K2C 3P1	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON5326509			Choice of Contact:	
Approval Years:	2011			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	442110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					

33	23 of 40	NE/115.6	70.9 / -0.85	UTC Canada Corporation 1050 Baxter Road Ottawa ON K2C 3P1	GEN

Generator Info

Generator No:	ON0051306	Choice of Contact:	
Approval Years:	2011	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	561799
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	All Other Services to Buildings and Dwellings		

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class:	145
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	113
Waste Class Name:	ACID WASTE - OTHER METALS

Waste Detail(s)

Waste Class:	331
Waste Class Name:	WASTE COMPRESSED GASES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>33</u>	24 of 40	NE/115.6	70.9 / -0.85	UTC Canada Corporation 1050 Baxter Road Ottawa ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:	ON0051306			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	561799
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		All Other Services to Buildings and Dwellings			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: 113 Waste Class Name: ACID WASTE - OTHER METALS <u>Waste Detail(s)</u> Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
33	25 of 40	NE/115.6	70.9 / -0.85	HOLMES HEATING INC 1050 BAXTER ROAD UNIT 5 OTTAWA ON	GEN
<u>Generator Info</u> Generator No: ON9970783 Approval Years: 2013 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: PLUMBING, HEATING AND AIR-CONDITIONING CONTRACTORS Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 238220					
<u>Waste Detail(s)</u> Waste Class: 252 Waste Class Name: WASTE OILS & LUBRICANTS					
33	26 of 40	NE/115.6	70.9 / -0.85	UTC Canada Corporation 1050 Baxter Road Ottawa ON	GEN
<u>Generator Info</u> Generator No: ON0051306 Approval Years: 2013 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: ALL OTHER SERVICES TO BUILDINGS AND DWELLINGS Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 561799					
<u>Waste Detail(s)</u> Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS <u>Waste Detail(s)</u> Waste Class: 121 Waste Class Name: ALKALINE WASTES - HEAVY METALS <u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			

33

27 of 40

NE/115.6

70.9 / -0.85

HOLMES HEATING INC
1050 BAXTER ROAD UNIT 5
OTTAWA ON K2C 3P1

GEN

Generator Info

Generator No: ON9970783
Approval Years: 2015
Status:
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:

Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No
SIC Code: 238220

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		PLUMBING, HEATING AND AIR-CONDITIONING CONTRACTORS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
33	28 of 40	NE/115.6	70.9 / -0.85	UTC Canada Corporation 1050 Baxter Road Ottawa ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:		ON0051306		Choice of Contact:	CO_ADMIN
Approval Years:		2015		Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	561799
Country:		Canada			
Co Admin:		Spencer McPhee			
Phone No Admin:		800-565-1939 Ext.3243			
SIC Description:		ALL OTHER SERVICES TO BUILDINGS AND DWELLINGS			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			

[33](#)

29 of 40

NE/115.6

70.9 / -0.85

UTC Canada Corporation
1050 Baxter Road
Ottawa ON K2C 3P1

GEN

Generator Info

Generator No:	ON0051306	Choice of Contact:	CO_ADMIN
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	561799
Country:	Canada		
Co Admin:	Spencer McPhee		
Phone No Admin:	800-565-1939 Ext.3243		
SIC Description:	ALL OTHER SERVICES TO BUILDINGS AND DWELLINGS		

Waste Detail(s)

Waste Class: 145
Waste Class Name: PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class: 213
Waste Class Name: PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class: 122
Waste Class Name: ALKALINE WASTES - OTHER METALS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		112			
Waste Class Name:		ACID WASTE - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
33	30 of 40	NE/115.6	70.9 / -0.85	HOLMES HEATING INC 1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	GEN

Generator Info

Generator No:	ON9970783	Choice of Contact:	CO_OFFICIAL
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	238220
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:	PLUMBING, HEATING AND AIR-CONDITIONING CONTRACTORS		

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		252 WASTE OILS & LUBRICANTS			

33	31 of 40	NE/115.6	70.9 / -0.85	CARRIER ENTERPRISE 1050 BAXTER ROAD OTTAWA ON K2C 3P1	GEN

Generator Info

Generator No:	ON3309953	Choice of Contact:	
Approval Years:	As of Dec 2017	Contaminated Fac:	
Status:	Registered	MHSW Facility:	
PO Box No:		SIC Code:	
Country:	Canada		
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Waste Class:	145 I
Waste Class Name:	Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class:	213 I
Waste Class Name:	Petroleum distillates

Waste Detail(s)

Waste Class:	252 L
Waste Class Name:	Waste crankcase oils and lubricants

2017 Generator Info

Gen No:	ON3309953	Choice of Contact:	CO_OFFICIAL
ID:	13370	Phone No Official:	613-820-4328 Ext.
Contaminated Fac:	N	Phone No Admin:	
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	238299	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	CARRIER ENTERPRISE		
Gen Div:			
Gen Op Name:	CARRIER ENTERPRISE		
Gen Op Div:			
Site Adrs1:	1050 BAXTER ROAD		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	OTTAWA		
Province Out:			
Site Postal Code:	K2C 3P1		
Site Country:	Canada		
Co Official:	JEFF VERGETTE		
Co Admin:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2017 Generator Manifest</u>					
ID:	35630			Sum Received Qty:	20.0
Generator No:	ON3309953			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	145				
<u>2017 Generator Manifest</u>					
ID:	35632			Sum Received Qty:	205.0
Generator No:	ON3309953			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	252				
<u>2017 Generator Manifest</u>					
ID:	35631			Sum Received Qty:	20.0
Generator No:	ON3309953			Waste Class Name:	PETROLEUM DISTILLATES
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	213				
33	32 of 40	NE/115.6	70.9 / -0.85	HOLMES HEATING INC 1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:	ON9970783			Choice of Contact:	CO_OFFICIAL
Approval Years:	2016			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	238220
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:	PLUMBING, HEATING AND AIR-CONDITIONING CONTRACTORS				
<u>Waste Detail(s)</u>					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				
33	33 of 40	NE/115.6	70.9 / -0.85	Reliance Comfort RELIANCE 1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:	ON9970783			Choice of Contact:	
Approval Years:	As of Dec 2018			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
33	34 of 40	NE/115.6	70.9 / -0.85	Reliance Comfort RELIANCE 1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:		ON9970783		Choice of Contact:	
Approval Years:		As of Jul 2020		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
33	35 of 40	NE/115.6	70.9 / -0.85	Reliance Comfort 1050 BAXTER ROAD UNIT 5 OTTAWA ON K2C 3P1	GEN
<u>Generator Info</u>					
Generator No:		ON9970783		Choice of Contact:	
Approval Years:		As of Jan 2021		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>2017 Generator Info</u>					
Gen No:		ON9970783		Choice of Contact:	
ID:		38919		CO_OFFICIAL	
Contaminated Fac:		N		Phone No Official:	
MHSW Facility:		N		519-750-2969 Ext.	
NAICS Code1:		238220		Phone No Admin:	
NAICS Code2:				County Ont:	
NAICS Code3:				OTTAWA CARLTON (RM)	
Gen Name:		Reliance Comfort		County Out:	
Gen Div:		RELIANCE		District:	
				402	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Op Name:		Reliance Comfort			
Gen Op Div:		RELIANCE			
Site Adrs1:		1050 BAXTER ROAD			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		UNIT 5			
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K2C 3P1			
Site Country:		Canada			
Co Official:		Andy Gould			
Co Admin:					
<u>2018 Generator Info</u>					
Gen No:		ON9970783		Choice of Contact:	CO_OFFICIAL
ID:		39736		Phone No Official:	519-750-2969 Ext.
Contaminated Fac:		N		Phone No Admin:	
MHSW Facility:		N		County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:		238220		County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Reliance Comfort			
Gen Div:		RELIANCE			
Gen Op Name:		Reliance Comfort			
Gen Op Div:		RELIANCE			
Site Adrs1:		1050 BAXTER ROAD			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		UNIT 5			
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K2C 3P1			
Site Country:		Canada			
Co Official:		Andy Gould			
Co Admin:					
<u>2020 Generator Info</u>					
Gen No:		ON9970783		Choice of Contact:	CO_OFFICIAL
ID:		40086		Phone No Official:	519-750-2969 Ext.
Contaminated Fac:		N		Phone No Admin:	
MHSW Facility:		N		County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:		238220		County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Reliance Comfort			
Gen Div:		RELIANCE			
Gen Op Name:		Reliance Comfort			
Gen Op Div:		RELIANCE			
Site Adrs1:		1050 BAXTER ROAD			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:		UNIT 5			
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K2C 3P1			
Site Country:		Canada			
Co Official:		Andy Gould			
Co Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2020 Generator Manifest</u>					
ID:	64560			Sum Received Qty:	205.0
Generator No:	ON9970783			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	030			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	252				
33	36 of 40	NE/115.6	70.9 / -0.85	Reliance Home Comfort 1050 Baxter Road Ottawa ON	GEN
<u>Generator Info (as of Dec 2024)</u>					
Generator No:	ON001053503				
Generator Company Name:	Reliance Home Comfort				
Street:	1050 Baxter Road				
City:	Ottawa				
Province State:	Ontario				
Country:	Canada				
Postal Code:	K2C 3P1				
Waste Class:	331 I, 252 L, 122 C, 148 B, 145 L				
Waste Class Decoded:					
331 - WASTE COMPRESSED GASES; 252 - WASTE OILS & LUBRICANTS; 122 - ALKALINE WASTES - OTHER METALS; 148 - INORGANIC LABORATORY CHEMICALS; 145 - PAINT/PIGMENT/COATING RESIDUES					
<u>Generator Info (as of Dec 2024)</u>					
Generator No:	ON001053503				
Generator Company Name:	Reliance Home Comfort				
Street:	1050 Baxter Road				
City:	Ottawa				
Province State:	Ontario				
Country:	Canada				
Postal Code:	K2C 3P1				
Waste Class:	331 I,252 L,122 C,148 B				
Waste Class Decoded:					
331 - WASTE COMPRESSED GASES; 252 - WASTE OILS & LUBRICANTS; 122 - ALKALINE WASTES - OTHER METALS; 148 - INORGANIC LABORATORY CHEMICALS					
<u>Generator Info (as of Apr 2025)</u>					
Generator Company Name:	Reliance Home Comfort				
Generator Site Address:	1050 Baxter Road				
City:	Ottawa				
Province State:	Ontario				
Country:	Canada				
Postal Code:	K2C 3P1				
Waste Class:	331 I, 252 L, 122 C, 148 B				
Waste Class Decoded:					
331 - WASTE COMPRESSED GASES; 252 - WASTE OILS & LUBRICANTS; 122 - ALKALINE WASTES - OTHER METALS; 148 - INORGANIC LABORATORY CHEMICALS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Characteristic Decoded:					
I - Ignitable; L - Liquid Industrial Waste; C - Corrosive; B - Hazardous Waste Chemical					
33	37 of 40	NE/115.6	70.9 / -0.85	Deslaurier Custom Cabinets Inc. 1050 Baxter Road Ottawa ON	GEN
Generator Info (as of Dec 2024)					
Generator No:		ON001055080			
Generator Company Name:		Deslaurier Custom Cabinets Inc.			
Street:		1050 Baxter Road			
City:		Ottawa			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2C 3P1			
Waste Class:		331 I, 252 L, 122 C, 148 B, 145 L			
Waste Class Decoded:					
331 - WASTE COMPRESSED GASES; 252 - WASTE OILS & LUBRICANTS; 122 - ALKALINE WASTES - OTHER METALS; 148 - INORGANIC LABORATORY CHEMICALS; 145 - PAINT/PIGMENT/COATING RESIDUES					
Generator Info (as of Dec 2024)					
Generator No:		ON001055080			
Generator Company Name:		Deslaurier Custom Cabinets Inc.			
Street:		1050 Baxter Road			
City:		Ottawa			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2C 3P1			
Waste Class:		145 L			
Waste Class Decoded:					
145 - PAINT/PIGMENT/COATING RESIDUES					
Generator Info (as of Apr 2025)					
Generator Company Name:		Deslaurier Custom Cabinets Inc.			
Generator Site Address:		1050 Baxter Road			
City:		Ottawa			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2C 3P1			
Waste Class:		145 L			
Waste Class Decoded:					
145 - PAINT/PIGMENT/COATING RESIDUES					
Waste Characteristic Decoded:					
L - Liquid Industrial Waste					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
33	38 of 40	NE/115.6	70.9 / -0.85	Cummings Mitchell Inc. 1050 Baxter Rd Unit 11 Ottawa ON K2C 3P1	SCT
Established: 1993 Plant Size (ft²): 5000 Employment:					
--Details--					
Description:		Showcase, Partition, Shelving and Locker Manufacturing			
SIC/NAICS Code:		337215			
Description:		All Other Wholesaler-Distributors			
SIC/NAICS Code:		418990			
33	39 of 40	NE/115.6	70.9 / -0.85	Roger Rossi Unit 5 - 1050 Baxter Rd Ottawa ON K2C 3P1	SPL
Ref No: 4746-B9SNRZ Year: Incident Dt: 2/25/2019 Dt MOE Arvl on Scn: 2/25/2019 MOE Reported Dt: 2/25/2019 Dt Document Closed: 3/5/2019 Site No: 0200-B9QMC5 MOE Response: Yes Site County/District: NA Site Geo Ref Meth: NA Site District Office: Ottawa Nearest Watercourse: Site Name: 1050 Baxter Road Unit 5 Site Address: Unit 5 - 1050 Baxter Rd Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: NA Site Geo Ref Accu: NA Site Map Datum: NA Northing: NA Easting: NA Entity Operating Name: Client Name: Roger Rossi Client Type: Sole Proprietor Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: No Expiry Date Entered on Notices Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium:					
				Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 1 - Administrative Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
33	40 of 40	NE/115.6	70.9 / -0.85	45.354181, -75.781171 OTTAWA ON	SPL
Ref No: 1-9W33U9 Year: Incident Dt: Aug 14,2024 05:29:24 PM Dt MOE Arvl on Scn: MOE Reported Dt: Aug 14,2024 05:29:24 PM Dt Document Closed: Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 45.354181, -75.781171 Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Other (specify) Incident Cause: Incident Preceding Spill: Incident Reason: Leak (Specify the source) Incident Summary: Spill: 9L hydraulic fluid, cntd, cing Environment Impact: Health Env Consequence: Low Nature of Impact: Contaminant Qty: 9 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Lower Ottawa Property Tertiary Watershed: 02KE - Lower Madawaska Sector Type: SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003883971"],"wks":["POINT (-75.7797581000 45.3542614000)","creation_date":"2024-08-14"} Time Reported: System Facility Address:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
34	1 of 1	SSW/116.6	72.9 / 1.15	2685 IRIS ST Ottawa ON	WWIS
Well ID: 7159663 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: Z126327 Tag: A094031 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 02/25/2011 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability: PDF URL (Map):https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159663.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 02/02/2011 Year Completed: 2011 Depth (m): Latitude: 45.3502176777868 Longitude: -75.7823329622726 X: -75.78233280030217 Y: 45.350217671053755 Path: 715\7159663.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1003479515 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: 02/02/2011 Remarks: Location Method Desc: on Water Well Record Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment: Elevation: Elevrc: Zone: 18 East83: 438717.00 North83: 5022154.00 Org CS: UTM83 UTMRC: 3 UTMRC Desc: margin of error : 10 - 30 m Location Method: wwr					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID: 1003806412 Layer: 2					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		1.8300000429153442			
Plug To:					
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806411			
Layer:		1			
Plug From:		0.0			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003806408			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003806364			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003806404			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003806405			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.890000343322754			
 <u>Water Details</u>					
Water ID:		1003806403			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1003806402			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>35</u>	1 of 1	SSE/117.0	73.9 / 2.15	1050 BAXTER RD OTTAWA ON	WWIS
Well ID:	7255863			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:				Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	01/14/2016
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z221586			Contractor:	6894
Tag:	A173786			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/725\7255863.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	01/04/2016				
Year Completed:	2016				
Depth (m):					
Latitude:	45.3509214627629				
Longitude:	-75.780772431842				
X:	-75.78077227080387				
Y:	45.35092145618393				
Path:	725\7255863.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1005865732			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438840.00
Code OB Desc:				North83:	5022231.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	01/04/2016			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005926093			
Layer:		1			
Plug From:		0.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005926092			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1005926086			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005926090			
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:		inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1005926091			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:					
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:					
<u>Water Details</u>					
Water ID:		1005926089			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		9.5			
Water Found Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1005926088			
Diameter:		2.0			
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
36	1 of 1	S/118.7	72.8 / 1.03	1119-1143 BAXTER RD Ottawa ON	WWIS
Well ID:	7233764			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	12/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z198267			Contractor:	7241
Tag:	A173765			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7233764.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	10/27/2014				
Year Completed:	2014				
Depth (m):	4.57				
Latitude:	45.350365619474				
Longitude:	-75.7817605329032				
X:	-75.78176037152227				
Y:	45.350365612049664				
Path:	723\7233764.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1005259730			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438762.00
Code OB Desc:				North83:	5022170.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	10/27/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005423102			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.8300000429153442			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005423101			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		1.8300000429153442			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005423111			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.2200000286102295			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005423110			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005423112			
Layer:		3			
Plug From:		1.2200000286102295			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1005423109			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1005423100			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1005423105			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005423106			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1005423104			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005423103			
Diameter:		8.300000190734863			
Depth From:		0.0			
Depth To:		4.570000171661377			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
37	1 of 1	SSW/119.1	72.9 / 1.15	2685 IRIS ST Ottawa ON	WWIS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well ID:	7159662			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	02/25/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:	Z126326			Contractor:	7241
Tag:	A094030			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159662.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	02/02/2011				
Year Completed:	2011				
Depth (m):					
Latitude:	45.3501999390221				
Longitude:	-75.7822944201528				
X:	-75.78229425809917				
Y:	45.35019993249763				
Path:	715\7159662.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003479513			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438720.00
Code OB Desc:				North83:	5022152.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	02/02/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003806352				
Layer:	2				
Plug From:	1.8300000429153442				
Plug To:					
Plug Depth UOM:	m				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806351			
Layer:		1			
Plug From:		0.0			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003806349			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003806341			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003806345			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003806346			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.890000343322754			
<u>Water Details</u>					
Water ID:		1003806344			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003806343			
Diameter:		20.31999969482422			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Depth From:		0.0			
Depth To:		2.440000057220459			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

38	1 of 1	SSW/120.9	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID:	7147022			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06/17/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z111653			Contractor:	7241
Tag:	A094031			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/7147147022.pdf				

Additional Detail(s) (Map)

Well Completed Date:	05/19/2010
Year Completed:	2010
Depth (m):	8.53
Latitude:	45.3501912882029
Longitude:	-75.7822432373439
X:	-75.78224307570521
Y:	45.35019128101818
Path:	7147147022.pdf

Bore Hole Information

Bore Hole ID:	1003044347	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	438724.00
Code OB Desc:		North83:	5022151.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	05/19/2010	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1003190972			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003190973			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		4.269999980926514			
Formation End Depth:		8.529999732971191			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003190976			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003190978			
Layer:		4			
Plug From:		5.179999828338623			
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003190975			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID:		1003190977			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003190984			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003190971			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003190980			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.489999771118164			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003190981			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.489999771118164			
Screen End Depth:		8.529999732971191			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
 <u>Water Details</u>					
Water ID:		1003190979			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
 <u>Hole Diameter</u>					
Hole ID:		1003190974			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.529999732971191			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

39	1 of 1	SSW/121.8	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS

Well ID:	7147024	Flowing (Y/N):	
Construction Date:		Flow Rate:	
Use 1st:	Monitoring and Test Hole	Data Entry Status:	
Use 2nd:	0	Data Src:	
Final Well Status:	Monitoring and Test Hole	Date Received:	06/17/2010
Water Type:		Selected Flag:	TRUE
Casing Material:		Abandonment Rec:	
Audit No:	Z111651	Contractor:	7241
Tag:	A094033	Form Version:	7
Constructn Method:		Owner:	
Elevation (m):		County:	OTTAWA-CARLETON
Elevatn Reliabilty:		Lot:	
Depth to Bedrock:		Concession:	
Well Depth:		Concession Name:	
Overburden/Bedrock:		Easting NAD83:	
Pump Rate:		Northing NAD83:	
Static Water Level:		Zone:	
Clear/Cloudy:		UTM Reliability:	
Municipality:	OTTAWA CITY		
Site Info:			

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147024.pdf

Additional Detail(s) (Map)

Well Completed Date:	05/19/2010
Year Completed:	2010
Depth (m):	
Latitude:	45.3501728499931
Longitude:	-75.782306812863
X:	-75.78230665125503
Y:	45.35017284296593
Path:	714\7147024.pdf

Bore Hole Information

Bore Hole ID:	1003044351	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	438719.00
Code OB Desc:		North83:	5022149.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	05/19/2010	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock

Materials Interval

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation ID:		1003191003			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:					
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003191004			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1003191008			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1003191009			
Layer:		4			
Plug From:		5.179999828338623			
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1003191007			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1003191006			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003191015			
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003191002			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003191011			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.489999771118164			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003191012			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.489999771118164			
Screen End Depth:		8.529999732971191			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
<u>Water Details</u>					
Water ID:		1003191010			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003191005			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.529999732971191			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
40	1 of 1	SSW/122.2	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID:7147023 Construction Date: Use 1st:Monitoring and Test Hole Use 2nd:0 Final Well Status:Monitoring and Test Hole Water Type: Casing Material: Audit No:Z111652 Tag:A094032 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality:OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received:06/17/2010 Selected Flag:TRUE Abandonment Rec: Contractor:7241 Form Version:7 Owner: County:OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147023.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		05/18/2010			
Year Completed:		2010			
Depth (m):		8.53			
Latitude:		45.3501730248553			
Longitude:		-75.7822812834651			
X:		-75.78228112114309			
Y:		45.350173018469235			
Path:		714\7147023.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003044349		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				18	
Code OB Desc:				East83:	
Open Hole:				438721.00	
Cluster Kind:				North83:	
Date Completed:		05/18/2010		5022149.00	
Remarks:				Org CS:	
Location Method Desc:		on Water Well Record		UTM83	
Elevrc Desc:				UTMRC:	
Location Source Date:				4	
Improvement Location Source:				UTMRC Desc:	
Improvement Location Method:				margin of error : 30 m - 100 m	
Source Revision Comment:				Location Method:	
Supplier Comment:				wwr	
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003190987			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003190988			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.269999980926514			
Formation End Depth:		7.320000171661377			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003190989			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		7.320000171661377			
Formation End Depth:		8.529999732971191			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1003190991			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1003190994			
Layer:		4			
Plug From:		5.179999828338623			
Plug To:		8.529999732971191			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190992			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003190993			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003191000			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003190986			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003190996			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.489999771118164			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003190997			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.489999771118164			
Screen End Depth:		8.529999732971191			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
<u>Water Details</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water ID: 1003190995 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1003190990 Diameter: 20.31999969482422 Depth From: 0.0 Depth To: 8.529999732971191 Hole Depth UOM: m Hole Diameter UOM: cm					
41	1 of 1	SSW/122.4	72.9 / 1.15	2685 IRIS ST Ottawa ON	WWIS
Well ID: 7159661 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Abandoned-Other Water Type: Casing Material: Audit No: Z126325 Tag: Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 02/25/2011 Selected Flag: TRUE Abandonment Rec: Yes Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159661.pdf					
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: 02/02/2011 Year Completed: 2011 Depth (m): Latitude: 45.3501731122842 Longitude: -75.782268518766 X: -75.78226835698544 Y: 45.35017310495818 Path: 715\7159661.pdf					
<u>Bore Hole Information</u>					
Bore Hole ID: 1003479511 DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole:					
Elevation: Elevrc: Zone: 18 East83: 438722.00 North83: 5022149.00 Org CS: UTM83					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Cluster Kind:				UTMRC:	3
Date Completed:	02/02/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806339			
Layer:		1			
Plug From:		0.0			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806340			
Layer:		2			
Plug From:		1.8300000429153442			
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003806337			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003806329			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003806333			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003806334			
Layer:		1			
Slot:		10			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Top Depth: Screen End Depth: Screen Material: 5 Screen Depth UOM: m Screen Diameter UOM: cm Screen Diameter: 8.890000343322754					
<u>Water Details</u>					
Water ID: 1003806332 Layer: Kind Code: Kind: Water Found Depth: Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1003806331 Diameter: 20.31999969482422 Depth From: 0.0 Depth To: 2.440000057220459 Hole Depth UOM: m Hole Diameter UOM: cm					
42	1 of 2	SE/123.6	73.6 / 1.84	VINTEX INC DEMPSEY AVE & IRISH ST.,OTTAWA,ON,K2C 1M1,CA ON	PINC
Incident Id: Incident No: 1949172 Incident Reported Dt: 9/26/2016 Type: FS-Pipeline Incident Status Code: Tank Status: Pipeline Damage Reason Est Task No: Spills Action Centre: Fuel Type: Fuel Occurrence Tp: Date of Occurrence: Occurrence Start Dt: Depth: Customer Acct Name: VINTEX INC Incident Address: DEMPSEY AVE & IRISH ST.,OTTAWA,ON,K2C 1M1,CA Operation Type: Pipeline Type: Regulator Type: Summary: Reported By: Affiliation: Occurrence Desc: Damage Reason: Notes:					
Pipe Material: Fuel Category: Health Impact: Environment Impact: Property Damage: Service Interrupt: Enforce Policy: Public Relation: Pipeline System: PSIG: Attribute Category: Regulator Location: Method Details:					
42	2 of 2	SE/123.6	73.6 / 1.84	Enbridge Gas Distribution Inc. Dempsey Ave and Irish Street Ottawa ON	SPL
Ref No: 2467-AE6J5T Year: Incident Dt: 9/26/2016					
Municipality No: Nature of Damage: Discharger Report:					

43	1 of 1	NNE/125.1	69.9 / -1.85	45.354877, -75.781035 OTTAWA ON	SPL
Ref No:		1-GTFO94		Municipality No:	
Year:				Nature of Damage:	
Incident Dt:		Jan 31,2025 6:17:46 PM		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		Jan 31,2025 6:17:46 PM		Impact to Health:	
Dt Document Closed:		Feb 4,2025 9:30:12 AM		Agency Involved:	
Site No:					
MOE Response:		Desktop Response			
Site County/District:					
Site Geo Ref Meth:					
Site District Office:		Ottawa District Office			
Nearest Watercourse:					
Site Name:					

44	1 of 1	SSW/125.9	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID:	7147025			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06/17/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z111650			Contractor:	7241
Tag:	A094034			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147025.pdf				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		05/18/2010			
Year Completed:		2010			
Depth (m):		8.53			
Latitude:		45.3501274101513			
Longitude:		-75.7823700163162			
X:		-75.78236985400638			
Y:		45.350127403105894			
Path:		714\7147025.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003044353			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438714.00
Code OB Desc:				North83:	5022144.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05/18/2010			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	www
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1003191018				
Layer:	1				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:	85				
Material 2 Desc:	SOFT				
Material 3:	68				
Material 3 Desc:	DRY				
Formation Top Depth:	0.0				
Formation End Depth:	4.269999980926514				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:	1003191020				
Layer:	3				
Color:	2				
General Color:	GREY				
Material 1:	05				
Material 1 Desc:	CLAY				
Material 2:	73				
Material 2 Desc:	HARD				
Material 3:	91				
Material 3 Desc:	WATER-BEARING				
Formation Top Depth:	7.320000171661377				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		8.529999732971191			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003191019			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.269999980926514			
Formation End Depth:		7.320000171661377			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191022			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191023			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191024			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191025			
Layer:		4			
Plug From:		5.179999828338623			
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003191031			
Method Construction Code:		2			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:	1003191017				
Casing No:	0				
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:	1003191027				
Layer:	1				
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:	0.0				
Depth To:	5.489999771118164				
Casing Diameter:	7.619999885559082				
Casing Diameter UOM:	cm				
Casing Depth UOM:	m				
<u>Construction Record - Screen</u>					
Screen ID:	1003191028				
Layer:	1				
Slot:	10				
Screen Top Depth:	5.489999771118164				
Screen End Depth:	8.529999732971191				
Screen Material:	5				
Screen Depth UOM:	m				
Screen Diameter UOM:	cm				
Screen Diameter:	8.020000457763672				
<u>Water Details</u>					
Water ID:	1003191026				
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:	m				
<u>Hole Diameter</u>					
Hole ID:	1003191021				
Diameter:	20.31999969482422				
Depth From:	0.0				
Depth To:	8.529999732971191				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
45	1 of 1	SSW/126.0	72.9 / 1.15	2685 IRIS ST Ottawa ON	WWIS
Well ID:	7159660			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Abandoned-Other			Date Received:	02/25/2011
Water Type:				Selected Flag:	TRUE

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Material:			Abandonment Rec:	Yes	
Audit No:	Z120983		Contractor:	7241	
Tag:	A094033		Form Version:	7	
Constructn Method:			Owner:		
Elevation (m):			County:	OTTAWA-CARLETON	
Elevatn Reliabilty:			Lot:		
Depth to Bedrock:			Concession:		
Well Depth:			Concession Name:		
Overburden/Bedrock:			Easting NAD83:		
Pump Rate:			Northing NAD83:		
Static Water Level:			Zone:		
Clear/Cloudy:			UTM Reliability:		
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159660.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		02/02/2011			
Year Completed:		2011			
Depth (m):					
Latitude:		45.3501369352951			
Longitude:		-75.7822935521799			
X:		-75.78229339033224			
Y:		45.35013692832413			
Path:		715\7159660.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003479509		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438720.00
Code OB Desc:				North83:	5022145.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		02/02/2011		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806242			
Layer:		1			
Plug From:		0.0			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806243			
Layer:		2			
Plug From:		1.8300000429153442			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003806240			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003806232			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003806236			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003806237			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.890000343322754			
<u>Water Details</u>					
Water ID:		1003806235			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003806234			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
46	1 of 1	SSW/126.5	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID: 7147026 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: 0 Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z111649 Tag: A094019 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 06/17/2010 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147026.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		05/19/2010			
Year Completed:		2010			
Depth (m):		8.84			
Latitude:		45.3501181472941			
Longitude:		-75.7824081863675			
X:		-75.78240802430926			
Y:		45.35011814050988			
Path:		714\7147026.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003044355			
DP2BR:		Elevation:			
Spatial Status:		Elevrc:			
Code OB:		Zone:			
Code OB Desc:		18			
Open Hole:		East83:			
Cluster Kind:		438711.00			
Date Completed:		North83:			
Remarks:		5022143.00			
Location Method Desc:		Org CS:			
Elevrc Desc:		UTM83			
Location Source Date:		UTMRC:			
Improvement Location Source:		4			
Improvement Location Method:		UTMRC Desc:			
Source Revision Comment:		margin of error : 30 m - 100 m			
Supplier Comment:		Location Method:			
		wwr			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003191036			
Layer:		3			
Color:		2			
General Color:		GREY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		5.489999771118164			
Formation End Depth:		8.84000015258789			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003191035			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.269999980926514			
Formation End Depth:		5.489999771118164			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003191034			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191040			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		5.489999771118164			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191041			
Layer:		4			
Plug From:		5.489999771118164			
Plug To:		8.84000015258789			
Plug Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191039			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191038			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003191047			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003191033			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003191043			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.489999771118164			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003191044			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.489999771118164			
Screen End Depth:		8.84000015258789			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
<u>Water Details</u>					
Water ID:		1003191042			
Layer:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM: m					
<u>Hole Diameter</u>					
Hole ID: 1003191037					
Diameter: 20.31999969482422					
Depth From: 0.0					
Depth To: 8.84000015258789					
Hole Depth UOM: m					
Hole Diameter UOM: cm					

Additional Detail(s) (Map)

Well Completed Date: 02/02/2011
Year Completed: 2011
Depth (m):
Latitude: 45.3501183221787
Longitude: -75.7823826569947
X: -75.78238249509566
Y: 45.350118315382005
Path: 715\7159659.pdf

Bore Hole Information

Bore Hole ID:	1003479507	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	438713.00
Code OB Desc:		North83:	5022143.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	02/02/2011	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
on Water Well Record					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: Layer: Plug From: Plug To: Plug Depth UOM:					
1003806140 2 1.8300000429153442 m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: Layer: Plug From: Plug To: Plug Depth UOM:					
1003806139 1 0.0 1.8300000429153442 m					
<u>Method of Construction & Well Use</u>					
Method Construction ID: Method Construction Code: Method Construction: Other Method Construction:					
1003806137 2 Rotary (Convent.) 					
<u>Pipe Information</u>					
Pipe ID: Casing No: Comment: Alt Name:					
1003806129 0 					
<u>Construction Record - Casing</u>					
Casing ID: Layer: Material: Open Hole or Material: Depth From: Depth To: Casing Diameter: Casing Diameter UOM: Casing Depth UOM:					
1003806133 1 5 PLASTIC 7.619999885559082 cm m					
<u>Construction Record - Screen</u>					
Screen ID: Layer: Slot: Screen Top Depth: Screen End Depth: Screen Material:					
1003806134 1 10 5					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.890000343322754			
<u>Water Details</u>					
Water ID:		1003806132			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003806131			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

48	1 of 1	SSW/127.4	72.9 / 1.15	Ottawa ON	WWIS
Well ID:	7147027			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06/17/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z111648			Contractor:	7241
Tag:	A094035			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147027.pdf				

Additional Detail(s) (Map)

Well Completed Date: 05/18/2010
 Year Completed: 2010
 Depth (m): 8.53
 Latitude: 45.3501090593173
 Longitude: -75.7824208270377
 X: -75.78242066539853
 Y: 45.35010905215323
 Path: 714\7147027.pdf

Bore Hole Information

Bore Hole ID: 1003044357 Elevation:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438710.00
Code OB Desc:				North83:	5022142.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	05/18/2010			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003191052			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		7.320000171661377			
Formation End Depth:		8.529999732971191			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003191050			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003191051			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation Top Depth:		4.269999980926514			
Formation End Depth:		7.320000171661377			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191056			
Layer:		3			
Plug From:		4.269999980926514			
Plug To:		5.179999828338623			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191057			
Layer:		4			
Plug From:		5.179999828338623			
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191055			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191054			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003191063			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003191049			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003191059			
Layer:		1			
Material:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.179999828338623			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003191060			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.179999828338623			
Screen End Depth:		8.529999732971191			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
<u>Water Details</u>					
Water ID:		1003191058			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003191053			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.529999732971191			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
49	1 of 1	SSW/129.3	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID:		7147029		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Monitoring and Test Hole		Date Received:	06/17/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:		Z111660		Contractor:	7241
Tag:		A094021		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147029.pdf			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Additional Detail(s) (Map)

Well Completed Date: 05/20/2010
Year Completed: 2010
Depth (m): 6.71
Latitude: 45.350090970807
Longitude: -75.7824333436861
X: -75.7824331825211
Y: 45.350090964449976
Path: 714\7147029.pdf

Bore Hole Information

Bore Hole ID:	1003044361	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	438709.00
Code OB Desc:		North83:	5022140.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	05/20/2010	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	www
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Overburden and Bedrock Materials Interval

Formation ID: 1003191083
Layer: 1
Color: 6
General Color: BROWN
Material 1: 28
Material 1 Desc: SAND
Material 2: 85
Material 2 Desc: SOFT
Material 3: 68
Material 3 Desc: DRY
Formation Top Depth: 0.0
Formation End Depth: 4.269999980926514
Formation End Depth UOM: m

Overburden and Bedrock Materials Interval

Formation ID: 1003191084
Layer: 2
Color: 2
General Color: GREY
Material 1: 06
Material 1 Desc: SILT
Material 2: 69
Material 2 Desc: FINE-GRAINED
Material 3: 85
Material 3 Desc: SOFT
Formation Top Depth: 4.269999980926514

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Formation End Depth:		6.710000038146973			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191088			
Layer:		3			
Plug From:		3.3499999046325684			
Plug To:		6.710000038146973			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191087			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		3.3499999046325684			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003191086			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003191094			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003191082			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003191090			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.6600000858306885			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003191091			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:		1			
Slot:		10			
Screen Top Depth:		3.6600000858306885			
Screen End Depth:		6.710000038146973			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
<u>Water Details</u>					
Water ID:		1003191089			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003191085			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.529999732971191			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

<u>50</u>	1 of 1	N/130.2	69.2 / -2.53	45.35476, -75.78189 OTTAWA ON	SPL
Ref No:	1-OHISHX			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	May 28,2025 6:30:47 AM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	May 28,2025 12:42:48 PM			Impact to Health:	
Dt Document Closed:	Jun 10,2025 3:04:19 PM			Agency Involved:	
Site No:					
MOE Response:	Desktop Response				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa District Office				
Nearest Watercourse:					
Site Name:					
Site Address:	45.35476, -75.78189				
Site Region:					
Site Municipality:	OTTAWA				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:	Tank - Above Ground				
Incident Cause:					
Incident Preceding Spill:	Overfill				
Incident Reason:	Equipment failure/malfunction				
Incident Summary:	Kiewit Eurovia Vinci: 1.5 L diesel from diesel generator to gravel				
Environment Impact:					
Health Env Consequence:	Low				
Nature of Impact:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Qty:		1.5 litre (L)			
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:		DIESEL FUEL			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		Land			
Activity Preceding Spill:		Normal operations			
Property 2nd Watershed:		Lower Ottawa			
Property Tertiary Watershed:		02KE - Lower Madawaska			
Sector Type:		URBAN TRANSIT SYSTEMS			
SAC Action Class:					
Call Report Locatn Geodata:		{ "integration_ids": ["PR00003951691"], "wkts": ["POINT (-75.7818900000 45.3547600000)", "POINT (-75.7818900000 45.3547600000)"], "creation_date": "2025-05-28" }			
Time Reported:					
System Facility Address:					

51	1 of 1	SSW/132.8	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID:	7155561			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06/17/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z111659			Contractor:	7241
Tag:	A094022			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7155561.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	05/19/2010				
Year Completed:	2010				
Depth (m):	8.32				
Latitude:	45.350054356518				
Longitude:	-75.7825222003179				
X:	-75.7825220384528				
Y:	45.350054350266895				
Path:	715\7155561.pdf				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003447591			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438702.00

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB Desc:				North83:	5022136.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		05/19/2010		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003522914			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003522915			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003522916			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.269999980926514			
Formation End Depth:		7.320000171661377			
Formation End Depth UOM:		m			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1003522917			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		7.320000171661377			
Formation End Depth:		8.319999694824219			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003522921			
Layer:		3			
Plug From:		4.880000114440918			
Plug To:		8.319999694824219			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003522920			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.880000114440918			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003522919			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003522927			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003522913			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1003522923			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.179999828338623			
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003522924			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.179999828338623			
Screen End Depth:		8.319999694824219			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.020000457763672			
<u>Water Details</u>					
Water ID:		1003522922			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003522918			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.319999694824219			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
52	1 of 1	SSW/133.3	72.9 / 1.15	2685 IRIS STREET Ottawa ON	WWIS
Well ID:	7147028			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	06/17/2010
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z111661			Contractor:	7241
Tag:	A094020			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:		OTTAWA CITY		UTM Reliability:	
Municipality:					
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/714\7147028.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		05/18/2010			
Year Completed:		2010			
Depth (m):		8.53			
Latitude:		45.3500549686778			
Longitude:		-75.7824328476151			
X:		-75.78243268665426			
Y:		45.35005496200435			
Path:		714\7147028.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1003044359		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		05/18/2010		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				www	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003191066			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		0.0			
Formation End Depth:		3.0999999046325684			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003191069			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		05			
Material 1 Desc:		CLAY			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		91			
Material 3 Desc:		WATER-BEARING			
Formation Top Depth:		7.320000171661377			
Formation End Depth:		8.529999732971191			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003191068			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.269999980926514			
Formation End Depth:		7.320000171661377			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003191067			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		68			
Material 3 Desc:		DRY			
Formation Top Depth:		3.0999999046325684			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1003191072			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		4.269999980926514			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1003191074			
Layer:		4			
Plug From:		4.880000114440918			
Plug To:		8.529999732971191			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug ID: 1003191073					
Layer: 3					
Plug From: 4.269999980926514					
Plug To: 4.880000114440918					
Plug Depth UOM: m					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID: 1003191071					
Layer: 1					
Plug From: 0.0					
Plug To: 0.3100000023841858					
Plug Depth UOM: m					
<u>Method of Construction & Well Use</u>					
Method Construction ID: 1003191080					
Method Construction Code: 2					
Method Construction: Rotary (Convent.)					
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID: 1003191065					
Casing No: 0					
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID: 1003191076					
Layer: 1					
Material: 5					
Open Hole or Material: PLASTIC					
Depth From: 0.0					
Depth To: 5.489999771118164					
Casing Diameter: 7.619999885559082					
Casing Diameter UOM: cm					
Casing Depth UOM: m					
<u>Construction Record - Screen</u>					
Screen ID: 1003191077					
Layer: 1					
Slot: 10					
Screen Top Depth: 5.489999771118164					
Screen End Depth: 8.529999732971191					
Screen Material: 5					
Screen Depth UOM: m					
Screen Diameter UOM: cm					
Screen Diameter: 8.020000457763672					
<u>Water Details</u>					
Water ID: 1003191075					
Layer:					
Kind Code:					
Kind:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003191070			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		8.529999732971191			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

53	1 of 1	SSW/134.9	72.9 / 1.15	ON	WWIS
Well ID: 7159657					
Construction Date:					
Use 1st:		Monitoring and Test Hole		Flowing (Y/N):	
Use 2nd:		0		Flow Rate:	
Final Well Status:		Abandoned-Other		Data Entry Status:	
Water Type:				Data Src:	
Casing Material:				Date Received:	02/25/2011
Audit No:		Z120985		Selected Flag:	TRUE
Tag:		A094019		Abandonment Rec:	Yes
Constructn Method:				Contractor:	7241
Elevation (m):				Form Version:	7
Elevatn Reliabilty:				Owner:	
Depth to Bedrock:				County:	OTTAWA-CARLETON
Well Depth:				Lot:	
Overburden/Bedrock:				Concession:	
Pump Rate:				Concession Name:	
Static Water Level:				Easting NAD83:	
Clear/Cloudy:				Northing NAD83:	
Municipality:		OTTAWA CITY		Zone:	
Site Info:				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159657.pdf			

Additional Detail(s) (Map)

Well Completed Date:	02/02/2011
Year Completed:	2011
Depth (m):	
Latitude:	45.3500365303636
Longitude:	-75.7824964229192
X:	-75.78249626130575
Y:	45.35003652327637
Path:	715\7159657.pdf

Bore Hole Information

Bore Hole ID:	1003479503	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	438704.00
Code OB Desc:		North83:	5022134.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	3
Date Completed:	02/02/2011	UTMRC Desc:	margin of error : 10 - 30 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003805943			
Layer:		2			
Plug From:		1.8300000429153442			
Plug To:					
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003805942			
Layer:		1			
Plug From:		0.0			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003805940			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003805932			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003805936			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003805937			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen Diameter:		8.890000343322754			
<u>Water Details</u>					
Water ID:		1003805935			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003805934			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			

541 of 1SSW/135.172.9 / 1.152685 IRIS ST
Ottawa ONWWIS

Well ID:7159658

Construction Date:

Use 1st:Test Hole

Use 2nd:

Final Well Status:Abandoned-Other

Water Type:

Casing Material:

Audit No:Z126324

Tag:A094035

Constructn Method:

Elevation (m):

Elevatn Reliabilty:

Depth to Bedrock:

Well Depth:

Overburden/Bedrock:

Pump Rate:

Static Water Level:

Clear/Cloudy:

Municipality:OTTAWA CITY

Site Info:

Flowing (Y/N):

Flow Rate:

Data Entry Status:

Data Src:

Date Received:02/25/2011

Selected Flag:TRUE

Abandonment Rec:Yes

Contractor:7241

Form Version:7

Owner:

County:OTTAWA-CARLETON

Lot:

Concession:

Concession Name:

Easting NAD83:

Northing NAD83:

Zone:

UTM Reliability:

PDF URL (Map):https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159658.pdf

Additional Detail(s) (Map)

Well Completed Date:02/02/2011

Year Completed:2011

Depth (m):

Latitude:45.3500367927176

Longitude:-75.7824581289158

X:-75.78245796703618

Y:45.3500367865319

Path:715\7159658.pdf

Bore Hole Information

Bore Hole ID:1003479505

DP2BR:

Spatial Status:

Elevation:

Elevrc:

Zone:18

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Code OB:				East83:	438707.00
Code OB Desc:				North83:	5022134.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:		02/02/2011		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806019			
Layer:		1			
Plug From:		0.0			
Plug To:		1.8300000429153442			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003806020			
Layer:		2			
Plug From:		1.8300000429153442			
Plug To:					
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003806017			
Method Construction Code:		2			
Method Construction:		Rotary (Convent.)			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1003806010			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003806014			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID:		1003806015			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.890000343322754			
<u>Water Details</u>					
Water ID:		1003806013			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003806012			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
55	1 of 1	S/138.0	73.6 / 1.85	1119-1143 BAXTER RD Ottawa ON	WWIS
Well ID:	7233763			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	12/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z198266			Contractor:	7241
Tag:	A173766			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	NEPEAN TOWNSHIP				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7233763.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	10/27/2014				
Year Completed:	2014				
Depth (m):	4.57				
Latitude:	45.3501951335408				
Longitude:	-75.7816815903438				
X:	-75.78168142851403				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Y:		45.3501951275687			
Path:		723\7233763.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1005259727			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438768.00
Code OB Desc:				North83:	5022151.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	10/27/2014			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005422968				
Layer:	1				
Color:	8				
General Color:	BLACK				
Material 1:	02				
Material 1 Desc:	TOPSOIL				
Material 2:					
Material 2 Desc:					
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.0				
Formation End Depth:	0.6100000143051147				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005422969				
Layer:	2				
Color:	6				
General Color:	BROWN				
Material 1:	28				
Material 1 Desc:	SAND				
Material 2:					
Material 2 Desc:					
Material 3:	85				
Material 3 Desc:	SOFT				
Formation Top Depth:	0.6100000143051147				
Formation End Depth:	1.5				
Formation End Depth UOM:	m				
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:	1005422970				
Layer:	3				
Color:	6				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.5			
Formation End Depth:		4.570000171661377			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005422980			
Layer:		3			
Plug From:		1.2200000286102295			
Plug To:		4.570000171661377			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005422979			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		1.2200000286102295			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1005422978			
Layer:		1			
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1005422977			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
 <u>Pipe Information</u>					
Pipe ID:		1005422967			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1005422973			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		1.5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1005422974			
Layer:		1			
Slot:		10			
Screen Top Depth:		1.5			
Screen End Depth:		4.570000171661377			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1005422972			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005422971			
Diameter:		8.25			
Depth From:		0.0			
Depth To:		4.570000171661377			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
56	1 of 1	SSW/138.7	72.9 / 1.15	2685 IRIS ST Ottawa ON	WWIS
Well ID:		7159656		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Abandoned-Other		Date Received:	02/25/2011
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	Yes
Audit No:		Z126298		Contractor:	7241
Tag:		A094022		Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/715\7159656.pdf			
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		02/02/2011			
Year Completed:		2011			
Depth (m):					
Latitude:		45.3500000034886			
Longitude:		-75.7825725147657			
X:		-75.78257235307983			
Y:		45.34999999617871			
Path:		715\7159656.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1003479501			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438698.00
Code OB Desc:				North83:	5022130.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	3
Date Completed:	02/02/2011			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1003805869				
Layer:	1				
Plug From:	0.0				
Plug To:	1.8300000429153442				
Plug Depth UOM:	m				
 <u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:	1003805870				
Layer:	2				
Plug From:	1.8300000429153442				
Plug To:					
Plug Depth UOM:	m				
 <u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:	1003805867				
Method Construction Code:	2				
Method Construction:	Rotary (Convent.)				
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:	1003805859				
Casing No:	0				
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1003805863			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:					
Casing Diameter:		7.619999885559082			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003805864			
Layer:		1			
Slot:		10			
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		8.890000343322754			
<u>Water Details</u>					
Water ID:		1003805862			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1003805861			
Diameter:		20.31999969482422			
Depth From:		0.0			
Depth To:		1.8300000429153442			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
57	1 of 1	S/140.9	73.6 / 1.85	1119-1143 BAXTER RD Ottawa ON	WWIS
Well ID:	7233762			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Monitoring and Test Hole			Date Received:	12/15/2014
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z198265			Contractor:	7241
Tag:	A173767			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Clear/Cloudy:				UTM Reliability:	
Municipality:		NEPEAN TOWNSHIP			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/723\7233762.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		10/27/2014			
Year Completed:		2014			
Depth (m):		6.1			
Latitude:		45.3500856417694			
Longitude:		-75.781897103136			
X:		-75.78189694147513			
Y:		45.35008563552637			
Path:		723\7233762.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:		1005259724		Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:				UTMRC:	
Date Completed:		10/27/2014		UTMRC Desc:	
Remarks:				Location Method:	
Location Method Desc:		on Water Well Record		margin of error : 30 m - 100 m	
Elevrc Desc:				www	
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005422956			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		08			
Material 1 Desc:		FINE SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:					
Formation End Depth:		6.099999904632568			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1005422955			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:					
Formation End Depth:					
Formation End Depth UOM:					
Annular Space/Abandonment Sealing Record					
Plug ID:					
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
Annular Space/Abandonment Sealing Record					
Plug ID:					
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
Annular Space/Abandonment Sealing Record					
Plug ID:					
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
Method of Construction & Well Use					
Method Construction ID:					
Method Construction Code:					
Method Construction:					
Other Method Construction:					
Pipe Information					
Pipe ID:					
Casing No:					
Comment:					
Alt Name:					
Construction Record - Casing					
Casing ID:					
Layer:					
Material:					
Open Hole or Material:					
Depth From:					
Depth To:					
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Screen</u>					
Screen ID:		1005422960			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		6.099999904632568			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			
<u>Water Details</u>					
Water ID:		1005422958			
Layer:					
Kind Code:					
Kind:					
Water Found Depth:					
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1005422957			
Diameter:		8.300000190734863			
Depth From:		0.0			
Depth To:		6.099999904632568			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
58	1 of 1	S/156.2	73.2 / 1.46	1129 BAXTOR ST. Ottawa ON	WWIS
Well ID:	7136631			Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:	Monitoring and Test Hole			Data Entry Status:	
Use 2nd:	0			Data Src:	
Final Well Status:	Test Hole			Date Received:	12/21/2009
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	M05273			Contractor:	7241
Tag:	A084169			Form Version:	5
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliability:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:	OTTAWA CITY				
Site Info:					
PDF URL (Map):	https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7136631.pdf				
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:	11/20/2009				
Year Completed:	2009				
Depth (m):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Latitude:		45.3505659897357			
Longitude:		-75.7814186096821			
X:		-75.78141844856685			
Y:		45.35056598330693			
Path:		713\7136631.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7136631.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		11/20/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.3504844609048			
Longitude:		-75.7814940835823			
X:		-75.781493922304			
Y:		45.3504844544704			
Path:		713\7136631.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7136631.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		11/19/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.350463314598			
Longitude:		-75.7819533674294			
X:		-75.78195320560563			
Y:		45.35046330822173			
Path:		713\7136631.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7136631.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		11/19/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.3505077054714			
Longitude:		-75.7820433405735			
X:		-75.78204317903426			
Y:		45.35050769858651			
Path:		713\7136631.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7136631.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		11/20/2009			
Year Completed:		2009			
Depth (m):		9.75			
Latitude:		45.3499232826096			
Longitude:		-75.7819459309301			
X:		-75.78194576940001			
Y:		45.34992327647424			
Path:		713\7136631.pdf			
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/713\7136631.pdf			
<u>Additional Detail(s) (Map)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Well Completed Date:		11/20/2009			
Year Completed:		2009			
Depth (m):					
Latitude:		45.350621128159			
Longitude:		-75.781253410405			
X:		-75.78125324843613			
Y:		45.350621121559655			
Path:		713\7136631.pdf			
 <u>Bore Hole Information</u>					
Bore Hole ID:	1003236033			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438740.00
Code OB Desc:				North83:	5022186.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	11/19/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:	1003236037				
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
 <u>Method of Construction & Well Use</u>					
Method Construction ID:	1003236036				
Method Construction Code:					
Method Construction:					
Other Method Construction:	DIRECT PUSH				
 <u>Pipe Information</u>					
Pipe ID:	1003236038				
Casing No:	0				
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:	1003236040				
Layer:					
Material:	5				
Open Hole or Material:	PLASTIC				
Depth From:					
Depth To:	1.8300000429153442				
Casing Diameter:					
Casing Diameter UOM:					

307 erisinfo.com | Environmental Risk Information Services Order No: 25082500253

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003236046			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003236045			
Method Construction Code:					
Method Construction:					
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1003236047			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003236049			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.0999999046325684			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003236048			
Layer:					
Slot:					
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		9.140000343322754			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1003236050			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1003236044			
Diameter:		8.25			
Depth From:					
Depth To:		8.84000015258789			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1002909738			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438747.00
Code OB Desc:				North83:	5022121.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	11/20/2009			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003236101			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		73			
Material 3 Desc:		HARD			
Formation Top Depth:		0.3100000023841858			
Formation End Depth:		1.7999999523162842			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1003236103			
Layer:		4			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		28			
Material 2 Desc:		SAND			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		4.269999980926514			
Formation End Depth:		7.320000171661377			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003236104			
Layer:		5			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		7.320000171661377			
Formation End Depth:		9.75			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003236102			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.7999999523162842			
Formation End Depth:		4.269999980926514			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1003236100			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:					
Material 2 Desc:					
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		0.0			
Formation End Depth:		0.3100000023841858			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1003236106			
Layer:		1			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Plug From:		0.0			
Plug To:		0.3100000023841858			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003236107			
Layer:		2			
Plug From:		0.3100000023841858			
Plug To:		2.740000009536743			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003236108			
Layer:		3			
Plug From:		2.740000009536743			
Plug To:		9.75			
Plug Depth UOM:		m			
 <u>Method of Construction & Well Use</u>					
Method Construction ID:		1003236113			
Method Construction Code:		D			
Method Construction:		Direct Push			
Other Method Construction:					
 <u>Pipe Information</u>					
Pipe ID:		1003236099			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1003236109			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		3.0999999046325684			
Casing Diameter:		4.03000020980835			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
 <u>Construction Record - Screen</u>					
Screen ID:		1003236110			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		9.75			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:		cm			
Screen Diameter:		4.820000171661377			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:	1003236105				
Diameter:	8.25				
Depth From:	0.0				
Depth To:	9.75				
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003236069			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	
Code OB:				East83:	
Code OB Desc:				North83:	
Open Hole:				Org CS:	
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	9
Date Completed:				UTMRC Desc:	unknown UTM
Remarks:				Location Method:	na
Location Method Desc:	Not Applicable i.e. no UTM				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:	1003236072				
Method Construction Code:					
Method Construction:					
Other Method Construction:					
<u>Hole Diameter</u>					
Hole ID:	1003236071				
Diameter:					
Depth From:					
Depth To:					
Hole Depth UOM:	m				
Hole Diameter UOM:	cm				
<u>Bore Hole Information</u>					
Bore Hole ID:	1003236051			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438802.00
Code OB Desc:				North83:	5022198.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	11/20/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	www
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003236055			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003236054			
Method Construction Code:					
Method Construction:					
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1003236056			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003236058			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		3.0999999046325684			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003236057			
Layer:					
Slot:					
Screen Top Depth:		3.0999999046325684			
Screen End Depth:		9.140000343322754			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1003236059			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Levels UOM: Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1003236053			
Diameter:		8.25			
Depth From:					
Depth To:		9.140000343322754			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003236024			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438747.00
Code OB Desc:				North83:	5022181.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3
Date Completed:	11/19/2009			UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:	on Water Well Record				
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment</u>					
<u>Sealing Record</u>					
Plug ID:		1003236028			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well</u>					
<u>Use</u>					
Method Construction ID:		1003236027			
Method Construction Code:					
Method Construction:					
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1003236029			
Casing No:		0			
Comment:					
Alt Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Construction Record - Casing</u>					
Casing ID:		1003236031			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		1.5			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003236030			
Layer:					
Slot:					
Screen Top Depth:		1.5			
Screen End Depth:		3.0999999046325684			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1003236032			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:					
Rate UOM:					
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:					
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Hole Diameter</u>					
Hole ID:		1003236026			
Diameter:		5.710000038146973			
Depth From:					
Depth To:		3.0999999046325684			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Bore Hole Information</u>					
Bore Hole ID:	1003236060			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438789.00
Code OB Desc:				North83:	5022192.00
Open Hole:				Org CS:	UTM83
Cluster Kind:	This is a record from cluster log sheet			UTMRC:	3

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Completed:		11/20/2009		UTMRC Desc:	margin of error : 10 - 30 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1003236064			
Layer:					
Plug From:					
Plug To:					
Plug Depth UOM:					
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1003236063			
Method Construction Code:					
Method Construction:					
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1003236065			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1003236067			
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		1.5			
Casing Diameter:					
Casing Diameter UOM:					
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1003236066			
Layer:					
Slot:					
Screen Top Depth:		1.5			
Screen End Depth:		3.0999999046325684			
Screen Material:					
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pump Test ID: 1003236068 Pump Set At: Static Level: Final Level After Pumping: Recommended Pump Depth: Pumping Rate: Flowing Rate: Recommended Pump Rate: Levels UOM: Rate UOM: Water State After Test Code: Water State After Test: Pumping Test Method: Pumping Duration HR: Pumping Duration MIN: Flowing:					
<u>Hole Diameter</u>					
Hole ID: 1003236062 Diameter: 5.710000038146973 Depth From: Depth To: 3.0999999046325684 Hole Depth UOM: m Hole Diameter UOM: cm					
59	1 of 1	W/159.7	68.9 / -2.85	KIEWIT EUROVIA VINCI OTTAWA ON	SPL
Ref No: 1-9KXMAM Year: Incident Dt: Aug 02,2024 12:00:00 PM Dt MOE Arvl on Scn: MOE Reported Dt: Aug 02,2024 05:54:25 PM Dt Document Closed: Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: KIEWIT EUROVIA VINCI OTTAWA PARTERNSHIP Client Name: KIEWIT EUROVIA VINCI Client Type: Private Business Source Type: Motor Vehicle Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Incident Summary: Kiewit Eurovia: sub-contractor hydraulic oil spill on LRT extension site (45.352559, -75.785036) Environment Impact: Health Env Consequence: Low Nature of Impact: Contaminant Qty: 3 litre (L)					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Normal operations Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: OTHER HEAVY AND CIVIL ENGINEERING CONSTRUCTION SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004292659","PR00004325294"],"wkts":["POINT (-75.7850360000 45.3525590000)","POINT (-75.7856690000 45.3520760000)"],"creation_date":"2024-08-02"} Time Reported: System Facility Address:					
60	1 of 1	S/160.9	73.2 / 1.46	2620 Iris St. OTTAWA ON	SPL
Ref No: 1-4D9UIJ Year: Incident Dt: 11/8/2023 10:45:41 AM Dt MOE Arvl on Scn: MOE Reported Dt: 11/8/2023 1:56:41 PM Dt Document Closed: Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 2620 Iris St. Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Pipeline/Components Incident Cause: Incident Preceding Spill: Incident Reason: Human error (Specify) Incident Summary: FSB: Ottawa/Enbridge/2" plastic IP main damage/locates/4 evac/3 losses/safe Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see notes Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: NATURAL GAS Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Air Activity Preceding Spill:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:		02K Central Ottawa River 02KF Mississippi River - Central Ottawa River NATURAL GAS DISTRIBUTION {"integration_ids":["PR00003961636"],"wks":["POINT (-75.7821976000 45.3498294000)","creation_date":"2023-11-08"} 			
61	1 of 4	NW/167.2	69.2 / -2.54	Kiewit Eurovia Vinci 2600 Queensview Dr. Ottawa ON	SPL
Ref No: Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:		1530-BN9J98 2020/03/31 2020/04/01 2020/07/17 NA No Ottawa construction site<UNOFFICIAL> 2600 Queensview Dr. Eastern Ottawa NAD83 5022612.09 438551.33 Kiewit Eurovia Vinci Corporation Valve/Fitting/Piping Leak/Break Material Failure - Poor Design/Substandard Material Kiewit Eurovia Vinci: ~1L hydraulic oil to soil/cleaned/no impacts 1 L 1 L 15 HYDRAULIC OIL n/a Land; Source Water Zone Unknown / N/A Land Spills 			
		Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:			
		2 - Minor Environment			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
61	2 of 4	NW/167.2	69.2 / -2.54	2600 Queensview Drive OTTAWA ON	SPL
Ref No: Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address: 1-1OH6YA 3/16/2022 7:52:14 AM 4/6/2022 3:29:14 PM Desktop Response Ottawa District Office 2600 Queensview Drive OTTAWA Truck - Transport/Hauling Leak/Break KEV: 5L engine coolant to grnd, cnted 1 Minor Impact 5 litre (L) COOLANT (N.O.S.) Land Loading and Unloading Lower Ottawa 02KE - Lower Madawaska OTHER HEAVY AND CIVIL ENGINEERING CONSTRUCTION {"integration_ids":["PR00004293769"],"wmts":["POINT (-75.7831476000 45.3544808000)","creation_date":"2022-03-16"} Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved: 0 No Impact					

61	3 of 4	NW/167.2	69.2 / -2.54	2600 Queensview drive Ottawa ON	SPL
Ref No: Year: Incident Dt: Dt MOE Arvl on Scn: 1-1HU2FC Municipality No: Nature of Damage: Discharger Report: Material Group:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MOE Reported Dt:	12/17/2021 1:32:59 PM			Impact to Health:	1 Minor Health Impact
Dt Document Closed:	3/18/2022 5:11:03 PM			Agency Involved:	
Site No:					
MOE Response:		Desktop Response			
Site County/District:					
Site Geo Ref Meth:					
Site District Office:		Ottawa District Office			
Nearest Watercourse:					
Site Name:					
Site Address:		2600 Queensview drive Ottawa			
Site Region:					
Site Municipality:		OTTAWA			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:					
Incident Preceding Spill:					
Incident Reason:					
Incident Summary:		KEV construction Antifreeze 25L Ottawa			
Environment Impact:		1 Minor Impact			
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:		25 litre (L)			
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:		ETHYLENE GLYCOL			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		Land			
Activity Preceding Spill:					
Property 2nd Watershed:		Lower Ottawa			
Property Tertiary Watershed:		02KE - Lower Madawaska			
Sector Type:		CONSTRUCTION MACHINERY MANUFACTURING			
SAC Action Class:					
Call Report Locatn Geodata:		{ "integration_ids": ["PR00004293769"], "wks": ["POINT (-75.7831476000 45.3544808000)"], "creation_date": "2021-12-17" }			
Time Reported:					
System Facility Address:					

61	4 of 4	NW/167.2	69.2 / -2.54	2600 Queensview Dr. Ottawa ON K2B 8H6 OTTAWA ON	SPL
Ref No:	1-290TPW			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	11/9/2022 9:00:51 AM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	11/9/2022 10:24:51 AM			Impact to Health:	0 No Impact
Dt Document Closed:	11/17/2022 12:28:40 PM			Agency Involved:	
Site No:					
MOE Response:		Desktop Response			
Site County/District:					
Site Geo Ref Meth:					
Site District Office:		Ottawa District Office			
Nearest Watercourse:					
Site Name:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Address: 2600 Queensview Dr. Ottawa ON K2B 8H6 Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Motor Vehicle Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Equipment failure/malfunction Incident Summary: OLRT - hydraulic oil to grd, ctnd, clng 20L Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 20 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Lower Ottawa Property Tertiary Watershed: 02KE - Lower Madawaska Sector Type: INDUSTRIAL BUILDING AND STRUCTURE CONSTRUCTION SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004293769"],"wks":["POINT (-75.7831476000 45.3544808000)","creation_date":"2022-11-09"} Time Reported: System Facility Address:					
62	1 of 8	WNW/167.5	68.9 / -2.85	Nuvo Network Management Inc. 2650 Queensview Drive Ottawa ON	CA
Certificate #: 7402-6LKMQW Application Year: 2006 Issue Date: 4/5/2006 Approval Type: Air Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
62	2 of 8	WNW/167.5	68.9 / -2.85	Nuvo Network Management Inc. 2650 Queensview Drive Ottawa ON K2B 8H6	ECA
Approval No: 7402-6LKMQW MOE District: Ottawa					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Approval Date: Status: Record Type: Link Source: SWP Area Name: Approval Type: Project Type: Business Name: Address: Full Address: Full PDF Link: PDF Site Location:	2006-04-05 Approved ECA IDS Rideau Valley ECA-AIR AIR Nuvo Network Management Inc. 2650 Queensview Drive https://www.accessenvironment.ene.gov.on.ca/instruments/3086-6K9LD9-14.pdf			City: Longitude: Latitude: Geometry X: Geometry Y:	

62	3 of 8	WNW/167.5	68.9 / -2.85	2650 Queensview Dr Ottawa ON K2B8H6	EHS
Order No: Status: Report Type: Report Date: Date Received: Previous Site Name: Lot/Building Size: Additional Info Ordered:	20170306152 C Standard Report 13-MAR-17 06-MAR-17 City Directory			Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): X: Y:	

62	4 of 8	WNW/167.5	68.9 / -2.85	INTERNATIONAL DATACAST (OUT OF BUSINESS) 2650 QUEENSVIEW DRIVE, SUITE 260 OTTAWA ON K2B 8H6	GEN
Generator Info					
Generator No: Approval Years: Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:	ON1531700 92,93,96,97,98 OTHER COMMUN. & ELE.			Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:	 3359
Waste Detail(s)					
Waste Class: Waste Class Name:	233 OTHER POLYMERIC WASTES				
Waste Detail(s)					
Waste Class: Waste Class Name:	253 EMULSIFIED OILS				

62	5 of 8	WNW/167.5	68.9 / -2.85	INTERNATIONAL DATACASTING CORP. 21-546 2650 QUEENSVIEW DRIVE, SUITE 260 OTTAWA ON K2B 8H6	GEN
Generator Info					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON1531700 Approval Years: 94,95 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: OTHER COMMUN. & ELE. Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 3359					
<u>Waste Detail(s)</u>					
Waste Class: 253 Waste Class Name: EMULSIFIED OILS					
<u>Waste Detail(s)</u>					
Waste Class: 233 Waste Class Name: OTHER POLYMERIC WASTES					
62	6 of 8	WNW/167.5	68.9 / -2.85	Proslide Technology Inc. 2650 Queensview Drive Ottawa ON	GEN
<u>Generator Info (as of Dec 2024)</u>					
Generator No: ON001060754 Generator Company Name: Proslide Technology Inc. Street: 2650 Queensview Drive City: Ottawa Province State: Ontario Country: Canada Postal Code: K2B 8K1 Waste Class: 122 C					
Waste Class Decoded: 122 - ALKALINE WASTES - OTHER METALS					
<u>Generator Info (as of Apr 2025)</u>					
Generator Company Name: Proslide Technology Inc. Generator Site Address: 2650 Queensview Drive City: Ottawa Province State: Ontario Country: Canada Postal Code: K2B 8K1 Waste Class: 122 C					
Waste Class Decoded: 122 - ALKALINE WASTES - OTHER METALS					
Waste Characteristic Decoded: C - Corrosive					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
62	7 of 8	WNW/167.5	68.9 / -2.85	HUBER+SUHNER Canada 2650 Queensview Dr Suite 206 Ottawa ON K2B 8H6	SCT
Established:					
Plant Size (ft²):					
Employment:		3			
--Details--					
Description:		Electrical Wiring and Construction Supplies Wholesaler-Distributors			
SIC/NAICS Code:		416110			
Description:		Industrial Machinery, Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		417230			
Description:		Electronic Components, Navigational and Communications Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		417320			
62	8 of 8	WNW/167.5	68.9 / -2.85	ProSlide Technology Inc. 2650 Queensview Dr Suite 150 Ottawa ON K2B 8H6	SCT
Established:		01-AUG-86			
Plant Size (ft²):					
Employment:					
--Details--					
Description:		All Other Plastic Product Manufacturing			
SIC/NAICS Code:		326198			
63	1 of 1	ESE/185.9	73.9 / 2.15	Avanex Corporation 2299 Edwin Cres Ottawa ON K2C 1H8	SCT
Established:		2003			
Plant Size (ft²):					
Employment:		1			
--Details--					
Description:		Electronic Components, Navigational and Communications Equipment and Supplies Wholesaler-Distributors			
SIC/NAICS Code:		417320			
64	1 of 1	E/193.5	73.7 / 2.02	SERVICE STATION COBDON & IRIS (N.O.S.) OTTAWA CITY ON	SPL
Ref No:		80563		Municipality No:	20101
Year:				Nature of Damage:	
Incident Dt:		1/4/1993		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		1/4/1993		Impact to Health:	
Dt Document Closed:				Agency Involved:	OTTAWA WORKS DEPT
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: CONTAINER OVERFLOW Incident Preceding Spill: Incident Reason: ERROR Incident Summary: COMPLETE CAR CARE: WASTE OIL TO LAND & SEWER FROM UNCAPPED WASTE OIL TANK. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Water course or lake Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND / WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
65	1 of 2	E/193.6	72.9 / 1.15	1105 Cobden Rd Ottawa ON K2C2Z1	EHS
Order No: 20141008065 Status: C Report Type: Standard Report Report Date: 16-OCT-14 Date Received: 08-OCT-14 Previous Site Name: Lot/Building Size: 0.79 acres Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.777824 Y: 45.352577					
65	2 of 2	E/193.6	72.9 / 1.15	IRIS PLAZA 1105 Cobden Rd Ottawa ON K2C2Z1	GEN
Generator Info					
Generator No: ON9533917 Approval Years: As of Nov 2021 Status: Registered					
Choice of Contact: Contaminated Fac: MHSW Facility:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
 <u>Waste Detail(s)</u>					
Waste Class:	252 L				
Waste Class Name:	Waste crankcase oils and lubricants				
 <u>2021 Generator Info</u>					
Gen No:	ON9533917			Choice of Contact:	CO_OFFICIAL
ID:	39284			Phone No Official:	613-828-7023 Ext.
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	722110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	IRIS PLAZA				
Gen Div:					
Gen Op Name:	ISIR PLAZA				
Gen Op Div:					
Site Adrs1:	1105 Cobden Rd				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C2Z1				
Site Country:	Canada				
Co Official:	Mel Mel				
Co Admin:					
 <u>2021 Generator Manifest</u>					
ID:	65457			Sum Received Qty:	55.0
Generator No:	ON9533917			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	252				

66

1 of 1

SSE/196.0

73.9 / 2.15

OTTAWA CITY
SODERLIND ST./SUDBURY AVE.
OTTAWA CITY ON

CA

Certificate #: 3-1110-93-
Application Year: 93
Issue Date: 9/29/1993
Approval Type: Municipal sewage
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
67	1 of 2	ESE/199.5	73.9 / 2.15	OTTAWA HYDRO 2317 EDWIN CRESCENT OTTAWA ON K2C 1H8	GEN
<u>Generator Info</u>					
Generator No:	ON0456602			Choice of Contact:	
Approval Years:	90			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	0000
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	*** NOT DEFINED ***				
67	2 of 2	ESE/199.5	73.9 / 2.15	OTTAWA HYDRO 29-541 2317 EDWIN CRESCENT OTTAWA ON K2C 1H8	GEN
<u>Generator Info</u>					
Generator No:	ON0456602			Choice of Contact:	
Approval Years:	92,93,94,95,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	4911
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	ELECT. POWER SYS.				
<u>Waste Detail(s)</u>					
Waste Class:	243				
Waste Class Name:	PCB'S				
68	1 of 1	NW/206.2	68.9 / -2.85	MURLEE HOLDINGS LIMITED 2600-2630 QUEENSVIEW DR. (SWM) OTTAWA CITY ON K2B 8H6	CA
Certificate #:	3-0037-96-				
Application Year:	96				
Issue Date:	5/10/1996				
Approval Type:	Municipal sewage				
Status:	Approved				
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
69	1 of 1	NNE/206.3	69.8 / -1.92	KIEWIT EUROVIA VINCI 45.355491, -75.780125 OTTAWA ON	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ref No: Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northings: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:	1-3Y15KI 10/18/2023 11:00:04 AM 10/19/2023 7:36:04 AM 10/20/2023 2:45:52 PM Desktop Response Ottawa District Office 45.355491, -75.780125 OTTAWA KIEWIT EUROVIA VINCI Private Business Fuel Pump Overfill KEV: 5L diesel spill to gravel, Ottawa, late report 5 litre (L) DIESEL FUEL Land Lower Ottawa 02KE - Lower Madawaska OTHER HEAVY AND CIVIL ENGINEERING CONSTRUCTION {"integration_ids":["PR00003951691"],"wks":["POINT (-75.7801250000 45.3554910000)","POINT (-75.7801250000 45.3554910000)"],"creation_date":"2023-10-19"} 	Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:			

70	1 of 1	SSW/209.6	72.9 / 1.15	2685 IRIS ST. NAPEAN ON	WWIS
Well ID: Construction Date: Use 1st: Use 2nd: Final Well Status: Water Type: Casing Material: Audit No: Tag:	7051219 Monitoring Observation Wells Z63627 A061530	Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: Selected Flag: Abandonment Rec: Contractor: Form Version:	 10/22/2007 TRUE 7241 4		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: Site Info:				Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/705\7051219.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date: Year Completed: Depth (m): Latitude: Longitude: X: Y: Path:		09/12/2007 2007 13.7 45.3493762547916 -75.7829596562594 -75.78295949455267 45.34937624838548 705\7051219.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID: DP2BR: Spatial Status: Code OB: Code OB Desc: Open Hole: Cluster Kind: Date Completed: Remarks: Location Method Desc: Elevrc Desc: Location Source Date: Improvement Location Source: Improvement Location Method: Source Revision Comment: Supplier Comment:		23051219 09/12/2007 on Water Well Record		Elevation: Elevrc: Zone: East83: North83: Org CS: UTMRC: UTMRC Desc: Location Method:	18 438667.00 5022061.00 UTM83 3 margin of error : 10 - 30 m wwr
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID: Layer: Color: General Color: Material 1: Material 1 Desc: Material 2: Material 2 Desc: Material 3: Material 3 Desc: Formation Top Depth: Formation End Depth: Formation End Depth UOM:		1000006239 2 2 GREY 15 LIMESTONE 26 ROCK 6.699999809265137 13.699999809265137 m			
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1000006238			
Layer:		1			
Color:		6			
General Color:		BROWN			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		08			
Material 2 Desc:		FINE SAND			
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		0.0			
Formation End Depth:		6.699999809265137			
Formation End Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1000006243			
Layer:		3			
Plug From:		7.599999904632568			
Plug To:		13.699999809265137			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1000006241			
Layer:		1			
Plug From:		0.0			
Plug To:		0.30000001192092896			
Plug Depth UOM:		m			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1000006242			
Layer:		2			
Plug From:		0.30000001192092896			
Plug To:		7.599999904632568			
Plug Depth UOM:		m			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1000006247			
Method Construction Code:		7			
Method Construction:		Diamond			
Other Method Construction:					
<u>Pipe Information</u>					
Pipe ID:		1000006236			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1000006245			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Layer:					
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:					
Depth To:		9.100000381469727			
Casing Diameter:		3.174999952316284			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1000006246			
Layer:					
Slot:					
Screen Top Depth:					
Screen End Depth:					
Screen Material:		5			
Screen Depth UOM:					
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1000006237			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:		0			
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1000006244			
Layer:		1			
Kind Code:		1			
Kind:		FRESH			
Water Found Depth:		3.0			
Water Found Depth UOM:		m			
<u>Hole Diameter</u>					
Hole ID:		1000006240			
Diameter:		4.0			
Depth From:					
Depth To:		13.699999809265137			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
71	1 of 48	SW/210.5	70.9 / -0.85	2685 IRIS STREET OTTAWA ON K2C 3S4	EHS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Order No: 20070520001 Status: C Report Type: CAN - Custom Report Report Date: 5/25/2007 Date Received: 5/20/2007 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps And /or Site Plans					
Nearest Intersection: Municipality: Client Prov/State: Search Radius (km): 0.3 X: -75.784798 Y: 45.349626					
71	2 of 48	SW/210.5	70.9 / -0.85	2685 Iris St Ottawa ON K2C 1E5	EHS
Order No: 21082800016 Status: C Report Type: Custom Report Report Date: 02-SEP-21 Date Received: 28-AUG-21 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .15 X: -75.78491997 Y: 45.35027213					
71	3 of 48	SW/210.5	70.9 / -0.85	BLACK PHOTO CORPORATION 2685 IRIS STREET, OTTAWA C/O 371 GOUGH ROAD MARKHAM ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No: ON0074380 Approval Years: 90 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: CAMERA/PHOTO. SUPPLY					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 6571					
<u>Waste Detail(s)</u>					
Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
71	4 of 48	SW/210.5	70.9 / -0.85	BLACK PHOTO CORPORAT (OUT OF BUSINESS) 2685 IRIS STREET, OTTAWA C/O 371 GOUGH ROAD MARKHAM ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No: ON0074380 Approval Years: 92,93,95,96,97 Status: PO Box No: Country: Co Admin: Phone No Admin:					
Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 6571					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		CAMERA/PHOTO. SUPPLY			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
71	5 of 48	SW/210.5	70.9 / -0.85	BLACK PHOTO CORPORATION 05-422 2685 IRIS STREET, OTTAWA C/O 371 GOUGH ROAD MARKHAM ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No:		ON0074380		Choice of Contact:	
Approval Years:		94		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 6571	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		CAMERA/PHOTO. SUPPLY			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
71	6 of 48	SW/210.5	70.9 / -0.85	BLACK PHOTO CORPORAT (OUT OF BUSINESS) 2685 IRIS STREET OTTAWA ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No:		ON0074380		Choice of Contact:	
Approval Years:		98		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 6571	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		CAMERA/PHOTO. SUPPLY			
<u>Waste Detail(s)</u>					
Waste Class:		264			
Waste Class Name:		PHOTOPROCESSING WASTES			
71	7 of 48	SW/210.5	70.9 / -0.85	NATIONAL GROCERS COMPANY LTD. 2685 IRIS STREET OTTAWA ON K2C 3S4	GEN
<u>Generator Info</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON0129148 Approval Years: 97 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: CAMERA/PHOTO. SUPPLY Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 6571 <u>Waste Detail(s)</u> Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
71	8 of 48	SW/210.5	70.9 / -0.85	NATIONAL GROCERS COMPANY LTD. LOBLAWS SUPERMARKETS LTD. 2685 IRIS STREET OTTAWA ON K2C 3S4	GEN
<u>Generator Info</u> Generator No: ON0129148 Approval Years: 98,99,00,01 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: CAMERA/PHOTO. SUPPLY Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 6571 <u>Waste Detail(s)</u> Waste Class: 264 Waste Class Name: PHOTOPROCESSING WASTES					
71	9 of 48	SW/210.5	70.9 / -0.85	PHARMA PLUS DRUGS LTD 2685 IRIS STREET OTTAWA ON K2C 3S4	GEN
<u>Generator Info</u> Generator No: ON1553321 Approval Years: 92,93,97 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: PHARMACIES Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 6031 <u>Waste Detail(s)</u> Waste Class: 261 Waste Class Name: PHARMACEUTICALS <u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: Waste Class Name:		312 PATHOLOGICAL WASTES			
71	10 of 48	SW/210.5	70.9 / -0.85	PHARMA PLUS DRUGS LTD. 31-674 2685 IRIS STREET, OTTAWA C/O 5935 AIRPORT ROAD STE. 500 MISSISSAUGA ON K2C 3S4	GEN
Generator Info					
Generator No:		ON1553321		Choice of Contact:	
Approval Years:		94,95,96		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6031
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		PHARMACIES			
Waste Detail(s)					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Detail(s)					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
71	11 of 48	SW/210.5	70.9 / -0.85	PHARMA PLUS DRUGS LTD(OUT OF BUSINESS) 2685 IRIS STREET OTTAWA ON K2C 3S4	GEN
Generator Info					
Generator No:		ON1553321		Choice of Contact:	
Approval Years:		98,99		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6031
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		PHARMACIES			
Waste Detail(s)					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
Waste Detail(s)					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
71	12 of 48	SW/210.5	70.9 / -0.85	DRUGSTORE PHARMACY, THE 2685 IRIS STREET	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OTTAWA ON K2C 3S4					
<u>Generator Info</u>					
Generator No:	ON2445407			Choice of Contact:	
Approval Years:	00,01			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	6031
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		PHARMACIES			
<u>Waste Detail(s)</u>					
Waste Class:		261			
Waste Class Name:		PHARMACEUTICALS			
71	13 of 48	SW/210.5	70.9 / -0.85	IKEA Canada 2685 Iris Street Pinecrest shopping Mall Ottawa ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No:	ON5638175			Choice of Contact:	
Approval Years:	02,03,04			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
71	14 of 48	SW/210.5	70.9 / -0.85	IKEA Canada Limited Partnership 2685 Iris Street Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON7627928			Choice of Contact:	
Approval Years:	03,04,05,06			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Detail(s)					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
71	15 of 48	SW/210.5	70.9 / -0.85	IKEA CANADA 2685 Iris Street Ottawa ON K2C 3S4	GEN
Generator Info					
Generator No:		ON3543278		Choice of Contact:	
Approval Years:		07,08		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 442298	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		All Other Home Furnishings Stores			
Waste Detail(s)					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
Waste Detail(s)					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
Waste Detail(s)					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
Waste Detail(s)					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
71	16 of 48	SW/210.5	70.9 / -0.85	IKEA CANADA 2685 Iris Street Ottawa ON K2C 3S4	GEN
Generator Info					
Generator No:		ON3543278		Choice of Contact:	
Approval Years:		2009		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 442298	
Country:					
Co Admin:					
Phone No Admin:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		All Other Home Furnishings Stores			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
71	17 of 48	SW/210.5	70.9 / -0.85	SEARS CANADA INC 2685 IRIS STREET OTTAWA ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No:		ON9213177		Choice of Contact:	
Approval Years:		2010		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code: 453999	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		All Other Miscellaneous Store Retailers (except Beer and Wine-Making Supplies Stores)			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
71	18 of 48	SW/210.5	70.9 / -0.85	IKEA CANADA 2685 Iris Street Ottawa ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No:		ON3543278		Choice of Contact:	
Approval Years:		2010		Contaminated Fac:	

340 erisinfo.com | Environmental Risk Information Services Order No: 25082500253

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
71	21 of 48	SW/210.5	70.9 / -0.85	IKEA CANADA LTD PARTNERSHIP 2685 Iris Street Ottawa ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No:	ON3543278			Choice of Contact:	
Approval Years:	2012			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	442298
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		All Other Home Furnishings Stores			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
71	22 of 48	SW/210.5	70.9 / -0.85	IKEA CANADA LTD PARTNERSHIP 2685 Iris Street Ottawa ON	GEN

Generator Info

Generator No:	ON3543278	Choice of Contact:	
Approval Years:	2013	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	442298
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	ALL OTHER HOME FURNISHINGS STORES		

Waste Detail(s)

Waste Class:	121
Waste Class Name:	ALKALINE WASTES - HEAVY METALS

Waste Detail(s)

Waste Class:	312
Waste Class Name:	PATHOLOGICAL WASTES

Waste Detail(s)

Waste Class:	146
Waste Class Name:	OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class:	331
Waste Class Name:	WASTE COMPRESSED GASES

Waste Detail(s)

Waste Class:	145
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES

71	23 of 48	SW/210.5	70.9 / -0.85	Michaels Stores, Inc. 2685 Iris St Ottawa ON	GEN

Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No: ON6196387 Approval Years: 2013 Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description: SEWING, NEEDLEWORK AND PIECE GOODS STORES Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 451130					
<u>Waste Detail(s)</u>					
Waste Class: 263 Waste Class Name: ORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 212 Waste Class Name: ALIPHATIC SOLVENTS					
<u>Waste Detail(s)</u>					
Waste Class: 146 Waste Class Name: OTHER SPECIFIED INORGANICS					
<u>Waste Detail(s)</u>					
Waste Class: 331 Waste Class Name: WASTE COMPRESSED GASES					
<u>Waste Detail(s)</u>					
Waste Class: 148 Waste Class Name: INORGANIC LABORATORY CHEMICALS					
<u>Waste Detail(s)</u>					
Waste Class: 145 Waste Class Name: PAINT/PIGMENT/COATING RESIDUES					
<u>Waste Detail(s)</u>					
Waste Class: 122 Waste Class Name: ALKALINE WASTES - OTHER METALS					
71	24 of 48	SW/210.5	70.9 / -0.85	Michaels Stores, Inc. 2685 Iris St Ottawa ON K2C 3S4	GEN

Generator Info

Generator No:	ON6196387	Choice of Contact:	CO_OFFICIAL
Approval Years:	2016	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	451130
Country:	Canada		
Co Admin:	James Williams		
Phone No Admin:	(647)288-3298 Ext.		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		SEWING, NEEDLEWORK AND PIECE GOODS STORES			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			

<u>71</u>	25 of 48	SW/210.5	70.9 / -0.85	IKEA CANADA LTD PARTNERSHIP 2685 Iris Street Ottawa ON K2C3S4	GEN

Generator Info

Generator No:	ON3543278	Choice of Contact:	CO_OFFICIAL
Approval Years:	2016	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	442298
Country:	Canada		
Co Admin:	Donna Black		
Phone No Admin:	613-670-8060 Ext.2331		
SIC Description:	ALL OTHER HOME FURNISHINGS STORES		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			

71

26 of 48

SW/210.5

70.9 / -0.85

IKEA CANADA LTD PARTNERSHIP
2685 Iris Street
Ottawa ON K2C3S4

GEN

Generator Info

Generator No:	ON3543278	Choice of Contact:	CO_ADMIN
Approval Years:	2015	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	442298
Country:	Canada		
Co Admin:	Julie Dameren		
Phone No Admin:	613-670-8060 Ext.2334		
SIC Description:	ALL OTHER HOME FURNISHINGS STORES		

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		312			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>71</u>	27 of 48	SW/210.5	70.9 / -0.85	Michaels Stores, Inc. 2685 Iris St Ottawa ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No:	ON6196387			Choice of Contact:	CO_OFFICIAL
Approval Years:	2015			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	451130
Country:	Canada				
Co Admin:	James Williams				
Phone No Admin:	(647)288-3298 Ext.				
SIC Description:	SEWING, NEEDLEWORK AND PIECE GOODS STORES				
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			

[71](#)

28 of 48

SW/210.5

70.9 / -0.85

IKEA CANADA LTD PARTNERSHIP
2685 Iris Street
Ottawa ON K2C3S4

GEN

Generator Info

Generator No:	ON3543278	Choice of Contact:	CO_OFFICIAL
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	442298
Country:	Canada		
Co Admin:	Chelsea Murray		
Phone No Admin:	613-670-8060 Ext.2334		
SIC Description:	ALL OTHER HOME FURNISHINGS STORES		

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 312
Waste Class Name: PATHOLOGICAL WASTES

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		121			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
71	29 of 48	SW/210.5	70.9 / -0.85	Michaels Stores, Inc. 2685 Iris St Ottawa ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No:	ON6196387			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	451130
Country:	Canada				
Co Admin:	James Williams				
Phone No Admin:	(647)288-3298 Ext.				
SIC Description:	SEWING, NEEDLEWORK AND PIECE GOODS STORES				
<u>Waste Detail(s)</u>					
Waste Class:		148			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		263			
Waste Class Name:		ORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		122			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		262			
Waste Class Name:		DETERGENTS/SOAPS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
71	30 of 48	SW/210.5	70.9 / -0.85	Michaels Stores, Inc. 2685 Iris St Ottawa ON K2C 3S4	GEN
<u>Generator Info</u>					
Generator No:		ON6196387		Choice of Contact:	
Approval Years:		As of Dec 2018		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		148 L			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		262 L			
Waste Class Name:		Detergents and soaps			
<u>Waste Detail(s)</u>					
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		331 L			
Waste Class Name:		Waste compressed gases including cylinders			

[71](#)

31 of 48

SW/210.5

70.9 / -0.85

**IKEA CANADA LTD PARTNERSHIP OTTAWA
(004)
2685 Iris Street
Ottawa ON K2C3S4**

GEN

Generator Info

Generator No: ON3543278
Approval Years: As of Dec 2018
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			

71

32 of 48

SW/210.5

70.9 / -0.85

**Michaels Stores, Inc.
2685 Iris St
Ottawa ON K2C 3S4**

GEN

Generator Info

Generator No: ON6196387
Approval Years: As of Jul 2020
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 263 L
Waste Class Name: Misc. waste organic chemicals

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		262 L			
Waste Class Name:		Detergents and soaps			
<u>Waste Detail(s)</u>					
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		148 L			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		331 L			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
71	33 of 48	SW/210.5	70.9 / -0.85	IKEA CANADA LTD PARTNERSHIP OTTAWA	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
				(004) 2685 Iris Street Ottawa ON K2C3S4	
<u>Generator Info</u>					
Generator No:	ON3543278			Choice of Contact:	
Approval Years:	As of Jul 2020			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	212 L				
Waste Class Name:	Aliphatic solvents and residues				
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
<u>Waste Detail(s)</u>					
Waste Class:	331 I				
Waste Class Name:	Waste compressed gases including cylinders				
<u>Waste Detail(s)</u>					
Waste Class:	252 L				
Waste Class Name:	Waste crankcase oils and lubricants				
<u>Waste Detail(s)</u>					
Waste Class:	145 I				
Waste Class Name:	Wastes from the use of pigments, coatings and paints				
<u>Waste Detail(s)</u>					
Waste Class:	146 T				
Waste Class Name:	Other specified inorganic sludges, slurries or solids				
<u>Waste Detail(s)</u>					
Waste Class:	121 C				
Waste Class Name:	Alkaline slutions - containing heavy metals				
71	34 of 48	SW/210.5	70.9 / -0.85	Michaels Stores, Inc. 2685 Iris St Ottawa ON K2C 3S4	GEN
<u>Generator Info</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:		ON6196387		Choice of Contact:	
Approval Years:		As of Nov 2021		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		212 I			
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		331 L			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		148 L			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		148 A			
Waste Class Name:		Misc. wastes and inorganic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		262 L			
Waste Class Name:		Detergents and soaps			
<u>Waste Detail(s)</u>					
Waste Class:		263 L			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		263 A			
Waste Class Name:		Misc. waste organic chemicals			
<u>Waste Detail(s)</u>					
Waste Class:		145 L			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
71	35 of 48	SW/210.5	70.9 / -0.85	IKEA CANADA LTD PARTNERSHIP OTTAWA (004) 2685 Iris Street Ottawa ON K2C3S4	GEN
<u>Generator Info</u>					
Generator No:		ON3543278		Choice of Contact:	
Approval Years:		As of Nov 2021		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		Alkaline slutions - containing heavy metals			
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		Pathological wastes			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Aliphatic solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		Waste crankcase oils and lubricants			
71	36 of 48	SW/210.5	70.9 / -0.85	IKEA Canada Limited Partnership Pinecrest Shopping Centre, 2685 Iris Street Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:		ON3543278		Choice of Contact:	
Approval Years:		As of Oct 2022		Contaminated Fac:	
Status:		Registered		MHSW Facility:	
PO Box No:				SIC Code:	
Country:		Canada			
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		312 P			
Waste Class Name:		PATHOLOGICAL WASTES			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		121 C			
Waste Class Name:		ALKALINE WASTES - HEAVY METALS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Info (as of Dec 2024)

Generator No: ON3543278
Generator Company Name: IKEA Canada Limited Partnership
Street: Pinecrest Shopping Centre, 2685 Iris Street
City: Ottawa
Province State: Ontario
Country: Canada
Postal Code: K2C3S4
Waste Class: 312 P, 262 A, 121 C, 263 A, 145 I, 262 L, 212 L, 263 I, 252 L, 331 I, 146 T, 331 L

Waste Class Decoded:

312 - PATHOLOGICAL WASTES; 262 - DETERGENTS/SOAPS; 121 - ALKALINE WASTES - HEAVY METALS; 263 - ORGANIC LABORATORY CHEMICALS; 145 - PAINT/PIGMENT/COATING RESIDUES; 262 - DETERGENTS/SOAPS; 212 - ALIPHATIC SOLVENTS; 263 - ORGANIC LABORATORY CHEMICALS; 252 - WASTE OILS & LUBRICANTS; 331 - WASTE COMPRESSED GASES; 146 - OTHER SPECIFIED INORGANICS; 331 - WASTE COMPRESSED GASES

Generator Info (as of Dec 2024)

Generator No: ON3543278
Generator Company Name: IKEA Canada Limited Partnership
Street: Pinecrest Shopping Centre, 2685 Iris Street
City: Ottawa
Province State: Ontario
Country: Canada
Postal Code: K2C3S4
Waste Class: 312 P, 121 C, 145 I, 212 L, 252 L, 331 I, 146 T, 262 A, 263 A, 262 L, 263 I, 331 L

Waste Class Decoded:

312 - PATHOLOGICAL WASTES; 121 - ALKALINE WASTES - HEAVY METALS; 145 - PAINT/PIGMENT/COATING RESIDUES; 212 - ALIPHATIC SOLVENTS; 252 - WASTE OILS & LUBRICANTS; 331 - WASTE COMPRESSED GASES; 146 - OTHER SPECIFIED INORGANICS; 262 - DETERGENTS/SOAPS; 263 - ORGANIC LABORATORY CHEMICALS; 262 - DETERGENTS/SOAPS; 263 - ORGANIC LABORATORY CHEMICALS; 331 - WASTE COMPRESSED GASES

Generator Info (as of Apr 2025)

Generator Company Name: IKEA Canada Limited Partnership
Generator Site Address: Pinecrest Shopping Centre, 2685 Iris Street
City: Ottawa
Province State: Ontario
Country: Canada
Postal Code: K2C3S4
Waste Class: 312 P, 121 C, 145 I, 212 L, 252 L, 331 I, 146 T, 262 A, 263 A, 262 L, 263 I, 331 L

Waste Class Decoded:

312 - PATHOLOGICAL WASTES; 121 - ALKALINE WASTES - HEAVY METALS; 145 - PAINT/PIGMENT/COATING RESIDUES; 212 - ALIPHATIC SOLVENTS; 252 - WASTE OILS & LUBRICANTS; 331 - WASTE COMPRESSED GASES; 146 - OTHER SPECIFIED INORGANICS; 262 - DETERGENTS/SOAPS; 263 - ORGANIC LABORATORY CHEMICALS; 262 - DETERGENTS/SOAPS; 263 - ORGANIC LABORATORY CHEMICALS; 331 - WASTE COMPRESSED GASES

Waste Characteristic Decoded:

P - Pathological; C - Corrosive; I - Ignitable; L - Liquid Industrial Waste; L - Liquid Industrial Waste; I - Ignitable; T - Leachate Toxic; A - Acutely Hazardous Waste Chem.; A - Acutely Hazardous Waste Chem.; L - Liquid Industrial Waste; I - Ignitable; L - Liquid Industrial Waste

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2017 Generator Info</u>					
Gen No:	ON3543278			Choice of Contact:	CO_OFFICIAL
ID:	14236			Phone No Official:	613-670-8060 Ext.3406
Contaminated Fac:	N			Phone No Admin:	613-670-8060 Ext.2331
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	442298			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		IKEA CANADA LTD PARTNERSHIP			
Gen Div:		OTTAWA (004)			
Gen Op Name:		IKEA CANADA LTD PARTNERSHIP			
Gen Op Div:		OTTAWA (004)			
Site Adrs1:		2685 Iris Street			
Site Bldg:		Pinecrest Shopping Centre			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C3S4			
Site Country:		Canada			
Co Official:		Daniel Lish			
Co Admin:		Donna Black			
<u>2017 Generator Manifest</u>					
ID:	36714			Sum Received Qty:	6.6
Generator No:	ON3543278			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>2018 Generator Info</u>					
Gen No:	ON3543278			Choice of Contact:	CO_OFFICIAL
ID:	14122			Phone No Official:	613-670-8060 Ext.2406
Contaminated Fac:	N			Phone No Admin:	613-670-8060 Ext.2331
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	442298			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		IKEA CANADA LTD PARTNERSHIP			
Gen Div:		OTTAWA (004)			
Gen Op Name:		IKEA CANADA LTD PARTNERSHIP			
Gen Op Div:		OTTAWA (004)			
Site Adrs1:		2685 Iris Street			
Site Bldg:		Pinecrest Shopping Centre			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C3S4			
Site Country:		Canada			
Co Official:		Ricardo Rodas			
Co Admin:		Donna Black			
<u>2019 Generator Info</u>					
Gen No:	ON3543278			Choice of Contact:	CO_OFFICIAL
ID:	13927			Phone No Official:	613-670-8060 Ext.2406
Contaminated Fac:	N			Phone No Admin:	613-670-8060 Ext.2331

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	442298			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		IKEA CANADA LTD PARTNERSHIP			
Gen Div:		OTTAWA (004)			
Gen Op Name:		IKEA CANADA LTD PARTNERSHIP			
Gen Op Div:		OTTAWA (004)			
Site Adrs1:		2685 Iris Street			
Site Bldg:		Pinecrest Shopping Centre			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C3S4			
Site Country:		Canada			
Co Official:		Ricardo Rodas			
Co Admin:		Donna Black			

2020 Generator Info

Gen No:	ON3543278	Choice of Contact:	CO_OFFICIAL
ID:	13576	Phone No Official:	613-670-8060 Ext.2406
Contaminated Fac:	N	Phone No Admin:	613-670-8060 Ext.2331
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	442298	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	IKEA CANADA LTD PARTNERSHIP		
Gen Div:	OTTAWA (004)		
Gen Op Name:	IKEA CANADA LTD PARTNERSHIP		
Gen Op Div:	OTTAWA (004)		
Site Adrs1:	2685 Iris Street		
Site Bldg:	Pinecrest Shopping Centre		
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2C3S4		
Site Country:	Canada		
Co Official:	Ricardo Rodas		
Co Admin:	Clancy Adami		

2020 Generator Manifest

ID:	33007	Sum Received Qty:	12.5
Generator No:	ON3543278	Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	035	Count Manifests:	1
Waste Char:	P	District:	305
Waste Code:	312		

2020 Generator Manifest

ID:	33008	Sum Received Qty:	10.8
Generator No:	ON3543278	Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030	Count Manifests:	1
Waste Char:	P	District:	402
Waste Code:	312		

2021 Generator Info

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen No:	ON3543278			Choice of Contact:	CO_OFFICIAL
ID:	13449			Phone No Official:	613-670-8060 Ext.2406
Contaminated Fac:	N			Phone No Admin:	613-670-8060 Ext.2406
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	442298			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		IKEA CANADA LTD PARTNERSHIP			
Gen Div:		OTTAWA (004)			
Gen Op Name:		IKEA CANADA LTD PARTNERSHIP			
Gen Op Div:		OTTAWA (004)			
Site Adrs1:		2685 Iris Street			
Site Bldg:		Pinecrest Shopping Centre			
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C3S4			
Site Country:		Canada			
Co Official:		Francis P Coleman			
Co Admin:		Francis Coleman			

71	37 of 48	SW/210.5	70.9 / -0.85	Michaels Stores Inc. 2685 Iris Street Ottawa ON	GEN

Generator Info

Generator No:	ON6196387	Choice of Contact:
Approval Years:	As of Oct 2022	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class:	145 L
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class:	263 L
Waste Class Name:	ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	263 A
Waste Class Name:	ORGANIC LABORATORY CHEMICALS

Waste Detail(s)

Waste Class:	212 I
Waste Class Name:	ALIPHATIC SOLVENTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		148 A			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		148 L			
Waste Class Name:		INORGANIC LABORATORY CHEMICALS			
<u>Waste Detail(s)</u>					
Waste Class:		331 L			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		262 L			
Waste Class Name:		DETERGENTS/SOAPS			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Generator Info (as of Dec 2024)</u>					
Generator No:		ON6196387			
Generator Company Name:		Michaels Stores Inc.			
Street:		2685 Iris Street			
City:		Ottawa			
Province State:		Ontario			
Country:		Canada			
Postal Code:		K2C 3S4			
Waste Class:		145 L, 148 C, 122 C, 146 T, 148 A, 148 L, 212 I, 263 A, 263 L, 331 I, 262 L, 145 I, 263 I			
Waste Class Decoded:					
145 - PAINT/PIGMENT/COATING RESIDUES; 148 - INORGANIC LABORATORY CHEMICALS; 122 - ALKALINE WASTES - OTHER METALS; 146 - OTHER SPECIFIED INORGANICS; 148 - INORGANIC LABORATORY CHEMICALS; 148 - INORGANIC LABORATORY CHEMICALS; 212 - ALIPHATIC SOLVENTS; 263 - ORGANIC LABORATORY CHEMICALS; 263 - ORGANIC LABORATORY CHEMICALS; 331 - WASTE COMPRESSED GASES; 262 - DETERGENTS/SOAPS; 145 - PAINT/PIGMENT/COATING RESIDUES; 263 - ORGANIC LABORATORY CHEMICALS					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB

Generator Info (as of Dec 2024)

Generator No: ON6196387
Generator Company Name: Michaels Stores Inc.
Street: 2685 Iris Street
City: Ottawa
Province State: Ontario
Country: Canada
Postal Code: K2C 3S4
Waste Class: 145 L,263 I,122 C,146 T,148 A,148 L,212 I,263 A,263 L,331 I,262 L,145 I,148 C

Waste Class Decoded:

145 - PAINT/PIGMENT/COATING RESIDUES; 263 - ORGANIC LABORATORY CHEMICALS; 122 - ALKALINE WASTES - OTHER METALS; 146 - OTHER SPECIFIED INORGANICS; 148 - INORGANIC LABORATORY CHEMICALS; 148 - INORGANIC LABORATORY CHEMICALS; 212 - ALIPHATIC SOLVENTS; 263 - ORGANIC LABORATORY CHEMICALS; 263 - ORGANIC LABORATORY CHEMICALS; 331 - WASTE COMPRESSED GASES; 262 - DETERGENTS/SOAPS; 145 - PAINT/PIGMENT/COATING RESIDUES; 148 - INORGANIC LABORATORY CHEMICALS

Generator Info (as of Apr 2025)

Generator Company Name: Michaels Stores Inc.
Generator Site Address: 2685 Iris Street
City: Ottawa
Province State: Ontario
Country: Canada
Postal Code: K2C 3S4
Waste Class: 145 L, 122 C, 146 T, 148 A, 148 L, 212 I, 263 A, 263 L, 331 I, 262 L, 145 I, 263 I, 148 C

Waste Class Decoded:

145 - PAINT/PIGMENT/COATING RESIDUES; 122 - ALKALINE WASTES - OTHER METALS; 146 - OTHER SPECIFIED INORGANICS; 148 - INORGANIC LABORATORY CHEMICALS; 148 - INORGANIC LABORATORY CHEMICALS; 212 - ALIPHATIC SOLVENTS; 263 - ORGANIC LABORATORY CHEMICALS; 263 - ORGANIC LABORATORY CHEMICALS; 331 - WASTE COMPRESSED GASES; 262 - DETERGENTS/SOAPS; 145 - PAINT/PIGMENT/COATING RESIDUES; 263 - ORGANIC LABORATORY CHEMICALS; 148 - INORGANIC LABORATORY CHEMICALS

Waste Characteristic Decoded:

L - Liquid Industrial Waste; C - Corrosive; T - Leachate Toxic; A - Acutely Hazardous Waste Chem.; L - Liquid Industrial Waste; I - Ignitable; A - Acutely Hazardous Waste Chem.; L - Liquid Industrial Waste; I - Ignitable; L - Liquid Industrial Waste; I - Ignitable; I - Ignitable; C - Corrosive

2017 Generator Info

Gen No:	ON6196387	Choice of Contact:	CO_OFFICIAL
ID:	24416	Phone No Official:	(972) 409-5786 Ext.
Contaminated Fac:	N	Phone No Admin:	(647)288-3298 Ext.
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	451130	County Out:	
NAICS Code2:		District:	402
NAICS Code3:			
Gen Name:	Michaels Stores, Inc.		
Gen Div:			
Gen Op Name:	3505 OTTAWA-PINECREST		
Gen Op Div:			
Site Adrs1:	2685 Iris St		
Site Bldg:			
Site Pobox:			
Province In:	ONTARIO		
Site Adrs2:			
Site City:	Ottawa		
Province Out:			
Site Postal Code:	K2C 3S4		

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Country:		Canada			
Co Official:		Ryan Draper			
Co Admin:		James Williams			
<u>2017 Generator Manifest</u>					
ID:	49800			Sum Received Qty:	2.0
Generator No:	ON6196387			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	030			Count Manifests:	1
Waste Char:	T			District:	402
Waste Code:	146				
<u>2017 Generator Manifest</u>					
ID:	49802			Sum Received Qty:	3.0
Generator No:	ON6196387			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	030			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	212				
<u>2017 Generator Manifest</u>					
ID:	49805			Sum Received Qty:	11.0
Generator No:	ON6196387			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	3
Waste Char:	L			District:	402
Waste Code:	331				
<u>2017 Generator Manifest</u>					
ID:	49798			Sum Received Qty:	2.0
Generator No:	ON6196387			Waste Class Name:	ALKALINE WASTES - OTHER METALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	C			District:	402
Waste Code:	122				
<u>2017 Generator Manifest</u>					
ID:	49803			Sum Received Qty:	4.0
Generator No:	ON6196387			Waste Class Name:	DETERGENTS/SOAPS
Receiver Type:	030			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	262				
<u>2017 Generator Manifest</u>					
ID:	49799			Sum Received Qty:	223.0
Generator No:	ON6196387			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	030			Count Manifests:	3
Waste Char:	L			District:	402
Waste Code:	145				
<u>2017 Generator Manifest</u>					
ID:	49801			Sum Received Qty:	2.0
Generator No:	ON6196387			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	A			District:	402
Waste Code:	148				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2017 Generator Manifest</u>					
ID:	49804			Sum Received Qty:	163.0
Generator No:	ON6196387			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	3
Waste Char:	I			District:	402
Waste Code:	331				
<u>2018 Generator Info</u>					
Gen No:	ON6196387			Choice of Contact:	CO_OFFICIAL
ID:	24703			Phone No Official:	(972) 409-5786 Ext.
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	451130			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Michaels Stores, Inc.			
Gen Div:					
Gen Op Name:		3505 OTTAWA-PINECREST			
Gen Op Div:					
Site Adrs1:		2685 Iris St			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 3S4			
Site Country:		Canada			
Co Official:		Ryan Draper			
Co Admin:		Alyson Roberts			
<u>2018 Generator Manifest</u>					
ID:	49695			Sum Received Qty:	22.0
Generator No:	ON6196387			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	030			Count Manifests:	2
Waste Char:	L			District:	402
Waste Code:	145				
<u>2018 Generator Manifest</u>					
ID:	49696			Sum Received Qty:	2.0
Generator No:	ON6196387			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	A			District:	402
Waste Code:	148				
<u>2018 Generator Manifest</u>					
ID:	49697			Sum Received Qty:	4.0
Generator No:	ON6196387			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	030			Count Manifests:	2
Waste Char:	I			District:	402
Waste Code:	212				
<u>2018 Generator Manifest</u>					
ID:	49699			Sum Received Qty:	20.0
Generator No:	ON6196387			Waste Class Name:	WASTE COMPRESSED GASES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Receiver Type:	030			Count Manifests:	2
Waste Char:	L			District:	402
Waste Code:	331				
<u>2018 Generator Manifest</u>					
ID:	49698			Sum Received Qty:	23.0
Generator No:	ON6196387			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	2
Waste Char:	I			District:	402
Waste Code:	331				
<u>2019 Generator Info</u>					
Gen No:	ON6196387			Choice of Contact:	CO_OFFICIAL
ID:	24866			Phone No Official:	(972) 409-5786 Ext.
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	451130			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Michaels Stores, Inc.				
Gen Div:					
Gen Op Name:	3505 OTTAWA-PINECREST				
Gen Op Div:					
Site Adrs1:	2685 Iris St				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 3S4				
Site Country:	Canada				
Co Official:	Ryan Draper				
Co Admin:	Alyson Roberts				
<u>2019 Generator Manifest</u>					
ID:	49492			Sum Received Qty:	13.0
Generator No:	ON6196387			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	030			Count Manifests:	2
Waste Char:	I			District:	402
Waste Code:	212				
<u>2019 Generator Manifest</u>					
ID:	49491			Sum Received Qty:	13.0
Generator No:	ON6196387			Waste Class Name:	INORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	148				
<u>2019 Generator Manifest</u>					
ID:	49490			Sum Received Qty:	7.0
Generator No:	ON6196387			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	030			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	145				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2019 Generator Manifest</u>					
ID:	49493			Sum Received Qty:	12.0
Generator No:	ON6196387			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	2
Waste Char:	I			District:	402
Waste Code:	331				
<u>2020 Generator Info</u>					
Gen No:	ON6196387			Choice of Contact:	CO_ADMIN
ID:	24588			Phone No Official:	(972) 409-5786 Ext.
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	451130			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		Michaels Stores, Inc.			
Gen Div:					
Gen Op Name:		3505 OTTAWA-PINECREST			
Gen Op Div:					
Site Adrs1:		2685 Iris St			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		Ottawa			
Province Out:					
Site Postal Code:		K2C 3S4			
Site Country:		Canada			
Co Official:		Ryan Draper			
Co Admin:		Alyson Roberts			
<u>2020 Generator Manifest</u>					
ID:	45993			Sum Received Qty:	4.0
Generator No:	ON6196387			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	030			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	145				
<u>2020 Generator Manifest</u>					
ID:	45996			Sum Received Qty:	9.0
Generator No:	ON6196387			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	2
Waste Char:	I			District:	402
Waste Code:	331				
<u>2020 Generator Manifest</u>					
ID:	45994			Sum Received Qty:	13.0
Generator No:	ON6196387			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	030			Count Manifests:	2
Waste Char:	I			District:	402
Waste Code:	212				
<u>2020 Generator Manifest</u>					
ID:	45995			Sum Received Qty:	11.0
Generator No:	ON6196387			Waste Class Name:	ORGANIC LABORATORY CHEMICALS
Receiver Type:	030			Count Manifests:	1

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Char: Waste Code:	L 263			District:	402
<u>2020 Generator Manifest</u>					
ID:	45997			Sum Received Qty:	3.0
Generator No:	ON6196387			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	1
Waste Char:	L			District:	402
Waste Code:	331				
<u>2020 Generator Manifest</u>					
ID:	45992			Sum Received Qty:	4.0
Generator No:	ON6196387			Waste Class Name:	ALKALINE WASTES - OTHER METALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	C			District:	402
Waste Code:	122				
<u>2021 Generator Info</u>					
Gen No:	ON6196387			Choice of Contact:	CO_ADMIN
ID:	24982			Phone No Official:	(972) 409-5786 Ext.
Contaminated Fac:	N			Phone No Admin:	8552770388 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	451130			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	Michaels Stores, Inc.				
Gen Div:					
Gen Op Name:	3505 OTTAWA-PINECREST				
Gen Op Div:					
Site Adrs1:	2685 Iris St				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2C 3S4				
Site Country:	Canada				
Co Official:	Ryan Draper				
Co Admin:	Alyson Roberts				
<u>2021 Generator Manifest</u>					
ID:	47872			Sum Received Qty:	22.0
Generator No:	ON6196387			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	030			Count Manifests:	2
Waste Char:	L			District:	402
Waste Code:	145				
<u>2021 Generator Manifest</u>					
ID:	47874			Sum Received Qty:	18.0
Generator No:	ON6196387			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	030			Count Manifests:	2
Waste Char:	I			District:	402
Waste Code:	331				
<u>2021 Generator Manifest</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
ID:	47873			Sum Received Qty:	8.0
Generator No:	ON6196387			Waste Class Name:	ALIPHATIC SOLVENTS
Receiver Type:	030			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	212				
<u>2021 Generator Manifest</u>					
ID:	47871			Sum Received Qty:	9.0
Generator No:	ON6196387			Waste Class Name:	ALKALINE WASTES - OTHER METALS
Receiver Type:	030			Count Manifests:	1
Waste Char:	C			District:	402
Waste Code:	122				
<u>71</u>	38 of 48	SW/210.5	70.9 / -0.85	LOBLAWS SUPERMARKETS LTD. #153-5 2685 IRIS STREET OTTAWA ON K2C 3S4	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:				Oper Area Code:	
Licence Type:	Vendor			Oper Phone No:	
Licence Type Code:				Operator Ext:	
Licence Class:				Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					
<u>71</u>	39 of 48	SW/210.5	70.9 / -0.85	ZELLERS INC. STORE 53 PINECREST S.C., 2685 IRIS STREET OTTAWA ON K2C 3S4	PES
Detail Licence No:				Operator Box:	
Licence No:				Operator Class:	
Status:				Operator No:	
Approval Date:				Operator Type:	
Report Source:				Oper Area Code:	
Licence Type:	Vendor			Oper Phone No:	
Licence Type Code:				Operator Ext:	
Licence Class:				Operator Lot:	
Licence Control:				Oper Concession:	
Latitude:				Operator Region:	
Longitude:				Operator District:	
Lot:				Operator County:	
Concession:				Op Municipality:	
Region:				Post Office Box:	
District:				MOE District:	
County:				SWP Area Name:	
Trade Name:					
PDF URL:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
71	40 of 48	SW/210.5	70.9 / -0.85	LOBLAWS SUPERMARKETS LTD #1153 2685 IRIS ST OTTAWA ON K2C3S4	PES
Detail Licence No: 23-01-10068-0 Licence No: 10068 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Limited Vendor Licence Type Code: 23 Licence Class: 01 Licence Control: 0 Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 613 Oper Phone No: 8283094 Operator Ext: Operator Lot: Oper Concession: Operator Region: 4 Operator District: Operator County: 15 Op Municipality: Post Office Box: MOE District: SWP Area Name:			
71	41 of 48	SW/210.5	70.9 / -0.85	LOBLAWS SUPERMARKETS LTD#1153 2685 IRIS ST OTTAWA ON K2C3S4	PES
Detail Licence No: Licence No: 10068 Status: Approval Date: Report Source: Legacy Licenses (Excluding TS) Licence Type: Retail Vendor Class 03 Licence Type Code: 21 Licence Class: 03 Licence Control: Latitude: Longitude: Lot: Concession: Region: District: County: Trade Name: PDF URL:		Operator Box: Operator Class: Operator No: Operator Type: Oper Area Code: 613 Oper Phone No: 8283094 Operator Ext: Operator Lot: Oper Concession: Operator Region: Operator District: Operator County: Op Municipality: Post Office Box: MOE District: SWP Area Name:			
71	42 of 48	SW/210.5	70.9 / -0.85	2685 Iris Street IKEA, 2685 Iris St, Ottawa OTTAWA ON	PFAS
Ref No: 1-1T6CRM Year: Incident Dt: 5/17/2022 10:30:00 AM Dt MOE Arvl on Scn: MOE Reported Dt: 5/17/2022 2:15:26 PM Dt Document Closed: 5/19/2022 1:03:06 PM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office		Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Nearest Watercourse:					
Site Name:		2685 Iris Street			
Site Address:		IKEA, 2685 Iris St, Ottawa			
Site Region:					
Site Municipality:		OTTAWA			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Incident Cause:					
Incident Preceding Spill:		Other (specify)			
Environment Impact:		0 No Impact			
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:		264 kilogram (kg)			
Contaminant Qty 1:					
Contaminant Unit:					
Client Type:		Private Business			
Source Type:		Valve/Fitting/Piping			
Contaminant Code:					
Contaminant Name:		1,1,1,2-TETRAFLUOROETHANE			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:		Air			
Incident Reason:		Improper operation			
Incident Summary:		TSSA BPV: 264kg R134A Refrigerant Leak, Ikea Ottawa			
Activity Preceding Spill:		Normal operations			
Property 2nd Watershed:		Lower Ottawa			
Property Tertiary Watershed:		02KE - Lower Madawaska			
Sector Type:		DEPARTMENT STORES			
SAC Action Class:		Ozone Depleting Substances			
Call Report Locatn Geodata:		{ "integration_ids": ["PR00003890121"], "wks": ["POINT (-75.7839393000 45.3504100000)"], "creation_date": "2022-05-17" }			
Time Reported:					
System Facility Address:		2685 IRIS ST, OTTAWA, ON K2C 3S4			
Client Name:		IKEA CANADA			

71	43 of 48	SW/210.5	70.9 / -0.85	PRIVATE BUSINESS 2685 IRIS ST. PINECREST SHOPPING CENTRE (N.O.S.) OTTAWA CITY ON K2C 3S4	SPL
Ref No:	226643			Municipality No:	20107
Year:				Nature of Damage:	
Incident Dt:	5/28/2002			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	5/29/2002			Impact to Health:	
Dt Document Closed:				Agency Involved:	
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Map Datum: Northings: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: OTHER CONTAINER LEAK Incident Preceding Spill: Incident Reason: EQUIPMENT FAILURE Incident Summary: TARMASEAL CONSTR: SPILL OF HYDRAULIC FLUID TO PARKING LOT. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Multi Media Pollution Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					

71	44 of 48	SW/210.5	70.9 / -0.85	Enbridge Gas Distribution Inc. 2685 Iris Street Ottawa ON K2C 3S4	SPL
Ref No: 3023-7YETPT Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: 12/4/2009 Dt Document Closed: 12/8/2009 Site No: MOE Response: Referral to others Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Pinecrest Shopping Centre<UNOFFICIAL> Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northings: Easting: Entity Operating Name: Client Name: Enbridge Gas Distribution Inc. Client Type: Source Type: Incident Cause: Unknown Incident Preceding Spill:					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Reason:		Equipment Failure - Malfunction of system components			
Incident Summary:		TSSA FSB: gas release to mall.			
Environment Impact:		Not Anticipated			
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:		10 min (duration)			
Contaminant Qty 1:		10			
Contaminant Unit:		min (duration)			
Contaminant Code:		35			
Contaminant Name:		NATURAL GAS (METHANE)			
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:					
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:					
SAC Action Class:		TSSA - Fuel Safety Branch			
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
71	46 of 48	SW/210.5	70.9 / -0.85	2685 Iris St (Hwy 417 and Pinecrest) Ottawa ON	SPL
Ref No: 3873-BD3KQM Year: Incident Dt: 6/12/2019 Dt MOE Arvl on Scn: MOE Reported Dt: 6/12/2019 Dt Document Closed: Site No: NA MOE Response: No Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: spill<UNOFFICIAL> Site Address: 2685 Iris St (Hwy 417 and Pinecrest) Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: 5022235 Easting: 438078 Entity Operating Name: Client Name: Client Type: Source Type: Truck - Only Saddle Tanks Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Material Failure - Poor Design/Substandard Material Incident Summary: Ainsley Haulage - 15-20 L diesel to grass Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Communal SAC Action Class: Land Spills					
				Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 3 - Minor Health Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Call Report Locatn Geodata: Time Reported: System Facility Address:					
71	47 of 48	SW/210.5	70.9 / -0.85	KIEWIT EUROVIA VINCI OTTAWA PARTERSHIP 2685 Iris St, Ottawa, ON K2C 3S4 OTTAWA ON	SPL
Ref No: 1-17H6MR Year: Incident Dt: 8/30/2021 4:00:51 PM Dt MOE Arvl on Scn: MOE Reported Dt: 8/31/2021 10:10:48 AM Dt Document Closed: 11/9/2021 2:28:38 PM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 2685 Iris St, Ottawa, ON K2C 3S4 Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: KIEWIT EUROVIA VINCI OTTAWA PARTERSHIP Client Type: Private Business Source Type: Container/Drum/Tote Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Human error (Specify) Incident Summary: KEV: ~ 3 L of oil to gravel, cntd and clnd Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 3 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: OIL (PETROLEUM BASED, NOT SPECIFIED) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Normal operations Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: ENGINEERING SERVICES SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004334924"],"wks":["POINT (-75.7895426743 45.3508666936)"],"creation_date":"2021-08-31"} Time Reported: System Facility Address:					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
71	48 of 48	SW/210.5	70.9 / -0.85	2685 Iris Street IKEA, 2685 Iris St, Ottawa OTTAWA ON	SPL
Ref No: 1-1T6CRM Year: Incident Dt: 5/17/2022 10:30:00 AM Dt MOE Arvl on Scn: MOE Reported Dt: 5/17/2022 2:15:26 PM Dt Document Closed: 5/19/2022 1:03:06 PM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: 2685 Iris Street Site Address: IKEA, 2685 Iris St, Ottawa Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: IKEA CANADA Client Type: Private Business Source Type: Valve/Fitting/Piping Incident Cause: Incident Preceding Spill: Other (specify) Incident Reason: Improper operation Incident Summary: TSSA BPV: 264kg R134A Refrigerant Leak, Ikea Ottawa Environment Impact: 0 No Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 264 kilogram (kg) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: 1,1,1,2-TETRAFLUOROETHANE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Air Activity Preceding Spill: Normal operations Property 2nd Watershed: Lower Ottawa Property Tertiary Watershed: 02KE - Lower Madawaska Sector Type: DEPARTMENT STORES SAC Action Class: Ozone Depleting Substances Call Report Locatn Geodata: {"integration_ids":["PR00003890121"],"wks":["POINT (-75.7839393000 45.3504100000)"],"creation_date":"2022-05-17"} Time Reported: System Facility Address: 2685 IRIS ST, OTTAWA, ON K2C 3S4 Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:					
72	1 of 1	SW/213.3	70.9 / -0.85	2685 Iris St Ottawa ON K2C 3S4	EHS
Order No: 24032500148 Status: C Report Type: Custom Report Report Date: 28-MAR-24 Date Received: 25-MAR-24 Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.78491066					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
73	3 of 42	N/229.1	68.9 / -2.85	CITY OF OTTAWA (OC TRANSP) 2550 QUEENSVIEW DR OTTAWA ON	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	11229686	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	74686	Facility Location:	
Instance Type:	FS Piping	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			
TSSAMax Hazard Rank 1:			
TSSA Risk Based Periodic Yn:			
TSSA Volume of Directives:			
TSSA Periodic Exempt:			
TSSA Statutory Interval:			
TSSA Recd Insp Interva:			
TSSA Recd Tolerance:			
TSSA Program Area:			
TSSA Program Area 2:			
Description:	FS Piping		
Original Source:	EXP		
Record Date:	Up to Mar 2012		

73	4 of 42	N/229.1	68.9 / -2.85	CITY OF OTTAWA (OC TRANSP) 2550 QUEENSVIEW DR OTTAWA ON	DTNK

Delisted Expired Fuel Safety
Facilities

Instance No:	11229649	Expired Date:	
Status:	EXPIRED	Max Hazard Rank:	
Instance ID:	74853	Facility Location:	
Instance Type:	FS Piping	Facility Type:	
Instance Creation Dt:		Fuel Type 2:	
Instance Install Dt:		Fuel Type 3:	
Item Description:		Panam Related:	
Manufacturer:		Panam Venue Nm:	
Model:		External Identifier:	
Serial No:		Item:	
ULC Standard:		Piping Steel:	
Quantity:		Piping Galvanized:	
Unit of Measure:		Tank Single Wall St:	
Overfill Prot Type:		Piping Underground:	
Creation Date:		Tank Underground:	
Next Periodic Str DT:		Source:	
TSSA Base Sched Cycle 2:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
TSSAMax Hazard Rank 1: TSSA Risk Based Periodic Yn: TSSA Volume of Directives: TSSA Periodic Exempt: TSSA Statutory Interval: TSSA Recd Insp Interva: TSSA Recd Tolerance: TSSA Program Area: TSSA Program Area 2: Description: Original Source: Record Date:					
		FS Piping EXP Up to Mar 2012			
73	5 of 42	N/229.1	68.9 / -2.85	OC Transpo 2550 Queensview Dr. Ottawa Ontario Ottawa ON	EBR
EBR Registry No: IT03E0050 Ministry Ref No: 2003-000054 Notice Type: Instrument Decision Notice Stage: Notice Date: April 03, 2003 Proposal Date: February 28, 2003 Year: 2003 Instrument Type: Off Instrument Name: Posted By: Company Name: OC Transpo Site Address: Location Other: Proponent Name: Proponent Address: 1500 St. Laurent Blvd., Ottawa Ontario, K1G 0Z8 Comment Period: URL: Summary: Site Location Details: 2550 Queensview Dr. Ottawa Ontario Ottawa					
				Decision Posted: Exception Posted: Section: Act 1: Act 2: Site Location Map:	
73	6 of 42	N/229.1	68.9 / -2.85	City of Ottawa 2550 Queensview Drive Ottawa ON K1G 0Z8	ECA
Approval No: 8064-5NUPCU Approval Date: 2005-10-19 Status: Approved Record Type: ECA Link Source: IDS SWP Area Name: Rideau Valley Approval Type: ECA-AIR Project Type: AIR Business Name: City of Ottawa Address: 2550 Queensview Drive Full Address: Full PDF Link: https://www.accessenvironment.ene.gov.on.ca/instruments/3774-5KKQ54-14.pdf PDF Site Location:					
				MOE District: Ottawa City: Longitude: -75.781296 Latitude: 45.355804 Geometry X: Geometry Y:	
73	7 of 42	N/229.1	68.9 / -2.85	CITY OF OTTAWA OC TRANSP 2550 QUEENSVIEW DR	EXP

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OTTAWA ON					
Inventory No:	11229629			Tank Material:	Steel
Inventory Status:	EXPIRED			Corrosion Protect:	Impressed Current
Installation Year:	1975			Overfill Protection:	
Capacity:	45460			Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		UNDERGROUND TANK			
Previous Fuel Type:		Diesel			
73	8 of 42	N/229.1	68.9 / -2.85	CITY OF OTTAWA OC TRANSP 2550 QUEENSVIEW DR OTTAWA ON	EXP
Inventory No:	11229668			Tank Material:	Steel
Inventory Status:	EXPIRED			Corrosion Protect:	Impressed Current
Installation Year:	1975			Overfill Protection:	
Capacity:	45460			Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		UNDERGROUND TANK			
Previous Fuel Type:		Diesel			
73	9 of 42	N/229.1	68.9 / -2.85	CITY OF OTTAWA OC TRANSP 2550 QUEENSVIEW DR OTTAWA ON	FST
Inventory No:	11093253			Tank Material:	Fiberglass (FRP)
Inventory Status:	Active			Corrosion Protect:	Fiberglass
Installation Year:				Overfill Protection:	
Capacity:				Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		UNDERGROUND TANK			
73	10 of 42	N/229.1	68.9 / -2.85	CITY OF OTTAWA OC TRANSP 2550 QUEENSVIEW DR OTTAWA ON	FST
Inventory No:	11093227			Tank Material:	Fiberglass (FRP)
Inventory Status:	Active			Corrosion Protect:	Fiberglass
Installation Year:				Overfill Protection:	
Capacity:				Inventory Context:	FS Liquid Fuel Tank
Capacity Unit:				Inventory Item:	FS LIQUID FUEL TANK
Tank Type:					
Manufacturer:					
Model:					
Description:		UNDERGROUND TANK			
73	11 of 42	N/229.1	68.9 / -2.85	CITY OF OTTAWA OC TRANSP 2550 QUEENSVIEW DR	FST

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OTTAWA ON					
Inventory No: Inventory Status: Installation Year: Capacity: Capacity Unit: Tank Type: Manufacturer: Model: Description:	11093266 Active			Tank Material: Corrosion Protect: Overfill Protection: Inventory Context: Inventory Item:	Steel Impressed Current FS Liquid Fuel Tank FS LIQUID FUEL TANK
	UNDERGROUND TANK				
73	12 of 42	N/229.1	68.9 / -2.85	CITY OF OTTAWA (OC TRANSP) 2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	FSTH
License Issue Date: Tank Status: Tank Status As Of: Operation Type: Facility Type:	1/30/1992 Licensed August 2007 Private Fuel Outlet Gasoline Station - Self Serve				
--Details--					
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:	Active 1991 44500 Liquid Fuel Single Wall UST - Diesel				
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:	Active 1991 44500 Liquid Fuel Single Wall UST - Diesel				
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:	Active 1991 44500 Liquid Fuel Single Wall UST - Diesel				
73	13 of 42	N/229.1	68.9 / -2.85	CITY OF OTTAWA (OC TRANSP) 2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	FSTH
License Issue Date: Tank Status: Tank Status As Of: Operation Type: Facility Type:	1/30/1992 Licensed December 2008 Private Fuel Outlet Gasoline Station - Self Serve				
--Details--					
Status: Year of Installation: Corrosion Protection: Capacity: Tank Fuel Type:	Active 1991 44500 Liquid Fuel Single Wall UST - Diesel				
Status: Year of Installation:	Active 1991				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Corrosion Protection: Capacity: 44500 Tank Fuel Type: Liquid Fuel Single Wall UST - Diesel Status: Active Year of Installation: 1991 Corrosion Protection: Capacity: 44500 Tank Fuel Type: Liquid Fuel Single Wall UST - Diesel					
73	14 of 42	N/229.1	68.9 / -2.85	OTTAWA-CARLETON REG. TRANSIT COMM. 2550 QUEENSVIEW DRIVE OTTAWA ON K2B 8H6	GEN
<u>Generator Info</u>					
Generator No:	ON0133303			Choice of Contact:	
Approval Years:	88,89,92,93,97			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	4571
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	URBAN TRANSIT SYS.				
<u>Waste Detail(s)</u>					
Waste Class:	251				
Waste Class Name:	OIL SKIMMINGS & SLUDGES				
<u>Waste Detail(s)</u>					
Waste Class:	252				
Waste Class Name:	WASTE OILS & LUBRICANTS				
<u>Waste Detail(s)</u>					
Waste Class:	145				
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES				
<u>Waste Detail(s)</u>					
Waste Class:	211				
Waste Class Name:	AROMATIC SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	212				
Waste Class Name:	ALIPHATIC SOLVENTS				
<u>Waste Detail(s)</u>					
Waste Class:	213				
Waste Class Name:	PETROLEUM DISTILLATES				
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
73	15 of 42	N/229.1	68.9 / -2.85	OTTAWA-CARLETON REG. TRANSIT COMM. 2550 QUEENSVIEW DRIVE C/O 1500 ST. LAURENT BLVD. OTTAWA ON K2B 8H6	GEN
<u>Generator Info</u>					
Generator No:	ON0133303			Choice of Contact:	
Approval Years:	90			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	4571
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		URBAN TRANSIT SYS.			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
73	16 of 42	N/229.1	68.9 / -2.85	OTTAWA-CARLETON REG. TRANSIT COMM.29-265 2550 QUEENSVIEW DRIVE C/O 1500 ST. LAURENT BLVD. OTTAWA ON K2B 8H6	GEN

Generator Info

Generator No:	ON0133303	Choice of Contact:	
Approval Years:	94,95,96	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	4571
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	URBAN TRANSIT SYS.		

Waste Detail(s)

Waste Class:	211
Waste Class Name:	AROMATIC SOLVENTS

Waste Detail(s)

Waste Class:	122
Waste Class Name:	ALKALINE WASTES - OTHER METALS

Waste Detail(s)

Waste Class:	145
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class:	221
Waste Class Name:	LIGHT FUELS

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
73	17 of 42	N/229.1	68.9 / -2.85	OTTAWA-CARLETON REG. TRANSIT COMMISSION 2550 QUEENSVIEW DRIVE OTTAWA ON K2B 8H6	GEN
<u>Generator Info</u>					
Generator No:	ON0133303			Choice of Contact:	
Approval Years:	98,99,00			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	4571
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		URBAN TRANSIT SYS.			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
73	18 of 42	N/229.1	68.9 / -2.85	OC TRANSP 2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	GEN

Generator Info

Generator No:	ON0133303	Choice of Contact:	
Approval Years:	01	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	4571
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	URBAN TRANSIT SYS.		

Waste Detail(s)

Waste Class:	213
Waste Class Name:	PETROLEUM DISTILLATES

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class:	211
Waste Class Name:	AROMATIC SOLVENTS

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class:	221
Waste Class Name:	LIGHT FUELS

Waste Detail(s)

Waste Class:	251
Waste Class Name:	OIL SKIMMINGS & SLUDGES

Waste Detail(s)

Waste Class:	113
Waste Class Name:	ACID WASTE - OTHER METALS

Waste Detail(s)

Waste Class:	145
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
73	19 of 42	N/229.1	68.9 / -2.85	City of Ottawa, OC Transpo 2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	GEN
<u>Generator Info</u>					
Generator No:		ON0133303		Choice of Contact:	
Approval Years:		02,03,04,05,06,07,08		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:		211			
Waste Class Name:		AROMATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		131			
Waste Class Name:		NEUTRALIZED WASTES - HEAVY METALS			
<u>Waste Detail(s)</u>					
Waste Class:		113			
Waste Class Name:		ACID WASTE - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			

73	20 of 42	N/229.1	68.9 / -2.85	City of Ottawa, OC Transpo 2550 QUEENSVIEW ROAD OTTAWA ON	GEN

Generator Info

Generator No:	ON0133303	Choice of Contact:	
Approval Years:	2009	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	485110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Urban Transit Systems		

Waste Detail(s)

Waste Class:	145
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES

Waste Detail(s)

Waste Class:	146
Waste Class Name:	OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
73	21 of 42	N/229.1	68.9 / -2.85	City of Ottawa, OC Transpo 2550 QUEENSVIEW ROAD OTTAWA ON	GEN
<u>Generator Info</u>					
Generator No:	ON0133303			Choice of Contact:	
Approval Years:	2010			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	485110
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:		Urban Transit Systems			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		212			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
73	22 of 42	N/229.1	68.9 / -2.85	City of Ottawa, OC Transpo 2550 QUEENSVIEW ROAD OTTAWA ON	GEN

Generator Info

Generator No:	ON0133303	Choice of Contact:	
Approval Years:	2011	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	485110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:	Urban Transit Systems		

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

Waste Detail(s)

Waste Class:	331
Waste Class Name:	WASTE COMPRESSED GASES

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			

73

23 of 42

N/229.1

68.9 / -2.85

City of Ottawa, OC Transpo
2550 QUEENSVIEW ROAD
OTTAWA ON K2B 8H6

GEN

Generator Info

Generator No: ON0133303

Approval Years: 2012

Status:

PO Box No:

Country:

Co Admin:

Phone No Admin:

SIC Description: Urban Transit Systems

Choice of Contact:

Contaminated Fac:

MHSW Facility:

SIC Code: 485110

Waste Detail(s)

Waste Class: 212

Waste Class Name: ALIPHATIC SOLVENTS

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>73</u>	24 of 42	N/229.1	68.9 / -2.85	City of Ottawa, OC Transpo 2550 QUEENSVIEW ROAD OTTAWA ON	GEN

Generator Info

Generator No:	ON0133303	Choice of Contact:	
Approval Years:	2013	Contaminated Fac:	
Status:		MHSW Facility:	
PO Box No:		SIC Code:	485110
Country:			
Co Admin:			
Phone No Admin:			
SIC Description:			

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			

[73](#)

25 of 42

N/229.1

68.9 / -2.85

City of Ottawa, OC Transpo
2550 QUEENSVIEW ROAD
OTTAWA ON K2B 8H6

GEN

Generator Info

Generator No: ON0133303
Approval Years: 2016
Status:
PO Box No:
Country: Canada
Co Admin:

Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No
SIC Code: 485110

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Phone No Admin:					
SIC Description:		485110			
 <u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
 <u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
 <u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
 <u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
 <u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
 <u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
 <u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
 <u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
 <u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
73	26 of 42	N/229.1	68.9 / -2.85	City of Ottawa, OC Transpo 2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	GEN

Generator Info

Generator No:	ON0133303	Choice of Contact:	CO_OFFICIAL
Approval Years:	2015	Contaminated Fac:	No

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Status: PO Box No: Country: Co Admin: Phone No Admin: SIC Description:		Canada		MHSW Facility: SIC Code:	No 485110
		485110			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
73	27 of 42	N/229.1	68.9 / -2.85	City of Ottawa, OC Transpo 2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON0133303			Choice of Contact:	CO_OFFICIAL
Approval Years:	2014			Contaminated Fac:	No
Status:				MHSW Facility:	No
PO Box No:				SIC Code:	485110
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:		485110			
<u>Waste Detail(s)</u>					
Waste Class:		145			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		212			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		221			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		252			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		331			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		122			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		146			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		251			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
73	28 of 42	N/229.1	68.9 / -2.85	City of Ottawa, OC Transpo 2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	GEN

Generator Info

Generator No:	ON0133303	Choice of Contact:
Approval Years:	As of Dec 2018	Contaminated Fac:
Status:	Registered	MHSW Facility:
PO Box No:		SIC Code:
Country:	Canada	
Co Admin:		
Phone No Admin:		
SIC Description:		

Waste Detail(s)

Waste Class: 145 I
Waste Class Name: Wastes from the use of pigments, coatings and paints

Waste Detail(s)

Waste Class: 146 T
Waste Class Name: Other specified inorganic sludges, slurries or solids

Waste Detail(s)

Waste Class: 122 C
Waste Class Name: Alkaline slutions - containing other metals and non-metals (not cyanide)

Waste Detail(s)

Waste Class: 212 L
Waste Class Name: Aliphatic solvents and residues

Waste Detail(s)

Waste Class: 221 I
Waste Class Name: Light fuels

Waste Detail(s)

Waste Class: 213 I
Waste Class Name: Petroleum distillates

Waste Detail(s)

Waste Class: 331 I
Waste Class Name: Waste compressed gases including cylinders

Waste Detail(s)

Waste Class: 241 H
Waste Class Name: Halogenated solvents and residues

Waste Detail(s)

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class: 251 L Waste Class Name: Waste oils/sludges (petroleum based) Waste Detail(s) Waste Class: 252 I Waste Class Name: Waste crankcase oils and lubricants Waste Detail(s) Waste Class: 252 L Waste Class Name: Waste crankcase oils and lubricants					
73	29 of 42	N/229.1	68.9 / -2.85	City of Ottawa, OC Transpo 2550 QUEENSVIEW ROAD OTTAWA ON K2B 8H6	GEN
Generator Info Generator No: ON0133303 Approval Years: As of Jul 2020 Status: Registered PO Box No: Country: Canada Co Admin: Phone No Admin: SIC Description: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code:					
Waste Detail(s) Waste Class: 241 H Waste Class Name: Halogenated solvents and residues Waste Detail(s) Waste Class: 122 C Waste Class Name: Alkaline slutions - containing other metals and non-metals (not cyanide) Waste Detail(s) Waste Class: 252 L Waste Class Name: Waste crankcase oils and lubricants Waste Detail(s) Waste Class: 331 I Waste Class Name: Waste compressed gases including cylinders Waste Detail(s) Waste Class: 212 L Waste Class Name: Aliphatic solvents and residues Waste Detail(s)					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		221 I			
Waste Class Name:		Light fuels			
<u>Waste Detail(s)</u>					
Waste Class:		213 I			
Waste Class Name:		Petroleum distillates			
<u>Waste Detail(s)</u>					
Waste Class:		252 I			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			

[73](#)

30 of 42

N/229.1

68.9 / -2.85

City of Ottawa, OC Transpo
2550 QUEENSVIEW ROAD
OTTAWA ON K2B 8H6

GEN

Generator Info

Generator No: ON0133303
Approval Years: As of Nov 2021
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Waste Detail(s)

Waste Class: 252 L
Waste Class Name: Waste crankcase oils and lubricants

Waste Detail(s)

Waste Class: 213 I
Waste Class Name: Petroleum distillates

Waste Detail(s)

Waste Class: 241 H

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class Name:		Halogenated solvents and residues			
<u>Waste Detail(s)</u>					
Waste Class:		221 I			
Waste Class Name:		Light fuels			
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		Alkaline slutions - containing other metals and non-metals (not cyanide)			
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		Other specified inorganic sludges, slurries or solids			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		Waste compressed gases including cylinders			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		Waste oils/sludges (petroleum based)			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		Wastes from the use of pigments, coatings and paints			
<u>Waste Detail(s)</u>					
Waste Class:		252 I			
Waste Class Name:		Waste crankcase oils and lubricants			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		Aliphatic solvents and residues			

[73](#)

31 of 42

N/229.1

68.9 / -2.85

OC Transpo
2550 QUEENSVIEW ROAD
OTTAWA ON

GEN

Generator Info

Generator No: ON0133303
Approval Years: As of Oct 2022
Status: Registered
PO Box No:
Country: Canada
Co Admin:
Phone No Admin:
SIC Description:

Choice of Contact:
Contaminated Fac:
MHSW Facility:
SIC Code:

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Waste Detail(s)</u>					
Waste Class:		146 T			
Waste Class Name:		OTHER SPECIFIED INORGANICS			
<u>Waste Detail(s)</u>					
Waste Class:		251 L			
Waste Class Name:		OIL SKIMMINGS & SLUDGES			
<u>Waste Detail(s)</u>					
Waste Class:		331 I			
Waste Class Name:		WASTE COMPRESSED GASES			
<u>Waste Detail(s)</u>					
Waste Class:		241 H			
Waste Class Name:		HALOGENATED SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		212 L			
Waste Class Name:		ALIPHATIC SOLVENTS			
<u>Waste Detail(s)</u>					
Waste Class:		221 I			
Waste Class Name:		LIGHT FUELS			
<u>Waste Detail(s)</u>					
Waste Class:		252 I			
Waste Class Name:		WASTE OILS & LUBRICANTS			
<u>Waste Detail(s)</u>					
Waste Class:		122 C			
Waste Class Name:		ALKALINE WASTES - OTHER METALS			
<u>Waste Detail(s)</u>					
Waste Class:		213 I			
Waste Class Name:		PETROLEUM DISTILLATES			
<u>Waste Detail(s)</u>					
Waste Class:		145 I			
Waste Class Name:		PAINT/PIGMENT/COATING RESIDUES			
<u>Waste Detail(s)</u>					
Waste Class:		252 L			
Waste Class Name:		WASTE OILS & LUBRICANTS			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info (as of Dec 2024)</u>					
Generator No:	ON0133303				
Generator Company Name:	OC Transpo				
Street:	2550 QUEENSVIEW ROAD				
City:	OTTAWA				
Province State:	Ontario				
Country:	Canada				
Postal Code:	K2B8H6				
Waste Class:	122 C,146 T,331 I,212 L,213 I,221 I,251 L,252 L,145 I,241 H,252 I				
Waste Class Decoded:					
122 - ALKALINE WASTES - OTHER METALS; 146 - OTHER SPECIFIED INORGANICS; 331 - WASTE COMPRESSED GASES; 212 - ALIPHATIC SOLVENTS; 213 - PETROLEUM DISTILLATES; 221 - LIGHT FUELS; 251 - OIL SKIMMINGS & SLUDGES; 252 - WASTE OILS & LUBRICANTS; 145 - PAINT/PIGMENT/COATING RESIDUES; 241 - HALOGENATED SOLVENTS; 252 - WASTE OILS & LUBRICANTS					
<u>Generator Info (as of Apr 2025)</u>					
Generator Company Name:	OC Transpo				
Generator Site Address:	2550 QUEENSVIEW ROAD				
City:	OTTAWA				
Province State:	Ontario				
Country:	Canada				
Postal Code:	K2B8H6				
Waste Class:	122 C, 146 T, 331 I, 212 L, 213 I, 221 I, 251 L, 252 L, 145 I, 241 H, 252 I				
Waste Class Decoded:					
122 - ALKALINE WASTES - OTHER METALS; 146 - OTHER SPECIFIED INORGANICS; 331 - WASTE COMPRESSED GASES; 212 - ALIPHATIC SOLVENTS; 213 - PETROLEUM DISTILLATES; 221 - LIGHT FUELS; 251 - OIL SKIMMINGS & SLUDGES; 252 - WASTE OILS & LUBRICANTS; 145 - PAINT/PIGMENT/COATING RESIDUES; 241 - HALOGENATED SOLVENTS; 252 - WASTE OILS & LUBRICANTS					
Waste Characteristic Decoded:					
C - Corrosive; T - Leachate Toxic; I - Ignitable; L - Liquid Industrial Waste; I - Ignitable; I - Ignitable; L - Liquid Industrial Waste; L - Liquid Industrial Waste; I - Ignitable; H - Hazardous Industrial Waste; I - Ignitable					
<u>2017 Generator Info</u>					
Gen No:	ON0133303	Choice of Contact:	CO_OFFICIAL		
ID:	1575	Phone No Official:	613-580-2424 Ext.52434		
Contaminated Fac:	N	Phone No Admin:			
MHSW Facility:	N	County Ont:	OTTAWA CARLTON (RM)		
NAICS Code1:	485110	County Out:			
NAICS Code2:		District:	402		
NAICS Code3:					
Gen Name:	City of Ottawa, OC Transpo				
Gen Div:					
Gen Op Name:	OC Transpo				
Gen Op Div:					
Site Adrs1:	2550 QUEENSVIEW ROAD				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	OTTAWA				
Province Out:					
Site Postal Code:	K2B 8H6				
Site Country:	Canada				
Co Official:	Collett Barbara				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Co Admin:					
<u>2017 Generator Manifest</u>					
ID:	7412			Sum Received Qty:	440.0
Generator No:	ON0133303			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	035			Count Manifests:	5
Waste Char:	I			District:	402
Waste Code:	331				
<u>2017 Generator Manifest</u>					
ID:	7409			Sum Received Qty:	410.0
Generator No:	ON0133303			Waste Class Name:	HALOGENATED SOLVENTS
Receiver Type:	035			Count Manifests:	2
Waste Char:	H			District:	402
Waste Code:	241				
<u>2017 Generator Manifest</u>					
ID:	7407			Sum Received Qty:	22034.0
Generator No:	ON0133303			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	030			Count Manifests:	9
Waste Char:	L			District:	402
Waste Code:	252				
<u>2017 Generator Manifest</u>					
ID:	7410			Sum Received Qty:	130241.0
Generator No:	ON0133303			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	15
Waste Char:	L			District:	402
Waste Code:	251				
<u>2017 Generator Manifest</u>					
ID:	7408			Sum Received Qty:	470.0
Generator No:	ON0133303			Waste Class Name:	PETROLEUM DISTILLATES
Receiver Type:	035			Count Manifests:	5
Waste Char:	I			District:	402
Waste Code:	213				
<u>2017 Generator Manifest</u>					
ID:	7411			Sum Received Qty:	500.0
Generator No:	ON0133303			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	4
Waste Char:	I			District:	402
Waste Code:	252				
<u>2018 Generator Info</u>					
Gen No:	ON0133303			Choice of Contact:	CO_OFFICIAL
ID:	1536			Phone No Official:	613-580-2424 Ext.52434
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	485110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	City of Ottawa, OC Transpo				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gen Div: Gen Op Name: OC Transpo Gen Op Div: Site Adrs1: 2550 QUEENSVIEW ROAD Site Bldg: Site Pobox: Province In: ONTARIO Site Adrs2: Site City: OTTAWA Province Out: Site Postal Code: K2B 8H6 Site Country: Canada Co Official: Collett Barbara Co Admin:					
<u>2018 Generator Manifest</u>					
ID:	7104			Sum Received Qty:	23020.0
Generator No:	ON0133303			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	030			Count Manifests:	8
Waste Char:	L			District:	402
Waste Code:	252				
<u>2018 Generator Manifest</u>					
ID:	7107			Sum Received Qty:	300.0
Generator No:	ON0133303			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	035			Count Manifests:	3
Waste Char:	I			District:	402
Waste Code:	331				
<u>2018 Generator Manifest</u>					
ID:	7105			Sum Received Qty:	176183.0
Generator No:	ON0133303			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	24
Waste Char:	L			District:	402
Waste Code:	251				
<u>2018 Generator Manifest</u>					
ID:	7106			Sum Received Qty:	1100.0
Generator No:	ON0133303			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	14
Waste Char:	I			District:	402
Waste Code:	252				
<u>2019 Generator Info</u>					
Gen No:	ON0133303			Choice of Contact:	CO_OFFICIAL
ID:	1499			Phone No Official:	613-580-2424 Ext.52434
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	485110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	City of Ottawa, OC Transpo				
Gen Div:					
Gen Op Name:	OC Transpo				
Gen Op Div:					
Site Adrs1:	2550 QUEENSVIEW ROAD				
Site Bldg:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					
Site Postal Code:		K2B 8H6			
Site Country:		Canada			
Co Official:		Collett Barbara			
Co Admin:					
<u>2019 Generator Manifest</u>					
ID:	7023			Sum Received Qty:	600.0
Generator No:	ON0133303			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	9
Waste Char:	I			District:	402
Waste Code:	252				
<u>2019 Generator Manifest</u>					
ID:	7024			Sum Received Qty:	300.0
Generator No:	ON0133303			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	035			Count Manifests:	3
Waste Char:	I			District:	402
Waste Code:	331				
<u>2019 Generator Manifest</u>					
ID:	7021			Sum Received Qty:	21627.0
Generator No:	ON0133303			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	030			Count Manifests:	8
Waste Char:	L			District:	402
Waste Code:	252				
<u>2019 Generator Manifest</u>					
ID:	7022			Sum Received Qty:	126410.0
Generator No:	ON0133303			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	17
Waste Char:	L			District:	402
Waste Code:	251				
<u>2020 Generator Info</u>					
Gen No:	ON0133303			Choice of Contact:	CO_OFFICIAL
ID:	1433			Phone No Official:	613-580-2424 Ext.52434
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	485110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:		City of Ottawa, OC Transpo			
Gen Div:					
Gen Op Name:		OC Transpo			
Gen Op Div:					
Site Adrs1:		2550 QUEENSVIEW ROAD			
Site Bldg:					
Site Pobox:					
Province In:		ONTARIO			
Site Adrs2:					
Site City:		OTTAWA			
Province Out:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Postal Code:		K2B 8H6			
Site Country:		Canada			
Co Official:		Collett Barbara			
Co Admin:					
<u>2020 Generator Manifest</u>					
ID:	6346			Sum Received Qty:	20860.0
Generator No:	ON0133303			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	030			Count Manifests:	8
Waste Char:	L			District:	402
Waste Code:	252				
<u>2020 Generator Manifest</u>					
ID:	6353			Sum Received Qty:	200.0
Generator No:	ON0133303			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	035			Count Manifests:	2
Waste Char:	I			District:	402
Waste Code:	252				
<u>2020 Generator Manifest</u>					
ID:	6347			Sum Received Qty:	20.0
Generator No:	ON0133303			Waste Class Name:	ALKALINE WASTES - OTHER METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	402
Waste Code:	122				
<u>2020 Generator Manifest</u>					
ID:	6351			Sum Received Qty:	10.0
Generator No:	ON0133303			Waste Class Name:	PETROLEUM DISTILLATES
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	213				
<u>2020 Generator Manifest</u>					
ID:	6348			Sum Received Qty:	100.0
Generator No:	ON0133303			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	035			Count Manifests:	1
Waste Char:	I			District:	402
Waste Code:	145				
<u>2020 Generator Manifest</u>					
ID:	6354			Sum Received Qty:	550.0
Generator No:	ON0133303			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	035			Count Manifests:	8
Waste Char:	I			District:	402
Waste Code:	331				
<u>2020 Generator Manifest</u>					
ID:	6352			Sum Received Qty:	82859.0
Generator No:	ON0133303			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	9
Waste Char:	L			District:	402
Waste Code:	251				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>2020 Generator Manifest</u>					
ID:	6349			Sum Received Qty:	30.0
Generator No:	ON0133303			Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES
Receiver Type:	035			Count Manifests:	1
Waste Char:	T			District:	402
Waste Code:	145				
<u>2020 Generator Manifest</u>					
ID:	6350			Sum Received Qty:	45.0
Generator No:	ON0133303			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	3
Waste Char:	T			District:	402
Waste Code:	146				
<u>2021 Generator Info</u>					
Gen No:	ON0133303			Choice of Contact:	CO_OFFICIAL
ID:	1417			Phone No Official:	613-580-2424 Ext.52434
Contaminated Fac:	N			Phone No Admin:	
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	485110			County Out:	
NAICS Code2:				District:	402
NAICS Code3:					
Gen Name:	City of Ottawa, OC Transpo				
Gen Div:					
Gen Op Name:	OC Transpo				
Gen Op Div:					
Site Adrs1:	2550 QUEENSVIEW ROAD				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	OTTAWA				
Province Out:					
Site Postal Code:	K2B 8H6				
Site Country:	Canada				
Co Official:	Collett Barbara				
Co Admin:					
<u>2021 Generator Manifest</u>					
ID:	6310			Sum Received Qty:	22782.0
Generator No:	ON0133303			Waste Class Name:	WASTE OILS & LUBRICANTS
Receiver Type:	030			Count Manifests:	10
Waste Char:	L			District:	402
Waste Code:	252				
<u>2021 Generator Manifest</u>					
ID:	6311			Sum Received Qty:	60.0
Generator No:	ON0133303			Waste Class Name:	ALKALINE WASTES - OTHER METALS
Receiver Type:	035			Count Manifests:	1
Waste Char:	C			District:	402
Waste Code:	122				
<u>2021 Generator Manifest</u>					
ID:	6314			Sum Received Qty:	200.0

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Generator No:	ON0133303			Waste Class Name:	WASTE COMPRESSED GASES
Receiver Type:	035			Count Manifests:	4
Waste Char:	I			District:	402
Waste Code:	331				
<u>2021 Generator Manifest</u>					
ID:	6312			Sum Received Qty:	50.0
Generator No:	ON0133303			Waste Class Name:	OTHER SPECIFIED INORGANICS
Receiver Type:	035			Count Manifests:	2
Waste Char:	T			District:	402
Waste Code:	146				
<u>2021 Generator Manifest</u>					
ID:	6313			Sum Received Qty:	172781.0
Generator No:	ON0133303			Waste Class Name:	OIL SKIMMINGS & SLUDGES
Receiver Type:	035			Count Manifests:	19
Waste Char:	L			District:	402
Waste Code:	251				
<u>73</u>	32 of 42	N/229.1	68.9 / -2.85	CITY OF OTTAWA OC TRANSP 2550 QUEENSVIEW DR OTTAWA ON	INC
Incident No:	1352320			Any Health Impact:	
Incident ID:				Any Enviro Impact:	
Instance No:	9884807			Service Intrap:	
Status Code:				Was Prop Damaged:	
Incident Status:	Non Mandated			Reside App. Type:	
Incident Severity:				Commer App. Type:	
Task No:				Indus App. Type:	
Attribute Category:	FS-Incident			Institut App. Type:	
Context:				Depth Ground Cover:	
Date of Occurrence:	3/10/2014			Operation Pressure:	
Time of Occurrence:				Equipment Type:	
Occr Insp Start Dt:				Equipment Model:	
Incident Creat On:	3/11/2014			Serial No:	
Instance Creat Dt:				Cylinder Capacity:	
Instance Install Dt:				Cylinder Cap Units:	
Approx Quant Rel:				Cylinder Mat Type:	
Tank Capacity:				Pump Flow Rate Cap:	
Fuels Occur Type:	Liquid Petroleum Spill			Contam. Migrated:	
Occur Type Rpt:	Leak			Near Body of Water:	
Occur Category:				Drainage System:	
Fuel Type Involved:	Diesel			Sub Surface Contam:	
Fuel Type Reported:	Transportation Fuel			Tank Material Type:	
Enforcement Policy:				Tank Storage Type:	
Prc Escalation Req:				Tank Location Type:	
Item:					
Item Description:					
Device Installed Location:					
Venting Type:					
Vent Conn Mater:					
Vent Chimney Mater:					
Pipeline Type:					
Pipeline Involved:					
Pipe Material:					
Regulator Location:					
Regulator Type:					
Liquid Prop Make:					
Liquid Prop Model:					
Liquid Prop Serial No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Liquid Prop Notes: Inventory Address: 2550 QUEENSVIEW DR Invent Postal Code: K2B 8H6 Notes: Contact Natural Env: Aff Prop Use Water: Occurrence Narrative: NOZZEL FAILED AT PFO BUS GARAGE Operation Type Involved: Private Fuel Outlet					
73	33 of 42	N/229.1	68.9 / -2.85	OC TRANSP 2550 Queensview Drive Ottawa ON K2B8H6	NPRI
NPRI ID: 8800000090 Other ID: No Other ID: Track ID: Report ID: Report Type: Rpt Type ID: Report Year: 2003 Not-Current Rpt?: Yr of Last Filed Rpt: Fac ID: Fac Name: PINECREST GARAGE Fac Address1: Fac Address2: Fac Postal Zip: Facility Lat: Facility Long: DLS (Last Filed Rpt): Facility DLS: Datum: Facility Cmnts: URL: No of Empl.: 50 Parent Co.: No Parent Co.: Pollut Prev Cmnts: Stacks: No of Stacks: Canadian SIC Code (2 digit): Canadian SIC Code: SIC Code Description: American SIC Code: NAICS Code (2 digit): 48-49 NAICS 2 Description: Transportation and Warehousing NAICS Code (4 digit): 4851 NAICS 4 Description: Urban Transit Systems NAICS Code (6 digit): 485110 NAICS 6 Description: Urban Transit Systems					
Org ID: Submit Date: Last Modified: Contact ID: Cont Type: MED Contact Title: Cont First Name: Cont Last Name: Contact Position: Contact Fax: Contact Ph.: Cont Area Code: Contact Tel.: Contact Ext.: Cont Fax Area Cde: Contact Fax: Contact Email: Latitude: Longitude: UTM Zone: UTM Northing: UTM Easting: Waste Streams: No Streams: Waste Off Sites: No Off Sites: Shutdown: No of Shutdown:					
<u>Substance Release Report</u>					
CAS No: NA - M10 Report ID: Rpt Period: 2003 Subst Released: PM2.5 - Particulate Matter <= 2.5 Microns Air: Water: Land: Total Releases: Units: tonnes					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
CAS No:		NA - M16			
Report ID:					
Rpt Period:		2003			
Subst Released:		Volatile Organic Compounds (VOCs)			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		NA - M09			
Report ID:					
Rpt Period:		2003			
Subst Released:		PM10 - Particulate Matter <= 10 Microns			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		630-08-0			
Report ID:					
Rpt Period:		2003			
Subst Released:		Carbon monoxide			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		811-97-2			
Report ID:					
Rpt Period:		2003			
Subst Released:		HFC-134a Hydrofluorocarbon			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		NA - M08			
Report ID:					
Rpt Period:		2003			
Subst Released:		PM - Total Particulate Matter			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		10024-97-2			
Report ID:					
Rpt Period:		2003			
Subst Released:		Nitrous oxide			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		7446-09-5			
Report ID:					
Rpt Period:		2003			
Subst Released:		Sulphur dioxide			
Air:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Water: Land: Total Releases: Units: tonnes CAS No: 74-82-8 Report ID: Rpt Period: 2003 Subst Released: Methane Air: Water: Land: Total Releases: Units: tonnes CAS No: 11104-93-1 Report ID: Rpt Period: 2003 Subst Released: Nitrogen oxides (expressed as NO2) Air: Water: Land: Total Releases: Units: tonnes CAS No: 124-38-9 Report ID: Rpt Period: 2003 Subst Released: Carbon dioxide Air: Water: Land: Total Releases: Units: tonnes					
73	34 of 42	N/229.1	68.9 / -2.85	OC TRANSP 2550 Queensview Drive Ottawa ON K2B8H6	NPRI
NPRI ID: 8800002006 Other ID: No Other ID: Track ID: Report ID: Report Type: Rpt Type ID: Report Year: 2004 Not-Current Rpt?: Yr of Last Filed Rpt: Fac ID: Fac Name: PINECREST GARAGE Fac Address1: Fac Address2: Fac Postal Zip: Facility Lat: Facility Long: DLS (Last Filed Rpt): Facility DLS: Datum: Facility Cmnts: URL: No of Empl.: 50 Parent Co.: No Parent Co.: Pollut Prev Cmnts:					
Org ID: Submit Date: Last Modified: Contact ID: Cont Type: MED Contact Title: Cont First Name: Cont Last Name: Contact Position: Contact Fax: Contact Ph.: Cont Area Code: Contact Tel.: Contact Ext.: Cont Fax Area Cde: Contact Fax: Contact Email: Latitude: Longitude: UTM Zone: UTM Northing: UTM Easting: Waste Streams: No Streams: Waste Off Sites: No Off Sites:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Stacks:				Shutdown:	
No of Stacks:				No of Shutdown:	
Canadian SIC Code (2 digit):					
Canadian SIC Code:					
SIC Code Description:					
American SIC Code:					
NAICS Code (2 digit):				48-49	
NAICS 2 Description:				Transportation and Warehousing	
NAICS Code (4 digit):				4851	
NAICS 4 Description:				Urban Transit Systems	
NAICS Code (6 digit):				485110	
NAICS 6 Description:				Urban Transit Systems	
<u>Substance Release Report</u>					
CAS No:		11104-93-1			
Report ID:					
Rpt Period:		2004			
Subst Released:		Nitrogen oxides (expressed as NO2)			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		630-08-0			
Report ID:					
Rpt Period:		2004			
Subst Released:		Carbon monoxide			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		NA - M08			
Report ID:					
Rpt Period:		2004			
Subst Released:		PM - Total Particulate Matter			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		124-38-9			
Report ID:					
Rpt Period:		2004			
Subst Released:		Carbon dioxide			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			
CAS No:		NA - M09			
Report ID:					
Rpt Period:		2004			
Subst Released:		PM10 - Particulate Matter <= 10 Microns			
Air:					
Water:					
Land:					
Total Releases:					
Units:		tonnes			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
CAS No: Report ID: Rpt Period: Subst Released: Air: Water: Land: Total Releases: Units:		10024-97-2 2004 Nitrous oxide tonnes			
CAS No: Report ID: Rpt Period: Subst Released: Air: Water: Land: Total Releases: Units:		7446-09-5 2004 Sulphur dioxide tonnes			
CAS No: Report ID: Rpt Period: Subst Released: Air: Water: Land: Total Releases: Units:		74-82-8 2004 Methane tonnes			
CAS No: Report ID: Rpt Period: Subst Released: Air: Water: Land: Total Releases: Units:		NA - M16 2004 Volatile Organic Compounds (VOCs) tonnes			
CAS No: Report ID: Rpt Period: Subst Released: Air: Water: Land: Total Releases: Units:		811-97-2 2004 HFC-134a Hydrofluorocarbon tonnes			
CAS No: Report ID: Rpt Period: Subst Released: Air: Water: Land: Total Releases: Units:		NA - M10 2004 PM2.5 - Particulate Matter <= 2.5 Microns tonnes			
73	35 of 42	N/229.1	68.9 / -2.85	OTTAW CARLETON REGIONAL TRANSIT COMMISSION 2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	PRT

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Location ID:		18826			
Type:		private			
Expiry Date:					
Capacity (L):		90920.00			
Licence #:		0076343284			
73	36 of 42	N/229.1	68.9 / -2.85	OTTAWA CARLETON REGIONAL TRANSIT COMMISSION 2550 QUEENSVIEW DR OTTAWA ON K2B 8H6	PRT
Location ID:		18826			
Type:		retail			
Expiry Date:					
Capacity (L):		90920			
Licence #:		0001027643			
73	37 of 42	N/229.1	68.9 / -2.85	OTTAWA-CARLETON O-C TRANSIT DEPOT; 2550 QUEENSVIEW DR OC TRANSPO GARAGE OTTAWA CITY ON K2B 8H6	SPL
Ref No:		114162		Municipality No:	20101
Year:				Nature of Damage:	
Incident Dt:		6/6/1995		Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:		6/7/1995		Impact to Health:	
Dt Document Closed:				Agency Involved:	CITY OF OTTAWA WORKS
Site No:					
MOE Response:					
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:		OTTAWA CITY			
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:					
Incident Cause:		UNKNOWN			
Incident Preceding Spill:					
Incident Reason:		UNKNOWN			
Incident Summary:		OTTAWA-CARLETON TRANSIT- 20L ENG OIL TO GND,CATCH-BASIN,NOT SEWER.WORKS DEP			
Environment Impact:		POSSIBLE			
Health Env Consequence:					
Nature of Impact:		Water course or lake			
Contaminant Qty:					
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:					
Contaminant Limit 1:					
Contam Limit Freq 1:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant UN No 1: Receiving Medium: LAND / WATER Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:					
73	38 of 42	N/229.1	68.9 / -2.85	TRANSPORT TRUCK 2550 QUEENSVIEW DR. MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON K2B 8H6	SPL
Ref No: 163437 Year: Incident Dt: 1/5/1999 Dt MOE Arvl on Scn: MOE Reported Dt: 1/5/1999 Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: OTTAWA CITY Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: PIPE/HOSE LEAK Incident Preceding Spill: Incident Reason: WELD/SEAM FAILURE Incident Summary: TRNASPORT TRUCK - 50 L HYDRAULIC FLUID TO GROUND CLEANED. Environment Impact: POSSIBLE Health Env Consequence: Nature of Impact: Soil contamination Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: LAND Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata:					
Municipality No: 20101 Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Time Reported: System Facility Address:					
73	39 of 42	N/229.1	68.9 / -2.85	Veolia ES Canada Industrial Services Inc. 2550 Queensview Drive Ottawa ON K2B 8H6	SPL
Ref No: 4334-89CHQP Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: 9/16/2010 Dt Document Closed: 9/28/2010 Site No: MOE Response: No Field Response Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Storm Sewer<UNOFFICIAL> Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Pipe Or Hose Leak Incident Preceding Spill: Incident Reason: Equipment Failure Incident Summary: Veolia:100L oil to pavement, 50L to storm sewer Environment Impact: Not Anticipated Health Env Consequence: Nature of Impact: Contaminant Qty: 100 L Contaminant Qty 1: 100 Contaminant Unit: L Contaminant Code: 46 Contaminant Name: WASTE OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Motor Vehicle SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					
73	40 of 42	N/229.1	68.9 / -2.85	City of Ottawa 2550 Queensview Dr Ottawa ON	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Ref No:	5531-9H3VRW			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	2014/03/10			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	2014/03/10			Impact to Health:	
Dt Document Closed:	2014/10/15			Agency Involved:	
Site No:	NA				
MOE Response:	Referral to others				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:					
Nearest Watercourse:					
Site Name:	Ottawa bus fueling station<UNOFFICIAL>				
Site Address:	2550 Queensview Dr				
Site Region:					
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:	City of Ottawa				
Client Type:					
Source Type:					
Incident Cause:	Leak/Break				
Incident Preceding Spill:					
Incident Reason:	Equipment Failure				
Incident Summary:	Ottawa Bus: dsl to flr&recpt, malfnct nozzle 60L				
Environment Impact:	Not Anticipated				
Health Env Consequence:					
Nature of Impact:	Other Impact(s)				
Contaminant Qty:	60 L				
Contaminant Qty 1:	60				
Contaminant Unit:	L				
Contaminant Code:	13				
Contaminant Name:	DIESEL FUEL				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:					
Activity Preceding Spill:					
Property 2nd Watershed:					
Property Tertiary Watershed:					
Sector Type:	Service Station				
SAC Action Class:	TSSA - Fuel Safety Branch - Hydrocarbon Fuel Release/Spill				
Call Report Locatn Geodata:					
Time Reported:					
System Facility Address:					

[73](#)

41 of 42

N/229.1

68.9 / -2.85

2550 Queensview Dr
Ottawa ON

SPL

Ref No:	8140-BHPQKE	Municipality No:	
Year:		Nature of Damage:	
Incident Dt:	11/7/2019	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	11/7/2019	Impact to Health:	2 - Minor Environment
Dt Document Closed:		Agency Involved:	
Site No:	NA		
MOE Response:	No		
Site County/District:			
Site Geo Ref Meth:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site District Office: Ottawa Nearest Watercourse: Site Name: LRT Ottawa Project. <UNOFFICIAL> Site Address: 2550 Queensview Dr Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Oil/Gas Well Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Equipment Failure Incident Summary: Kiewit/LRT Ottawa: < 1 L motor oil to and, cntd & cing Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 1 L Contaminant Qty 1: 1 Contaminant Unit: L Contaminant Code: 15 Contaminant Name: MOTOR OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1993 Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Industrial SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					
73	42 of 42	N/229.1	68.9 / -2.85	KIEWIT EUROVIA VINCI OTTAWA PARTERSHIP 2550 Queensview Dr., Ottawa OTTAWA ON	SPL
Ref No: 1-1N4VRR Year: Incident Dt: 2/28/2022 1:30:00 PM Dt MOE Arvl on Scn: MOE Reported Dt: 2/28/2022 4:20:12 PM Dt Document Closed: 3/8/2022 9:03:36 AM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 2550 Queensview Dr., Ottawa Site Region: Site Municipality: OTTAWA Site Lot: Site Conc:					
				Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: KIEWIT EUROVIA VINCI OTTAWA PARTERSHIP Client Type: Private Business Source Type: Tank - Above Ground Incident Cause: Incident Preceding Spill: Overflow/Surcharge Incident Reason: Incident Summary: KEV: 5m3 release of treated water to storm sewer Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 5 cubic metre (m3) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: WATER Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Normal operations Property 2nd Watershed: Lower Ottawa Property Tertiary Watershed: 02KE - Lower Madawaska Sector Type: CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003951691"],"wks":["POINT (-75.7816730000 45.3557788000)","creation_date":"2022-02-28"} Time Reported: System Facility Address:					
74	1 of 1	N/230.6	68.9 / -2.85	45.355038, - 75.780809, Ottawa, ON OTTAWA ON	SPL
Ref No: 1-3PXXLR Year: Incident Dt: 8/9/2023 1:30:09 PM Dt MOE Arvl on Scn: MOE Reported Dt: 8/9/2023 3:11:09 PM Dt Document Closed: 8/18/2023 2:32:30 PM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 45.355038, - 75.780809, Ottawa, ON Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type:					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: KEV: 10 L hydraulic fluid to ground Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 10 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Lower Ottawa Property Tertiary Watershed: 02KE - Lower Madawaska Sector Type: OTHER HEAVY AND CIVIL ENGINEERING CONSTRUCTION SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003951691"],"wks":["POINT (-75.7816730000 45.3557788000)","creation_date":"2023-08-09"} Time Reported: System Facility Address:					
75	1 of 11	W/240.3	68.9 / -2.85	HEWLETT-PACKARD (CANADA) LTD. 2670 QUEENSVIEW DRIVE (SWM) OTTAWA ON K2B 8K1	CA
Certificate #: 3-0773-98- Application Year: 98 Issue Date: 8/10/1998 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
75	2 of 11	W/240.3	68.9 / -2.85	KIEWIT/EUROVIA/VINCI OTTAWA PARTNERSHIP 2670 Queensview DR Ottawa ON K1G 6H5	EASR
Approval No: R-009-6113283063 Status: REGISTERED Date: 2021-06-22 Record Type: EASR Link Source: MOFA Project Type: Water Taking - Construction Dewatering Full Address: Approval Type: EASR-Water Taking - Construction Dewatering SWP Area Name: Rideau Valley PDF NAICS Code: PDF URL: PDF Site Location:					
				MOE District: Ottawa Municipality: Ottawa Latitude: 45.35277778 Longitude: -75.78611111 Geometry X: -8436471.2981 Geometry Y: 5677231.162100001	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
75	3 of 11	W/240.3	68.9 / -2.85	2670 Queensview Drive Ottawa ON K2B 8K1	EHS
Order No: 19990525005 Status: C Report Type: Complete Report Report Date: 5/27/99 Date Received: 5/25/99 Previous Site Name: Lot/Building Size: Additional Info Ordered:		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.35 X: -75.787445 Y: 45.352749			
75	4 of 11	W/240.3	68.9 / -2.85	2670 Queensview Drive Ottawa ON K2B 8K1	EHS
Order No: 20060825016 Status: C Report Type: Complete Report Report Date: 8/29/2006 Date Received: 8/25/2006 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps And /or Site Plans		Nearest Intersection: Pinecrest Road Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.786369 Y: 45.35321			
75	5 of 11	W/240.3	68.9 / -2.85	Kiewit Eurovia Vinci 2670 Queensview Dr Ottawa ON	SPL
Ref No: 1845-BZKRA5 Year: Incident Dt: 3/29/2021 Dt MOE Arvl on Scn: MOE Reported Dt: 3/29/2021 Dt Document Closed: 4/19/2021 Site No: NA MOE Response: No Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: Construction Site<UNOFFICIAL> Site Address: 2670 Queensview Dr Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: 5022437.21 Easting: 438310.52 Entity Operating Name: Client Name: Kiewit Eurovia Vinci Client Type: Corporation Source Type: Other Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Operator/Human Error Incident Summary: KEV: 1L hydraulic oil to gravel; cleaned Environment Impact: Health Env Consequence:		Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 2 - Minor Environment Agency Involved:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Nature of Impact: Contaminant Qty: 1 L Contaminant Qty 1: 1 Contaminant Unit: L Contaminant Code: 15 Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: n/a Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Industrial SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					
75	6 of 11	W/240.3	68.9 / -2.85	2670 Queensview Dr, Ottawa ON OTTAWA ON	SPL
Ref No: 1-IFQU2 Year: Incident Dt: 6/16/2021 6:30:00 AM Dt MOE Arvl on Scn: MOE Reported Dt: 6/16/2021 7:57:09 AM Dt Document Closed: 6/18/2021 11:42:36 AM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 2670 Queensview Dr, Ottawa ON Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: KEV spill of coolant 5 L cleaned Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 5 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: COOLANT (N.O.S.) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land					
				Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Activity Preceding Spill: Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004292659"],"wks":["POINT (-75.7859087000 45.3527284000)","creation_date":"2021-06-16"} Time Reported: System Facility Address:					
75	7 of 11	W/240.3	68.9 / -2.85	2670 Queensview Drive, Ottawa ON OTTAWA ON	SPL
Ref No: 1-GA539 Year: Incident Dt: 5/19/2021 12:30:00 PM Dt MOE Arvl on Scn: MOE Reported Dt: 5/19/2021 1:17:19 PM Dt Document Closed: 5/27/2021 4:38:06 PM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 2670 Queensview Drive, Ottawa ON Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Kiewit Eurovia Vinci- diesel spill 20 L cleaned Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 30 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: DIESEL FUEL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004292659"],"wks":["POINT (-75.7859087000 45.3527284000)","creation_date":"2021-05-19"}					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Time Reported: System Facility Address:					
75	8 of 11	W/240.3	68.9 / -2.85	2670 Queensview Dr. OTTAWA ON	SPL
Ref No: 1-C2SGY Municipality No: Year: Nature of Damage: Incident Dt: 4/5/2021 1:30:57 PM Discharger Report: Dt MOE Arvl on Scn: MOE Reported Dt: 4/5/2021 2:43:11 PM Material Group: Dt Document Closed: 8/6/2021 12:46:07 PM Impact to Health: 0 No Impact Site No: Agency Involved: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 2670 Queensview Dr. Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Motor Vehicle Incident Cause: Incident Preceding Spill: Incident Reason: Equipment failure/malfunction Incident Summary: KEV - 0.5 L hydraulic fluid to ground, cleaned Environment Impact: 0 No Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 1 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Construction or repair Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004292659"],"wks":["POINT (-75.785909 45.352728)","POINT (-75.785909 45.352728)"],"creation_date":"2021-04-05"} Time Reported: System Facility Address:					

75	9 of 11	W/240.3	68.9 / -2.85	behind 2670 Queensview Drive, Ottawa OTTAWA ON	SPL
Ref No: 1-3F8ZR6 Municipality No:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year: Incident Dt: 4/21/2023 8:00:00 AM Dt MOE Arvl on Scn: MOE Reported Dt: 4/21/2023 11:21:34 AM Dt Document Closed: 4/24/2023 11:43:39 AM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: behind 2670 Queensview Drive, Ottawa Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Truck - Transport/Hauling Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Kiewit Erovia Vinci - 7L concrete wash water to dirt. Cleaning Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 7 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: CEMENT SLURRY Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Surface Water Activity Preceding Spill: Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004292659"],"wks":["POINT (-75.7858874000 45.3527251000)","creation_date":"2023-04-21"} Time Reported: System Facility Address: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:					

75	10 of 11	W/240.3	68.9 / -2.85	2670 Queensview Dr, Ottawa OTTAWA ON	SPL
Ref No: 1-3J0Q4G Year: Incident Dt: 6/9/2023 12:30:00 PM Dt MOE Arvl on Scn: MOE Reported Dt: 6/9/2023 1:50:27 PM Dt Document Closed: 8/3/2023 4:07:28 PM Site No: MOE Response: Desktop Response Site County/District: Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 2670 Queensview Dr, Ottawa Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Motor Vehicle Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: KEV - 1L hydraulic oil to soil and granular, cleaned Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 1 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004292659"],"wks":["POINT (-75.7858874000 45.3527261000)","POINT (-75.7858874000 45.3527261000)"],"creation_date":"2023-06-09"} Time Reported: System Facility Address:					
75	11 of 11	W/240.3	68.9 / -2.85	2670 Queensview Drive Ottawa, ON OTTAWA ON	SPL
Ref No: 1-32R6MK Year: Incident Dt: 3/14/2023 9:32:28 AM Dt MOE Arvl on Scn: MOE Reported Dt: 3/14/2023 9:32:28 AM Dt Document Closed: 3/15/2023 8:40:15 AM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 2670 Queensview Drive Ottawa, ON Site Region: Site Municipality: OTTAWA Site Lot:					
Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: KEV: 8L Diesel to ground, cntd Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 8 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: DIESEL FUEL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004292659"],"wkts":["POINT (-75.7858874000 45.3527251000)"],"creation_date":"2023-03-14"} Time Reported: System Facility Address:					
76	1 of 3	SE/245.1	74.9 / 3.15	1175 Soderlind St Ottawa ON K2C 3B3	EHS
Order No: 20130104007 Status: C Report Type: Standard Report Report Date: 14-JAN-13 Date Received: 04-JAN-13 Previous Site Name: Lot/Building Size: 4 acre Additional Info Ordered: City Directory Nearest Intersection: Municipality: Ottawa Client Prov/State: ON Search Radius (km): .25 X: -75.779811 Y: 45.350349					
76	2 of 3	SE/245.1	74.9 / 3.15	Ottawa Catholic District School Board 1175 Soderlind Rd Ottawa ON	GEN
Generator Info Generator No: ON8231400 Approval Years: 2013 Status: PO Box No: Country: Co Admin: Phone No Admin: Choice of Contact: Contaminated Fac: MHSW Facility: SIC Code: 611110					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
SIC Description:		ELEMENTARY AND SECONDARY SCHOOLS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
76	3 of 3	SE/245.1	74.9 / 3.15	Ottawa Catholic District School Board 1175 Soderlind St. Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:		ON3595134		Choice of Contact:	
Approval Years:		2013		Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	
Country:				611110	
Co Admin:					
Phone No Admin:					
SIC Description:		ELEMENTARY AND SECONDARY SCHOOLS			
<u>Waste Detail(s)</u>					
Waste Class:		213			
Waste Class Name:		PETROLEUM DISTILLATES			
77	1 of 1	SE/248.3	74.9 / 3.15	1175 SODERLIND ST Ottawa ON	WWIS
Well ID:		7229422		Flowing (Y/N):	
Construction Date:				Flow Rate:	
Use 1st:		Monitoring and Test Hole		Data Entry Status:	
Use 2nd:		0		Data Src:	
Final Well Status:		Abandoned-Quality		Date Received:	
Water Type:				10/14/2014	
Casing Material:				Selected Flag:	
Audit No:		Z180793		TRUE	
Tag:		A157431		Abandonment Rec:	
Constructn Method:				Yes	
Elevation (m):				Contractor:	
Elevatn Reliabilty:				6894	
Depth to Bedrock:				Form Version:	
Well Depth:				7	
Overburden/Bedrock:				Owner:	
Pump Rate:				County:	
Static Water Level:				OTTAWA-CARLETON	
Clear/Cloudy:				Lot:	
Municipality:		NEPEAN TOWNSHIP		Concession:	
Site Info:				Concession Name:	
				Easting NAD83:	
				Northing NAD83:	
				Zone:	
				UTM Reliability:	
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/722\7229422.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/28/2014			
Year Completed:		2014			
Depth (m):					
Latitude:		45.3499923832755			
Longitude:		-75.7797383881969			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
X:		-75.77973822678989			
Y:		45.34999237611611			
Path:		722\7229422.pdf			

Bore Hole Information

Bore Hole ID:	1005161120	Elevation:	
DP2BR:		Elevrc:	
Spatial Status:		Zone:	18
Code OB:		East83:	438920.00
Code OB Desc:		North83:	5022127.00
Open Hole:		Org CS:	UTM83
Cluster Kind:		UTMRC:	4
Date Completed:	07/28/2014	UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:		Location Method:	wwr
Location Method Desc:	on Water Well Record		
Elevrc Desc:			
Location Source Date:			
Improvement Location Source:			
Improvement Location Method:			
Source Revision Comment:			
Supplier Comment:			

Annular Space/Abandonment Sealing Record

Plug ID:	1005395656
Layer:	1
Plug From:	1.0
Plug To:	9.0
Plug Depth UOM:	ft

Method of Construction & Well Use

Method Construction ID:	1005395655
Method Construction Code:	B
Method Construction:	Other Method
Other Method Construction:	AUGER

Pipe Information

Pipe ID:	1005395647
Casing No:	0
Comment:	
Alt Name:	

Construction Record - Casing

Casing ID:	1005395651
Layer:	1
Material:	5
Open Hole or Material:	PLASTIC
Depth From:	0.0
Depth To:	10.0
Casing Diameter:	2.0
Casing Diameter UOM:	inch
Casing Depth UOM:	ft

Construction Record - Screen

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Screen ID:		1005395652			
Layer:		1			
Slot:		.10			
Screen Top Depth:		10.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		inch			
Screen Diameter:		2.375			
 <u>Water Details</u>					
Water ID:		1005395650			
Layer:		1			
Kind Code:					
Kind:					
Water Found Depth:		11.5			
Water Found Depth UOM:		ft			
 <u>Hole Diameter</u>					
Hole ID:		1005395649			
Diameter:		8.0			
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		inch			
<u>78</u>	1 of 1	ENE/251.5	71.9 / 0.15	ON	BORE
Borehole ID:	610873			Inclin FLG:	No
OGF ID:	215512383			SP Status:	Initial Entry
Status:				Surv Elev:	No
Type:	Borehole			Piezometer:	No
Use:				Primary Name:	
Completion Date:	MAR-1959			Municipality:	
Static Water Level:				Lot:	
Primary Water Use:				Township:	
Sec. Water Use:				Latitude DD:	45.354282
Total Depth m:	6.6			Longitude DD:	-75.777874
Depth Ref:	Ground Surface			UTM Zone:	18
Depth Elev:				Easting:	439071
Drill Method:				Northing:	5022602
Orig Ground Elev m:	74.9			Location Accuracy:	
Elev Reliabil Note:				Accuracy:	Not Applicable
DEM Ground Elev m:	74.6				
Concession:					
Location D:					
Survey D:					
Comments:					
 <u>Borehole Geology Stratum</u>					
Geology Stratum ID:	218386793			Mat Consistency:	Loose
Top Depth:	.3			Material Moisture:	
Bottom Depth:	.8			Material Texture:	Fine
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Gsc Material Description:					
Stratum Description:		SAND-FINE. LOOSE.			
Geology Stratum ID:	218386797			Mat Consistency:	Dense
Top Depth:	4.9			Material Moisture:	
Bottom Depth:	6.6			Material Texture:	
Material Color:	Grey			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Silt			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		CLAY,SILT. STIFF. 0002501800055010T,CLAY. GREY,VERY LOOSE. SAND,SILT,COBBLE. GREY,DENSE. TI			
**Note: Many records provided by the department have a truncated [Stratum Description] field.					
Geology Stratum ID:	218386795			Mat Consistency:	Dense
Top Depth:	1.2			Material Moisture:	
Bottom Depth:	1.7			Material Texture:	Fine
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		SAND-FINE. DENSE.			
Geology Stratum ID:	218386792			Mat Consistency:	
Top Depth:	0			Material Moisture:	
Bottom Depth:	.3			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Unknown			Geologic Formation:	
Material 2:				Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		UNSPECIFIED.			
Geology Stratum ID:	218386794			Mat Consistency:	Soft
Top Depth:	.8			Material Moisture:	
Bottom Depth:	1.2			Material Texture:	
Material Color:	Brown			Non Geo Mat Type:	
Material 1:	Clay			Geologic Formation:	
Material 2:	Sand			Geologic Group:	
Material 3:				Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		CLAY,SAND. BROWN,GREY,VERY SOFT.			
Geology Stratum ID:	218386796			Mat Consistency:	Loose
Top Depth:	1.7			Material Moisture:	
Bottom Depth:	4.9			Material Texture:	
Material Color:				Non Geo Mat Type:	
Material 1:	Sand			Geologic Formation:	
Material 2:	Clay			Geologic Group:	
Material 3:	Silt			Geologic Period:	
Material 4:				Depositional Gen:	
Gsc Material Description:					
Stratum Description:		SAND,CLAY,SILT. LOOSE.			
Source					
Source Type:	Data Survey			Source Appl:	Spatial/Tabular
Source Orig:	Geological Survey of Canada			Source Iden:	1
Source Date:	1956-1972			Scale or Res:	Varies
Confidence:	H			Horizontal:	NAD27

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Observatio:				Verticalda:	Mean Average Sea Level
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Details:		File: OTTAWA1.txt RecordID: 033810 NTS_Sheet: 31G05C			
Confiden 1:		Logged by professional. Exact and complete description of material and properties.			
Source List					
Source Identifier:		1	Horizontal Datum:		NAD27
Source Type:		Data Survey	Vertical Datum:		Mean Average Sea Level
Source Date:		1956-1972	Projection Name:		Universal Transverse Mercator
Scale or Resolution:		Varies			
Source Name:		Urban Geology Automated Information System (UGAIS)			
Source Originators:		Geological Survey of Canada			
79	1 of 1	NW/251.6	68.9 / -2.85	2611 Queensview Drive Ottawa ON K2B 6B7	EHS
Order No:		20191108020	Nearest Intersection:		
Status:		C	Municipality:		
Report Type:		Standard Report	Client Prov/State:		QC
Report Date:		13-NOV-19	Search Radius (km):		.25
Date Received:		08-NOV-19	X:		-75.78368
Previous Site Name:			Y:		45.355207
Lot/Building Size:					
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; City Directory			
80	1 of 3	NW/251.6	68.9 / -2.85	1561761 Ontario Inc. 2611 Queensview Dr Ottawa ON	CA
Certificate #:		2017-7PYM7Z			
Application Year:		2009			
Issue Date:		3/12/2009			
Approval Type:		Municipal and Private Sewage Works			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
80	2 of 3	NW/251.6	68.9 / -2.85	1561761 Ontario Inc. 2611 Queensview Dr Ottawa ON K2H 9C4	ECA
Approval No:		2017-7PYM7Z	MOE District:		
Approval Date:		2009-03-12	City:		
Status:		Approved	Longitude:		
Record Type:		ECA	Latitude:		
Link Source:		IDS	Geometry X:		
SWP Area Name:			Geometry Y:		
Approval Type:		ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS			
Project Type:		MUNICIPAL AND PRIVATE SEWAGE WORKS			
Business Name:		1561761 Ontario Inc.			
Address:		2611 Queensview Dr			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/7637-7NWPBW-14.pdf			
PDF Site Location:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
80	3 of 3	NW/251.6	68.9 / -2.85	Munro and Scullion Contracting Inc<UNOFFICIAL> 2611 Queensview Drive Ottawa ON	SPL
Ref No: 2225-8KRSXX Year: Incident Dt: 8/15/2011 Dt MOE Arvl on Scn: MOE Reported Dt: 8/15/2011 Dt Document Closed: 12/3/2011 Site No: MOE Response: No Field Response Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Catch Basins<UNOFFICIAL> Site Address: 2611 Queensview Drive Site Region: Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Munro and Scullion Contracting Inc<UNOFFICIAL> Client Type: Source Type: Incident Cause: Other Transport Accident Incident Preceding Spill: Incident Reason: Other - Reason not otherwise defined Incident Summary: Munro- 200L diesel to road/catchbasin Environment Impact: Confirmed Health Env Consequence: Nature of Impact: Other Impact(s); Soil Contamination Contaminant Qty: 200 L Contaminant Qty 1: 200 Contaminant Unit: L Contaminant Code: 13 Contaminant Name: DIESEL FUEL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Motor Vehicle SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address: Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					
81	1 of 1	NW/252.7	68.9 / -2.85	2615 Queensview Drive Ottawa ON K2B	EHS
Order No: 21010400274 Status: C Nearest Intersection: Municipality:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Report Type: Standard Report Report Date: 07-JAN-21 Date Received: 04-JAN-21 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Client Prov/State: ON Search Radius (km): .25 X: -75.7842154 Y: 45.3549517					
82	1 of 1	WNW/260.3	68.9 / -2.85	2625 Queensway Drive Ottawa ON Ottawa ON K2B 8K2	EHS
Order No: 22013100309 Status: C Report Type: Standard Report Report Date: 03-FEB-22 Date Received: 31-JAN-22 Previous Site Name: Lot/Building Size: Additional Info Ordered:					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.7853065 Y: 45.3543653					
83	1 of 5	WNW/269.1	68.9 / -2.85	O & Y PROPERTIES INC. 2625 QUEENSVIEW DR. (SWM) OTTAWA CITY ON K2B 8K2	CA
Certificate #: 3-1556-97- Application Year: 97 Issue Date: 11/24/1997 Approval Type: Municipal sewage Status: Approved Application Type: Client Name: Client Address: Client City: Client Postal Code: Project Description: Contaminants: Emission Control:					
83	2 of 5	WNW/269.1	68.9 / -2.85	2625 Queensview Dr. Ottawa ON K2B 8K2	EHS
Order No: 20060309007 Status: C Report Type: Complete Report Report Date: 3/17/2006 Date Received: 3/9/2006 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans; City Directory					
Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.785489 Y: 45.354281					
83	3 of 5	WNW/269.1	68.9 / -2.85	2625 Queensview Drive Ottawa ON K2B 8K2	EHS
Order No: 20101101046 Status: C Report Type: Standard Report Report Date: 11/5/2010 Date Received: 11/1/2010 4:41:23 PM Previous Site Name: Lot/Building Size: Lot: 2.74 acres					
Nearest Intersection: Queensview Drive & Pinecrest Road Municipality: Client Prov/State: ON Search Radius (km): 0.25 X: -75.785304 Y: 45.354083					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Additional Info Ordered:		Fire Insur. Maps and/or Site Plans; City Directory			
83	4 of 5	WNW/269.1	68.9 / -2.85	2625 Queensview Drive Ottawa ON	EHS
Order No: 20160112076 Status: C Report Type: Standard Report Report Date: 19-JAN-16 Date Received: 12-JAN-16 Previous Site Name: Lot/Building Size: Additional Info Ordered: Aerial Photos		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.785502 Y: 45.354316			
83	5 of 5	WNW/269.1	68.9 / -2.85	2625 Queensview Drive Ottawa ON K2B 8K2	EHS
Order No: 20180920039 Status: C Report Type: Standard Report Report Date: 25-SEP-18 Date Received: 20-SEP-18 Previous Site Name: Lot/Building Size: Additional Info Ordered: Fire Insur. Maps and/or Site Plans		Nearest Intersection: Municipality: Client Prov/State: ON Search Radius (km): .25 X: -75.785531 Y: 45.35432			
84	1 of 2	NNE/270.9	69.2 / -2.54	KIEWIT EUROVIA VINCI OTTAWA PARTERNSHIP Connaught Ave and Roman Ave, Ottawa, ON OTTAWA ON	SPL
Ref No: 1-XQNRT Year: Incident Dt: 7/15/2021 6:00:08 AM Dt MOE Arvl on Scn: MOE Reported Dt: 7/15/2021 2:00:27 PM Dt Document Closed: 11/10/2021 3:27:57 PM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: Connaught Ave and Roman Ave, Ottawa, ON Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: KIEWIT EUROVIA VINCI OTTAWA PARTERNSHIP Client Type: Private Business Source Type: Motor Vehicle Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Human error (Specify)		Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: SAC Action Class: Call Report Locatn Geodata: Time Reported: System Facility Address:		KEV: 2L engine oil to gravel, cleaned 1 Minor Impact 2 litre (L) ENGINE OIL Land Construction or repair Central Ottawa 02KF-Central Ottawa - Mississippi CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING			
		{ "integration_ids": ["PR00004318271"], "wks": ["POINT (-75.7795326000 45.3559808000)", "creation_date": "2021-07-15"] }			

84	2 of 2	NNE/270.9	69.2 / -2.54	LAFARGE CANADA INC. Roman Ave and Cannaught, Ottawa ON OTTAWA ON	SPL
Ref No: Year: Incident Dt: Dt MOE Arvl on Scn: MOE Reported Dt: Dt Document Closed: Site No: MOE Response: Site County/District: Site Geo Ref Meth: Site District Office: Nearest Watercourse: Site Name: Site Address: Site Region: Site Municipality: Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: Contaminant Qty 1: Contaminant Unit:		1-3G23E7 5/4/2023 2:00:49 PM 5/5/2023 7:48:49 AM 5/8/2023 7:17:49 AM Desktop Response Ottawa District Office Roman Ave and Cannaught, Ottawa ON OTTAWA	Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:	0 No Impact	

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Contaminant Code: Contaminant Name: CONCRETE Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Loading and Unloading Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: INDUSTRIAL BUILDING AND STRUCTURE CONSTRUCTION SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00004318271"],"wks":["POINT (-75.7795326000 45.3559808000)","creation_date":"2023-05-05"} Time Reported: System Facility Address:					

85	1 of 1	NNE/274.2	68.9 / -2.85	2550 QUEENSVIEW DR Ottawa ON	WWIS
Well ID: 7386190 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z359292 Tag: A318116 Constructn Method: Elevation (m): Elevatn Reliability: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info:					
Flowing (Y/N): Flow Rate: Data Entry Status: Data Src: Date Received: 04/28/2021 Selected Flag: TRUE Abandonment Rec: Contractor: 7241 Form Version: 7 Owner: County: OTTAWA-CARLETON Lot: Concession: Concession Name: Easting NAD83: Northing NAD83: Zone: UTM Reliability:					

PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/738\7386190.pdf

Additional Detail(s) (Map)

Well Completed Date: 04/16/2021
Year Completed: 2021
Depth (m):
Latitude: 45.3562139491019
Longitude: -75.7808196796511
X: -75.7808195181295
Y: 45.35621394214439
Path: 738\7386190.pdf

Bore Hole Information

Bore Hole ID: 1008650687
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:

Elevation:
Elevrc:
Zone: 18
East83: 438842.00
North83: 5022819.00
Org CS: UTM83
UTMRC: 4

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Date Completed:		04/16/2021		UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1009843352			
Layer:		4			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		08			
Material 2 Desc:		FINE SAND			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		7.0			
Formation End Depth:		16.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1009843350			
Layer:		2			
Color:		2			
General Color:		GREY			
Material 1:		11			
Material 1 Desc:		GRAVEL			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		1.0			
Formation End Depth:		2.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1009843349			
Layer:		1			
Color:		2			
General Color:		GREY			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:		73			
Material 2 Desc:		HARD			
Material 3:		66			
Material 3 Desc:		DENSE			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Materials Interval</u>					
Formation ID:		1009843351			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		2.0			
Formation End Depth:		7.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009844805			
Layer:		2			
Plug From:		1.0			
Plug To:		2.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009844804			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009844806			
Layer:		3			
Plug From:		2.0			
Plug To:		5.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009844807			
Layer:		4			
Plug From:		5.0			
Plug To:		16.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1009846063			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pipe ID:		1009722046			
Casing No:		0			
Comment:					
Alt Name:					
 <u>Construction Record - Casing</u>					
Casing ID:		1009846600			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		6.0			
Casing Diameter:		1.6100000143051147			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
 <u>Construction Record - Screen</u>					
Screen ID:		1009847133			
Layer:		1			
Slot:		10			
Screen Top Depth:		6.0			
Screen End Depth:		16.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		Inch			
Screen Diameter:		1.899999976158142			
 <u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1009847835			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
 <u>Hole Diameter</u>					
Hole ID:		1009845493			
Diameter:		3.25			
Depth From:		0.0			
Depth To:		16.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
86	1 of 1	W/279.5	67.9 / -3.85	KIEWIT EUROVIA VINCI	SPL

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
OTTAWA ON					
Ref No:	1-32QCPO			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	3/13/2023 10:50:00 AM			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	3/14/2023 8:32:50 AM			Impact to Health:	0 No Impact
Dt Document Closed:	3/15/2023 7:56:15 AM			Agency Involved:	
Site No:					
MOE Response:	Desktop Response				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa District Office				
Nearest Watercourse:					
Site Name:					
Site Address:					
Site Region:					
Site Municipality:	OTTAWA				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:					
Easting:					
Entity Operating Name:					
Client Name:	KIEWIT EUROVIA VINCI				
Client Type:	Private Business				
Source Type:	Motor Vehicle				
Incident Cause:					
Incident Preceding Spill:	Leak/Break				
Incident Reason:	Unknown				
Incident Summary:	KEV: 2 L coolant on ground, cleaned up				
Environment Impact:	1 Minor Impact				
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	2 litre (L)				
Contaminant Qty 1:					
Contaminant Unit:					
Contaminant Code:					
Contaminant Name:	COOLANT (N.O.S.)				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:					
Receiving Medium:	Land				
Activity Preceding Spill:	Construction or repair				
Property 2nd Watershed:	Central Ottawa				
Property Tertiary Watershed:	02KF-Central Ottawa - Mississippi				
Sector Type:	OTHER HEAVY AND CIVIL ENGINEERING CONSTRUCTION				
SAC Action Class:					
Call Report Locatn Geodata:	{"integration_ids":["PR00004292659"],"wkts":["POINT (-75.7863970197 45.3532151709)"],"creation_date":"2023-03-14"}				
Time Reported:					
System Facility Address:					

87	1 of 1	NW/283.7	68.9 / -2.85	2591 & 2611 Queensview Drive Ottawa ON	EHS
Order No:	20110412046			Nearest Intersection:	
Status:	C			Municipality:	
Report Type:	Custom Report			Client Prov/State:	ON
Report Date:	4/19/2011			Search Radius (km):	0.25
Date Received:	4/12/2011 4:52:10 PM			X:	-75.783978
Previous Site Name:				Y:	45.355412

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Lot/Building Size: Additional Info Ordered:					
88	1 of 1	ENE/284.2	72.2 / 0.46	City of Ottawa<UNOFFICIAL> 2237 Elmira Road Ottawa ON	SPL
Ref No: 3831-AS3T98 Year: Incident Dt: 2017/10/12 Dt MOE Arvl on Scn: MOE Reported Dt: 2017/10/12 Dt Document Closed: Site No: NA MOE Response: No Site County/District: Site Geo Ref Meth: Site District Office: Ottawa Nearest Watercourse: Site Name: Road<UNOFFICIAL> Site Address: 2237 Elmira Road Site Region: Eastern Site Municipality: Ottawa Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northings: 5022540.27 Easting: 439118.28 Entity Operating Name: Client Name: City of Ottawa<UNOFFICIAL> Client Type: Source Type: Motor Vehicle Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Deliberate Act Incident Summary: CofOttawa: resident dumping moto fluids into CB Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 0 other - see incident description Contaminant Qty 1: 0 Contaminant Unit: other - see incident description Contaminant Code: 15 Contaminant Name: MOTOR OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: 1993 Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Unknown / N/A SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address: Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: 2 - Minor Environment Agency Involved:					
89	1 of 1	NNE/284.5	68.9 / -2.85	2655 QUEENSVIEW DRIVE BEHIND LOCATION Ottawa ON	WWIS
Well ID: 7339878 Flowing (Y/N):					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Construction Date:				Flow Rate:	
Use 1st:	Monitoring			Data Entry Status:	
Use 2nd:				Data Src:	
Final Well Status:	Observation Wells			Date Received:	08/22/2019
Water Type:				Selected Flag:	TRUE
Casing Material:				Abandonment Rec:	
Audit No:	Z213683			Contractor:	7328
Tag:	A267507			Form Version:	7
Constructn Method:				Owner:	
Elevation (m):				County:	OTTAWA-CARLETON
Elevatn Reliabilty:				Lot:	
Depth to Bedrock:				Concession:	
Well Depth:				Concession Name:	
Overburden/Bedrock:				Easting NAD83:	
Pump Rate:				Northing NAD83:	
Static Water Level:				Zone:	
Clear/Cloudy:				UTM Reliability:	
Municipality:		OTTAWA CITY			
Site Info:					
PDF URL (Map):		https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/733\7339878.pdf			
<u>Additional Detail(s) (Map)</u>					
Well Completed Date:		07/24/2019			
Year Completed:		2019			
Depth (m):		11.89			
Latitude:		45.3562708315715			
Longitude:		-75.780399141919			
X:		-75.78039898004853			
Y:		45.35627082531962			
Path:		733\7339878.pdf			
<u>Bore Hole Information</u>					
Bore Hole ID:	1007597472			Elevation:	
DP2BR:				Elevrc:	
Spatial Status:				Zone:	18
Code OB:				East83:	438875.00
Code OB Desc:				North83:	5022825.00
Open Hole:				Org CS:	UTM83
Cluster Kind:				UTMRC:	4
Date Completed:	07/24/2019			UTMRC Desc:	margin of error : 30 m - 100 m
Remarks:				Location Method:	wwr
Location Method Desc:		on Water Well Record			
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Source Revision Comment:					
Supplier Comment:					
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008025037			
Layer:		6			
Color:		4			
General Color:		GREEN			
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:					
Material 2 Desc:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Material 3:					
Material 3 Desc:					
Formation Top Depth:		2.990000009536743			
Formation End Depth:		11.890000343322754			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008025034			
Layer:		3			
Color:		6			
General Color:		BROWN			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:					
Material 2 Desc:					
Material 3:		08			
Material 3 Desc:		FINE SAND			
Formation Top Depth:		0.5			
Formation End Depth:		1.2000000476837158			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008025032			
Layer:		1			
Color:					
General Color:					
Material 1:		27			
Material 1 Desc:		OTHER			
Material 2:					
Material 2 Desc:					
Material 3:					
Material 3 Desc:					
Formation Top Depth:		0.0			
Formation End Depth:		0.029999999329447746			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008025033			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		12			
Material 1 Desc:		STONES			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		27			
Material 3 Desc:		OTHER			
Formation Top Depth:		0.029999999329447746			
Formation End Depth:		0.5			
Formation End Depth UOM:		m			
<u>Overburden and Bedrock</u>					
<u>Materials Interval</u>					
Formation ID:		1008025036			
Laver:		5			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Color:		2			
General Color:		GREY			
Material 1:		28			
Material 1 Desc:		SAND			
Material 2:		06			
Material 2 Desc:		SILT			
Material 3:		11			
Material 3 Desc:		GRAVEL			
Formation Top Depth:		3.049999952316284			
Formation End Depth:		2.990000009536743			
Formation End Depth UOM:		m			
 <u>Overburden and Bedrock</u> <u>Materials Interval</u>					
Formation ID:		1008025035			
Layer:		4			
Color:		6			
General Color:		BROWN			
Material 1:		05			
Material 1 Desc:		CLAY			
Material 2:		28			
Material 2 Desc:		SAND			
Material 3:		84			
Material 3 Desc:		SILTY			
Formation Top Depth:		1.2000000476837158			
Formation End Depth:		3.049999952316284			
Formation End Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1008026346			
Layer:		3			
Plug From:		6.239999771118164			
Plug To:		11.890000343322754			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1008026345			
Layer:		2			
Plug From:		0.6000000238418579			
Plug To:		2.490000009536743			
Plug Depth UOM:		m			
 <u>Annular Space/Abandonment</u> <u>Sealing Record</u>					
Plug ID:		1008026344			
Layer:		1			
Plug From:		0.0			
Plug To:		15.0			
Plug Depth UOM:		m			
 <u>Method of Construction & Well</u> <u>Use</u>					
Method Construction ID:		1008027503			
Method Construction Code:		B			
Method Construction:		Other Method			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Other Method Construction:		HSA, HQ/W			
<u>Pipe Information</u>					
Pipe ID:		1008023969			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1008027990			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.10000000149011612			
Depth To:		3.3499999046325684			
Casing Diameter:		5.090000152587891			
Casing Diameter UOM:		cm			
Casing Depth UOM:		m			
<u>Construction Record - Screen</u>					
Screen ID:		1008028501			
Layer:		1			
Slot:		10			
Screen Top Depth:		3.3499999046325684			
Screen End Depth:		5.940000057220459			
Screen Material:		5			
Screen Depth UOM:		m			
Screen Diameter UOM:					
Screen Diameter:					
<u>Results of Well Yield Testing</u>					
Pumping Test Method Desc:					
Pump Test ID:		1008029191			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		m			
Rate UOM:		LPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:					
<u>Water Details</u>					
Water ID:		1008028728			
Layer:		1			
Kind Code:		8			
Kind:		Untested			
Water Found Depth:					
Water Found Depth UOM:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Hole Diameter</u>					
Hole ID:		1008026911			
Diameter:		20.299999237060547			
Depth From:		0.0			
Depth To:		5.989999771118164			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>Hole Diameter</u>					
Hole ID:		1008026912			
Diameter:		10.15999984741211			
Depth From:		5.989999771118164			
Depth To:		11.890000343322754			
Hole Depth UOM:		m			
Hole Diameter UOM:		cm			
<u>90</u>	1 of 1	NNE/285.0	68.9 / -2.85	Ottawa ON	SPL
Ref No:	2483-BU8HQW			Municipality No:	
Year:				Nature of Damage:	
Incident Dt:	10/9/2020			Discharger Report:	
Dt MOE Arvl on Scn:				Material Group:	
MOE Reported Dt:	10/9/2020			Impact to Health:	2 - Minor Environment
Dt Document Closed:	2/8/2021			Agency Involved:	
Site No:	NA				
MOE Response:	No				
Site County/District:					
Site Geo Ref Meth:					
Site District Office:	Ottawa				
Nearest Watercourse:					
Site Name:	Intersection of Hanlon Avenue and Connaught Avenue <UNOFFICIAL>				
Site Address:					
Site Region:	Eastern				
Site Municipality:	Ottawa				
Site Lot:					
Site Conc:					
Site Geo Ref Accu:					
Site Map Datum:					
Northing:	5022810				
Easting:	438928				
Entity Operating Name:					
Client Name:					
Client Type:					
Source Type:	Valve/Fitting/Piping				
Incident Cause:					
Incident Preceding Spill:	Leak/Break				
Incident Reason:	Equipment Failure				
Incident Summary:	Kiewit: 20 L raw Sew to pavement; cleaned				
Environment Impact:					
Health Env Consequence:					
Nature of Impact:					
Contaminant Qty:	20 L				
Contaminant Qty 1:	20				
Contaminant Unit:	L				
Contaminant Code:	44				
Contaminant Name:	SEWAGE,RAW UNCHLORINATED				
Contaminant Limit 1:					
Contam Limit Freq 1:					
Contaminant UN No 1:	n/a				
Receiving Medium:	Land				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Activity Preceding Spill: Property 2nd Watershed: Property Tertiary Watershed: Sector Type: Miscellaneous Industrial SAC Action Class: Land Spills Call Report Locatn Geodata: Time Reported: System Facility Address:					
91	1 of 1	NNE/286.5	68.9 / -2.85	2550 QUEENSVIEW DR Ottawa ON	WWIS
Well ID: 7386191 Construction Date: Use 1st: Monitoring and Test Hole Use 2nd: Final Well Status: Monitoring and Test Hole Water Type: Casing Material: Audit No: Z359294 Tag: A318117 Constructn Method: Elevation (m): Elevatn Reliabilty: Depth to Bedrock: Well Depth: Overburden/Bedrock: Pump Rate: Static Water Level: Clear/Cloudy: Municipality: OTTAWA CITY Site Info: PDF URL (Map): https://d2khazk8e83rdv.cloudfront.net/moe_mapping/downloads/2Water/Wells_pdfs/738\7386191.pdf					
Flowing (Y/N):					
Flow Rate:					
Data Entry Status:					
Data Src:					
Date Received: 04/28/2021					
Selected Flag: TRUE					
Abandonment Rec:					
Contractor: 7241					
Form Version: 7					
Owner:					
County: OTTAWA-CARLETON					
Lot:					
Concession:					
Concession Name:					
Easting NAD83:					
Northing NAD83:					
Zone:					
UTM Reliability:					
Additional Detail(s) (Map)					
Well Completed Date: 04/16/2021					
Year Completed: 2021					
Depth (m):					
Latitude: 45.3563223045044					
Longitude: -75.7807701007738					
X: -75.78076993921788					
Y: 45.35632229809588					
Path: 738\7386191.pdf					
Bore Hole Information					
Bore Hole ID: 1008650690					
DP2BR:					
Spatial Status:					
Code OB:					
Code OB Desc:					
Open Hole:					
Cluster Kind:					
Date Completed: 04/16/2021					
Remarks:					
Location Method Desc: on Water Well Record					
Elevrc Desc:					
Location Source Date:					
Improvement Location Source:					
Improvement Location Method:					
Elevation: Elevrc: Zone: 18 East83: 438846.00 North83: 5022831.00 Org CS: UTM83 UTMRC: 4 UTMRC Desc: margin of error : 30 m - 100 m Location Method: wwr					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Source Revision Comment: Supplier Comment:					
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009843355			
Layer:		3			
Color:		2			
General Color:		GREY			
Material 1:		06			
Material 1 Desc:		SILT			
Material 2:		05			
Material 2 Desc:		CLAY			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		6.0			
Formation End Depth:		15.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009843353			
Layer:		1			
Color:		8			
General Color:		BLACK			
Material 1:		02			
Material 1 Desc:		TOPSOIL			
Material 2:		85			
Material 2 Desc:		SOFT			
Material 3:		77			
Material 3 Desc:		LOOSE			
Formation Top Depth:		0.0			
Formation End Depth:		1.0			
Formation End Depth UOM:		ft			
<u>Overburden and Bedrock Materials Interval</u>					
Formation ID:		1009843354			
Layer:		2			
Color:		6			
General Color:		BROWN			
Material 1:		09			
Material 1 Desc:		MEDIUM SAND			
Material 2:		11			
Material 2 Desc:		GRAVEL			
Material 3:		85			
Material 3 Desc:		SOFT			
Formation Top Depth:		1.0			
Formation End Depth:		6.0			
Formation End Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009844808			
Layer:		1			
Plug From:		0.0			
Plug To:		1.0			
Plug Depth UOM:		ft			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009844810			
Layer:		3			
Plug From:		4.0			
Plug To:		15.0			
Plug Depth UOM:		ft			
<u>Annular Space/Abandonment Sealing Record</u>					
Plug ID:		1009844809			
Layer:		2			
Plug From:		1.0			
Plug To:		4.0			
Plug Depth UOM:		ft			
<u>Method of Construction & Well Use</u>					
Method Construction ID:		1009846064			
Method Construction Code:		B			
Method Construction:		Other Method			
Other Method Construction:		DIRECT PUSH			
<u>Pipe Information</u>					
Pipe ID:		1009722047			
Casing No:		0			
Comment:					
Alt Name:					
<u>Construction Record - Casing</u>					
Casing ID:		1009846601			
Layer:		1			
Material:		5			
Open Hole or Material:		PLASTIC			
Depth From:		0.0			
Depth To:		5.0			
Casing Diameter:		1.3799999952316284			
Casing Diameter UOM:		Inch			
Casing Depth UOM:		ft			
<u>Construction Record - Screen</u>					
Screen ID:		1009847134			
Layer:		1			
Slot:		10			
Screen Top Depth:		5.0			
Screen End Depth:		15.0			
Screen Material:		5			
Screen Depth UOM:		ft			
Screen Diameter UOM:		Inch			
Screen Diameter:		1.659999966621399			
<u>Results of Well Yield Testing</u>					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Pumping Test Method Desc:					
Pump Test ID:		1009847836			
Pump Set At:					
Static Level:					
Final Level After Pumping:					
Recommended Pump Depth:					
Pumping Rate:					
Flowing Rate:					
Recommended Pump Rate:					
Levels UOM:		ft			
Rate UOM:		GPM			
Water State After Test Code:					
Water State After Test:					
Pumping Test Method:		0			
Pumping Duration HR:					
Pumping Duration MIN:					
Flowing:		No			
Hole Diameter					
Hole ID:		1009845494			
Diameter:		2.25			
Depth From:		0.0			
Depth To:		15.0			
Hole Depth UOM:		ft			
Hole Diameter UOM:		Inch			
92	1 of 16	W/294.7	68.0 / -3.71	Metcalfe Realty Company Limited 2680 Queensview Dr Ottawa ON	CA
Certificate #:		3873-7YQR9U			
Application Year:		2009			
Issue Date:		12/15/2009			
Approval Type:		Air			
Status:		Approved			
Application Type:					
Client Name:					
Client Address:					
Client City:					
Client Postal Code:					
Project Description:					
Contaminants:					
Emission Control:					
92	2 of 16	W/294.7	68.0 / -3.71	Metcalfe Realty Company Limited 2680 Queensview Dr Ottawa ON K1P 5G4	ECA
Approval No:		3873-7YQR9U		MOE District:	Ottawa
Approval Date:		2009-12-15		City:	
Status:		Approved		Longitude:	-75.78699
Record Type:		ECA		Latitude:	45.352062
Link Source:		IDS		Geometry X:	
SWP Area Name:		Rideau Valley		Geometry Y:	
Approval Type:		ECA-AIR			
Project Type:		AIR			
Business Name:		Metcalfe Realty Company Limited			
Address:		2680 Queensview Dr			
Full Address:					
Full PDF Link:		https://www.accessenvironment.ene.gov.on.ca/instruments/5574-7X3RVY-14.pdf			
PDF Site Location:					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	3 of 16	W/294.7	68.0 / -3.71	LEE VALLEY TOOLS LTD. 2680 QUEENSVIEW DR. OTTAWA ON K2B 8J9	GEN
<u>Generator Info</u>					
Generator No:	ON0907900			Choice of Contact:	
Approval Years:	86,87			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	3063
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	HAND TOOL/IMPLEMENT				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
92	4 of 16	W/294.7	68.0 / -3.71	LEE VALLEY TOOLS LTD-OUT OF BUS 2680 QUEENSVIEW DR. OTTAWA ON K2B 8J9	GEN
<u>Generator Info</u>					
Generator No:	ON0907900			Choice of Contact:	
Approval Years:	88,89,90			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	3063
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	HAND TOOL/IMPLEMENT				
<u>Waste Detail(s)</u>					
Waste Class:	264				
Waste Class Name:	PHOTOPROCESSING WASTES				
92	5 of 16	W/294.7	68.0 / -3.71	LEE VALLEY TOOLS LTD-OUT OF BUS 24-400 2680 QUEENSVIEW DR. OTTAWA ON K2B 8J9	GEN
<u>Generator Info</u>					
Generator No:	ON0907900			Choice of Contact:	
Approval Years:	92,93,94,95,96,97,98			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	3063
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	HAND TOOL/IMPLEMENT				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
92	6 of 16	W/294.7	68.0 / -3.71	SiGe Semiconductor Inc. 2680 Queensview Drive Ottawa ON K2B 8J9	GEN
<u>Generator Info</u>					
Generator No:	ON7401927			Choice of Contact:	
Approval Years:	05			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	335990
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	All Other Electrical Equipment and Component Manufacturing				
<u>Waste Detail(s)</u>					
Waste Class:	212				
Waste Class Name:	ALIPHATIC SOLVENTS				
92	7 of 16	W/294.7	68.0 / -3.71	International Datacasting Corporation 2680 Queensview Drive Ottawa ON K2B 8J9	GEN
<u>Generator Info</u>					
Generator No:	ON8593996			Choice of Contact:	
Approval Years:	05,06			Contaminated Fac:	
Status:				MHSW Facility:	
PO Box No:				SIC Code:	334290
Country:					
Co Admin:					
Phone No Admin:					
SIC Description:	Other Communications Equipment Manufacturing				
<u>Waste Detail(s)</u>					
Waste Class:	145				
Waste Class Name:	PAINT/PIGMENT/COATING RESIDUES				
<u>Waste Detail(s)</u>					
Waste Class:	122				
Waste Class Name:	ALKALINE WASTES - OTHER METALS				
<u>Waste Detail(s)</u>					
Waste Class:	263				
Waste Class Name:	ORGANIC LABORATORY CHEMICALS				
92	8 of 16	W/294.7	68.0 / -3.71	EllisDon Corporation Ottawa Buildings 2680 Queensview Drive Ottawa ON K2B8J9	GEN

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
<u>Generator Info</u>					
Generator No:	ON2951966			Choice of Contact:	
Approval Years:	As of Nov 2021			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	Pathological wastes				
92	9 of 16	W/294.7	68.0 / -3.71	EllisDon Corporation 2680 Queensview Drive Ottawa ON	GEN
<u>Generator Info</u>					
Generator No:	ON2951966			Choice of Contact:	
Approval Years:	As of Oct 2022			Contaminated Fac:	
Status:	Registered			MHSW Facility:	
PO Box No:				SIC Code:	
Country:	Canada				
Co Admin:					
Phone No Admin:					
SIC Description:					
<u>Waste Detail(s)</u>					
Waste Class:	312 P				
Waste Class Name:	PATHOLOGICAL WASTES				
<u>Generator Info (as of Dec 2024)</u>					
Generator No:	ON2951966				
Generator Company Name:	EllisDon Corporation				
Street:	2680 Queensview Drive				
City:	Ottawa				
Province State:	Ontario				
Country:	Canada				
Postal Code:	K2B8J9				
Waste Class:	312 P				
Waste Class Decoded:					
	312 - PATHOLOGICAL WASTES				
<u>Generator Info (as of Apr 2025)</u>					
Generator Company Name:	EllisDon Corporation				
Generator Site Address:	2680 Queensview Drive				
City:	Ottawa				
Province State:	Ontario				
Country:	Canada				
Postal Code:	K2B8J9				

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Waste Class:		312 P			
Waste Class Decoded:					
312 - PATHOLOGICAL WASTES					
Waste Characteristic Decoded:					
P - Pathological					
<u>2021 Generator Info</u>					
Gen No:	ON2951966			Choice of Contact:	CO_OFFICIAL
ID:	10961			Phone No Official:	613-565-2680 Ext.
Contaminated Fac:	N			Phone No Admin:	613-565-2680 Ext.
MHSW Facility:	N			County Ont:	OTTAWA CARLTON (RM)
NAICS Code1:	236210			County Out:	
NAICS Code2:	236220			District:	402
NAICS Code3:					
Gen Name:	EllisDon Corporation				
Gen Div:	Ottawa Buildings				
Gen Op Name:	EllisDon Corporation				
Gen Op Div:					
Site Adrs1:	2680 Queensview Drive				
Site Bldg:					
Site Pobox:					
Province In:	ONTARIO				
Site Adrs2:					
Site City:	Ottawa				
Province Out:					
Site Postal Code:	K2B8J9				
Site Country:	Canada				
Co Official:	Greg Scollan				
Co Admin:	Michele Casey				
<u>2021 Generator Manifest</u>					
ID:	30495			Sum Received Qty:	48.44
Generator No:	ON2951966			Waste Class Name:	PATHOLOGICAL WASTES
Receiver Type:	030			Count Manifests:	1
Waste Char:	P			District:	402
Waste Code:	312				
<u>92</u>	10 of 16	W/294.7	68.0 / -3.71	INTERNATIONAL DATACASTING 2680 QUEENSVIEW DR OTTAWA ON K2B 8J9	SCT
Established:	1974				
Plant Size (ft²):	0				
Employment:	50				
<u>--Details--</u>					
Description:	RADIO AND TELEVISION BROADCASTING AND COMMUNICATIONS EQUIPMENT				
SIC/NAICS Code:	3663				
<u>92</u>	11 of 16	W/294.7	68.0 / -3.71	INTERNATIONAL DATACASTING INC. 2680 Queensview Dr Ottawa ON K2B 8J9	SCT

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Established: 1984 Plant Size (ft²): 0 Employment: 55					
--Details-- Description: Radio and Television Broadcasting and Wireless Communications Equipment Manufacturing SIC/NAICS Code: 334220 Description: Manufacturing and Reproducing Magnetic and Optical Media SIC/NAICS Code: 334610					
92	12 of 16	W/294.7	68.0 / -3.71	International Datacasting Corp 2680 Queensview Dr Ottawa ON K2B 8J9	SCT
Established: 1984 Plant Size (ft²): 32000 Employment: 50					
--Details-- Description: Radio and Television Broadcasting and Wireless Communications Equipment Manufacturing SIC/NAICS Code: 334220 Description: Computer Systems Design and Related Services SIC/NAICS Code: 541510					
92	13 of 16	W/294.7	68.0 / -3.71	SiGe Semiconductor, Inc. 2680 Queensview Dr Ottawa ON K2B 8J9	SCT
Established: 2000 Plant Size (ft²): Employment: 95					
--Details-- Description: Semiconductor and Other Electronic Component Manufacturing SIC/NAICS Code: 334410					
92	14 of 16	W/294.7	68.0 / -3.71	Integrating Solutions Inc. 2680 Queensview Dr Suite 100 Ottawa ON K2B 8J9	SCT
Established: 1996 Plant Size (ft²): Employment: 10					
--Details-- Description: Software Publishers SIC/NAICS Code: 511210 Description: Wired Telecommunications Carriers SIC/NAICS Code: 517110 Description: Internet Service Providers SIC/NAICS Code: 518111 Description: Computer Systems Design and Related Services					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB		
SIC/NAICS Code:		541510					
92	15 of 16	W/294.7	68.0 / -3.71	2680 Queensview Dr. Ottawa OTTAWA ON	SPL		
Ref No:		1-OSLUC		Municipality No:			
Year:				Nature of Damage:			
Incident Dt:		6/29/2021 10:30:00 AM		Discharger Report:			
Dt MOE Arvl on Scn:				Material Group:			
MOE Reported Dt:		6/29/2021 11:27:49 AM		Impact to Health:			
Dt Document Closed:		12/3/2021 4:02:36 PM		Agency Involved:			
Site No:		0 No Impact					
MOE Response:						Desktop Response	
Site County/District:							
Site Geo Ref Meth:							
Site District Office:						Ottawa District Office	
Nearest Watercourse:							
Site Name:							
Site Address:						2680 Queensview Dr. Ottawa	
Site Region:							
Site Municipality:						OTTAWA	
Site Lot:							
Site Conc:							
Site Geo Ref Accu:							
Site Map Datum:							
Northing:							
Easting:							
Entity Operating Name:							
Client Name:							
Client Type:							
Source Type:						Motor Vehicle	
Incident Cause:							
Incident Preceding Spill:						Leak/Break	
Incident Reason:							
Incident Summary:						KEV: 1L hydraulic oil to ground, cleaned	
Environment Impact:						0 No Impact	
Health Env Consequence:							
Nature of Impact:							
Contaminant Qty:						1 litre (L)	
Contaminant Qty 1:							
Contaminant Unit:							
Contaminant Code:							
Contaminant Name:						HYDRAULIC OIL	
Contaminant Limit 1:							
Contam Limit Freq 1:							
Contaminant UN No 1:							
Receiving Medium:						Land	
Activity Preceding Spill:						Normal operations	
Property 2nd Watershed:						Central Ottawa	
Property Tertiary Watershed:						02KF-Central Ottawa - Mississippi	
Sector Type:						OTHER HEAVY AND CIVIL ENGINEERING CONSTRUCTION	
SAC Action Class:							
Call Report Locatn Geodata:						{ "integration_ids": ["PR00003794247"], "wks": ["POINT (-75.7872442000 45.3525146000)"], "creation_date": "2021-06-29" }	
Time Reported:							
System Facility Address:							
92	16 of 16	W/294.7	68.0 / -3.71	LAFARGE CANADA INC. 2680 Queensview Dr, Ottawa OTTAWA ON	SPL		
Ref No:		1-3FMSOO		Municipality No:			

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
Year: Incident Dt: 4/28/2023 8:00:00 AM Dt MOE Arvl on Scn: MOE Reported Dt: 4/28/2023 8:09:14 AM Dt Document Closed: 5/2/2023 6:06:10 AM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 2680 Queensview Dr, Ottawa Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: LAFARGE CANADA INC. Client Type: Private Business Source Type: Motor Vehicle Incident Cause: Incident Preceding Spill: Leak/Break Incident Reason: Equipment failure/malfunction Incident Summary: KEV: Lafarge truck spilled 15 L of coolant to ground, cleaning Environment Impact: 1 Minor Impact Health Env Consequence: Nature of Impact: Contaminant Qty: 15 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: COOLANT (N.O.S.) Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Normal operations Property 2nd Watershed: Central Ottawa Property Tertiary Watershed: 02KF-Central Ottawa - Mississippi Sector Type: CONSTRUCTION, TRANSPORTATION, MINING, AND FORESTRY MACHINERY AND EQUIPMENT RENTAL AND LEASING SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003794247"],"wks":["POINT (-75.7872442000 45.3525146000)"],"creation_date":"2023-04-28"} Time Reported: System Facility Address: Nature of Damage: Discharger Report: Material Group: Impact to Health: 0 No Impact Agency Involved:					

93	1 of 1	NE/295.4	69.9 / -1.85	2506 Roman Ave Ottawa ON K2B 7X9	EHS
Order No: 20080828024 Status: C Report Type: Complete Report Report Date: 9/9/2008 Date Received: 8/28/2008 Previous Site Name: Lot/Building Size: lot 16 m x 35 m Additional Info Ordered: Nearest Intersection: Connaught Ave Municipality: Ottawa Client Prov/State: ON Search Radius (km): 0.25 X: -75.779081 Y: 45.356021					

Map Key	Number of Records	Direction/ Distance (m)	Elev/Diff (m)	Site	DB
94	1 of 1	NNE/297.1	68.9 / -2.85	45.356050 -75.780023, Ottawa OTTAWA ON	SPL
Ref No: 1-3P6DPK Year: Incident Dt: 8/2/2023 9:00:07 AM Dt MOE Arvl on Scn: MOE Reported Dt: 8/2/2023 10:59:07 AM Dt Document Closed: 8/3/2023 3:52:33 PM Site No: MOE Response: Desktop Response Site County/District: Site Geo Ref Meth: Site District Office: Ottawa District Office Nearest Watercourse: Site Name: Site Address: 45.356050 -75.780023, Ottawa Site Region: Site Municipality: OTTAWA Site Lot: Site Conc: Site Geo Ref Accu: Site Map Datum: Northing: Easting: Entity Operating Name: Client Name: Client Type: Source Type: Incident Cause: Incident Preceding Spill: Incident Reason: Incident Summary: KEV: 16: Hydraulic Fluid to Gravel, cleaning. Environment Impact: Health Env Consequence: Nature of Impact: Contaminant Qty: 16 litre (L) Contaminant Qty 1: Contaminant Unit: Contaminant Code: Contaminant Name: HYDRAULIC OIL Contaminant Limit 1: Contam Limit Freq 1: Contaminant UN No 1: Receiving Medium: Land Activity Preceding Spill: Property 2nd Watershed: 02K Central Ottawa River Property Tertiary Watershed: 02KF Mississippi River - Central Ottawa River Sector Type: INDUSTRIAL BUILDING AND STRUCTURE CONSTRUCTION SAC Action Class: Call Report Locatn Geodata: {"integration_ids":["PR00003907066"],"wks":["POINT (-75.7795035000 45.3561944000)],"creation_date":"2023-08-02"} Time Reported: System Facility Address: Municipality No: Nature of Damage: Discharger Report: Material Group: Impact to Health: Agency Involved:					

Unplottable Summary

Total: **62** Unplottable sites

DB	Company Name/Site Name	Address	City	Postal
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Minto Developments Inc.		Ottawa ON	
CA	Lee Valley Tools Limited		Ottawa ON	

CA	Appleton Subdivision	Part of Lot 21, Concession 2	Ottawa ON
CA	Appleton Subdivision	Part of Lot 21, Concession 2	Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON
CA	Minto Developments Inc.		Ottawa ON

CONV	SOUTHAM INC. C.O.B. THE OTTAWA CITIZEN		OTTAWA ON	
CONV	LAFARGE CANADA INC.		MONTREAL, QC ON	
CONV	LAFARGE CANADA INC.		MONTREAL, QC ON	
CONV	Lafarge Canada Inc.		Ottawa ON	
ECA	City of Ottawa	Connaught Ave	Ottawa ON	K2G 6J8
ECA	Minto Developments Inc.		Ottawa ON	K1R 7Y2
ECA	Minto Developments Inc.		Ottawa ON	K1R 7Y2
EHS		Hwy 417	Ottawa ON	
GEN	R.W Tomlinson	LRT Central Site Hwy 417 Widening	ottawa ON	K1G 3N4
GEN	R.W Tomlinson	LRT Central Site Hwy 417 Widening	ottawa ON	K1G 3N4
PTTW	Lafarge Canada Inc		ON	
SPL	OTTAWA HYDRO	MOTOR VEHICLE (OPERATING FLUID)	OTTAWA CITY ON	
SPL	OC TRANSP	MOTOR VEHICLE (OPERATING FLUID)	OTTAWA CITY ON	
SPL	Lafarge Canada Inc.		Ottawa ON	
SPL	City of Ottawa	Highway 417	Ottawa ON	
SPL	OTTAWA HYDRO	MOTOR VEHICLE (OPERATING FLUID)	OTTAWA CITY ON	
SPL	CONSOLIDATED FREIGHTWAYS	ALONG THE 417 TRANSPORT TRUCK (CARGO)	OTTAWA CITY ON	
SPL	Lafarge Canada Inc.		Ottawa ON	
SPL	NATIONAL GROCERS	MOTOR VEHICLE (OPERATING FLUID)	OTTAWA ON	
SPL	TRANSPORT TRUCK	HWY. 417 MOTOR VEHICLE (OPERATING FLUID)	OTTAWA ON	
WWIS		HWY 417 WEST	Ottawa ON	

Unplottable Report

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 2206-5J5J5M
Application Year: 2003
Issue Date: 1/27/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 3360-7H3RCS
Application Year: 2008
Issue Date: 8/8/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 3324-5PXLNV
Application Year: 2003
Issue Date: 7/31/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 2814-68ZN2P

Application Year: 2005
Issue Date: 2/2/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 2803-6XKQB2
Application Year: 2007
Issue Date: 1/25/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 2539-66USUQ
Application Year: 2004
Issue Date: 11/25/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 2530-6JULSK
Application Year: 2005
Issue Date: 12/16/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Minto Developments Inc.*
 Ottawa ON

Database:
CA

Certificate #: 1814-73VJMC
Application Year: 2007
Issue Date: 6/7/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Minto Developments Inc.*
 Ottawa ON

Database:
CA

Certificate #: 1688-5ZCP3J
Application Year: 2004
Issue Date: 5/28/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Minto Developments Inc.*
 Ottawa ON

Database:
CA

Certificate #: 1530-6QQL2J
Application Year: 2006
Issue Date: 7/14/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Minto Developments Inc.*
 Ottawa ON

Database:
CA

Certificate #: 1462-76TNSQ
Application Year: 2007
Issue Date: 9/11/2007
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:

Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 1305-5PNSMF
Application Year: 2003
Issue Date: 7/22/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 1297-6SPJ46
Application Year: 2006
Issue Date: 8/17/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 1168-67AKKL
Application Year: 2004
Issue Date: 12/7/2004
Approval Type: Municipal and Private Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 1002-6GQJNY
Application Year: 2005

Issue Date: 10/3/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 0681-67QTZP
Application Year: 2005
Issue Date: 1/11/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 0523-7EVPTJ
Application Year: 2008
Issue Date: 8/21/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Lee Valley Tools Limited**
Ottawa ON

Database:
CA

Certificate #: 0276-7BLTL5
Application Year: 2008
Issue Date: 3/31/2008
Approval Type: Industrial Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Appleton Subdivision*
Part of Lot 21, Concession 2 Ottawa ON

Database:
CA

Certificate #: 9776-55UJ3V
Application Year: 02
Issue Date: 1/2/02
Approval Type: Municipal & Private water
Status: Approved
Application Type: New Certificate of Approval
Client Name: Richcraft Homes Ltd.
Client Address: 201-2280 St. Laurent Blvd.
Client City: Ottawa
Client Postal Code: K1G 4K1
Project Description: Construction of a Watermain
Contaminants:
Emission Control:

Site: *Appleton Subdivision*
Part of Lot 21, Concession 2 Ottawa ON

Database:
CA

Certificate #: 7361-55UJ9V
Application Year: 02
Issue Date: 1/2/02
Approval Type: Municipal & Private sewage
Status: Approved
Application Type: New Certificate of Approval
Client Name: Richcraft Homes Ltd.
Client Address: 201-2280 St. Laurent Blvd.
Client City: Ottawa
Client Postal Code: K1G 4K1
Project Description: Construction of Storm and Sanitary Sewers
Contaminants:
Emission Control:

Site: *Minto Developments Inc.*
Ottawa ON

Database:
CA

Certificate #: 3934-5QBL78
Application Year: 2003
Issue Date: 9/18/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: *Minto Developments Inc.*
Ottawa ON

Database:
CA

Certificate #: 4208-6J7J5T
Application Year: 2005
Issue Date: 11/17/2005
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:

Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 4309-6VTJMR
Application Year: 2006
Issue Date: 12/1/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 5109-66JPRR
Application Year: 2004
Issue Date: 11/9/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 5840-6NRNJD
Application Year: 2006
Issue Date: 5/4/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 5963-766KNS
Application Year: 2007
Issue Date: 8/21/2007

Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 6002-7DAKG9
Application Year: 2008
Issue Date: 4/2/2008
Approval Type: Municipal and Private Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 6380-6JGQ7B
Application Year: 2005
Issue Date: 12/29/2005
Approval Type: Municipal and Private Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 6733-5NSKZ9
Application Year: 2003
Issue Date: 6/23/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 7043-6P2REB
Application Year: 2006
Issue Date: 4/20/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 7163-5SYQ3M
Application Year: 2003
Issue Date: 11/14/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 7355-6M4TMP
Application Year: 2006
Issue Date: 2/20/2006
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 7677-7DPNN3
Application Year: 2008
Issue Date: 5/1/2008
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:

Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 7788-6XDSAP
Application Year: 2007
Issue Date: 1/19/2007
Approval Type: Municipal and Private Sewage Works
Status: Revoked and/or Replaced
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 7996-5Q7RGN
Application Year: 2003
Issue Date: 8/12/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 8133-65GMW9
Application Year: 2004
Issue Date: 10/6/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: **Minto Developments Inc.**
Ottawa ON

Database:
CA

Certificate #: 8418-76APWL
Application Year: 2007
Issue Date: 8/22/2007
Approval Type: Municipal and Private Sewage Works

Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 9152-65XHVP
Application Year: 2004
Issue Date: 10/21/2004
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 8733-8J9RH6
Application Year: 2011
Issue Date: 7/28/2011
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.
Ottawa ON

Database:
CA

Certificate #: 1930-5HZMDY
Application Year: 2003
Issue Date: 1/21/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: Minto Developments Inc.

Database:
CA

Ottawa ON

Certificate #: 3403-5MAJ6D
Application Year: 2003
Issue Date: 5/9/2003
Approval Type: Municipal and Private Sewage Works
Status: Approved
Application Type:
Client Name:
Client Address:
Client City:
Client Postal Code:
Project Description:
Contaminants:
Emission Control:

Site: SOUTHAM INC. C.O.B. THE OTTAWA CITIZEN
OTTAWA ON

Database:
CONV

File No:
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: DISCHARGED VARSOL & INK INTO NATURAL ENVIRON. CAUSING ADVERSE EFFECTS
Background:
URL:

Location:
Region: EASTERN REGION
Ministry District:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation:
Section: 14(1)
Act/Regulation/Section: EPA- -14(1)
Date of Offence:
Date of Conviction:
Date Charged: 94/05/12
Charge Disposition:
Fine: 9800
Synopsis:

Site: LAFARGE CANADA INC.
MONTREAL, QC ON

Database:
CONV

File No:
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: ESTABLISHING AND OPERATING A WASTE SITE WITHOUT A C OF A

Location:
Region: SOUTH EAST REGION
Ministry District:

Background:
URL:

Additional Details

Publication Date:
Count: 1
Act: OWRA
Regulation:
Section: 24(1)
Act/Regulation/Section: OWRA- 24(1)
Date of Offence:
Date of Conviction:
Date Charged: 92/12/15
Charge Disposition:
Fine: 6000
Synopsis:

Site: LAFARGE CANADA INC.
MONTREAL, QC ON

Database:
CONV

File No:
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:
Penalty Imposed:
Description: DEPOSITING WASTE ON UNAPPROVED SITE
Background:
URL:

Location:
Region: SOUTH EAST REGION
Ministry District:

Additional Details

Publication Date:
Count: 1
Act: EPA
Regulation:
Section: 39
Act/Regulation/Section: EPA- 39
Date of Offence:
Date of Conviction:
Date Charged: 92/12/14
Charge Disposition:
Fine: 65000
Synopsis:

Site: Lafarge Canada Inc.
Ottawa ON

Database:
CONV

File No: 086209
Crown Brief No:
Court Location:
Publication City:
Publication Title:
Act:
Act(s):
First Matter:
Second Matter:
Investigation 1:
Investigation 2:

Location:
Region:
Ministry District:

Penalty Imposed:**Description:**

On January 27, 2011, Lafarge Canada Inc. was convicted of two violations under the Ontario Water Resources Act for failing to comply with the condition of a Permit to Take Water and for failing to submit records of water taking. The Court heard the company operates a ready mix concrete plant in Ottawa. On August 22, 2007 the Ministry of Environment issued a Permit to Take Water. The permit requires that the total amounts of water pumped shall be measured using a properly calibrated flowmeter and totalizer and that the company must submit the water data by March 31, 2009. On May 14, 2009, the ministry received the 2008 water taking records and it was determined that no data was recorded between July 1, 2008 and October 24, 2008. No alternative method of recording water takings was implemented. Ministry staff conducted a search of the ministry's Water Taking Reporting System database, and found no data recorded on the database. The company was charged following an investigation by the ministry's Investigations and Enforcement Branch. The company was convicted and a total of \$13,500 plus victim fine surcharges. The company was given 60 days to pay the fine.

Background:**URL:****Additional Details****Publication Date:****Count:**

2

Act:

OWRA

Regulation:**Section:****Act/Regulation/Section:**

OWRA

Date of Offence:**Date of Conviction:****Date Charged:**

January 27, 2011

Charge Disposition:

fine, victim fine surcharge

Fine:

\$13,500

Synopsis:

Site: City of Ottawa
Connaught Ave Ottawa ON K2G 6J8

Database:
ECA

Approval No: 0904-D2PHTA
Approval Date: February 26, 2024
Status: Approved
Record Type: ECA
Link Source: IDS

MOE District: North Bay
City:
Longitude:
Latitude:
Geometry X: -9016878.754
Geometry Y: 5700582.732

SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: City of Ottawa
Address: Connaught Ave
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/4998-D28PXK-14.pdf>
PDF Site Location: Connaught Avenue
City of Ottawa, Ontario

Site: Minto Developments Inc.
Ottawa ON K1R 7Y2

Database:
ECA

Approval No: 7163-5SYQ3M
Approval Date: 2003-11-14
Status: Approved
Record Type: ECA
Link Source: IDS

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

SWP Area Name:
Approval Type: ECA-MUNICIPAL AND PRIVATE SEWAGE WORKS
Project Type: MUNICIPAL AND PRIVATE SEWAGE WORKS
Business Name: Minto Developments Inc.
Address:
Full Address:
Full PDF Link: <https://www.accessenvironment.ene.gov.on.ca/instruments/2997-5SKKCW-14.pdf>
PDF Site Location:

Site: Minto Developments Inc.
Ottawa ON K1R 7Y2

Database:
ECA

Approval No: 4490-5SYQAN
Approval Date: 2003-11-14
Status: Approved
Record Type: ECA
Link Source: IDS
SWP Area Name:
Approval Type: ECA-Municipal Drinking Water Systems
Project Type: Municipal Drinking Water Systems
Business Name: Minto Developments Inc.
Address:
Full Address:
Full PDF Link:
PDF Site Location:

MOE District:
City:
Longitude:
Latitude:
Geometry X:
Geometry Y:

Site: Hwy 417 Ottawa ON

Database:
EHS

Order No: 20120509053
Status: C
Report Type: Custom Report
Report Date: 5/16/2012
Date Received: 5/9/2012
Previous Site Name:
Lot/Building Size:
Additional Info Ordered:

Nearest Intersection:
Municipality:
Client Prov/State: ON
Search Radius (km): 0.25
X: -75.670099
Y: 1

Site: R.W Tomlinson
LRT Central Site Hwy 417 Widening ottawa ON K1G 3N4

Database:
GEN

Generator Info

Generator No: ON9834153
Approval Years: 2015
Status:
PO Box No:
Country: Canada
Co Admin: mark peralta
Phone No Admin: 6138221867 Ext.
SIC Description: HIGHWAY, STREET AND BRIDGE CONSTRUCTION

Choice of Contact: CO_OFFICIAL
Contaminated Fac: No
MHSW Facility: No
SIC Code: 237310

Waste Detail(s)

Waste Class: 146
Waste Class Name: OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class: 212
Waste Class Name: ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class: 252
Waste Class Name: WASTE OILS & LUBRICANTS

Site: R.W Tomlinson
LRT Central Site Hwy 417 Widening ottawa ON K1G 3N4

Database:
GEN

Generator Info

Generator No:	ON9834153	Choice of Contact:	CO_OFFICIAL
Approval Years:	2014	Contaminated Fac:	No
Status:		MHSW Facility:	No
PO Box No:		SIC Code:	237310
Country:	Canada		
Co Admin:	mark peralta		
Phone No Admin:	6138221867 Ext.		
SIC Description:	HIGHWAY, STREET AND BRIDGE CONSTRUCTION		

Waste Detail(s)

Waste Class:	212
Waste Class Name:	ALIPHATIC SOLVENTS

Waste Detail(s)

Waste Class:	146
Waste Class Name:	OTHER SPECIFIED INORGANICS

Waste Detail(s)

Waste Class:	252
Waste Class Name:	WASTE OILS & LUBRICANTS

Site: Lafarge Canada Inc
ON

Database:
[PTTW](#)

EBR Registry No:	010-0474	Decision Posted:	
Ministry Ref No:	8767-72NTZA	Exception Posted:	
Notice Type:	Instrument Decision	Section:	
Notice Stage:		Act 1:	
Notice Date:	April 15, 2009	Act 2:	
Proposal Date:	May 25, 2007	Site Location Map:	
Year:	2007		
Instrument Type:	(OWRA s. 34) - Permit to Take Water		
Off Instrument Name:			
Posted By:			
Company Name:	Lafarge Canada Inc		
Site Address:			
Location Other:			
Proponent Name:			
Proponent Address:	7880 Keele Street, 5th Floor, Concord Ontario, L4K 4G7		
Comment Period:			
URL:			
Summary:			

Site Location Details:

Lots 22 and 23, Concession 5 Address: Lot: 22 and 23, Concession: 5, Ottawa, City District Office: Ottawa GeoReference: Zone: 18, UTM Easting: 436180, UTM Northing: 5014020 GeoReference: Zone: 18, UTM Easting: 436400, UTM Northing: 5013720 CITY OF OTTAWA NEPEAN Nepean

Site: OTTAWA HYDRO
MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON

Database:
[SPL](#)

Ref No:	48830	Municipality No:	20101
Year:		Nature of Damage:	
Incident Dt:	4/9/1991	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	

MOE Reported Dt: 4/9/1991
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: PIPE/HOSE LEAK
Incident Preceding Spill:
Incident Reason: EQUIPMENT FAILURE
Incident Summary: OTTAWA HYDRO-2 LITRES OF HYDRAULIC FLUID TO ROAD CONTAINED & CLEANED-UP
Environment Impact: NOT ANTICIPATED
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Impact to Health:
Agency Involved:

Site: OC TRANSP
 MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON

Database:
 SPL

Ref No: 241575
Year:
Incident Dt: 10/6/2002
Dt MOE Arvl on Scn:
MOE Reported Dt: 10/6/2002
Dt Document Closed:
Site No:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:

Municipality No: 20107
Nature of Damage:
Discharger Report:
Material Group:
Impact to Health:
Agency Involved:

Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: OTHER TRANSPORTATION ACCIDENT
Incident Preceding Spill:
Incident Reason: UNKNOWN
Incident Summary: OC TRANSP: 10L ANTIFREEZE TO STORMS, ROAD. SEWERMATIC RESPONDING.
Environment Impact: POSSIBLE
Health Env Consequence:
Nature of Impact: Water course or lake
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: WATER, LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: Lafarge Canada Inc.
 Ottawa ON

Database:
[SPL](#)

Ref No:	5864-9NSQ2A	Municipality No:	
Year:		Nature of Damage:	
Incident Dt:	2014/09/09	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	2014/09/09	Impact to Health:	
Dt Document Closed:	2014/09/11	Agency Involved:	
Site No:	NA		
MOE Response:	No Field Response		
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:	994 Moodie Drive<UNOFFICIAL>		
Site Address:			
Site Region:			
Site Municipality:	Ottawa		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:	Lafarge Canada Inc.		
Client Type:			
Source Type:			
Incident Cause:	Overflow/Surcharge		
Incident Preceding Spill:			
Incident Reason:	Operator/Human Error		
Incident Summary:	Lafarge: 400L ready-mix concrete additive		

Environment Impact: Confirmed
Health Env Consequence:
Nature of Impact: Other Impact(s)
Contaminant Qty: 400 L
Contaminant Qty 1: 400
Contaminant Unit: L
Contaminant Code: 28
Contaminant Name: CONCRETE ADMIXTURE (DE-WATERING)
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Tank - Above Ground
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: City of Ottawa
 Highway 417 Ottawa ON

Database:
 SPL

Ref No:	3043-7QMTYH	Municipality No:
Year:		Nature of Damage:
Incident Dt:		Discharger Report:
Dt MOE Arvl on Scn:		Material Group:
MOE Reported Dt:	3/30/2009	Impact to Health:
Dt Document Closed:		Agency Involved:
Site No:		
MOE Response:		
Site County/District:		
Site Geo Ref Meth:		
Site District Office:		
Nearest Watercourse:		
Site Name:	EB Merge Lane Hwy 417 & Eagleson Road	
Site Address:		
Site Region:		
Site Municipality:	Ottawa	
Site Lot:		
Site Conc:		
Site Geo Ref Accu:		
Site Map Datum:		
Northing:	NA	
Easting:	NA	
Entity Operating Name:		
Client Name:	City of Ottawa	
Client Type:		
Source Type:		
Incident Cause:	Pipe Or Hose Leak	
Incident Preceding Spill:		
Incident Reason:	Unknown - Reason not determined	
Incident Summary:	OC Transpo: 10L engine oil to grnd on Hwy 417	
Environment Impact:	Not Anticipated	
Health Env Consequence:		
Nature of Impact:	Other Impact(s)	
Contaminant Qty:	10 L	
Contaminant Qty 1:	10	
Contaminant Unit:	L	
Contaminant Code:		
Contaminant Name:	ENGINE OIL	
Contaminant Limit 1:		
Contam Limit Freq 1:		
Contaminant UN No 1:		
Receiving Medium:		
Activity Preceding Spill:		

Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Other
SAC Action Class: Primary Assessment of Incident
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: OTTAWA HYDRO
MOTOR VEHICLE (OPERATING FLUID) OTTAWA CITY ON

Database:
SPL

Ref No: 46544 Municipality No: 20101
Year:
Incident Dt: 2/11/1991 Nature of Damage:
Dt MOE Arvl on Scn: Discharger Report:
MOE Reported Dt: 2/11/1991 Material Group:
Dt Document Closed: Impact to Health:
Site No: Agency Involved:
MOE Response:
Site County/District:
Site Geo Ref Meth:
Site District Office:
Nearest Watercourse:
Site Name:
Site Address:
Site Region:
Site Municipality: OTTAWA CITY
Site Lot:
Site Conc:
Site Geo Ref Accu:
Site Map Datum:
Northing:
Easting:
Entity Operating Name:
Client Name:
Client Type:
Source Type:
Incident Cause: PIPE/HOSE LEAK
Incident Preceding Spill:
Incident Reason: CORROSION
Incident Summary: HYDRO: 4L HYDRAULIC OIL LEAK FROM TRUCK TO GROUNDSOME LEAKED TO SEWER
Environment Impact: NOT ANTICIPATED
Health Env Consequence:
Nature of Impact: Water course or lake
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND / WATER
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: CONSOLIDATED FREIGHTWAYS
ALONG THE 417 TRANSPORT TRUCK (CARGO) OTTAWA CITY ON

Database:
SPL

Ref No: 35498 Municipality No: 20101

Year:		Nature of Damage:	
Incident Dt:	5/29/1990	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	5/30/1990	Impact to Health:	
Dt Document Closed:		Agency Involved:	CANUTEC,OPP
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA CITY		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	OTHER CONTAINER LEAK		
Incident Preceding Spill:			
Incident Reason:	MATERIAL FAILURE		
Incident Summary:	CONSOLIDATED FREIGHT-15 LGLUE TO HIGHWAY BETWEEN MONTREAL AND OTTAWA		
Environment Impact:	NOT ANTICIPATED		
Health Env Consequence:			
Nature of Impact:			
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			
Contaminant UN No 1:			
Receiving Medium:	LAND		
Activity Preceding Spill:			
Property 2nd Watershed:			
Property Tertiary Watershed:			
Sector Type:			
SAC Action Class:			
Call Report Locatn Geodata:			
Time Reported:			
System Facility Address:			

Site: Lafarge Canada Inc.
Ottawa ON

Database:
[SPL](#)

Ref No:	8758-96DH8U	Municipality No:	
Year:		Nature of Damage:	
Incident Dt:	02-APR-13	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	02-APR-13	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:	No Field Response		
Site County/District:			
Site Geo Ref Meth:	NA		
Site District Office:			
Nearest Watercourse:			
Site Name:	Lafarge Boyce Quarry		
Site Address:			

Site Region:
Site Municipality: Ottawa
Site Lot:
Site Conc:
Site Geo Ref Accu: NA
Site Map Datum: NA
Northing: NA
Easting: NA
Entity Operating Name:
Client Name: Lafarge Canada Inc.
Client Type:
Source Type:
Incident Cause: Leak/Break
Incident Preceding Spill:
Incident Reason: Equipment Failure
Incident Summary: Lafarge: 300 L hydraulic oil to ground from cone crusher
Environment Impact: Not Anticipated
Health Env Consequence:
Nature of Impact: Soil Contamination
Contaminant Qty: 300 L
Contaminant Qty 1: 300
Contaminant Unit: L
Contaminant Code: 15
Contaminant Name: HYDRAULIC OIL
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium:
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type: Motor Vehicle
SAC Action Class: Land Spills
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: NATIONAL GROCERS
 MOTOR VEHICLE (OPERATING FLUID) OTTAWA ON

Database:
 SPL

Ref No:	191981	Municipality No:	20107
Year:		Nature of Damage:	
Incident Dt:	12/13/2000	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	12/13/2000	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	CONTAINER OVERFLOW		

Incident Preceding Spill:
Incident Reason: OTHER
Incident Summary: NATIONAL GROCERS-14L ENG-INE OIL TO PVMT ONLY; NO DRAINS. CLEANING.
Environment Impact: NOT ANTICIPATED
Health Env Consequence:
Nature of Impact:
Contaminant Qty:
Contaminant Qty 1:
Contaminant Unit:
Contaminant Code:
Contaminant Name:
Contaminant Limit 1:
Contam Limit Freq 1:
Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site: TRANSPORT TRUCK
 HWY. 417 MOTOR VEHICLE (OPERATING FLUID) OTTAWA ON

Database:
 SPL

Ref No:	191523	Municipality No:	20107
Year:		Nature of Damage:	
Incident Dt:	12/4/2000	Discharger Report:	
Dt MOE Arvl on Scn:		Material Group:	
MOE Reported Dt:	12/4/2000	Impact to Health:	
Dt Document Closed:		Agency Involved:	
Site No:			
MOE Response:			
Site County/District:			
Site Geo Ref Meth:			
Site District Office:			
Nearest Watercourse:			
Site Name:			
Site Address:			
Site Region:			
Site Municipality:	OTTAWA		
Site Lot:			
Site Conc:			
Site Geo Ref Accu:			
Site Map Datum:			
Northing:			
Easting:			
Entity Operating Name:			
Client Name:			
Client Type:			
Source Type:			
Incident Cause:	TRUCK/TRAILER OVERTURN		
Incident Preceding Spill:			
Incident Reason:	OTHER		
Incident Summary:	RSR ENVIRONMENTAL:SPILL OF 50-100 L DIESEL DUE TO ROLLOVER. CONTAINED.		
Environment Impact:	POSSIBLE		
Health Env Consequence:			
Nature of Impact:	Soil contamination		
Contaminant Qty:			
Contaminant Qty 1:			
Contaminant Unit:			
Contaminant Code:			
Contaminant Name:			
Contaminant Limit 1:			
Contam Limit Freq 1:			

Contaminant UN No 1:
Receiving Medium: LAND
Activity Preceding Spill:
Property 2nd Watershed:
Property Tertiary Watershed:
Sector Type:
SAC Action Class:
Call Report Locatn Geodata:
Time Reported:
System Facility Address:

Site:

HWY 417 WEST Ottawa ON

Database:
WWIS

Well ID: 7290688
Construction Date:
Use 1st: Test Hole
Use 2nd:
Final Well Status: Observation Wells
Water Type:
Casing Material:
Audit No: Z261473
Tag: A228339
Constructn Method:
Elevation (m):
Elevatn Reliabilty:
Depth to Bedrock:
Well Depth:
Overburden/Bedrock:
Pump Rate:
Static Water Level:
Clear/Cloudy:
Municipality:
Site Info:

Flowing (Y/N):
Flow Rate:
Data Entry Status:
Data Src:
Date Received: 07/19/2017
Selected Flag: TRUE
Abandonment Rec:
Contractor: 7579
Form Version: 7
Owner:
County:
Lot:
Concession:
Concession Name:
Easting NAD83:
Northing NAD83:
Zone:
UTM Reliability:

Bore Hole Information

Bore Hole ID: 1006636095
DP2BR:
Spatial Status:
Code OB:
Code OB Desc:
Open Hole:
Cluster Kind:
Date Completed: 07/04/2017
Remarks:
Location Method Desc: on Water Well Record
Elevrc Desc:
Location Source Date:
Improvement Location Source:
Improvement Location Method:
Source Revision Comment:
Supplier Comment:

Elevation:
Elevrc:
Zone:
East83:
North83:
Org CS: UTM83
UTMRC: 9
UTMRC Desc: unknown UTM
Location Method: wwr

**Overburden and Bedrock
Materials Interval**

Formation ID: 1006753724
Layer: 3
Color: 8
General Color: BLACK
Material 1: 17
Material 1 Desc: SHALE
Material 2:
Material 2 Desc:

Material 3:
Material 3 Desc:
Formation Top Depth: 42.0
Formation End Depth: 72.5
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 1006753722
Layer: 1
Color: 2
General Color: GREY
Material 1: 11
Material 1 Desc: GRAVEL
Material 2: 28
Material 2 Desc: SAND
Material 3:
Material 3 Desc:
Formation Top Depth: 0.0
Formation End Depth: 20.0
Formation End Depth UOM: ft

Overburden and Bedrock
Materials Interval

Formation ID: 1006753723
Layer: 2
Color: 6
General Color: BROWN
Material 1: 28
Material 1 Desc: SAND
Material 2: 06
Material 2 Desc: SILT
Material 3:
Material 3 Desc:
Formation Top Depth: 20.0
Formation End Depth: 42.0
Formation End Depth UOM: ft

Annular Space/Abandonment
Sealing Record

Plug ID: 1006753731
Layer: 1
Plug From: 0.0
Plug To: 72.5
Plug Depth UOM: ft

Method of Construction & Well
Use

Method Construction ID: 1006753730
Method Construction Code:
Method Construction:
Other Method Construction:

Pipe Information

Pipe ID: 1006753721
Casing No: 0
Comment:
Alt Name:

Construction Record - Casing

Casing ID: 1006753727
Layer: 1
Material:
Open Hole or Material:
Depth From: 0.0
Depth To: 72.5
Casing Diameter: 2.5
Casing Diameter UOM: inch
Casing Depth UOM: ft

Construction Record - Screen

Screen ID: 1006753728
Layer:
Slot:
Screen Top Depth:
Screen End Depth:
Screen Material:
Screen Depth UOM: ft
Screen Diameter UOM: inch
Screen Diameter:

Water Details

Water ID: 1006753726
Layer:
Kind Code:
Kind:
Water Found Depth:
Water Found Depth UOM: ft

Hole Diameter

Hole ID: 1006753725
Diameter: 3.630000114440918
Depth From: 0.0
Depth To: 72.5
Hole Depth UOM: ft
Hole Diameter UOM: inch

Appendix: Database Descriptions

*Environmental Risk Information Services (ERIS) can search the following databases. The extent of historical information varies with each database and current information is determined by what is publicly available to ERIS at the time of update. **Note:** Databases denoted with " * " indicates that the database will no longer be updated. See the individual database description for more information.*

Abandoned Aggregate Inventory:

Provincial [AAGR](#)

The MAAP Program maintains a database of abandoned pits and quarries. Please note that the database is only referenced by lot and concession and city/town location. The database provides information regarding the location, type, size, land use, status and general comments.*

Government Publication Date: Sept 2002*

Aggregate Inventory:

Provincial [AGR](#)

This database of licensed and permitted pits and quarries is maintained by the Ontario Ministry of Natural Resources and Forestry (MNRF), as regulated under the Aggregate Resources Act, R.S.O. 1990. Aggregate site data has been divided into active and inactive sites. Active sites may be further subdivided into partial surrenders. In partial surrenders, defined areas of a site are inactive while the rest of the site remains active.

Government Publication Date: Up to Nov 2024

Abandoned Mine Information System:

Provincial [AMIS](#)

The Abandoned Mines Information System contains data on known abandoned and inactive mines located on both Crown and privately held lands. The information was provided by the Ministry of Northern Development and Mines (MNDM), with the following disclaimer: "the database provided has been compiled from various sources, and the Ministry of Northern Development and Mines makes no representation and takes no responsibility that such information is accurate, current or complete". Reported information includes official mine name, status, background information, mine start/end date, primary commodity, mine features, hazards and remediation.

Government Publication Date: 1800-May 2025

Anderson's Waste Disposal Sites:

Private [ANDR](#)

The information provided in this database was collected by examining various historical documents which aimed to characterize the likely position of former waste disposal sites from 1860 to present. The research initiative behind the creation of this database was to identify those sites that are missing from the Ontario MOE Waste Disposal Site Inventory, as well as to provide revisions and corrections to the positions and descriptions of sites currently listed in the MOE inventory. In addition to historic waste disposal facilities, the database also identifies certain auto wreckers and scrap yards that have been extrapolated from documentary sources. Please note that the data is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1860s-Present

Aboveground Storage Tanks:

Provincial [AST](#)

Historical listing of aboveground storage tanks made available by the Department of Natural Resources and Forestry. Includes tanks used to hold water or petroleum. This dataset has been retired as of September 25, 2014 and will no longer be updated.

Government Publication Date: May 31, 2014

Automobile Wrecking & Supplies:

Private [AUWR](#)

This database provides an inventory of known locations that are involved in the scrap metal, automobile wrecking/recycling, and automobile parts & supplies industry. Information is provided on the company name, location and business type.

Government Publication Date: 1999-Apr 30, 2025

Borehole:

Provincial [BORE](#)

A borehole is the generalized term for any narrow shaft drilled in the ground, either vertically or horizontally. The information here includes geotechnical investigations or environmental site assessments, mineral exploration, or as a pilot hole for installing piers or underground utilities. Information is from many sources such as the Ministry of Transportation (MTO) boreholes from engineering reports and projects from the 1950 to 1990's in Southern Ontario. Boreholes from the Ontario Geological Survey (OGS) including The Urban Geology Analysis Information System (UGAIS) and the York Peel Durham Toronto (YPDT) database of the Conservation Authority Moraine Coalition. This database will include fields such as location, stratigraphy, depth, elevation, year drilled, etc. For all water well data or oil and gas well data for Ontario please refer to WWIS and OOGW.

Government Publication Date: 1875-Jul 2018

Certificates of Approval:

Provincial CA

This database contains the following types of approvals: Air & Noise, Industrial Sewage, Municipal & Private Sewage, Waste Management Systems and Renewable Energy Approvals. The MOE in Ontario states that any facility that releases emissions to the atmosphere, discharges contaminants to ground or surface water, provides potable water supplies, or stores, transports or disposes of waste, must have a Certificate of Approval before it can operate lawfully. Fields include approval number, business name, address, approval date, approval type and status. This database will no longer be updated, as CofA's have been replaced by either Environmental Activity and Sector Registry (EASR) or Environmental Compliance Approval (ECA). Please refer to those individual databases for any information after Oct.31, 2011.

Government Publication Date: 1985-Oct 30, 2011*

Dry Cleaning Facilities:

Federal CDRY

List of dry cleaning facilities made available by Environment and Climate Change Canada. Environment and Climate Change Canada's Tetrachloroethylene (Use in Dry Cleaning and Reporting Requirements) Regulations (SOR/2003-79) are intended to reduce releases of tetrachloroethylene to the environment from dry cleaning facilities.

Government Publication Date: Jan 2004-Dec 2023

Commercial Fuel Oil Tanks:

Provincial CFOT

Locations of commercial underground fuel oil tanks. This is not a comprehensive or complete inventory of commercial fuel tanks in the province; this listing is a copy of records of registered commercial underground fuel oil tanks obtained under Access to Public Information.

Note that the following types of tanks do not require registration: waste oil tanks in apartments, office buildings, residences, etc.; aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Chemical Manufacturers and Distributors:

Private CHEM

This database includes information from both a one time study conducted in 1992 and private source and is a listing of facilities that manufacture or distribute chemicals. The production of these chemical substances may involve one or more chemical reactions and/or chemical separation processes (i.e. fractionation, solvent extraction, crystallization, etc.).

Government Publication Date: 1999-Jan 31, 2020

Chemical Register:

Private CHM

This database includes a listing of locations of facilities within the Province or Territory that either manufacture and/or distributes chemicals.

Government Publication Date: 1999-Apr 30, 2025

Compressed Natural Gas Stations:

Private CNG

Canada has a network of public access compressed natural gas (CNG) refuelling stations. These stations dispense natural gas in compressed form at 3,000 pounds per square inch (psi), the pressure which is allowed within the current Canadian codes and standards. The majority of natural gas refuelling is located at existing retail gasoline that have a separate refuelling island for natural gas. This list of stations is made available by the Canadian Natural Gas Vehicle Alliance.

Government Publication Date: Dec 2012 -Jul 2025

Inventory of Coal Gasification Plants and Coal Tar Sites:

Provincial COAL

This inventory includes both the "Inventory of Coal Gasification Plant Waste Sites in Ontario-April 1987" and the Inventory of Industrial Sites Producing or Using Coal Tar and Related Tars in Ontario-November 1988) collected by the MOE. It identifies industrial sites that produced and continue to produce or use coal tar and other related tars. Detailed information is available and includes: facility type, size, land use, information on adjoining properties, soil condition, site operators/occupants, site description, potential environmental impacts and historic maps available. This was a one-time inventory.*

Government Publication Date: Apr 1987 and Nov 1988*

Compliance and Convictions:

Provincial CONV

This database summarizes the fines and convictions handed down by the Ontario courts beginning in 1989. Companies and individuals named here have been found guilty of environmental offenses in Ontario courts of law.

Government Publication Date: 1989-Jul 2025

Certificates of Property Use:

Provincial CPU

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include CPU's on the registry such as (EPA s. 168.6) - Certificate of Property Use.

Government Publication Date: 1994 - Jul 31, 2025

Drill Hole Database:

Provincial

[DRL](#)

The Ontario Drill Hole Database (ODHD) is offered by the Province of Ontario's Ministry of Mines. The dataset contains information for over 164,000 percussion, overburden, sonic and diamond-drill holes. The presence of assay results with cutoff values for gold, silver, copper, zinc, lead, nickel and platinum group elements is noted. Drill hole data are compiled from assessment files that have been submitted to the ministry in accordance with the Ontario Mining Act (OMA). Source assessment file numbers are captured for cross reference with the Ontario Assessment File Database (OAFD). Please note that limited data is available for southern Ontario, as it was the last area to be completed. The database was created when surveys submitted to the Ministry were converted in the Assessment File Research Image Database (AFRI) project. However, the degree of accuracy (coordinates) as to the exact location of drill holes is dependent upon the source document submitted. Levels of accuracy used to locate holes are: centering on the mining claim; a sketch of the mining claim; a 1:50,000 map; a detailed company map; or from submitted a "Report of Work".

Government Publication Date: 1886 - Jul 2025**Delisted Fuel Tanks:**

Provincial

[DTNK](#)

List of fuel storage tank sites that were once found in - and have since been removed from - the list of fuel storage tanks made available by the regulatory agency under Access to Public Information.

Government Publication Date: Oct 2023**Environmental Activity and Sector Registry:**

Provincial

[EASR](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. The EASR allows businesses to register certain activities with the ministry, rather than apply for an approval. The registry is available for common systems and processes, to which preset rules of operation can be applied. The EASR is currently available for: heating systems, standby power systems and automotive refinishing. Businesses whose activities aren't subject to the EASR may apply for an ECA (Environmental Compliance Approval). Please see our ECA database.

Government Publication Date: Oct 2011 - Jul 31, 2025**Environmental Registry:**

Provincial

[EBR](#)

The Environmental Registry lists proposals, decisions and exceptions regarding policies, Acts, instruments, or regulations that could significantly affect the environment. Through the Registry, thirteen provincial ministries notify the public of upcoming proposals and invite their comments. For example, if a local business is requesting a permit, license, or certificate of approval to release substances into the air or water; these are notified on the registry. Data includes: Approval for discharge into the natural environment other than water (i.e. Air) - EPA s. 9, Approval for sewage works - OWRA s. 53(1), and EPA s. 27 - Approval for a waste disposal site. For information regarding Permit to Take Water (PTTW), Certificate of Property Use (CPU) and (ORD) Orders please refer to those individual databases.

Government Publication Date: 1994 - Jul 31, 2025**Environmental Compliance Approval:**

Provincial

[ECA](#)

On October 31, 2011, a smarter, faster environmental approvals system came into effect in Ontario. In the past, a business had to apply for multiple approvals (known as certificates of approval) for individual processes and pieces of equipment. Today, a business either registers itself, or applies for a single approval, depending on the types of activities it conducts. Businesses whose activities aren't subject to the EASR may apply for an ECA. A single ECA addresses all of a business's emissions, discharges and wastes. Separate approvals for air, noise and waste are no longer required. This database will also include Renewable Energy Approvals. For certificates of approval prior to Nov 1st, 2011, please refer to the CA database. For all Waste Disposal Sites please refer to the WDS database.

Government Publication Date: Oct 2011 - Jul 31, 2025**Environmental Effects Monitoring:**

Federal

[EEM](#)

The Environmental Effects Monitoring program assesses the effects of effluent from industrial or other sources on fish, fish habitat and human usage of fisheries resources. Since 1992, pulp and paper mills have been required to conduct EEM studies under the Pulp and Paper Effluent Regulations. This database provides information on the mill name, geographical location and sub-lethal toxicity data.

Government Publication Date: 1992-2007***ERIS Historical Searches:**

Private

[EHS](#)

ERIS has compiled a database of all environmental risk reports completed since March 1999. Available fields for this database include: site location, date of report, type of report, and search radius. As per all other databases, the ERIS database can be referenced on both the map and "Statistical Profile" page.

Government Publication Date: 1999-Apr 30, 2025**Environmental Issues Inventory System:**

Federal

[EIIS](#)

The Environmental Issues Inventory System was developed through the implementation of the Environmental Issues and Remediation Plan. This plan was established to determine the location and severity of contaminated sites on inhabited First Nation reserves, and where necessary, to remediate those that posed a risk to health and safety; and to prevent future environmental problems. The EIIS provides information on the reserve under investigation, inventory number, name of site, environmental issue, site action (Remediation, Site Assessment), and date investigation completed.

Government Publication Date: 1992-2001*

Emergency Management Historical Event:

Provincial

EMHE

List of locations of historical occurrences of emergency events, including those assigned to the Ministry of Natural Resources by Order-In-Council (OIC) under the Emergency Management and Civil Protection Act, as well as events where MNR provided requested emergency response assistance. Many of these events will have involved community evacuations, significant structural loss, and/or involvement of MNR emergency response staff. These events fall into one of ten (10) type categories: Dam Failure; Drought / Low Water; Erosion; Flood; Forest Fire; Soil and Bedrock Instability; Petroleum Resource Center Event, EMO Requested Assistance, Continuity of Operations Event, Other Requested Assistance. EMHE record details are reproduced by ERIIS under License with the Ontario Ministry of Natural Resources © Queen's Printer for Ontario, 2017.

Government Publication Date: Apr 30, 2022**Environmental Penalty Annual Report:**

Provincial

EPAR

This database contains data from Ontario's annual environmental penalty report published by the Ministry of the Environment, Conservation and Parks (MECP). These reports provide information on environmental penalties for land or water violations issued to companies in one of the nine industrial sectors covered by the Municipal Industrial Strategy for Abatement (MISA) regulations.

Government Publication Date: Jan 1, 2011 - Dec 31, 2024**List of Expired Fuels Safety Facilities:**

Provincial

EXP

List of facilities and tanks for which there was once a fuel registration. This is not a comprehensive or complete inventory of expired tanks/tank facilities in the province; this listing is a copy of previously registered tanks and facilities obtained under Access to Public Information. Includes private fuel outlets, bulk plants, fuel oil tanks, gasoline stations, marinas, propane filling stations, liquid fuel tanks, piping systems, etc; includes tanks which have been removed from the ground.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023**Federal Convictions:**

Federal

FCON

Environment Canada maintains a database referred to as the "Environmental Registry" that details prosecutions under the Canadian Environmental Protection Act (CEPA) and the Fisheries Act (FA). Information is provided on the company name, location, charge date, offence and penalty.

Government Publication Date: 1988-Jun 2007***Contaminated Sites on Federal Land:**

Federal

FCS

The Federal Contaminated Sites Inventory includes information on known federal contaminated sites under the custodianship of departments, agencies and consolidated Crown corporations as well as those that are being or have been investigated to determine whether they have contamination arising from past use that could pose a risk to human health or the environment. The inventory also includes non-federal contaminated sites for which the Government of Canada has accepted some or all financial responsibility. It does not include sites where contamination has been caused by, and which are under the control of, enterprise Crown corporations, private individuals, firms or other levels of government. Includes fire training sites and sites at which Per- and Polyfluoroalkyl Substances (PFAS) are a concern.

Government Publication Date: Jun 2000-Mar 2025**Fisheries & Oceans Fuel Tanks:**

Federal

FOFT

Fisheries & Oceans Canada maintains an inventory of aboveground & underground fuel storage tanks located on Fisheries & Oceans property or controlled by DFO. Our inventory provides information on the site name, location, tank owner, tank operator, facility type, storage tank location, tank contents & capacity, and date of tank installation.

Government Publication Date: 1964-Sep 2019**Federal Identification Registry for Storage Tank Systems (FIRSTS):**

Federal

FRST

A list of federally regulated Storage tanks from the Federal Identification Registry for Storage Tank Systems (FIRSTS). FIRSTS is Environment and Climate Change Canada's database of storage tank systems subject to the Storage Tank for Petroleum Products and Allied Petroleum Products Regulations. The main objective of the Regulations is to prevent soil and groundwater contamination from storage tank systems located on federal and aboriginal lands. Storage tank systems that do not have a valid identification number displayed in a readily visible location on or near the storage tank system may be refused product delivery.

Government Publication Date: Oct 31, 2021**Fuel Storage Tank:**

Provincial

FST

List of registered private and retail fuel storage tanks. This is not a comprehensive or complete inventory of private and retail fuel storage tanks in the province; this listing is a copy of registered private and retail fuel storage tanks, obtained under Access to Public Information.

Notes: registration was not required for private fuel underground/aboveground storage tanks prior to January 1990, nor for furnace oil tanks prior to May 1, 2002; registration is not required for waste oil tanks in apartments, office buildings, residences, etc., or aboveground gas or diesel tanks. Records are not verified for accuracy or completeness.

Government Publication Date: Oct 2023

Fuel Storage Tank - Historic:

Provincial

FSTH

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks. Public records of private fuel storage tanks are only available since the registration became effective in September 1989. This information is now collected by the Technical Standards and Safety Authority.

Government Publication Date: Pre-Jan 2010*

Ontario Regulation 347 Waste Generators Summary:

Provincial

GEN

Regulation 347 of the Ontario EPA defines a waste generation site as any site, equipment and/or operation involved in the production, collection, handling and/or storage of regulated wastes. A generator of regulated waste is required to register the waste generation site and each waste produced, collected, handled, or stored at the site. This database contains the registration number, company name and address of registered generators including the types of hazardous wastes generated. It includes data on waste generating facilities such as: drycleaners, waste treatment and disposal facilities, machine shops, electric power distribution etc. This information is a summary of all years from 1986 including the most currently available data. As of January 1, 2023, businesses and institutions subject to the amended Reg. 347: General – Waste Management are required to report their activities and pay fees through Resource Productivity & Recovery Authority (RPRA) online Hazardous Waste Program Registry (HWPR) rather than the Hazardous Waste Information Network (HWIN) system previously operated by the Ministry of the Environment, Conservation and Parks (MECP). Some records may contain, within the company name, the phrase "See & Use..." followed by a series of letters and numbers. This occurs when one company is amalgamated with or taken over by another registered company. The number listed as "See & Use", refers to the new ownership and the other identification number refers to the original ownership. This phrase serves as a link between the 2 companies until operations have been fully transferred.

Government Publication Date: 1986-Mar 31, 2025

Greenhouse Gas Emissions from Large Facilities:

Federal

GHG

List of greenhouse gas emissions from large facilities made available by Environment Canada. Greenhouse gas emissions in kilotonnes of carbon dioxide equivalents (kt CO₂ eq).

Government Publication Date: 2013-Feb 2025

TSSA Historic Incidents:

Provincial

HINC

List of historic incidences of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen recorded by the TSSA in their previous incident tracking system. The TSSA's Fuels Safety Program administers the Technical Standards & Safety Act 2000, providing fuel-related safety services associated with the safe transportation, storage, handling and use of fuels such as gasoline, diesel, propane, natural gas and hydrogen. Under this Act, the TSSA regulates fuel suppliers, storage facilities, transport trucks, pipelines, contractors and equipment or appliances that use fuels. Records are not verified for accuracy or completeness. This is not a comprehensive or complete inventory of historical fuel spills and leaks in the province. This listing is a copy of the data captured at one moment in time and is hence limited by the record date provided here.

Government Publication Date: 2006-June 2009*

Indian & Northern Affairs Fuel Tanks:

Federal

IAFT

The Department of Indian & Northern Affairs Canada (INAC) maintains an inventory of aboveground & underground fuel storage tanks located on both federal and crown land. Our inventory provides information on the reserve name, location, facility type, site/facility name, tank type, material & ID number, tank contents & capacity, and date of tank installation.

Government Publication Date: 1950-Aug 2003*

Fuel Oil Spills and Leaks:

Provincial

INC

Listing of spills and leaks of diesel, fuel oil, gasoline, natural gas, propane, and hydrogen reported to the Spills Action Centre (SAC). This is not a comprehensive or complete inventory of fuel-related leaks, spills, and incidents in the province; this listing in a copy of incidents reported to the SAC, obtained under Access to Public Information. Includes incidents from fuel-related hazards such as spills, fires, and explosions. Records are not verified for accuracy or completeness.

Government Publication Date: 31 Oct, 2023

Landfill Inventory Management Ontario:

Provincial

LIMO

The Landfill Inventory Management Ontario (LIMO) database is updated every year, as the Ministry of the Environment, Conservation and Parks compiles new and updated information. Includes small and large landfills currently operating as well as those which are closed and historic. Operators of larger landfills provide landfill information for the previous operating year to the ministry for LIMO including: estimated amount of total waste received, landfill capacity, estimated total remaining landfill capacity, fill rates, engineering designs, reporting and monitoring details, size of location, service area, approved waste types, leachate of site treatment, contaminant attenuation zone and more. The small landfills include information such as site owner, site location and certificate of approval # and status.

Government Publication Date: Mar 31, 2022

Canadian Mine Locations:

Private

MINE

This information is collected from the Canadian & American Mines Handbook. The Mines database is a national database that provides over 290 listings on mines (listed as public companies) dealing primarily with precious metals and hard rocks. Listed are mines that are currently in operation, closed, suspended, or are still being developed (advanced projects). Their locations are provided as geographic coordinates (x, y and/or longitude, latitude). As of 2002, data pertaining to Canadian smelters and refineries has been appended to this database.

Government Publication Date: 1998-2009*

Mineral Occurrences:

Provincial

MNR

In the early 70's, the Ministry of Northern Development and Mines created an inventory of approximately 19,000 mineral occurrences in Ontario, in regard to metallic and industrial minerals, as well as some information on building stones and aggregate deposits. Please note that the "Horizontal Positional Accuracy" is approximately +/- 200 m. Many reference elements for each record were derived from field sketches using pace or chain/tape measurements against claim posts or topographic features in the area. The primary limiting factor for the level of positional accuracy is the scale of the source material. The testing of horizontal accuracy of the source materials was accomplished by comparing the plan metric (X and Y) coordinates of that point with the coordinates of the same point as defined from a source of higher accuracy.

Government Publication Date: 1846-Feb 2025

National Analysis of Trends in Emergencies System (NATES):

Federal

NATE

In 1974 Environment Canada established the National Analysis of Trends in Emergencies System (NATES) database, for the voluntary reporting of significant spill incidents. The data was to be used to assist in directing the work of the emergencies program. NATES ran from 1974 to 1994. Extensive information is available within this database including company names, place where the spill occurred, date of spill, cause, reason and source of spill, damage incurred, and amount, concentration, and volume of materials released.

Government Publication Date: 1974-1994*

Non-Compliance Reports:

Provincial

NCPL

The Ministry of the Environment Conservation and Parks (MECP) provides information about non-compliant discharges of contaminants to air and water that exceed legal allowable limits, from regulated industrial and municipal facilities. A reported non-compliance failure may be in regard to a Control Order, Certificate of Approval, Sectoral Regulation or specific regulation/act. MECP publicly releases the Environmental Compliance Report (ECR) on the Ontario Data Catalogue. In Ontario, all facilities with regulated wastewater discharges or air emissions under the Ontario Water Resources Act and the Environmental Protection Act must monitor and report any cases where approved operating limits have been exceeded.

Government Publication Date: Dec 31, 2023

National Defense & Canadian Forces Fuel Tanks:

Federal

NDFT

The Department of National Defense and the Canadian Forces maintains an inventory of all aboveground & underground fuel storage tanks located on DND lands. Our inventory provides information on the base name, location, tank type & capacity, tank contents, tank class, date of tank installation, date tank last used, and status of tank as of May 2001. This database will no longer be updated due to the new National Security protocols which have prohibited any release of this database.

Government Publication Date: Up to May 2001*

National Defense & Canadian Forces Spills:

Federal

NDSP

The Department of National Defense and the Canadian Forces maintains an inventory of spills to land and water. All spill sites have been classified under the "Transportation of Dangerous Goods Act - 1992". Our inventory provides information on the facility name, location, spill ID #, spill date, type of spill, as well as the quantity of substance spilled & recovered.

Government Publication Date: Mar 1999-Nov 2023

National Defence & Canadian Forces Waste Disposal Sites:

Federal

NDWD

The Department of National Defence and the Canadian Forces maintains an inventory of waste disposal sites located on DND lands. Where available, our inventory provides information on the base name, location, type of waste received, area of site, depth of site, year site opened/closed and status.

Government Publication Date: 2001-Apr 2007*

National Energy Board Pipeline Incidents:

Federal

NEBI

Locations of pipeline incidents from 2008 to present, made available by the Canada Energy Regulator (CER) - previously the National Energy Board (NEB). Includes incidents reported under the Onshore Pipeline Regulations and the Processing Plant Regulations related to pipelines under federal jurisdiction, does not include incident data related to pipelines under provincial or territorial jurisdiction.

Government Publication Date: 2008-Jul 31, 2025

National Energy Board Wells:

Federal

NEBP

The NEBW database contains information on onshore & offshore oil and gas wells that are outside provincial jurisdiction(s) and are thereby regulated by the National Energy Board. Data is provided regarding the operator, well name, well ID No./UWI, status, classification, well depth, spud and release date.

Government Publication Date: 1920-Feb 2003*

National Environmental Emergencies System (NEES):

Federal

[NEES](#)

In 2000, the Emergencies program implemented NEES, a reporting system for spills of hazardous substances. For the most part, this system only captured data from the Atlantic Provinces, some from Quebec and Ontario and a portion from British Columbia. Data for Alberta, Saskatchewan, Manitoba and the Territories was not captured. However, NEES is also a repository for previous Environment Canada spill datasets. NEES is composed of the historic datasets ' or Trends ' which dates from approximately 1974 to present. NEES Trends is a compilation of historic databases, which were merged and includes data from NATES (National Analysis of Trends in Emergencies System), ARTS (Atlantic Regional Trends System), and NEES. In 2001, the Emergencies Program determined that variations in reporting regimes and requirements between federal and provincial agencies made national spill reporting and trend analysis difficult to achieve. As a consequence, the department has focused efforts on capturing data on spills of substances which fall under its legislative authority only (CEPA and FA). As such, the NEES database will be decommissioned in December 2004.

Government Publication Date: 1974-2003***National PCB Inventory:**

Federal

[NPCB](#)

Environment Canada's National PCB inventory includes information on in-use PCB containing equipment in Canada including federal, provincial and private facilities. Federal out-of-service PCB containing equipment and PCB waste owned by the federal government or by federally regulated industries such as airlines, railway companies, broadcasting companies, telephone and telecommunications companies, pipeline companies, etc. are also listed. Although it is not Environment Canada's mandate to collect data on non-federal PCB waste, the National PCB inventory includes some information on provincial and private PCB waste and storage sites. Some addresses provided may be Head Office addresses and are not necessarily the location of where the waste is being used or stored.

Government Publication Date: 1988-2008***National Pollutant Release Inventory:**

Federal

[NPR2](#)

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of pollutant releases (to air, water and land), disposals, and transfers for recycling. The inventory, managed by Environment and Climate Change Canada, tracks over 300 substances. Under the authority of the Canadian Environmental Protection Act (CEPA), owners or operators of facilities that meet published reporting requirements are required to report to the NPRI.

Government Publication Date: Feb 2024**National Pollutant Release Inventory - Historic:**

Federal

[NPRI](#)

Environment Canada has defined the National Pollutant Release Inventory ("NPRI") as a federal government initiative designed to collect comprehensive national data regarding releases to air, water, or land, and waste transfers for recycling for more than 300 listed substances. This data holds historic records; current records are found in NPR2.

Government Publication Date: 1993-May 2017**Oil and Gas Wells:**

Private

[OGWE](#)

The Nickle's Energy Group (publisher of the Daily Oil Bulletin) collects information on drilling activity including operator and well statistics. The well information database includes name, location, class, status and depth. The main Nickle's database is updated on a daily basis, however, this database is updated on a monthly basis. More information is available at www.nickles.com.

Government Publication Date: 1988-Jun 30, 2025**Ontario Oil and Gas Wells:**

Provincial

[OOGW](#)

In 1998, the Ministry of Natural Resources (MNR) handed over to the Ontario Oil, Gas and Salt Resources (OGSR) Corporation, the responsibility of maintaining a database of oil and gas wells drilled in Ontario. The OGSR Library has over 20,000+ wells in their database. Information available for all wells in the ERIS database includes well owner/operator, location, permit issue date, and well cap date, license number, status, depth and the primary target (rock unit) of the well being drilled. All geology/stratigraphy table information, plus all water table information is also provided for each well record.

Government Publication Date: 1800-Aug 2024**Inventory of PCB Storage Sites:**

Provincial

[OPCB](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of PCB storage sites within the province. Ontario Regulation 11/82 (Waste Management - PCB) and Regulation 347 (Generator Waste Management) under the Ontario EPA requires the registration of inactive PCB storage equipment and/or disposal sites of PCB waste with the Ontario Ministry of Environment. This database contains information on: 1) waste quantities; 2) major and minor sites storing liquid or solid waste; and 3) a waste storage inventory.

Government Publication Date: 1987-Oct 2004; 2012-Dec 2013**Orders:**

Provincial

[ORD](#)

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include Orders on the registry such as (EPA s. 17) - Order for remedial work, (EPA s. 18) - Order for preventative measures, (EPA s. 43) - Order for removal of waste and restoration of site, (EPA s. 44) - Order for conformity with Act for waste disposal sites, (EPA s. 136) - Order for performance of environmental measures.

Government Publication Date: 1994 - Jul 31, 2025

Canadian Pulp and Paper:

Private

PAP

This information is part of the Pulp and Paper Canada Directory. The Directory provides a comprehensive listing of the locations of pulp and paper mills and the products that they produce.

Government Publication Date: 1999, 2002, 2004, 2005, 2009-2014

Parks Canada Fuel Storage Tanks:

Federal

PCFT

Canadian Heritage maintains an inventory of known fuel storage tanks operated by Parks Canada, in both National Parks and at National Historic Sites. The database details information on site name, location, tank install/removal date, capacity, fuel type, facility type, tank design and owner/operator.

Government Publication Date: 1920-Jan 2005*

Pesticide Register:

Provincial

PES

The Ontario Ministry of the Environment and Climate Change maintains a database of licensed operators and vendors of registered pesticides.

Government Publication Date: Oct 2011 - Jul 31, 2025

Ontario PFAS Spills:

Provincial

PFAS

This specific list of spills includes those incidents where one or more of the listed contaminants are identified in the PFAS Structure List and/or PFAS Chemicals Without Explicit Structure List made available by the United States Environmental Protection Agency (US EPA), is originally sourced from the Ministry of the Environment, Conservation and Parks spills related data. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024; Aug 2024; Oct-Nov 2024

NPRI Reporters - PFAS Substances:

Federal

PFCH

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This listing of PFAS substance reporters includes those NPRI facilities that reported substances that are found in either: a) the Comprehensive Global Database of PFASs compiled by the Organisation for Economic Co-operation and Development (OECD), b) the US Environmental Protection Agency (US EPA) Master List of PFAS Substances, c) the US EPA list of PFAS chemicals without explicit structures, or d) the US EPA list of PFAS structures (encompassing the largest set of structures having sufficient levels of fluorination to potentially impart PFAS-type properties).

Government Publication Date: Feb 2024

Potential PFAS Handlers from NPRI:

Federal

PFHA

The National Pollutant Release Inventory (NPRI) is Canada's public inventory of releases, disposals, and transfers, tracking over 320 pollutants. Per - and polyfluoroalkyl substances (PFAS) are a group of over 4,700 human-made substances for which adverse environmental and health effects have been observed. This list of potential PFAS handlers includes those NPRI facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used, or released by the facility - these are facilities that potentially handle PFAS based on their industrial profile.

Government Publication Date: Feb 2024

Pipeline Incidents:

Provincial

PINC

List of pipeline incidents (strikes, leaks, spills). This is not a comprehensive or complete inventory of pipeline incidents in the province; this listing is an historical copy of records previously obtained under Access to Public Information. Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2021

Potential PFAS Handlers from EASR:

Provincial

PPHA

The Ontario Environmental Activity and Sector Registry (EASR), described in Ontario Regulation 245/11, allows businesses with less complex operations - and hence not requiring an Environmental Compliance Approval - to register their activities with the Ontario Ministry of the Environment, Conservation and Parks (MECP). This list of potential PFAS handlers includes those EASR facilities that reported business activity (NAICS code) included in the US Environmental Protection Agency (US EPA) list of Potential PFAS-Handling Industry Sectors, further described as operating in industry sectors where literature reviews indicate that PFAS may be handled and/or released. Inclusion of a facility in this listing does not indicate that PFAS are being manufactured, processed, used.

Government Publication Date: Jun 30, 2024

Private and Retail Fuel Storage Tanks:

Provincial

PRT

The Fuels Safety Branch of the Ontario Ministry of Consumer and Commercial Relations maintained a database of all registered private fuel storage tanks and licensed retail fuel outlets. This database includes an inventory of locations that have gasoline, oil, waste oil, natural gas and/or propane storage tanks on their property. The MCCR no longer collects this information. This information is now collected by the Technical Standards and Safety Authority (TSSA).

Government Publication Date: 1989-1996*

Permit to Take Water:

Provincial

PTTW

This is a subset taken from Ontario's Environmental Registry (EBR) database. It will include PTTW's on the registry such as OWRA s. 34 - Permit to take water.

Government Publication Date: 1994 - Jul 31, 2025

Ontario Regulation 347 Waste Receivers Summary:

Provincial

REC

Part V of the Ontario Environmental Protection Act ("EPA") regulates the disposal of regulated waste through an operating waste management system or a waste disposal site operated or used pursuant to the terms and conditions of a Certificate of Approval or a Provisional Certificate of Approval. Regulation 347 of the Ontario EPA defines a waste receiving site as any site or facility to which waste is transferred by a waste carrier. A receiver of regulated waste is required to register the waste receiving facility. This database represents registered receivers of regulated wastes, identified by registration number, company name and address, and includes receivers of waste such as: landfills, incinerators, transfer stations, PCB storage sites, sludge farms and water pollution control plants. This information is a summary of all years from 1986 including the most currently available data.

Government Publication Date: 1986-1990, 1992-2021

Record of Site Condition:

Provincial

RSC

The Record of Site Condition (RSC) is part of the Ministry of the Environment's Brownfields Environmental Site Registry. Protection from environmental cleanup orders for property owners is contingent upon documentation known as a record of site condition (RSC) being filed in the Environmental Site Registry. In order to file an RSC, the property must have been properly assessed and shown to meet the soil, sediment and groundwater standards appropriate for the use (such as residential) proposed to take place on the property. The Record of Site Condition Regulation (O. Reg. 153/04) details requirements related to site assessment and clean up. RSCs filed after July 1, 2011 will also be included as part of the new (O.Reg. 511/09). The Government of Ontario states that it is not responsible for the accuracy of the information in this Registry.

Government Publication Date: 1997-Sept 2001, Oct 2004-Aug 2025

Retail Fuel Storage Tanks:

Private

RST

This database includes an inventory of retail fuel outlet locations (including marinas) that have on their property gasoline, oil, waste oil, natural gas and / or propane storage tanks.

Government Publication Date: 1999-Apr 30, 2025

Scott's Manufacturing Directory:

Private

SCT

Scott's Directories is a data bank containing information on over 200,000 manufacturers across Canada. Even though Scott's listings are voluntary, it is the most comprehensive database of Canadian manufacturers available. Information concerning a company's address, plant size, and main products are included in this database.

Government Publication Date: 1992-Mar 2011*

Ontario Spills:

Provincial

SPL

List of spills and incidents made available by the Ministry of the Environment, Conservation and Parks. This database identifies information such as location (approximate), type and quantity of contaminant, date of spill, environmental impact, cause, nature of impact, etc. Information from 1988-2002 was part of the ORIS (Occurrence Reporting Information System). The SAC (Spills Action Centre) handles all spills reported in Ontario. Regulations for spills in Ontario are part of the MOE's Environmental Protection Act, Part X.

Government Publication Date: 1988-Jun 2024; Aug 2024; Oct-May 2025

Wastewater Discharger Registration Database:

Provincial

SRDS

Facilities that report either municipal treated wastewater effluent or industrial wastewater discharges under the Effluent Monitoring and Effluent Limits (EMEL) and Municipal/Industrial Strategy for Abatement Regulations. The Municipal/Industrial Strategy for Abatement (MISA) division of the Ontario Ministry of Environment keeps record of direct dischargers of toxic pollutants within nine sectors including: Electric Power Generation, Mining, Petroleum Refining, Organic Chemicals, Inorganic Chemicals, Pulp & Paper, Metal Casting, Iron & Steel, and Quarries.

Government Publication Date: 1990-Dec 31, 2021

Anderson's Storage Tanks:

Private

TANK

The information provided in this database was collected by examining various historical documents, which identified the location of former storage tanks, containing substances such as fuel, water, gas, oil, and other various types of miscellaneous products. Information is available in regard to business operating at tank site, tank location, permit year, permit & installation type, no. of tanks installed & configuration and tank capacity. Data contained within this database pertains only to the city of Toronto and is not warranted to be complete, exhaustive or authoritative. The information was collected for research purposes only.

Government Publication Date: 1915-1953*

Transport Canada Fuel Storage Tanks:

Federal

TCFT

List of fuel storage tanks currently or previously owned or operated by Transport Canada. This inventory also includes tanks on The Pickering Lands, which refers to 7,530 hectares (18,600 acres) of land in Pickering, Markham, and Uxbridge owned by the Government of Canada since 1972; properties on this land has been leased by the government since 1975, and falls under the Site Management Policy of Transport Canada, but is administered by Public Works and Government Services Canada. This inventory provides information on the site name, location, tank age, capacity and fuel type.

Government Publication Date: 1970 - Apr 2024

Variances for Abandonment of Underground Storage Tanks:

Provincial

[VAR](#)

Listing of variances granted for storage tank abandonment. This is not a comprehensive or complete inventory of tank abandonment variances in the province; this listing is a copy of tank abandonment variance records previously obtained under Access to Public Information. In Ontario, registered underground storage tanks must be removed within two years of disuse; if removal of a tank is not feasible, an application may be sought for a variance from this code requirement.

Records are not verified for accuracy or completeness.

Government Publication Date: Feb 28, 2022

Waste Disposal Sites - MOE CA Inventory:

Provincial

[WDS](#)

The Ontario Ministry of Environment, Waste Management Branch, maintains an inventory of known open (active or inactive) and closed disposal sites in the Province of Ontario. Active sites maintain a Certificate of Approval, are approved to receive and are receiving waste. Inactive sites maintain Certificate(s) of Approval but are not receiving waste. Closed sites are not receiving waste. The data contained within this database was compiled from the MOE's Certificate of Approval database. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number. All new Environmental Compliance Approvals handed out after Oct 31, 2011 for Waste Disposal Sites will still be found in this database.

Government Publication Date: Oct 2011 - Jul 31, 2025

Waste Disposal Sites - MOE 1991 Historical Approval Inventory:

Provincial

[WDSH](#)

In June 1991, the Ontario Ministry of Environment, Waste Management Branch, published the "June 1991 Waste Disposal Site Inventory", of all known active and closed waste disposal sites as of October 30st, 1990. For each "active" site as of October 31st 1990, information is provided on site location, site/CA number, waste type, site status and site classification. For each "closed" site as of October 31st 1990, information is provided on site location, site/CA number, closure date and site classification. Locations of these sites may be cross-referenced to the Anderson database described under ERI's Private Source Database section, by the CA number.

Government Publication Date: Up to Oct 1990*

Water Well Information System:

Provincial

[WWIS](#)

This database describes locations and characteristics of water wells found within Ontario in accordance with Regulation 903. It includes such information as coordinates, construction date, well depth, primary and secondary use, pump rate, static water level, well status, etc. Also included are detailed stratigraphy information, approximate depth to bedrock and the approximate depth to the water table.

Government Publication Date: Dec 31 2023

Definitions

Database Descriptions: This section provides a detailed explanation for each database including: source, information available, time coverage, and acronyms used. They are listed in alphabetic order.

Detail Report: This is the section of the report which provides the most detail for each individual record. Records are summarized by location, starting with the project property followed by records in closest proximity.

Distance: The distance value is the distance between plotted points, not necessarily the distance between the sites' boundaries. All values are an approximation.

Direction: The direction value is the compass direction of the site in respect to the project property and/or center point of the report.

Elevation: The elevation value is taken from the location at which the records for the site address have been plotted. All values are an approximation. Source: Google Elevation API.

Executive Summary: This portion of the report is divided into 3 sections:

'Report Summary'- Displays a chart indicating how many records fall on the project property and, within the report search radii.

'Site Report Summary'-Project Property'- This section lists all the records which fall on the project property. For more details, see the 'Detail Report' section.

'Site Report Summary-Surrounding Properties'- This section summarizes all records on adjacent properties, listing them in order of proximity from the project property. For more details, see the 'Detail Report' section.

Map Key: The map key number is assigned according to closest proximity from the project property. Map Key numbers always start at #1. The project property will always have a map key of '1' if records are available. If there is a number in brackets beside the main number, this will indicate the number of records on that specific property. If there is no number in brackets, there is only one record for that property.

The symbol and colour used indicates 'elevation': the red inverted triangle will dictate 'ERIS Sites with Lower Elevation', the yellow triangle will dictate 'ERIS Sites with Higher Elevation' and the orange square will dictate 'ERIS Sites with Same Elevation.'

Unplottables: These are records that could not be mapped due to various reasons, including limited geographic information. These records may or may not be in your study area, and are included as reference.